



**MFD NON-COMPLIANCE REPORT # 28877-3**

PART NAME: BOTTOM LID  
PF/SA NO.: PF-235-933-93 R2  
WORK ORDER NO.: 28877-3  
VENDOR: OSV MON-TEK

DATE: 8/2/12  
INSPECTOR: K. CABAN  
ENGINEER: B. DUDA  
ROUTE TO: MTLFNSH  
EXT.: 3564

Reason For Non-Compliance:

Action (UAI,RWK,SCRIP)

1. All surf. 32 on 2 of 3 parts measure above surface finish 32 ranging from 33.8 – 58.1.
2. Part Number & Revision were not inscribed by vendor.

RTV

RWK  
IF NEEDED

Engineer Signature: \_\_\_\_\_

Date: \_\_\_\_\_

8/3/12



MFD NON-COMPLIANCE REPORT # 28877-4

PART NAME: I-ZIP HOUSING, DETECTOR  
 PF/SA NO.: PF-235-934-21  
 WORK ORDER NO.: 28877-4  
 VENDOR: OSV MON-TEK

DATE: 8/2/12  
 INSPECTOR: K. CABAN  
 ENGINEER: B. DUDA  
 ROUTE TO: MTLFNHSH  
 EXT.: 3564

Reason For Non-Compliance:

Action (UAI,RWK,SCRIP)

1. All 2 out of 3 parts do not fit mating piece (PF-235-933-93 Bottom Lid). Parts sprung anywhere from 0.015 to 0.027 off of nominal.
  - a. See inspection report for out of tolerance dimensions.
  - b. See actual parts for fit/no fit.

*RTV*

*RWK  
OR REMAKE*

Engineer Signature: \_\_\_\_\_

Date: \_\_\_\_\_

*8/3/12*



**MFD NON-COMPLIANCE REPORT # 28877-2**

PART NAME: SHIPPING LID  
PF/SA NO.: PF-235-933-92 R2  
WORK ORDER NO.: 28877-2  
VENDOR: OSV MON-TEK

DATE: 8/2/12  
INSPECTOR: K. CABAN  
ENGINEER: B. DUDA  
ROUTE TO: MTLFNH  
EXT.: 3564

Reason For Non-Compliance:

Action (UAI,RWK,SCRP)

1. Dimension 3X 4.600 +0.000/-0.005 measure 4.6018 – 4.6043 (all parts).
2. Dimension 3X 4.100 +0.000/-0.005 measure 4.1002 – 4.1023 (all parts).
3. Part Number & Revision were not inscribed by vendor.

*RTV*

*RWK*  
*IF NEEDED*

Engineer Signature: \_\_\_\_\_

Date: \_\_\_\_\_

*8/3/12*