



NON-COMPLIANCE REPORT # M-25082

PART NAME: Coupler T Plate
PF/SA NO.: PF-380-616-02 R0
WORK ORDER NO.: M-25082
VENDOR: KLY

DATE: 8/25/15
INSPECTOR: K. CABAN
ENGINEER: HAASE EXT.: 8612
PLANNER: SHELLEY

Reason for Non-Compliance:

Disposition (UAI, Rework, Scrap, Other):

1. $\square .002$ measures 0.0029.
2. $\varnothing 1.431 \begin{matrix} +.001 \\ -.000 \end{matrix}$ measures 1.4304 (-0.0006" out of tolerance).
3. $\parallel .002 A$ of $.100 \pm .005$ surface measures 0.0044.
4. $.375 \pm .005$ measures 0.3678 (-.0022 out of tolerance).
5. $\begin{matrix} \square .001 A B C \\ K \leftrightarrow L \end{matrix} | 1.430 |$ measures 1.421 (-.009"), see fit on actual part and plot.

Engineer Signature: _____

Date: _____