



# SLAC Magnetic Measurement Plan and Traveler for the FACET Quadrupole Magnet Q3E#4 Q202351T (style 1.625Q27.3)

Account Number to be charged: 9141204

This traveler covers the magnetic measurements plan for one of 4 water-cooled quadrupoles, of engineering type 1.625Q27.3, called Q3E#4, to be used as Q202351T in sector 20 in FACET. This quadrupole was made in 1986 at SLAC and previously ran in the SLC arcs here at SLAC. Consequently it may have a very little residual radioactivity, the levels are marked on radiation tags and Jim Allan (ext 4064) can provide you further information on the type of radiation and what precautions you should take when handling these magnets.

This magnet weighs about 1375 lb, and comes to you on its final T1 mount. It has yellow labels that indicate its beamline position in FACET (Q202351T). It will run in series with 3 other quads: Q3E#2, Q3E#3 and QE3#1. Two booster power supplies will provide extra current to all.

1. Receiving Information:

Received by (MM initials)	SSX
Date received : (dd-mm-yyyy):	<u>/O - 11 -2010</u>
Checked Magnet Number(Q3E#4),Optics name(Q202351T)	90
Magnet Engineer (Cherrill Spencer or her substitute) verifies that this magnet is ready to be magnetically measured. The refurbishment is finished as much as it can be at this time.	Conspiner 8 Oct 2010
If quad does not have a barcode sticker then ask Magnet Engineer to add one and she will write the 6 digit barcode number here:	002591

Retrieve past measurements (from July 1986, when this magnet was called 53Q10 or 1.625Q27.3#6 Attach copy of old record (from David Jensen):

53Q10, old measurements attached (check):	
(	

#### Preparation:

**2. Power and LCW Connections:** Unipolar PS >=300A, 40 V required. Cosine-shaped ramp that mimics the ramps produced by an Ethernet-driven controller. You will not use a booster PS. High pressure LCW system will be needed to cool this magnet in your measurement lab.

#### 3. Magnet Orientation:

A beam direction arrow, should be visible on the top or side of the core, .Notice: This magnet has coil interconnects, power terminals and water fittings **downstream**. If there is no arrow, contact Cherrill Spencer, x3474.

Beam-direction arrow in place (initials):	6	CMANNE
		19 Jan 201


#### 4. Magnet Alignment:

This magnet has sockets for 4 old tooling balls (TBs), they were last fiducialized in 1986 and now have new TB sockets. Alignment crew should do a translation from old to new TBs (as





Cherrill previously discussed with them), could be done before magnet arrives at MMG. Fiducialization of new TB complete (Alignment Initials:) Alignment crew should do set up on measurement stand, and use the x,y,z axes of the whole magnet (as defined by TB measurements) such that the roll angle (angle of horizontal axis) is less than about 0.3 milliradian (or as small as possible), and pitch and yaw is also minimized. Fiducialization data on location of tooling balls with respect to geometric axis when poles are aligned perfectly horizontally should be saved. Alignment completed, Roll Angle = millirad (Alignment Initials :) The rotating coil should have its windings oriented that a 'zero' angle quoted for a pole is indeed zero relative to the horizontal axis defined by the alignment crew. (Angle of first south pole, and of higher multipoles is important). A stretched wire will be used before the rotating coil - see step 11. 5. Power leads and polarity: The required polarity for Q3E#4 is focussing. Looking downstream the upper-left pole should

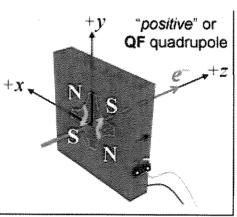

When looking at terminals from upstream

Determine the electrical connection polarity (with supply outputting positive current) which produces the required magnetic field polarities.

Place + and - labels on or near the main power flags for the required polarity.

i	1 - 8 1 1	- politicj.
	Polarity established, power +/- labels applied	SCA

#### 6. Cooling Water Flow Check:

be a NORTH pole as shown in this figure:

Each quadrupole has 8 water circuits, 2 per coil, with 4 input and 5 output hoses with appropriate Ys. There is no water manifold coming with the quad, please use your own manifold. Adjust the differential pressure across each water circuit (deltaP) to be about 150 psi. Total water flow should be about 2.55 gpm. If you cannot adjust deltaP to 150 psi, first use 200 psi (or max), measure the flow, then make total flow 2.6+/-0.2 gpm by adjusting the valve).

Water flow	/ [gpm]		Check
2.6 or	2.8	O JOM	
-		Water flow [gpm]  2.6 or 2.8	





# 7. Thermocouple placement and Thermal Test: (thermal test to be done on Q3E#3 only) Place 5 thermocouples at these locations:

- any one of the coils – on the incoming LCW – on the outgoing LCW –elsewhere on bench for ambient temperature measurement – on the steel core near any pole tip.

Arrange for temperatures to be read at least once every 3 minutes for the following thermal test: After water flow has been checked on each circuit, run JUST the FIRST quad to 250 A for three hours, reading the thermocouples, magnet current and voltage.

Confirm total LCW flow is 2.6 +/- 0.2 gpm	Flow is		gpm
Name of thermal test file and date of test			
URL of webpage where datafile stored			
Final LCW temp (in) – Final LCW temp (out)	_	°C	· · · · · · · · · · · · · · · · · · ·

If the rise in the LCW temperature is more than 12 deg C, something is wrong; stop, call Cherrill Spencer at x3474 or substitute.

#### 8. Initialization:

To be done only once, after successful completion of the water flow check and Thermal Test above. Use the cosine ramp with an equivalent linear rate of 15 A per second; minimum current of 5 A, maximum current of 300 A and pause time of 120 seconds at the minimum and maximum currents. Take the quad from 5 A to 300 A and back 7 times, ending up at 5 A

- 3			
	Initialization completed: date, MMG initials:	<u>io / p /2010</u> S D	7

## 9. (a) Standardisation parameters and detail: (For use in measurements below)

Ramp type: cosine shape

Minimum standardisation current: 5 amps Maximum standardisation current: 250 amps

Pause time at minimum or maximum standardization current: 30 seconds

Equivalent linear ramp rate for standardization process: 15 amps/second (increasing or

decreasing)

Start at 5 A and ramp up to 250 A and down to 5 A FIVE times, finishing at 5 amps. A standardization procedure always involves FIVE up and down ramps; the up ramp followed by the down current ramp is called a *cycle* [this is an increase in number of cycles since you started measuring Q3E#3]

Setting to desired current (BDES): ramp UP to BDES at 5 amps/second

All operating currents should be approached from below; except when I request a series of decreasing currents – these will be approached from a higher current. When moving from one current to another for the strength or harmonics measurements use 5 amps/second and wait at least 30 seconds after the operating current has been reached before making any magnetic measurements. Put basic standardization details in all datafile comments.

Confirm that magnet will ramp at 15 A/s (initials:)





9 (b) Multiple standardization cycles to be carried out BEFORE any measurements are made. NEW instruction for the remaining Q3E quads

Based on observations of the behavior of the very first 1.625Q27.3 quad to be measured it is necessary to carry out many standardization cycles on this style quad before any measurements are made on it. This will "train" the magnet into a state to produce a repeatable integrated strength when it is powered up in the beamline. The large number of cycles compensates for the low maximum standardization current; the size of the FACET power cables and the maximum voltage of the string's power supply limit the current.

Take the quad through 75 standardization cycles (equivalent to 15 standardization procedures)

	·	//////
Quad has undergone 75 standardization cycles	Date:	10/13/2010 Start time: 10:13

### 10. Poletip Field Measurements

When it is convenient, maybe when the rotating coil is not in the quad's aperture, please use a Hall probe to measure the poletip field at 208 amps (after a regular standardization procedure). Please make a correction in the field value for the thickness of the Hall probe.

Current	Actual current	Poletip field :
208 A nominal	208.11	0.779 T
Date and inititals		10 / 13 /2010 SDy

# 11 (a) Stretched Wire Measurement to calibrate the rotating coil:

If a stretched wire is used to calibrate the rotating coil then record the datafile name and URL:

	http://www-group.slac.sta	ford.edu/met/MagMeas/MAGDATA/FA	CET Sector 20/
Q3E#4/Coil Constant	Q3E#4/Coil (	onstant	

11 (b) Stretched Wire Measurement to Estimate Harmonics- NEW instruction Please do this stretched wire measurement on O3E#4 as well.

Based on observations of the behavior of the rotating coil DC34qadd we need to make some stretched wire measurements to estimate the sizes of the multipoles, especially the sextupole. Set up a stretched wire along the x=0, y=0 magnetic center of the quad's aperture, have an Alignment Crew help set it up as well as they can.

Ramp up to 208 amps at 5 amps/second. Pause for 30 seconds before taking any data. Measure integral G.dl at the following x positions (and y=0) with the stretched wire:

-1.8,-1.5,-1.2,-0.9,-0.6,-0.3, 0.0, 0.3, 0.6, 0.9, 1.2, 1.5, 1.8 cm

Go back across the aperture at the same x in reverse order and measure integral G.dl at 208 amps. Put all the data in the same data file.

Tell the Magnet Engineer when this data is available and don't remove the stretched wire until the Magnet Engineer says it's OK to proceed.

Filename of Wire-Harmonics Measurement	Wiresx .ru_1
Date of measurement, initials	<u>/O / _/3 /</u> 2010





12. Rotating Coil Magnetic Measurements: G.dl and harmonics at various currents.

Purpose of these measurements is to find the transfer functions (Current required to reach a certain integrated gradient strength) especially for certain desired integrated gradients, and to check that the multipole harmonics do not exceed FACET requirements. We have agreed to use rotating coil DC55 on the remaining 1.625O27.3 style guads.

For Q3E#4, the desired [Gdl is 275.3202 kGauss (will need about 208 A)

Rotating Coil Designation (Name)	DC 55
Rotating Coil Radius	0.01634 <b>8</b> 7 m

13. Integrated Strength Measurements:

Measure the integrated gradient [Gdl at these currents: 25, 75, 100, 125, 150, 175, 200, 208, 220, 230, 240, 250 amps

The late is steps 13+1+
un be and to create the
polynomial for pever.
ne same bet of Then back to 25 amps from 250 amps, measure the Gdl at the same set of currents in reverse order. Remember to ramp at 5 amps/second and wait for 30 seconds after reaching the new current before starting a measurement.

Filename of Int. Strength Measurement	strdat .ru 4
Date of measurement, initials	<u>10 / 14 /</u> 2010

14. Harmonics Measurements (with rotating coil, still do this, for comparison with stretched wire measurements in step 11(b)):

Measure the strength and angle of each multipole component at 208 amps.

(or at the operating current provided after analysis of integrated strength measurement).

Multipole values should be given as a percentage of the quadrupole moment calculated at a 1cm. PLEASE. Also provide the magnetic center X and Y coordinates measured during the harmonics measurements at the above current.

Filename of Harmonics Measurement	hardatru 4
Date of measurement, initials	<u>10/_/4_/</u> 2010

15. Polarity Reversal Test: After I have seen the reversal data on Q3E#2 I will decide if we need to do this test on Q3E#4 or not. Purpose of this test is to check the multiple standardizations in step 9(b) are sufficient to train this 1.625Q27.3 style quad.

REVERSE THE POLARITY OF Q3E#4 and redo the integrated strength and harmonics measurements (16, 17 below).

Swap the power cables on Q3E#4 when you have done its nominal polarity data-taking and do one standardization procedure [5 cycles] in the new polarity and redo the measurements of integrated strength and harmonics, as indicated below [when we have seen the stretched wire estimate of multipoles from step 9 (b) we will discuss whether the stretched wire needs to be used during the reversed polarity measurements or not].

The magnet engineer will do a comparison of the polynomials in the two polarities and decide if





the single standardization is sufficient to maintain the behavior of the quad.

Then swap back to the original polarity and standardize JUST ONCE and do the strength and harmonics measurements again (18,19 below) and the magnet engineer will do a comparison analysis and tell you of she needs any further measurements or if the same reversing polarity test has to be done on all 1.625Q27.3 quads.

# 16. Reversed Polarity Integrated Strength Measurements:

Measure the integrated gradient \( \int G. d\) at these currents:

25, 75, 100, 125, 150, 175, 200, 208, 220, 230, 240, 250 amps

Then back to 25 amps from 250 amps, measure the \( \int G\).dl at the same set of currents in reverse order. Remember to ramp at 5 amps/second and wait for 30 seconds after reaching the new current before starting a measurement.

Filename of Int. Strength Measurement	.ru
Date of measurement, initials	//2010
17. Reversed Polarity Harmonics Measuren Measure the strength and angle of each multip (or at operating current provided after analysi Multipole values should be given as a percent radius. Also provide the magnetic center X and measurements at the above current.	ole component at 208 amps.
Filename of Harmonics Measurement	.ru
Date of measurement, initials	//2010
18. Original Polarity Integrated Strength M Measure the integrated gradient ∫G.dl at these	currents: , 240, 250 amps
25, 75, 100, 125, 150, 175, 200, 210, 220, 230. Then back to 25 amps from 250 amps, measureder. Remember to ramp at 5 amps/second current before starting a measurement.	and wait for 30 seconds after reaching the
Then back to 25 amps from 250 amps, measureder. Remember to ramp at 5 amps/second	and wait for 30 seconds after reaching the

Measure the strength and angle of each multipole component at 208 amps.

(or at operating current provided after analysis of integrated strength measurement).

Multipole values should be given as a percentage of the quadrupole moment calculated at a 1cm radius. Also provide the magnetic center X and Y coordinates measured during the harmonics measurements at the above current.

Filename of Harmonics Measurement	.ru
Date of measurement, initials	//2010





The magnet engineer will do a comparison of the polynomials in the two polarities and decide if the single standardization procedure is sufficient to maintain the behavior of the quad. Check with her/him before removal of Q3E#4 from bench.

Magnet Engineer Approval obtained		/2010
20. Saving and Distributing the Magnetic measurement data		
Please post all data at		
http://www-group.slac.stanford.edu/met/Ma	ngMeas/MA	GDATA/FACET_Sector_20/quad/
in a subdirectory with the magnet name.  Please inform Magnet Engineer ( Cherrill S /or achim@SLAC.Stanford.EDU, wittmer@and harmonic measurement data are available.  This section is to be completed.	<u>@SLAC.Star</u> e for inspec	nford.EDU of FACET) when the strength tion and analysis, and for final approval.
Data been inspected & analyzed by Magnet	Engineer	Complerer 20 Oct 200
Based on Magnet Engineer analysis of confirm the pre-assigned beamline location deck name):		Optics beamline location:
Quadrupole is released from Magnetic signed and dated by FACET Magnet Engir		Q3E#4, Q202351T Conspersor 19 Jan 2011
Remove the LCW from the coils and take to the designated storage area. Signed & MMG personnel:		
22. This section is to be completed by	FACET R	eam Physicist (Walter Wittmer)
Checked that integrated strength data is s and have generated the polynomial function controlling database to set the magnet.	atisfactory	Signature and date:
Nominal operating current is <u>706.7</u>	amps.	
Checked that this is within the capabil	Å.	01/20/11
assigned power supply 220		Mars St-l = 250 A
Checked that the multipole values at r= below the Physics Requirements tolerances	1	
Magnet accepted for FACET (signed):	(mitiai).	
Date accepted (Month-Day-Year):		
Devent retpoint diffe may be required! FACET Q3E#4 (Q202351T) Magn	Sis will Also Love etic Measur	book Syphy 7 of 8





When this traveler is completed, attach it to the refurbishment traveler of this magnet and send these hardcopies to the designated person in Kathleen Ratcliffe's group at MS 18 to be scanned into a pdf file. Then that electronic file will be stored in a place TBD and the hardcopies will be returned to sit with the magnet until it is installed in the beamline.

Two travelers for this magnet been scanned	
into a pdf file; by Catherine (reech	Magnet 03=#4 0202351T
Two travelers been returned to sit with	Signed & dated:
magnet in its "waiting for installation" place.	an Cu 1-28-11

Further Tasks to be done on this magnet will be recorded on its Refurbishment Traveler.

END OF FACET Q3E#4 (Q202351T) MAGNET MAGNETIC MEASUREMENT PLAN AND TRAVELER