



MFD NON-COMPLIANCE REPORT # 31066-3



PART NAME: **Vacuum Chamber Assy**
PF/SA NO.: **SC-391-264-04 R1**
WORK ORDER NO.: **31066-3**
VENDOR **Nor Cal**

DATE: **6/26/14**
INSPECTOR: **K. Caban**
ENGINEER: **J. DeLor** EXT.: **3136**
ROUTE TO: **Mtlfnsh**

Reason For Non-Compliance:

Action (UAI,RWK,SCRIP)

1. 2X 7.000 ± 0.005 of 5/16-18 UNC-2B Threaded Holes measure 6.9670 (-0.028" out of tolerance).
 - a. 5/16-18 UNC-2B Threaded Holes had to be chased (Thread Burrs). Ok now.
2. Distance 3.000 ± 0.005 of 3/8-16 UNC-2B Threaded Holes measured 3.0135 (+0.0085" out of tolerance).

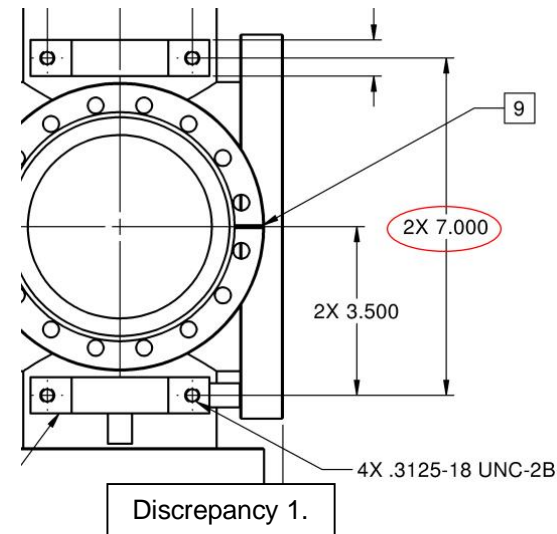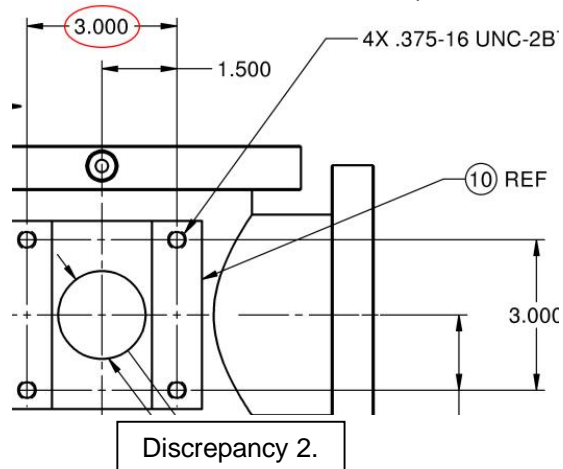

Engineer Signature: _____ Date: _____