SLAC Magnetic Measurements
Date: 07-07-2026
Time: 16:24:54

Input File:
Dir = S:\magdata\LCLS-II-HE\Undulator\DELTA-II\QUADRANT 4\DATASET0001\Final Results\Z Scans\Run 03
Name = zscan.dat

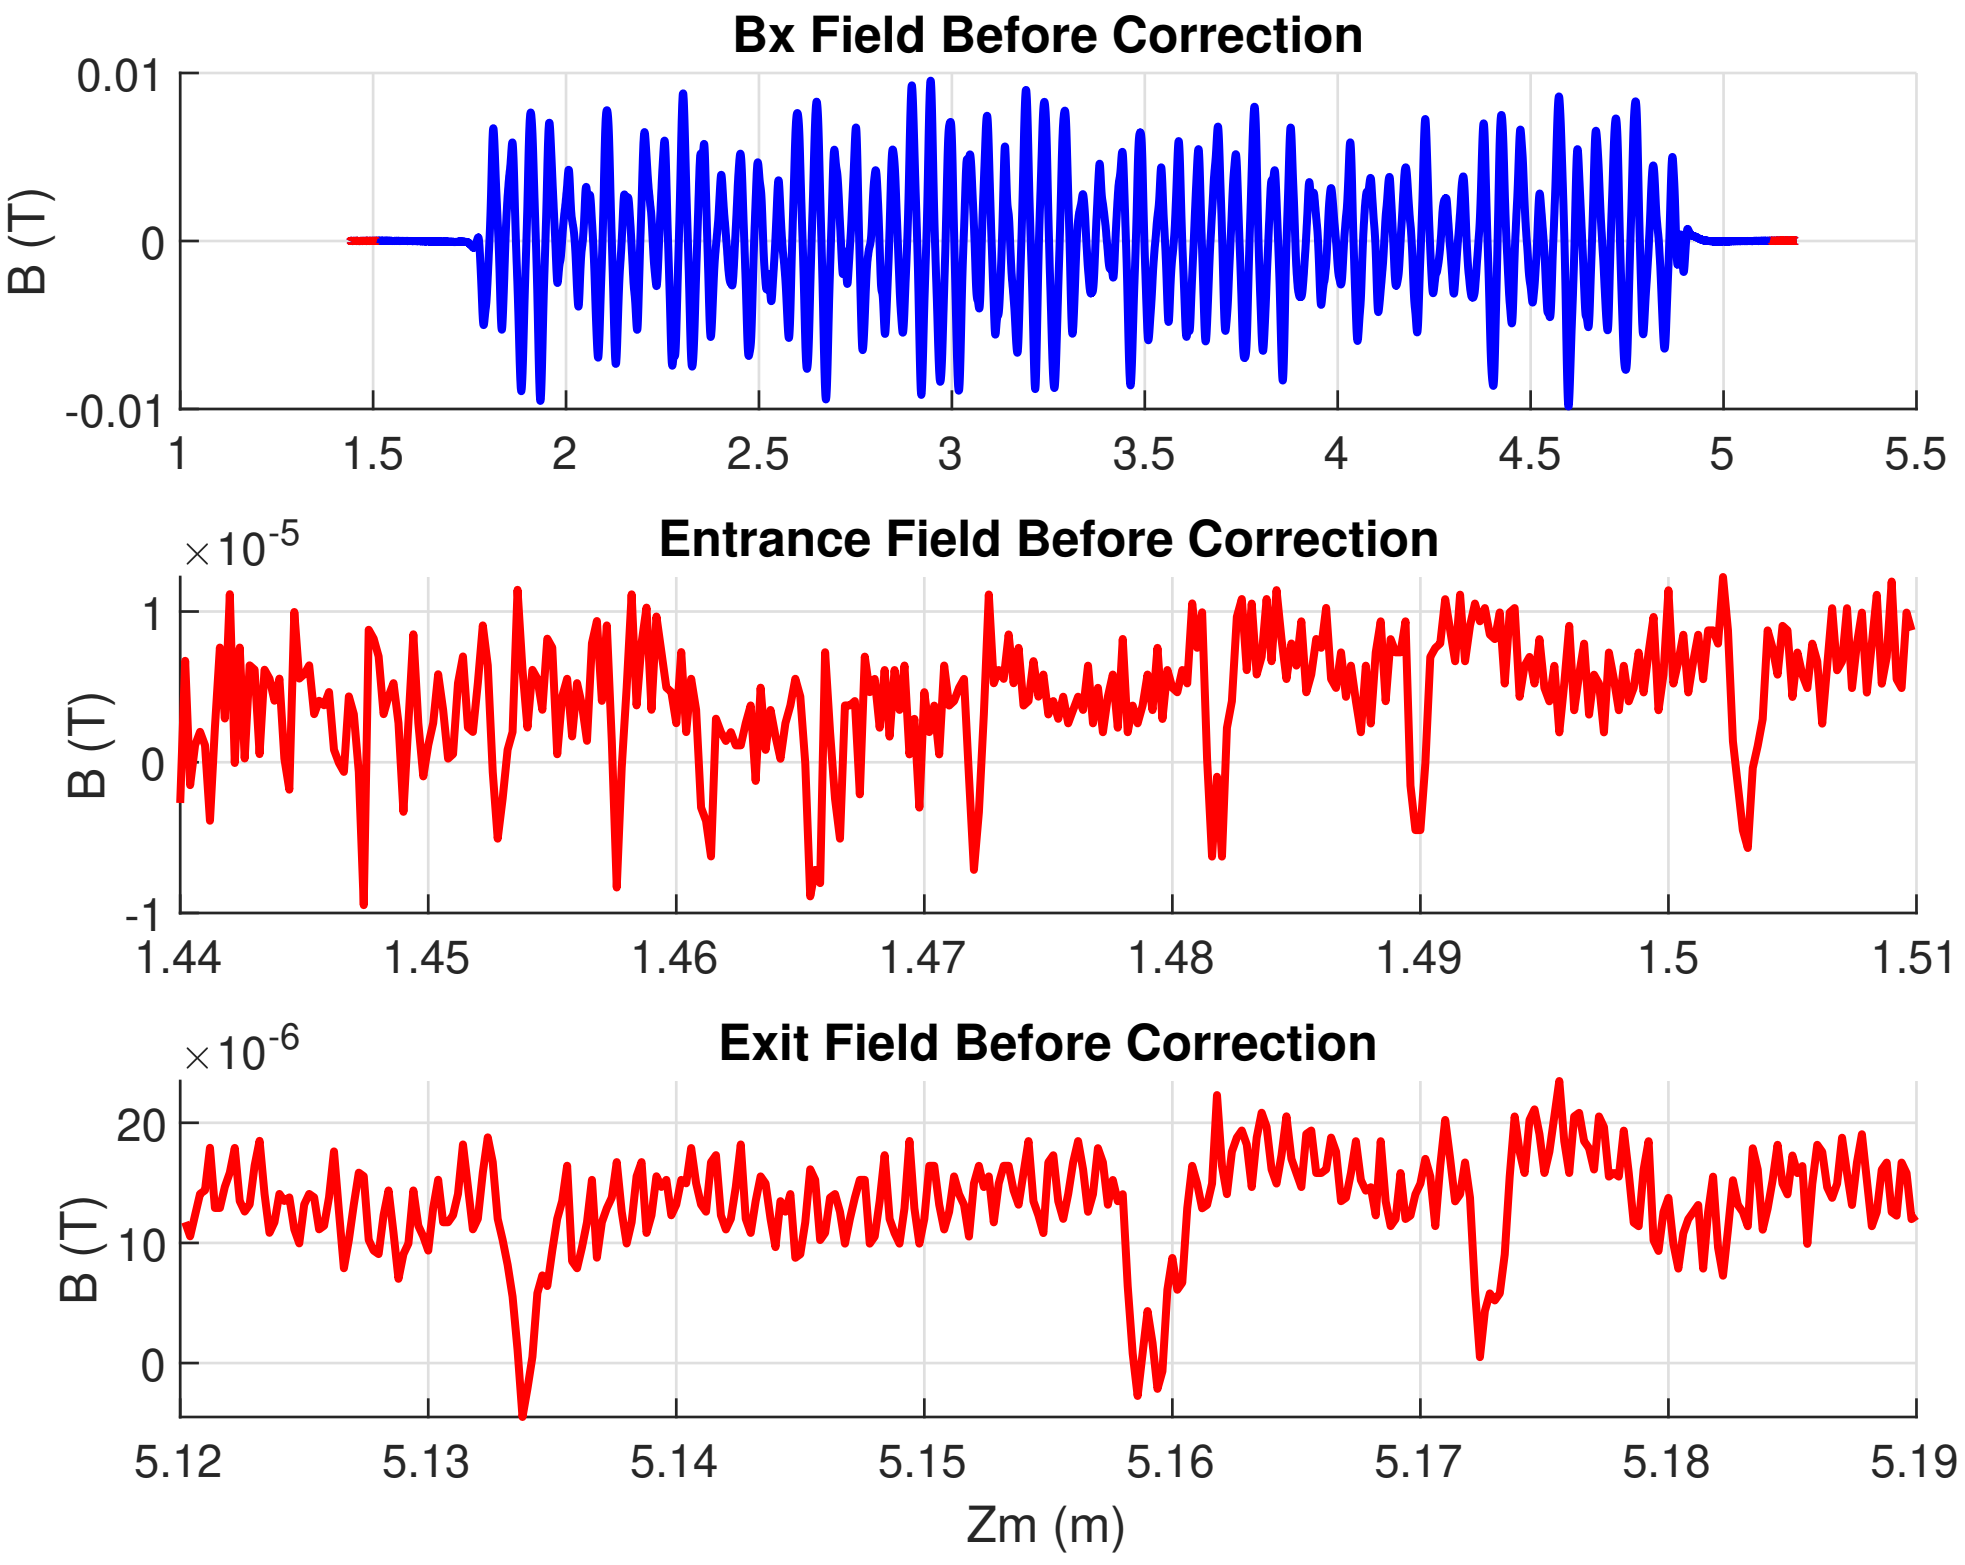
Bx Field Before Correction
B (T)
0.01
0
-0.01
1
1.5
2
2.5
3
3.5
4
4.5
5
5.5
Entrance Field Before Correction
$\times 10^{-5}$
B (T)
1
0
-1
1.44
1.45
1.46
1.47
1.48
1.49
1.5
1.51
Exit Field Before Correction
$\times 10^{-6}$
B (T)
20
10
0
5.12
5.13
5.14
5.15
5.16
5.17
5.18
5.19
Zm (m)

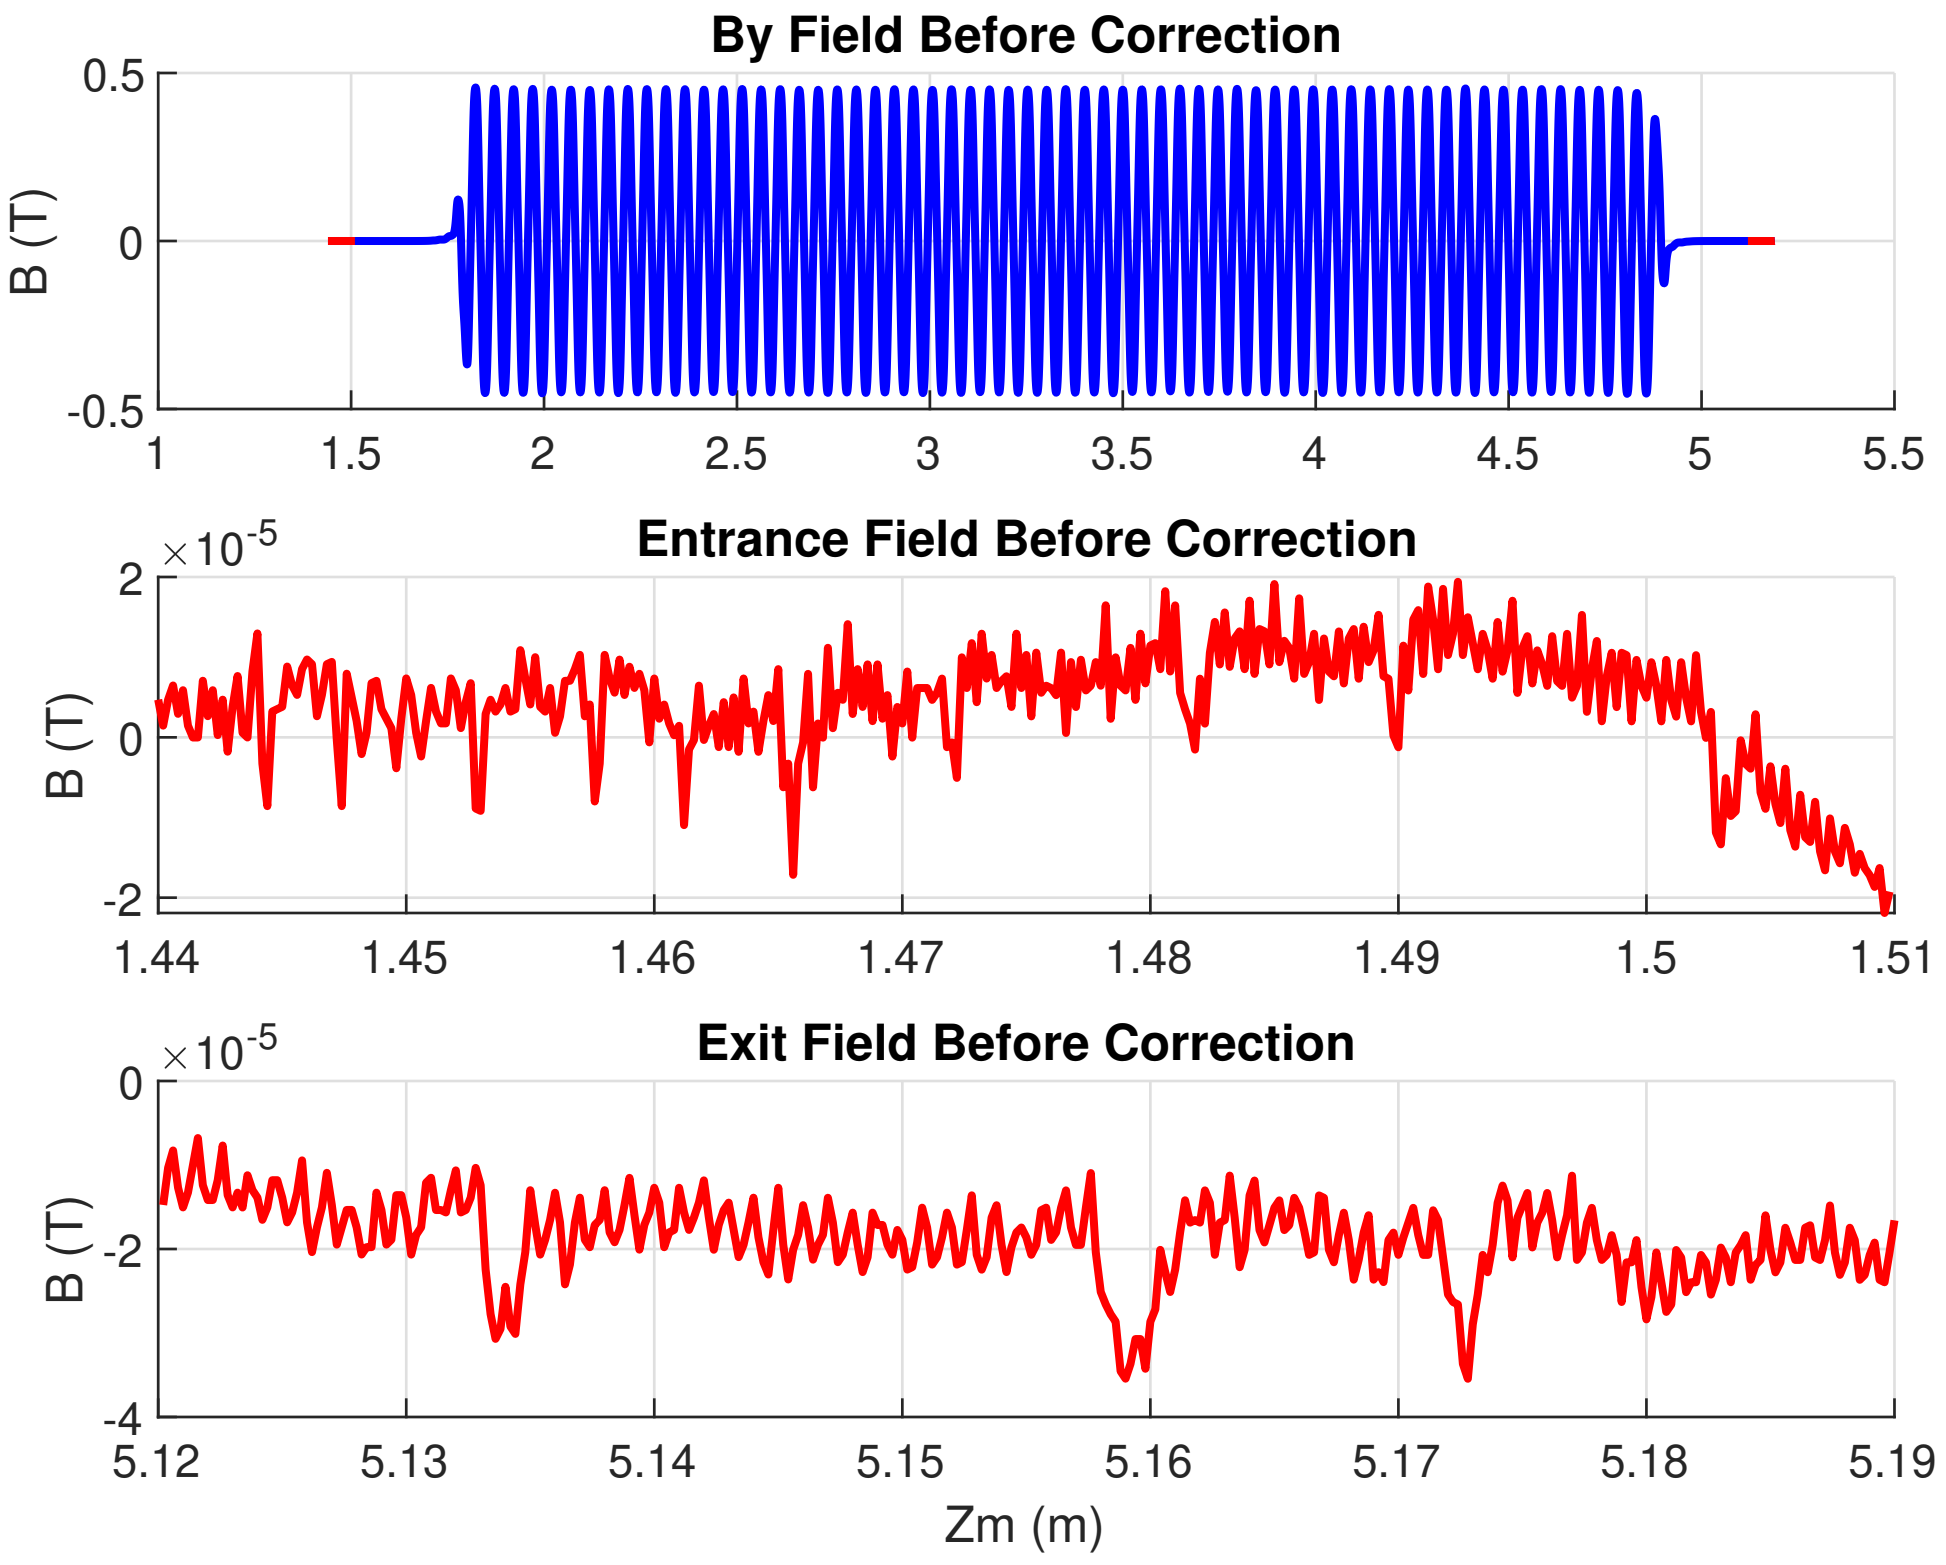
By Field Before Correction
B (T)
0.5
0
-0.5
1
1.5
2
2.5
3
3.5
4
4.5
5
5.5
Entrance Field Before Correction
×10^-5
2
0
-2
B (T)
1.44
1.45
1.46
1.47
1.48
1.49
1.5
1.51
Exit Field Before Correction
×10^-5
0
-2
-4
B (T)
5.12
5.13
5.14
5.15
5.16
5.17
5.18
5.19
Zm (m)

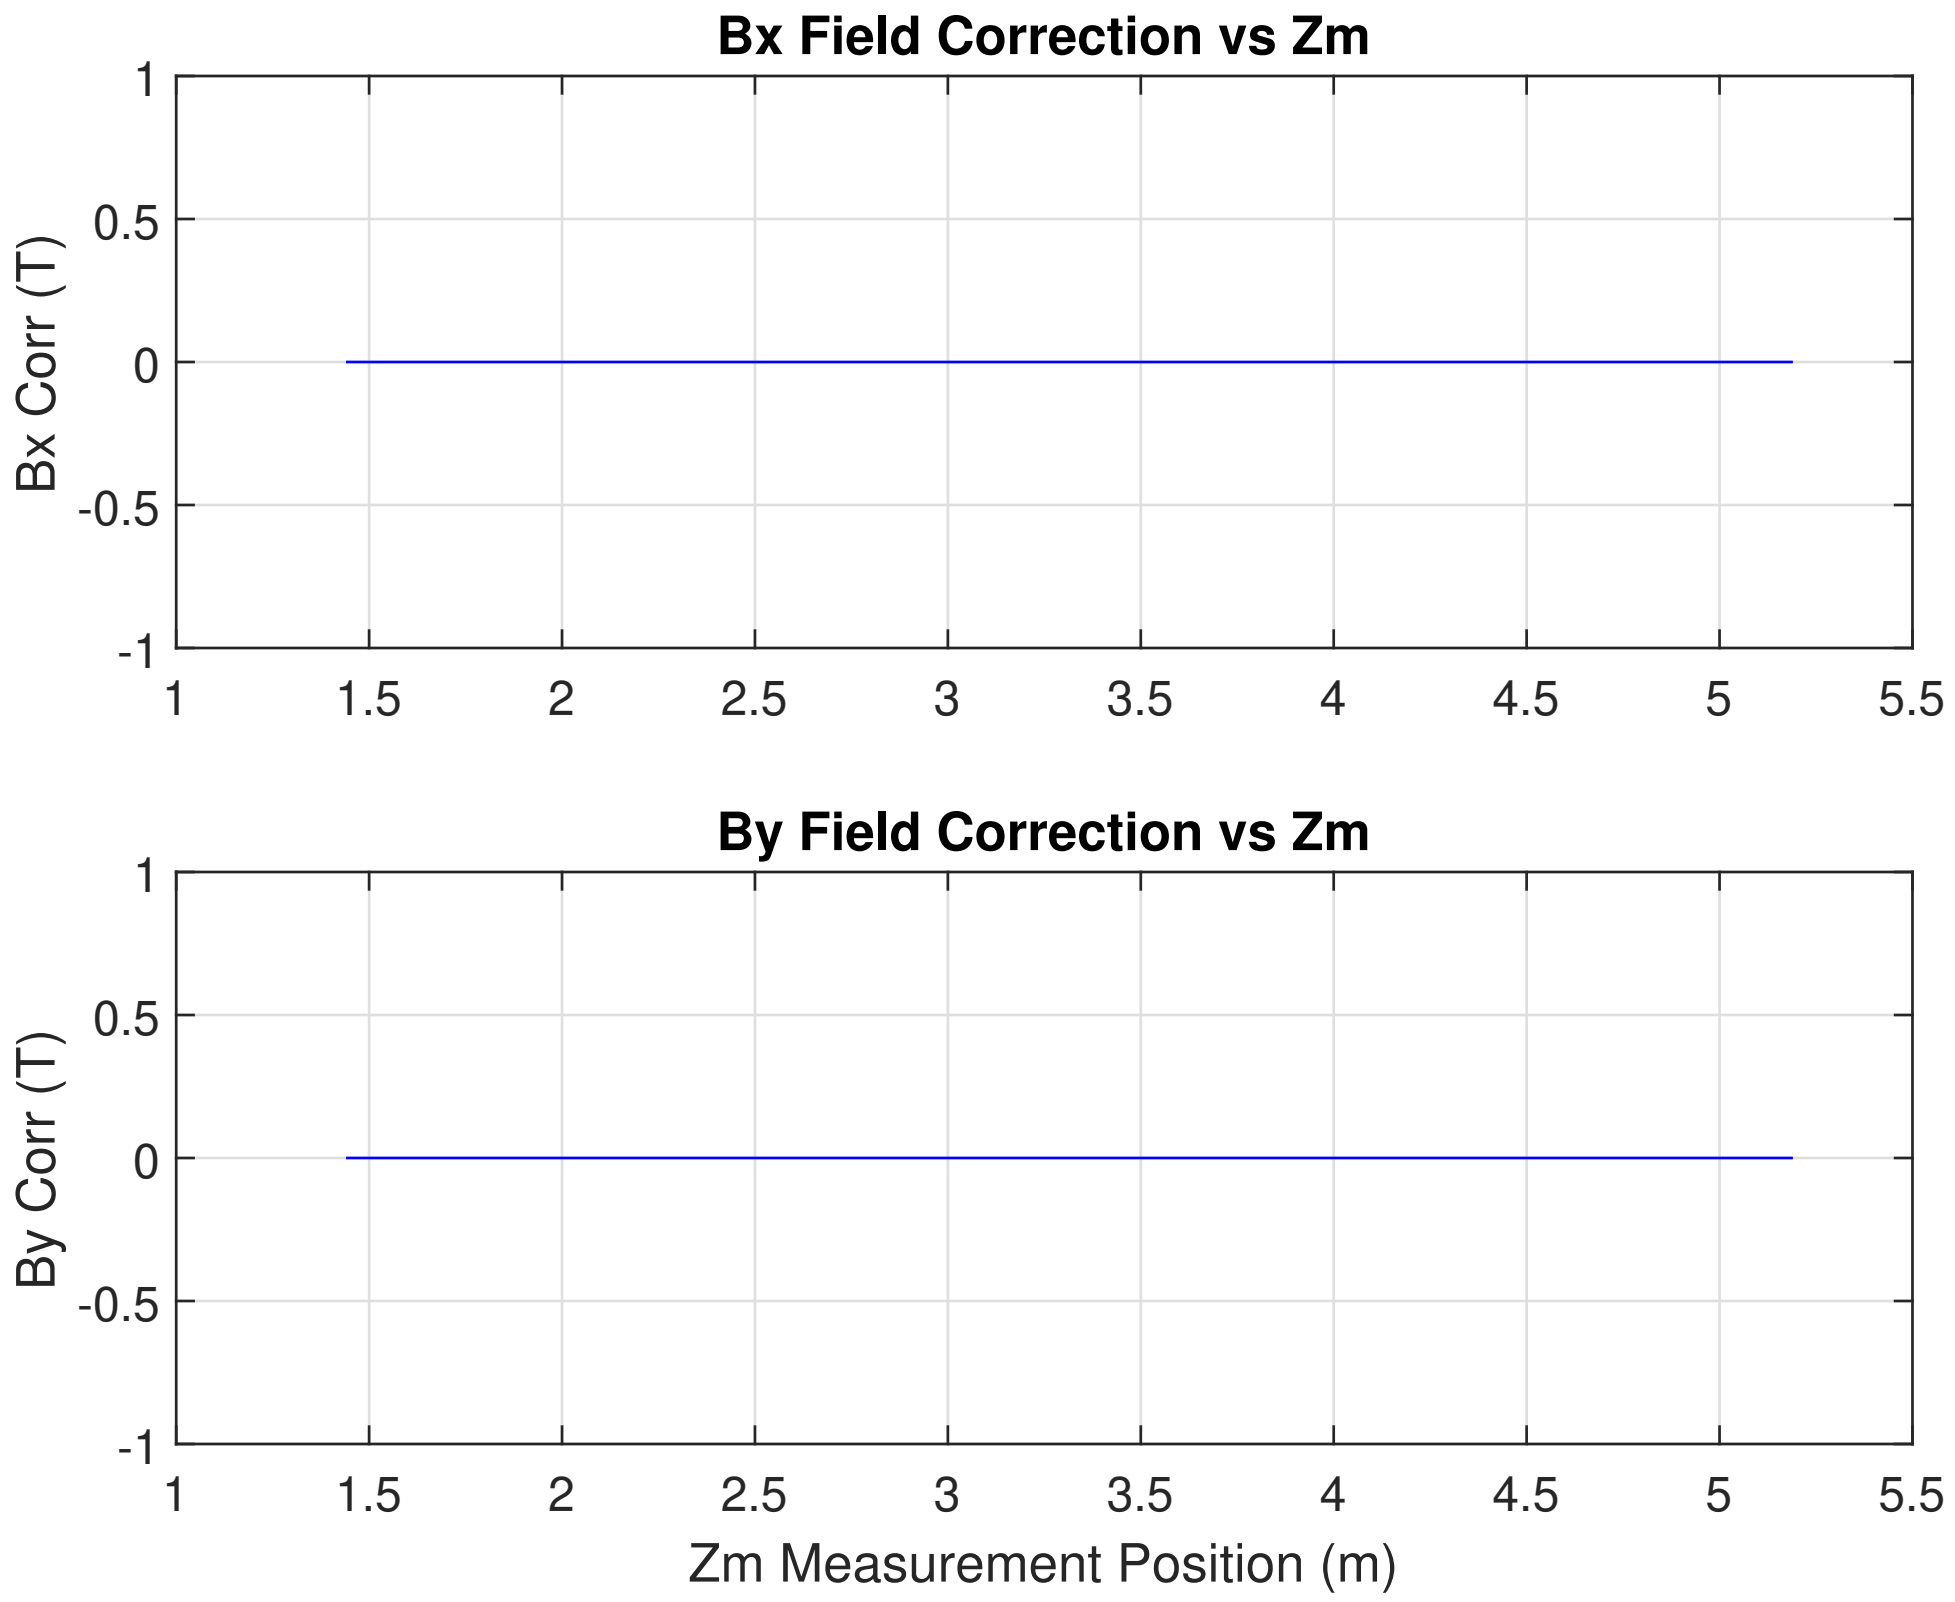
Bx Field Correction vs Zm
Bx Corr (T)
1
0.5
0
-0.5
-1
1
1.5
2
2.5
3
3.5
4
4.5
5
5.5
By Field Correction vs Zm
By Corr (T)
1
0.5
0
-0.5
-1
1
1.5
2
2.5
3
3.5
4
4.5
5
5.5
Zm Measurement Position (m)

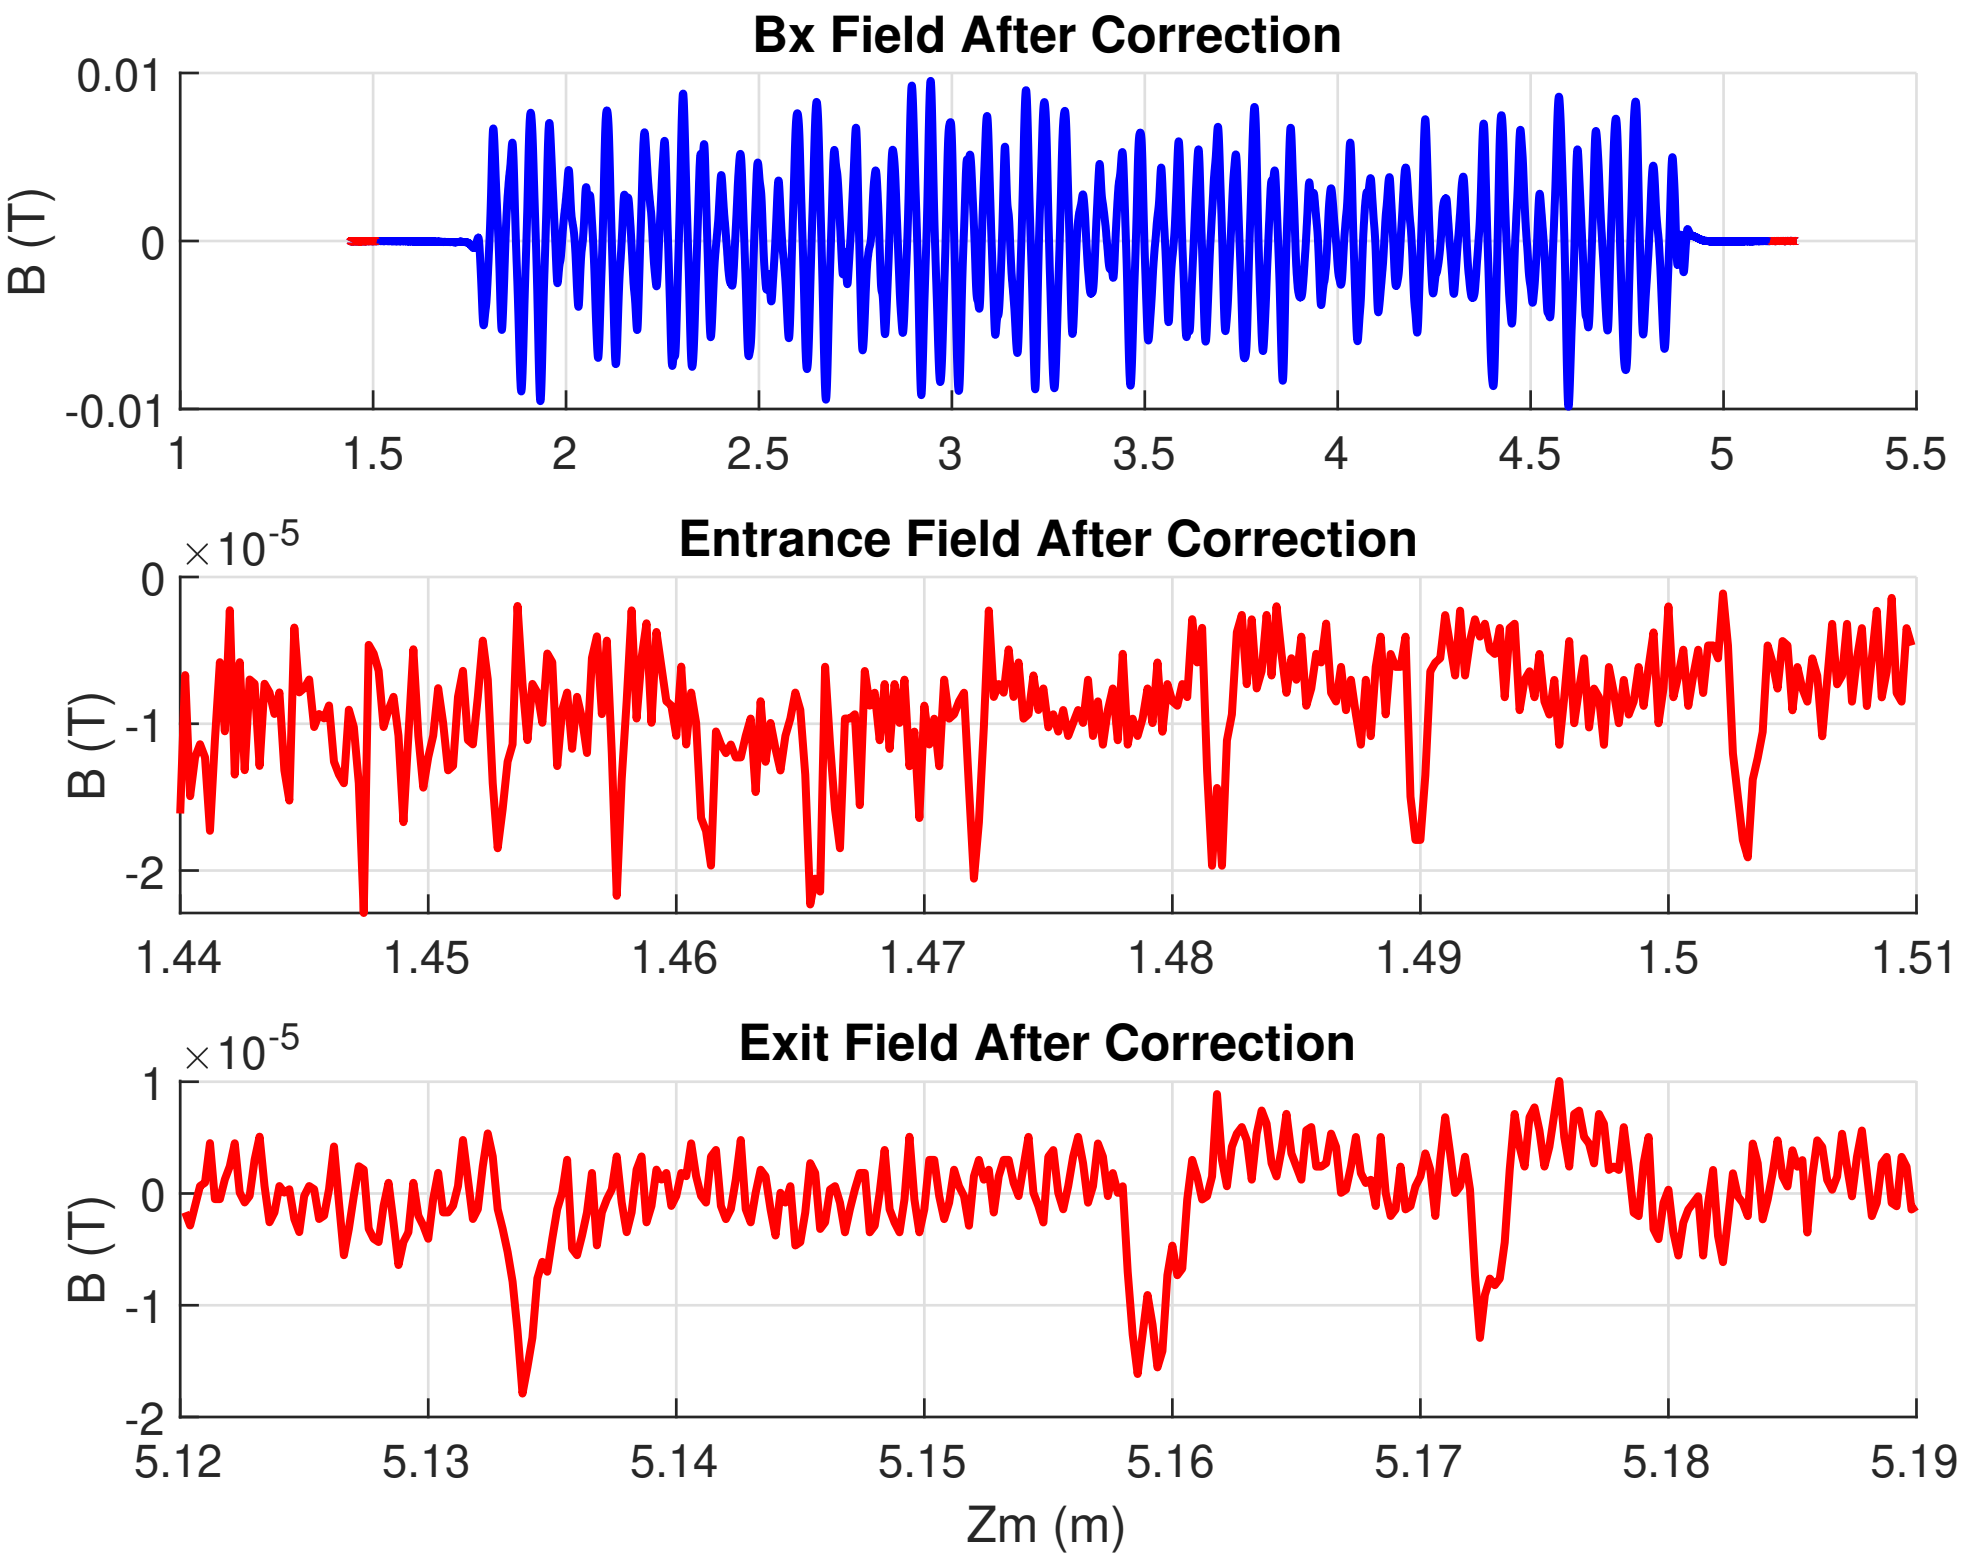
Bx Field After Correction
B (T)
0.01
0
-0.01
1
1.5
2
2.5
3
3.5
4
4.5
5
5.5
Entrance Field After Correction
×10^-5
0
-1
-2
B (T)
1.44
1.45
1.46
1.47
1.48
1.49
1.5
1.51
Exit Field After Correction
×10^-5
1
0
-1
-2
B (T)
5.12
5.13
5.14
5.15
5.16
5.17
5.18
5.19
Zm (m)

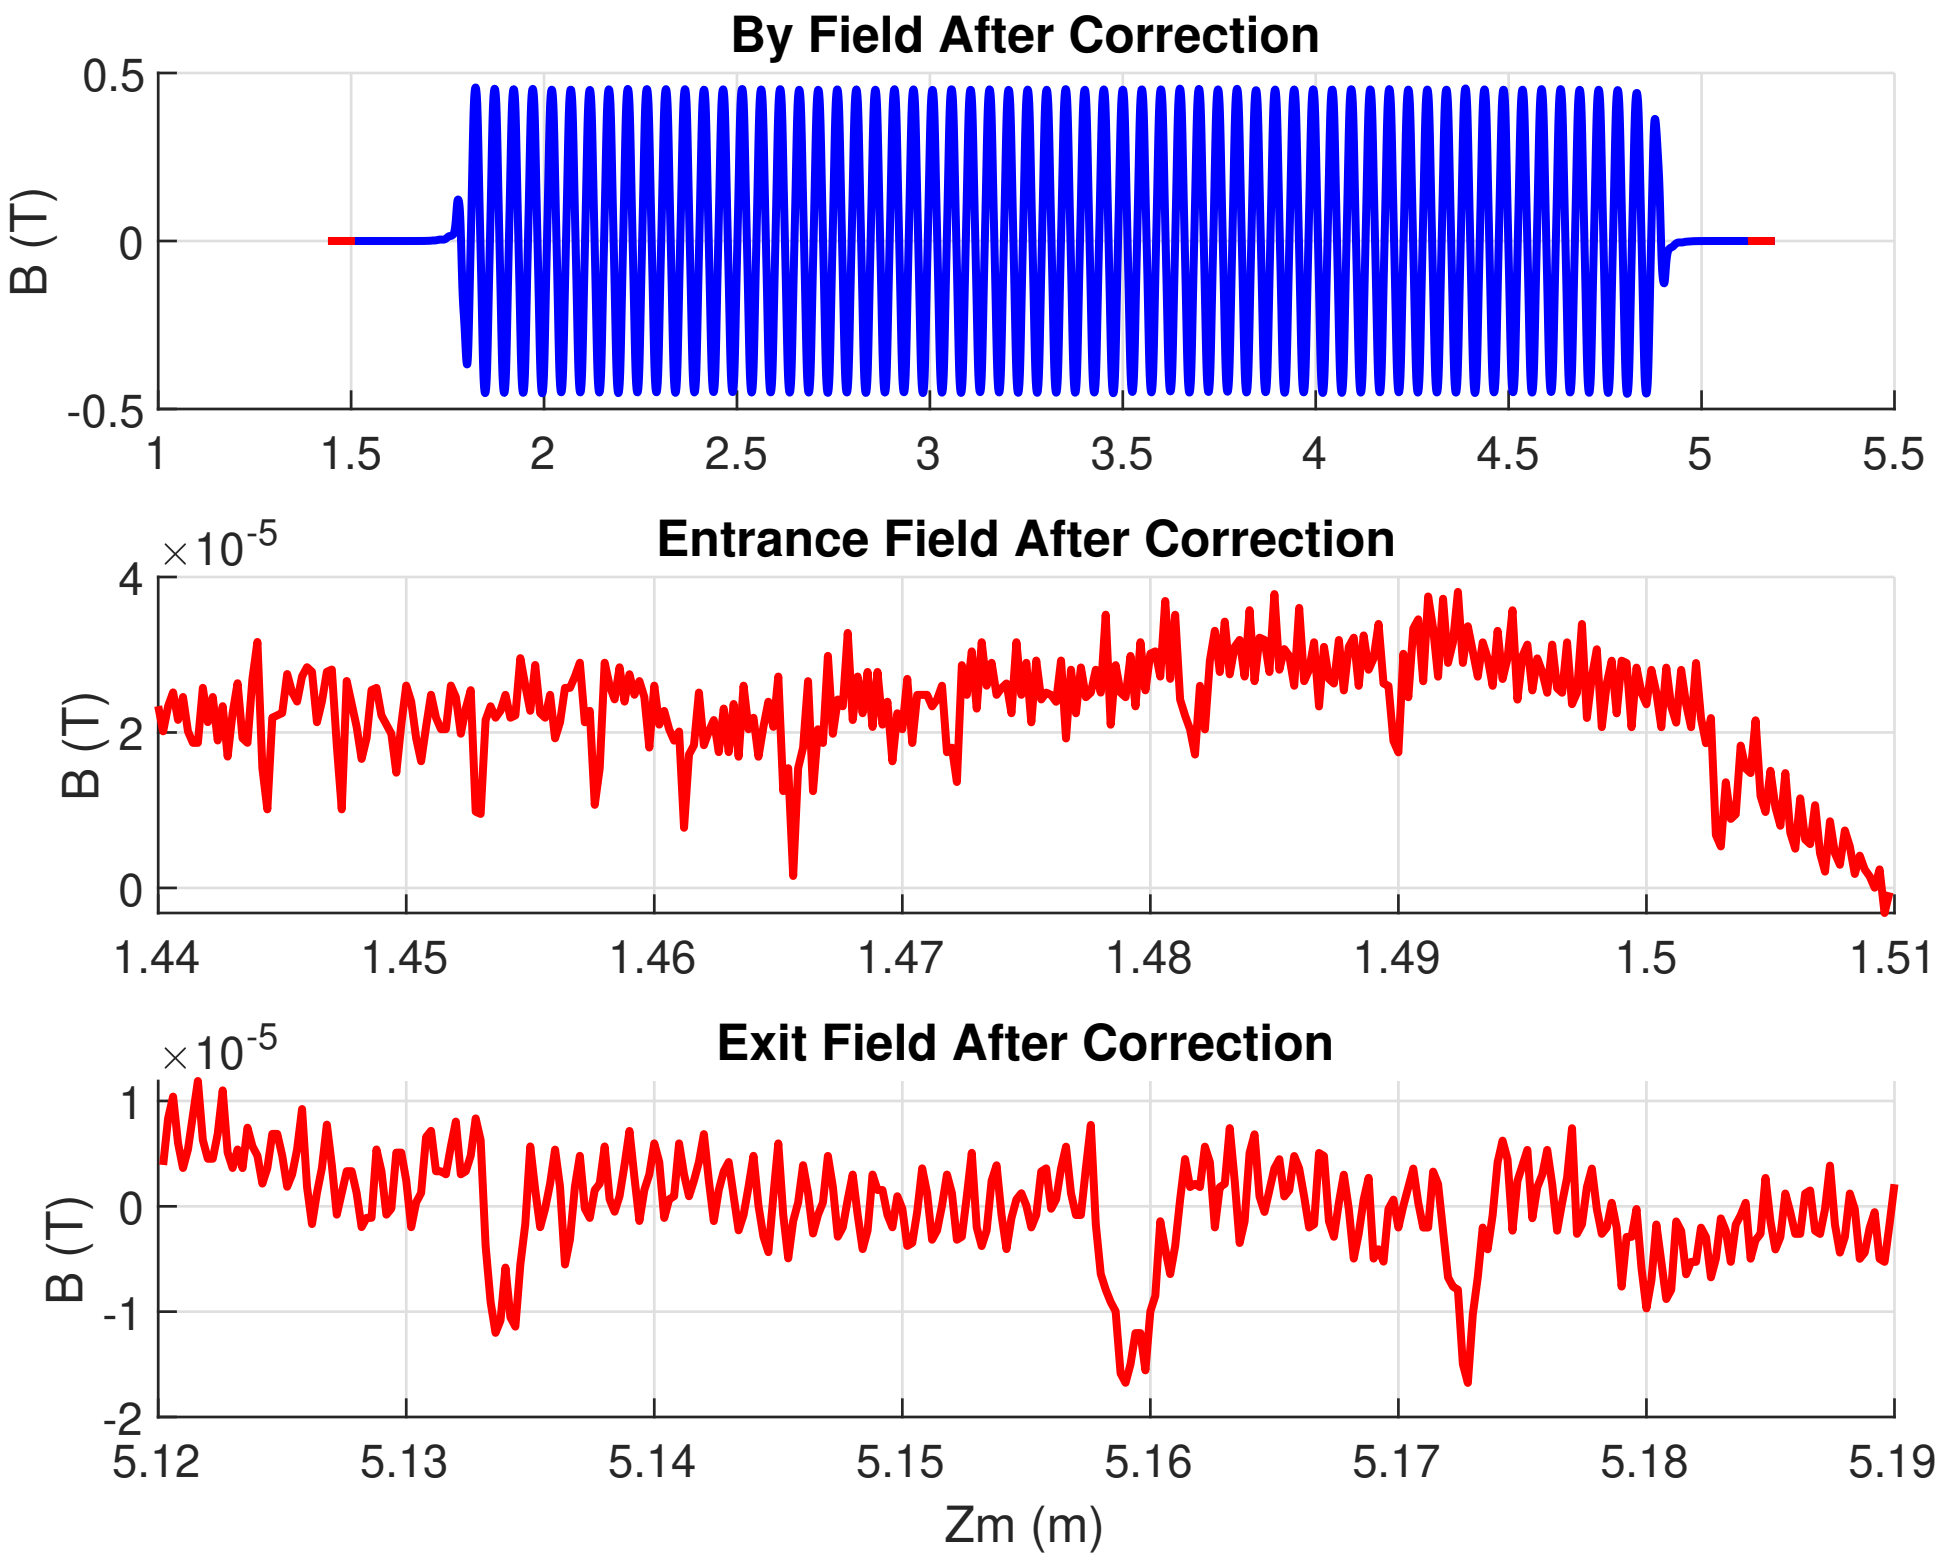
By Field After Correction
B (T)
0.5
0
-0.5
1
1.5
2
2.5
3
3.5
4
4.5
5
5.5
Entrance Field After Correction
×10^-5
4
2
0
1.44
1.45
1.46
1.47
1.48
1.49
1.5
1.51
Exit Field After Correction
×10^-5
1
0
-1
-2
5.12
5.13
5.14
5.15
5.16
5.17
5.18
5.19
Zm (m)

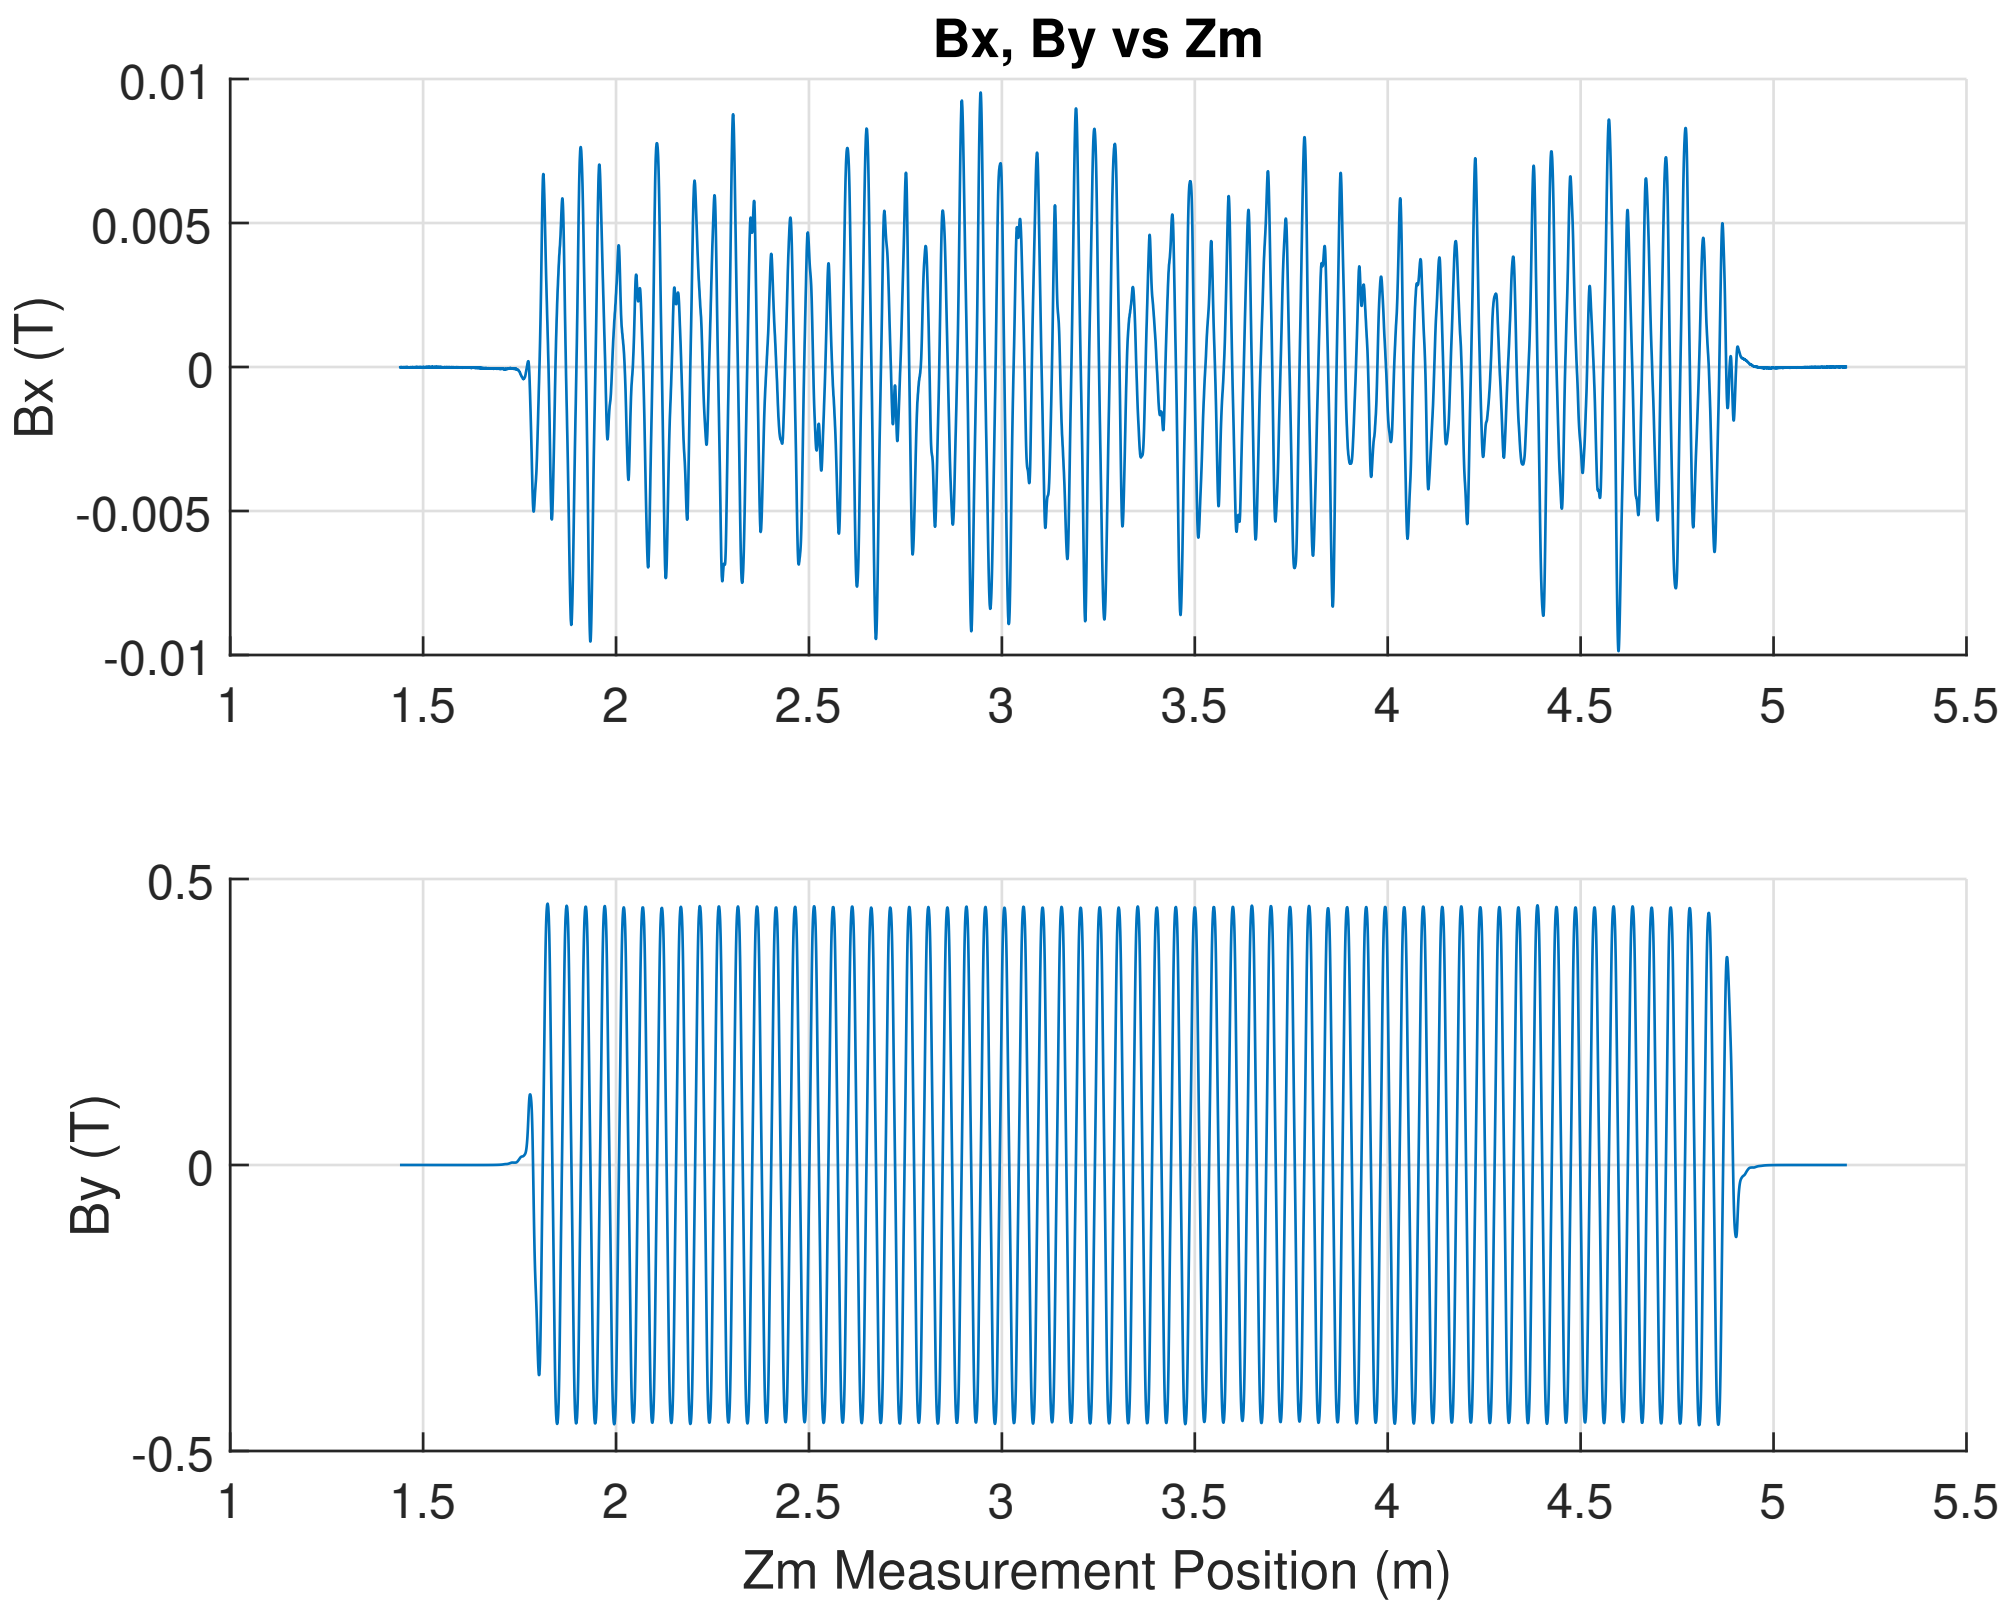
Bx, By vs Zm
0.01
0.005
0
-0.005
-0.01
Bx (T)
1
1.5
2
2.5
3
3.5
4
4.5
5
5.5
0.5
0
-0.5
By (T)
1
1.5
2
2.5
3
3.5
4
4.5
5
5.5
Zm Measurement Position (m)

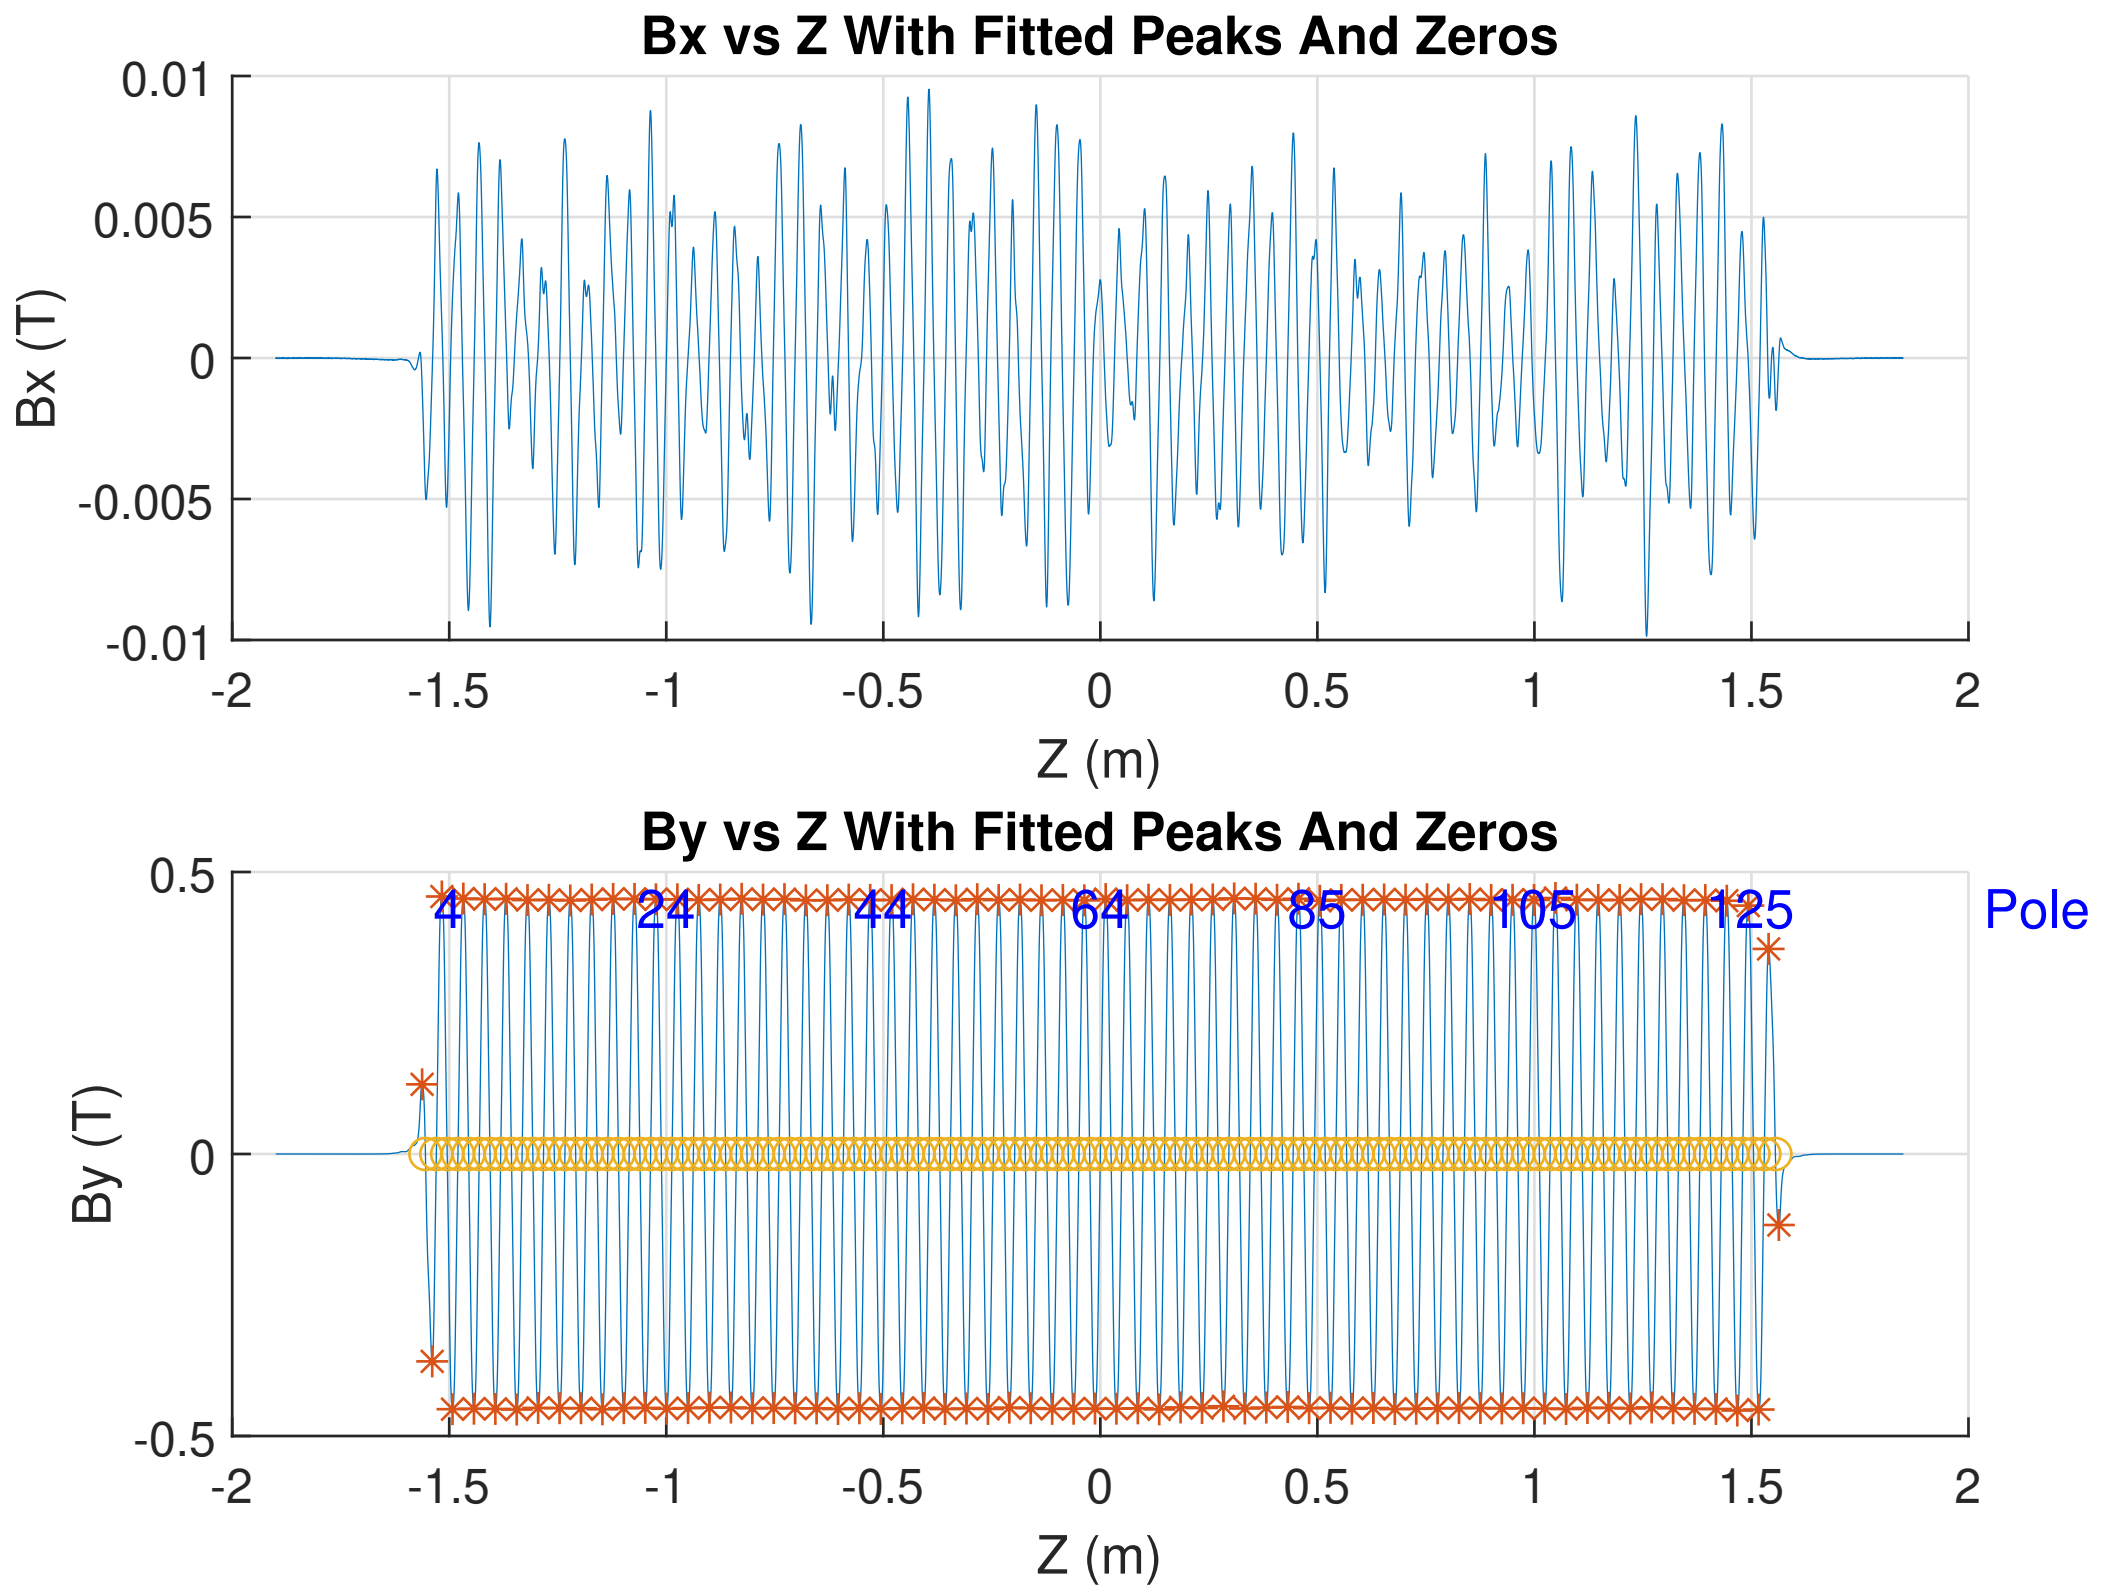
Bx vs Z With Fitted Peaks And Zeros
Bx (T)
0.01
0.005
0
-0.005
-0.01
-2
-1.5
-1
-0.5
0
0.5
1
1.5
2
Z (m)
By vs Z With Fitted Peaks And Zeros
By (T)
0.5
0
-0.5
4
24
44
64
85
105
125
Pole
-2
-1.5
-1
-0.5
0
0.5
1
1.5
2
Z (m)

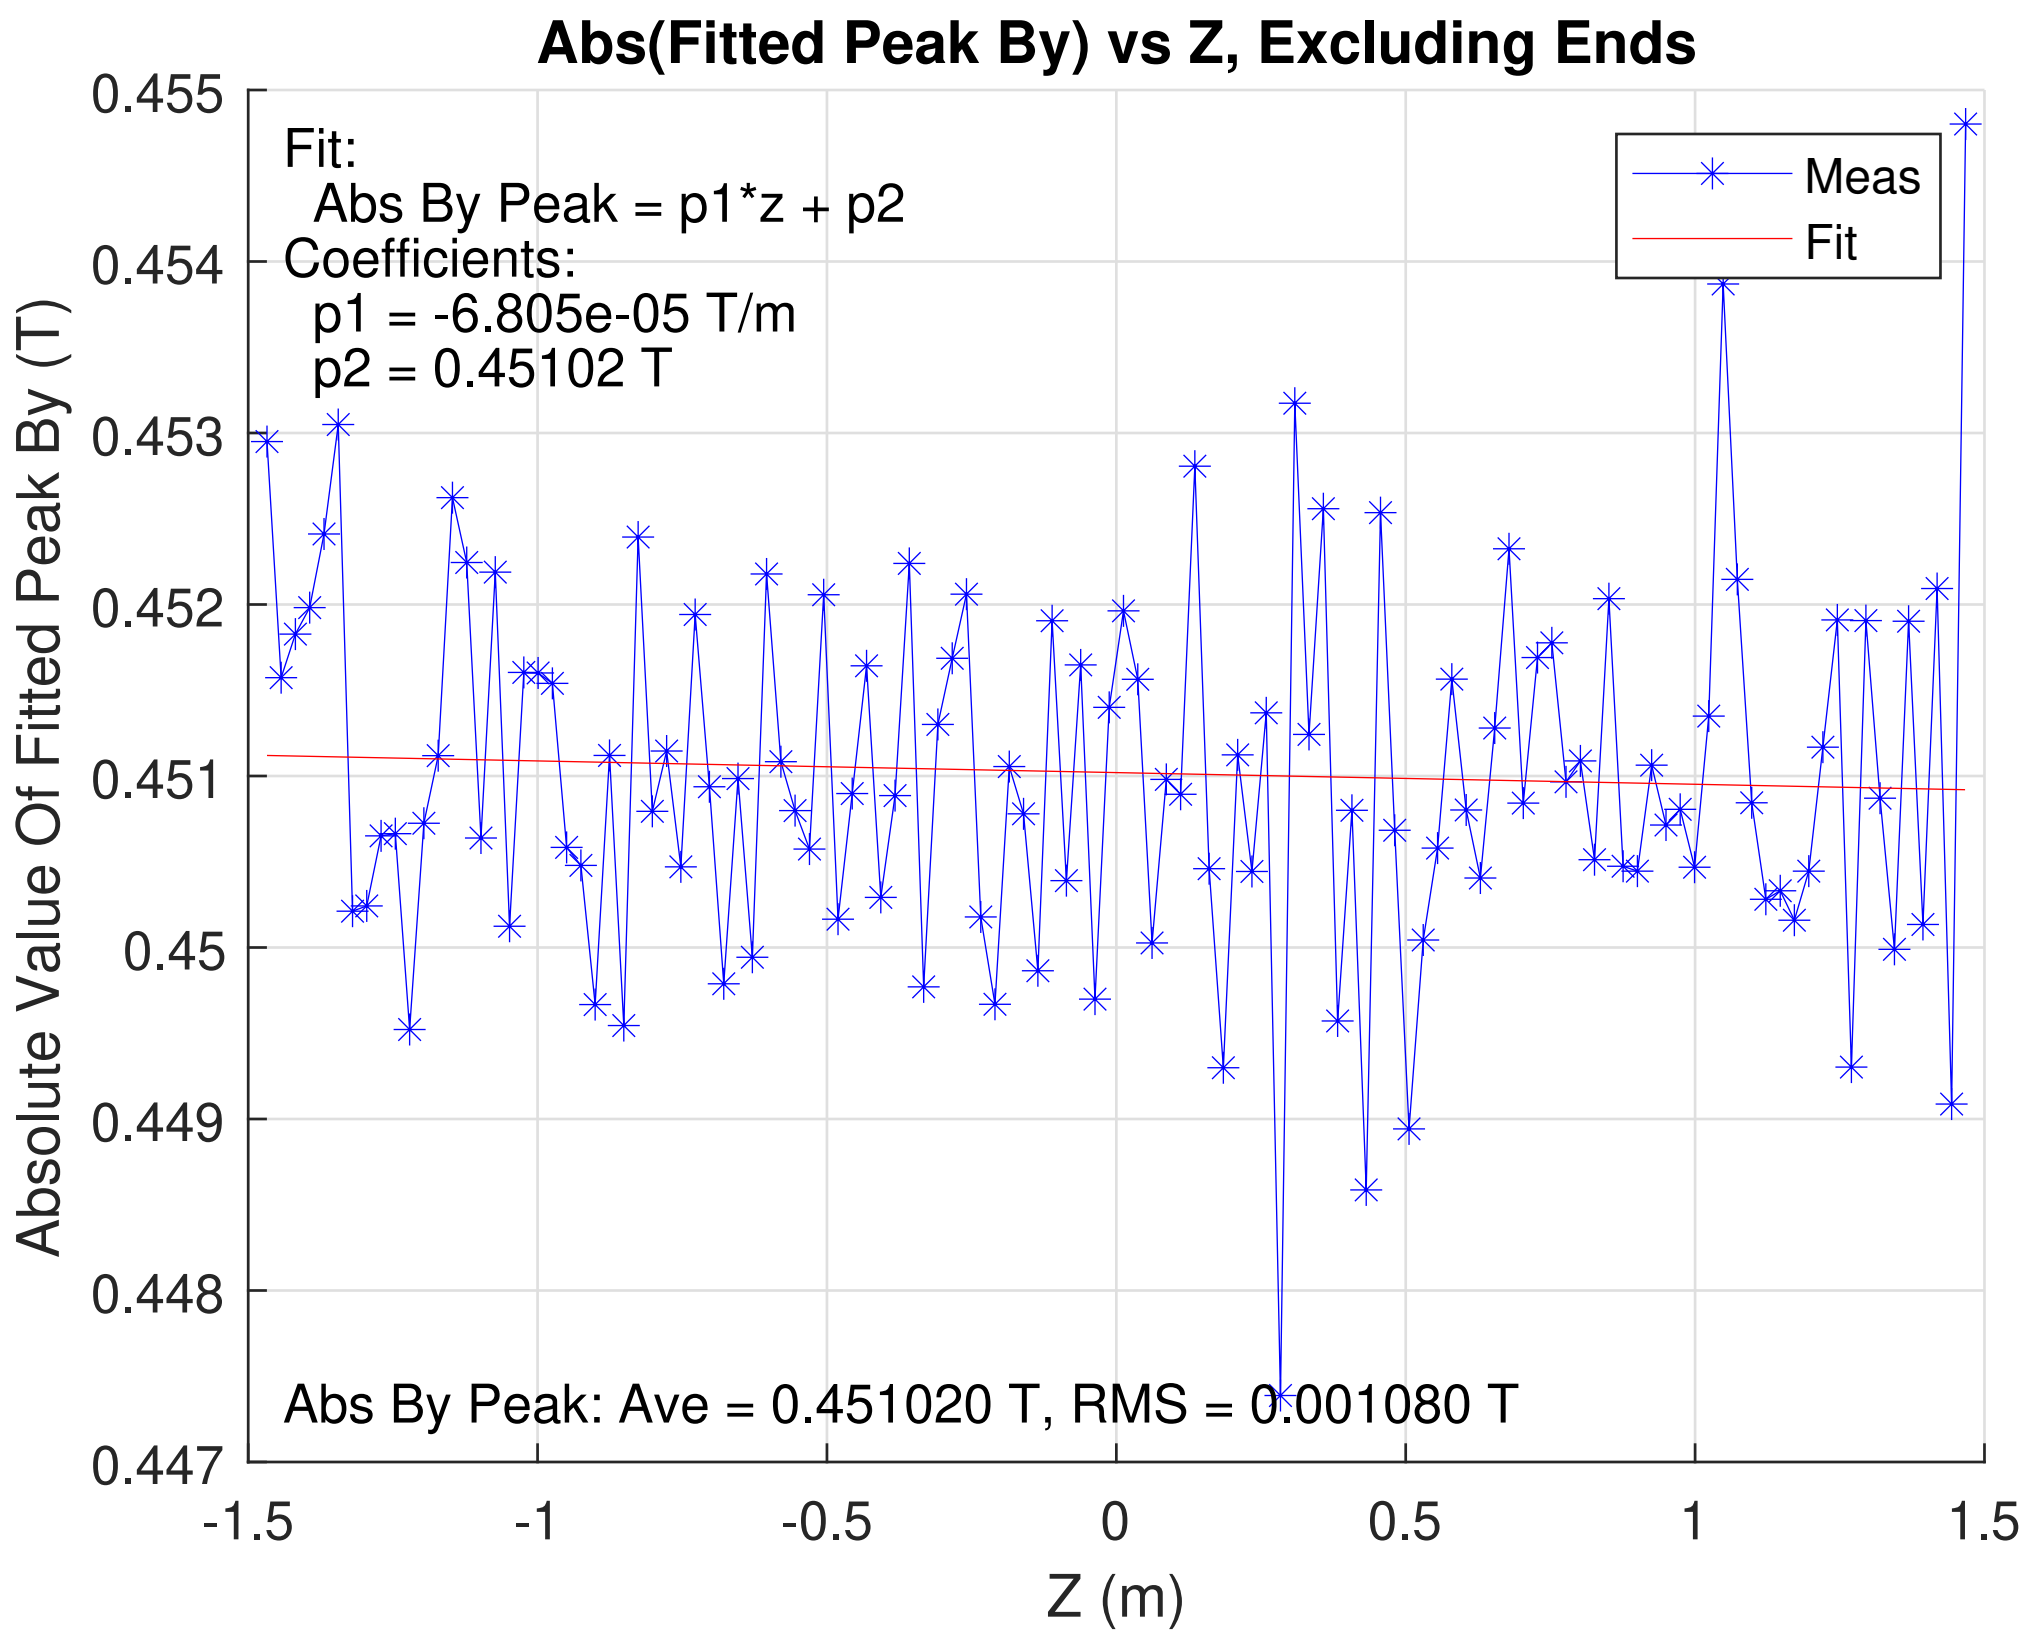
Abs(Fitted Peak By) vs Z, Excluding Ends
Fit:
Abs By Peak = p1*z + p2
Coefficients:
p1 = -6.805e-05 T/m
p2 = 0.45102 T
Meas
Fit
Abs By Peak: Ave = 0.451020 T, RMS = 0.001080 T
Absolute Value Of Fitted Peak By (T)
0.455
0.454
0.453
0.452
0.451
0.45
0.449
0.448
0.447
Z (m)
-1.5
-1
-0.5
0
0.5
1
1.5

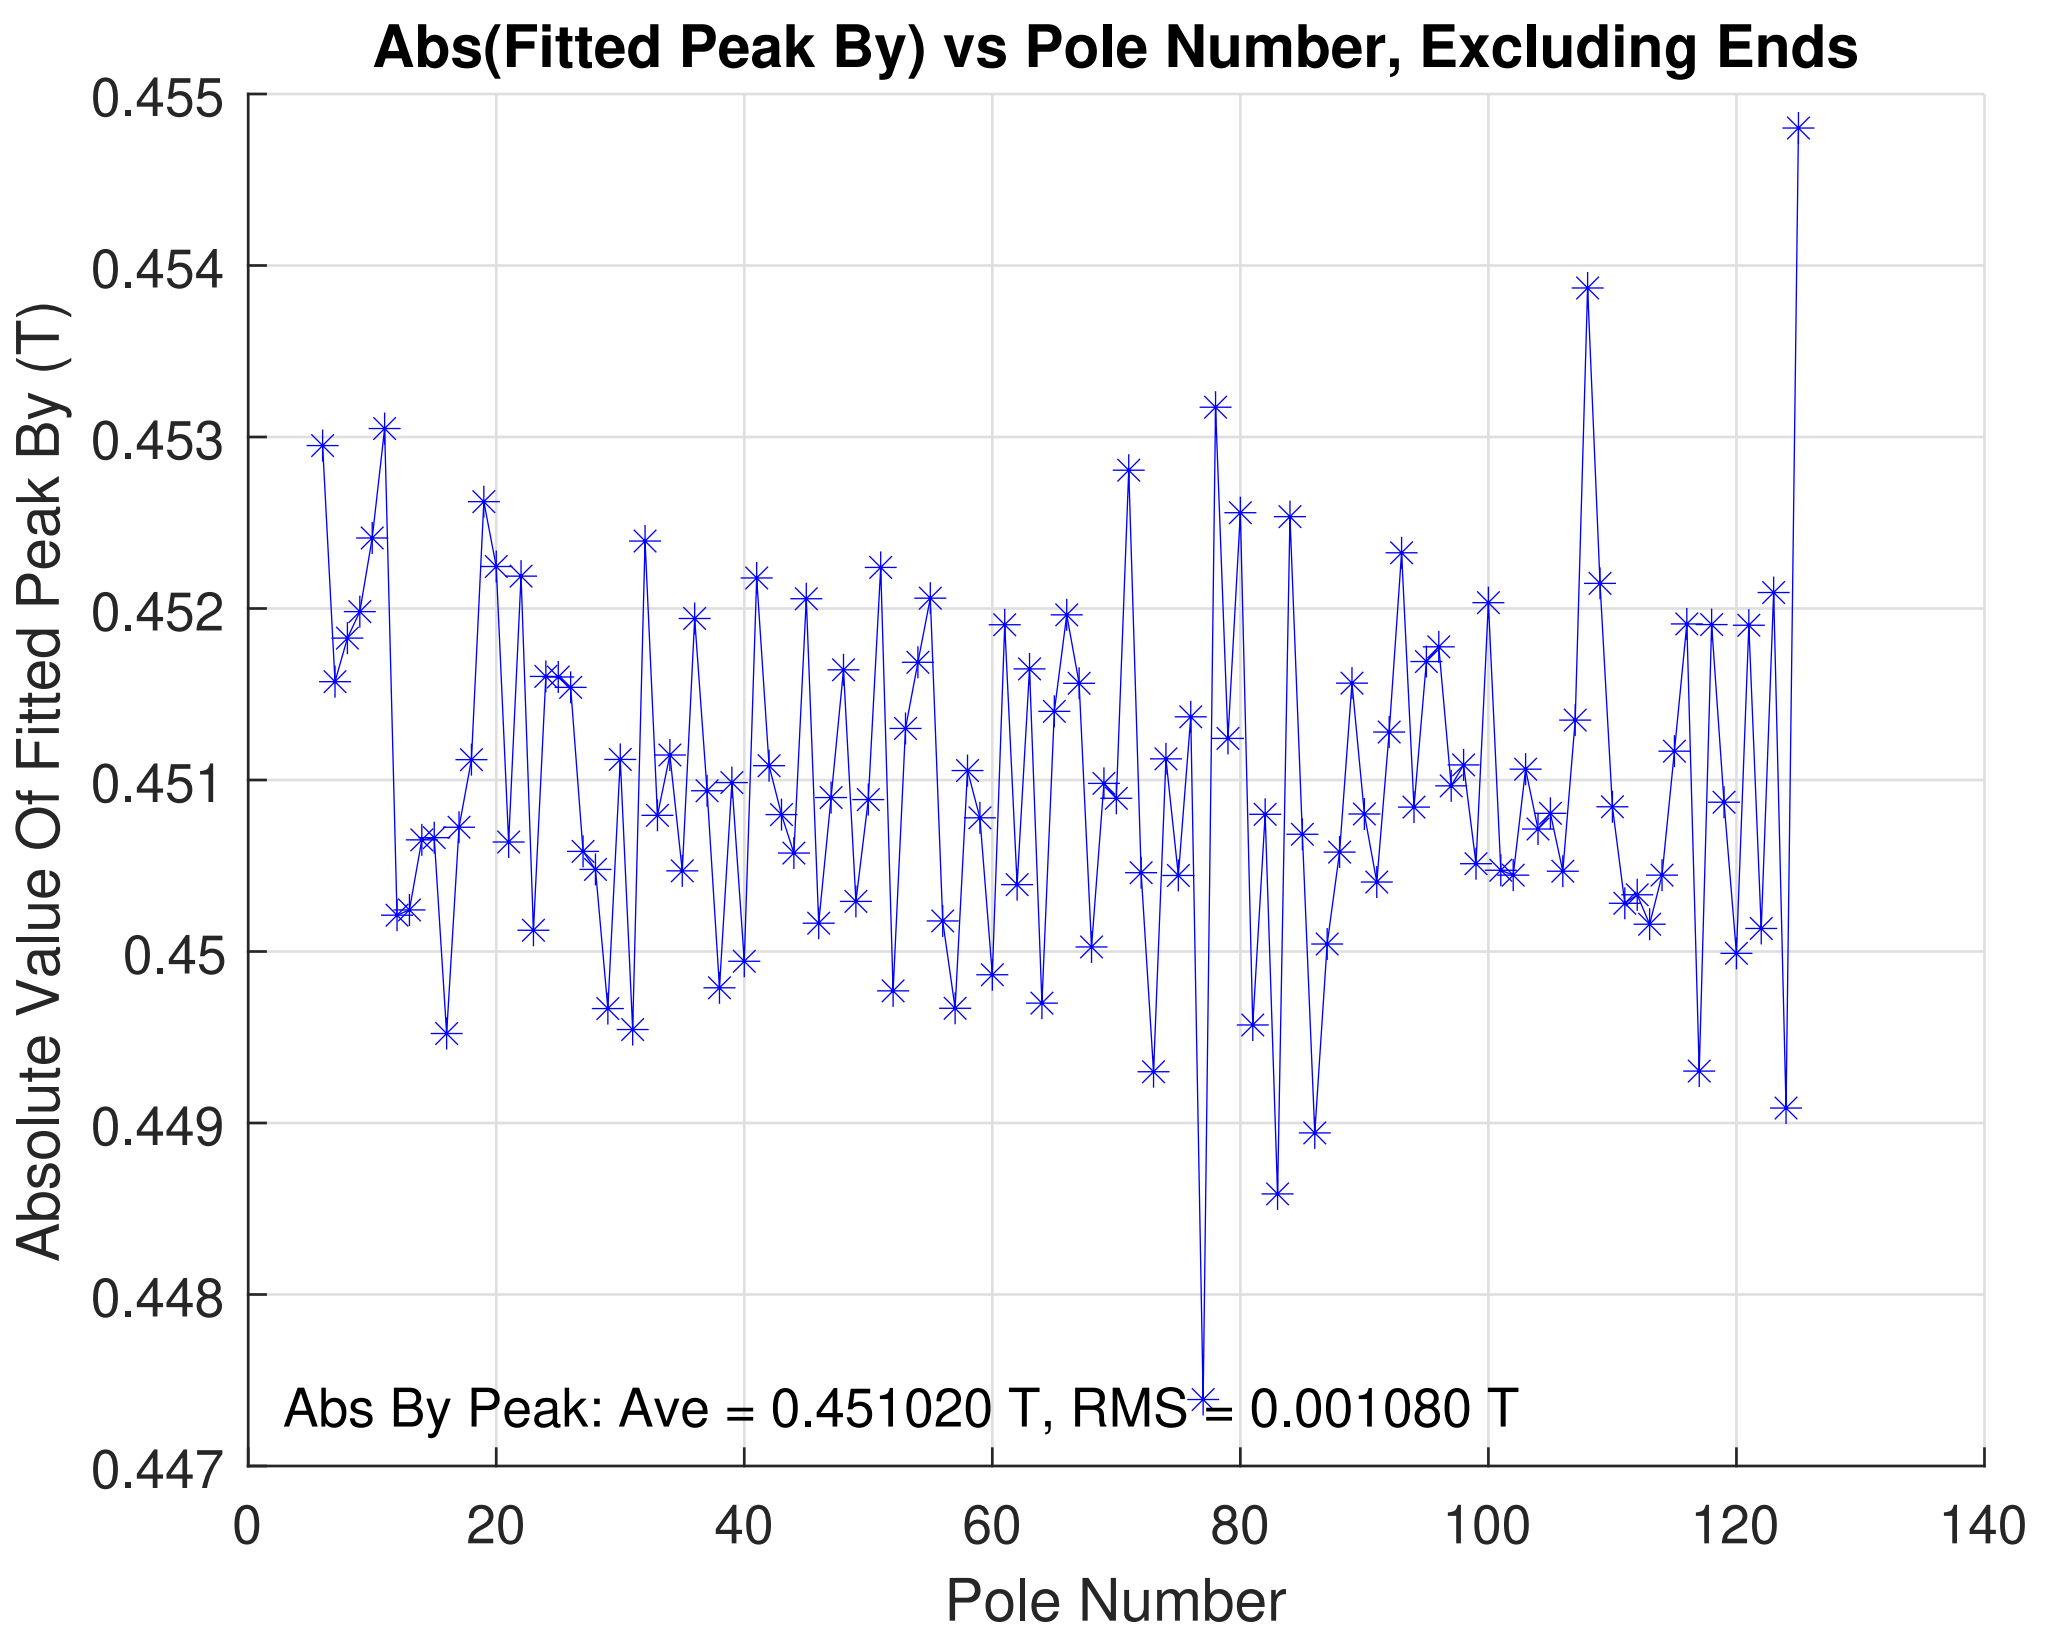

Abs(Fitted Peak By) vs Pole Number, Excluding Ends

Abs By Peak: Ave = 0.451020 T, RMS = 0.001080 T

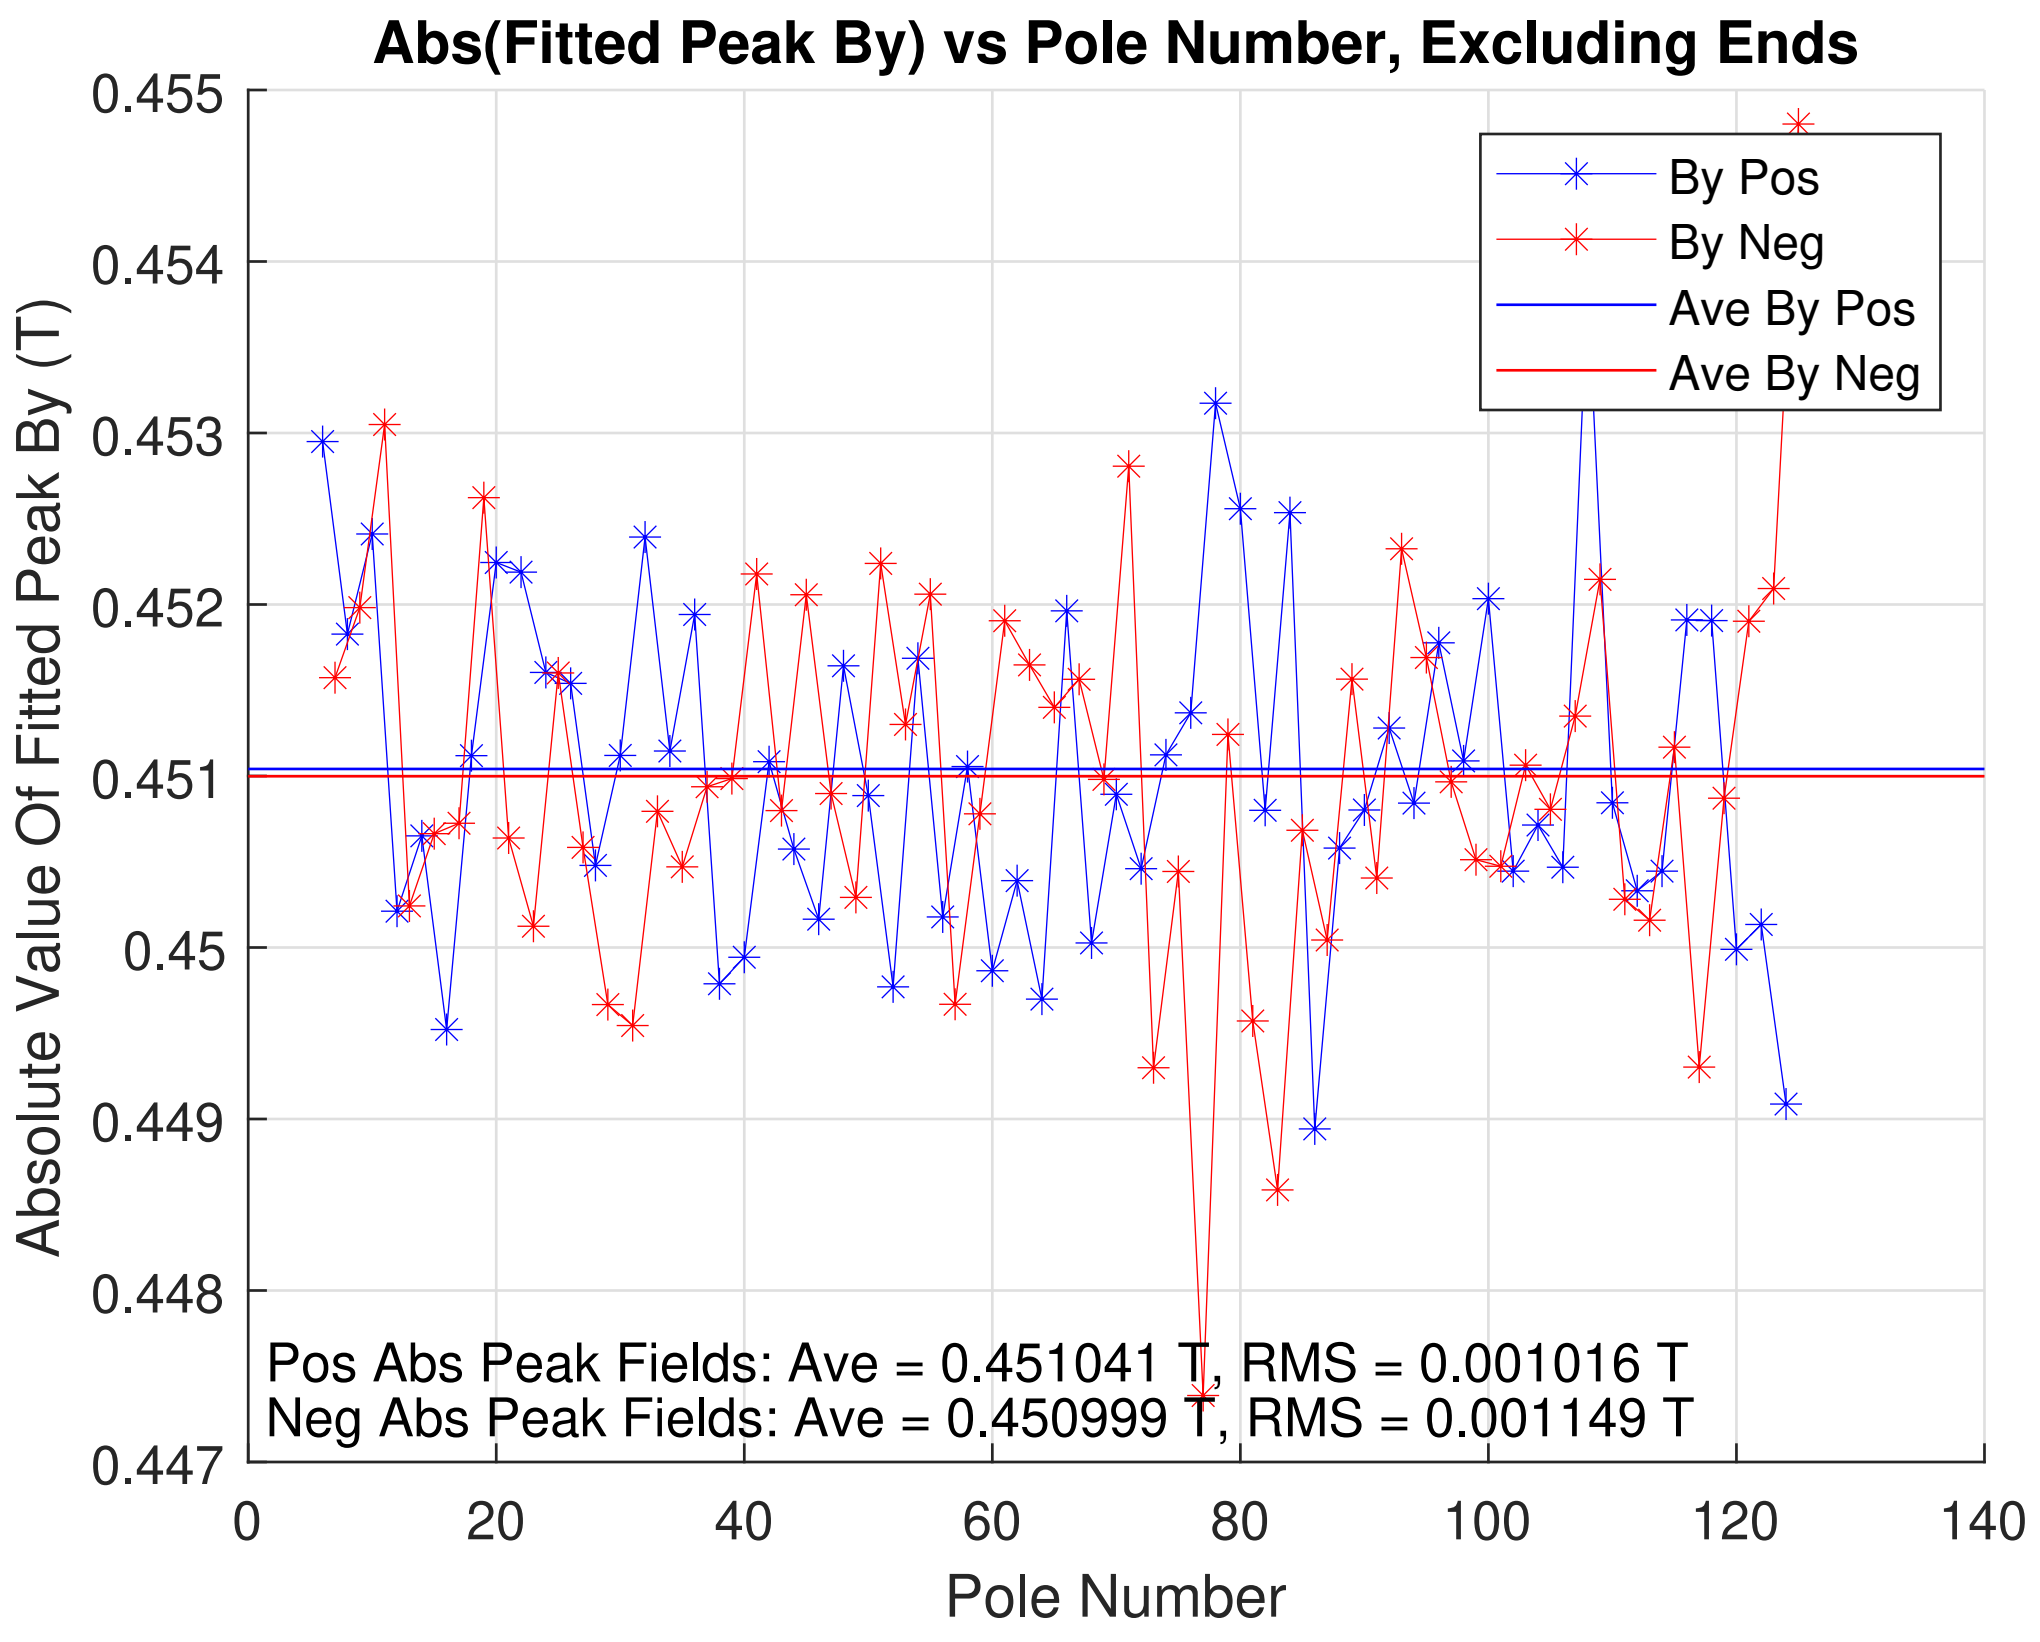

Abs(Fitted Peak By) vs Pole Number, Excluding Ends
Absolute Value Of Fitted Peak By (T)
0.455
0.454
0.453
0.452
0.451
0.45
0.449
0.448
0.447
Pole Number
0
20
40
60
80
100
120
140
By Pos
By Neg
Ave By Pos
Ave By Neg
Pos Abs Peak Fields: Ave = 0.451041 T, RMS = 0.001016 T
Neg Abs Peak Fields: Ave = 0.450999 T, RMS = 0.001149 T

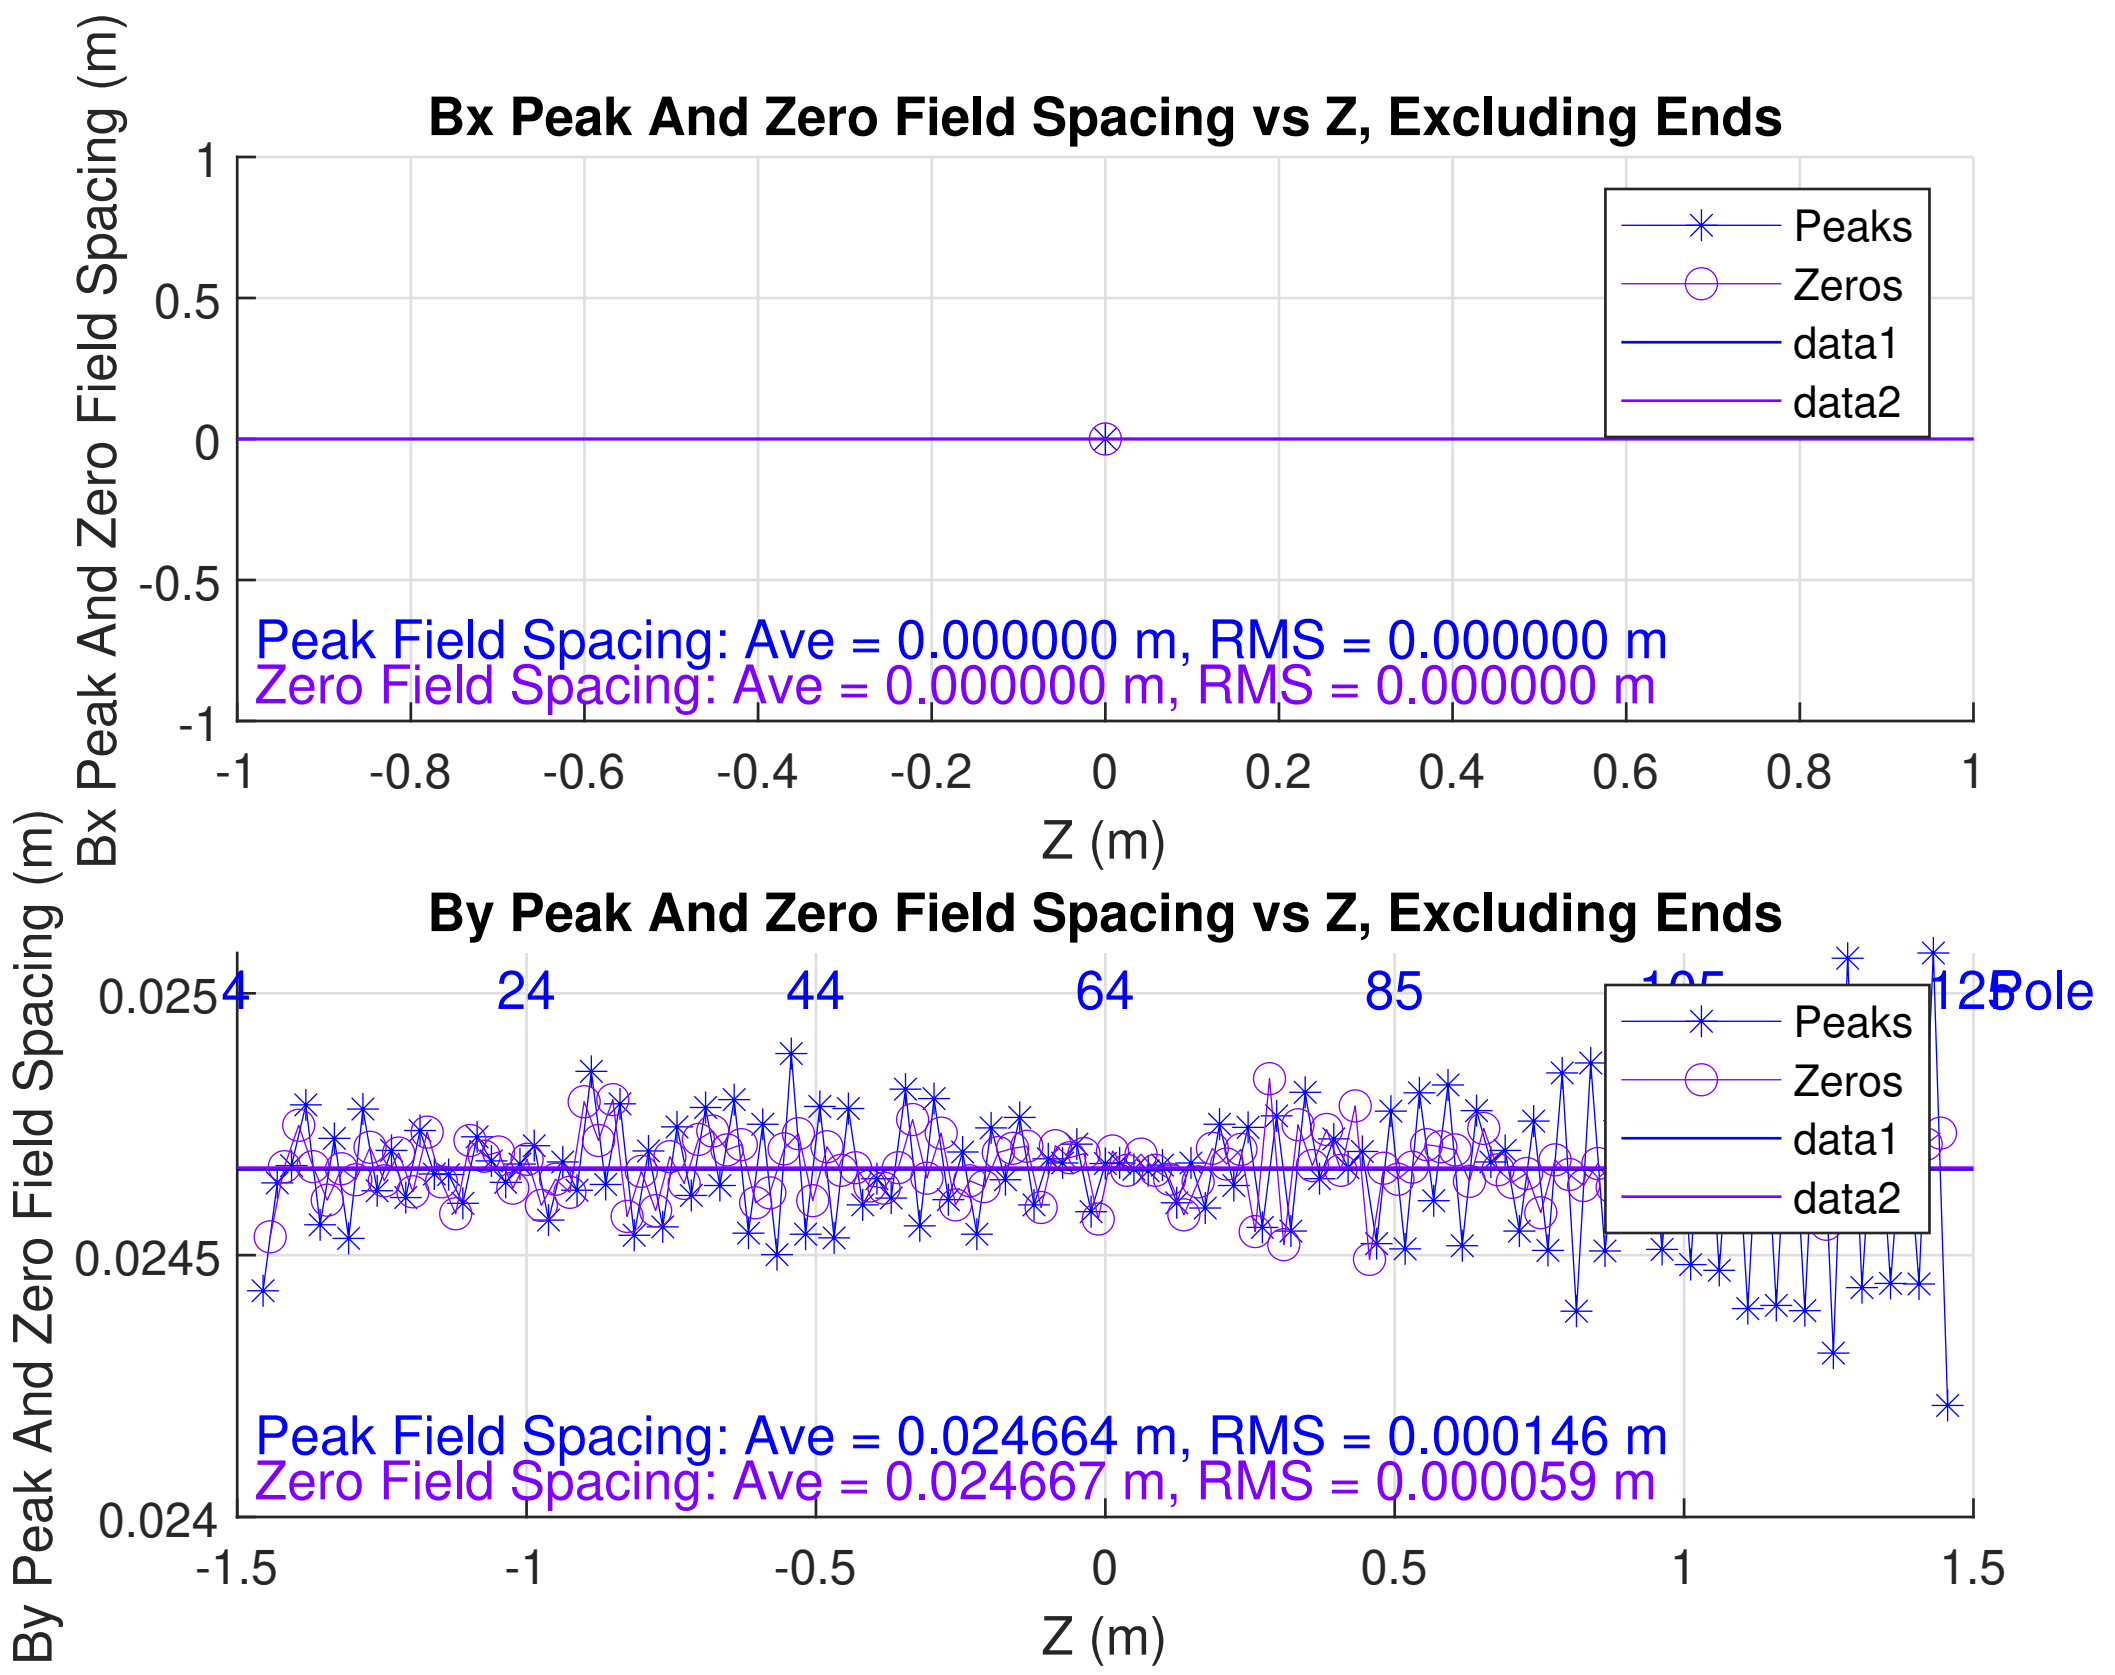
Bx Peak And Zero Field Spacing vs Z, Excluding Ends
Bx Peak And Zero Field Spacing (m)
1
0.5
0
-0.5
-1
-1
-0.8
-0.6
-0.4
-0.2
0
0.2
0.4
0.6
0.8
1
Z (m)
Peaks
Zeros
data1
data2
Peak Field Spacing: Ave = 0.000000 m, RMS = 0.000000 m
Zero Field Spacing: Ave = 0.000000 m, RMS = 0.000000 m
By Peak And Zero Field Spacing vs Z, Excluding Ends
By Peak And Zero Field Spacing (m)
0.025
0.0245
0.024
-1.5
-1
-0.5
0
0.5
1
1.5
Z (m)
4
24
44
64
85
105
125
Pole
Peaks
Zeros
data1
data2
Peak Field Spacing: Ave = 0.024664 m, RMS = 0.000146 m
Zero Field Spacing: Ave = 0.024667 m, RMS = 0.000059 m

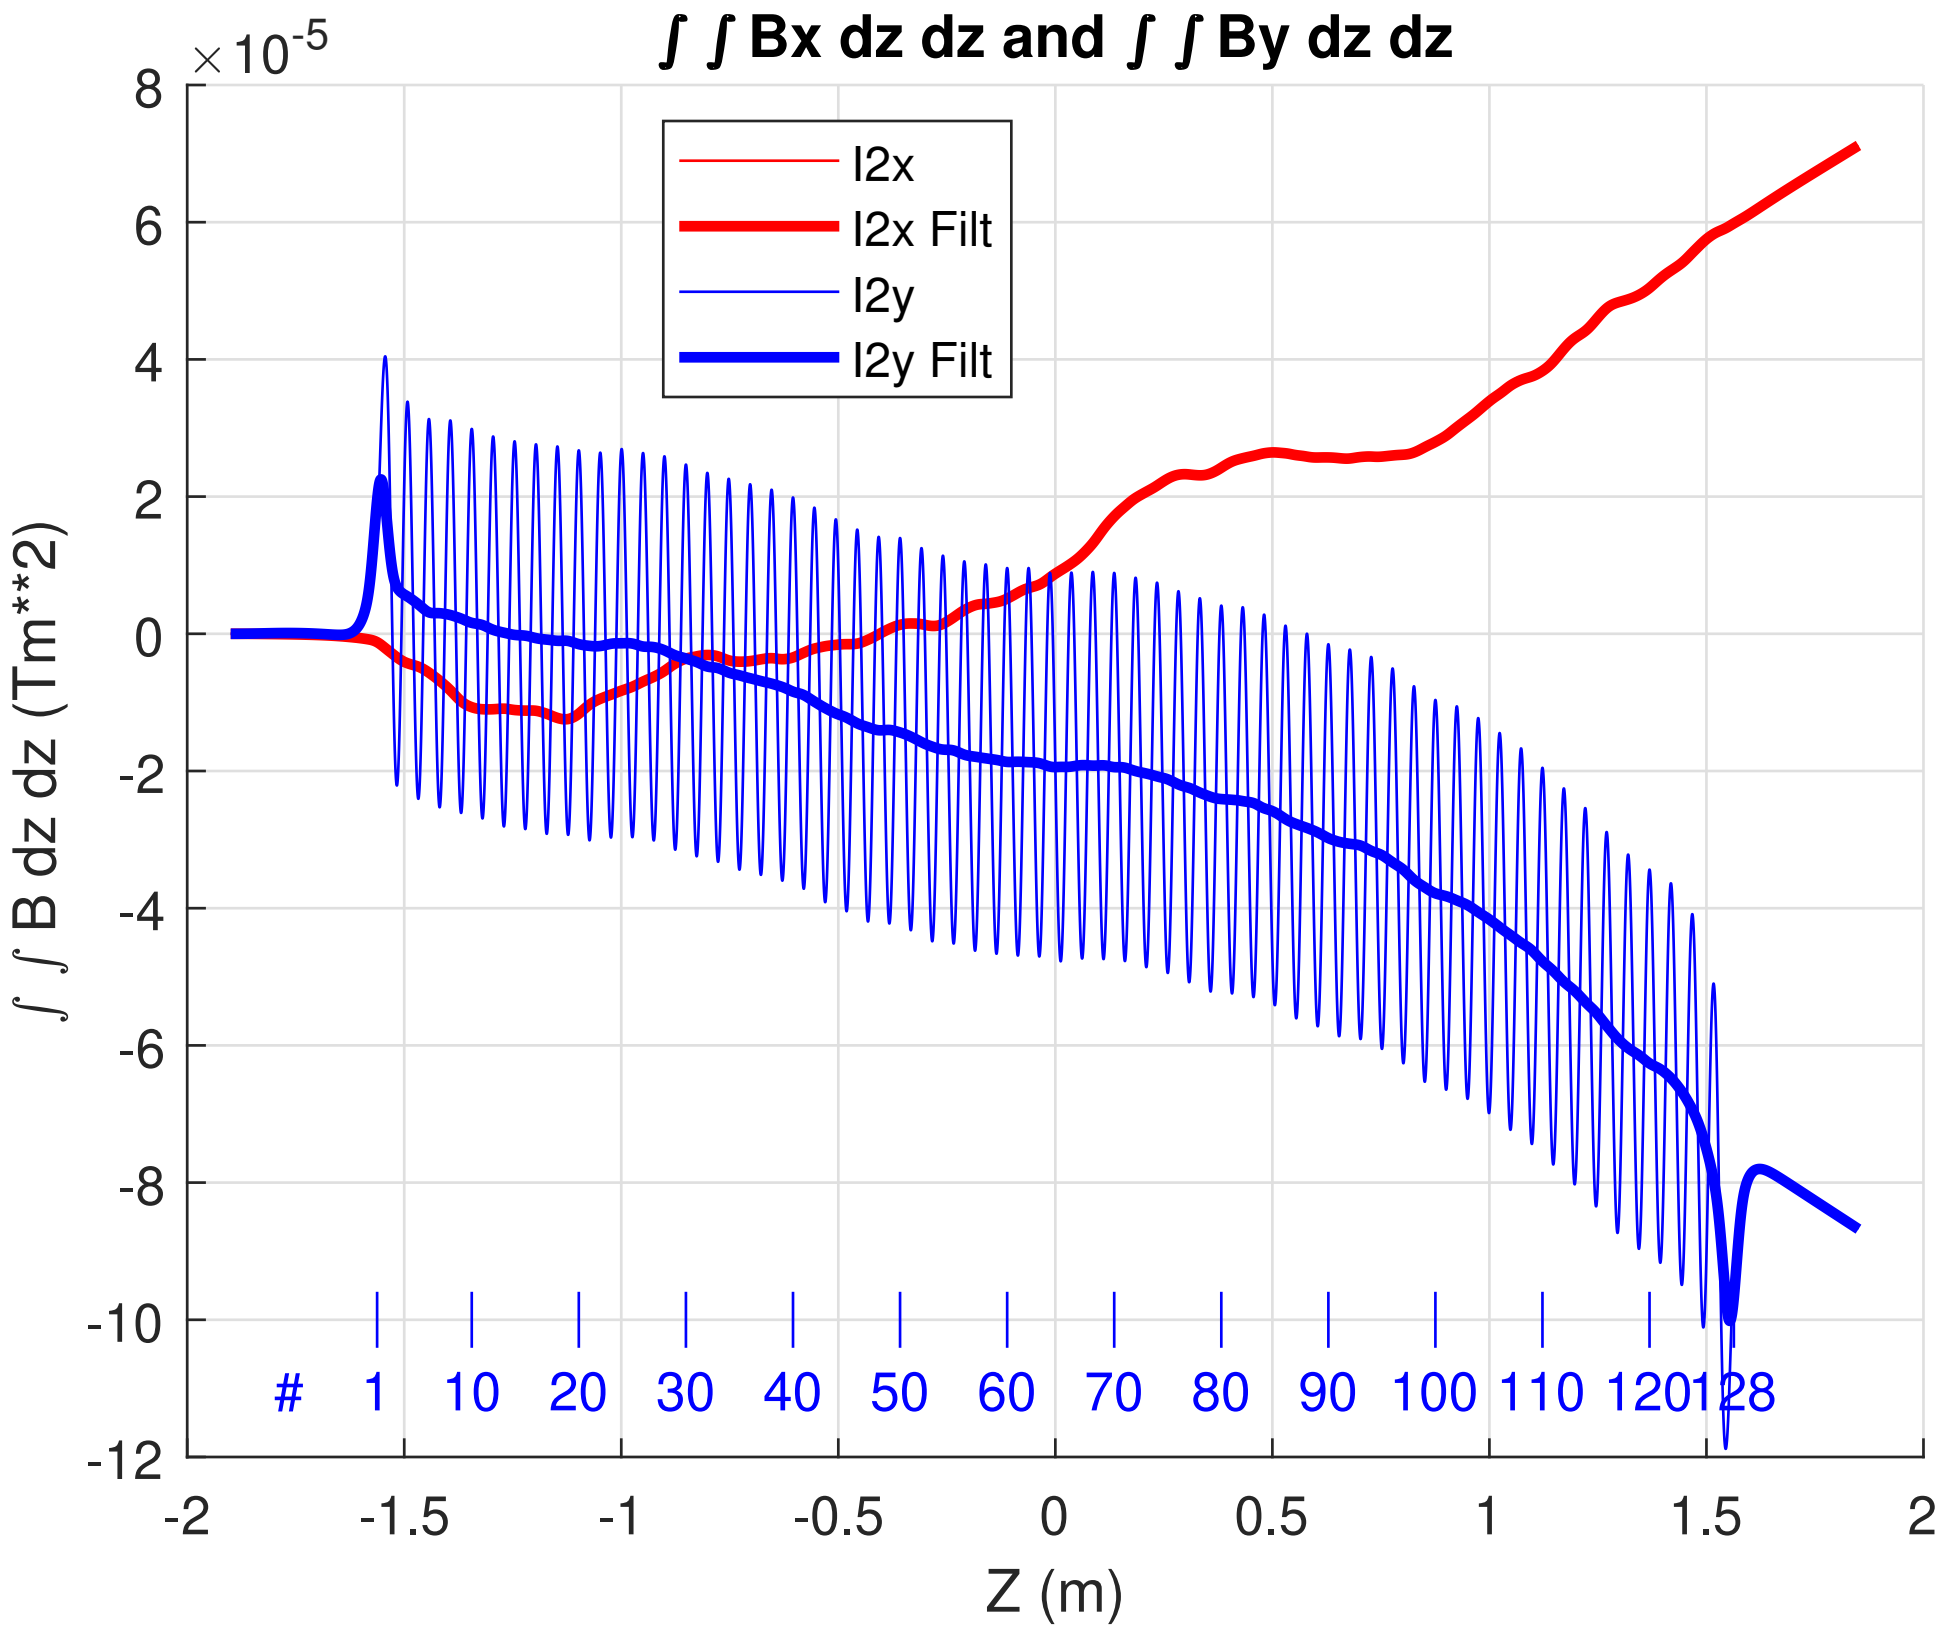
∫ ∫ Bx dz dz and ∫ ∫ By dz dz
×10^-5
I2x
I2x Filt
I2y
I2y Filt
∫ ∫ B dz dz (Tm**2)
8
6
4
2
0
-2
-4
-6
-8
-10
-12
1 10 20 30 40 50 60 70 80 90 100 110 120 128
-2
-1.5
-1
-0.5
0
0.5
1
1.5
2
Z (m)

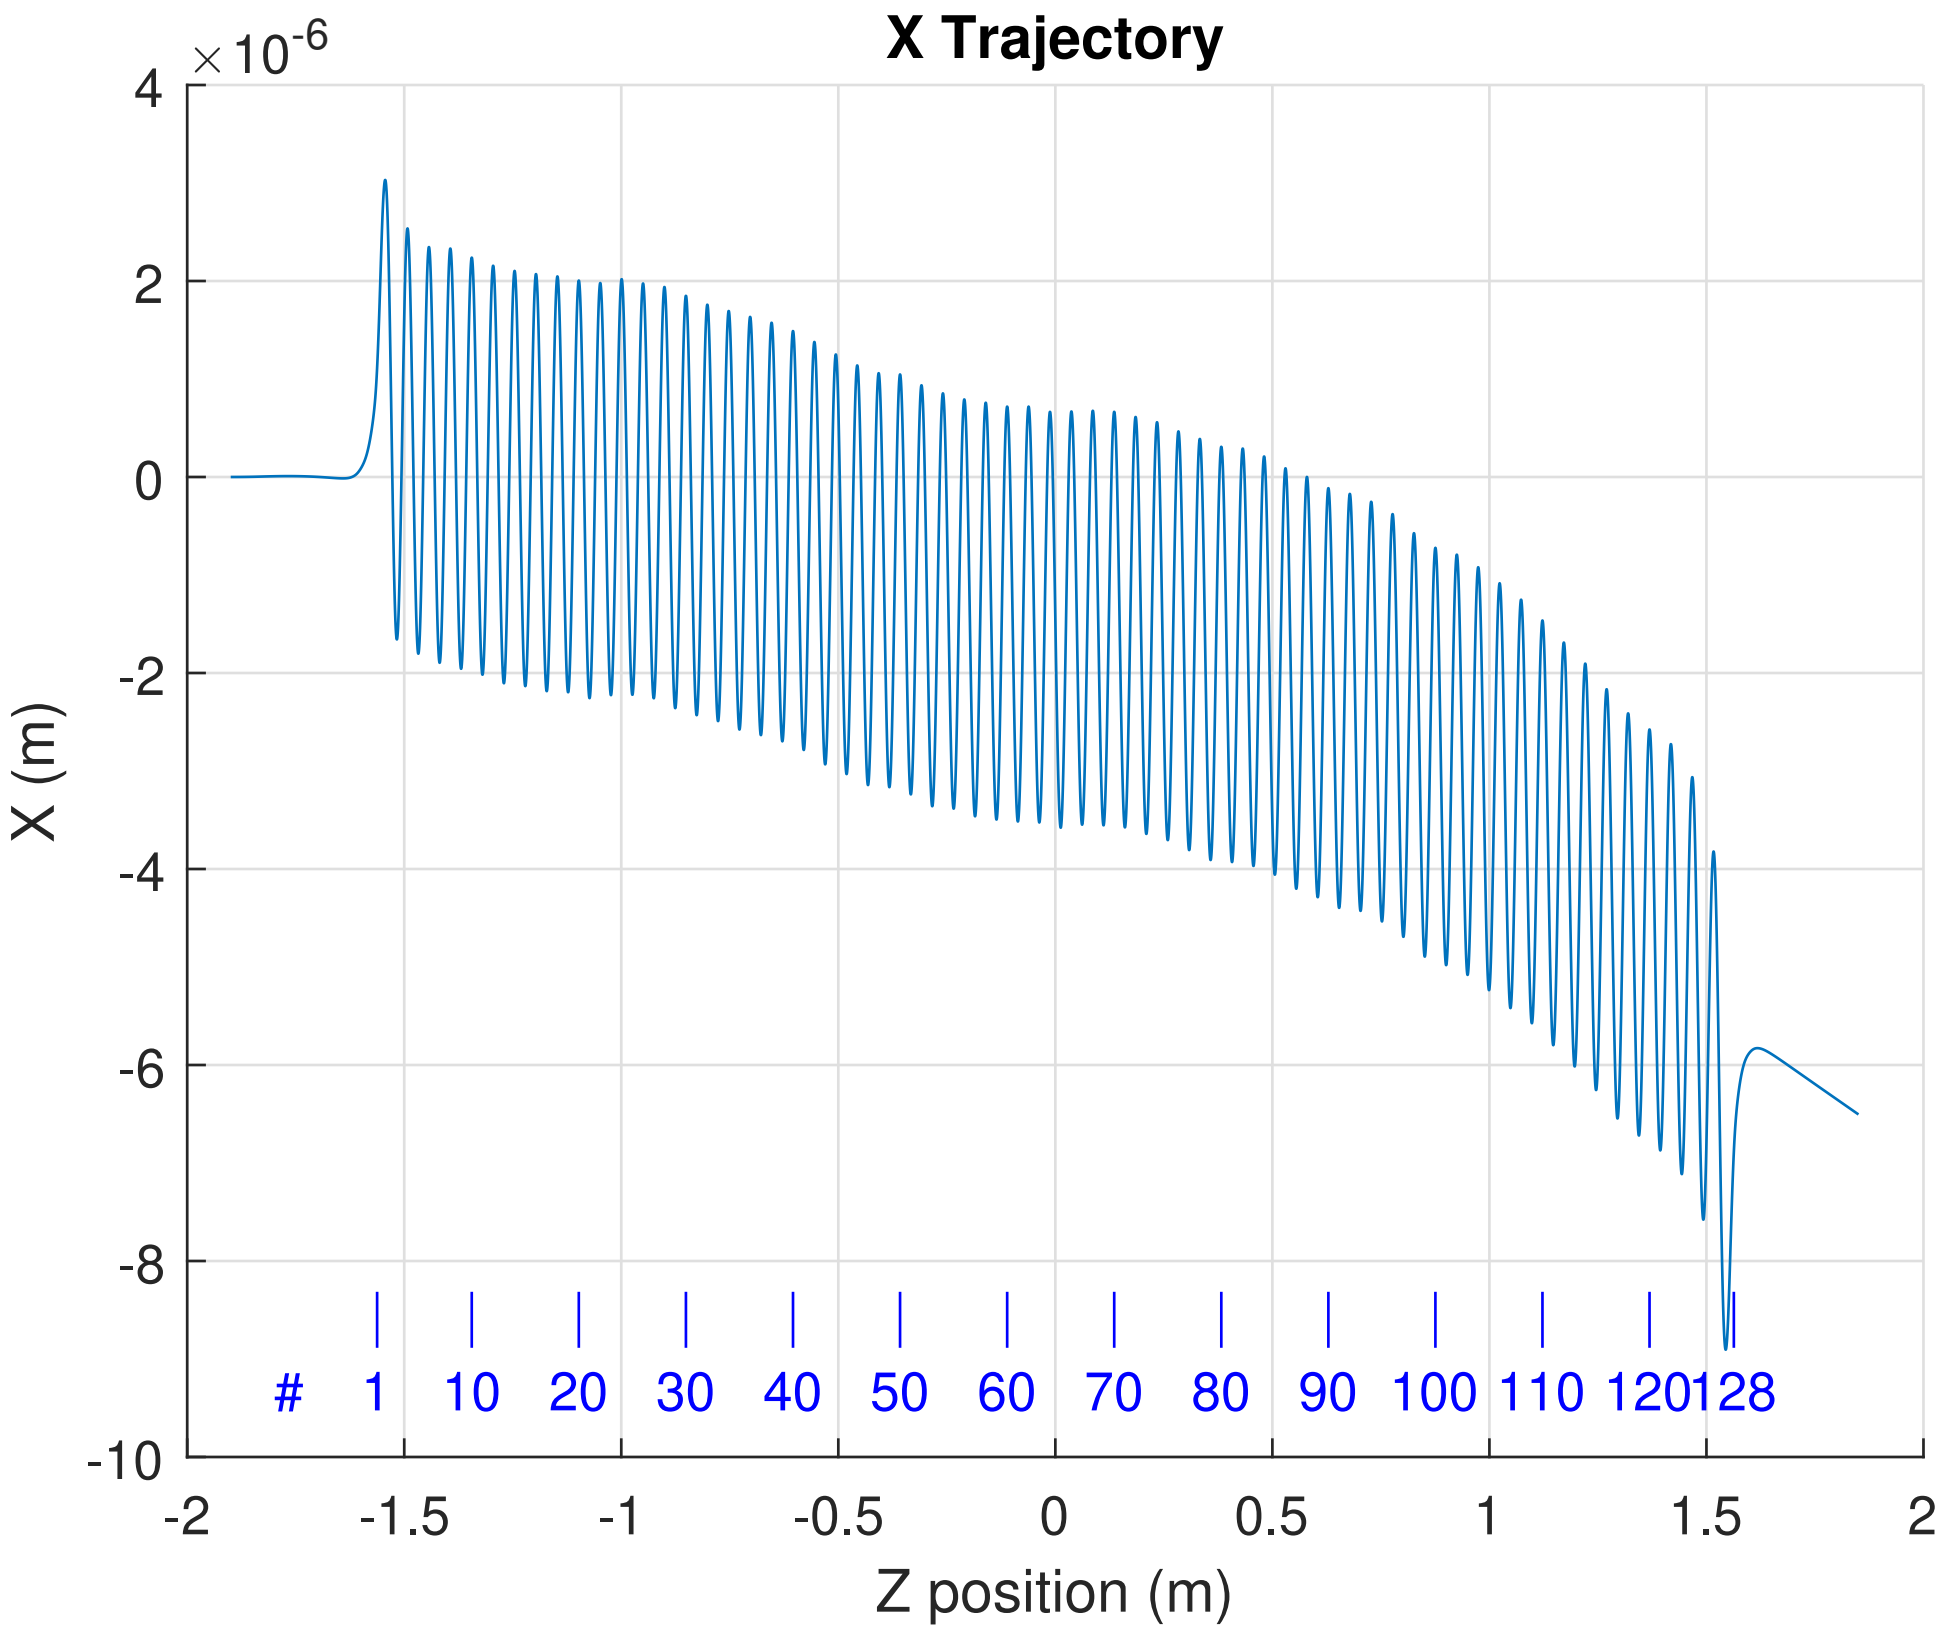
X Trajectory
×10^-6
4
2
0
-2
-4
-6
-8
-10
X (m)
-2
-1.5
-1
-0.5
0
0.5
1
1.5
2
Z position (m)
#
1
10
20
30
40
50
60
70
80
90
100
110
120
128

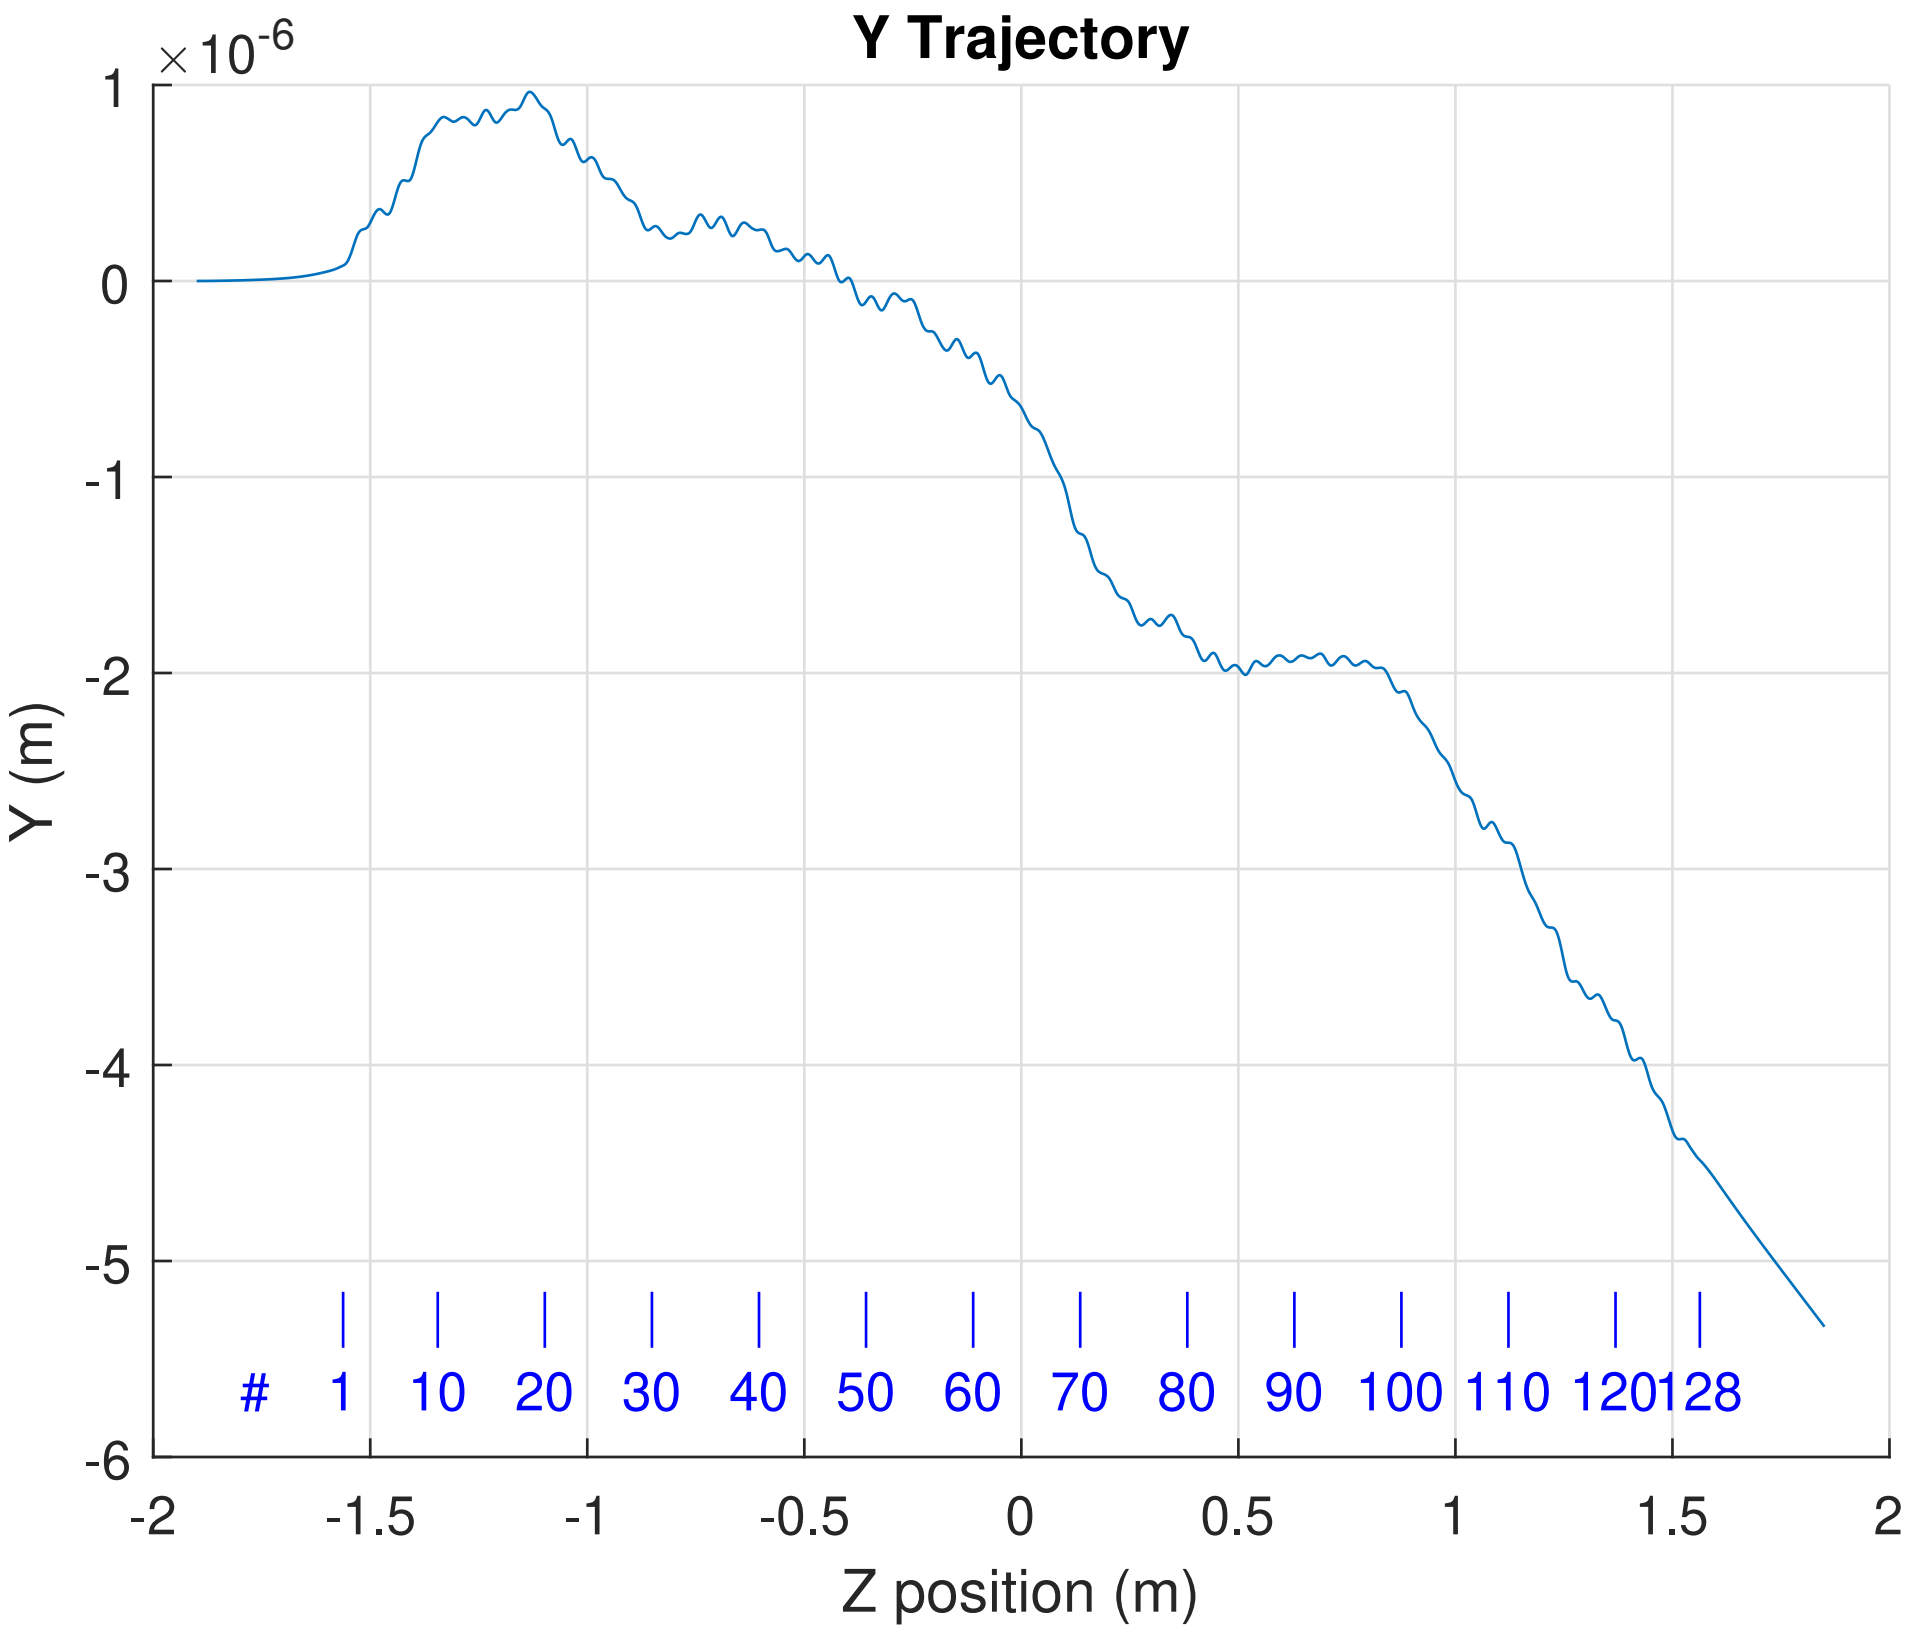
Y Trajectory
×10^-6
1
0
-1
-2
-3
-4
-5
-6
Y (m)
-2
-1.5
-1
-0.5
0
0.5
1
1.5
2
Z position (m)
#
1
10
20
30
40
50
60
70
80
90
100
110
120
128

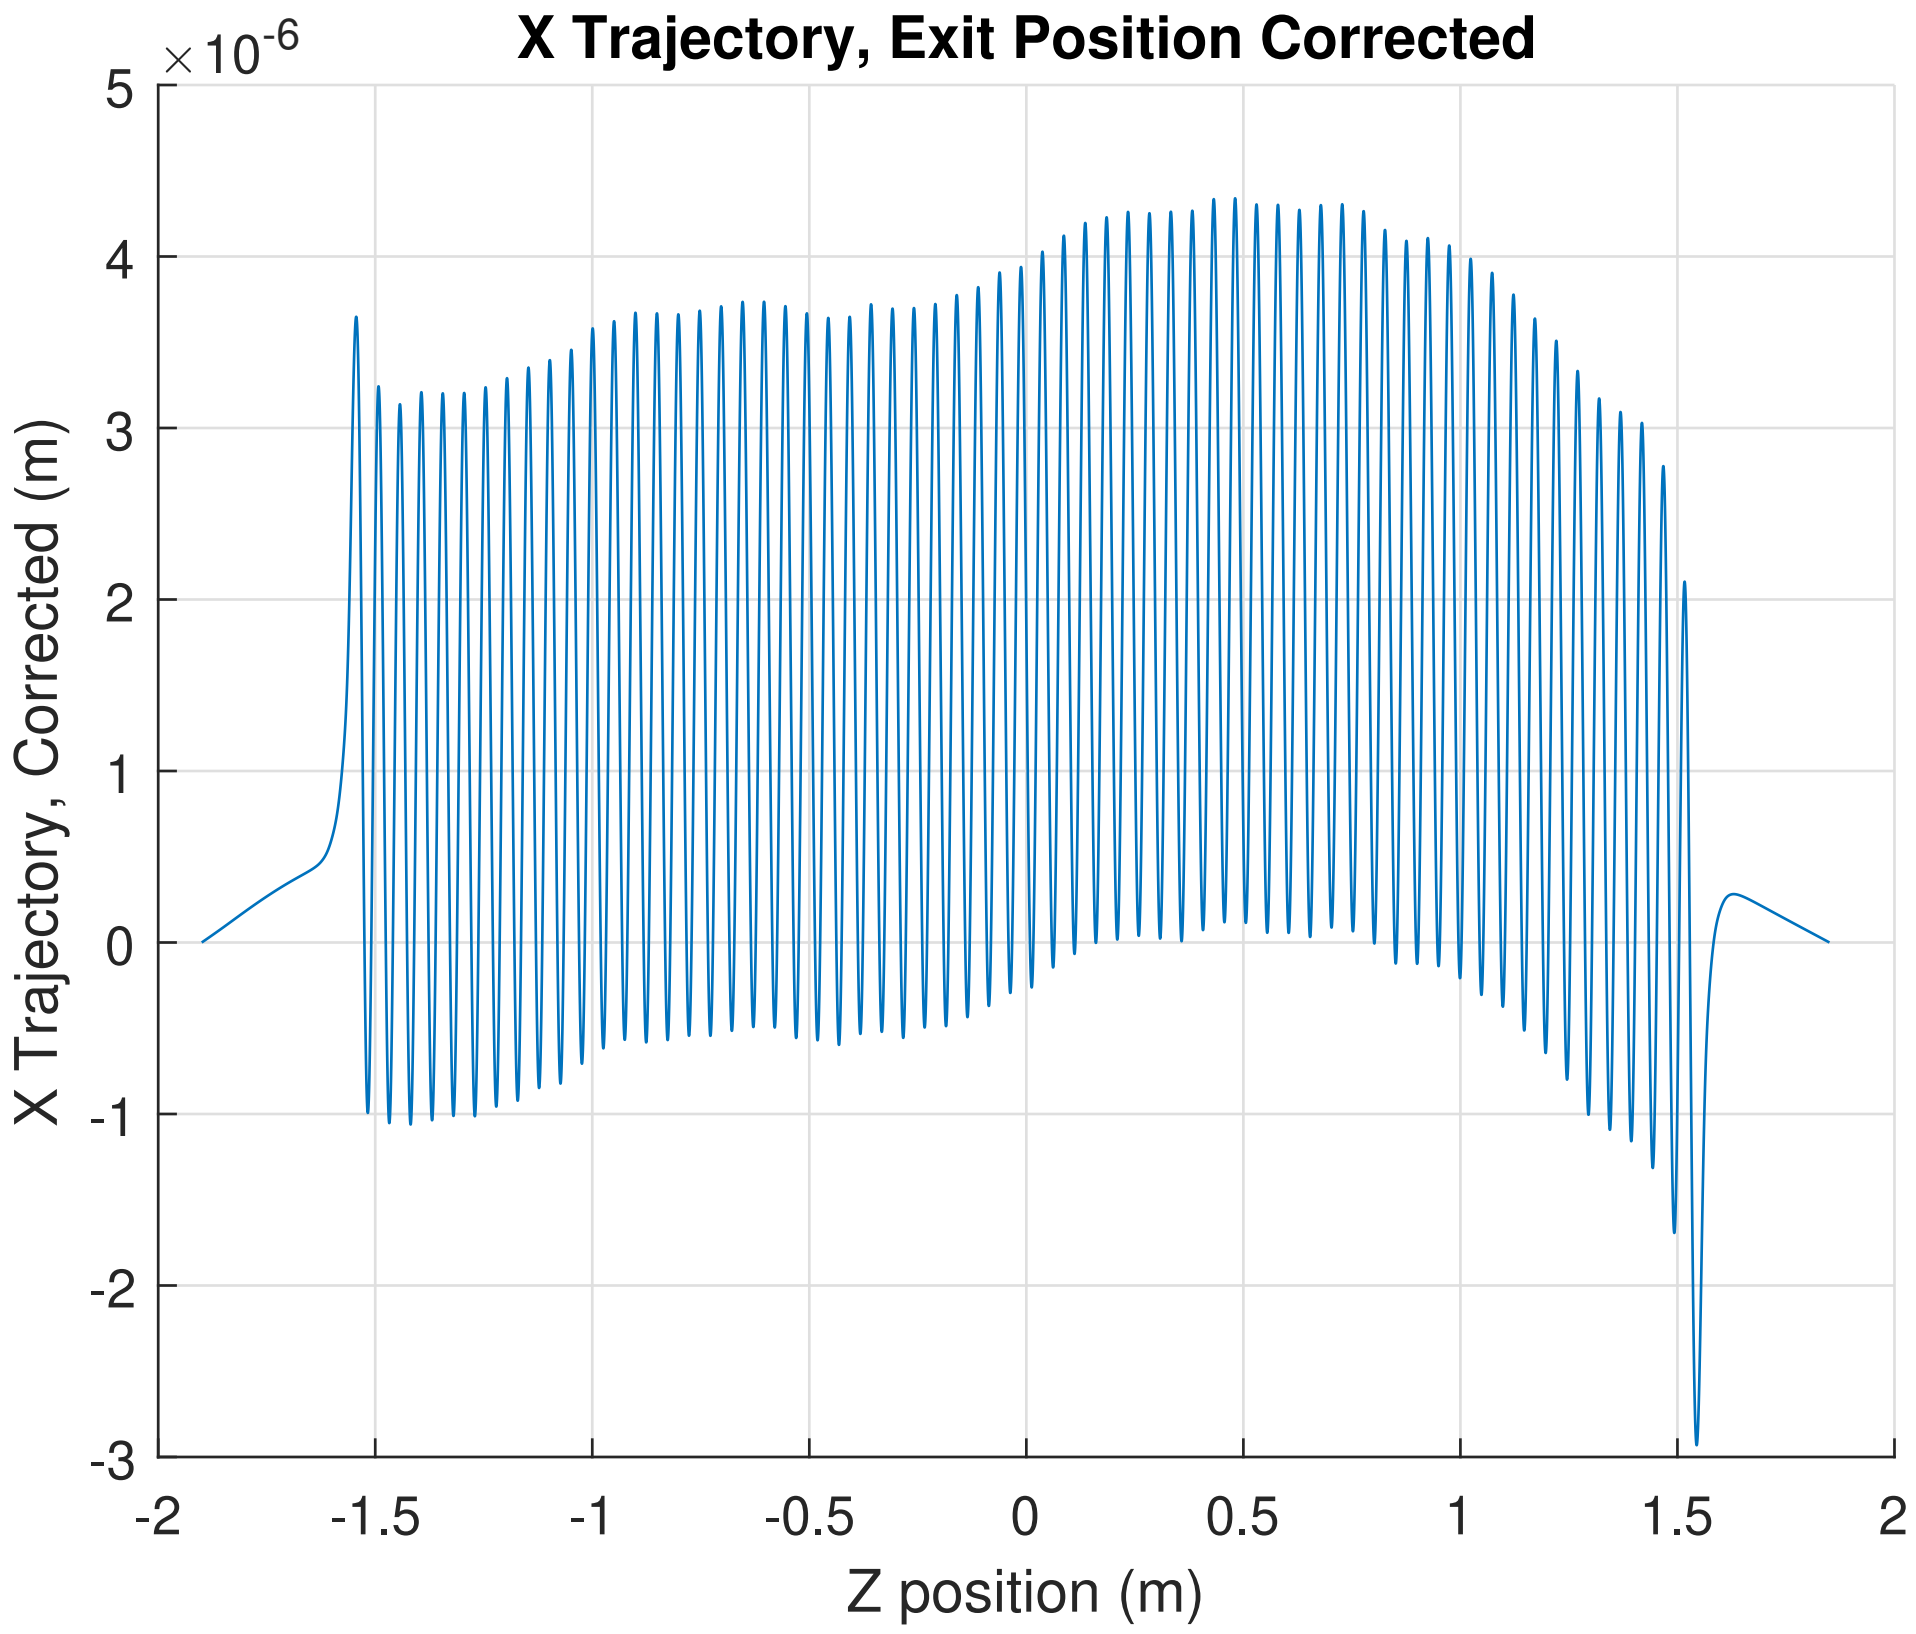
X Trajectory, Exit Position Corrected
×10^-6
5
4
3
2
1
0
-1
-2
-3
X Trajectory, Corrected (m)
-2
-1.5
-1
-0.5
0
0.5
1
1.5
2
Z position (m)


Y Trajectory, Exit Position Corrected
×10^-6
2.5
2
1.5
1
0.5
0
Y Trajectory, Corrected (m)
-2
-1.5
-1
-0.5
0
0.5
1
1.5
2
Z position (m)

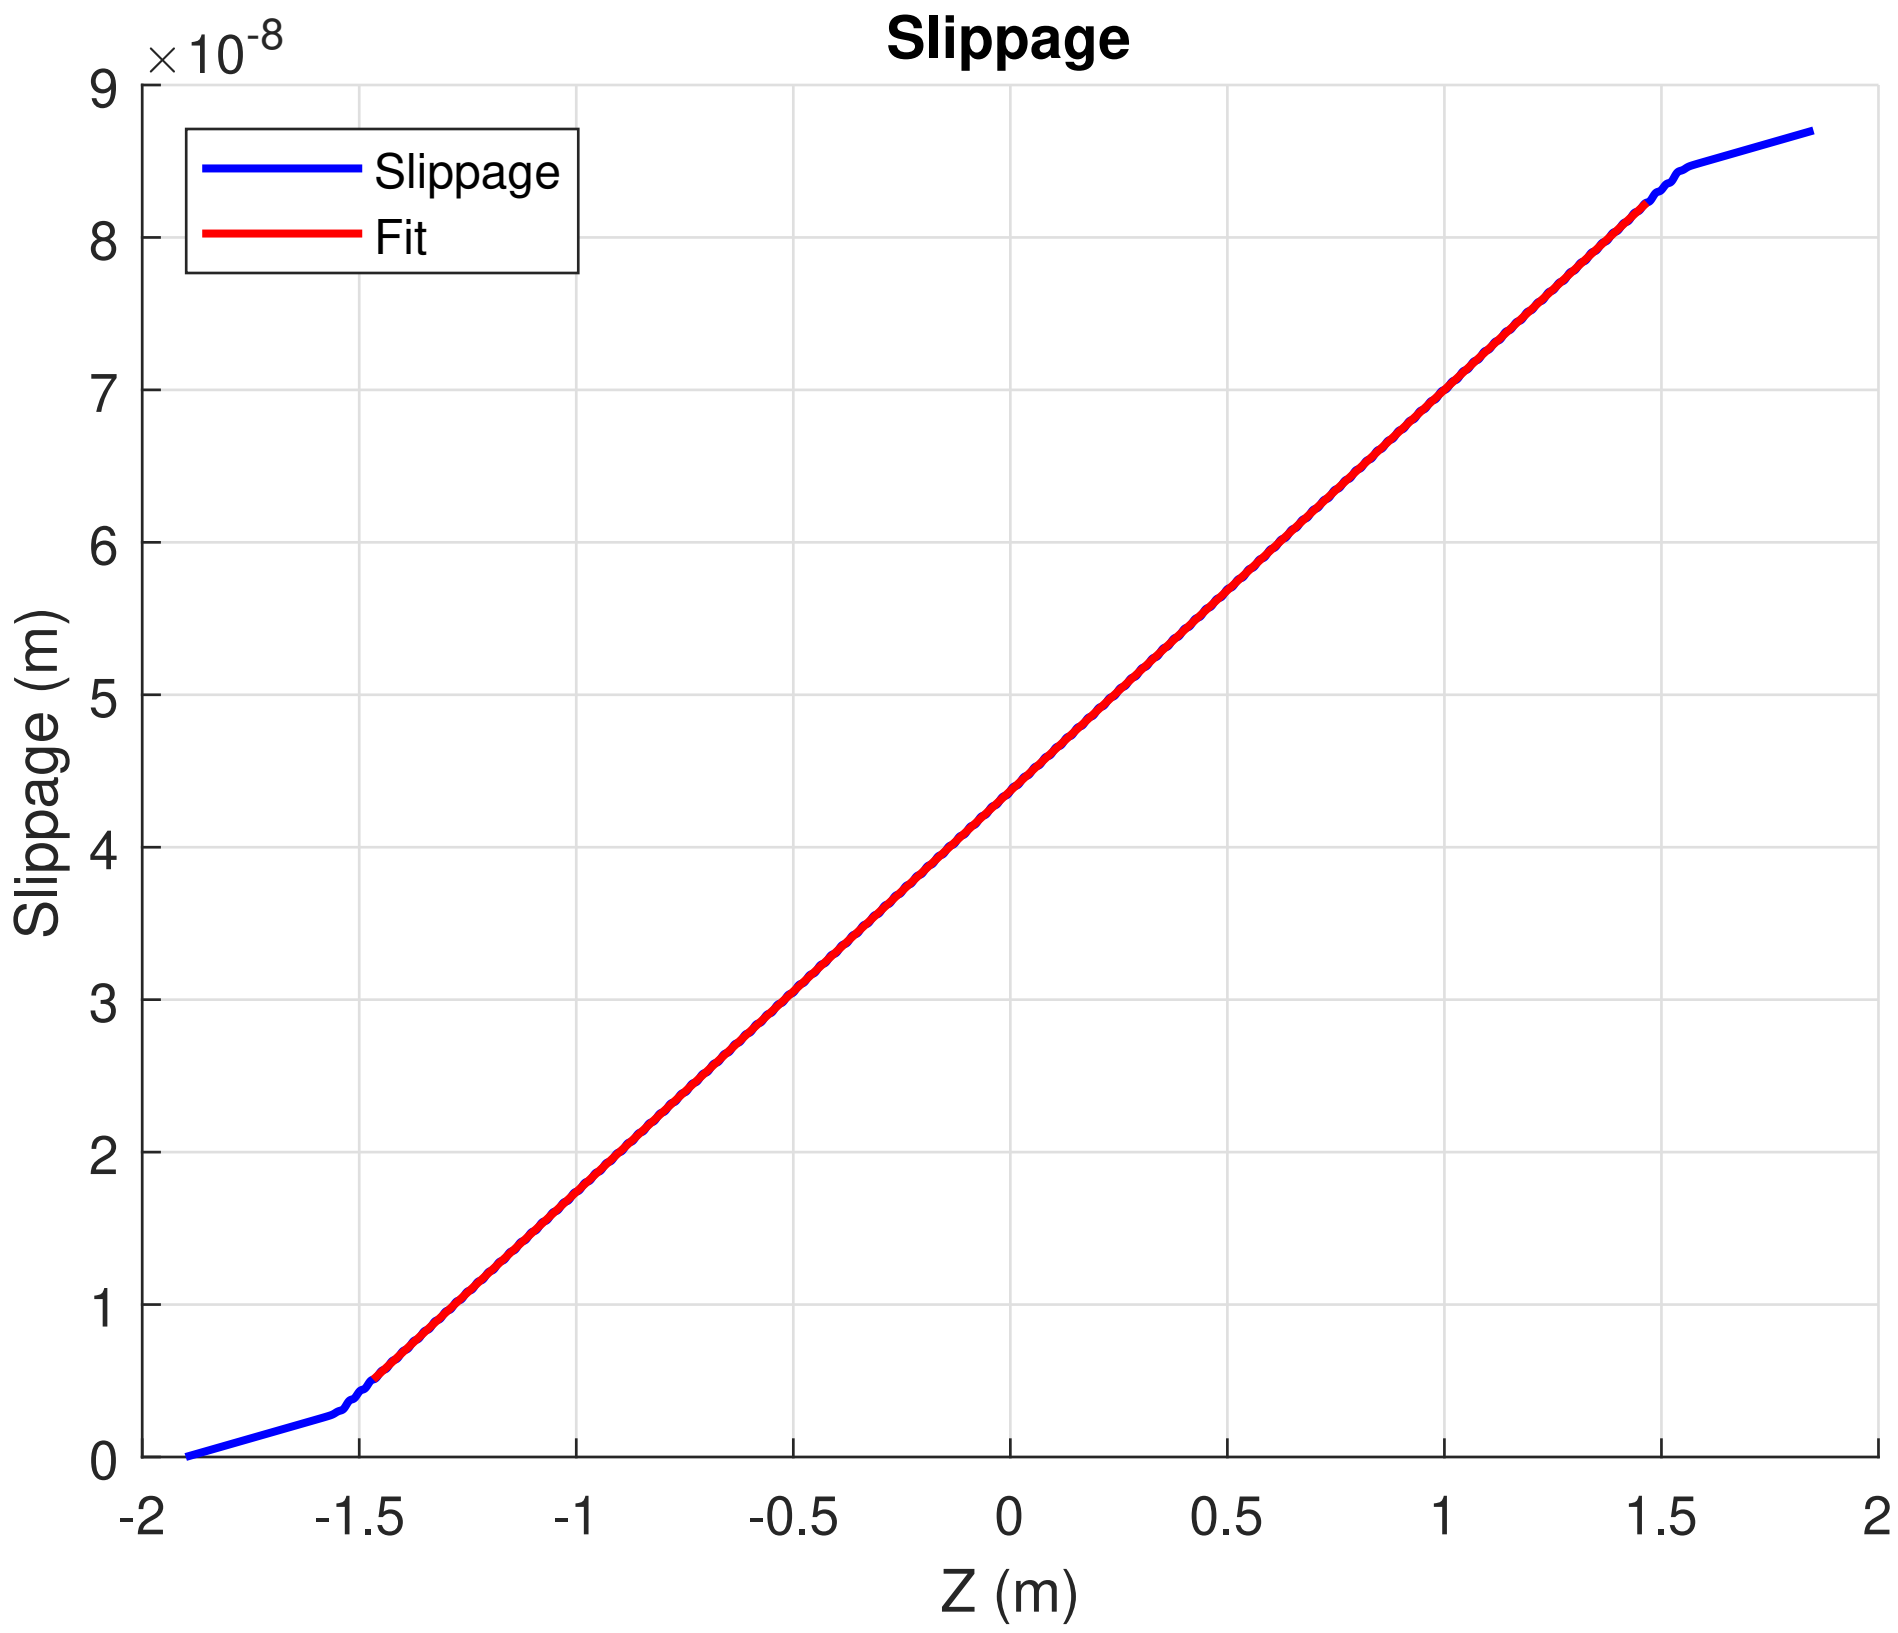
Slippage
×10^-8
Slippage
Fit
Slippage (m)
Z (m)
0
1
2
3
4
5
6
7
8
9
-2
-1.5
-1
-0.5
0
0.5
1
1.5
2

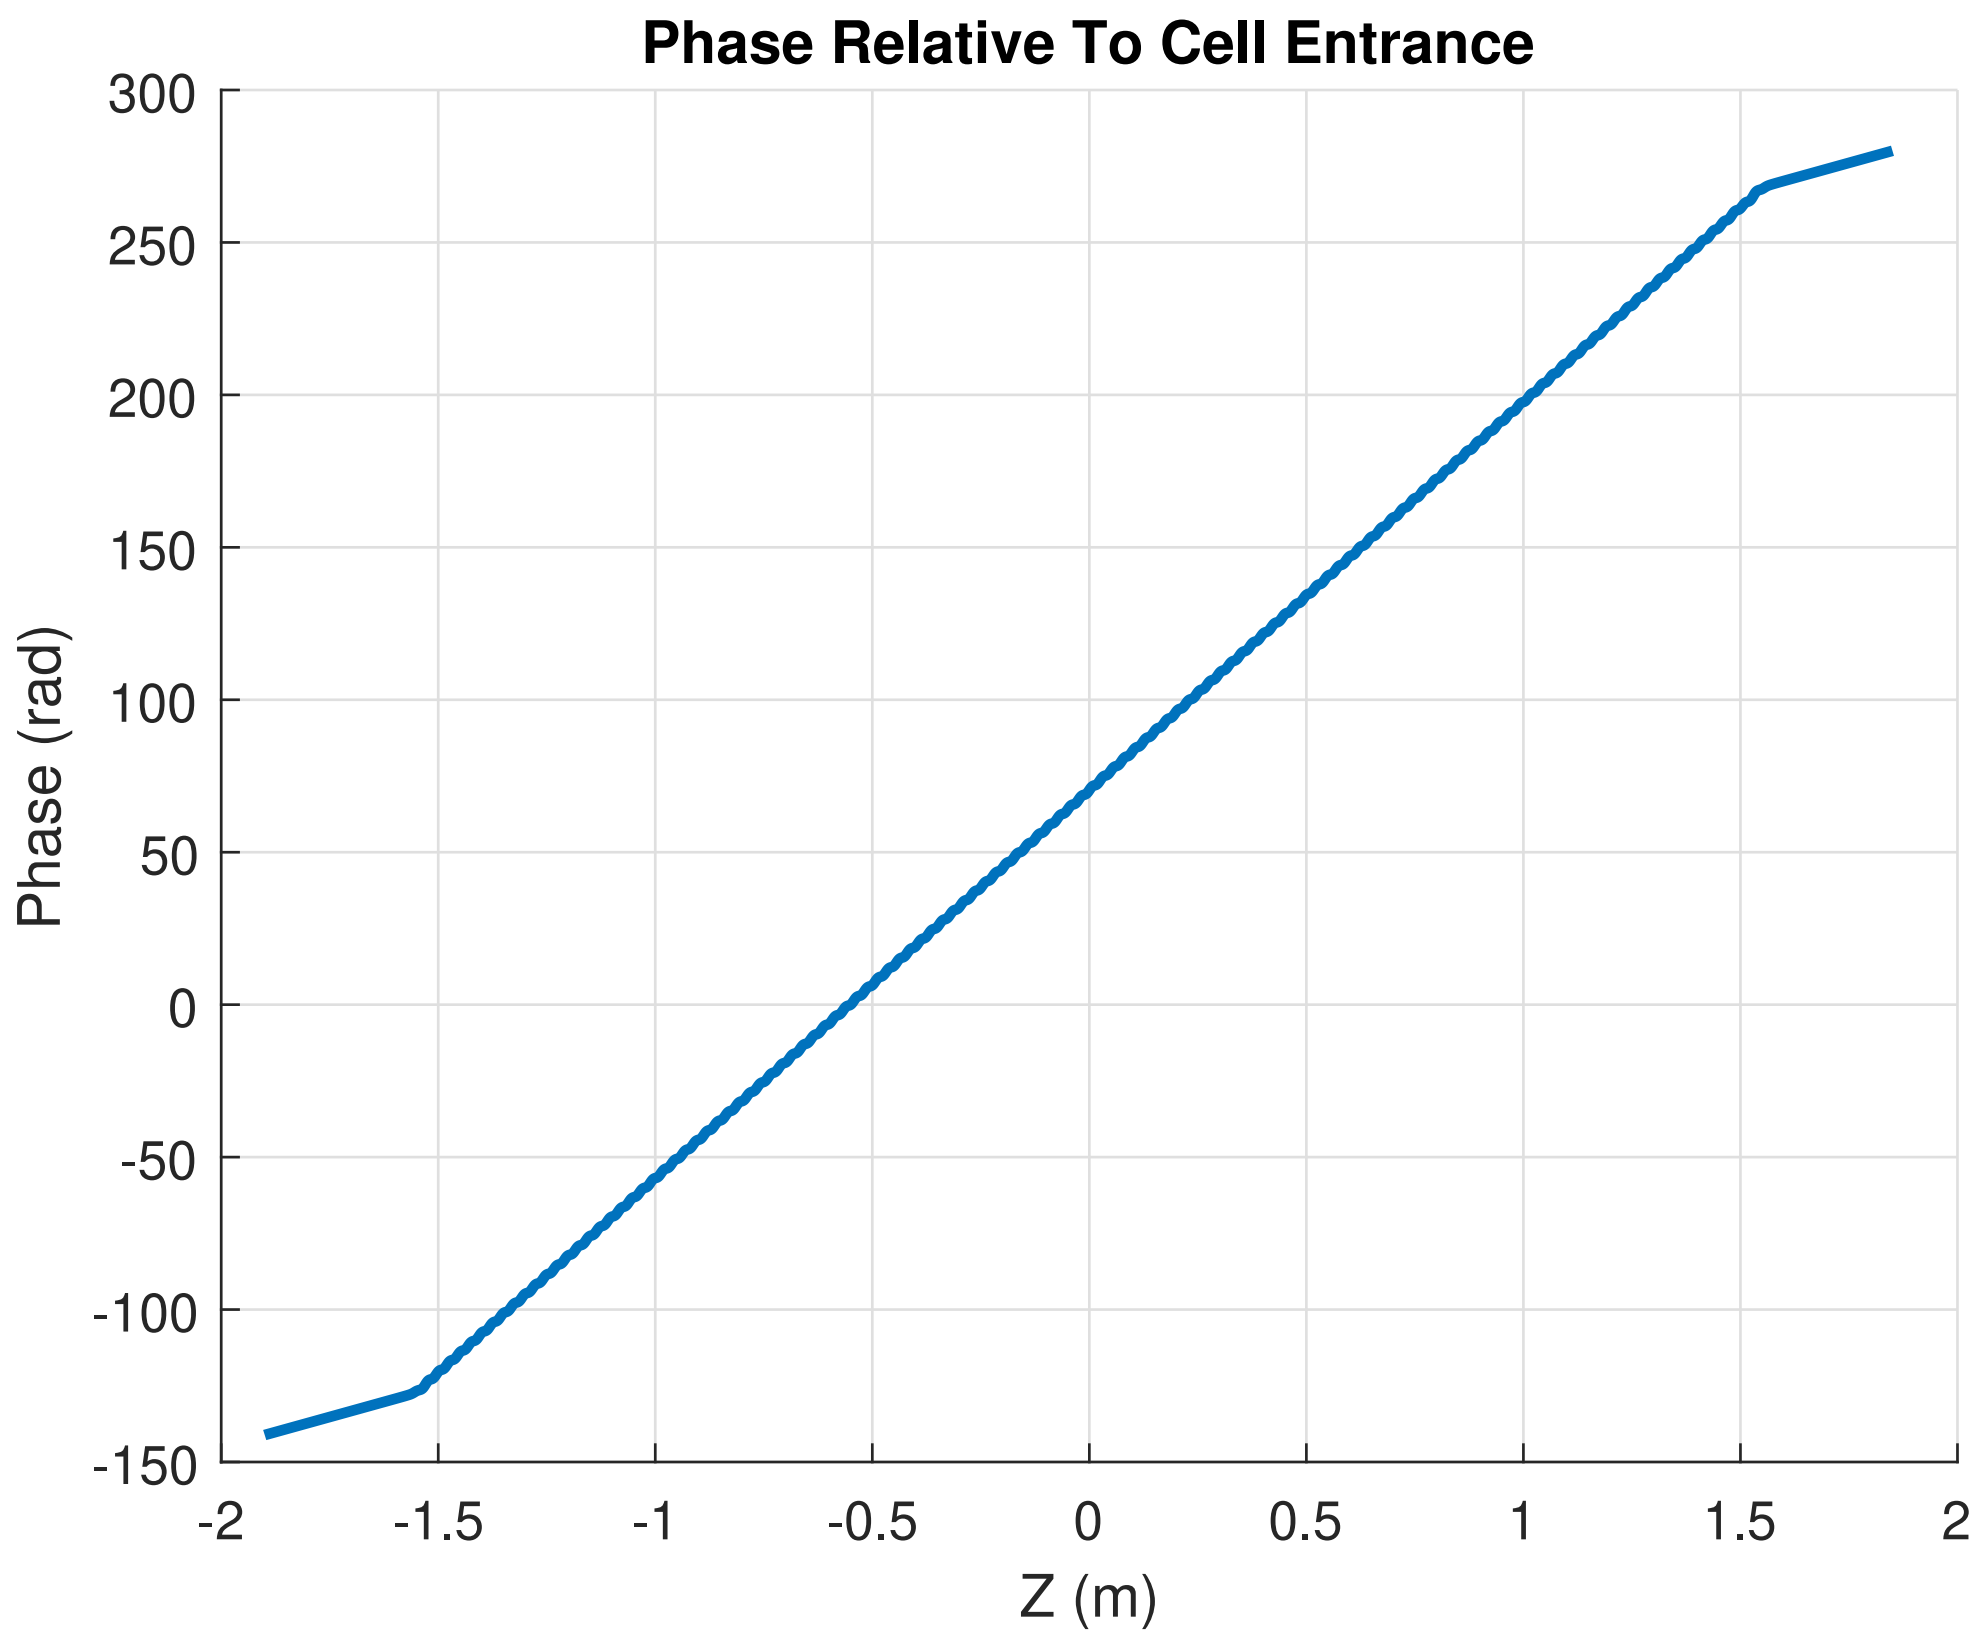
Phase Relative To Cell Entrance
Phase (rad)
300
250
200
150
100
50
0
-50
-100
-150
-2
-1.5
-1
-0.5
0
0.5
1
1.5
2
Z (m)

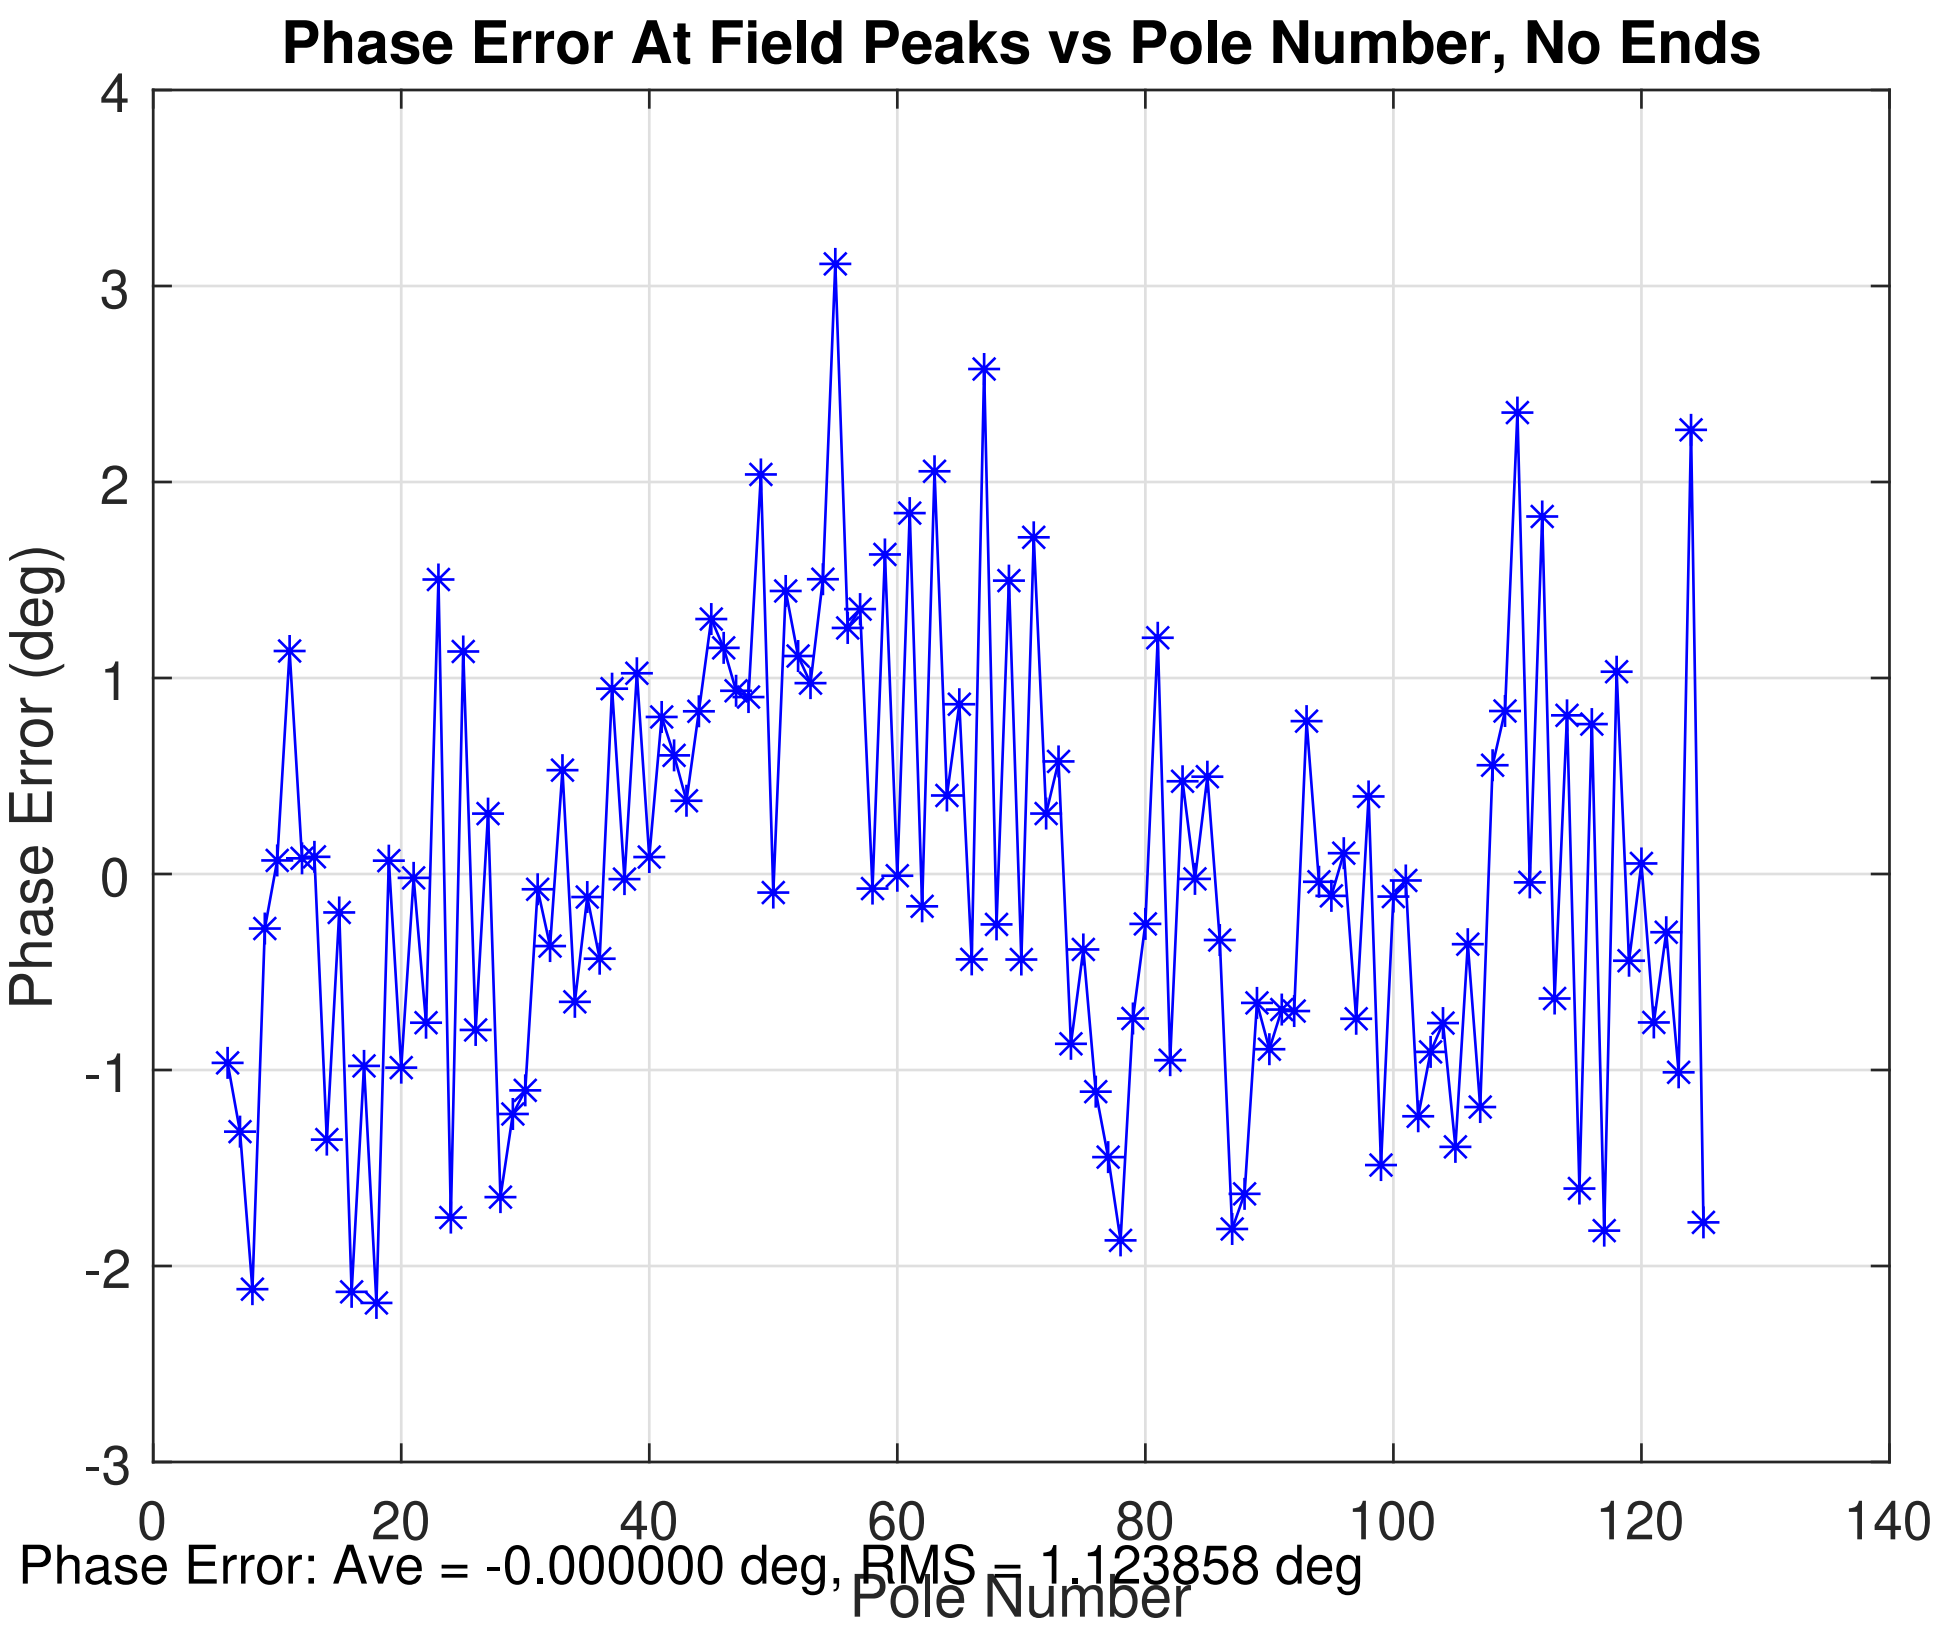

Phase Error: Ave = -0.000000 deg, RMS = 1.123858 deg

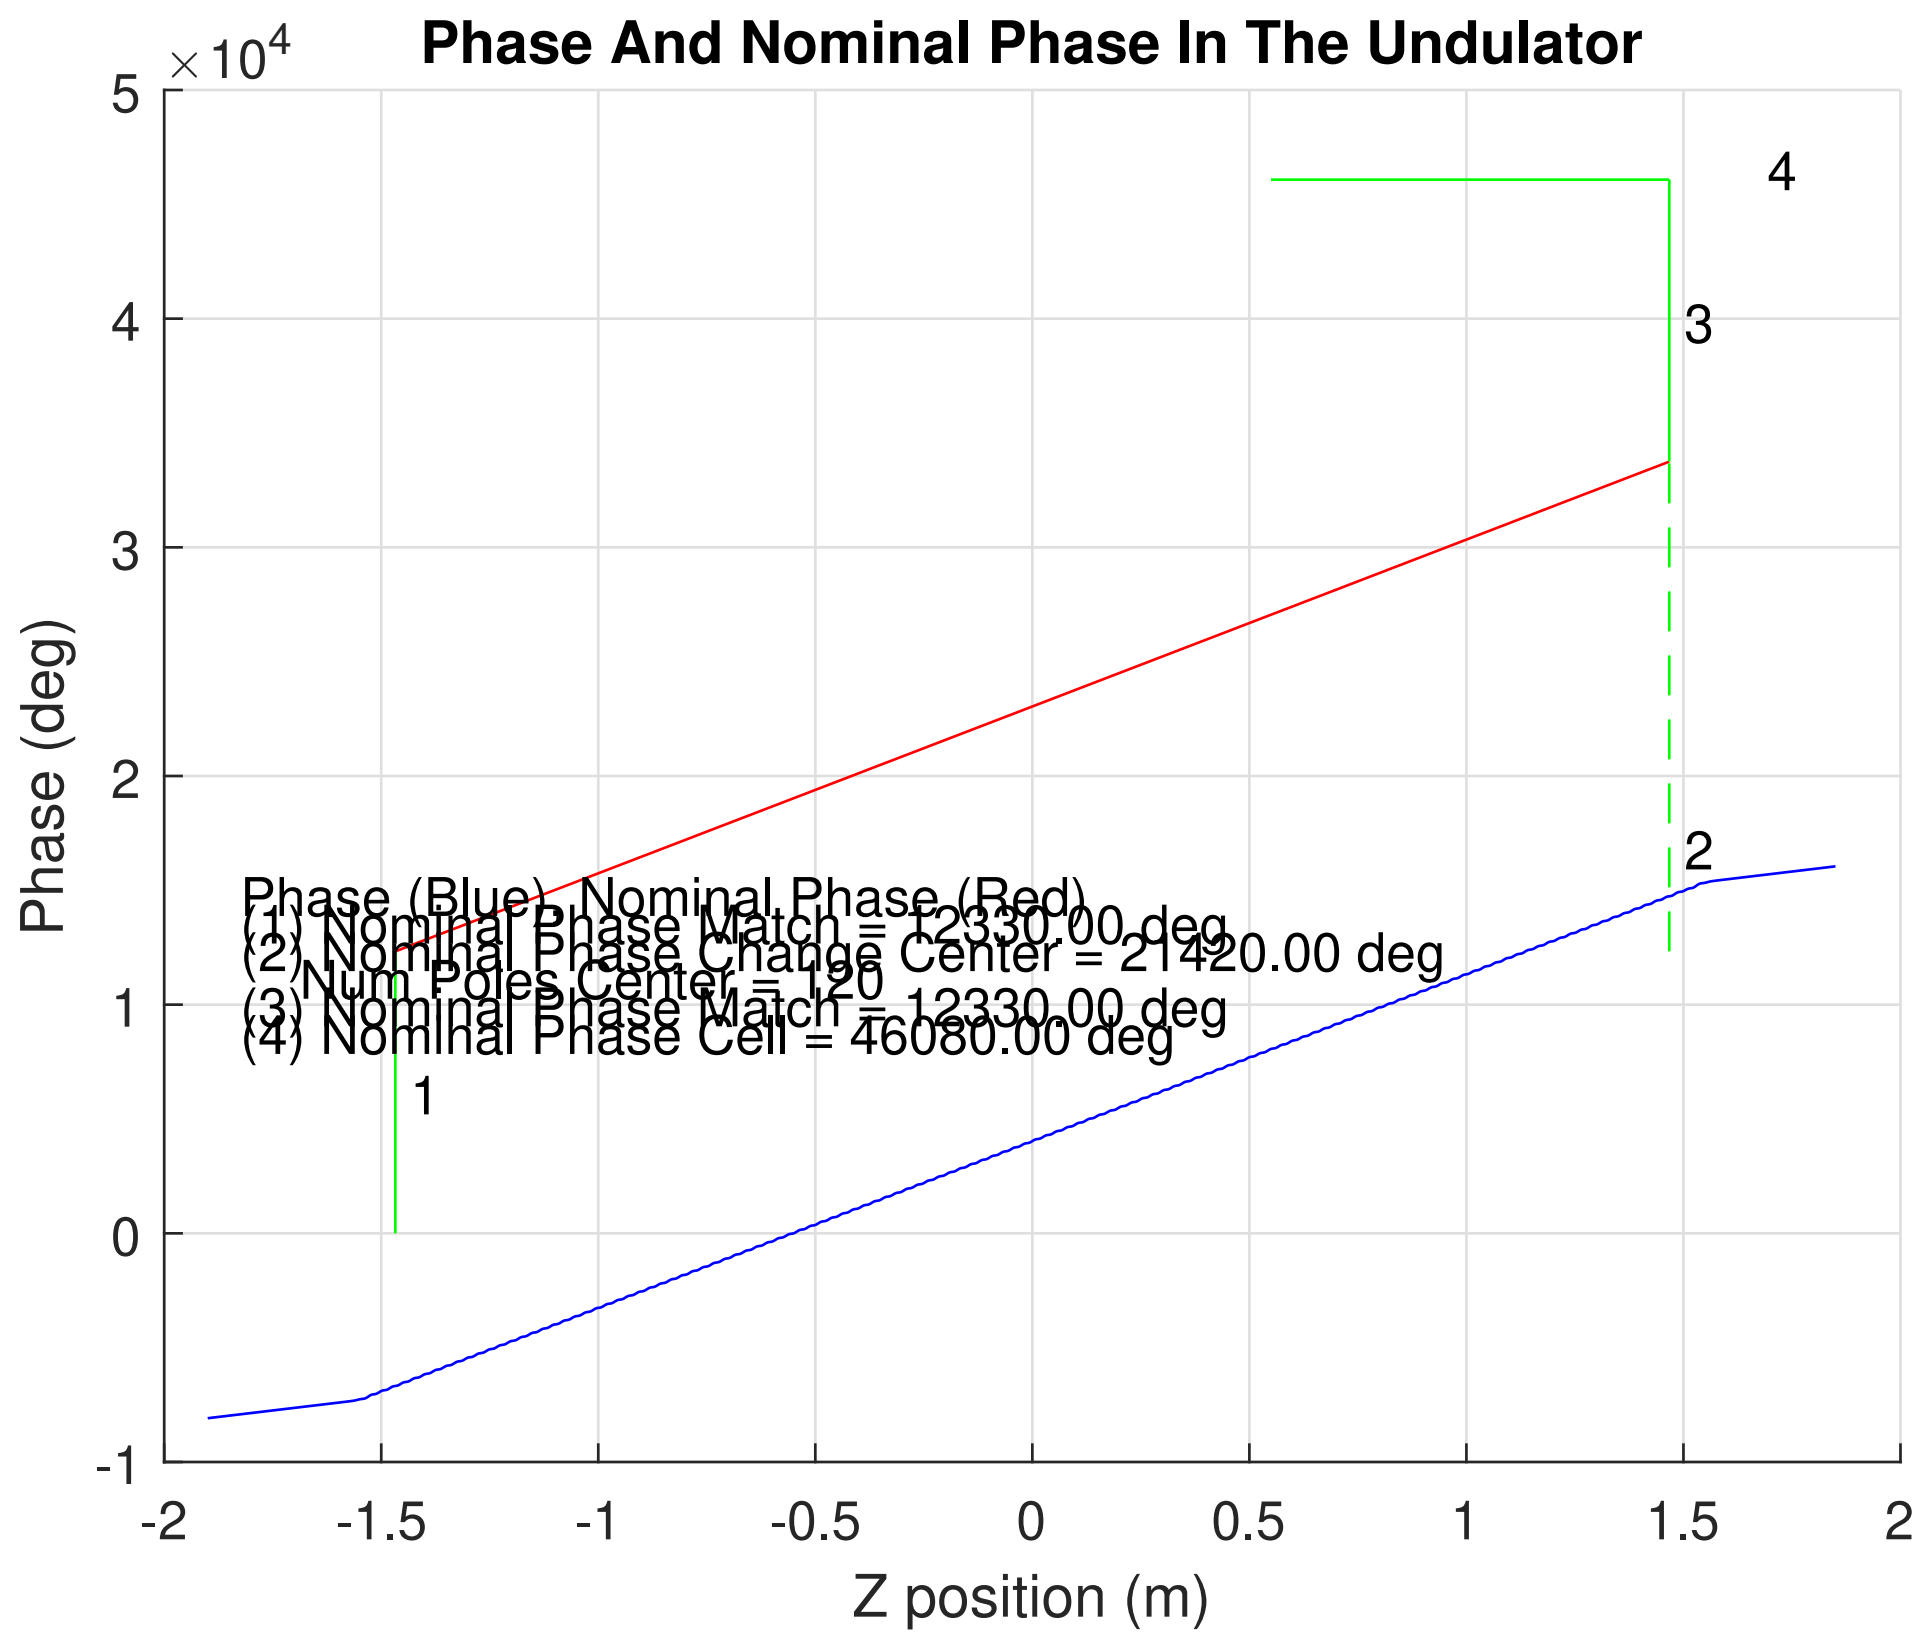
Phase And Nominal Phase In The Undulator
×10^4
5
4
3
2
1
0
-1
Phase (deg)
-2
-1.5
-1
-0.5
0
0.5
1
1.5
2
Z position (m)
4
3
2
1
Phase (Blue), Nominal Phase (Red)
(1) Nominal Phase Match = 12330.00 deg
(2) Nominal Phase Change Center = 21420.00 deg
Num Poles Center = 120
(3) Nominal Phase Match = 12330.00 deg
(4) Nominal Phase Cell = 46080.00 deg

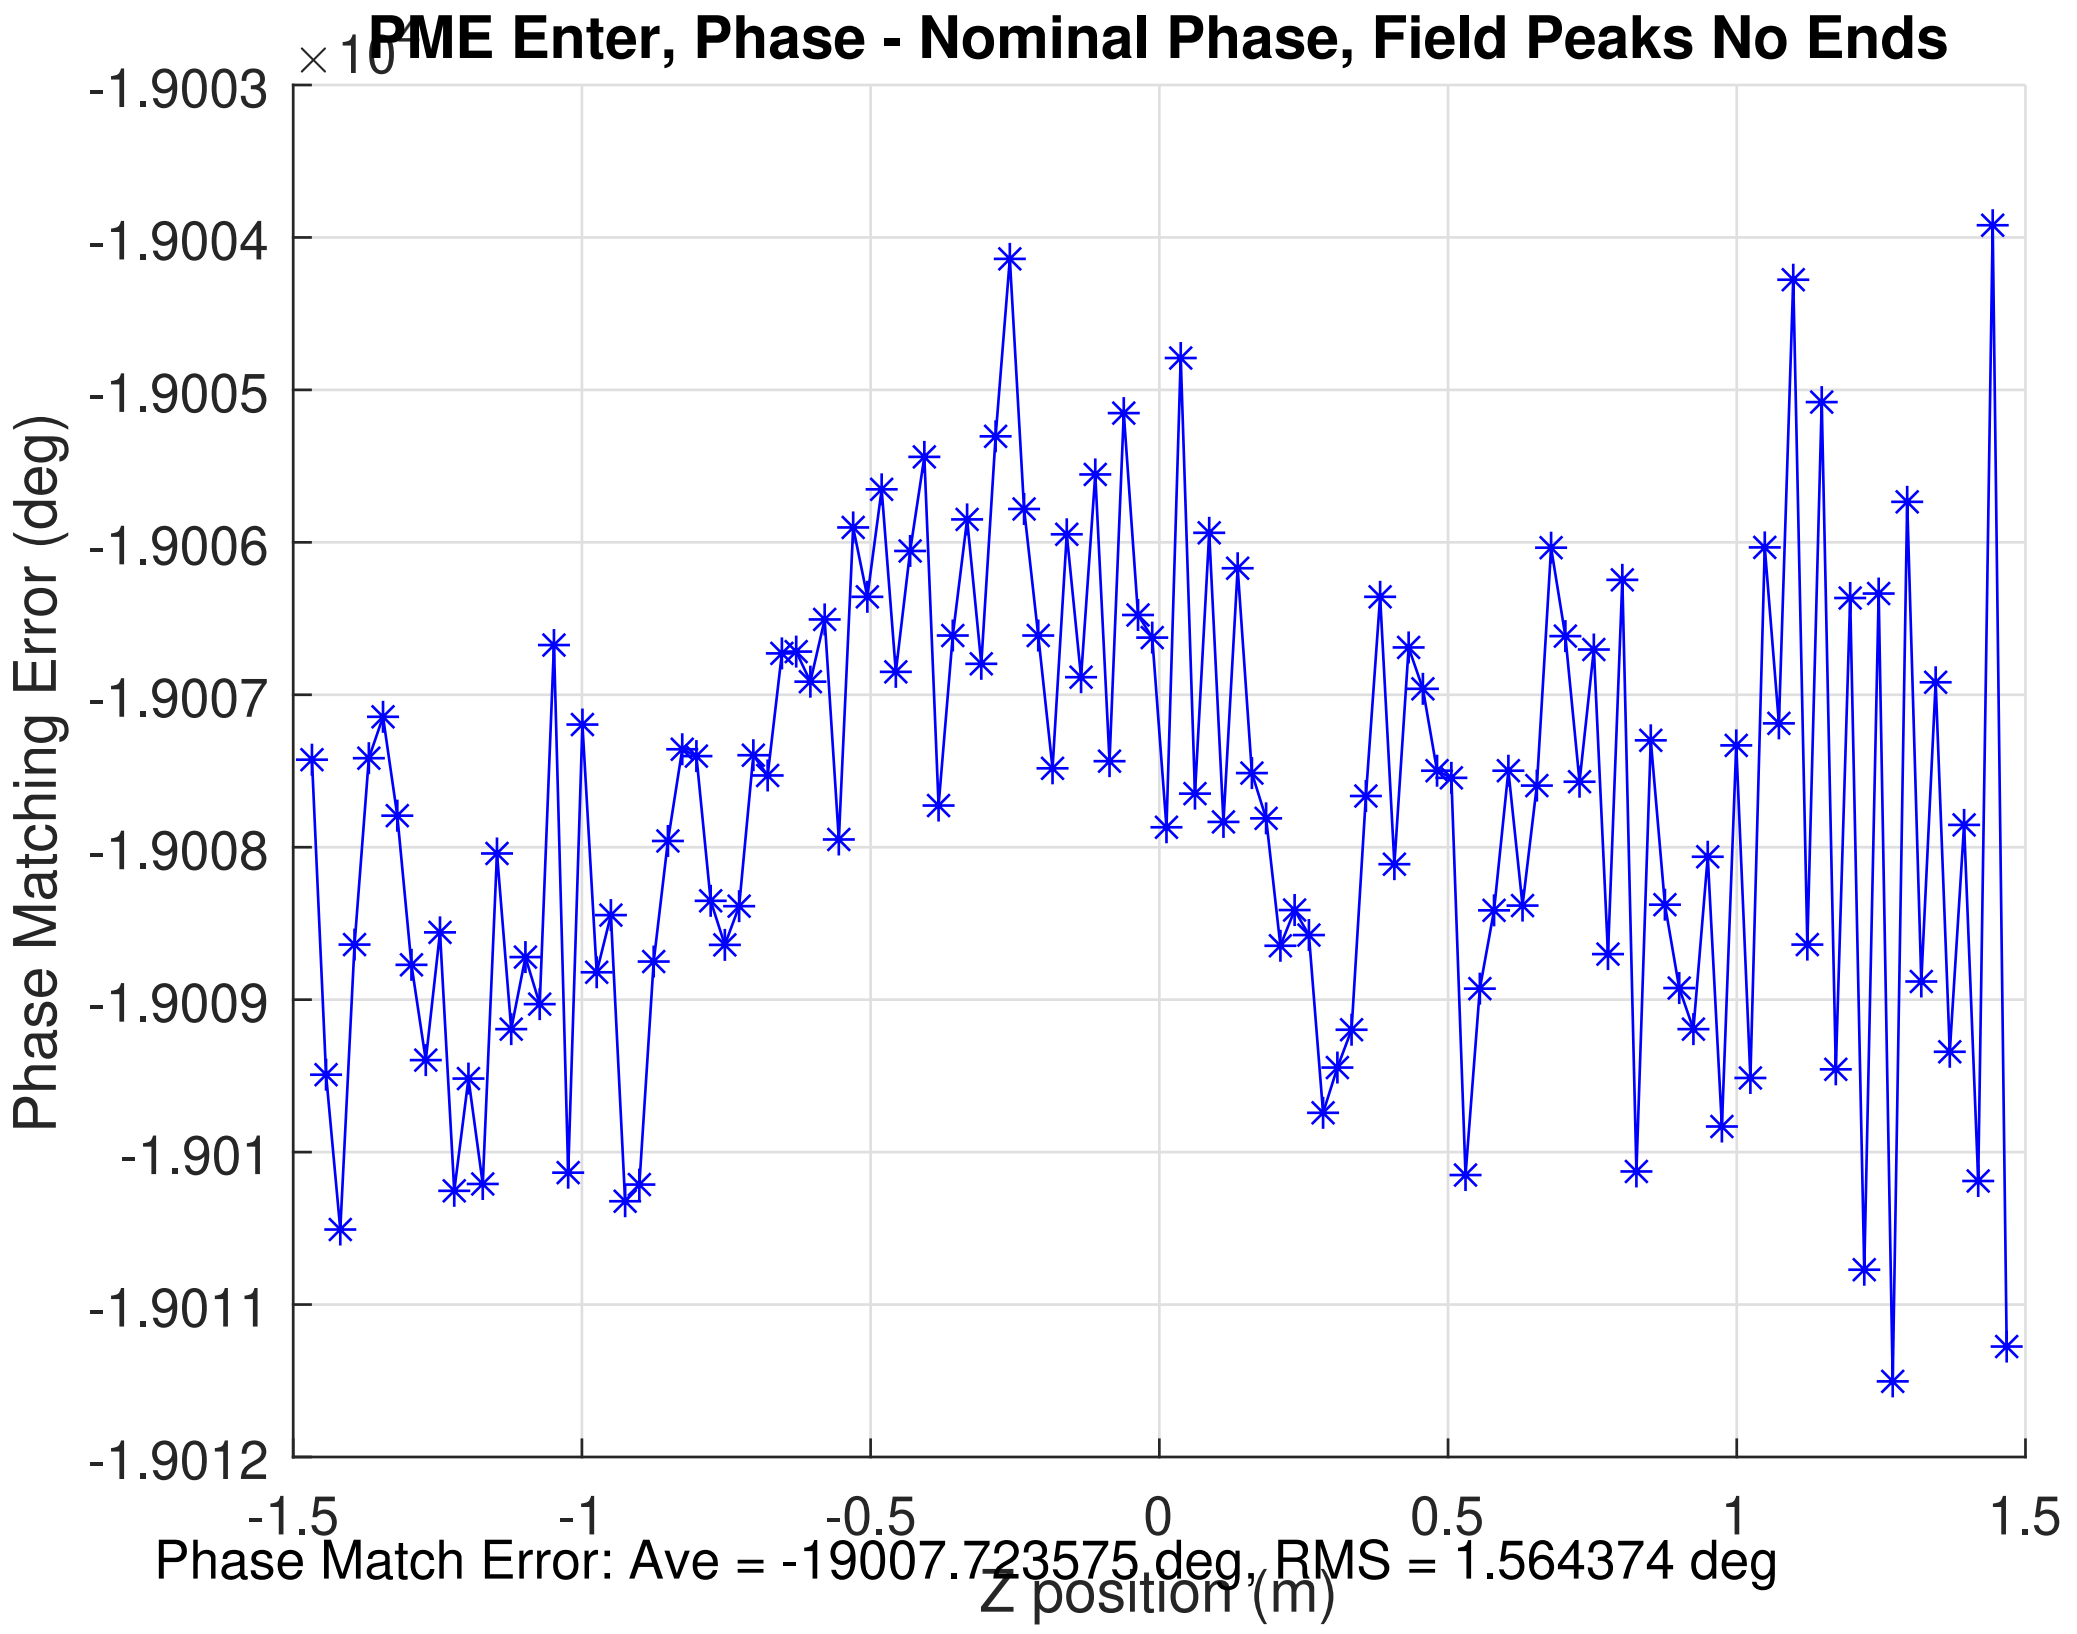

Phase Match Error: Ave = -19007.723575 deg, RMS = 1.564374 deg

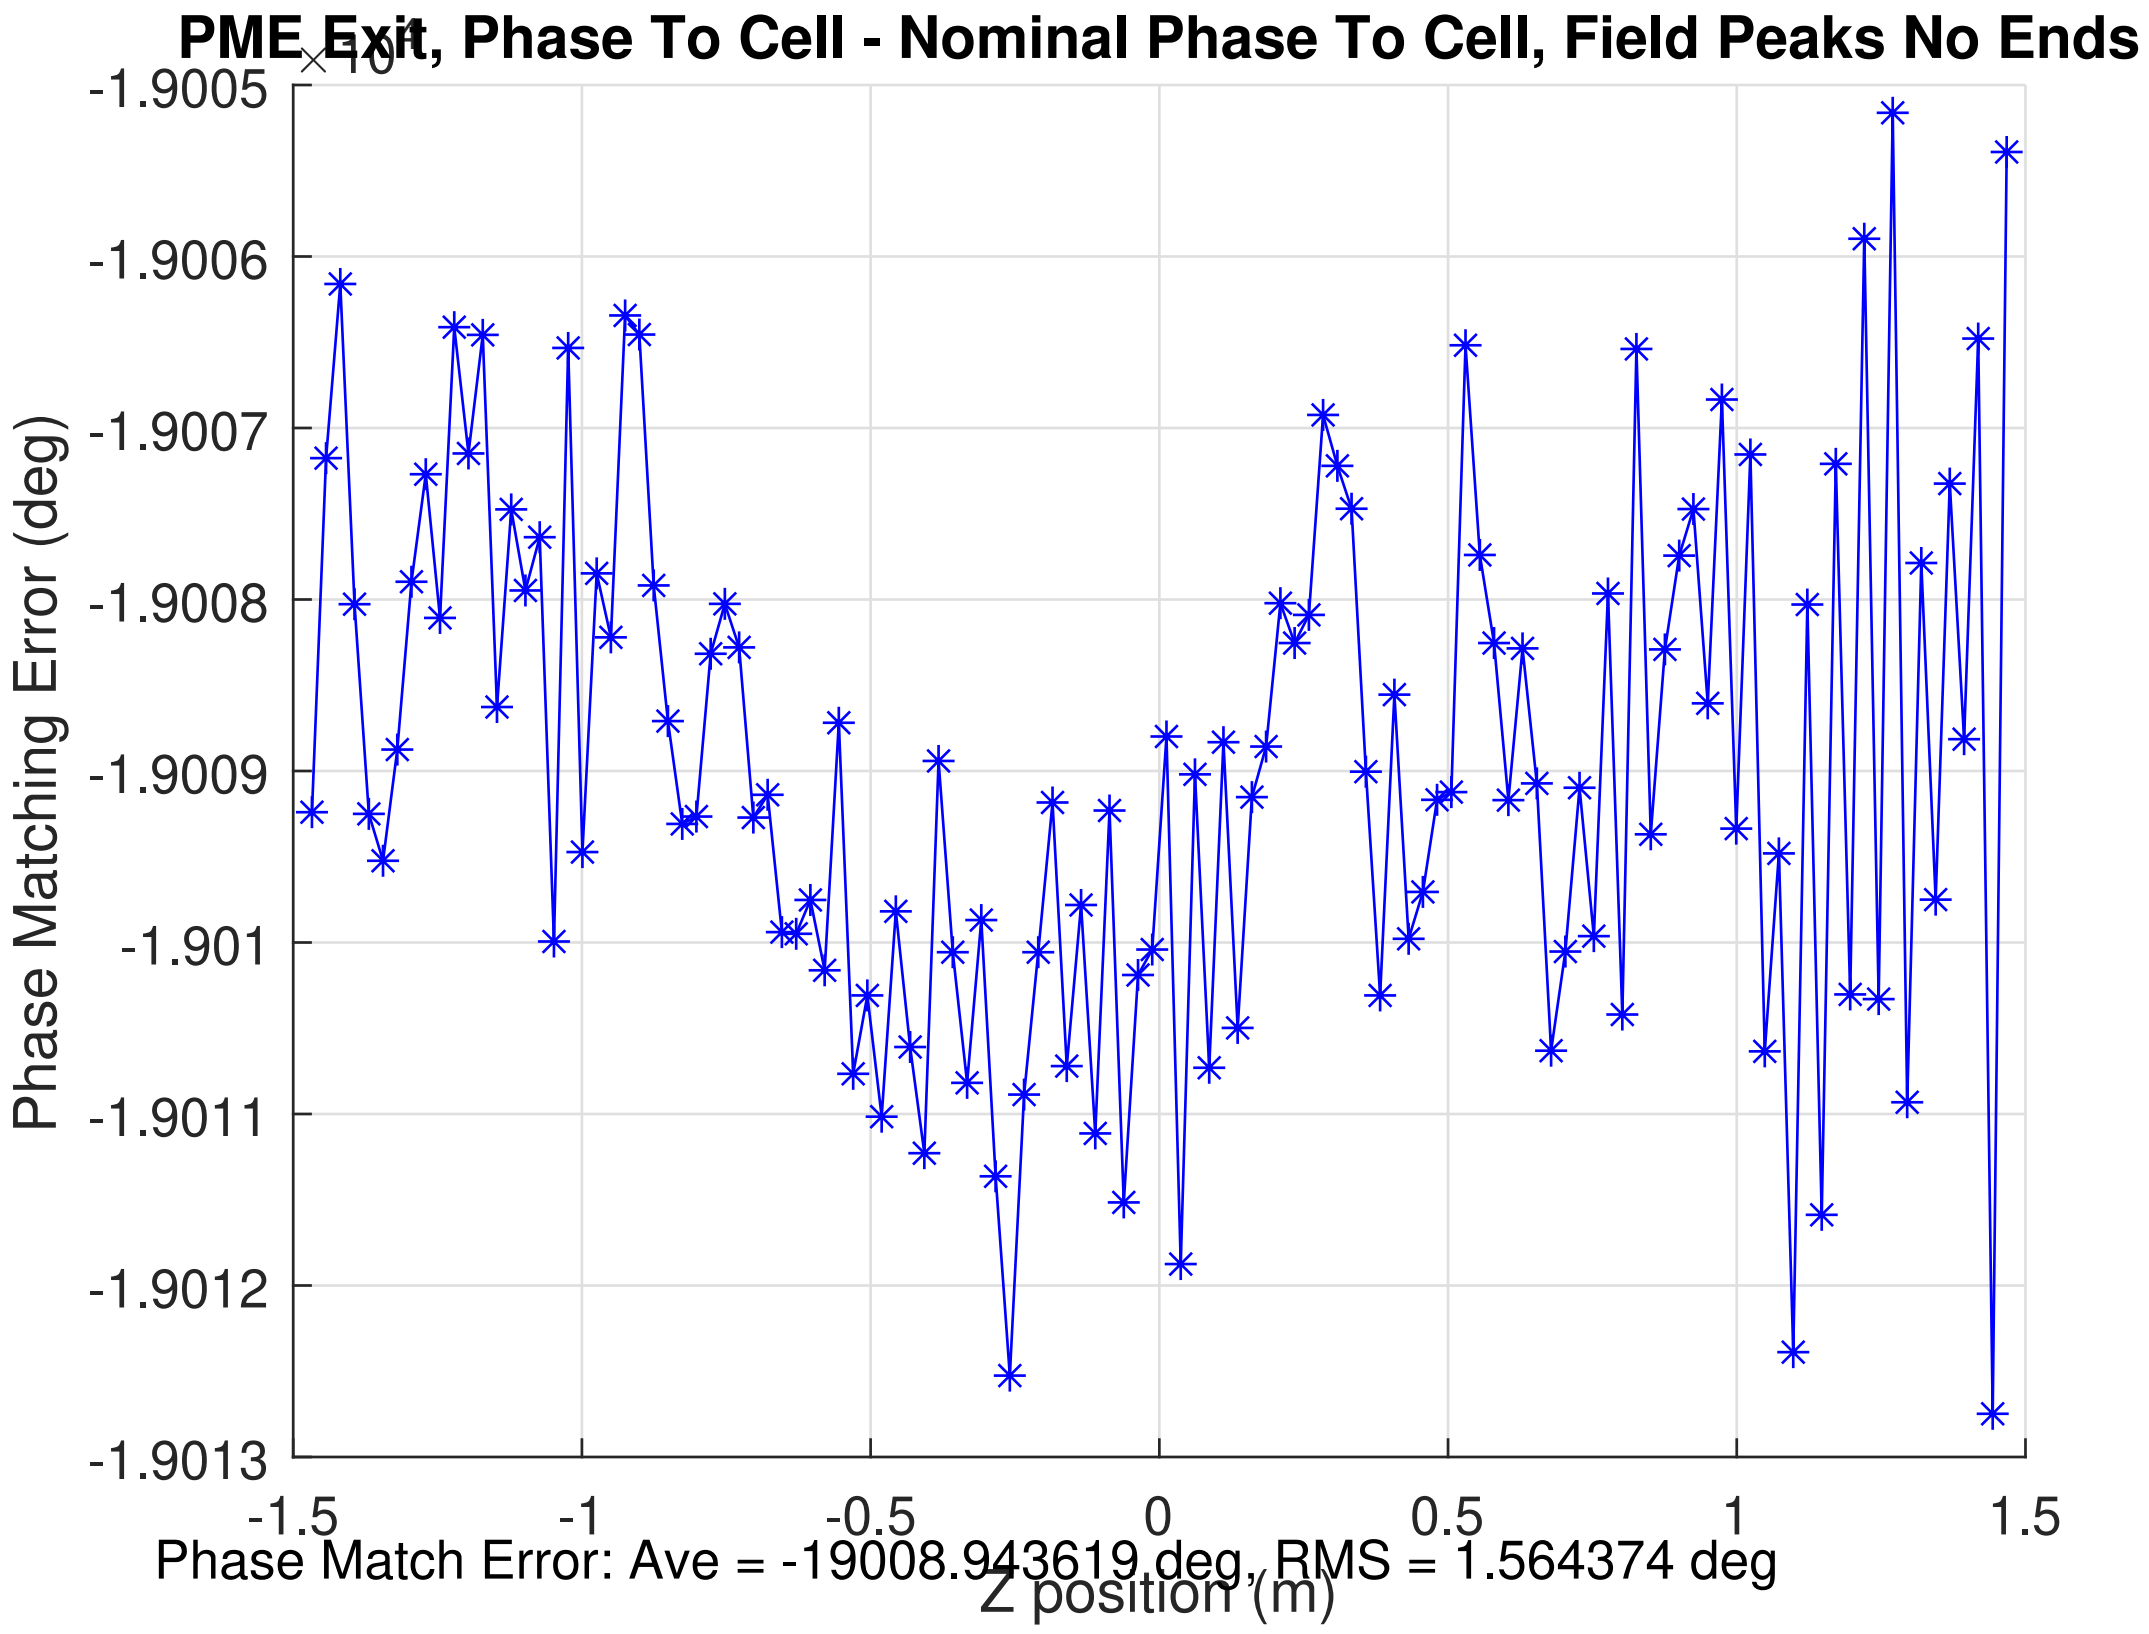
PME Exit, Phase To Cell - Nominal Phase To Cell, Field Peaks No Ends

Phase Match Error: Ave = -19008.943619 deg, RMS = 1.564374 deg

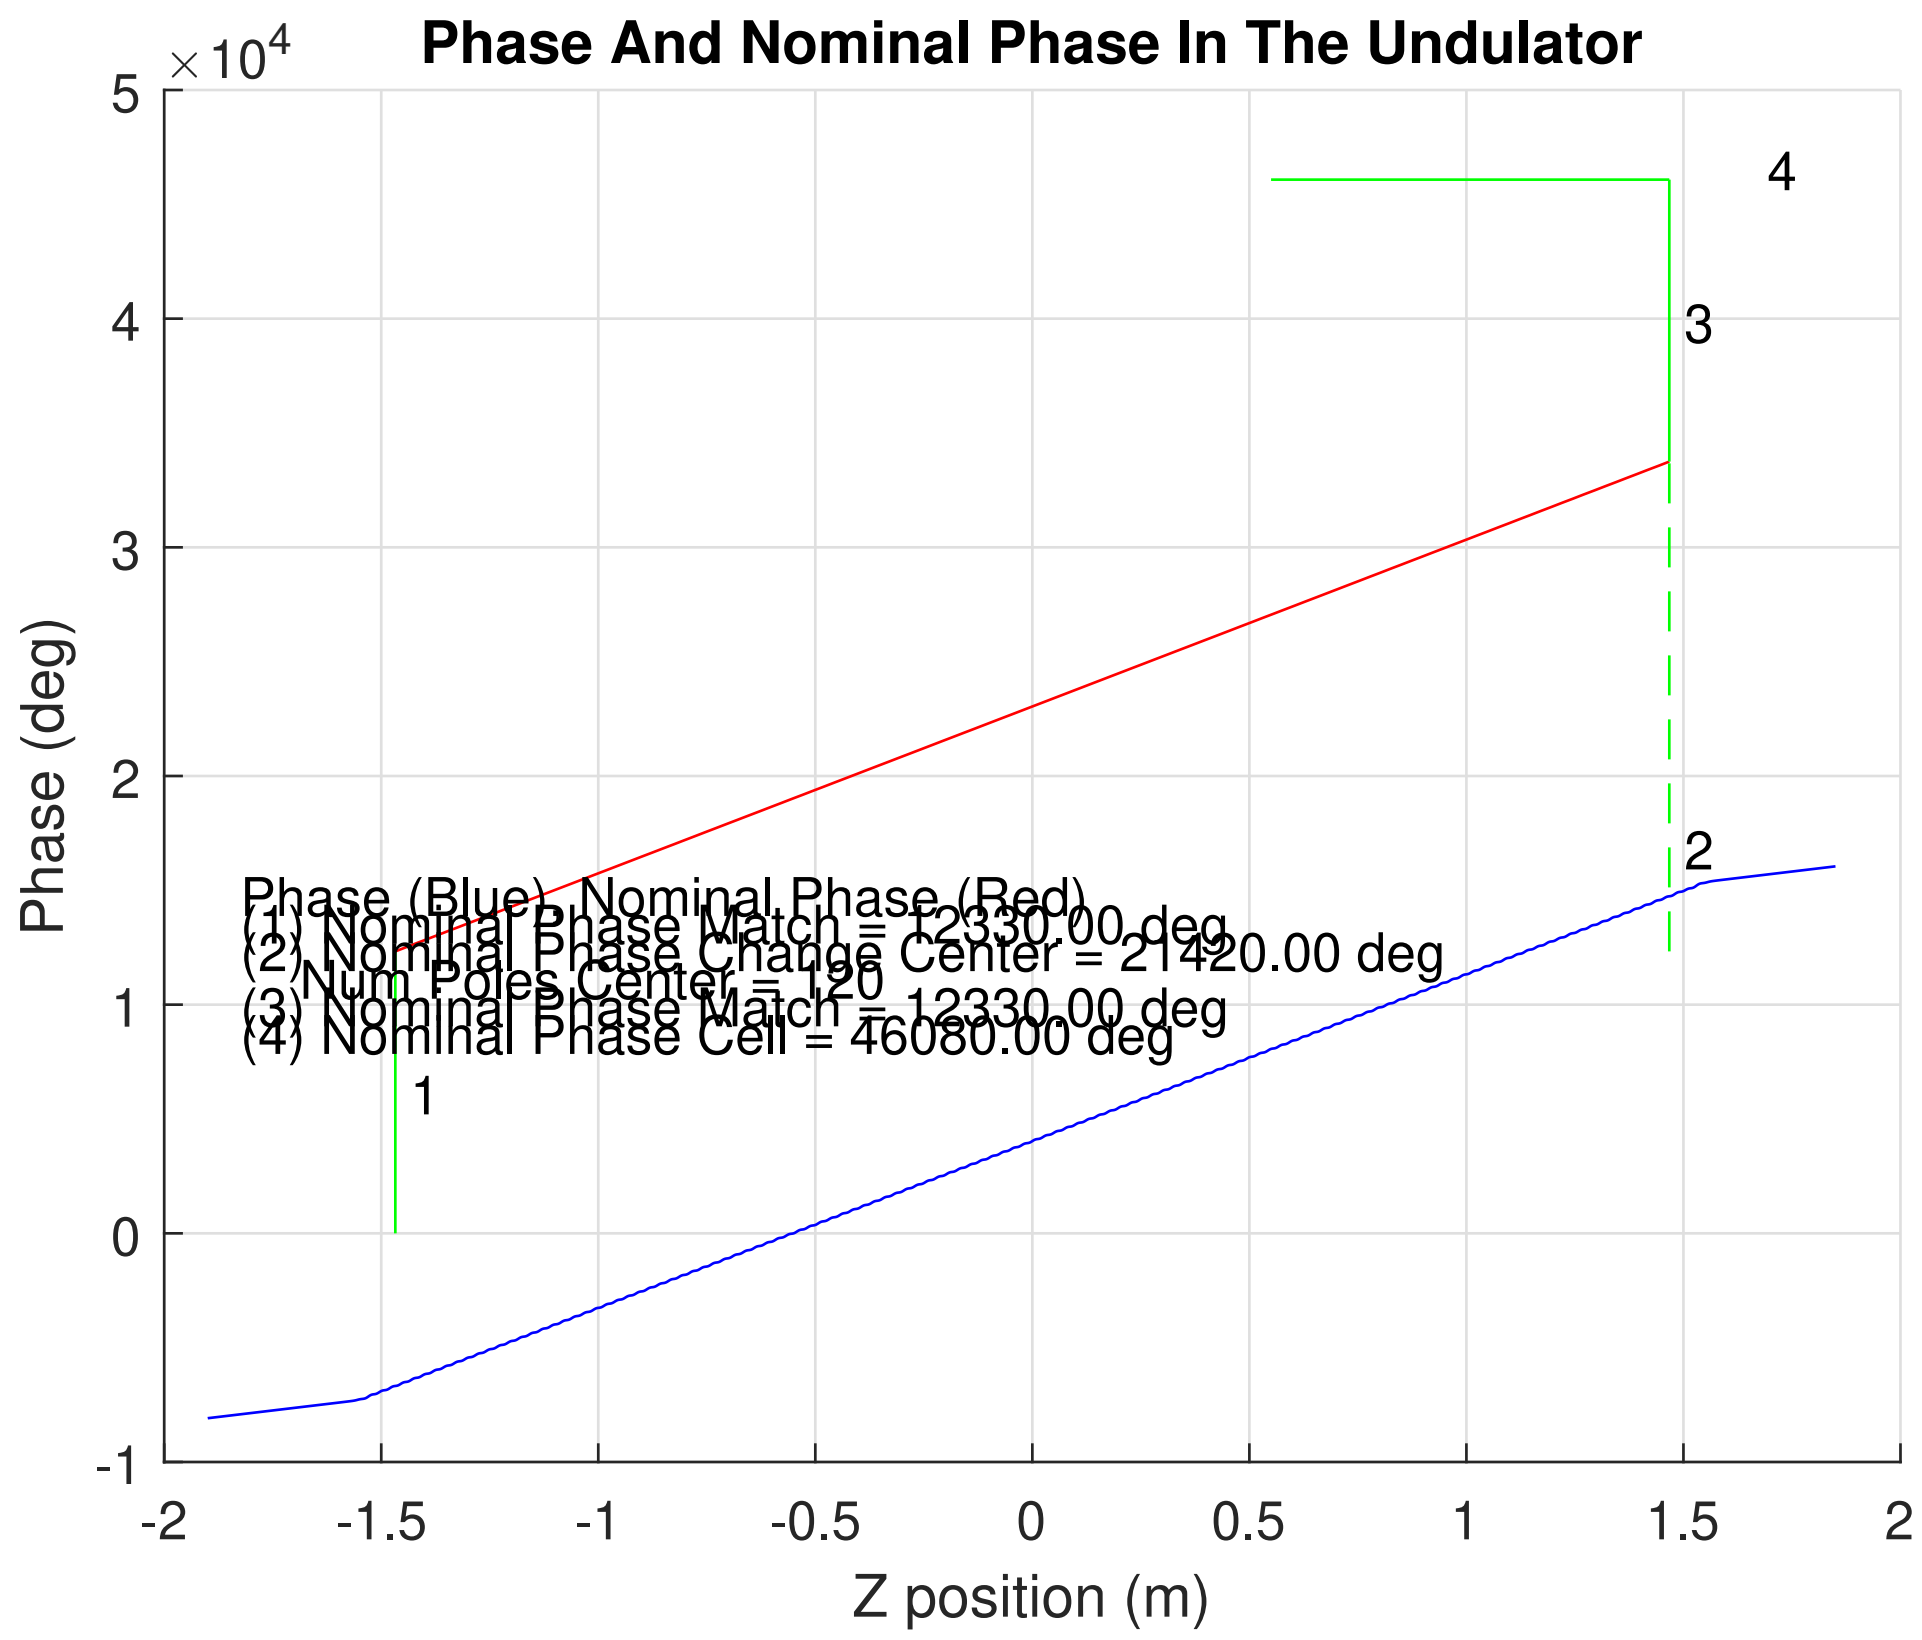
Phase And Nominal Phase In The Undulator
×10^4
5
4
3
2
1
0
-1
Phase (deg)
-2
-1.5
-1
-0.5
0
0.5
1
1.5
2
Z position (m)
1
2
3
4
Phase (Blue), Nominal Phase (Red)
(1) Nominal Phase Match = 12330.00 deg
(2) Nominal Phase Change Center = 21420.00 deg
Num Poles Center = 120
(3) Nominal Phase Match = 12330.00 deg
(4) Nominal Phase Cell = 46080.00 deg

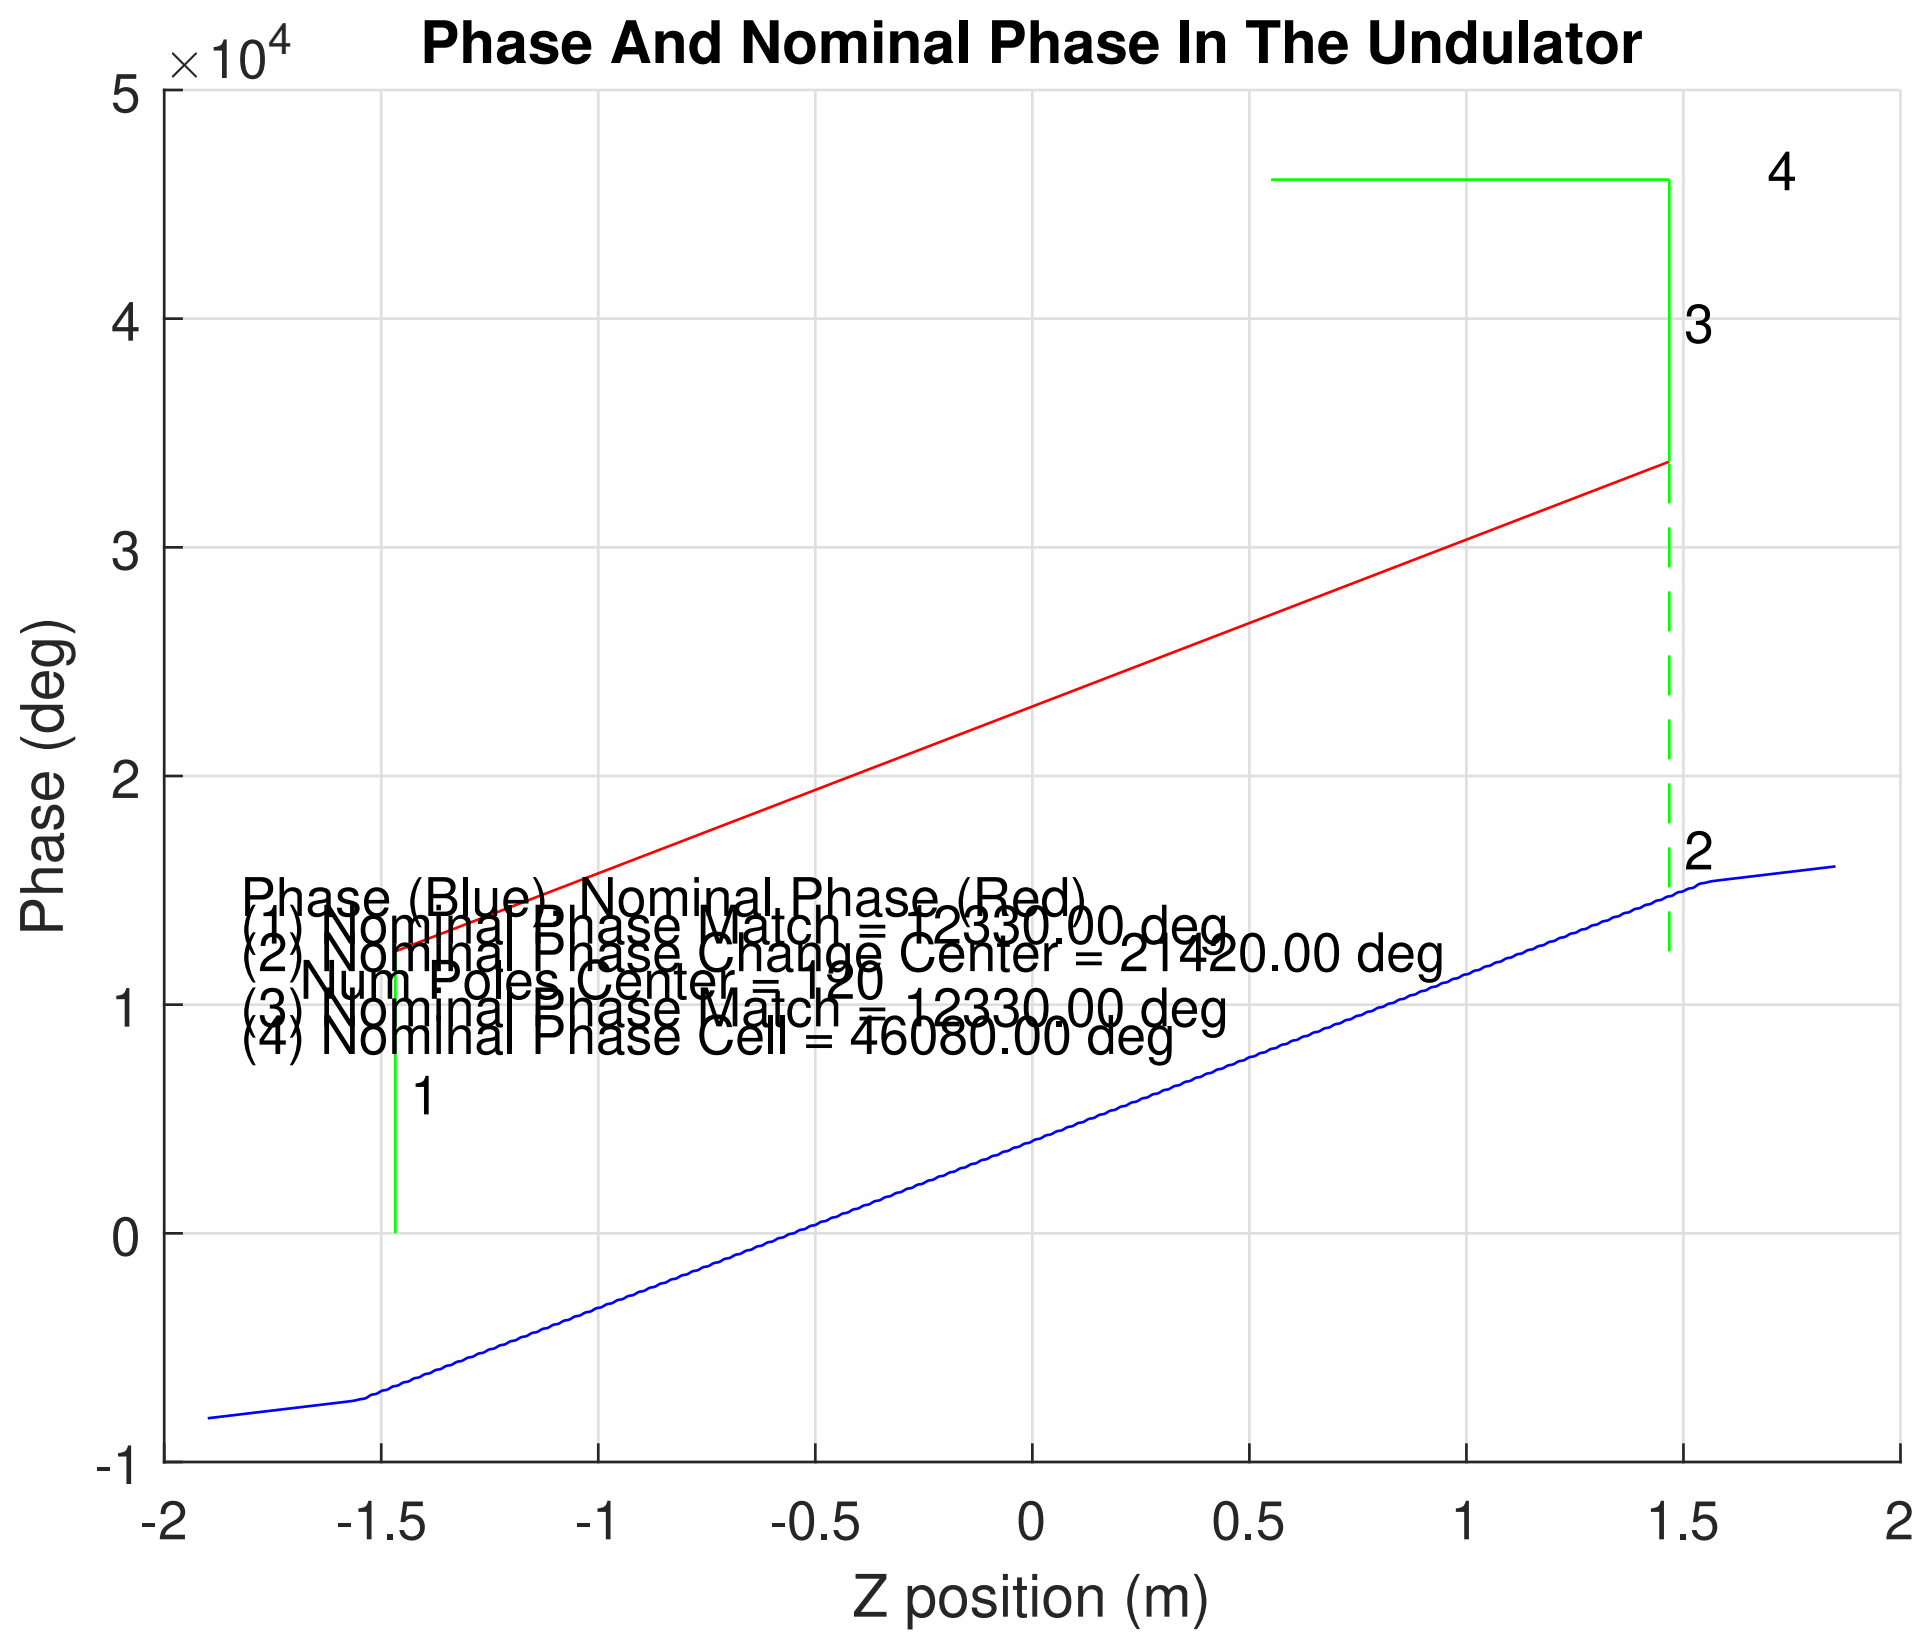
Phase And Nominal Phase In The Undulator
×10^4
5
4
3
2
1
0
-1
Phase (deg)
-2
-1.5
-1
-0.5
0
0.5
1
1.5
2
Z position (m)
Phase (Blue), Nominal Phase (Red)
(1) Nominal Phase Match = 12330.00 deg
(2) Nominal Phase Change Center = 21420.00 deg
Num Poles Center = 120
(3) Nominal Phase Match = 12330.00 deg
(4) Nominal Phase Cell = 46080.00 deg
1
2
3
4