SLAC Magnetic Measurements

Trajectory Analysis
−−−−−−−−−−−−−−−−−−

Parameters:
INPUT−FILE−DIR =S:\MagData\LCLS\Undulator\A1−ANL\DATASET0001\Rough Tuning\Z Scans\Run 039\
INPUT−FILE−NAME =x+00000−y+000−bscanz.dat
INPUT−FILE−TYPE =ZVXYBXYH
CORR−REQUIRED =0
GAMMA =26627.1
DEVICE CENTER POSITION ZM =2.1492 m
DEVICE ENTRANCE POSITION ZM =0.9685 m
DEVICE EXIT POSITION ZM =3.3299 m
NOM−LAMBDA−R =1.5e−010 m

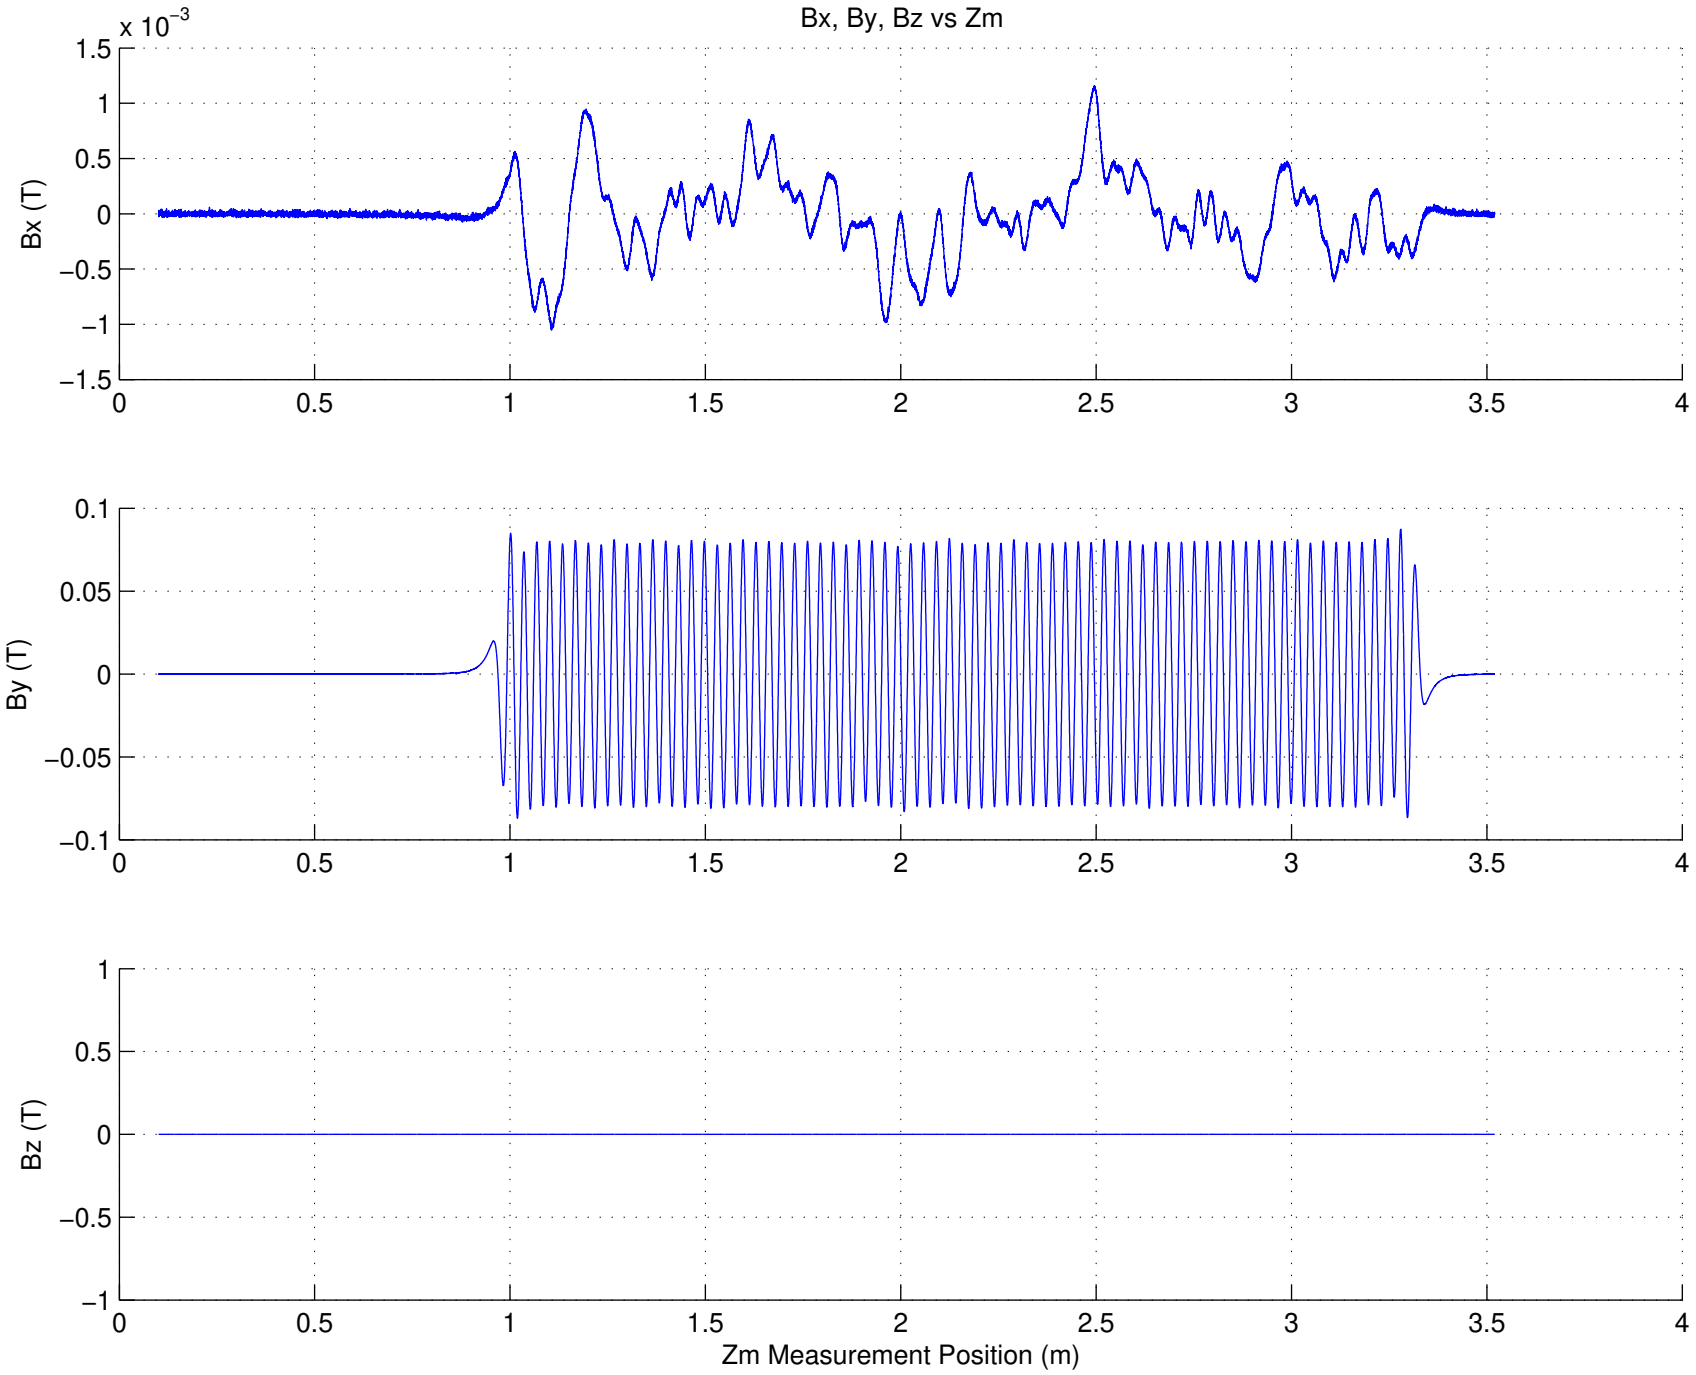
Bx, By, Bz vs Zm
x 10^-3
Bx (T)
By (T)
Bz (T)
Zm Measurement Position (m)

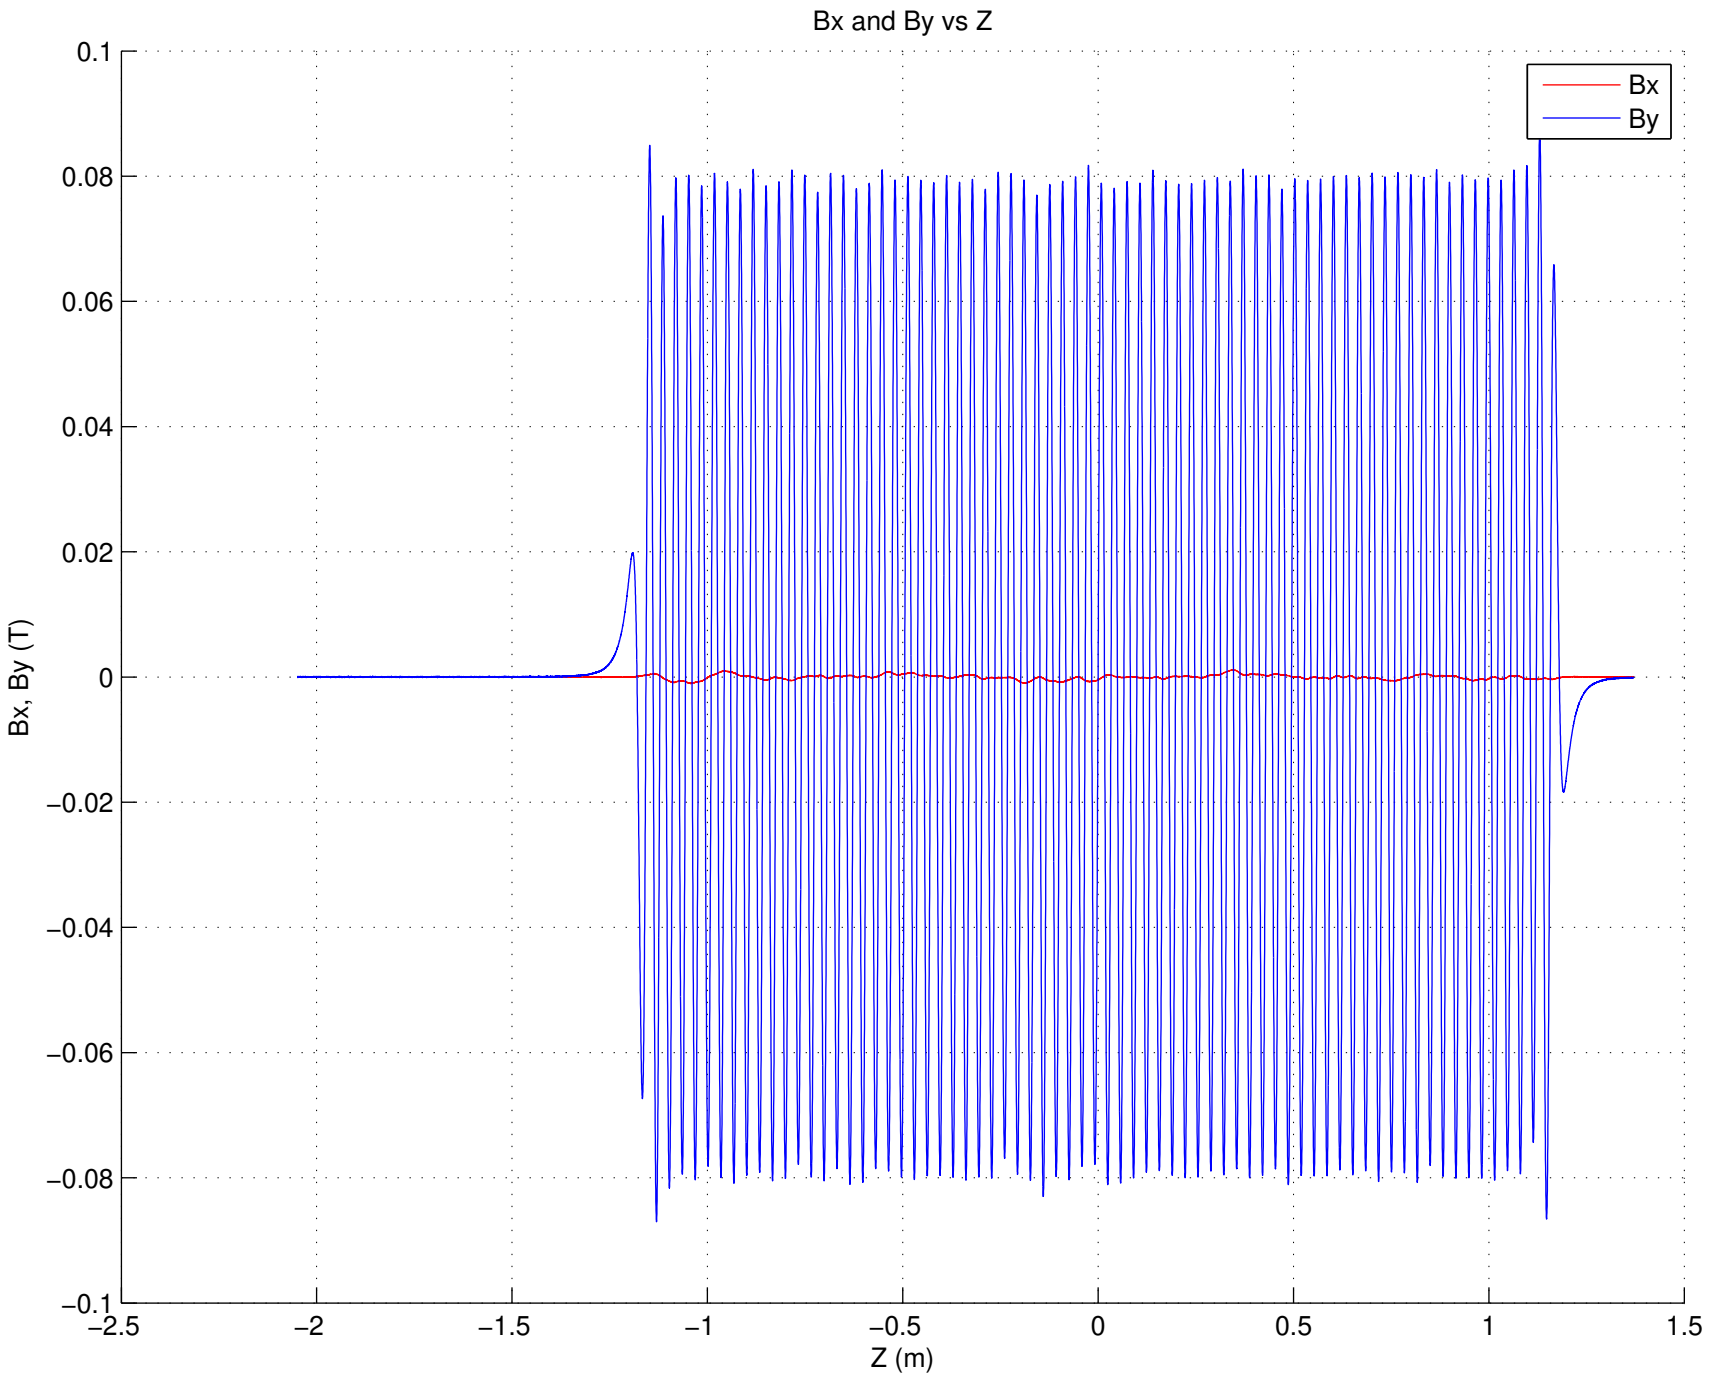
Bx and By vs Z
Bx
By
Bx, By (T)
Z (m)
0.1
0.08
0.06
0.04
0.02
0
−0.02
−0.04
−0.06
−0.08
−0.1
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5

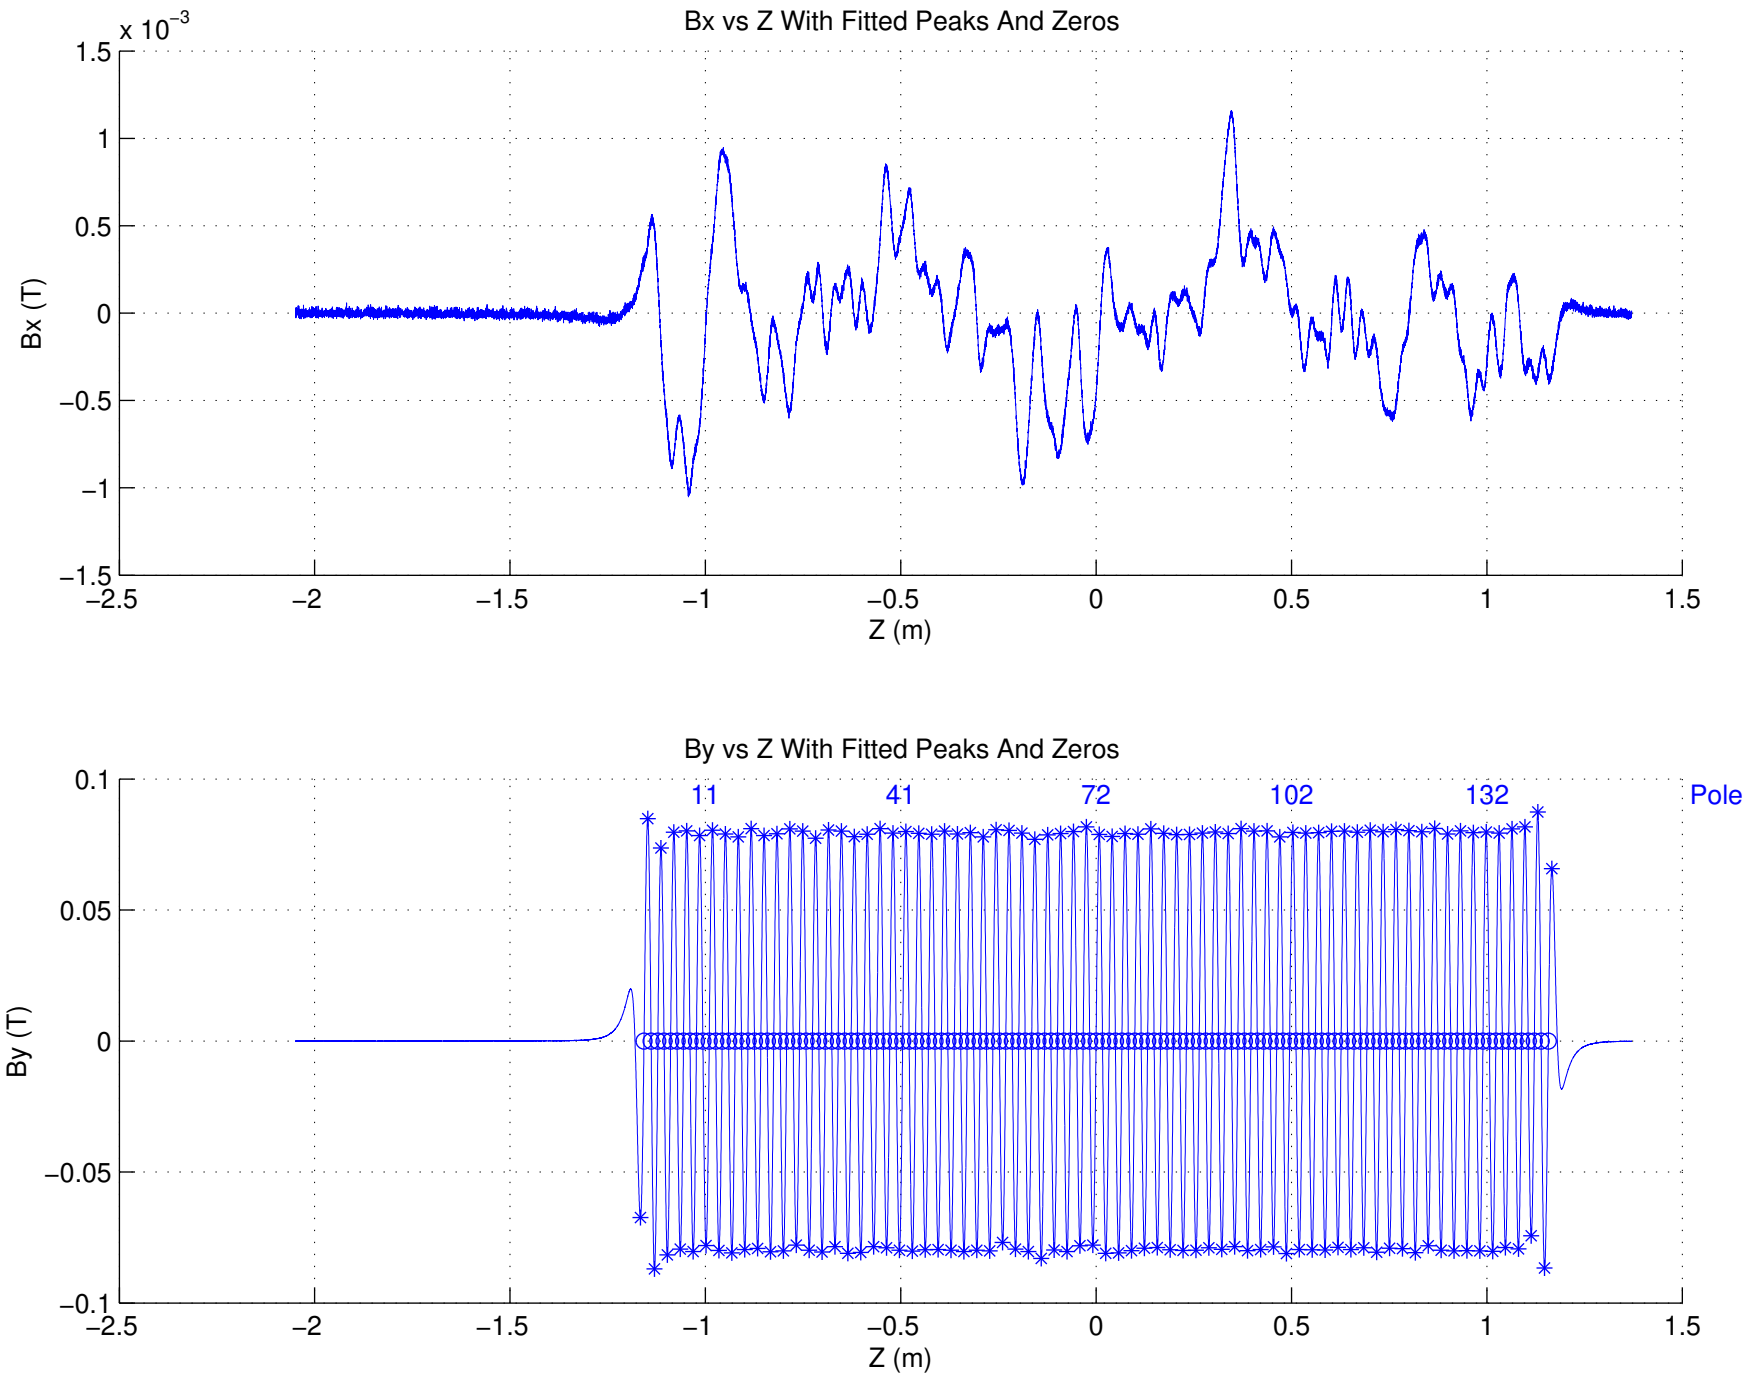
Bx vs Z With Fitted Peaks And Zeros
x 10^-3
Bx (T)
Z (m)
By vs Z With Fitted Peaks And Zeros
By (T)
Z (m)
11
41
72
102
132
Pole

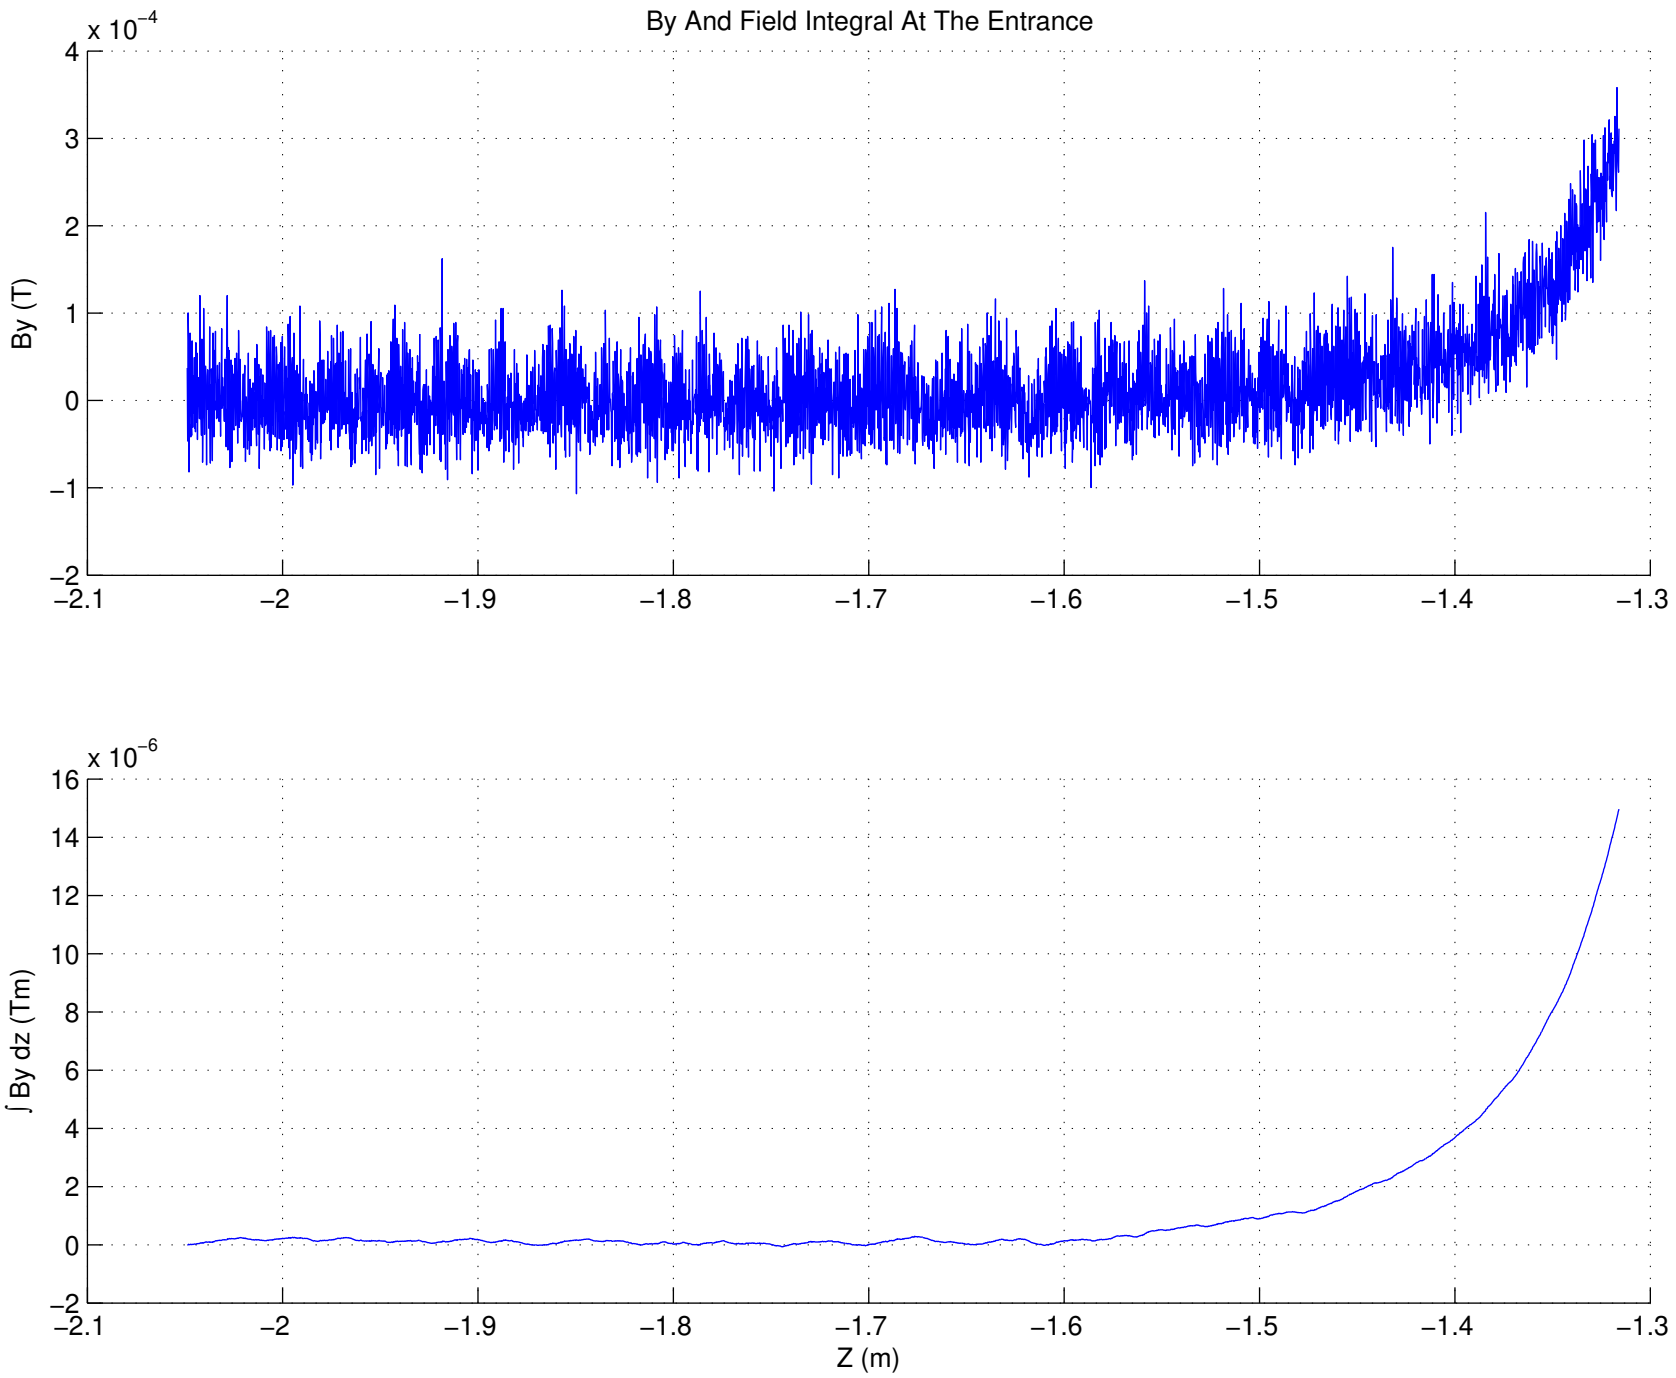
By And Field Integral At The Entrance
x 10^-4
By (T)
4
3
2
1
0
−1
−2
−2.1
−2
−1.9
−1.8
−1.7
−1.6
−1.5
−1.4
−1.3
x 10^-6
∫ By dz (Tm)
16
14
12
10
8
6
4
2
0
−2
Z (m)

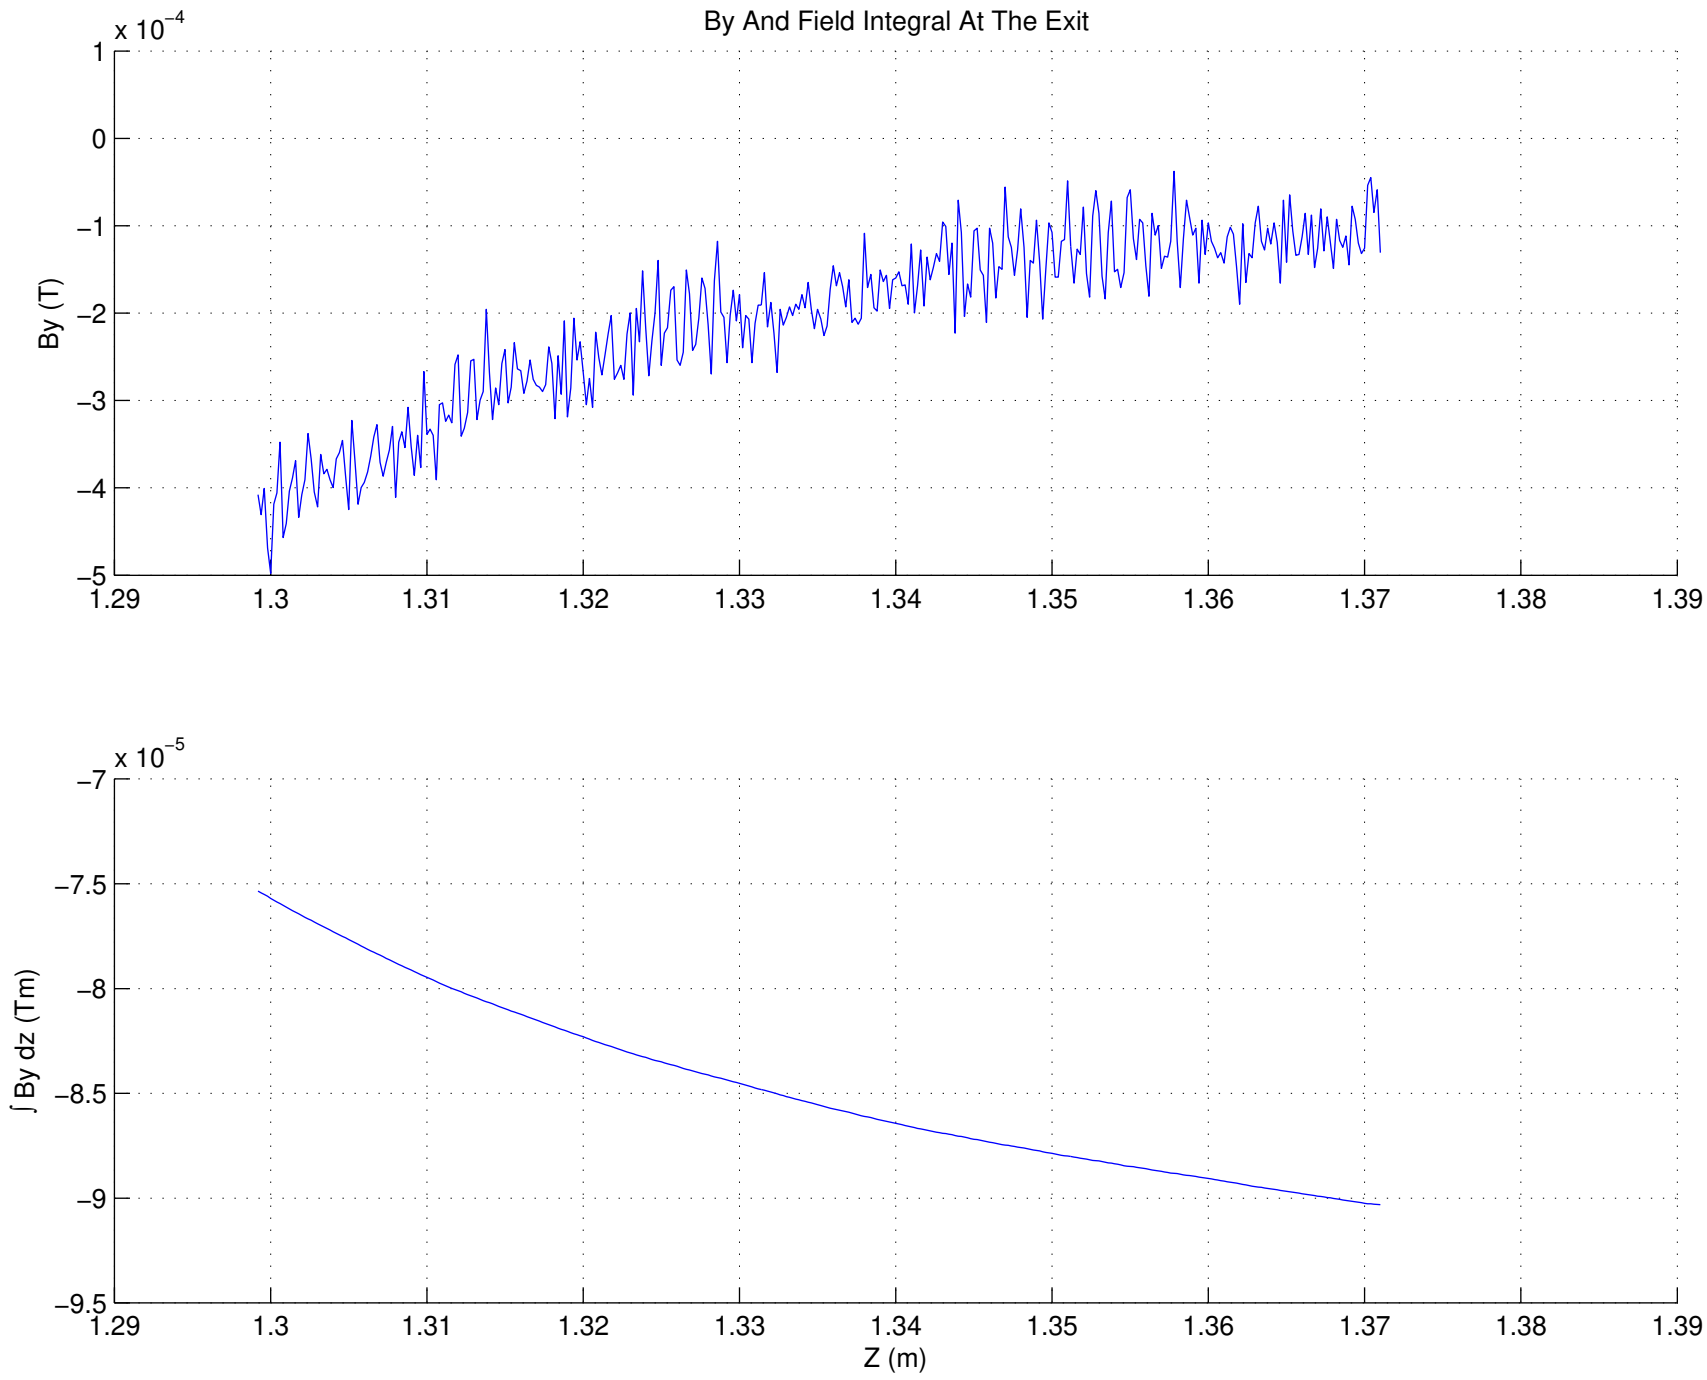
By And Field Integral At The Exit
x 10^-4
1
0
−1
−2
−3
−4
−5
By (T)
1.29
1.3
1.31
1.32
1.33
1.34
1.35
1.36
1.37
1.38
1.39
x 10^-5
−7
−7.5
−8
−8.5
−9
−9.5
∫ By dz (Tm)
Z (m)

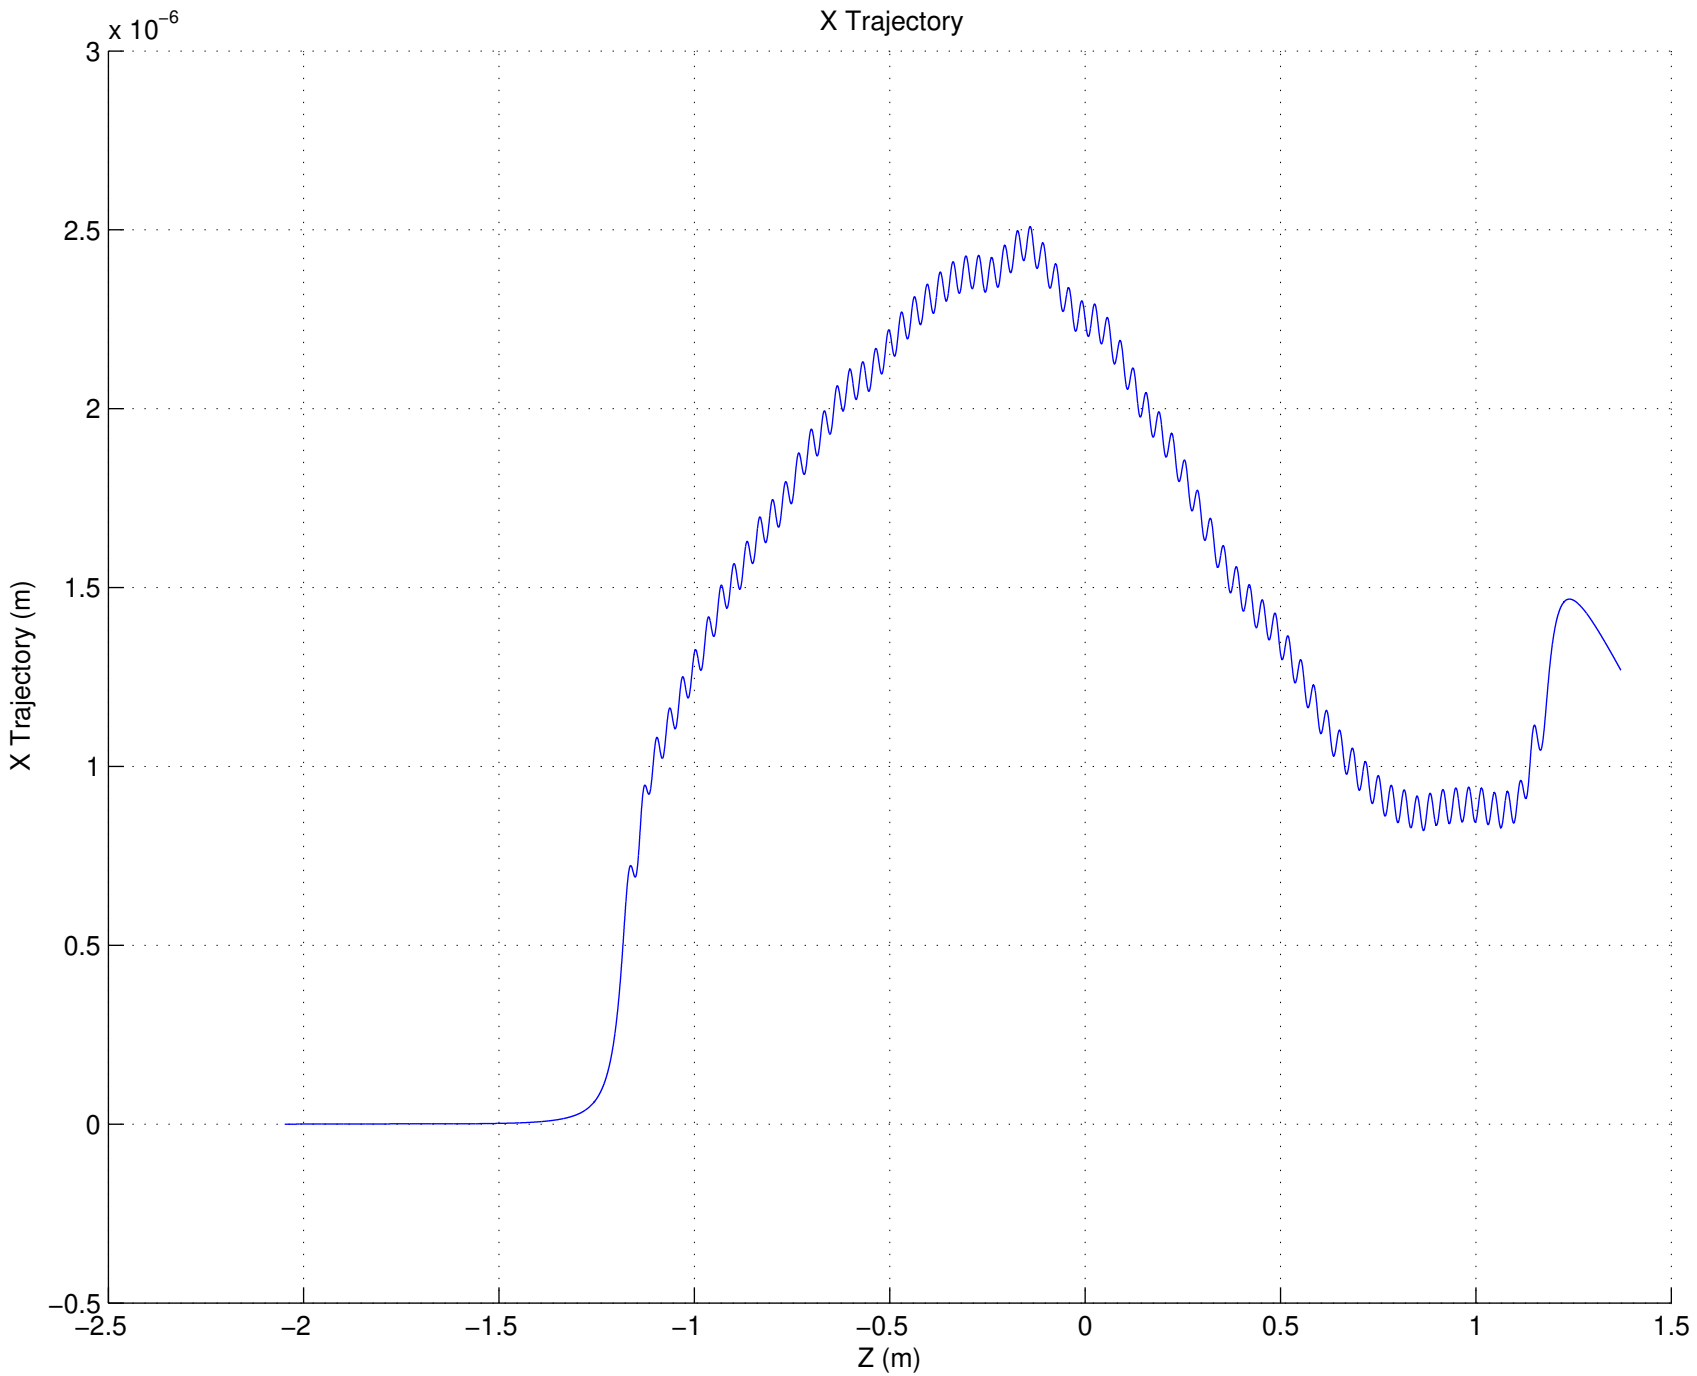
X Trajectory
x 10^-6
3
2.5
2
1.5
1
0.5
0
−0.5
X Trajectory (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
Z (m)

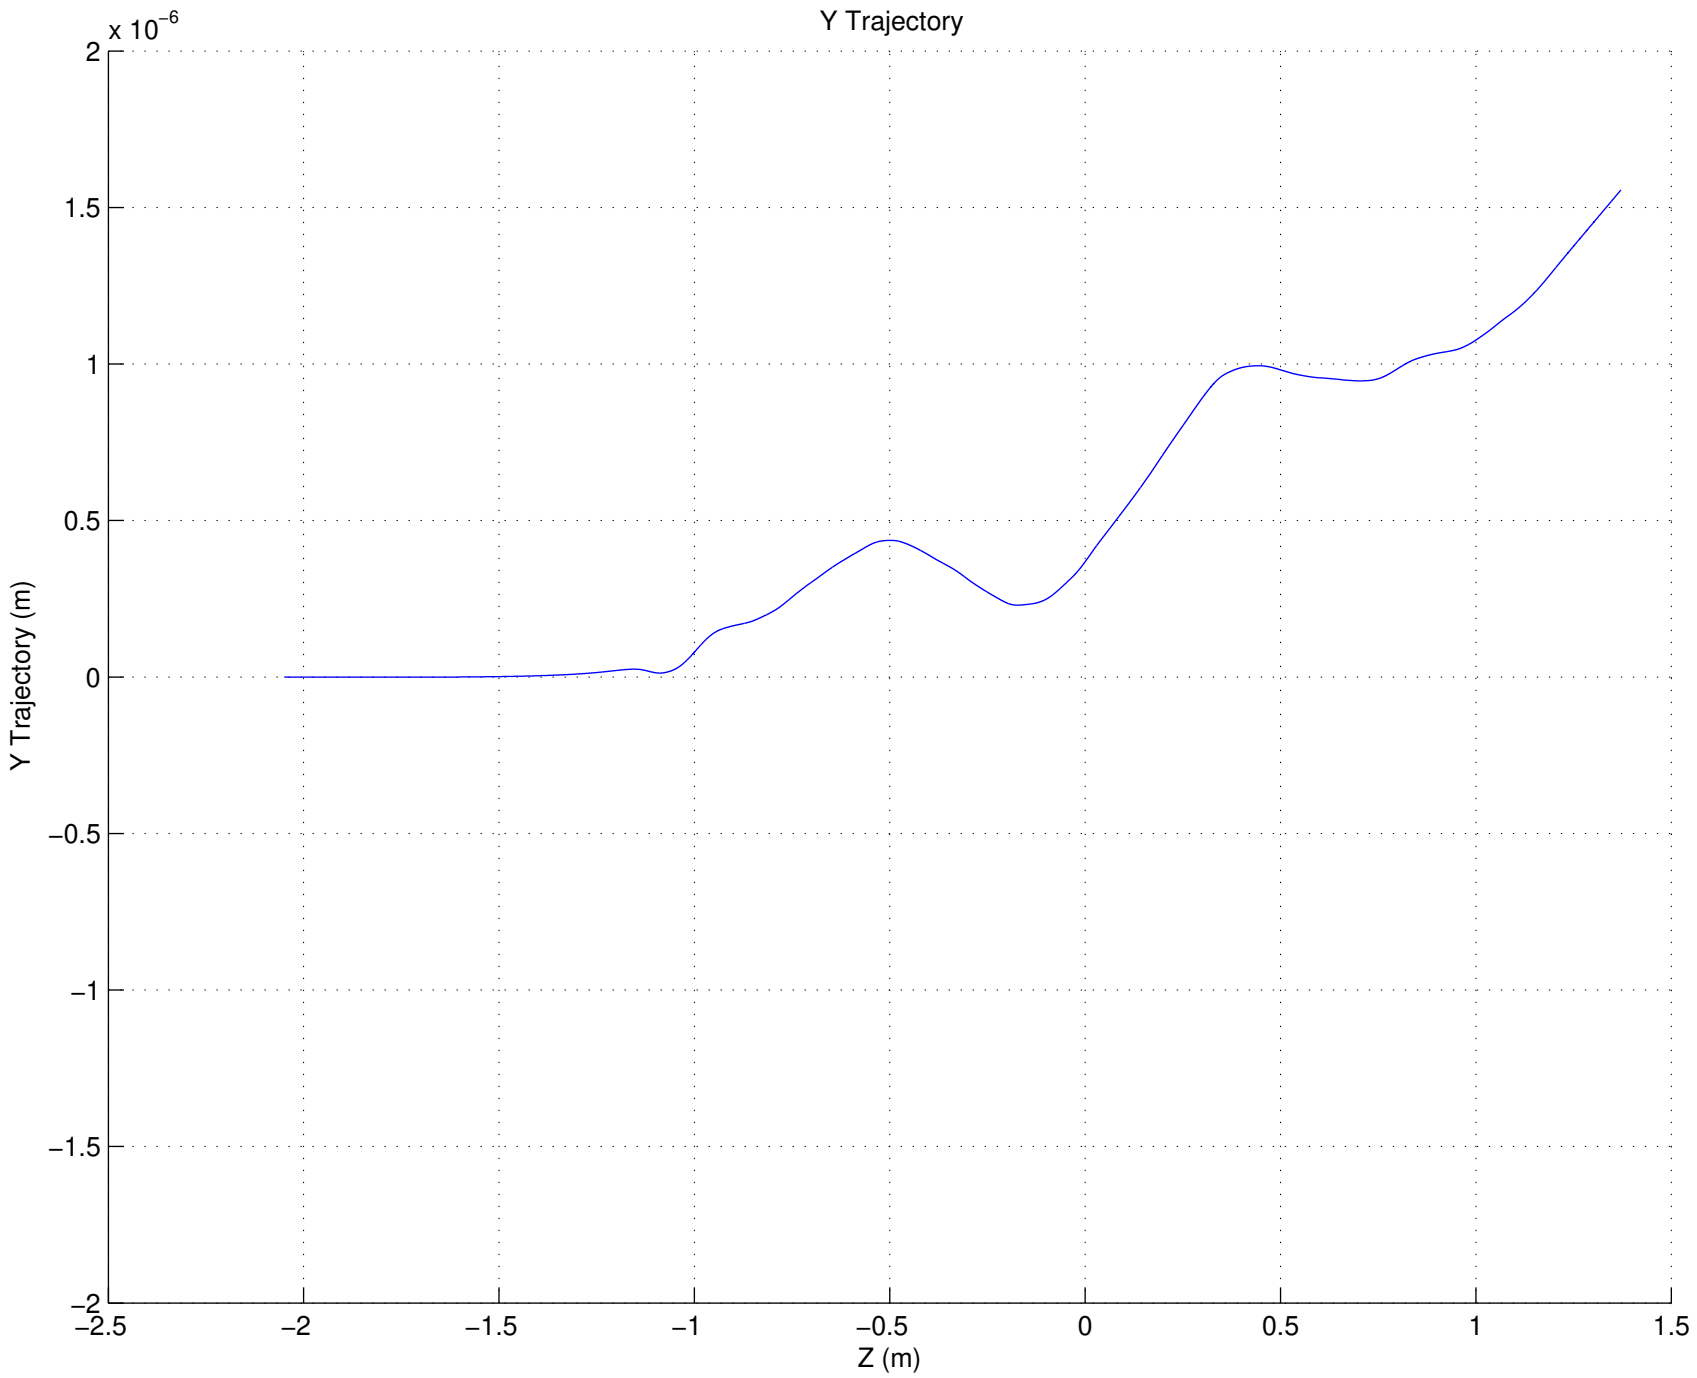
Y Trajectory
x 10^-6
2
1.5
1
0.5
0
−0.5
−1
−1.5
−2
Y Trajectory (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
Z (m)

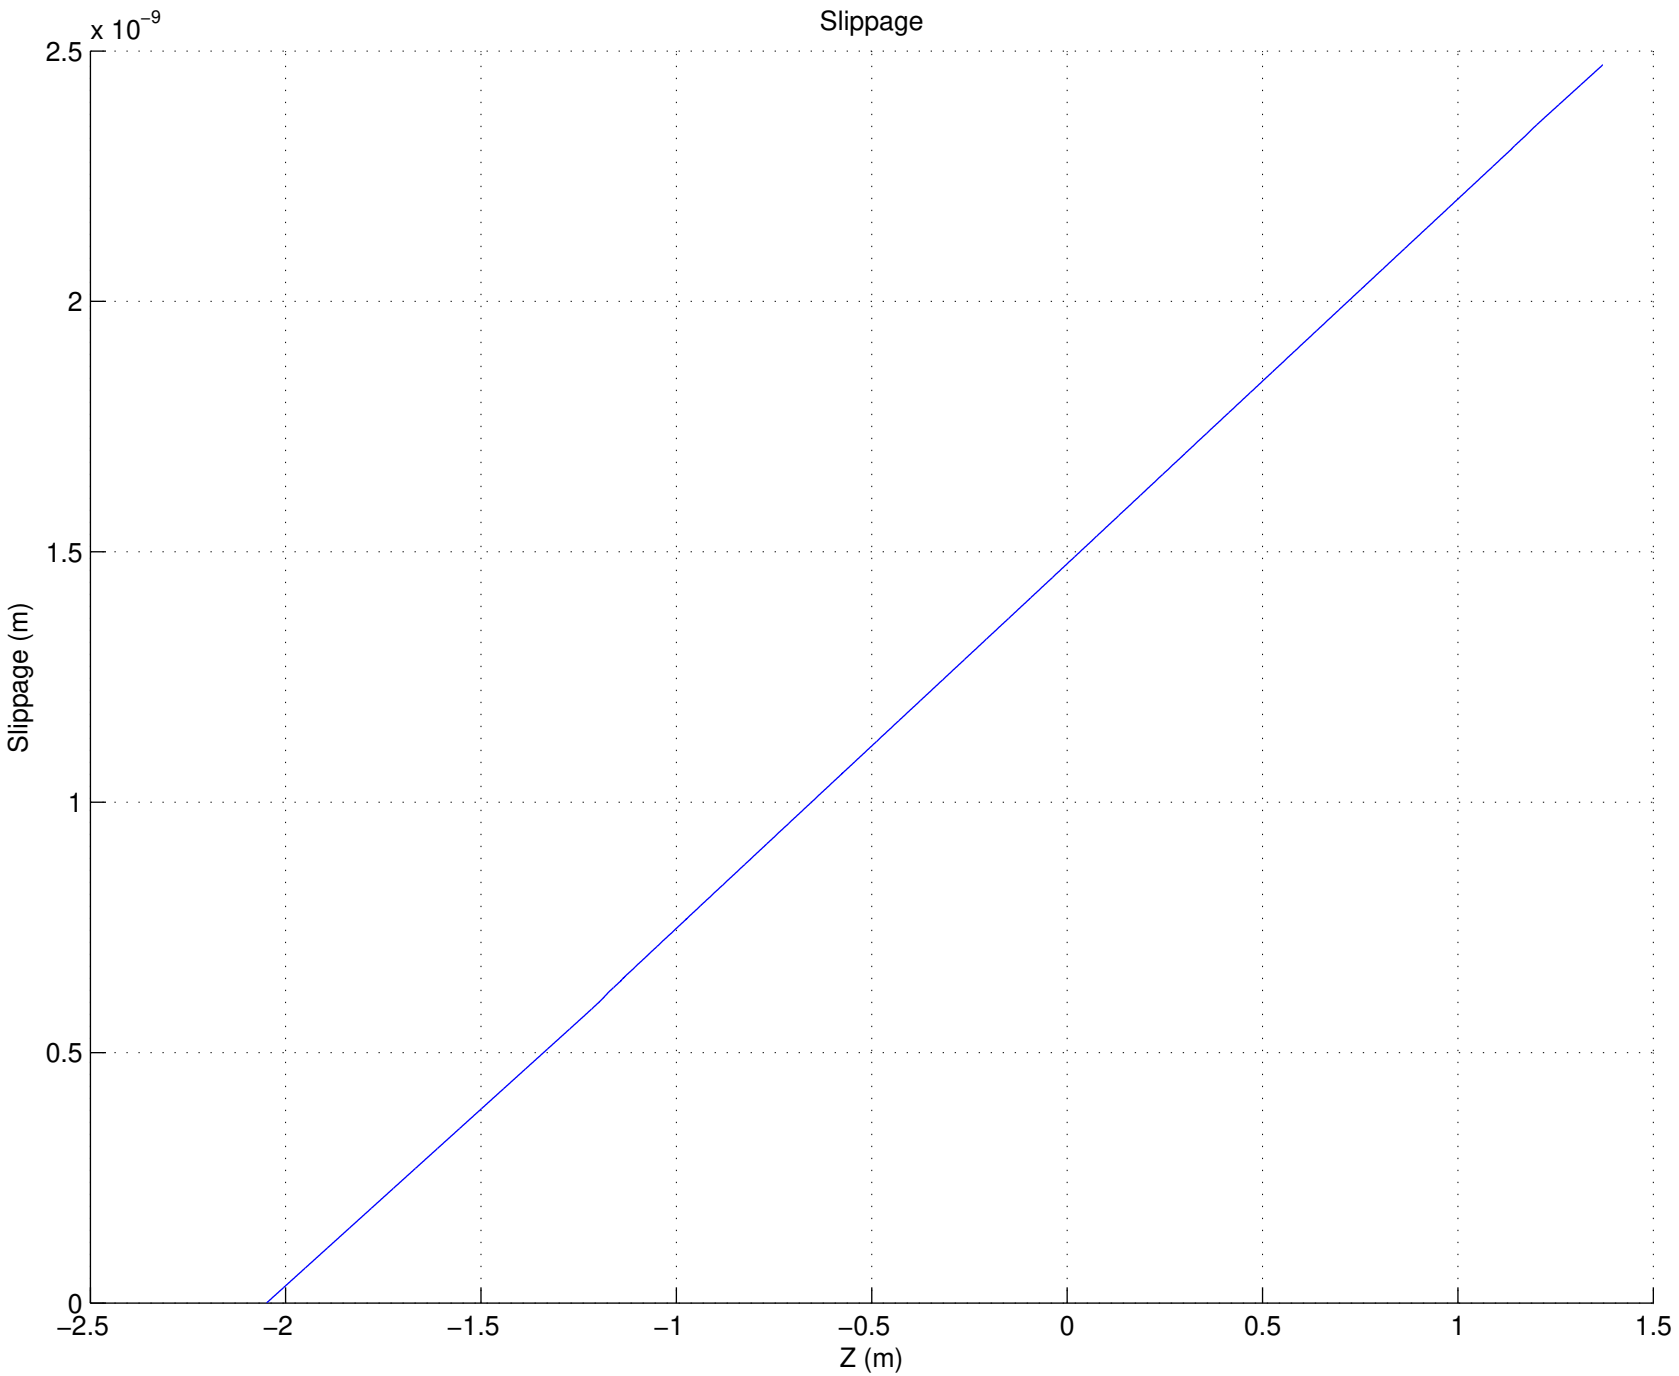
Slippage
x 10^-9
2.5
2
1.5
1
0.5
0
Slippage (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
Z (m)

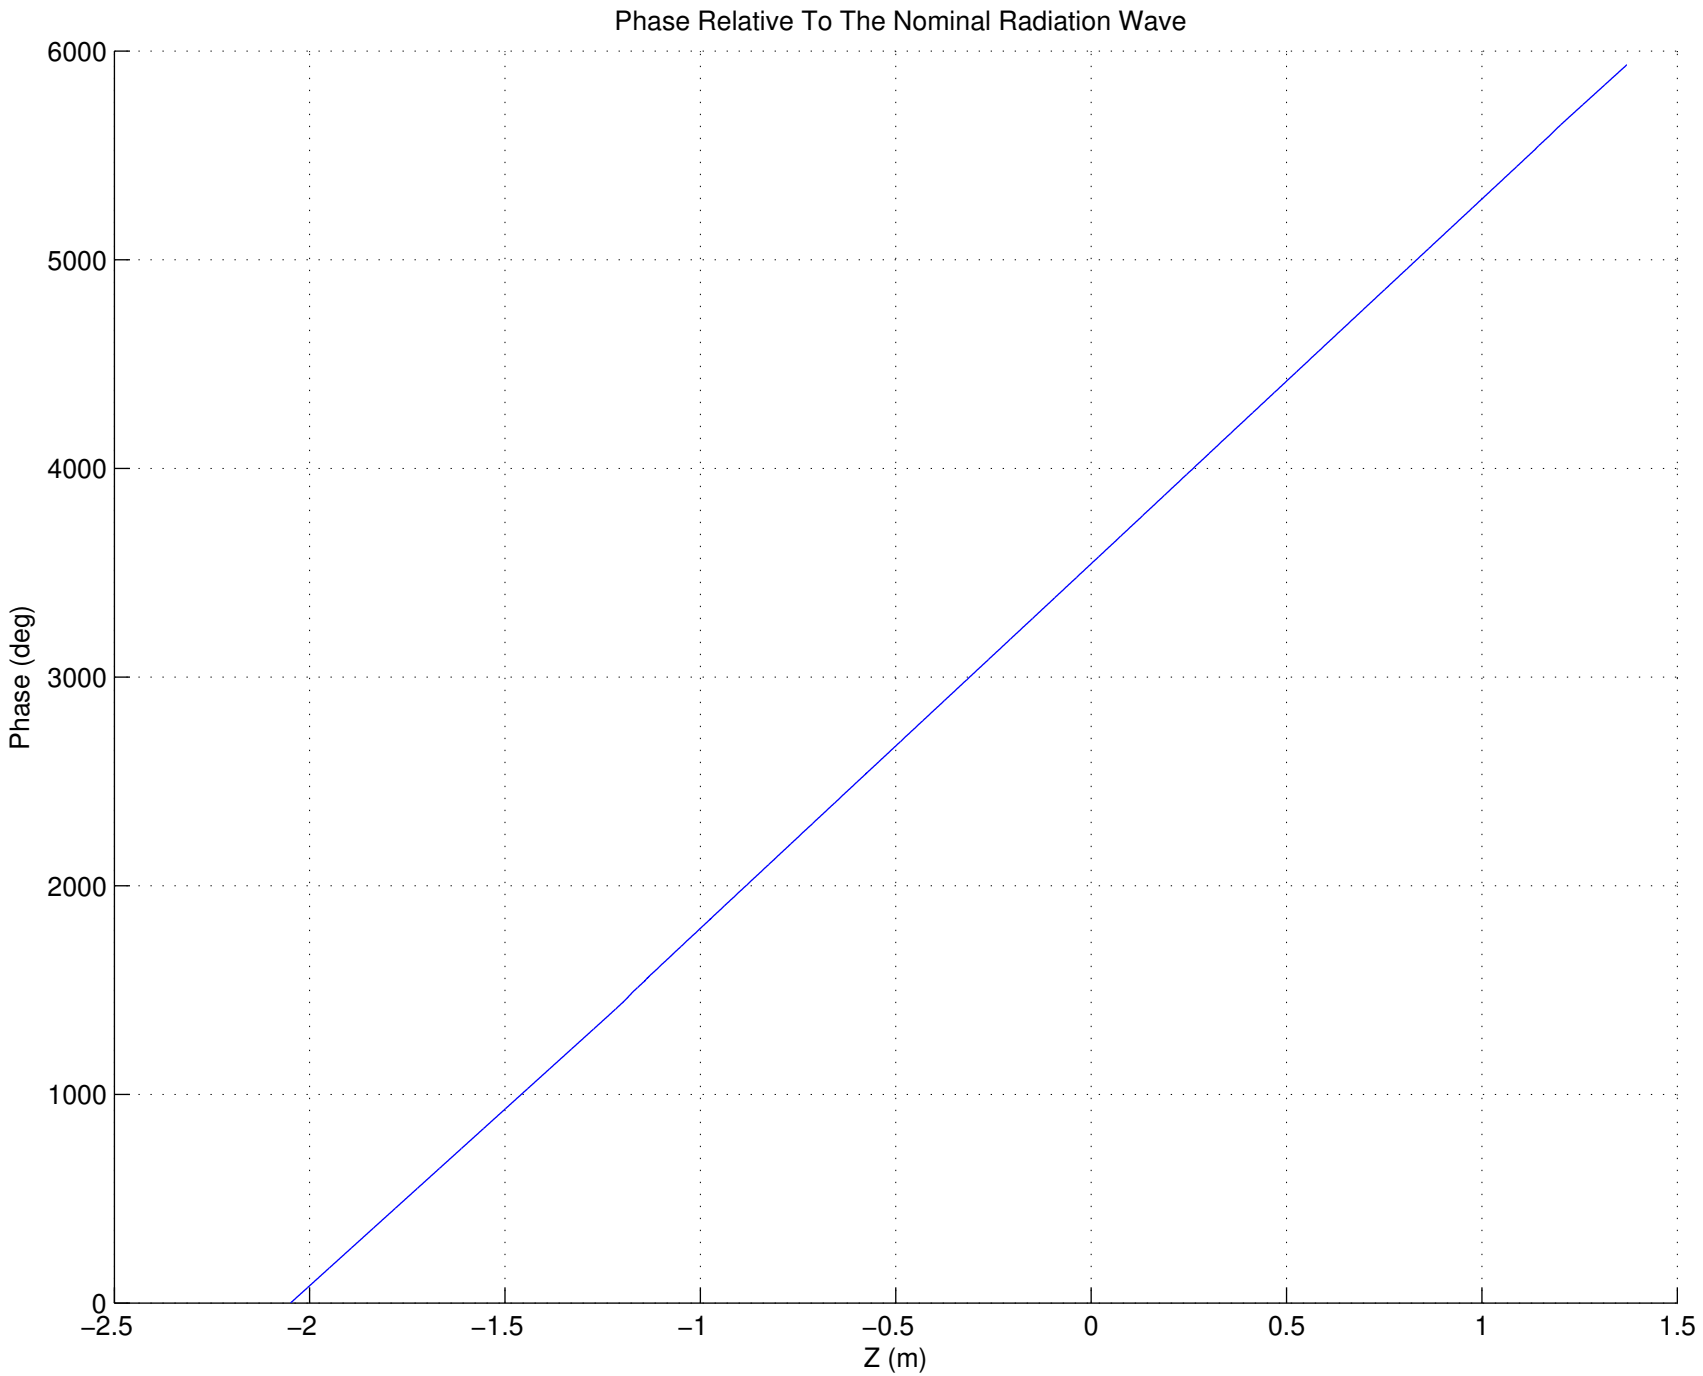
Phase Relative To The Nominal Radiation Wave
Phase (deg)
6000
5000
4000
3000
2000
1000
0
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
Z (m)