SLAC Magnetic Measurements

Planar Insertion Device Shim Analysis

Parameters:
INPUT−FILE−DIR =S:\MagData\LCLS\Undulator\L143−112000−03\DATASET0001\Fine Tuning\Z Scans\Run 017\
INPUT−FILE−NAME =bscanz−dat.001
INPUT−FILE−TYPE =ZVXYBXYH
CORR−REQUIRED =0
CORR−FILE =c:\Magdata\Earth Field Correction\earth−field−corr.dat
CORR−FILE−TYPE =CORR−ZBXY
GAMMA =26641.85
NOM−LAMBDA−U =0.03
NOM−K−VALUE =3.489
NOM−LAMBDA−R =1.5e−010
NUM−POLES =226
NUM−END−POLES =4
CELL−LENGTH =3.656

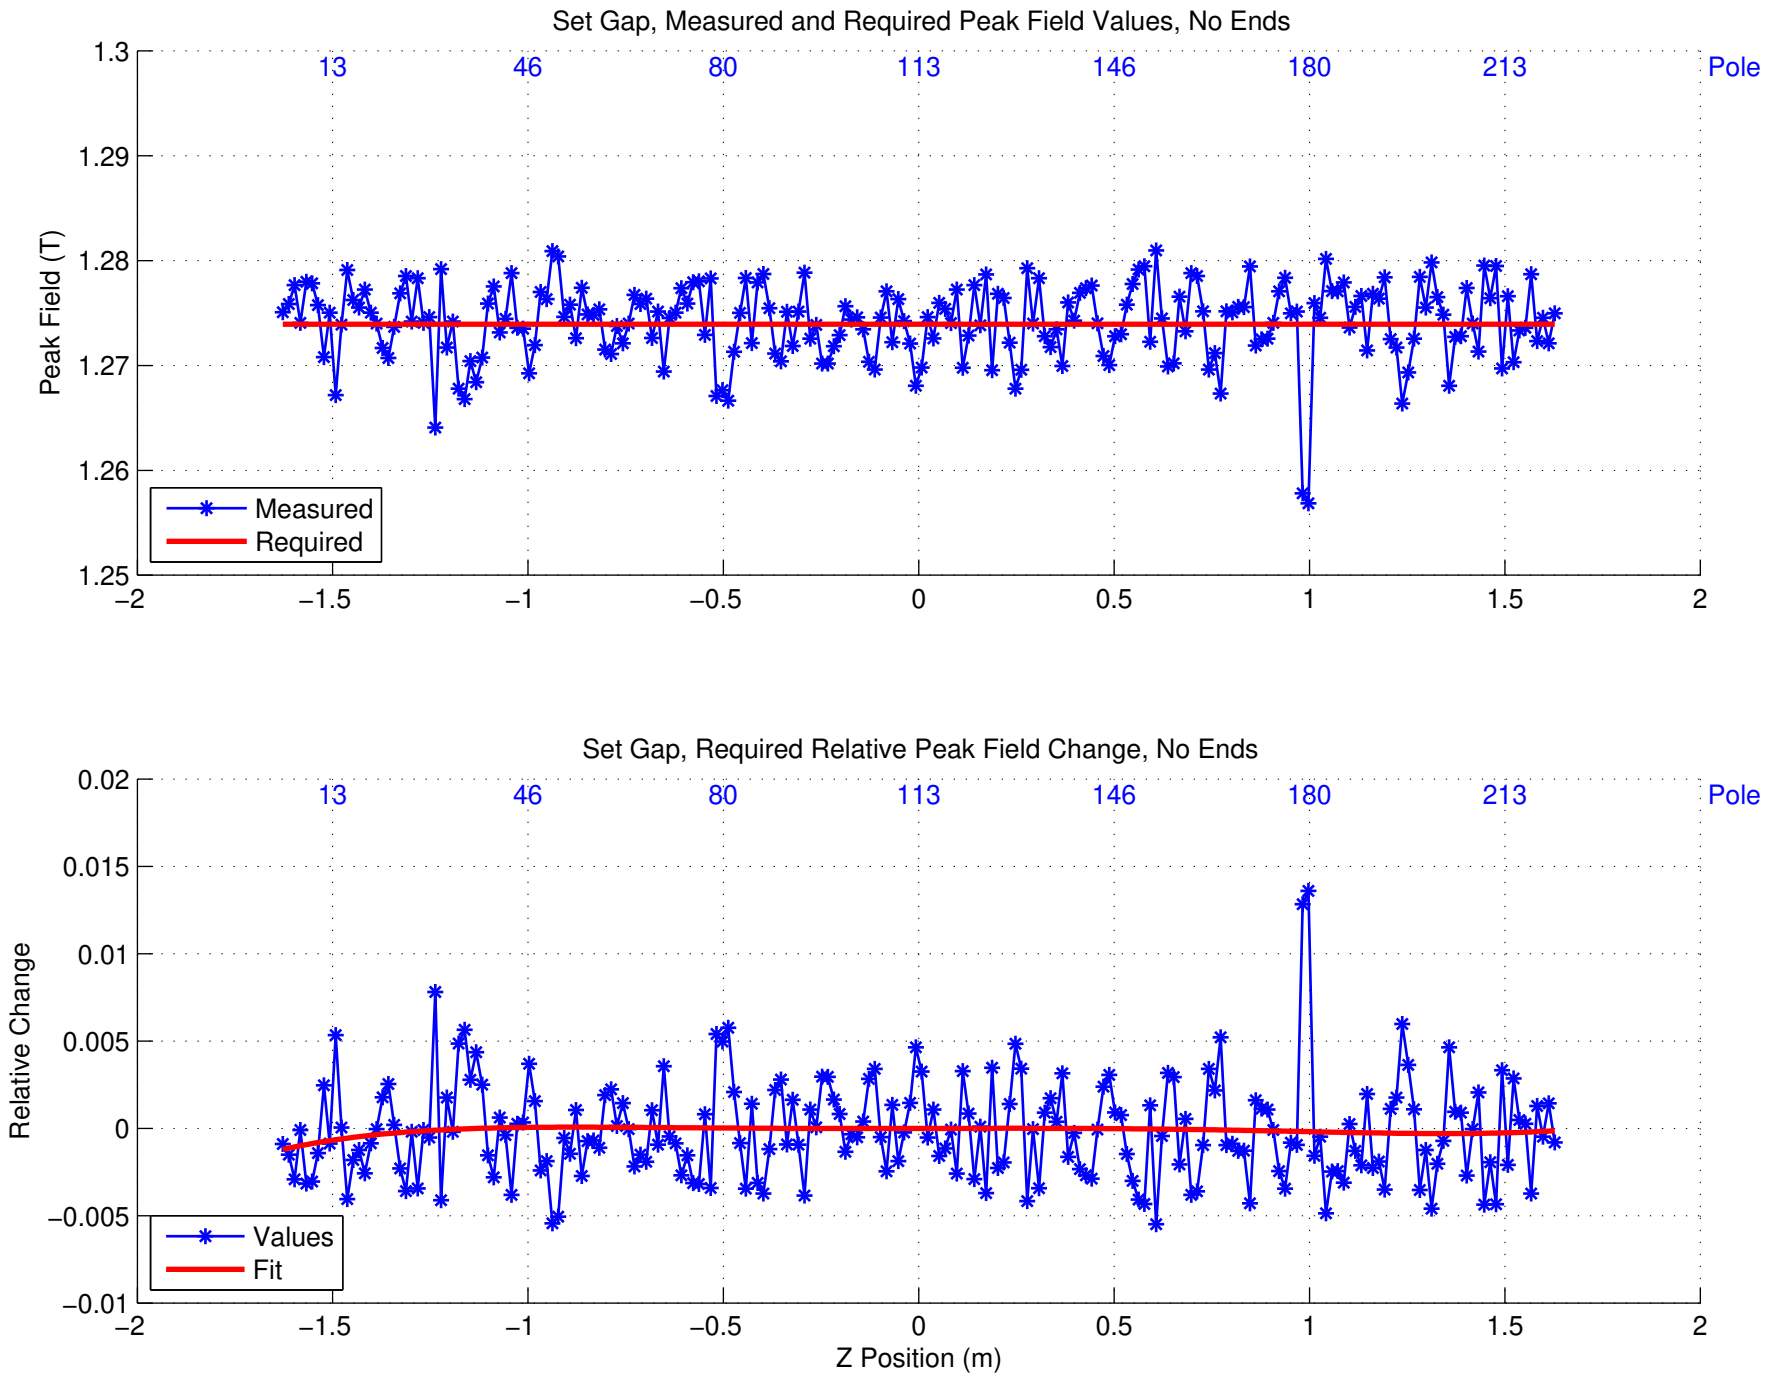
Set Gap, Measured and Required Peak Field Values, No Ends
13
46
80
113
146
180
213
Pole
Peak Field (T)
1.3
1.29
1.28
1.27
1.26
1.25
Measured
Required
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Set Gap, Required Relative Peak Field Change, No Ends
Relative Change
0.02
0.015
0.01
0.005
0
−0.005
−0.01
Values
Fit
Z Position (m)

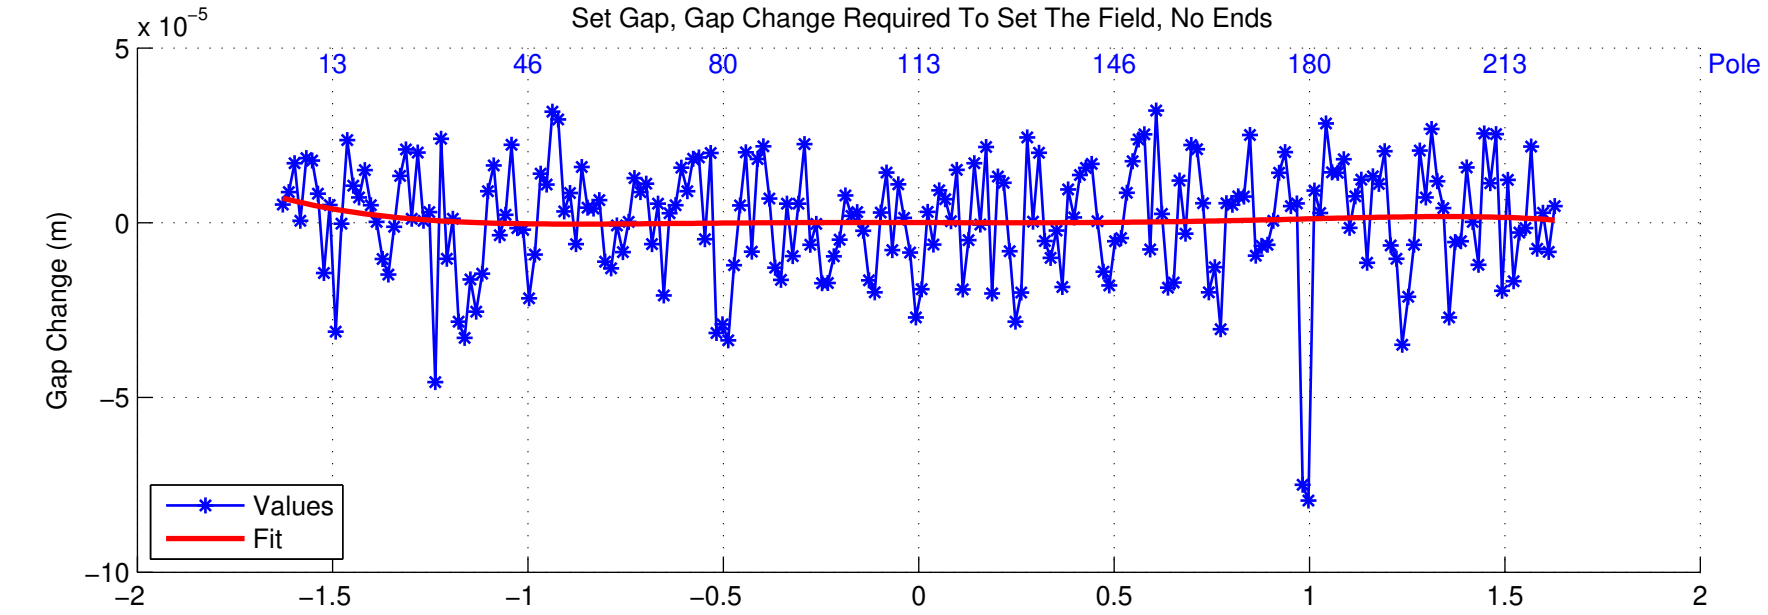
Set Gap, Gap Change Required To Set The Field, No Ends
x 10^-5
Gap Change (m)
5
0
−5
−10
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Values
Fit

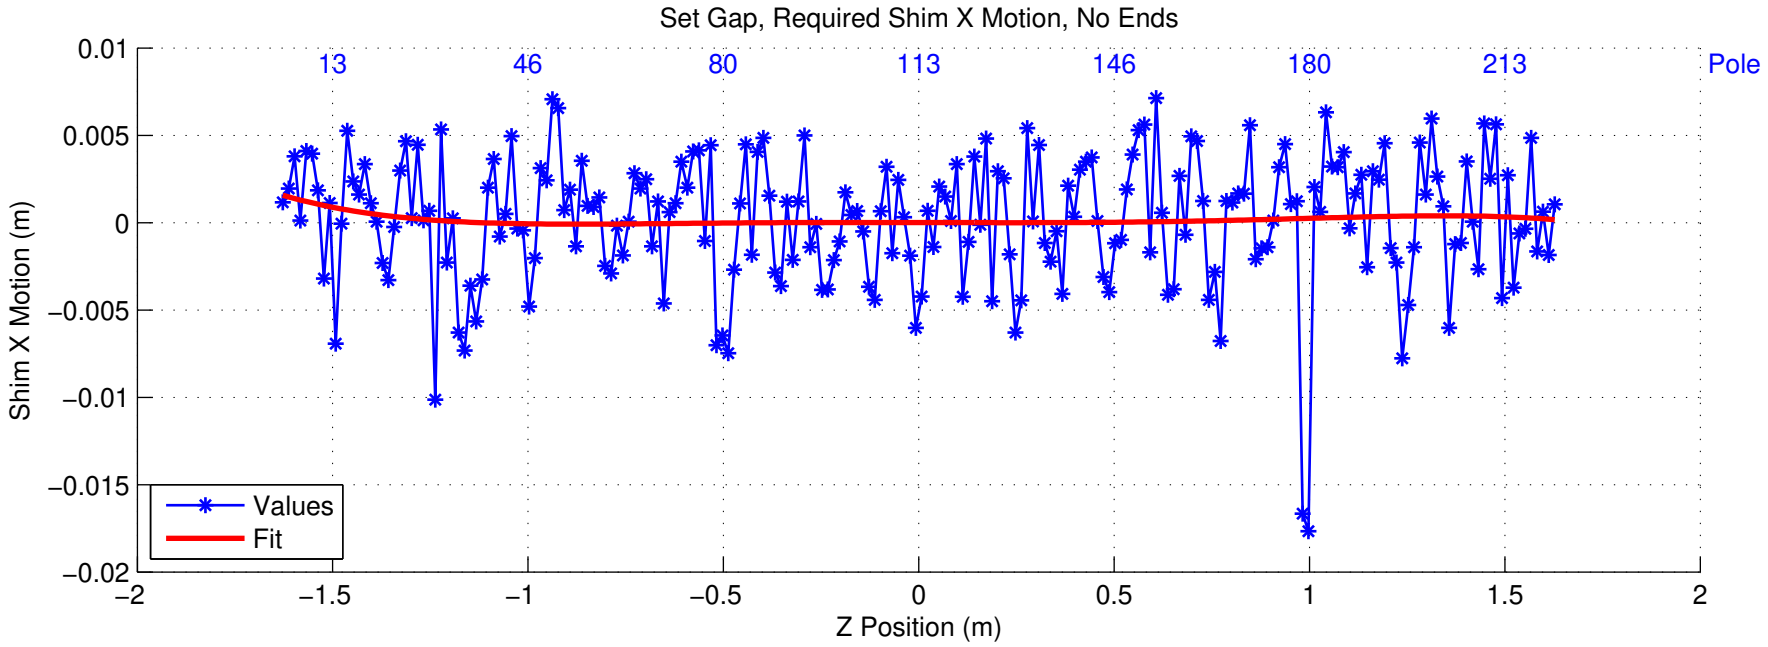
Set Gap, Required Shim X Motion, No Ends
Shim X Motion (m)
0.01
0.005
0
−0.005
−0.01
−0.015
−0.02
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Values
Fit

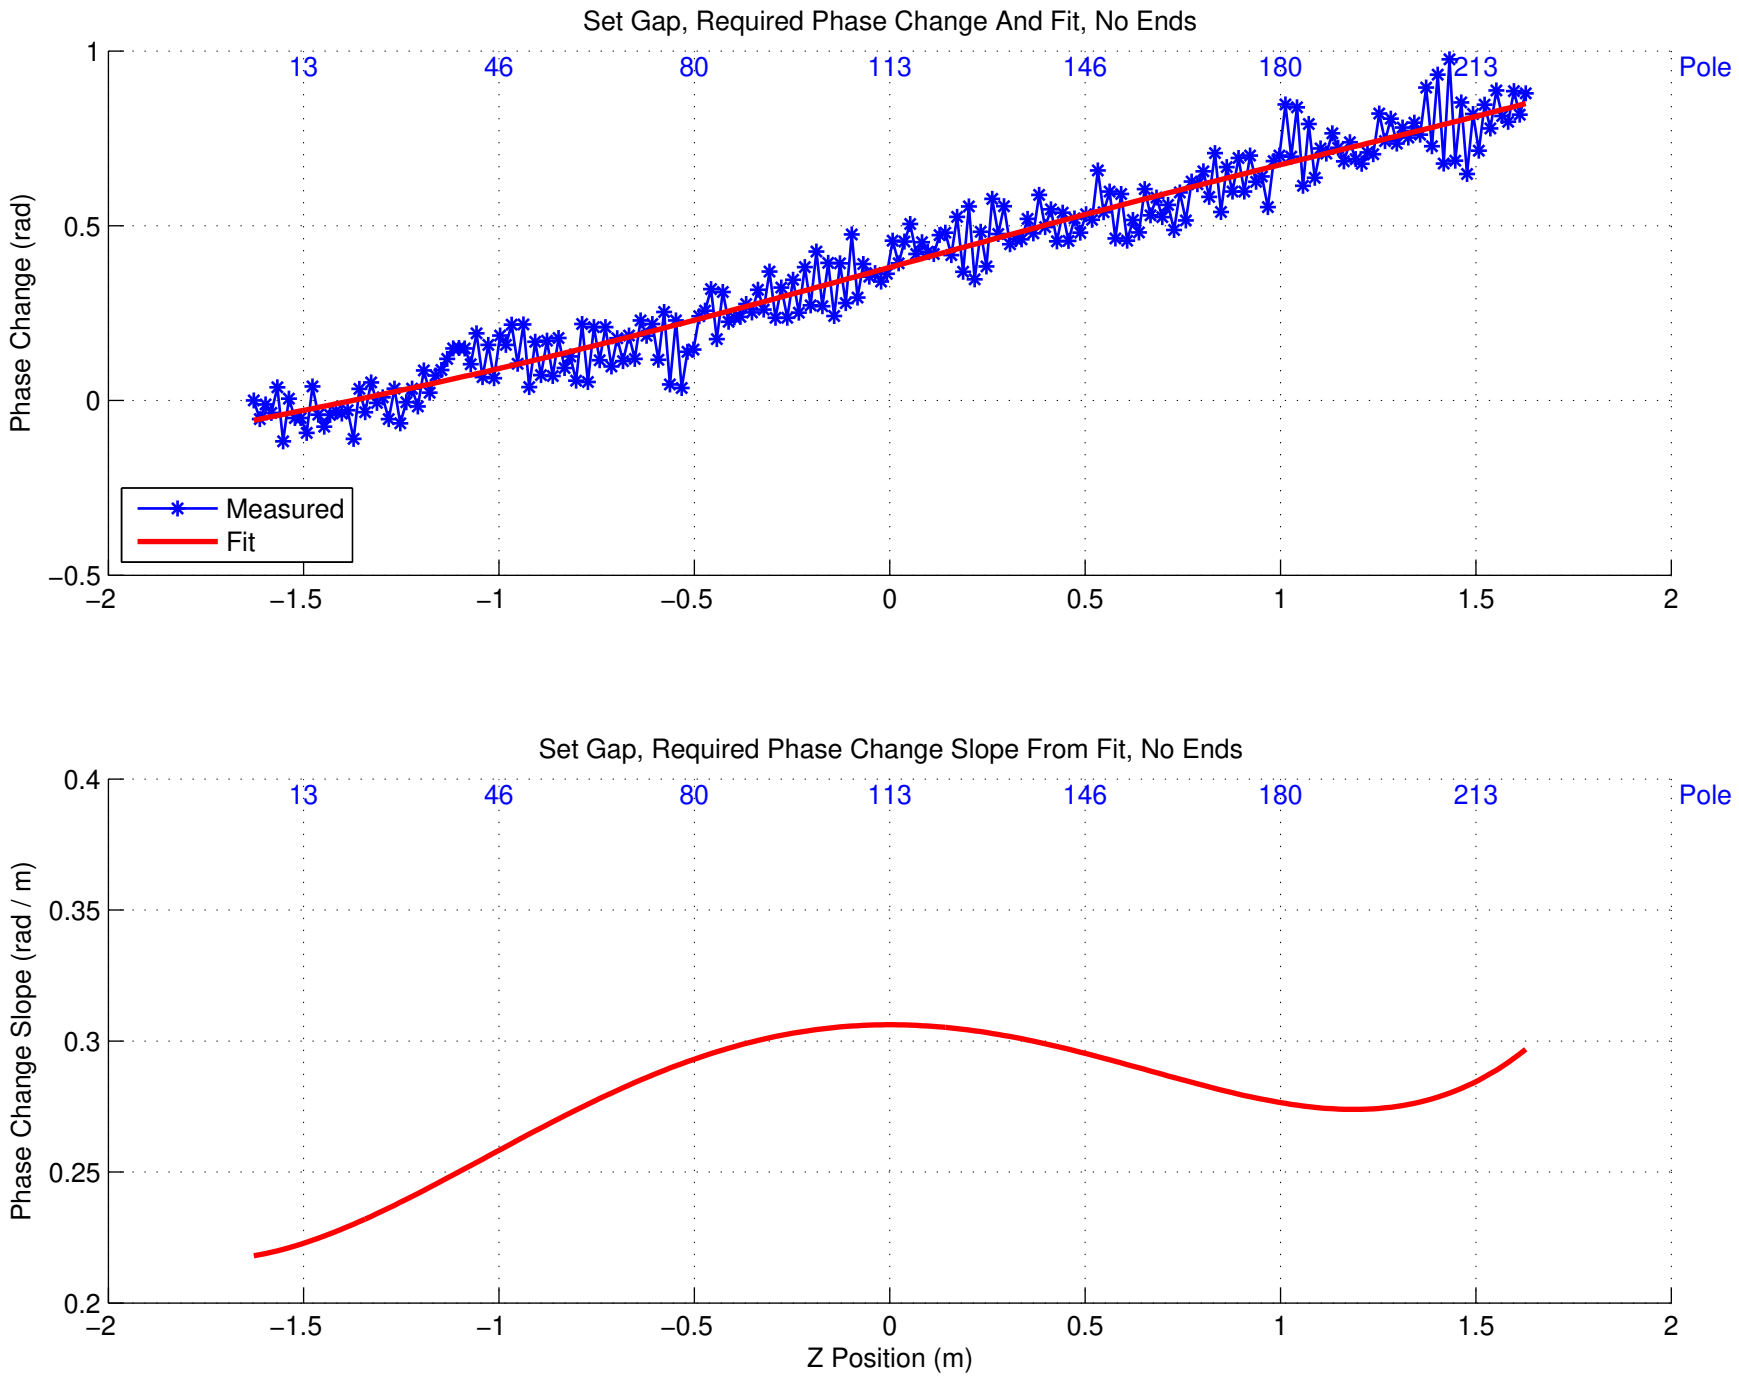
Set Gap, Required Phase Change And Fit, No Ends
13
46
80
113
146
180
213
Pole
Phase Change (rad)
1
0.5
0
−0.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Measured
Fit
Set Gap, Required Phase Change Slope From Fit, No Ends
Phase Change Slope (rad / m)
0.4
0.35
0.3
0.25
0.2
Z Position (m)

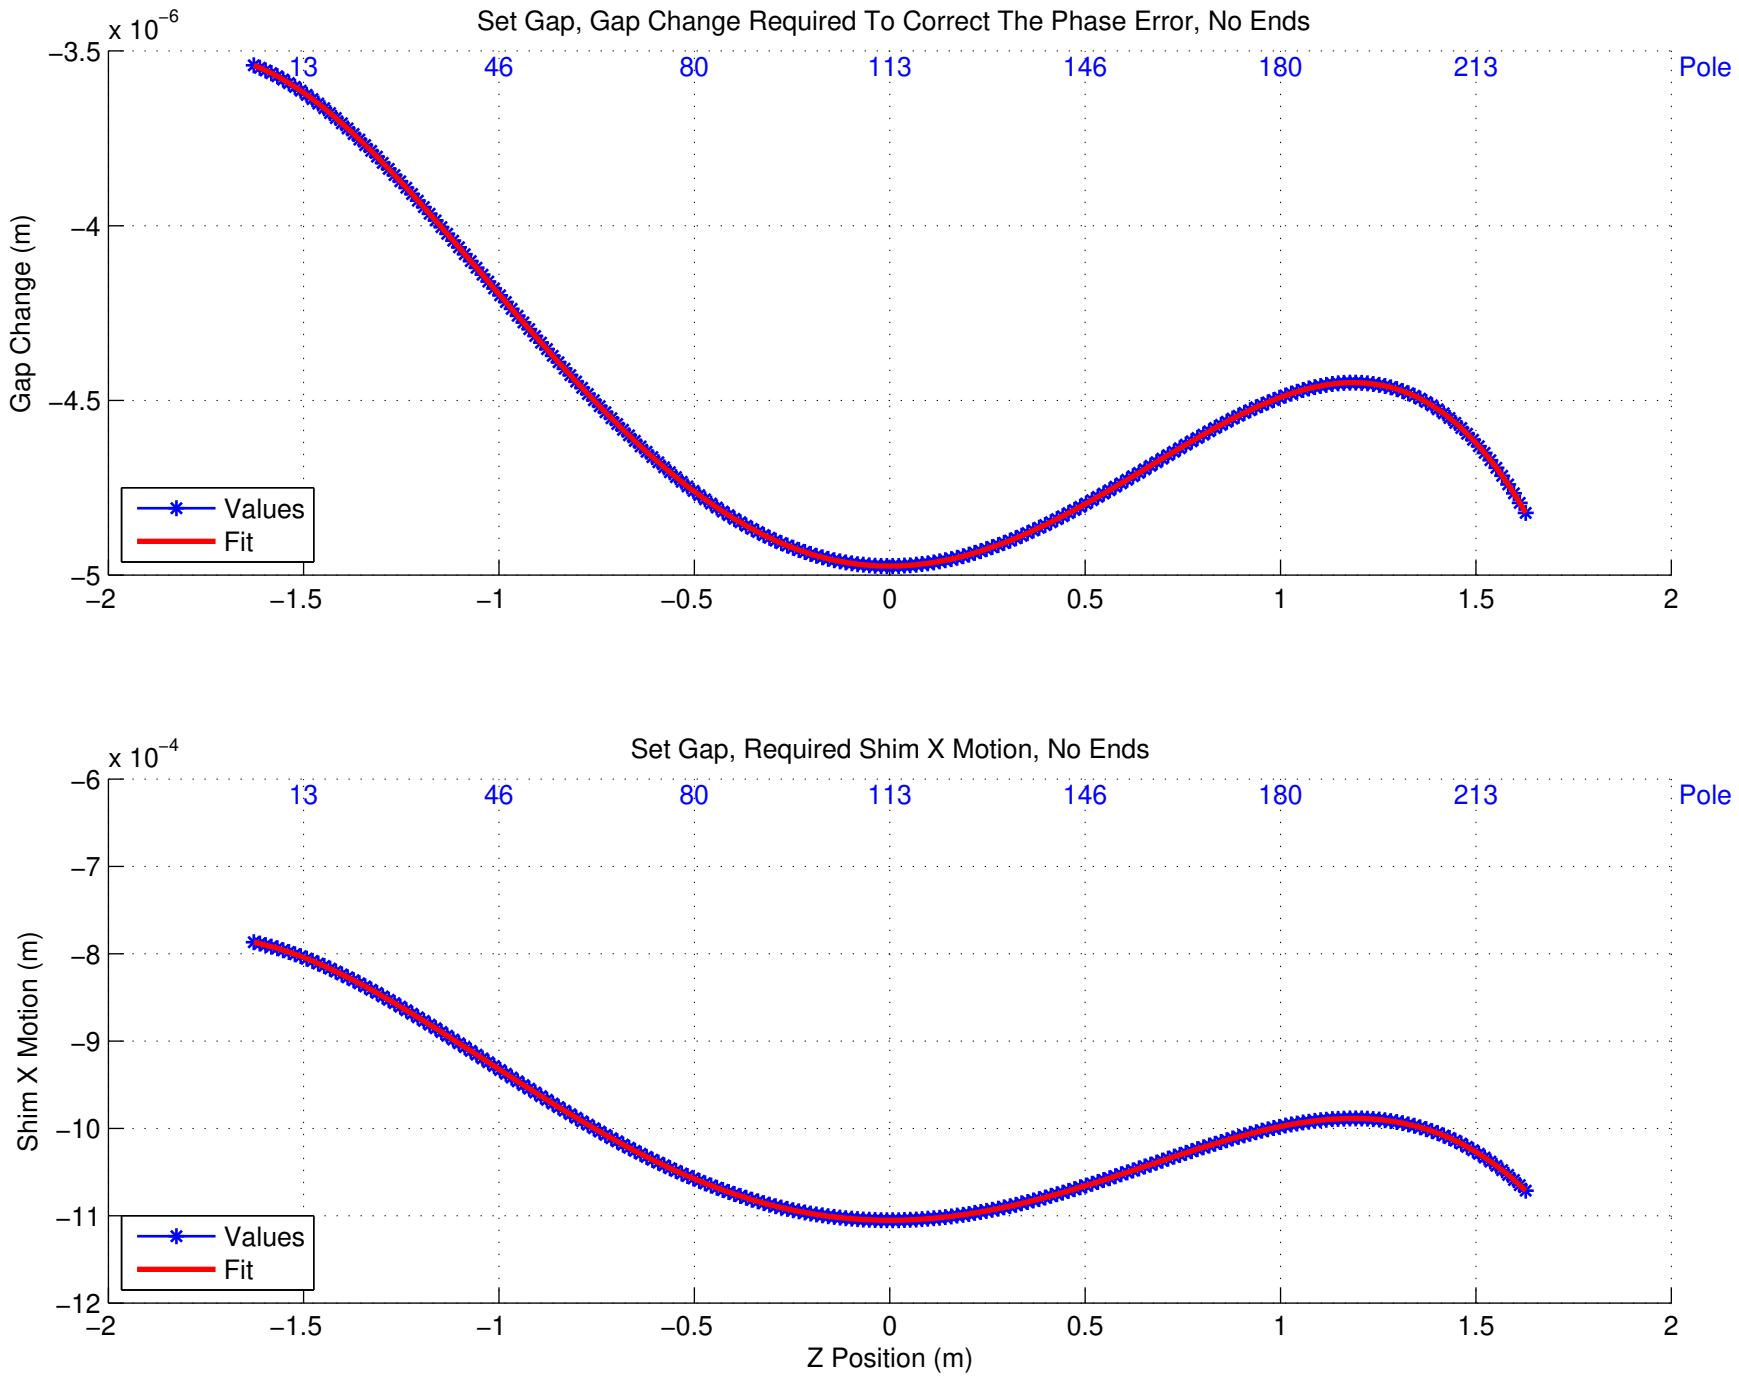
Set Gap, Gap Change Required To Correct The Phase Error, No Ends
x 10^-6
−3.5
−4
−4.5
−5
Gap Change (m)
13
46
80
113
146
180
213
Pole
Values
Fit
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Set Gap, Required Shim X Motion, No Ends
x 10^-4
−6
−7
−8
−9
−10
−11
−12
Shim X Motion (m)
Z Position (m)

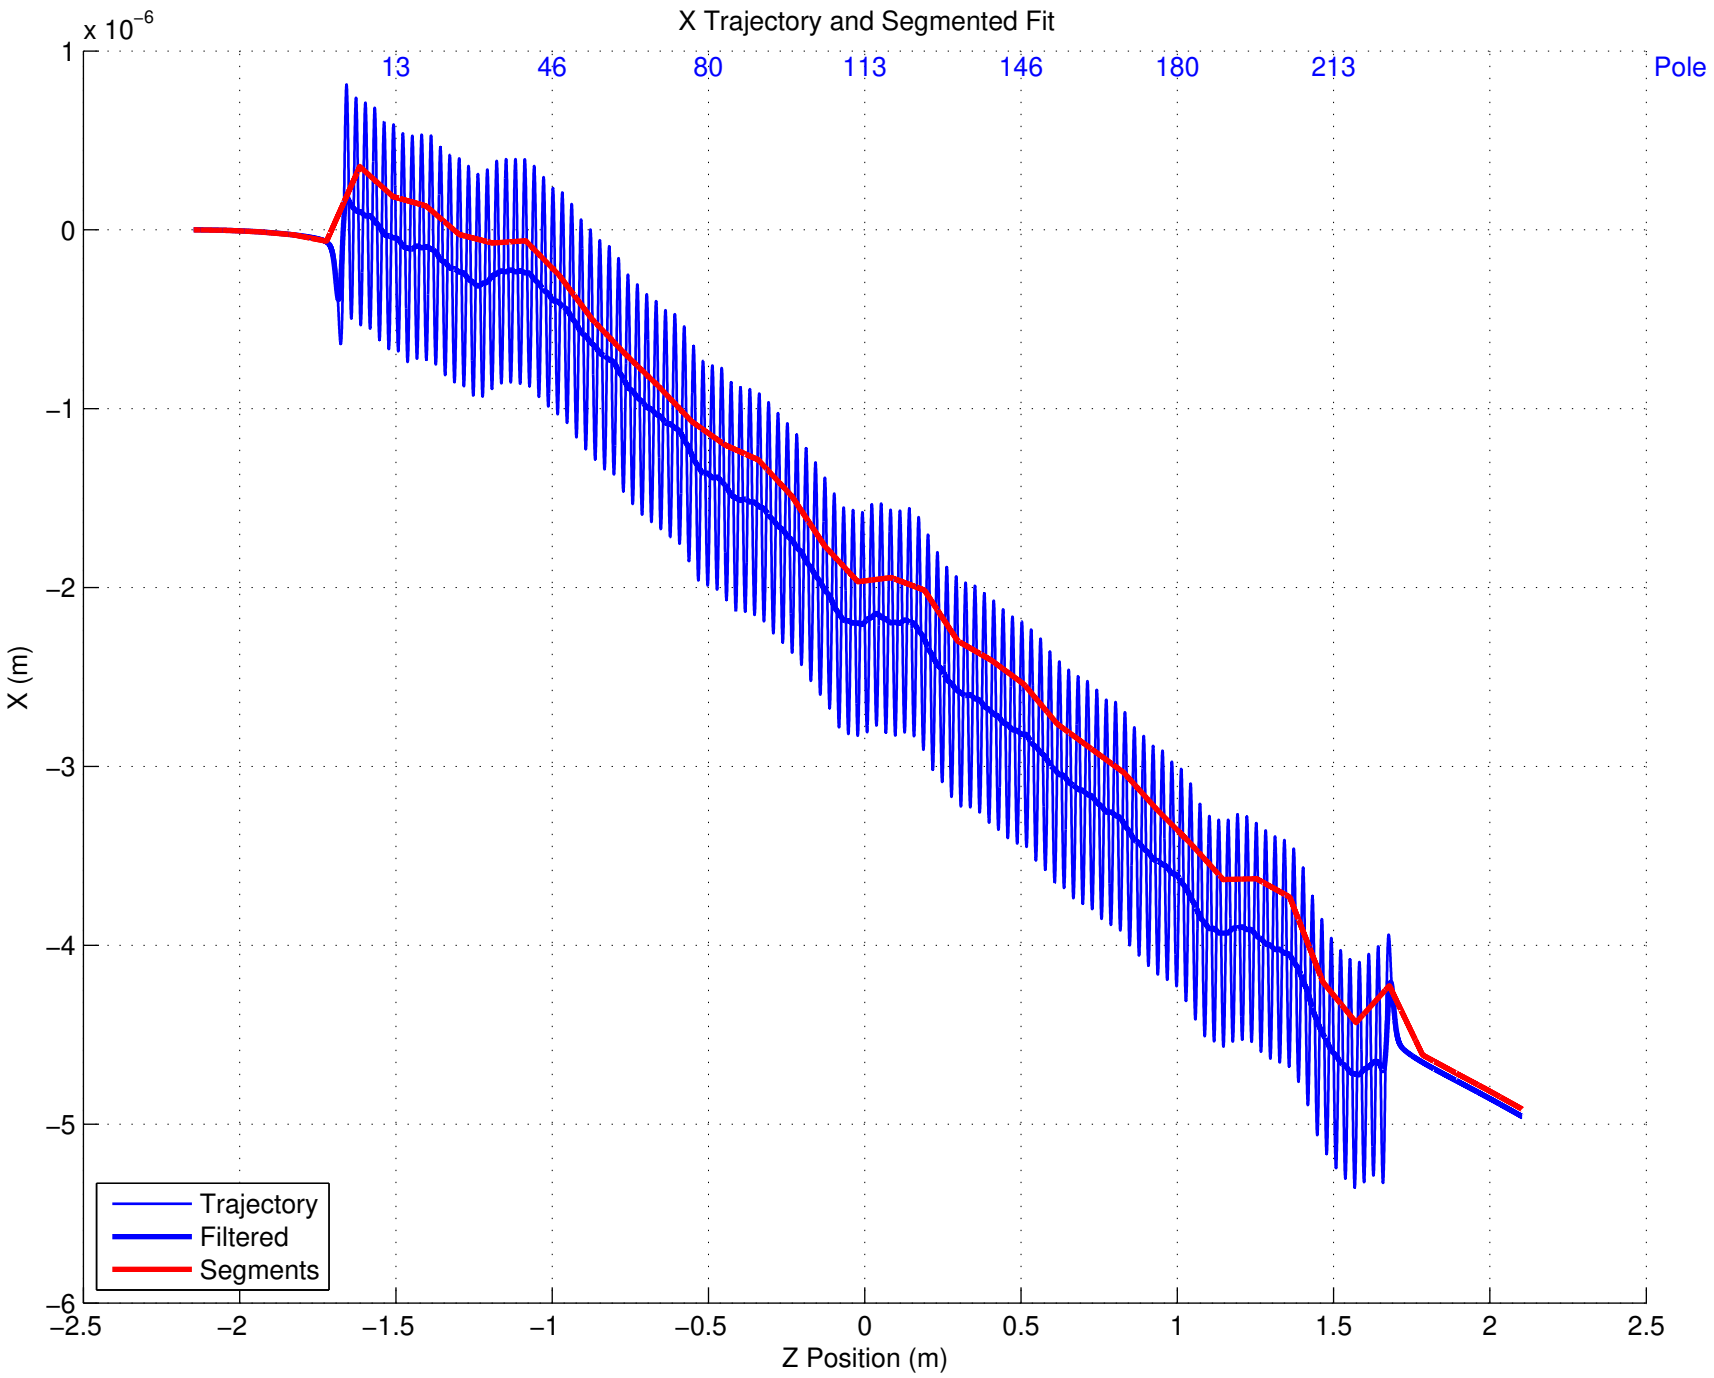
X Trajectory and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
1
0
−1
−2
−3
−4
−5
−6
X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
2.5
Z Position (m)
Trajectory
Filtered
Segments

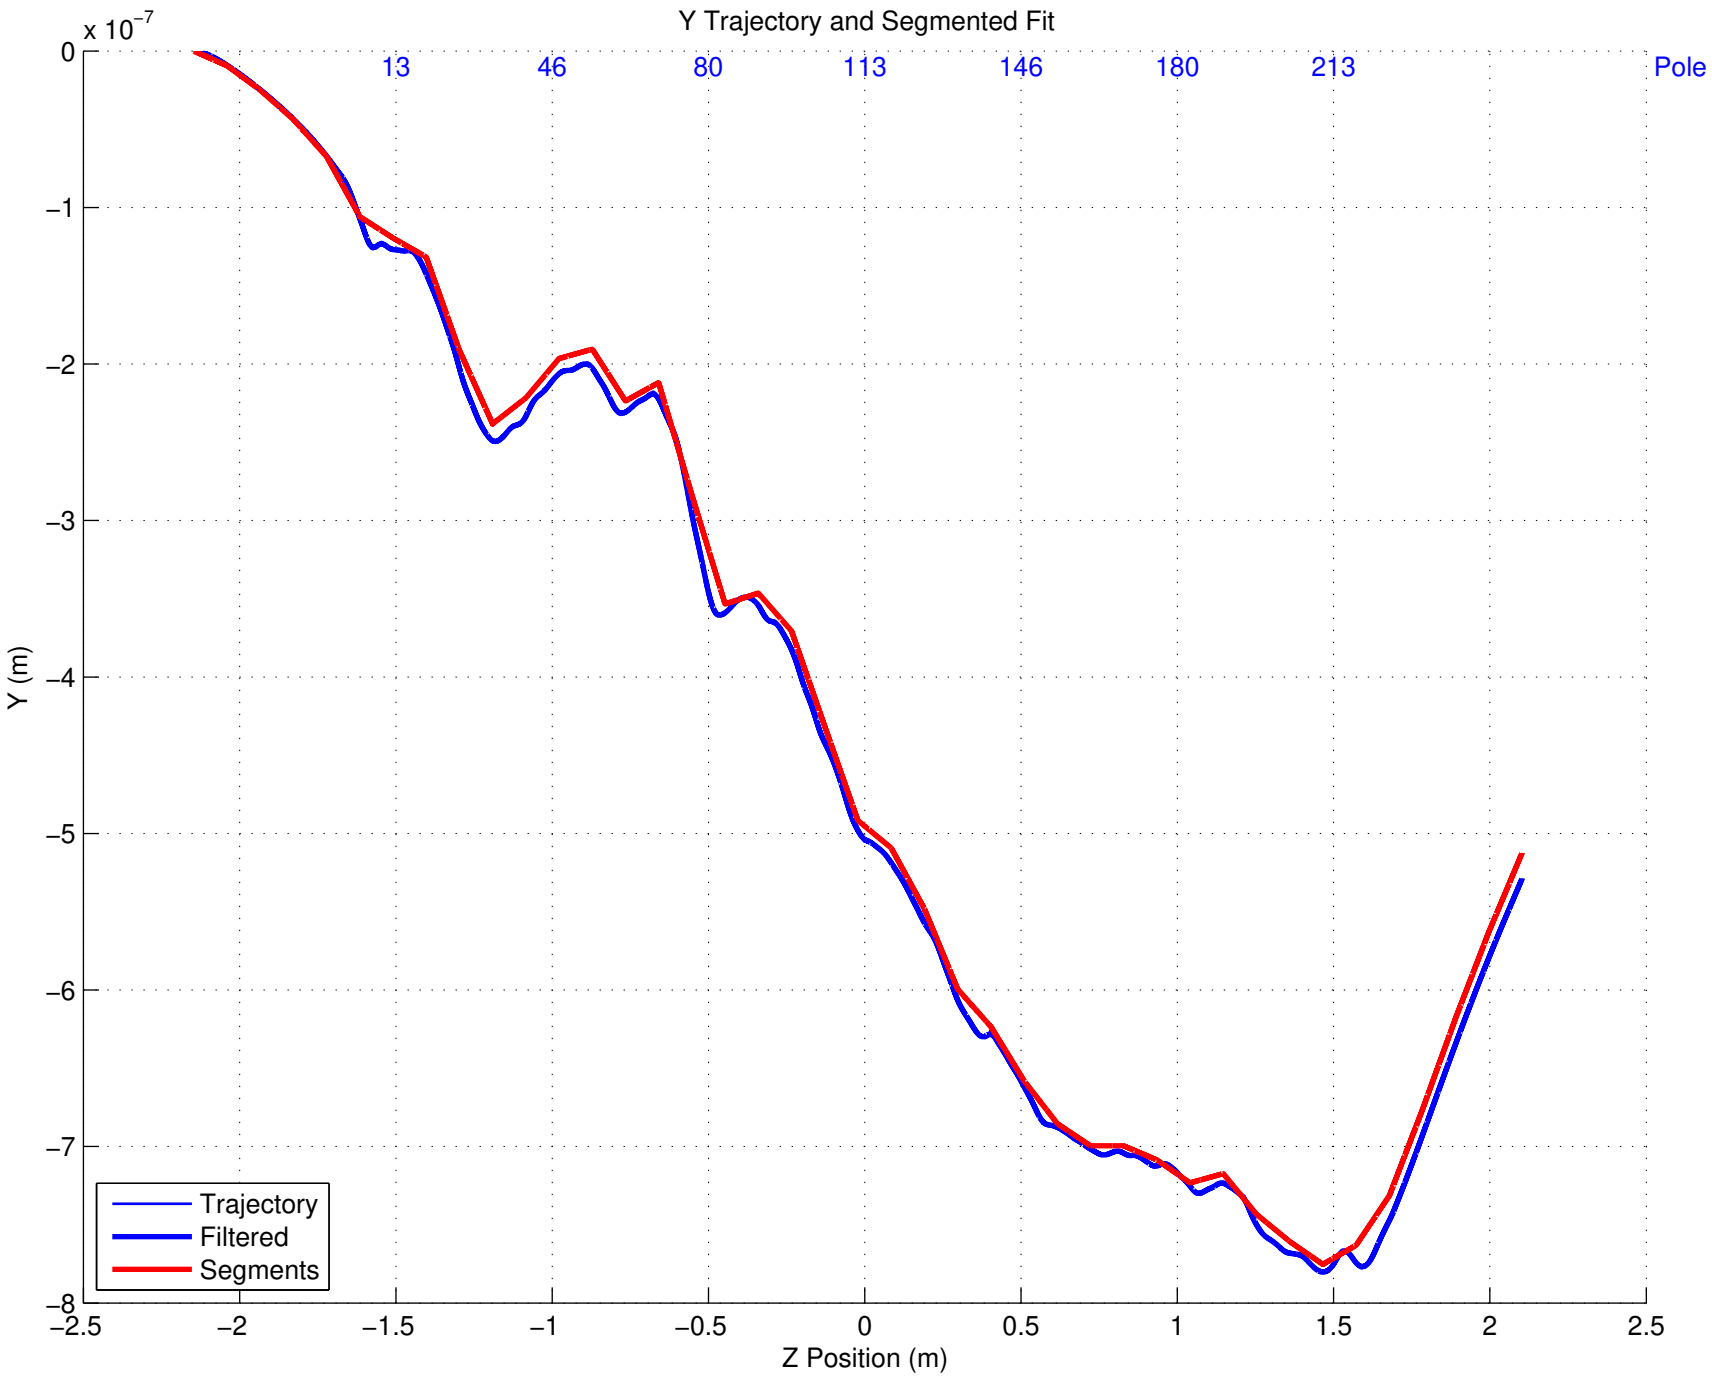
Y Trajectory and Segmented Fit
x 10^-7
13
46
80
113
146
180
213
Pole
0
−1
−2
−3
−4
−5
−6
−7
−8
Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
2.5
Z Position (m)
Trajectory
Filtered
Segments

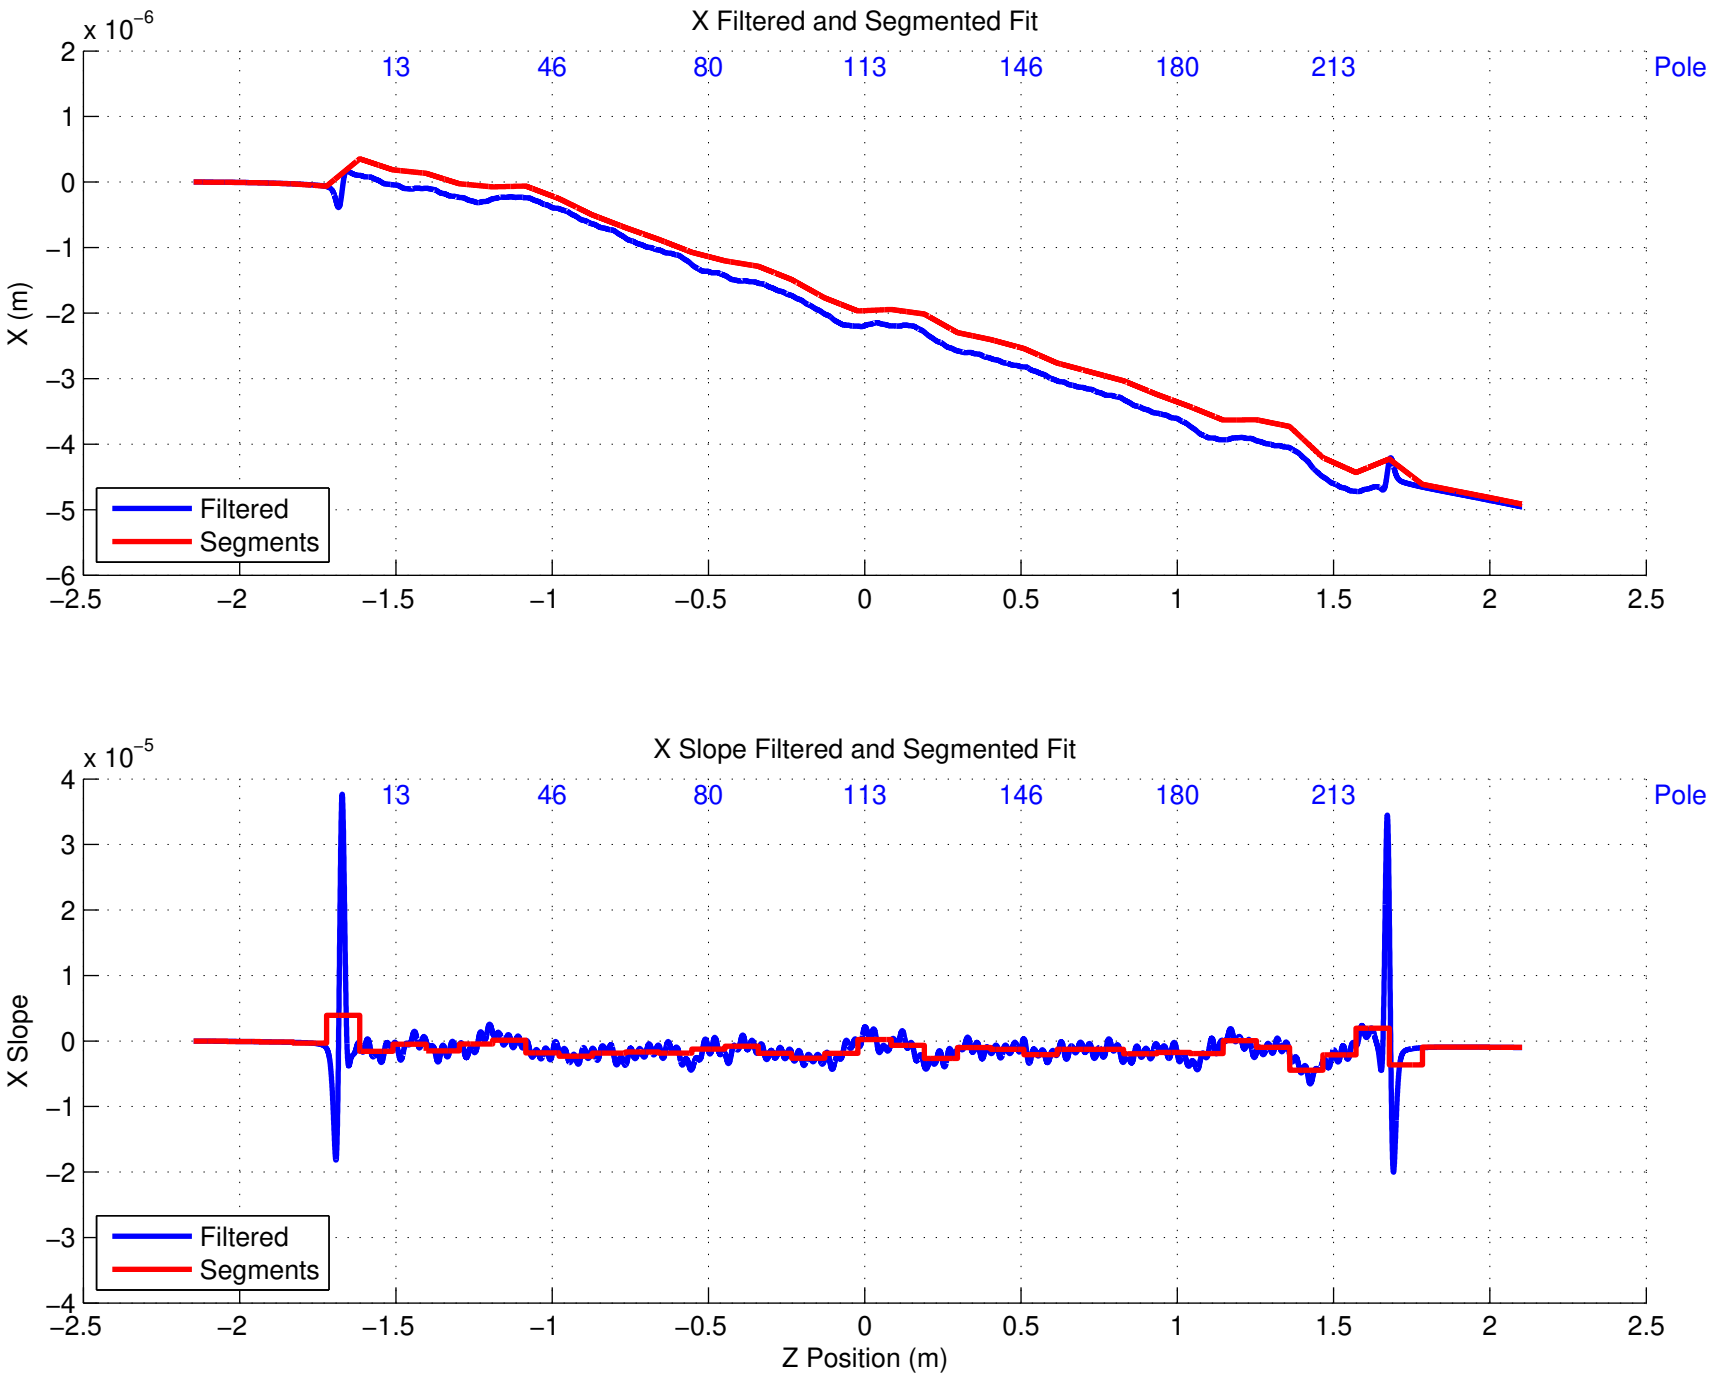
X Filtered and Segmented Fit
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
X Slope Filtered and Segmented Fit
x 10^-5
X Slope
Z Position (m)

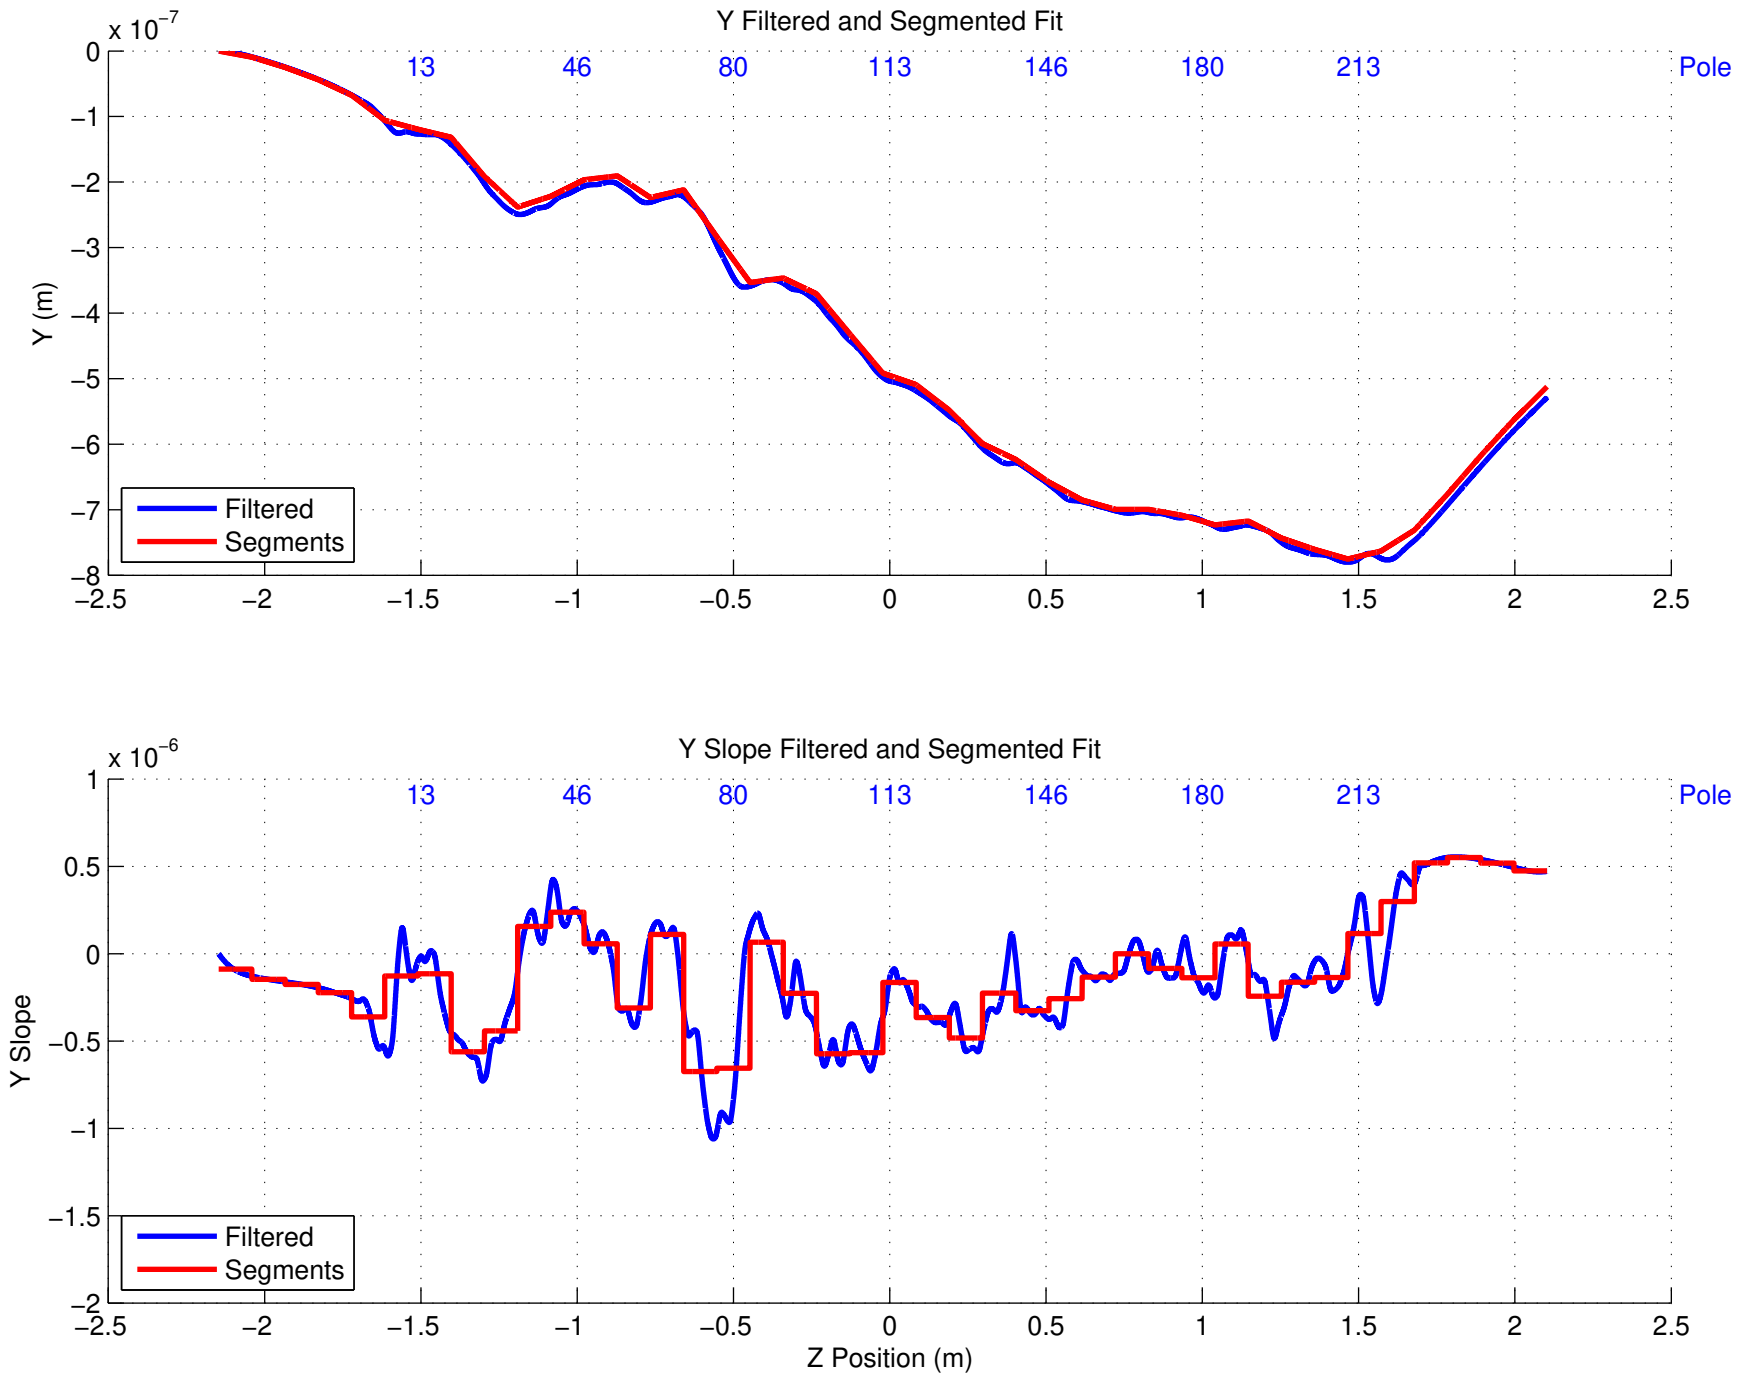
Y Filtered and Segmented Fit
x 10^-7
13
46
80
113
146
180
213
Pole
Y (m)
Filtered
Segments
Y Slope Filtered and Segmented Fit
x 10^-6
Y Slope
Z Position (m)

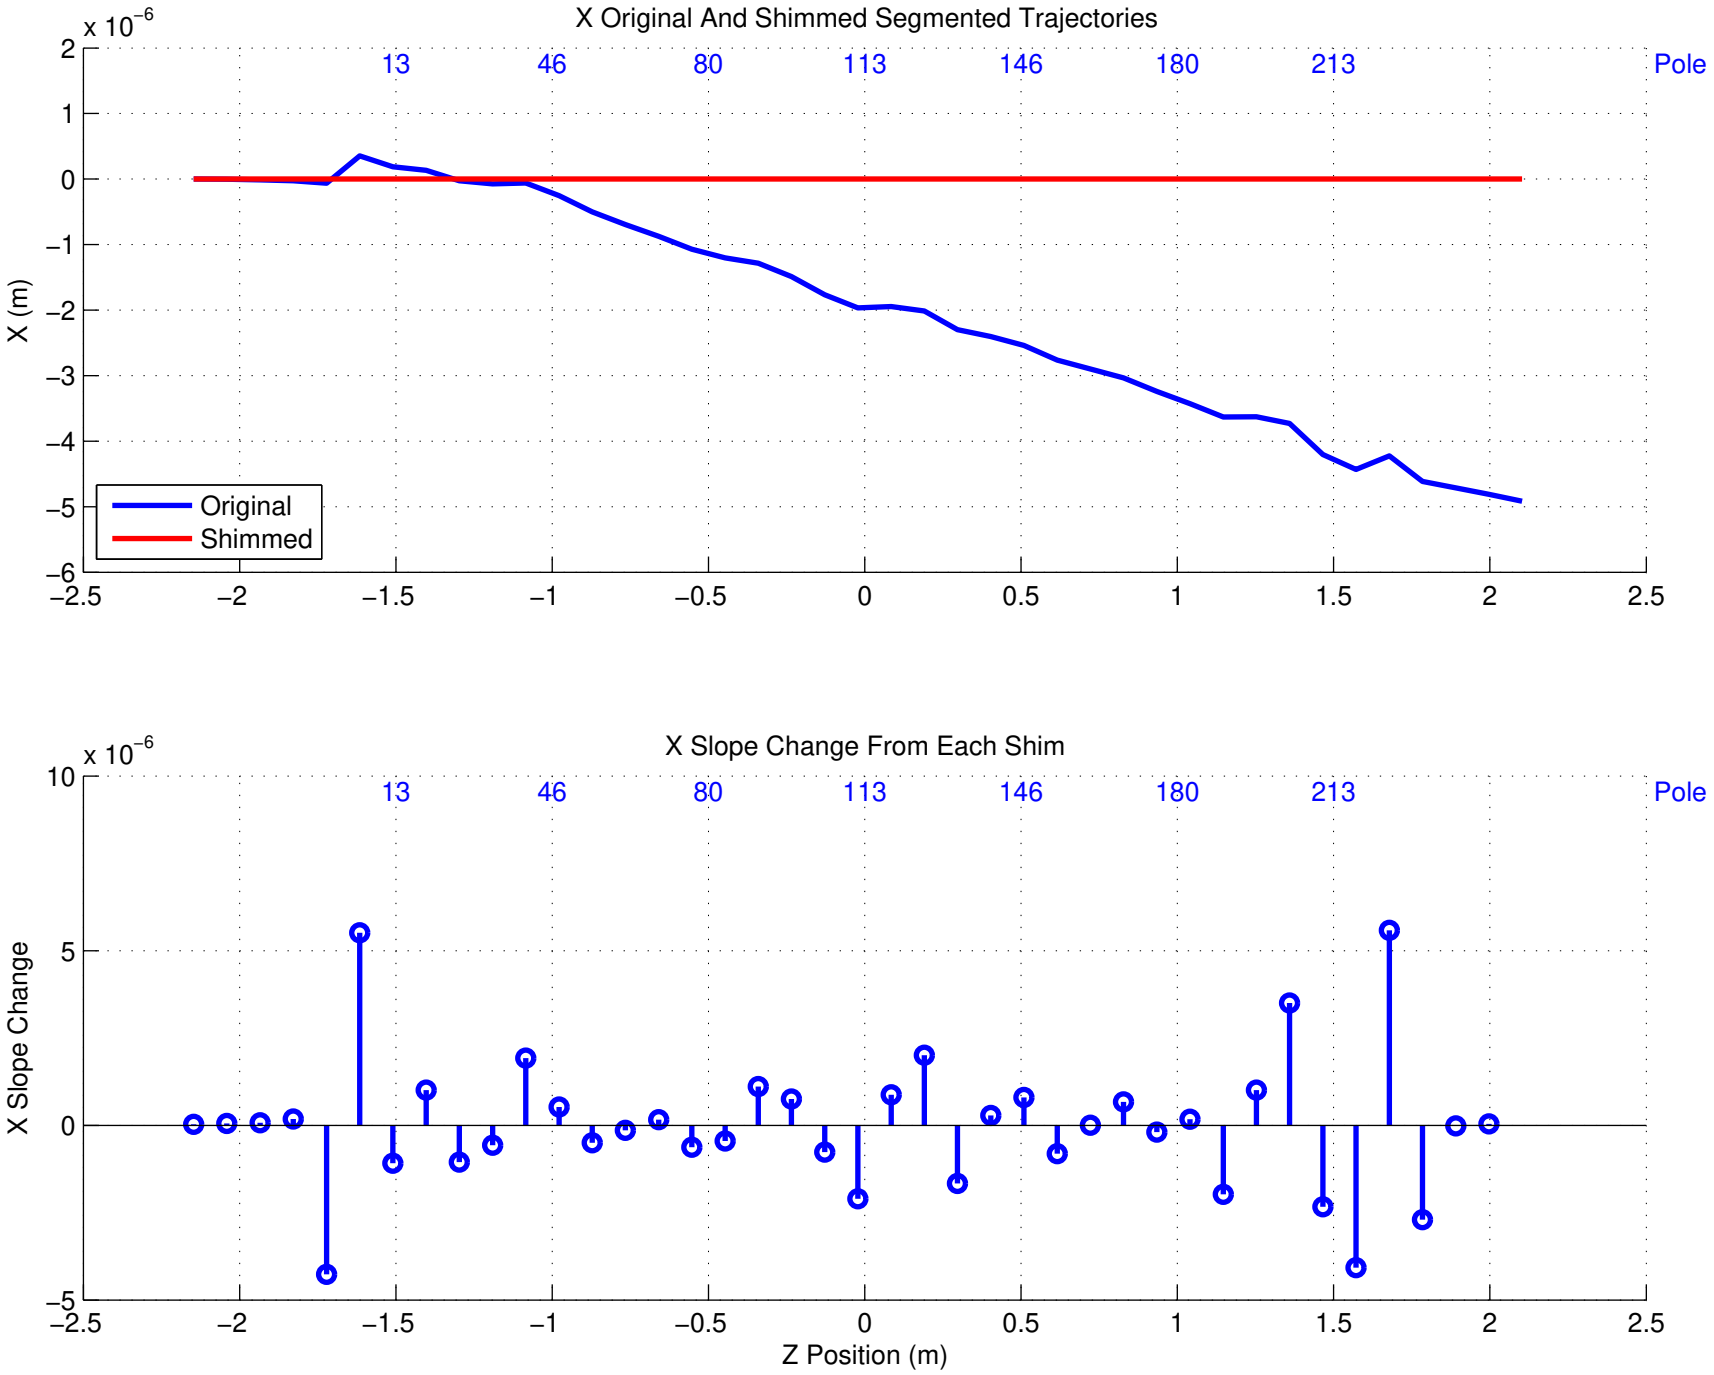
X Original And Shimmed Segmented Trajectories
x 10^-6
13
46
80
113
146
180
213
Pole
X (m)
Original
Shimmed
X Slope Change From Each Shim
X Slope Change
Z Position (m)

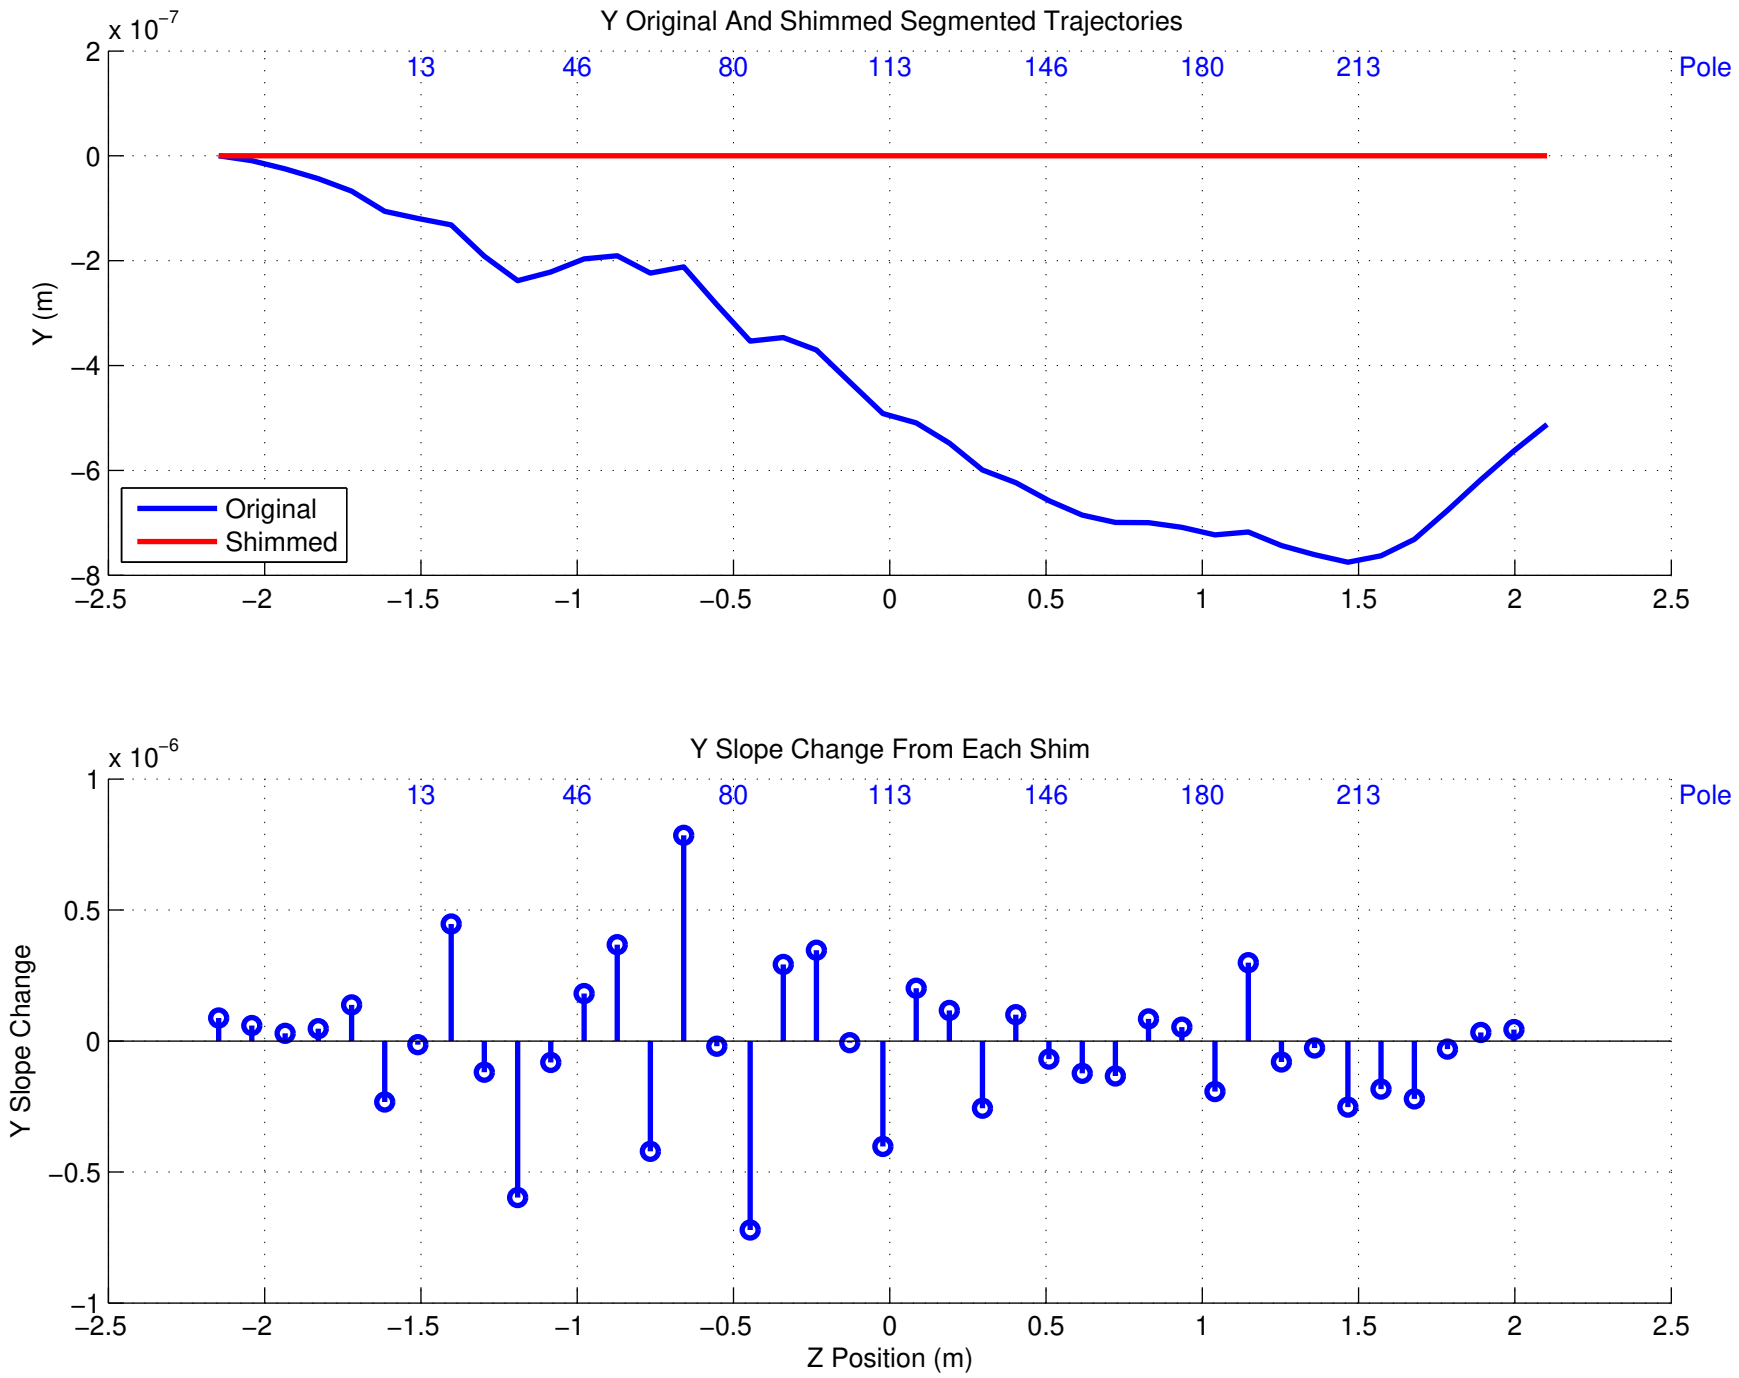
Y Original And Shimmed Segmented Trajectories
x 10^-7
13
46
80
113
146
180
213
Pole
Y (m)
Original
Shimmed
Y Slope Change From Each Shim
x 10^-6
Y Slope Change
Z Position (m)

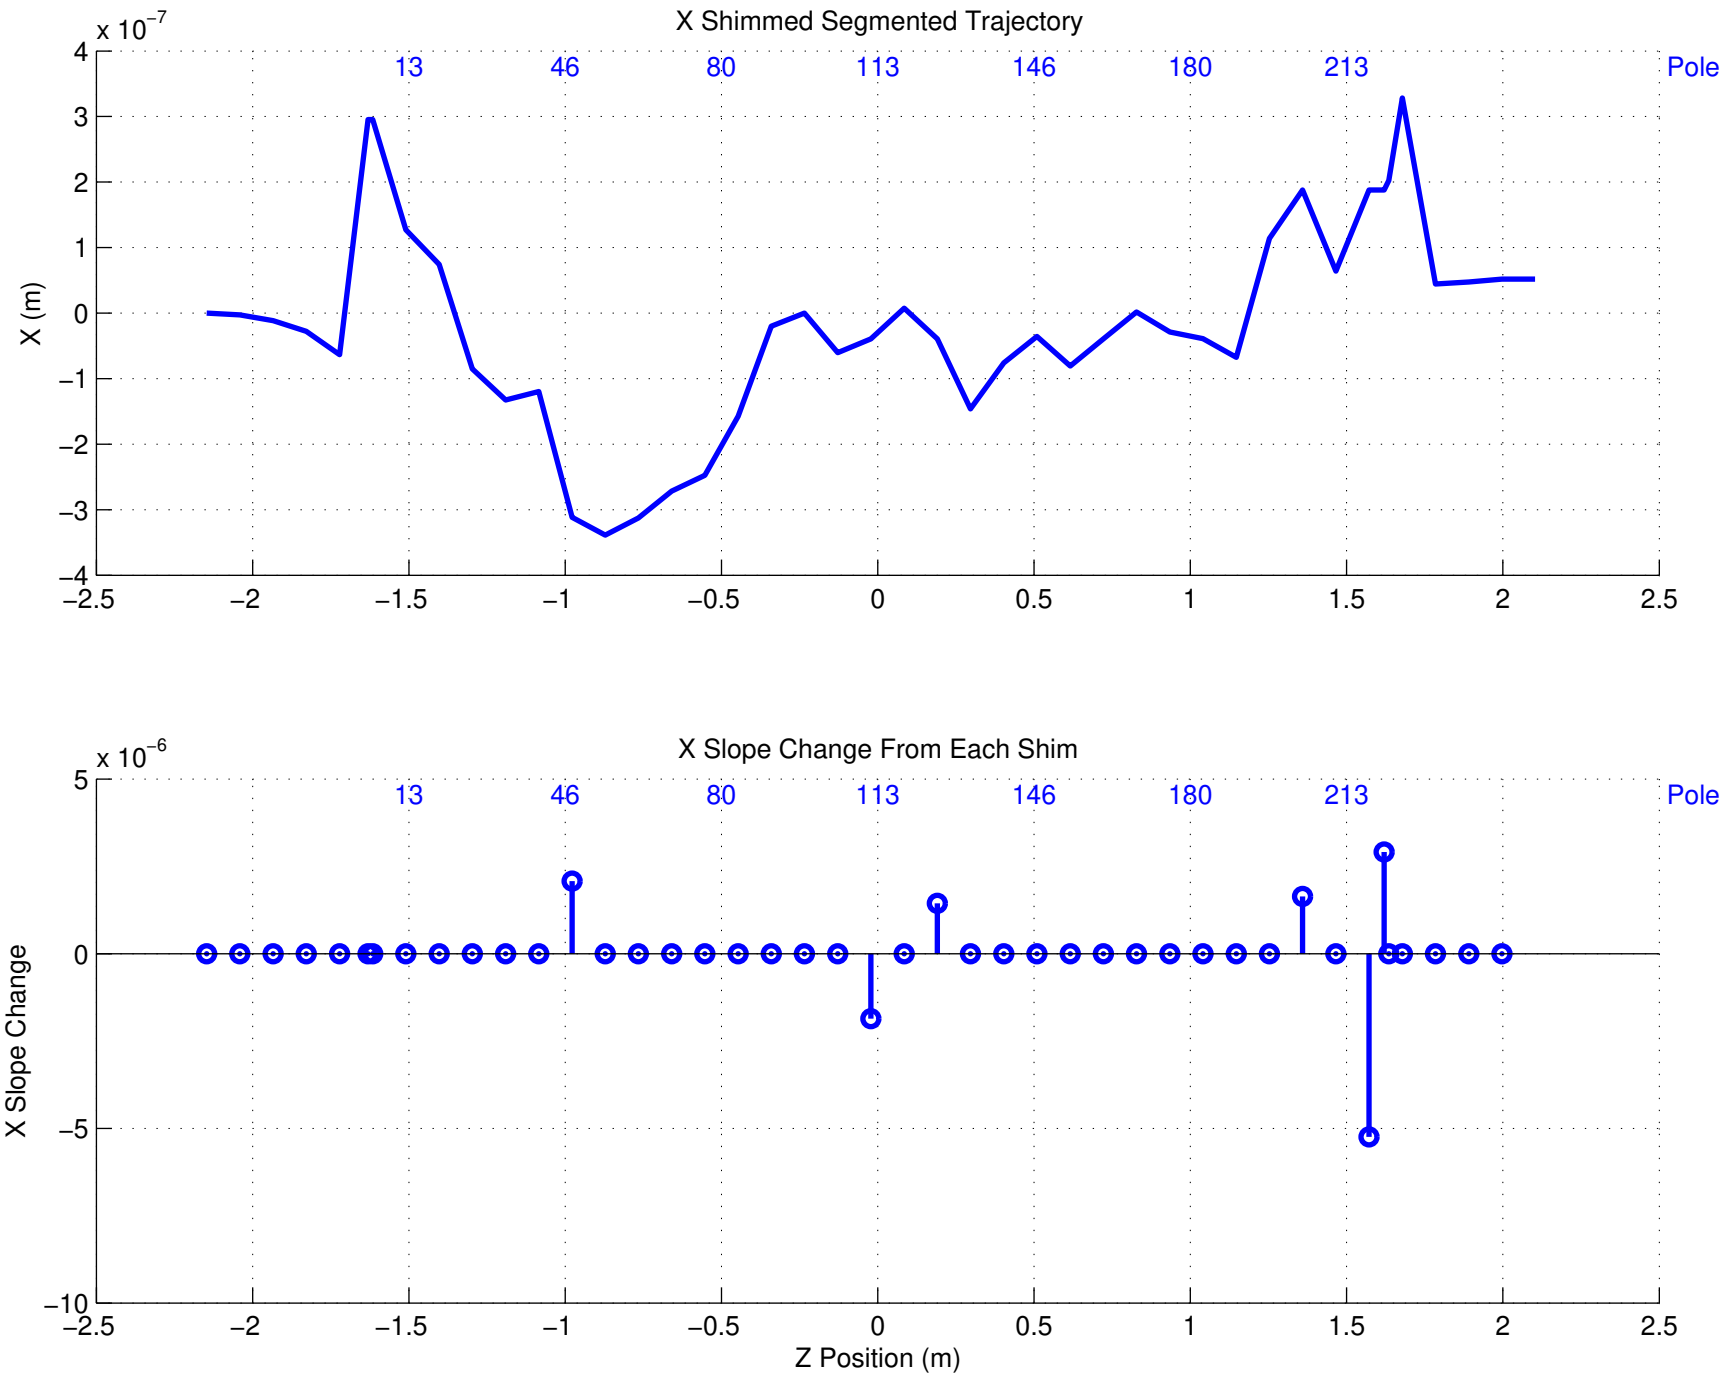
X Shimmed Segmented Trajectory
x 10^-7
X (m)
13
46
80
113
146
180
213
Pole
X Slope Change From Each Shim
x 10^-6
X Slope Change
Z Position (m)

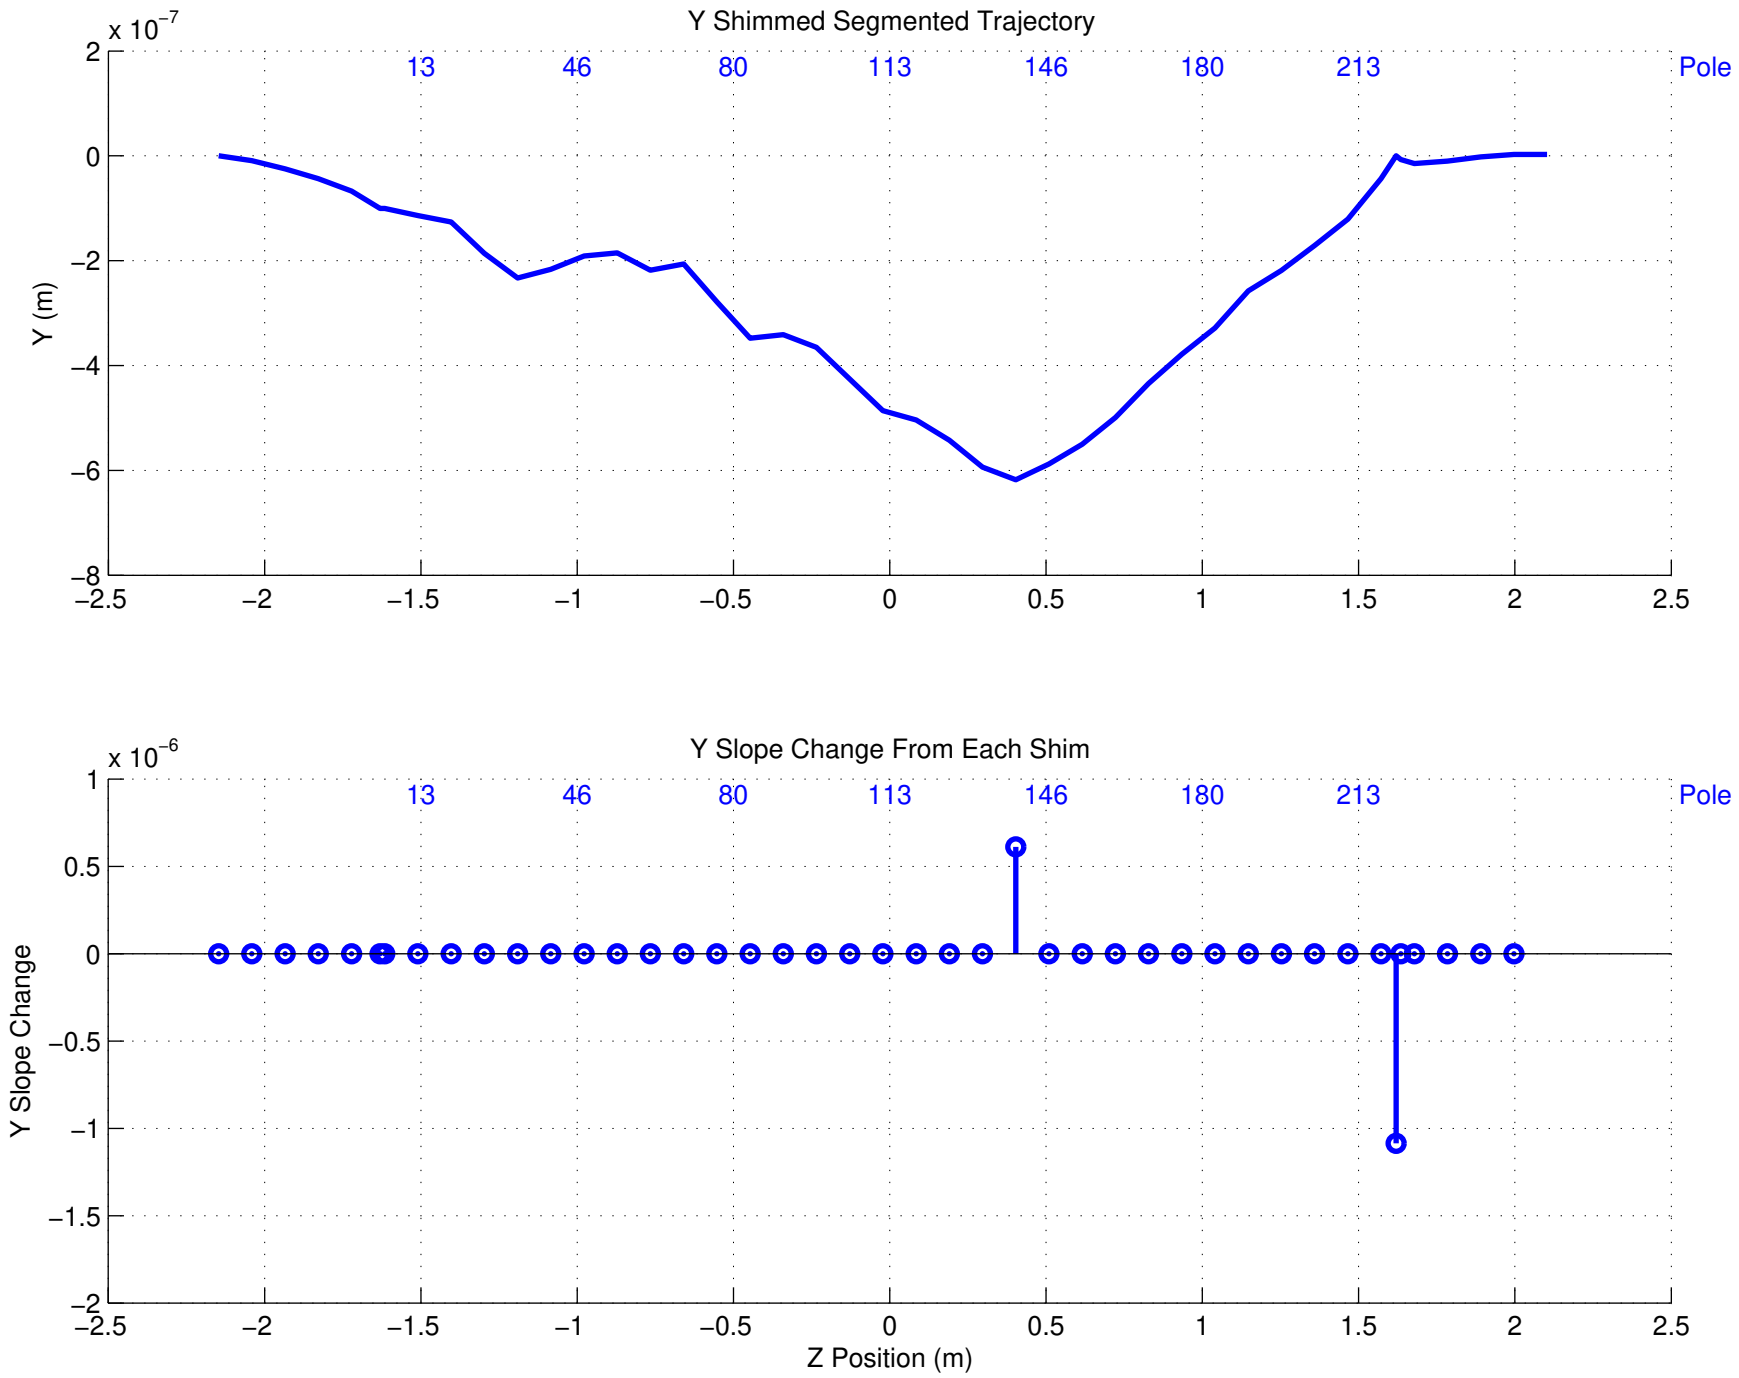
Y Shimmed Segmented Trajectory
x 10^-7
Y (m)
13
46
80
113
146
180
213
Pole
Y Slope Change From Each Shim
x 10^-6
Y Slope Change
Z Position (m)

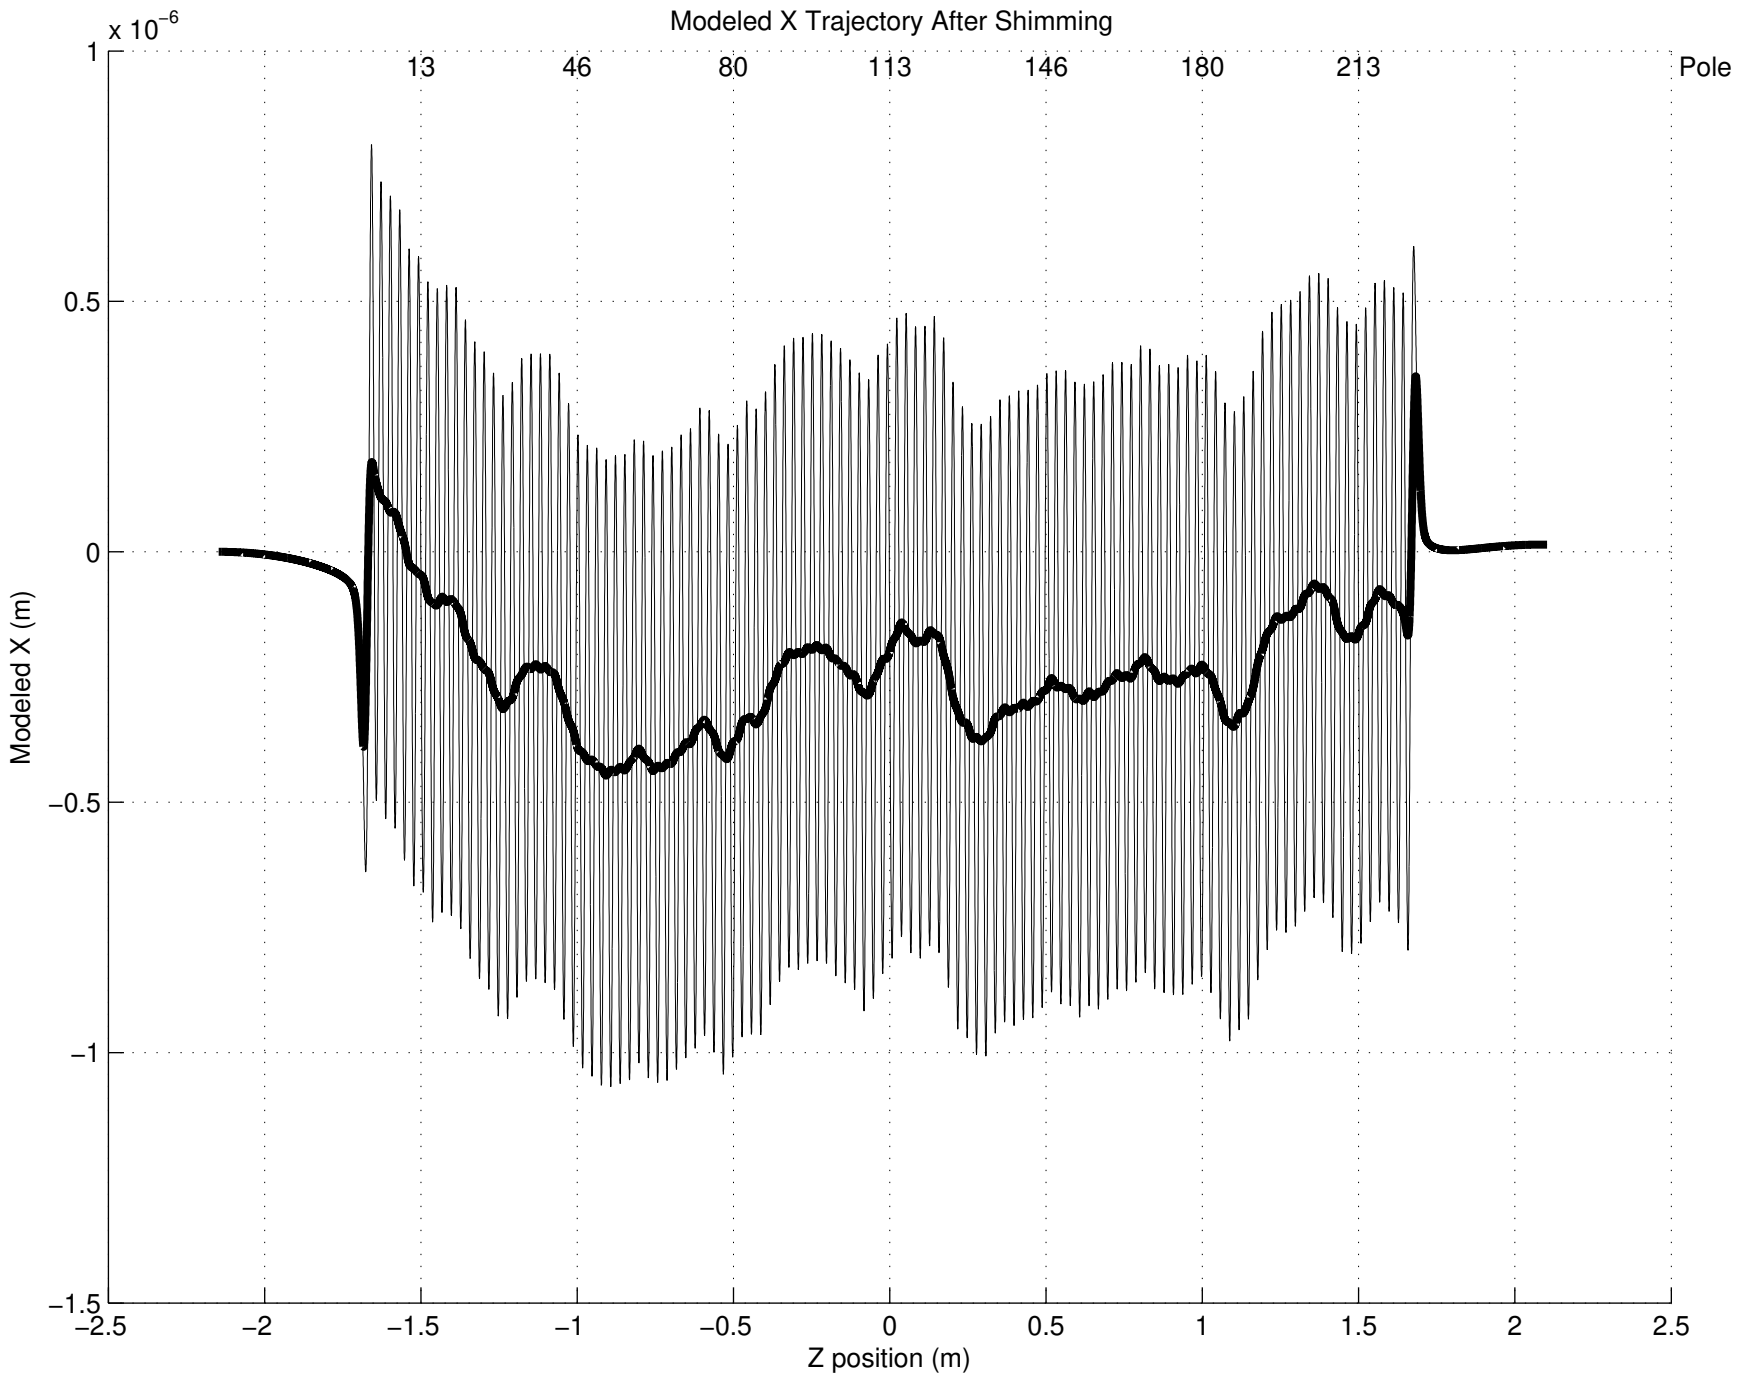
Modeled X Trajectory After Shimming
x 10^-6
13
46
80
113
146
180
213
Pole
1
0.5
0
−0.5
−1
−1.5
Modeled X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
2.5
Z position (m)

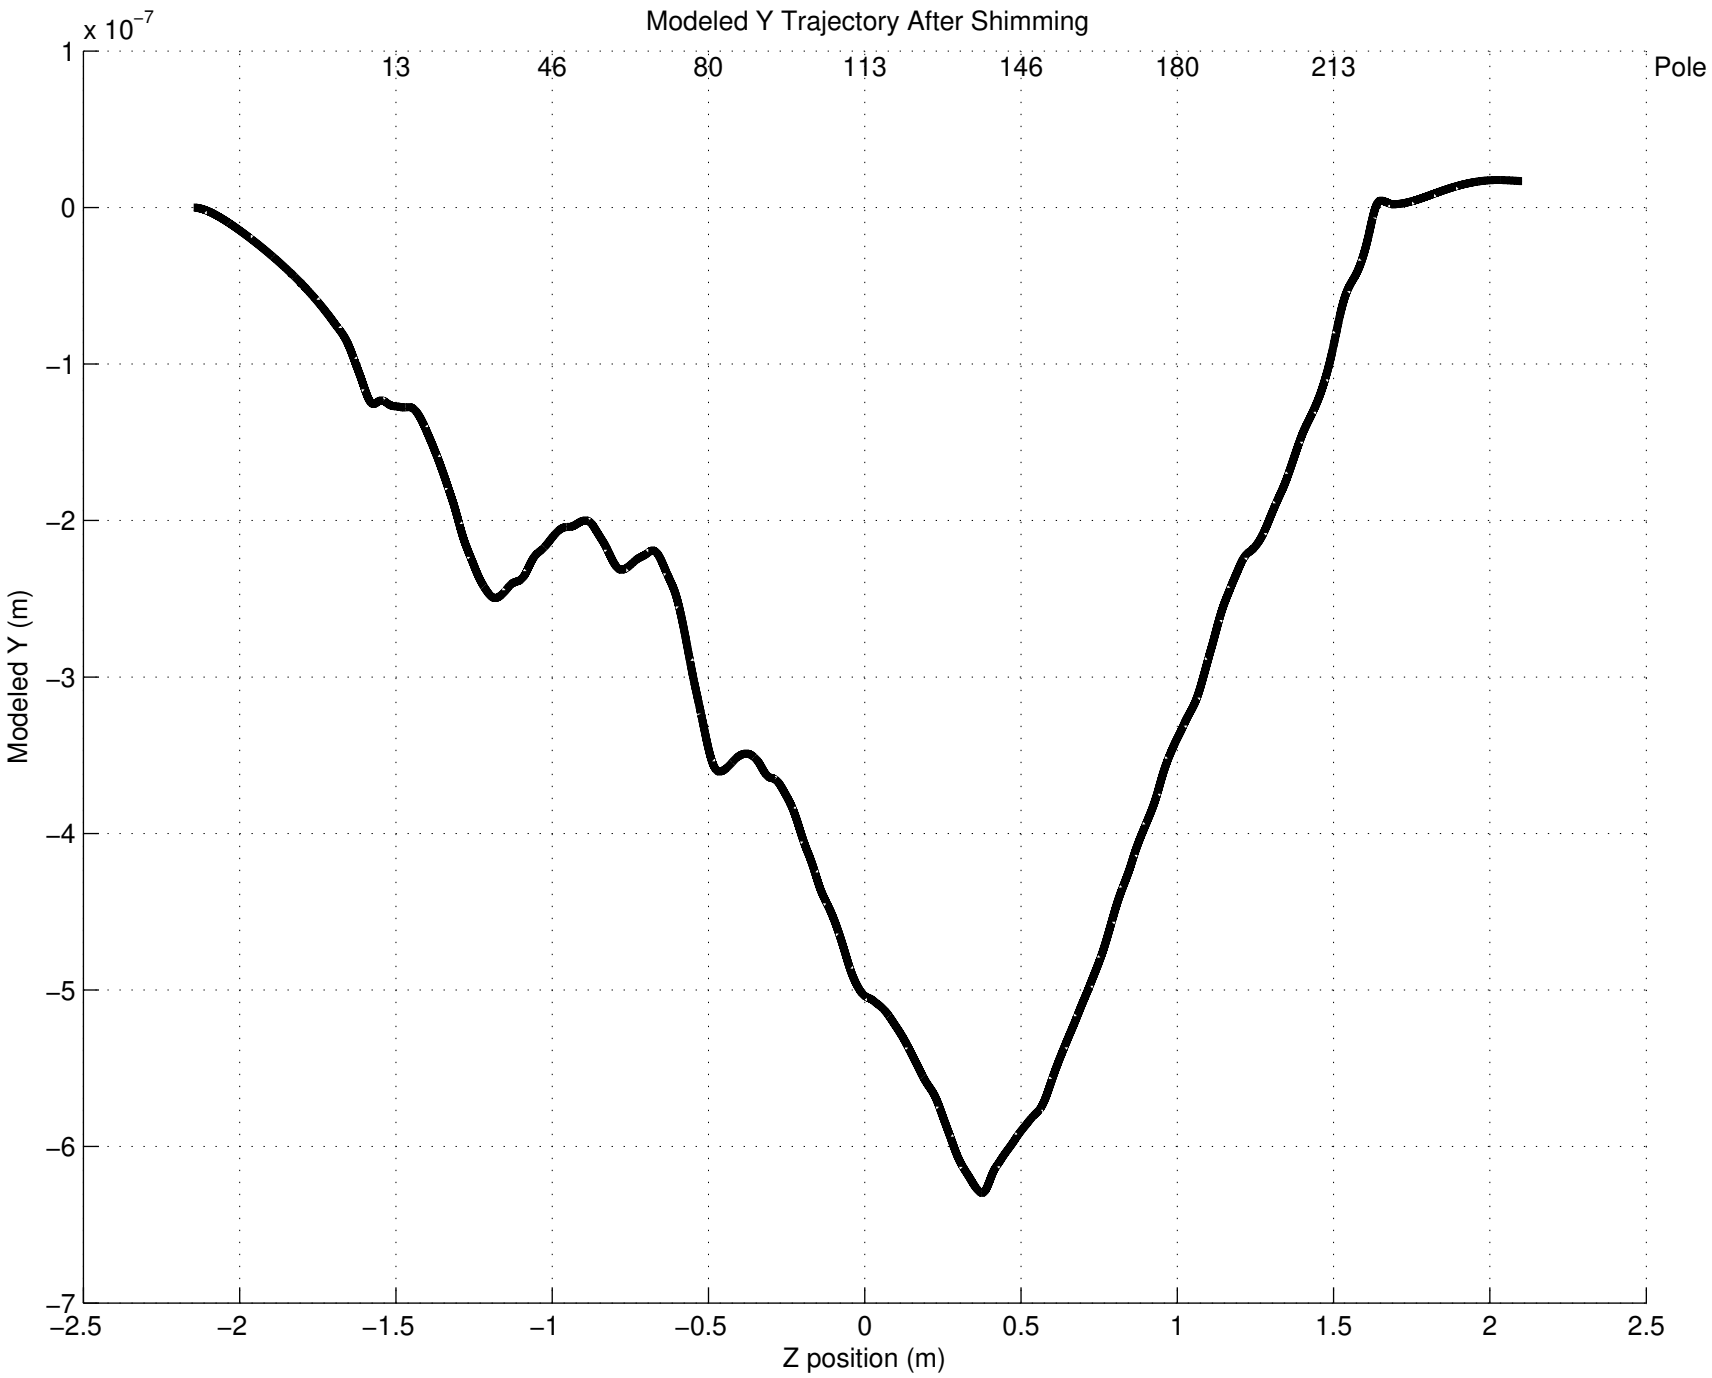
Modeled Y Trajectory After Shimming
x 10^-7
13
46
80
113
146
180
213
Pole
1
0
−1
−2
−3
−4
−5
−6
−7
Modeled Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
2.5
Z position (m)

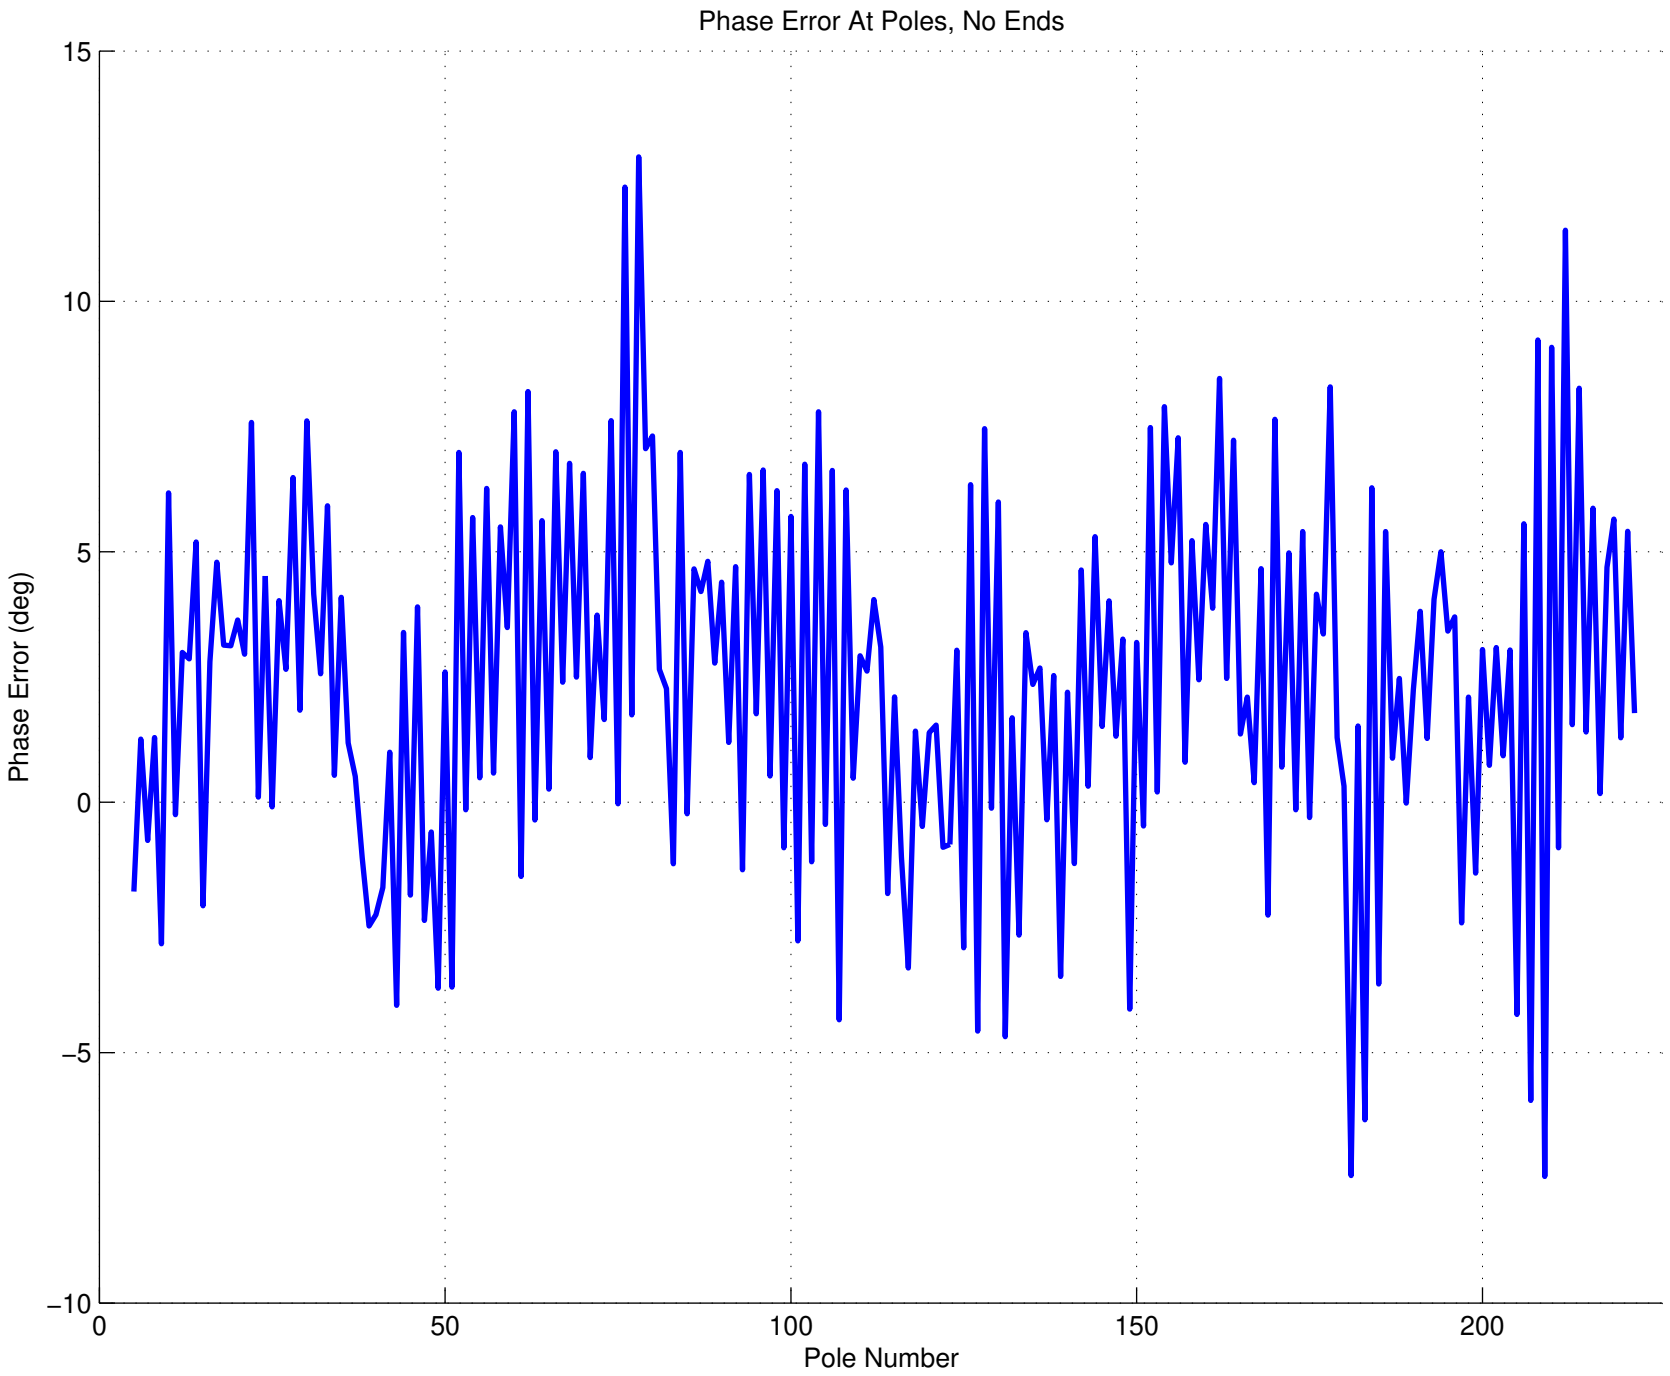
Phase Error At Poles, No Ends
Phase Error (deg)
15
10
5
0
−5
−10
0
50
100
150
200
Pole Number

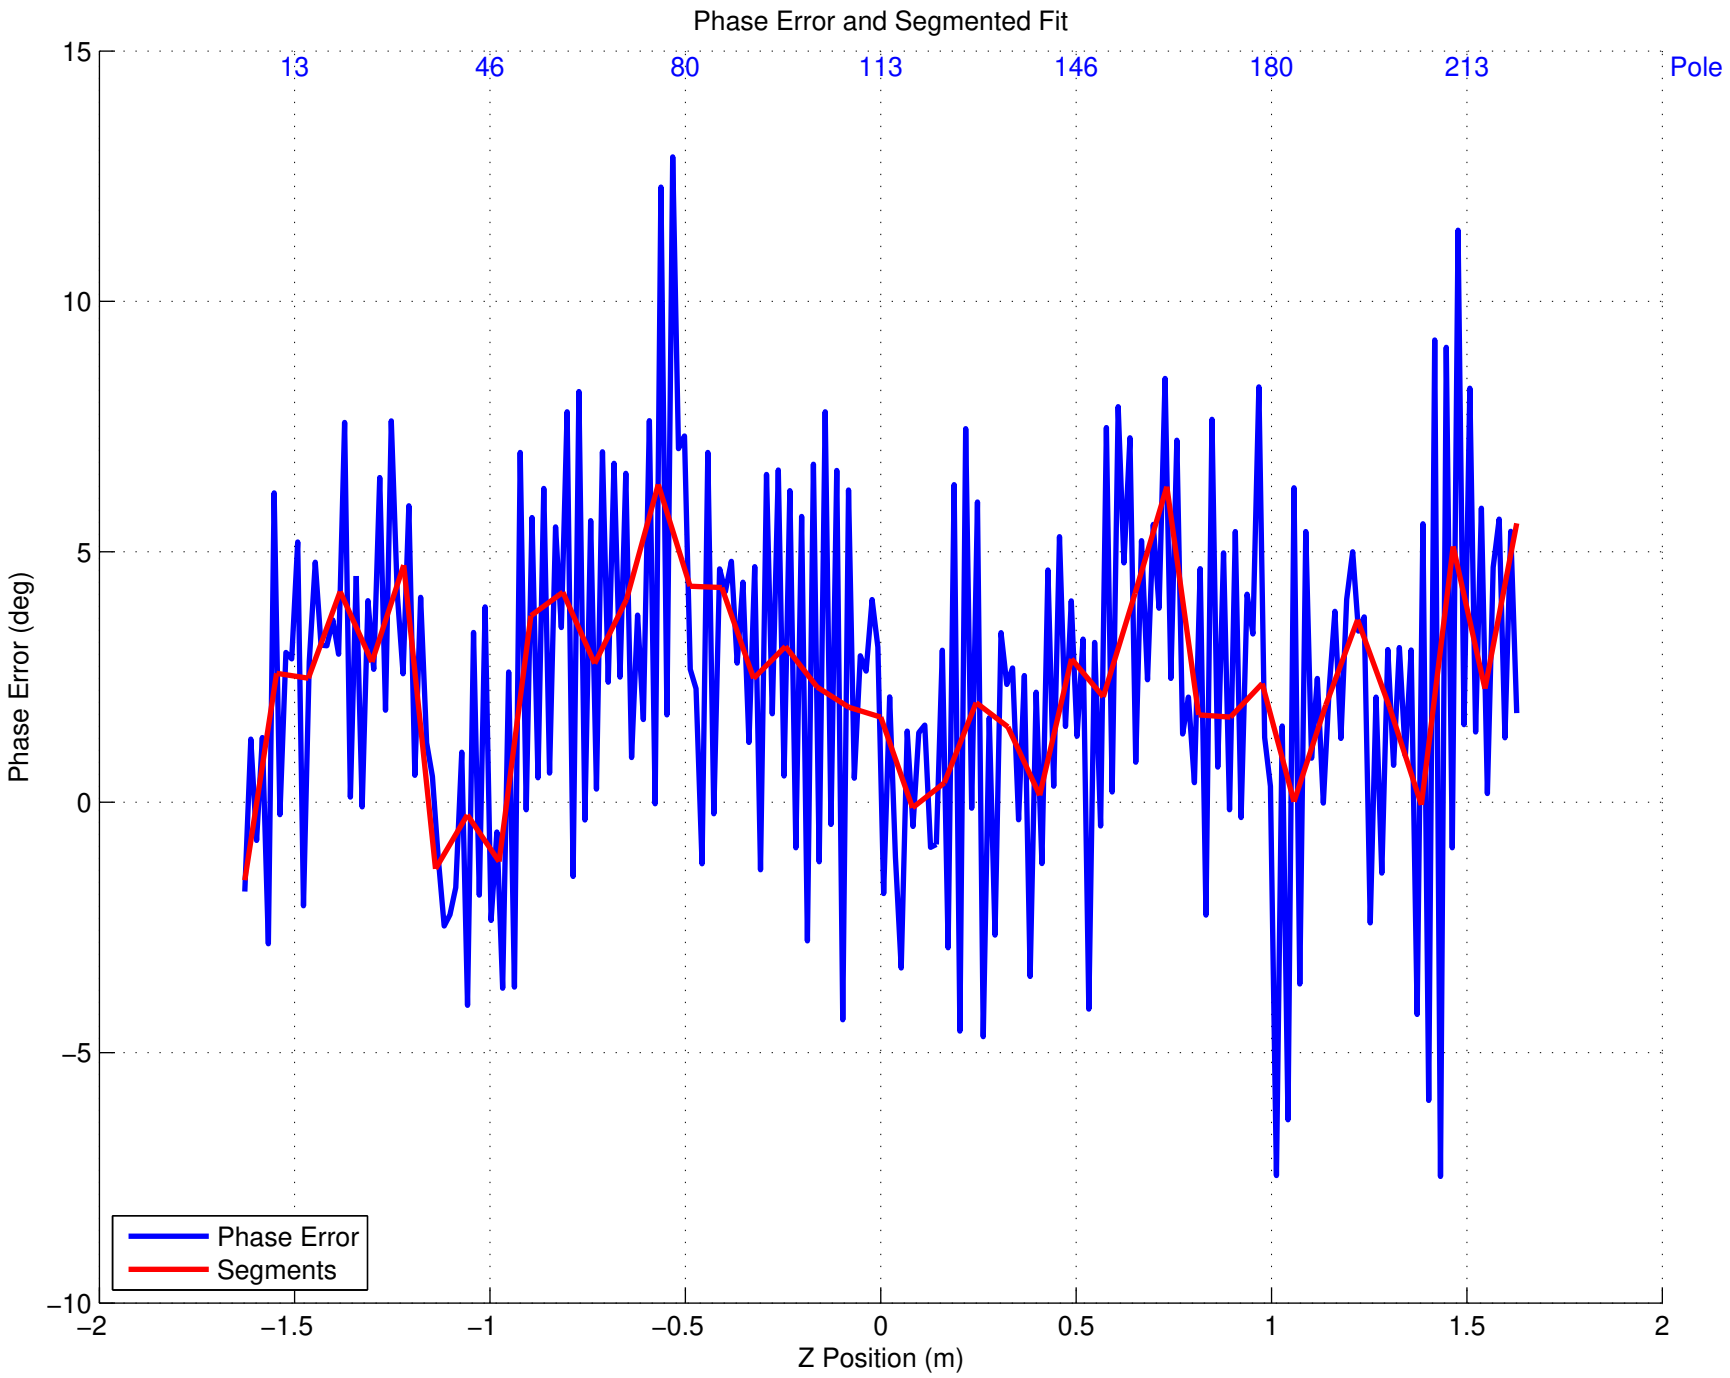
Phase Error and Segmented Fit
13
46
80
113
146
180
213
Pole
15
10
5
0
−5
−10
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Phase Error (deg)
Z Position (m)
Phase Error
Segments

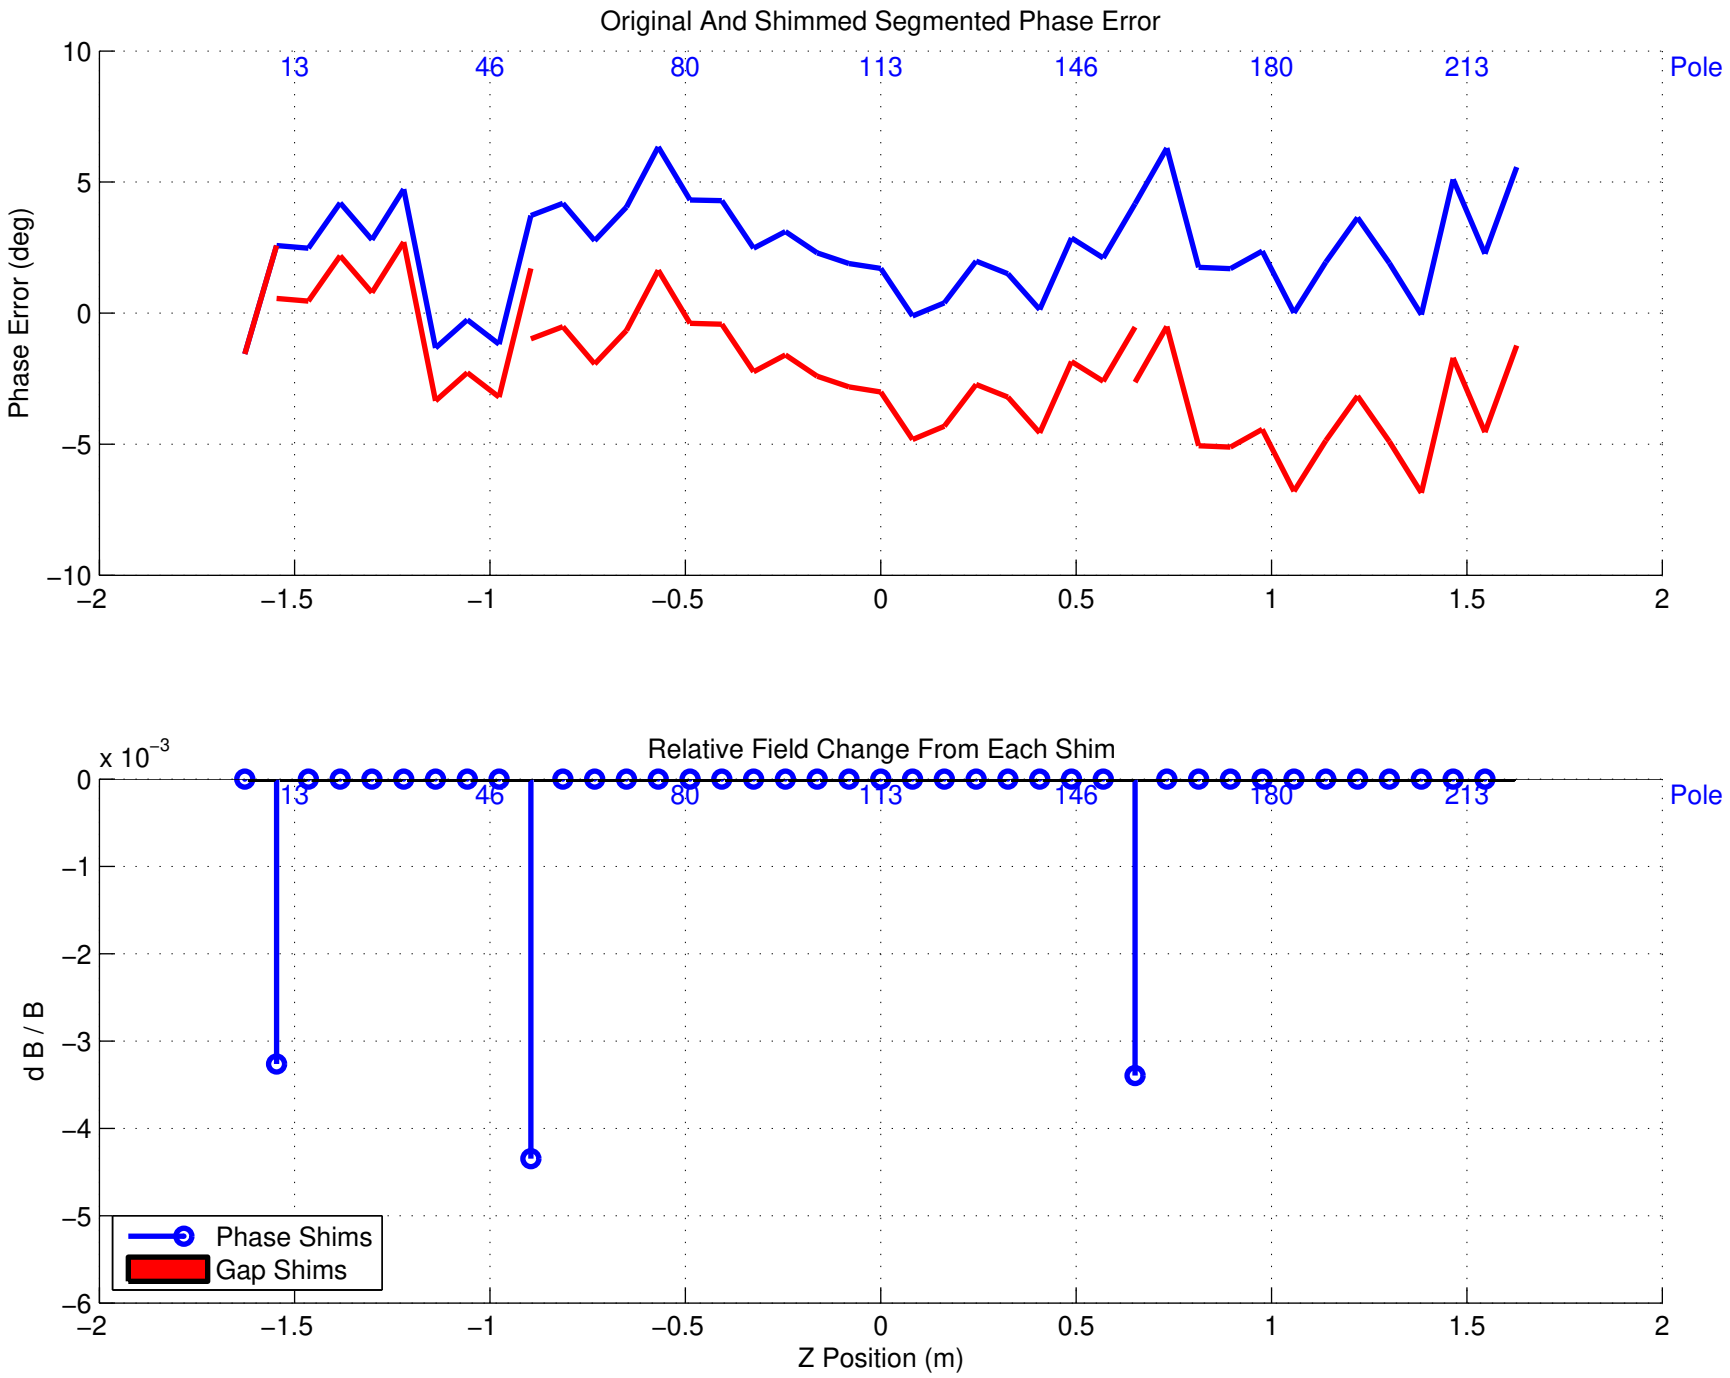
Original And Shimmed Segmented Phase Error
Phase Error (deg)
10
5
0
−5
−10
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
0
−1
−2
−3
−4
−5
−6
Phase Shims
Gap Shims
Z Position (m)

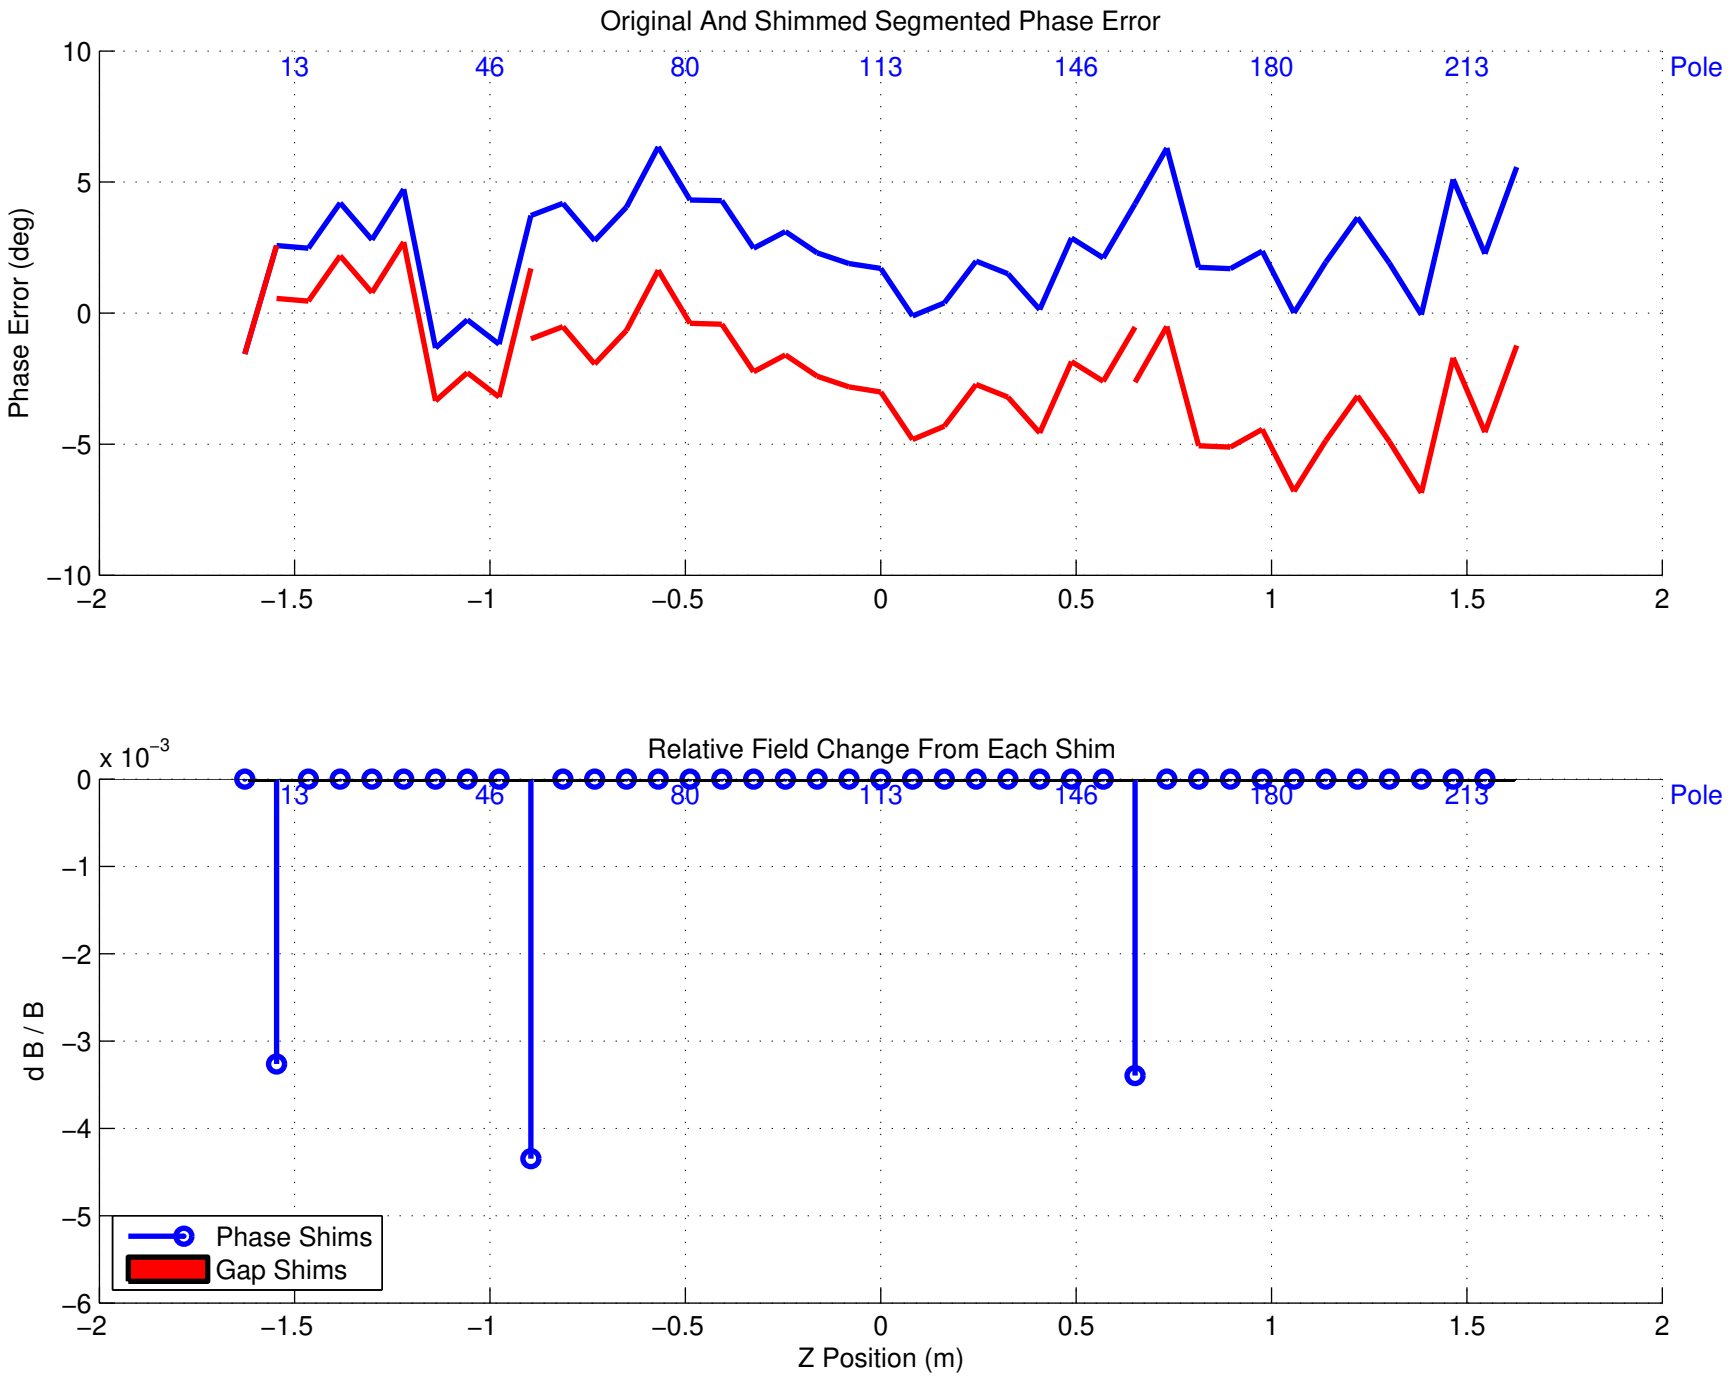
Original And Shimmed Segmented Phase Error
Phase Error (deg)
10
5
0
−5
−10
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
0
−1
−2
−3
−4
−5
−6
Phase Shims
Gap Shims
Z Position (m)

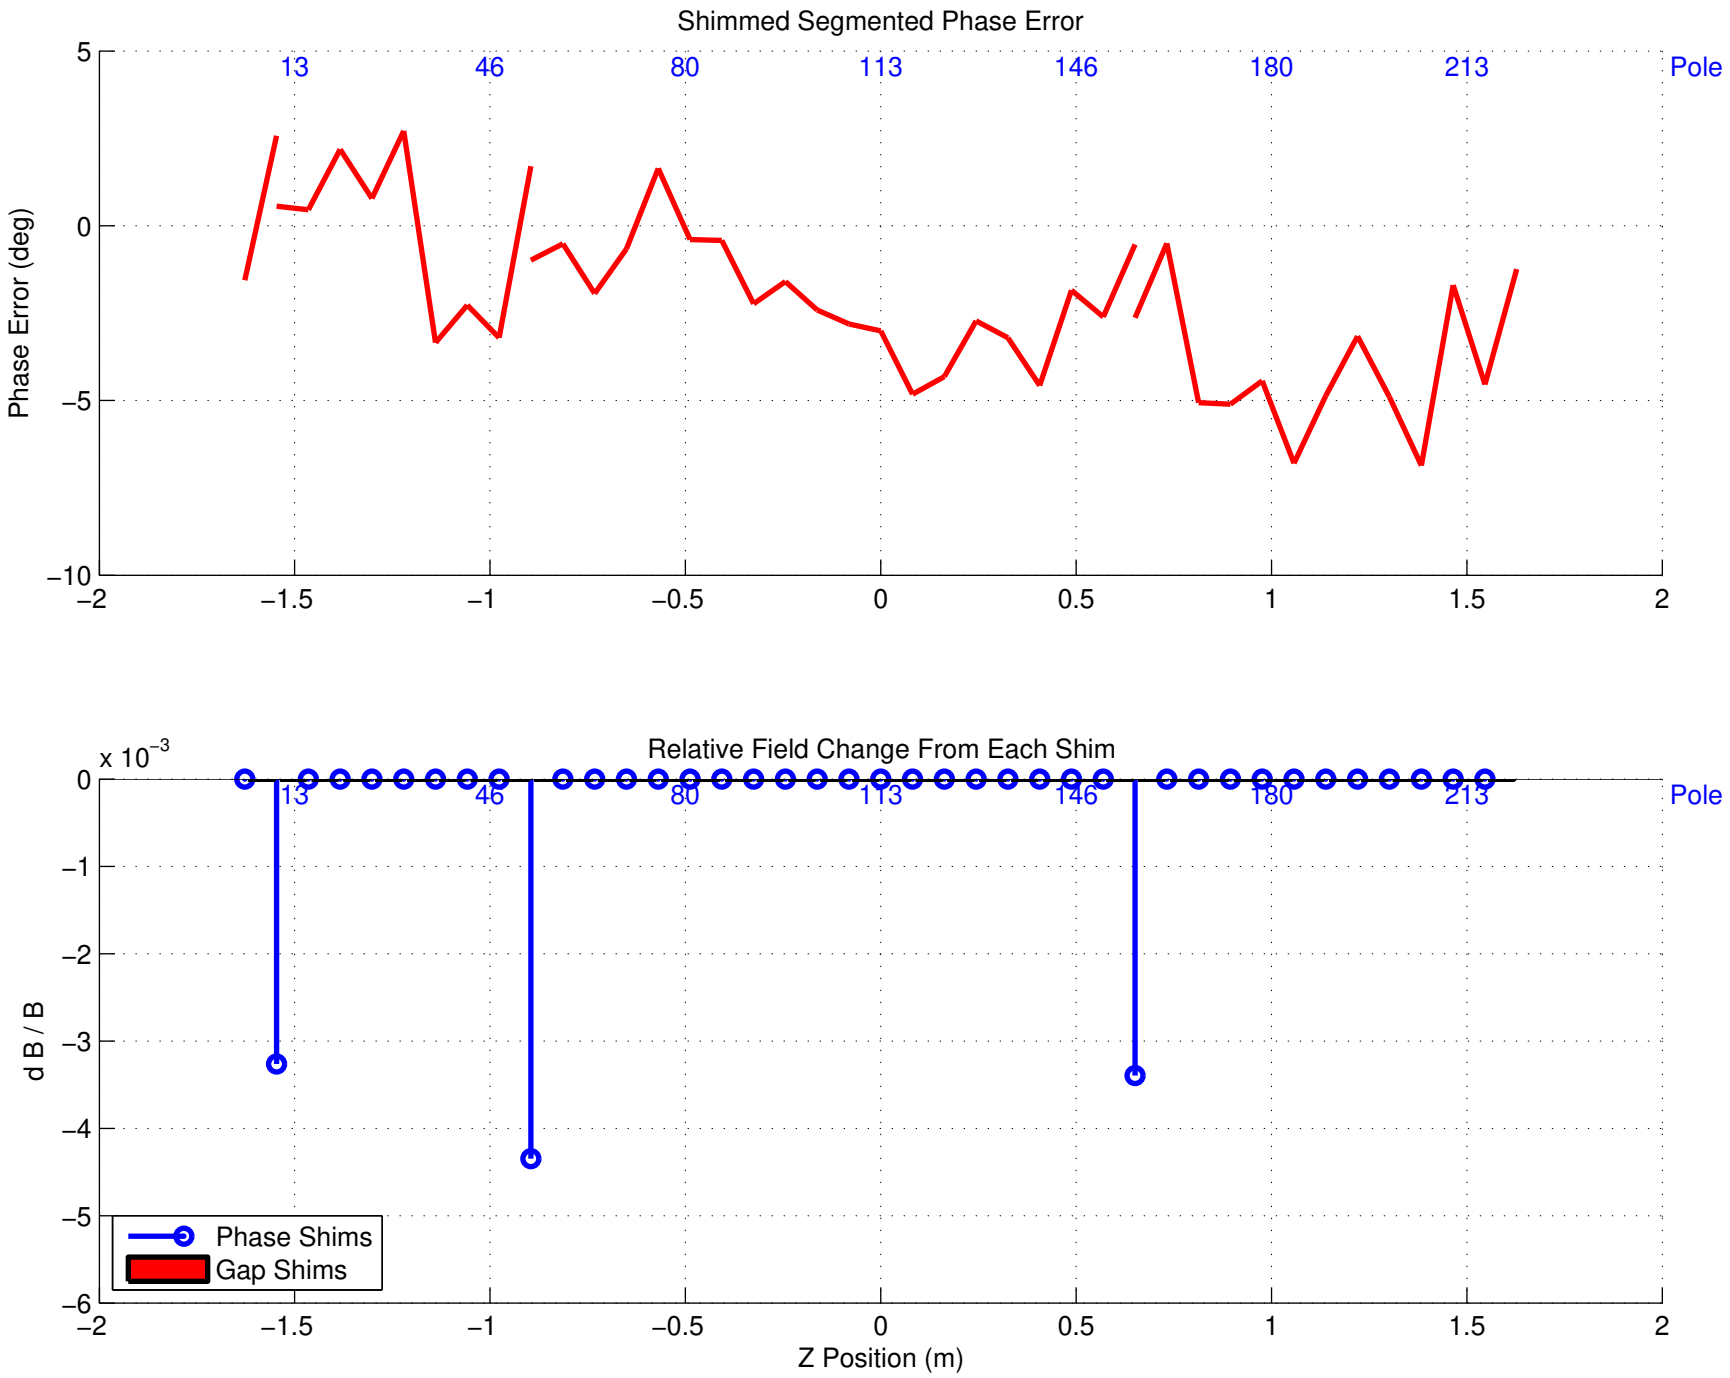
Shimmed Segmented Phase Error
Phase Error (deg)
5
0
−5
−10
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
0
−1
−2
−3
−4
−5
−6
Phase Shims
Gap Shims
Z Position (m)

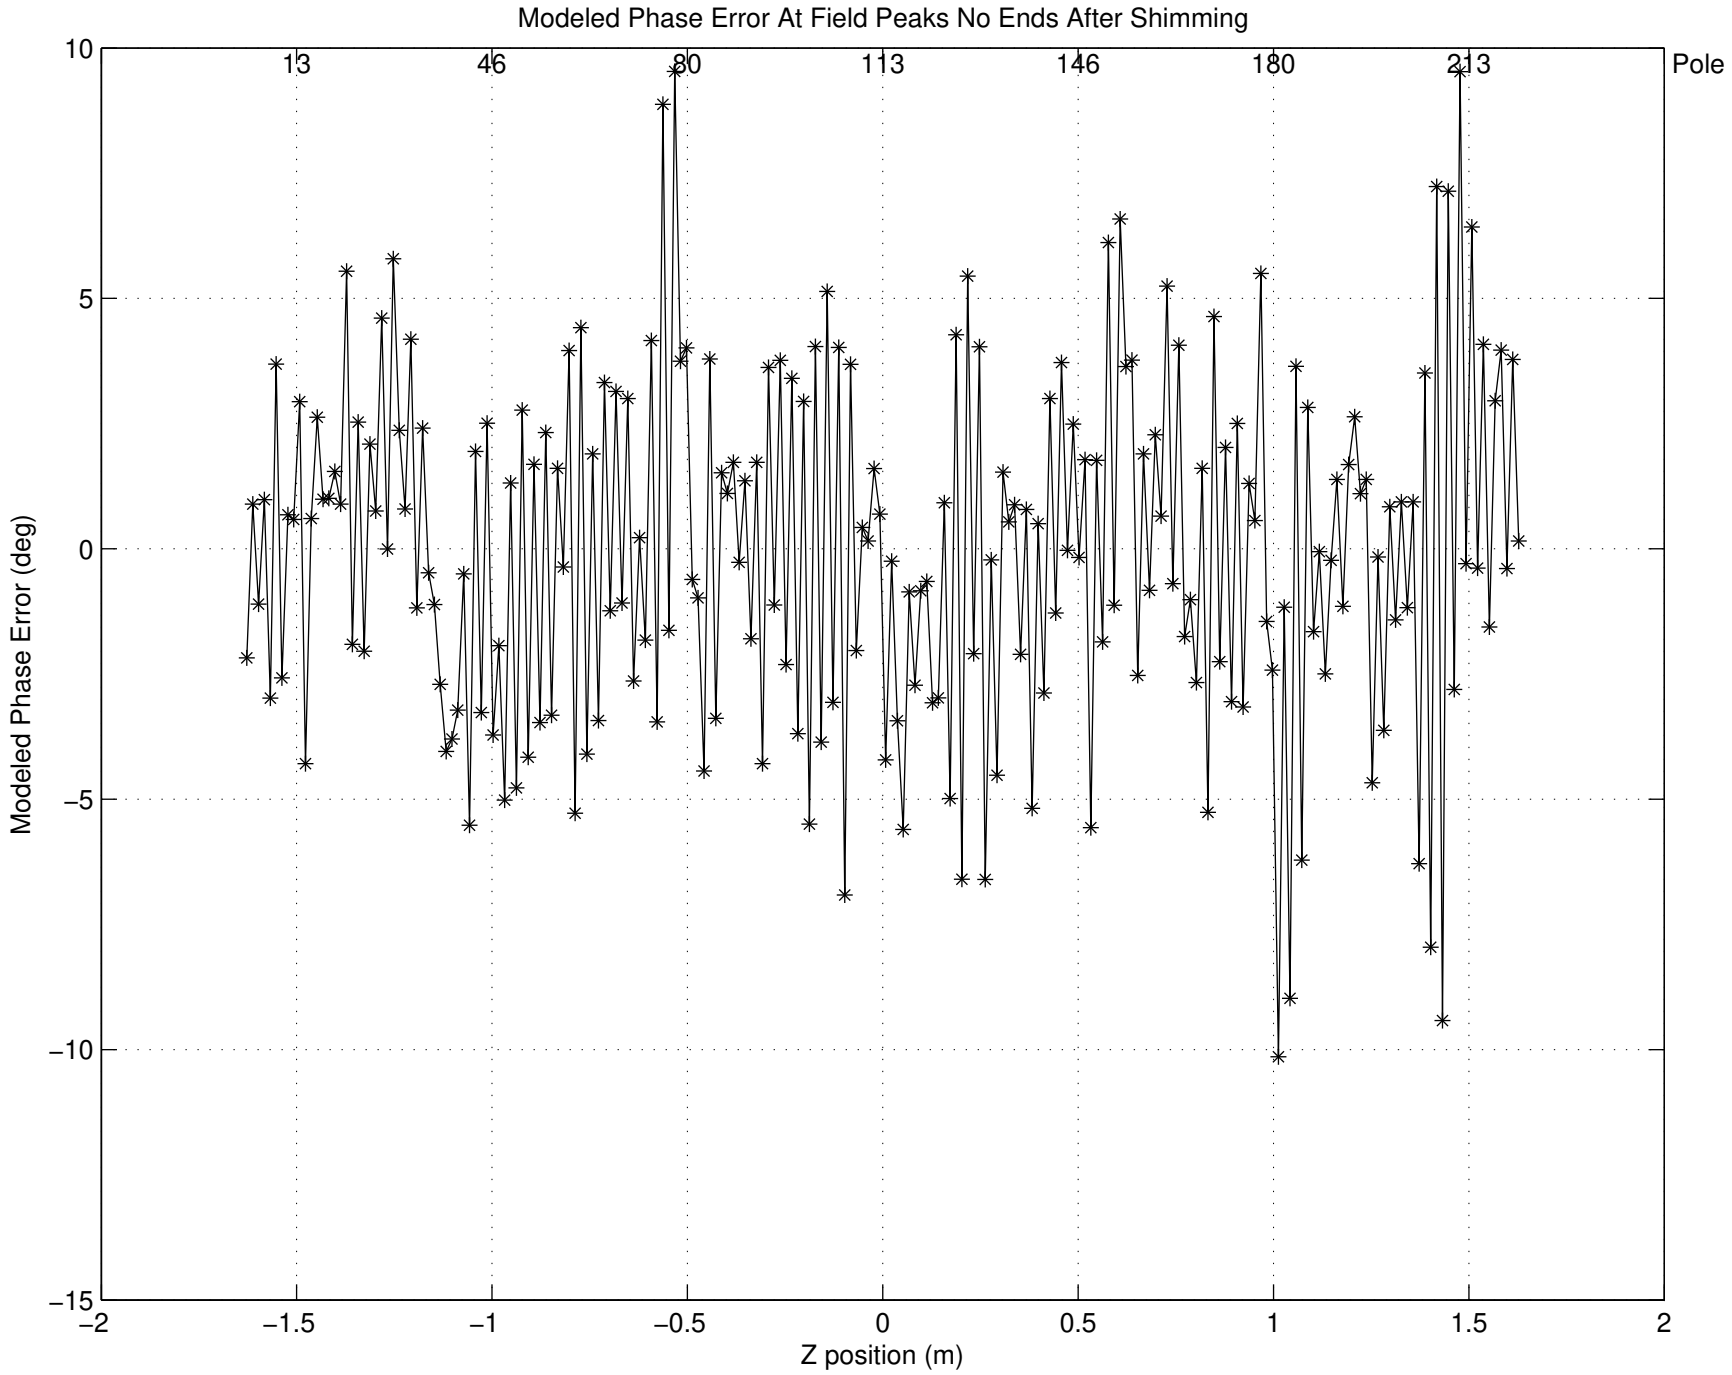

Phase Error: Ave = −0.000000 deg, RMS = 3.508087 deg