SLAC Magnetic Measurements

Planar Insertion Device Shim Analysis

Parameters:
INPUT−FILE−DIR =S:\MagData\LCLS\Undulator\L143−112000−06\DATASET0001\Rough Tuning\Z Scans\Run 019\
INPUT−FILE−NAME =bscanz−dat.001
INPUT−FILE−TYPE =ZVXYBXYH
CORR−REQUIRED =1
CORR−FILE =S:\Magdata\Earth Field Correction\earth−field−corr.dat
CORR−FILE−TYPE =CORR−ZBXY
GAMMA =26667.27
NOM−LAMBDA−U =0.03
NOM−K−VALUE =3.4945
NOM−LAMBDA−R =1.4988e−010
NUM−POLES =226
NUM−END−POLES =4
CELL−LENGTH =3.656

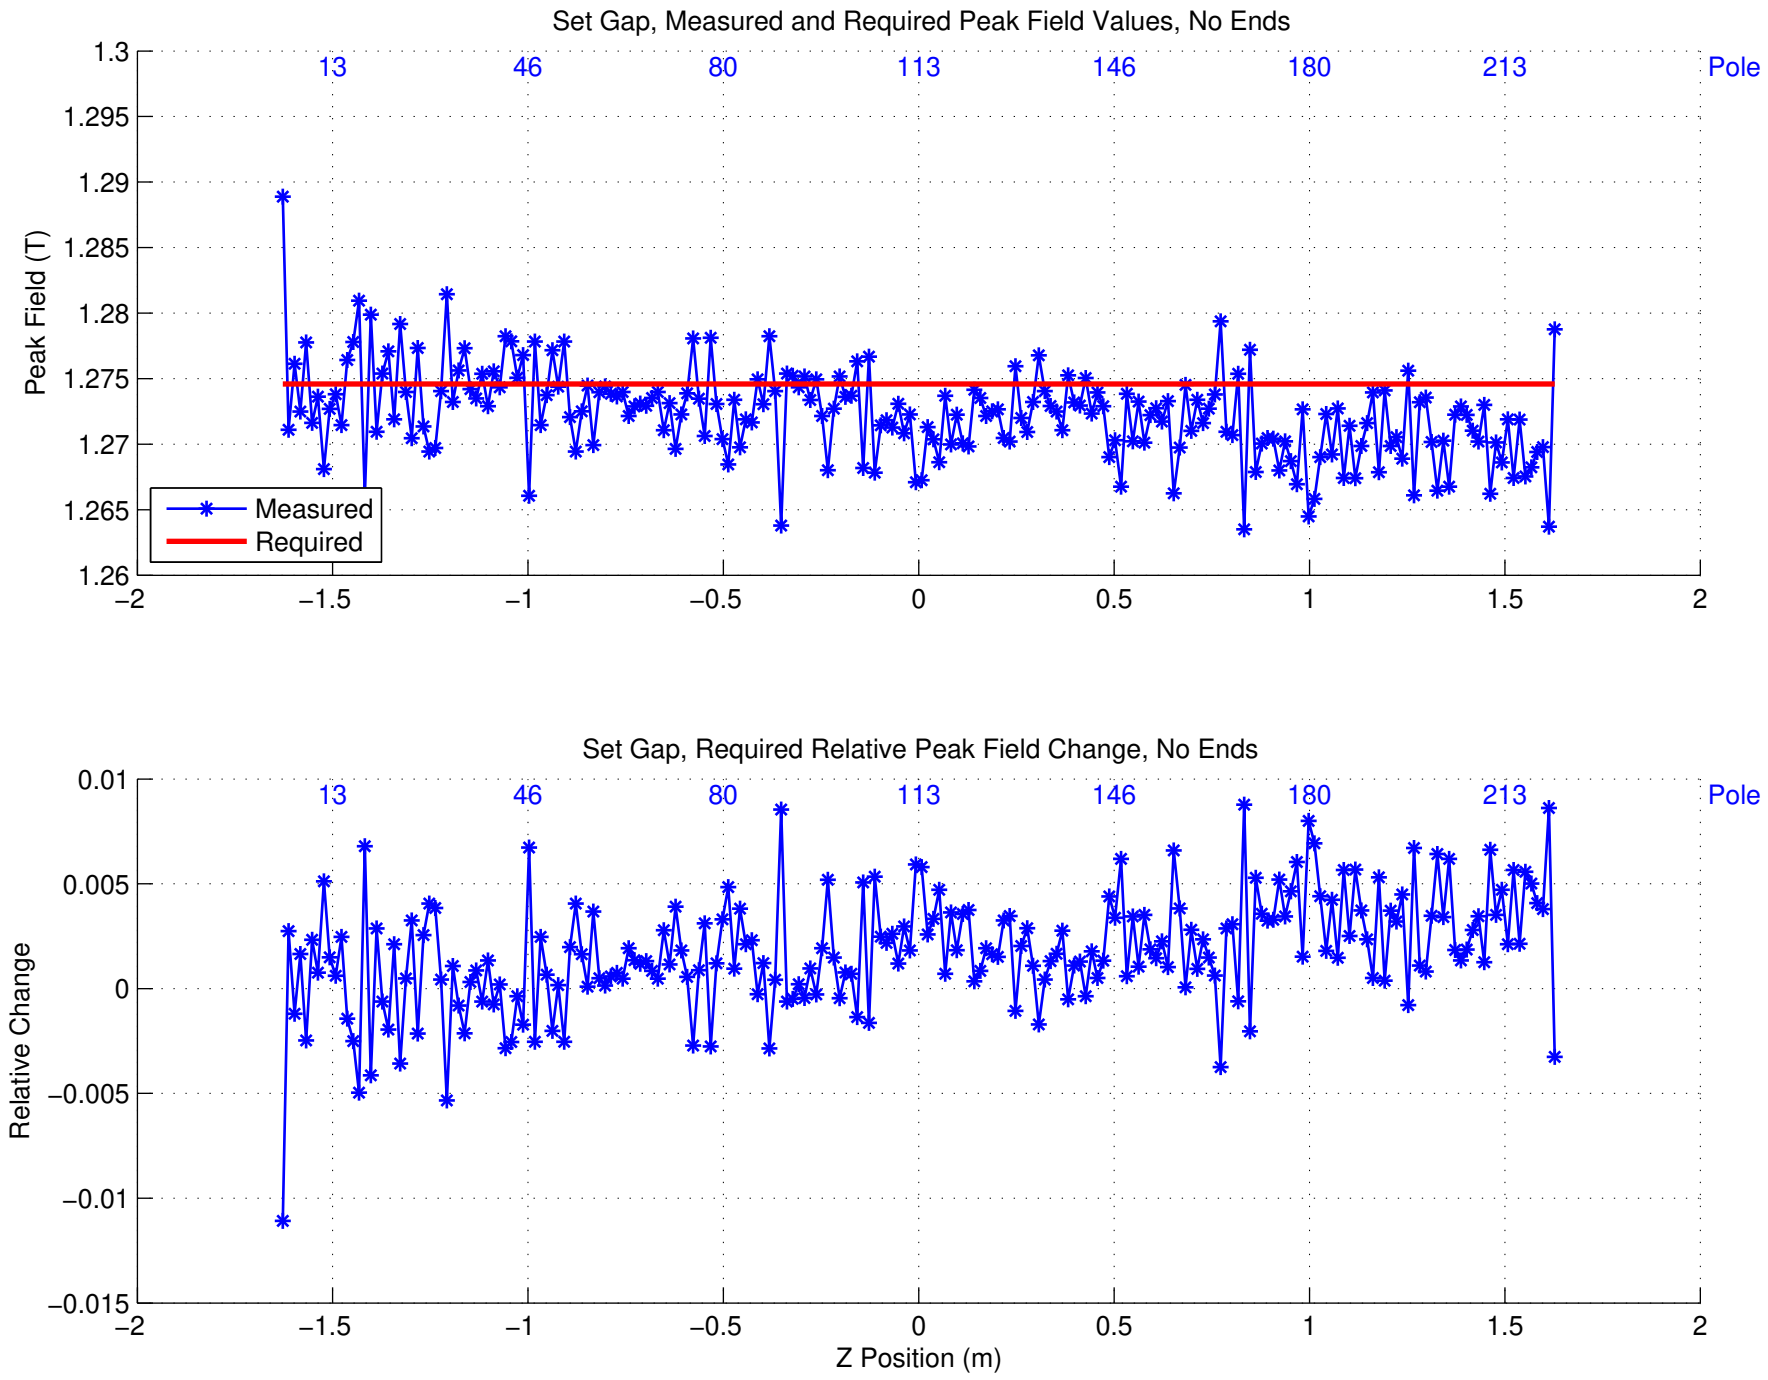
Set Gap, Measured and Required Peak Field Values, No Ends
13
46
80
113
146
180
213
Pole
Peak Field (T)
1.3
1.295
1.29
1.285
1.28
1.275
1.27
1.265
1.26
Measured
Required
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Set Gap, Required Relative Peak Field Change, No Ends
Relative Change
0.01
0.005
0
−0.005
−0.01
−0.015
Z Position (m)

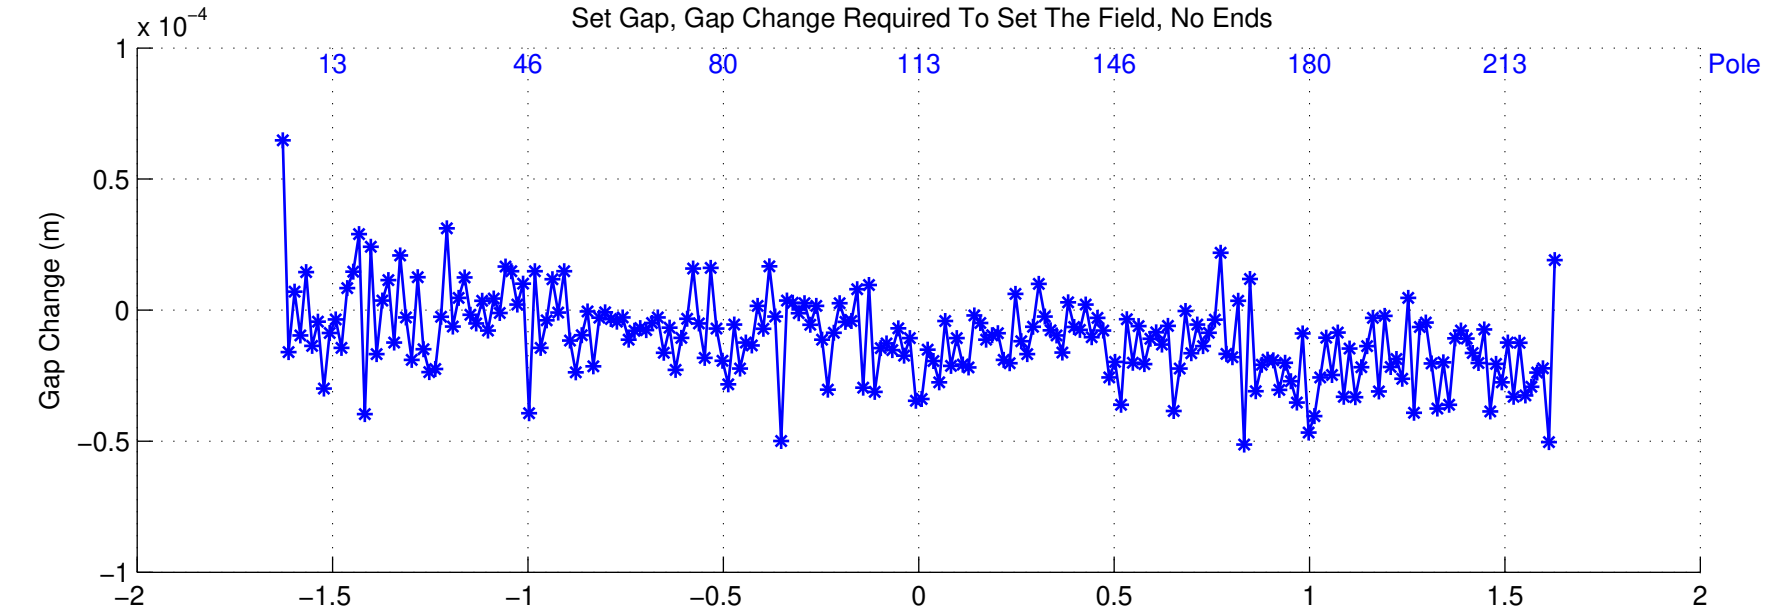
Set Gap, Gap Change Required To Set The Field, No Ends
x 10^-4
13
46
80
113
146
180
213
Pole
Gap Change (m)
1
0.5
0
−0.5
−1
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

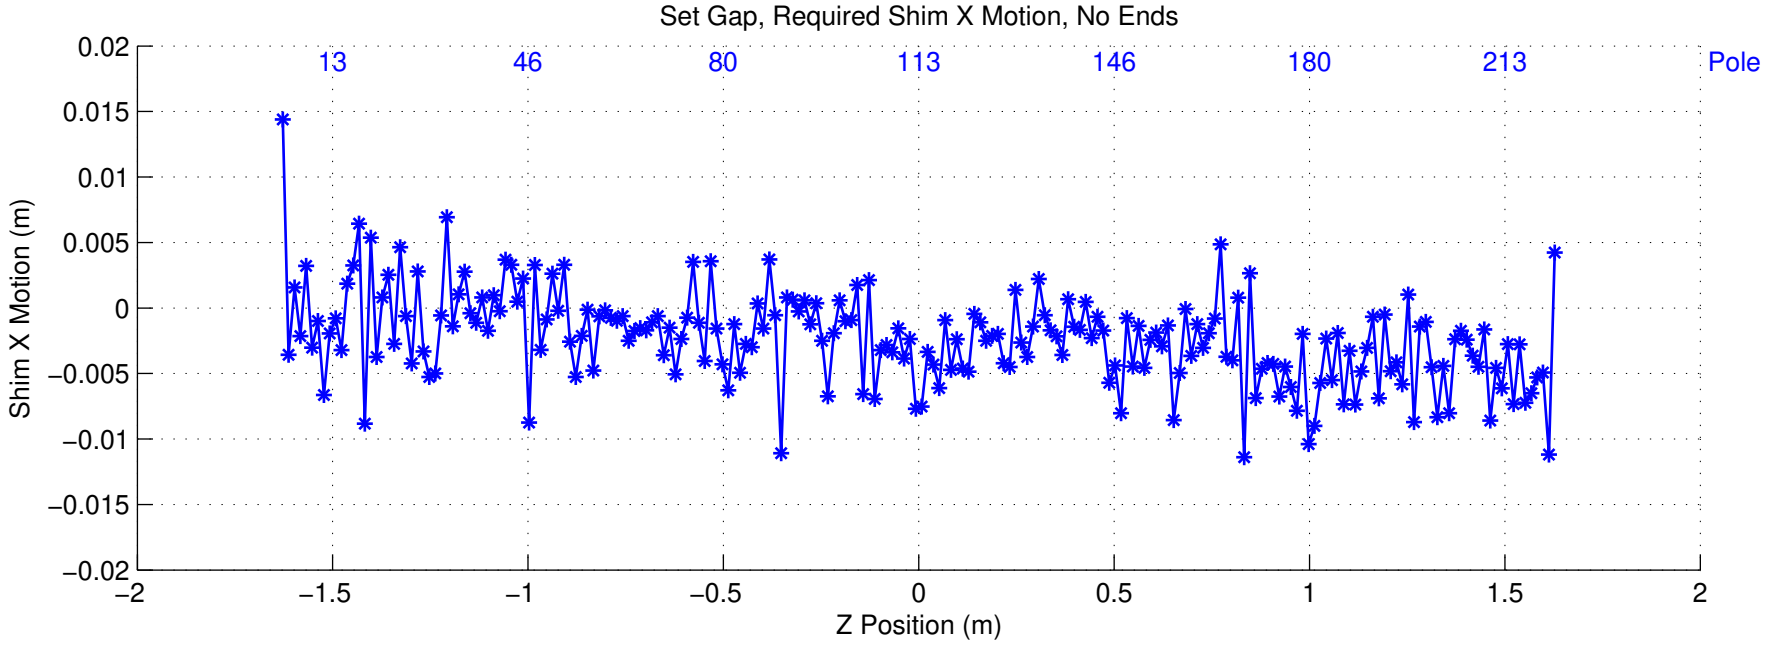
Set Gap, Required Shim X Motion, No Ends
13
46
80
113
146
180
213
Pole
Shim X Motion (m)
0.02
0.015
0.01
0.005
0
−0.005
−0.01
−0.015
−0.02
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

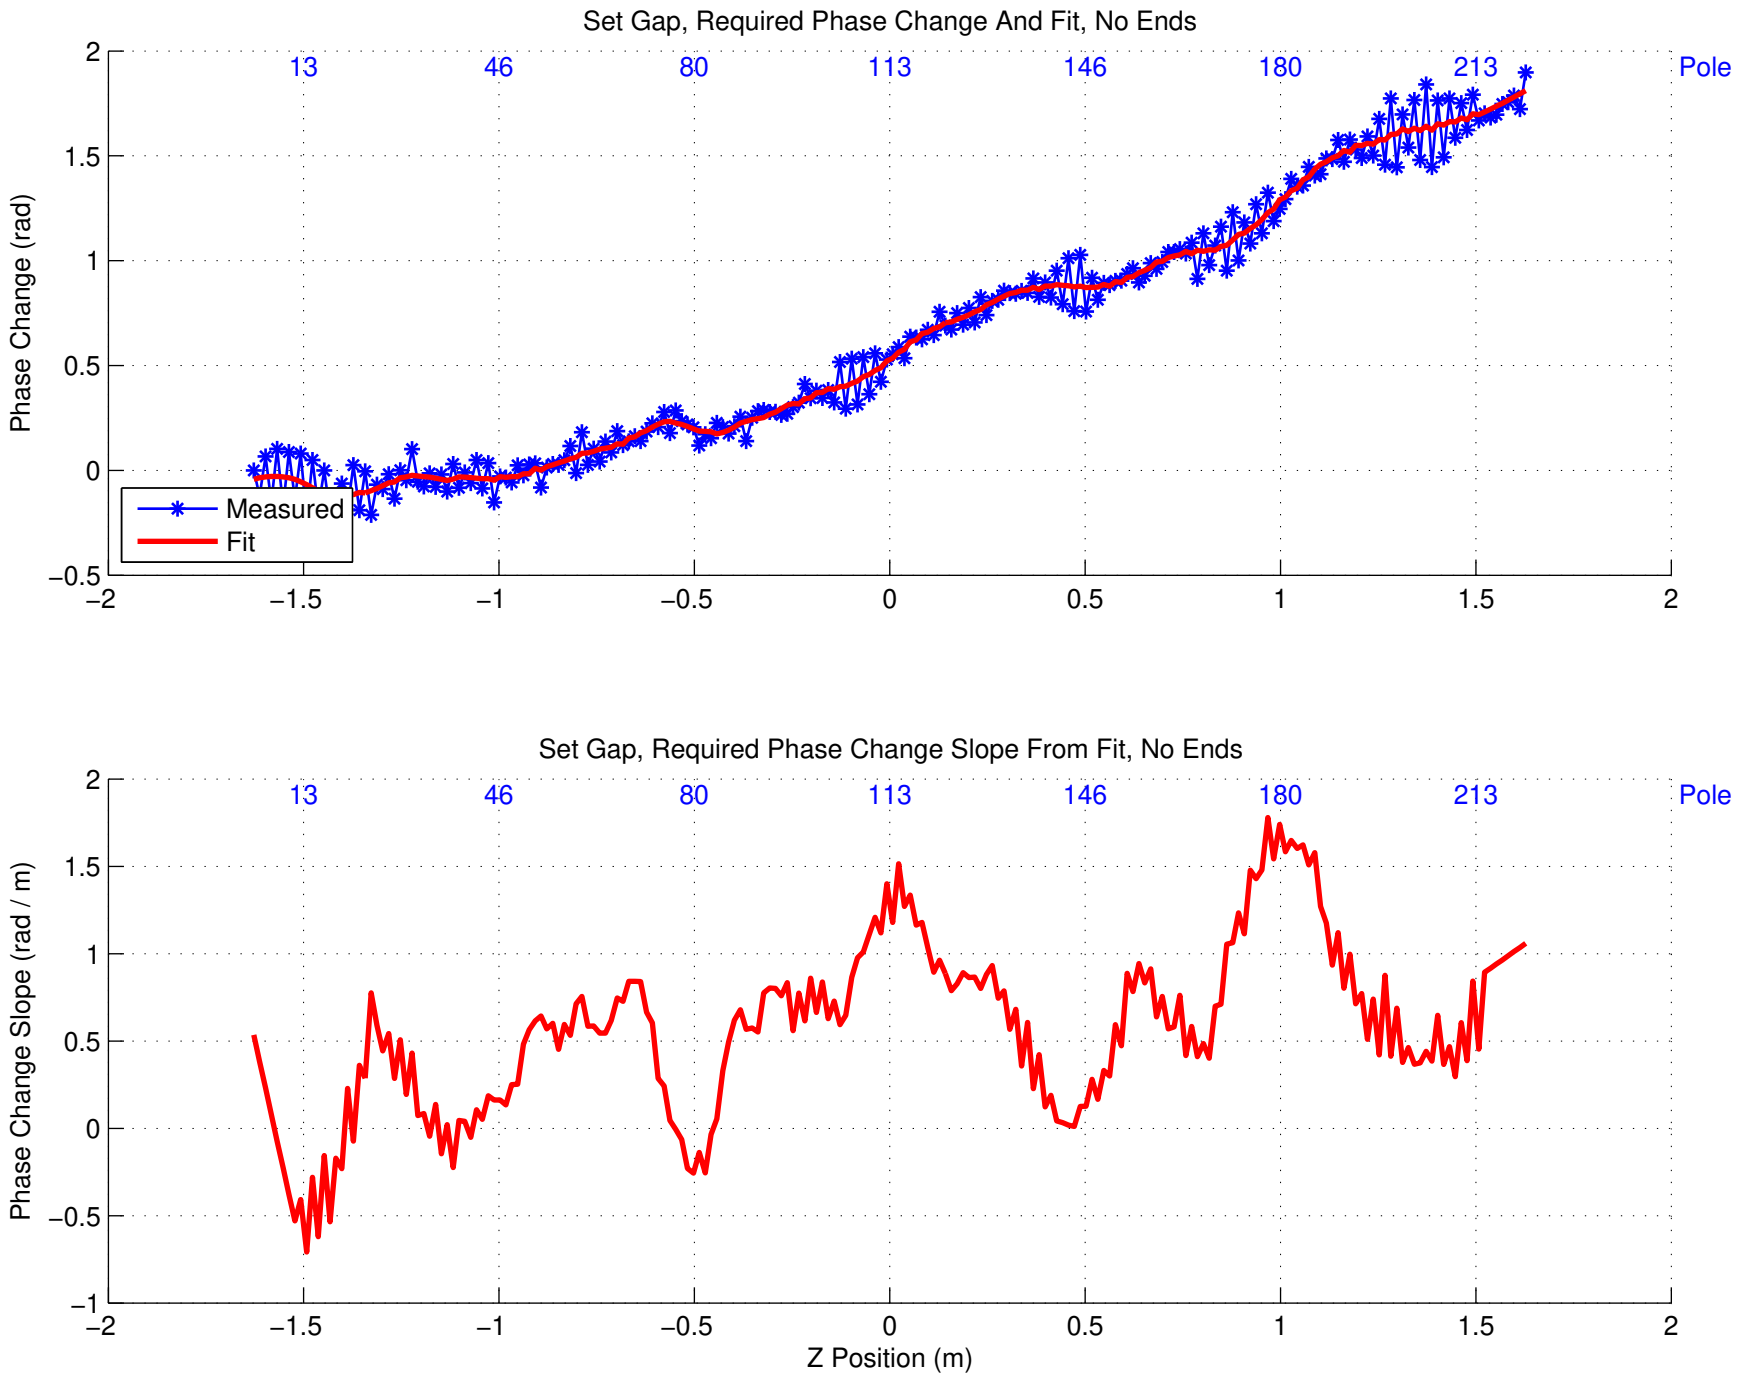
Set Gap, Required Phase Change And Fit, No Ends
13
46
80
113
146
180
213
Pole
Phase Change (rad)
Measured
Fit
Set Gap, Required Phase Change Slope From Fit, No Ends
Phase Change Slope (rad / m)
Z Position (m)

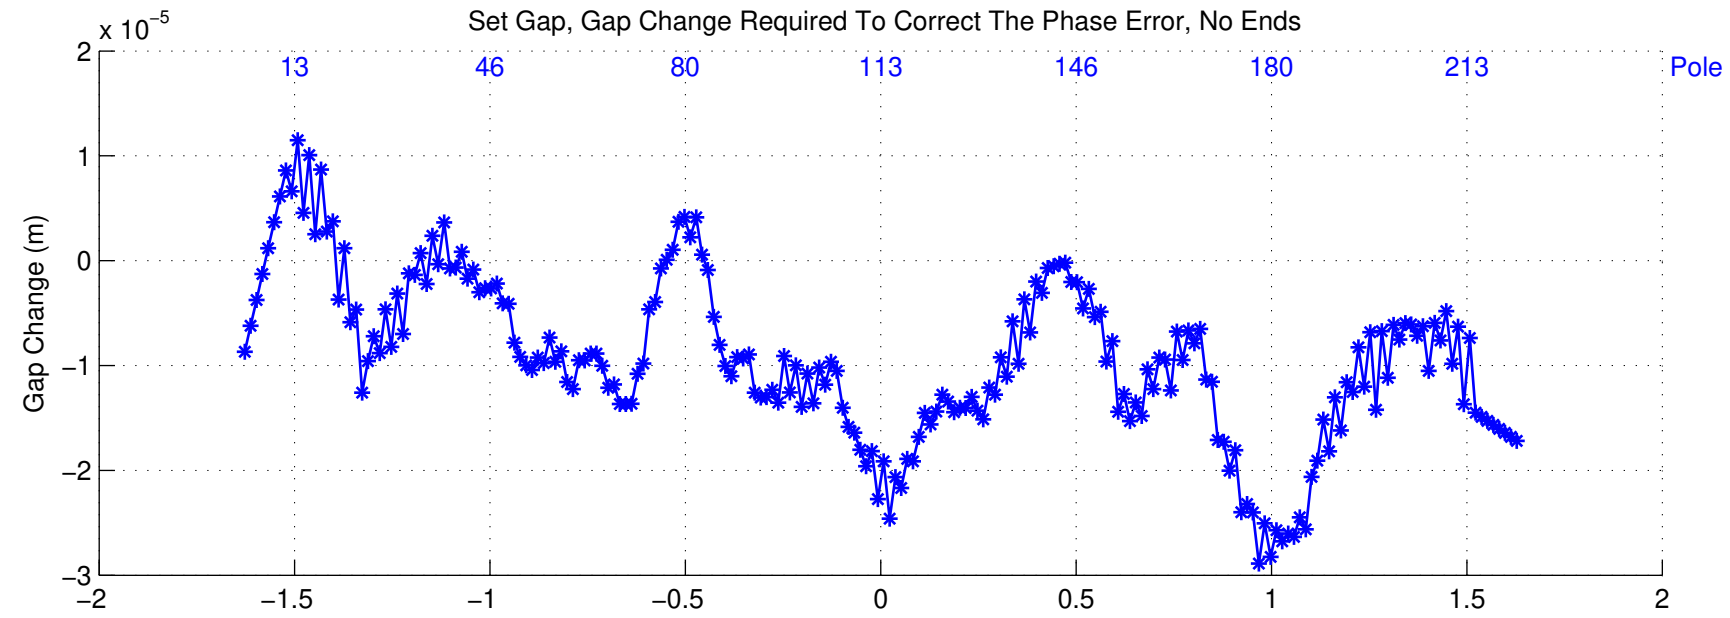
Set Gap, Gap Change Required To Correct The Phase Error, No Ends
x 10^-5
Gap Change (m)
13
46
80
113
146
180
213
Pole
2
1
0
−1
−2
−3
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

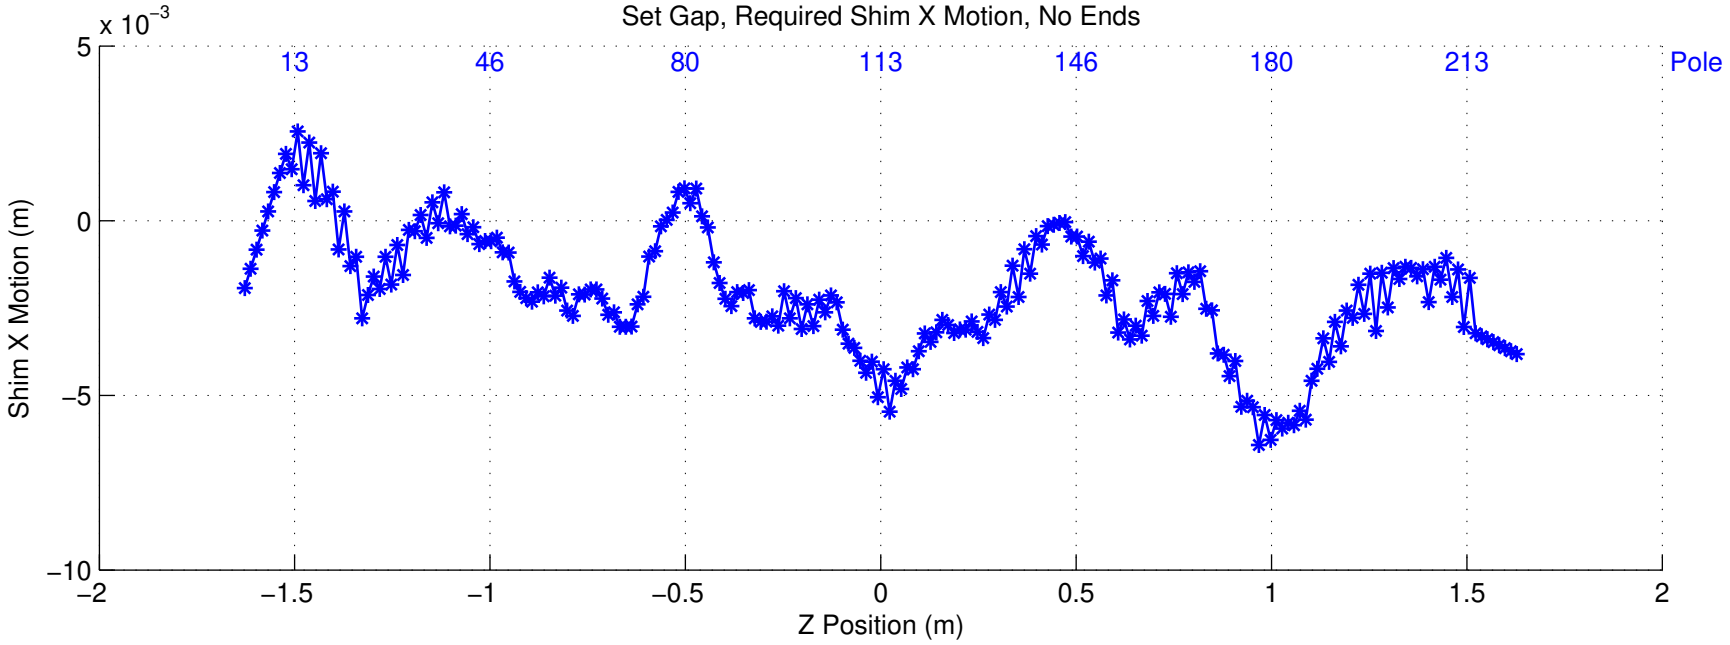
Set Gap, Required Shim X Motion, No Ends
x 10^-3
Shim X Motion (m)
13
46
80
113
146
180
213
Pole
5
0
−5
−10
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

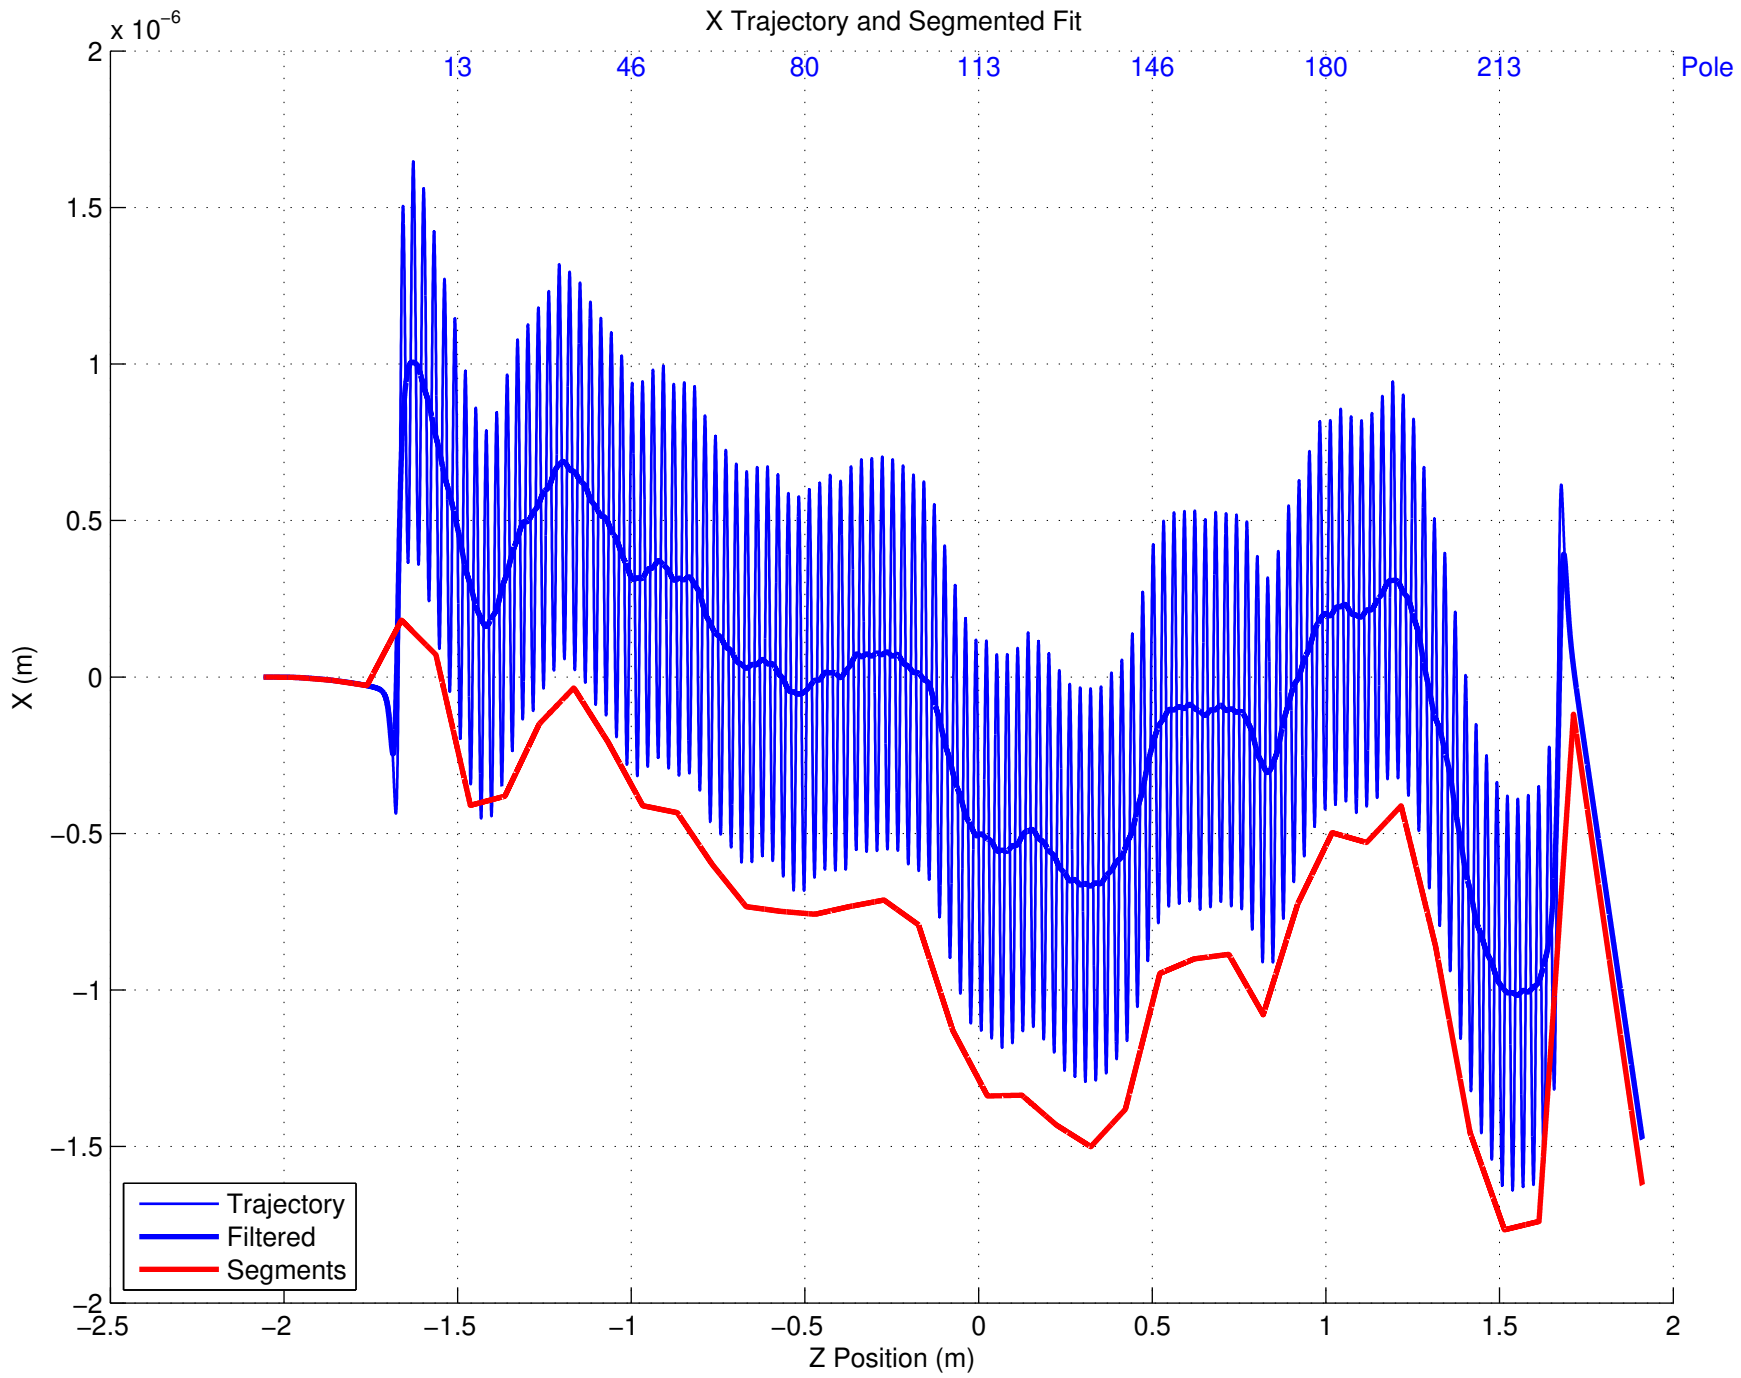
X Trajectory and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
2
1.5
1
0.5
0
−0.5
−1
−1.5
−2
X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

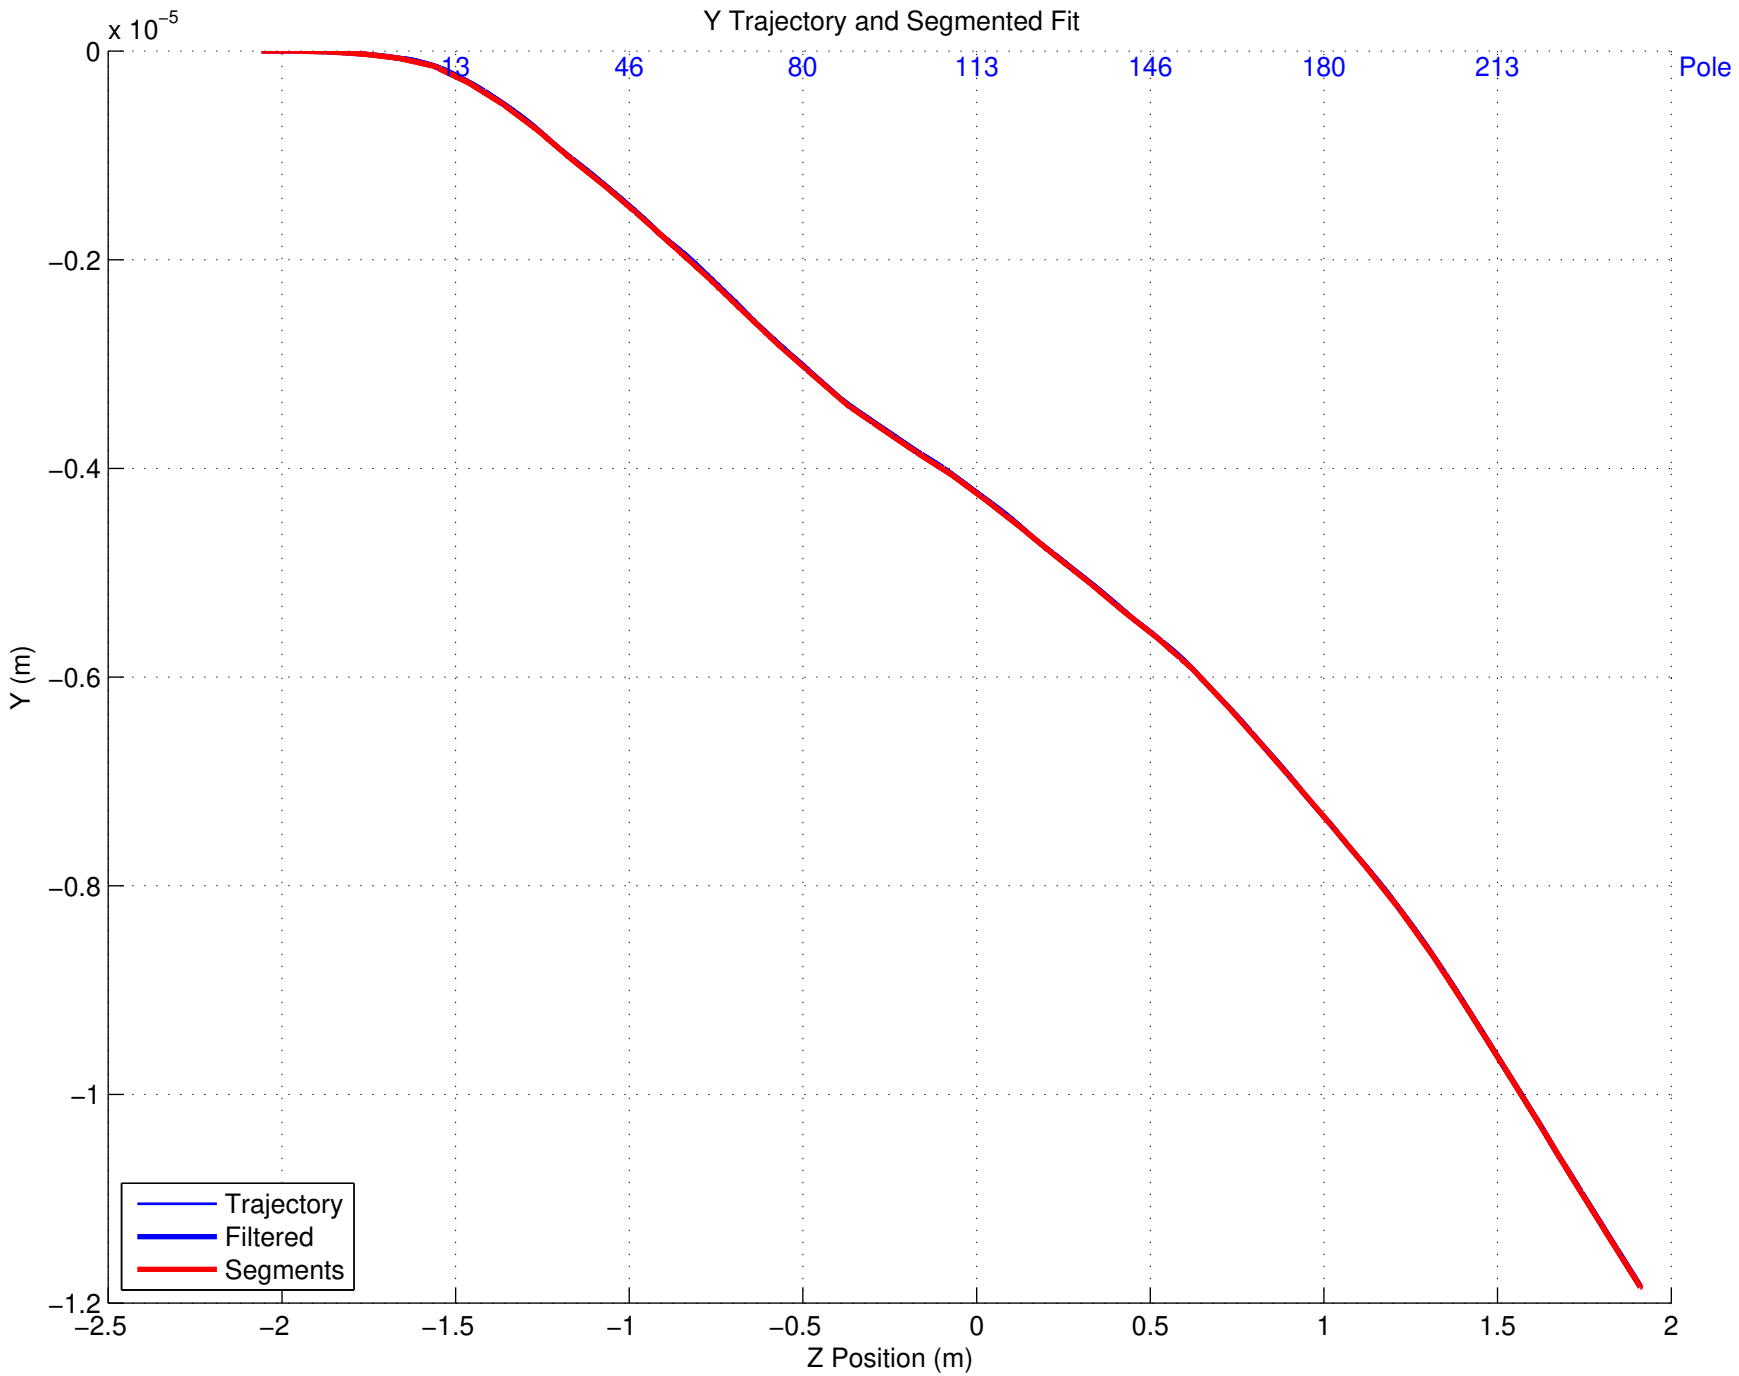
Y Trajectory and Segmented Fit
x 10^-5
0
−0.2
−0.4
−0.6
−0.8
−1
−1.2
Y (m)
13
46
80
113
146
180
213
Pole
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

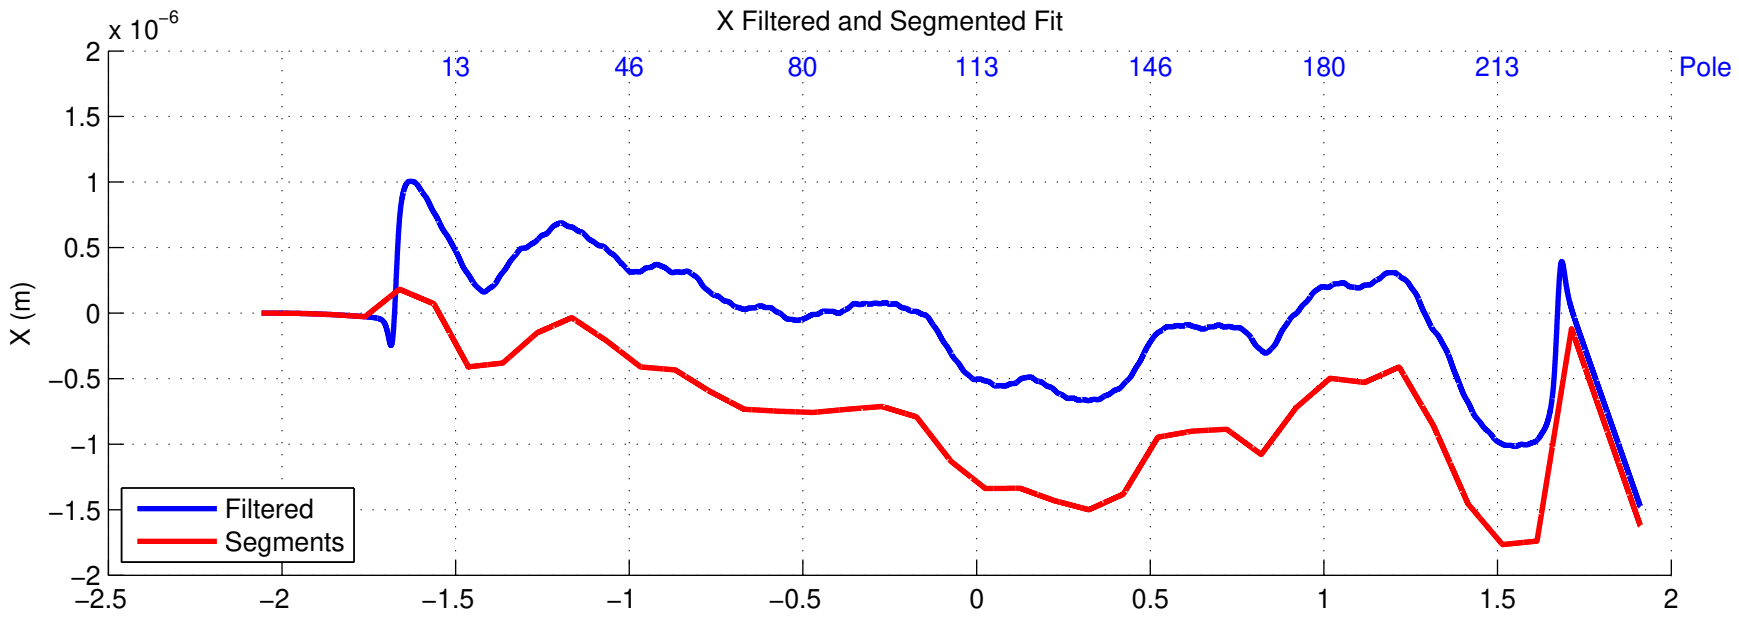
X Filtered and Segmented Fit
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
2
1.5
1
0.5
0
−0.5
−1
−1.5
−2
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

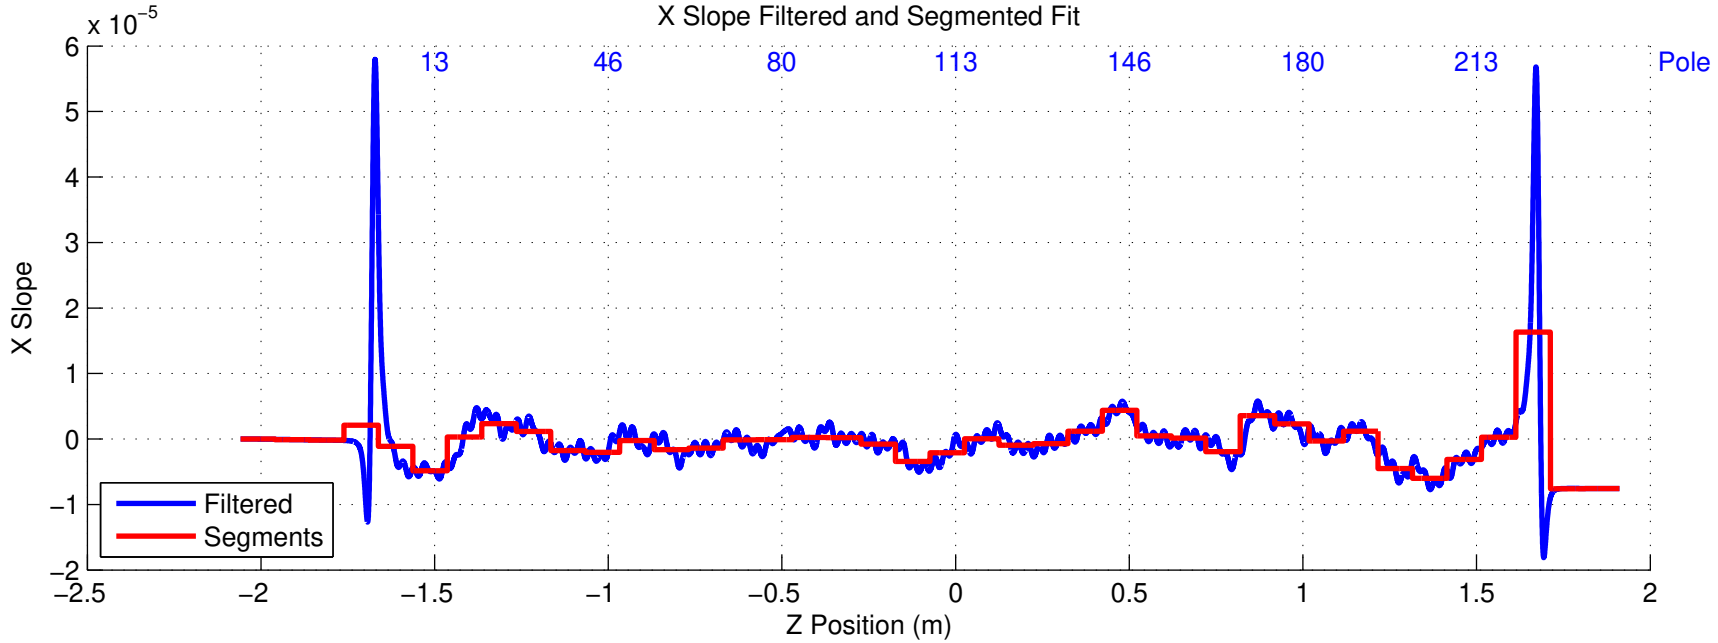
X Slope Filtered and Segmented Fit
x 10^-5
X Slope
13
46
80
113
146
180
213
Pole
Filtered
Segments
6
5
4
3
2
1
0
−1
−2
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

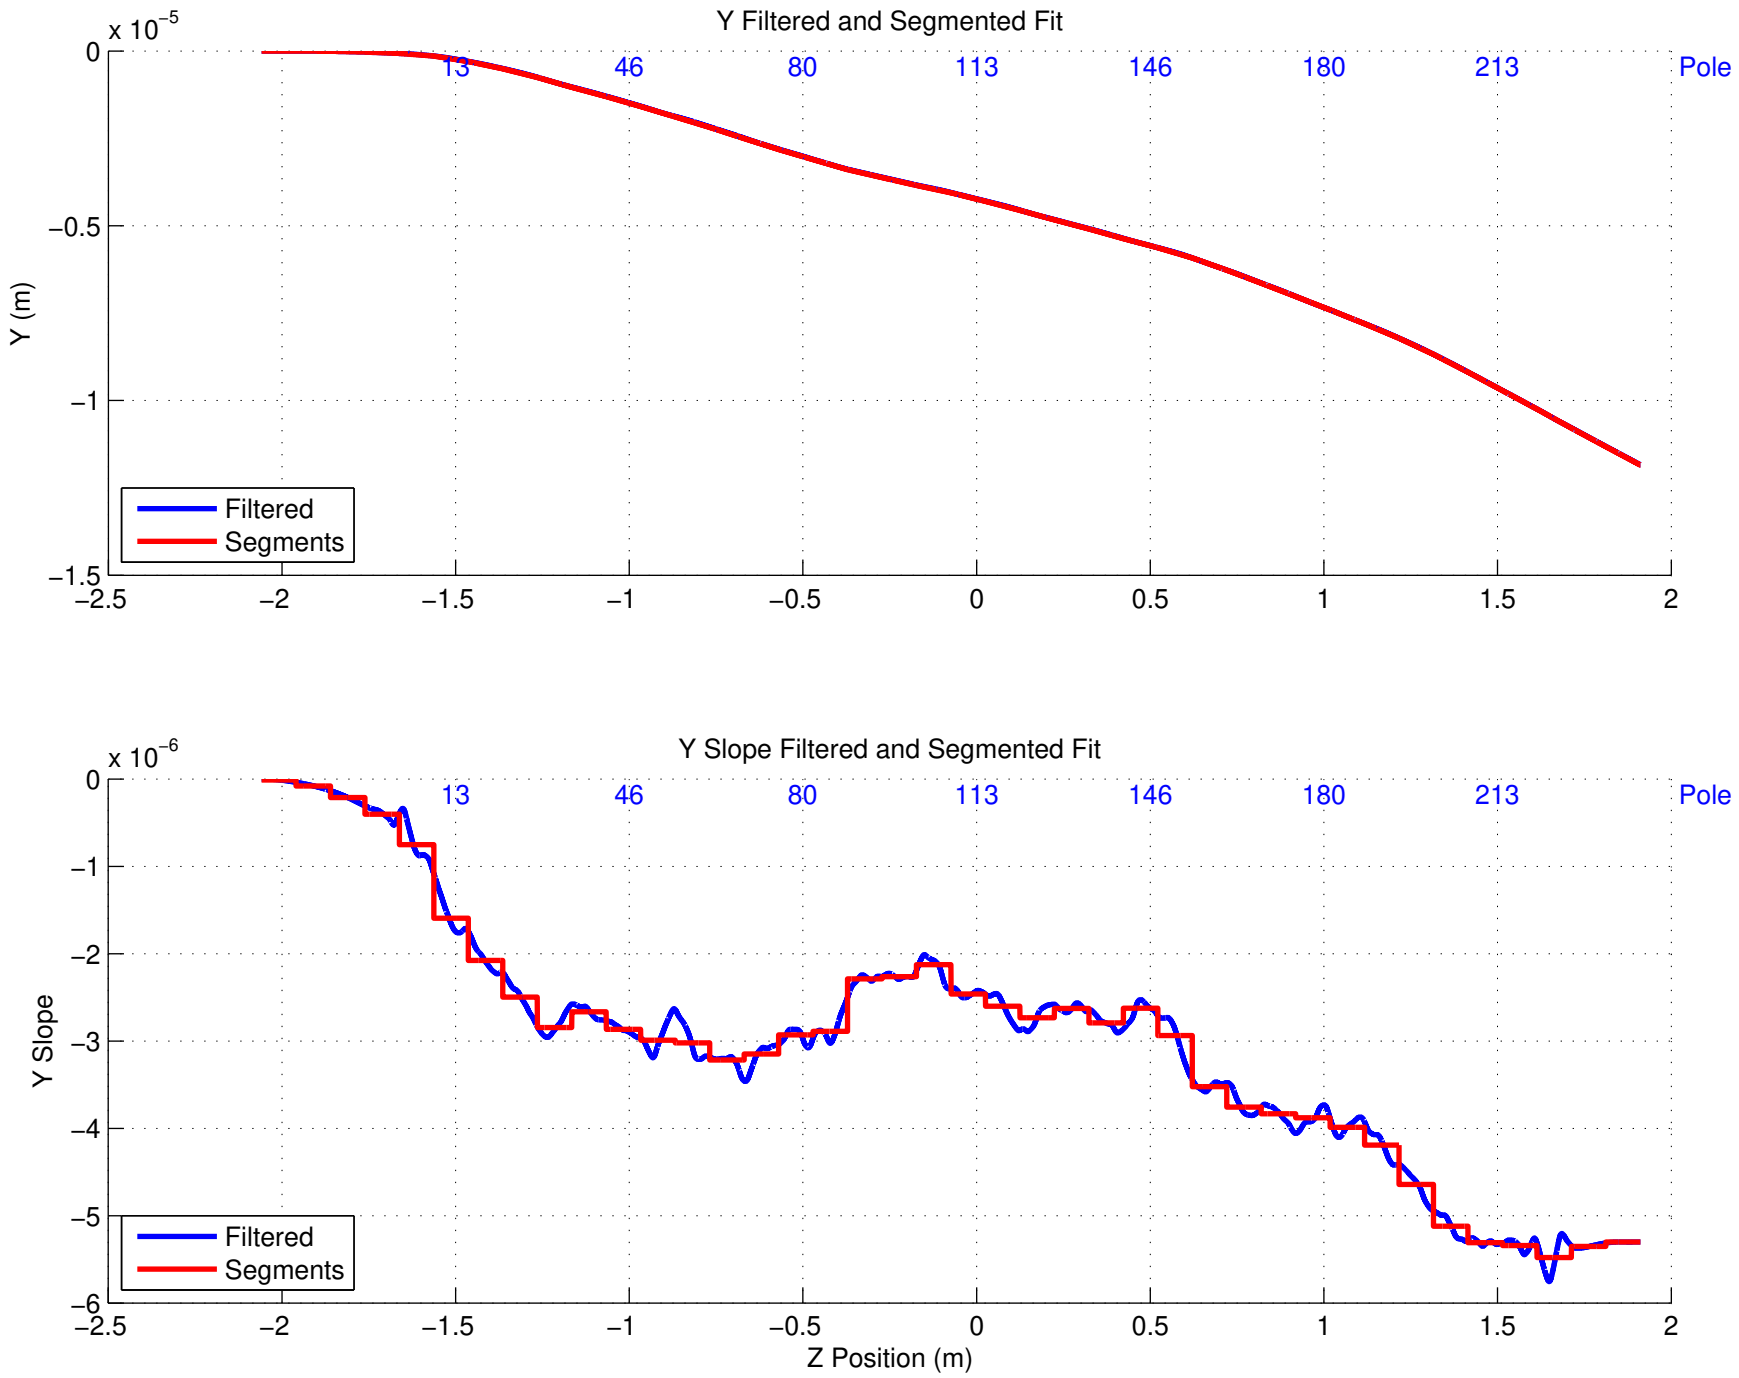
Y Filtered and Segmented Fit
x 10^-5
0
−0.5
−1
−1.5
Y (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Y Slope Filtered and Segmented Fit
x 10^-6
0
−1
−2
−3
−4
−5
−6
Y Slope
13
46
80
113
146
180
213
Pole
Filtered
Segments
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

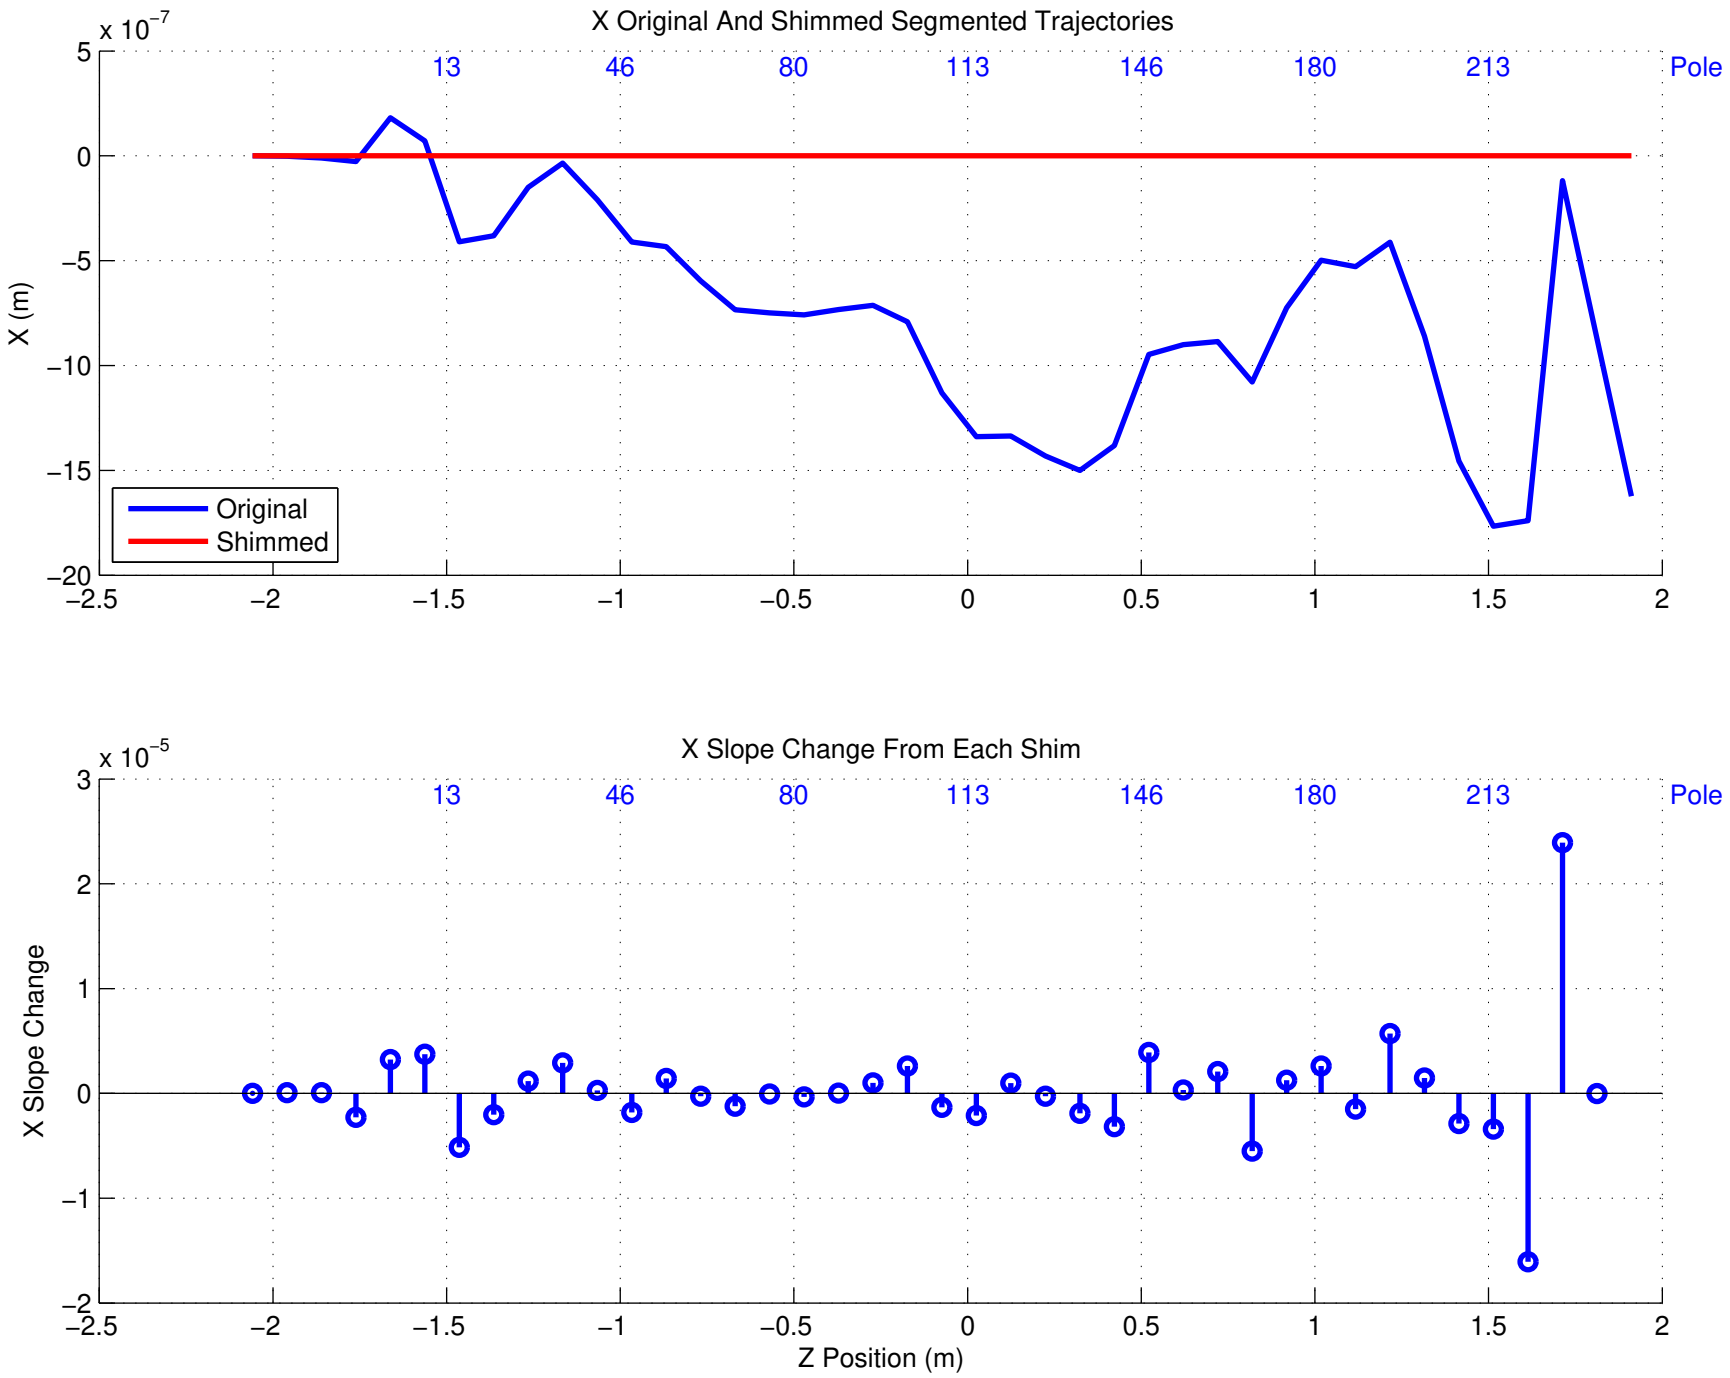
X Original And Shimmed Segmented Trajectories
x 10^-7
13
46
80
113
146
180
213
Pole
X (m)
Original
Shimmed
X Slope Change From Each Shim
x 10^-5
X Slope Change
Z Position (m)

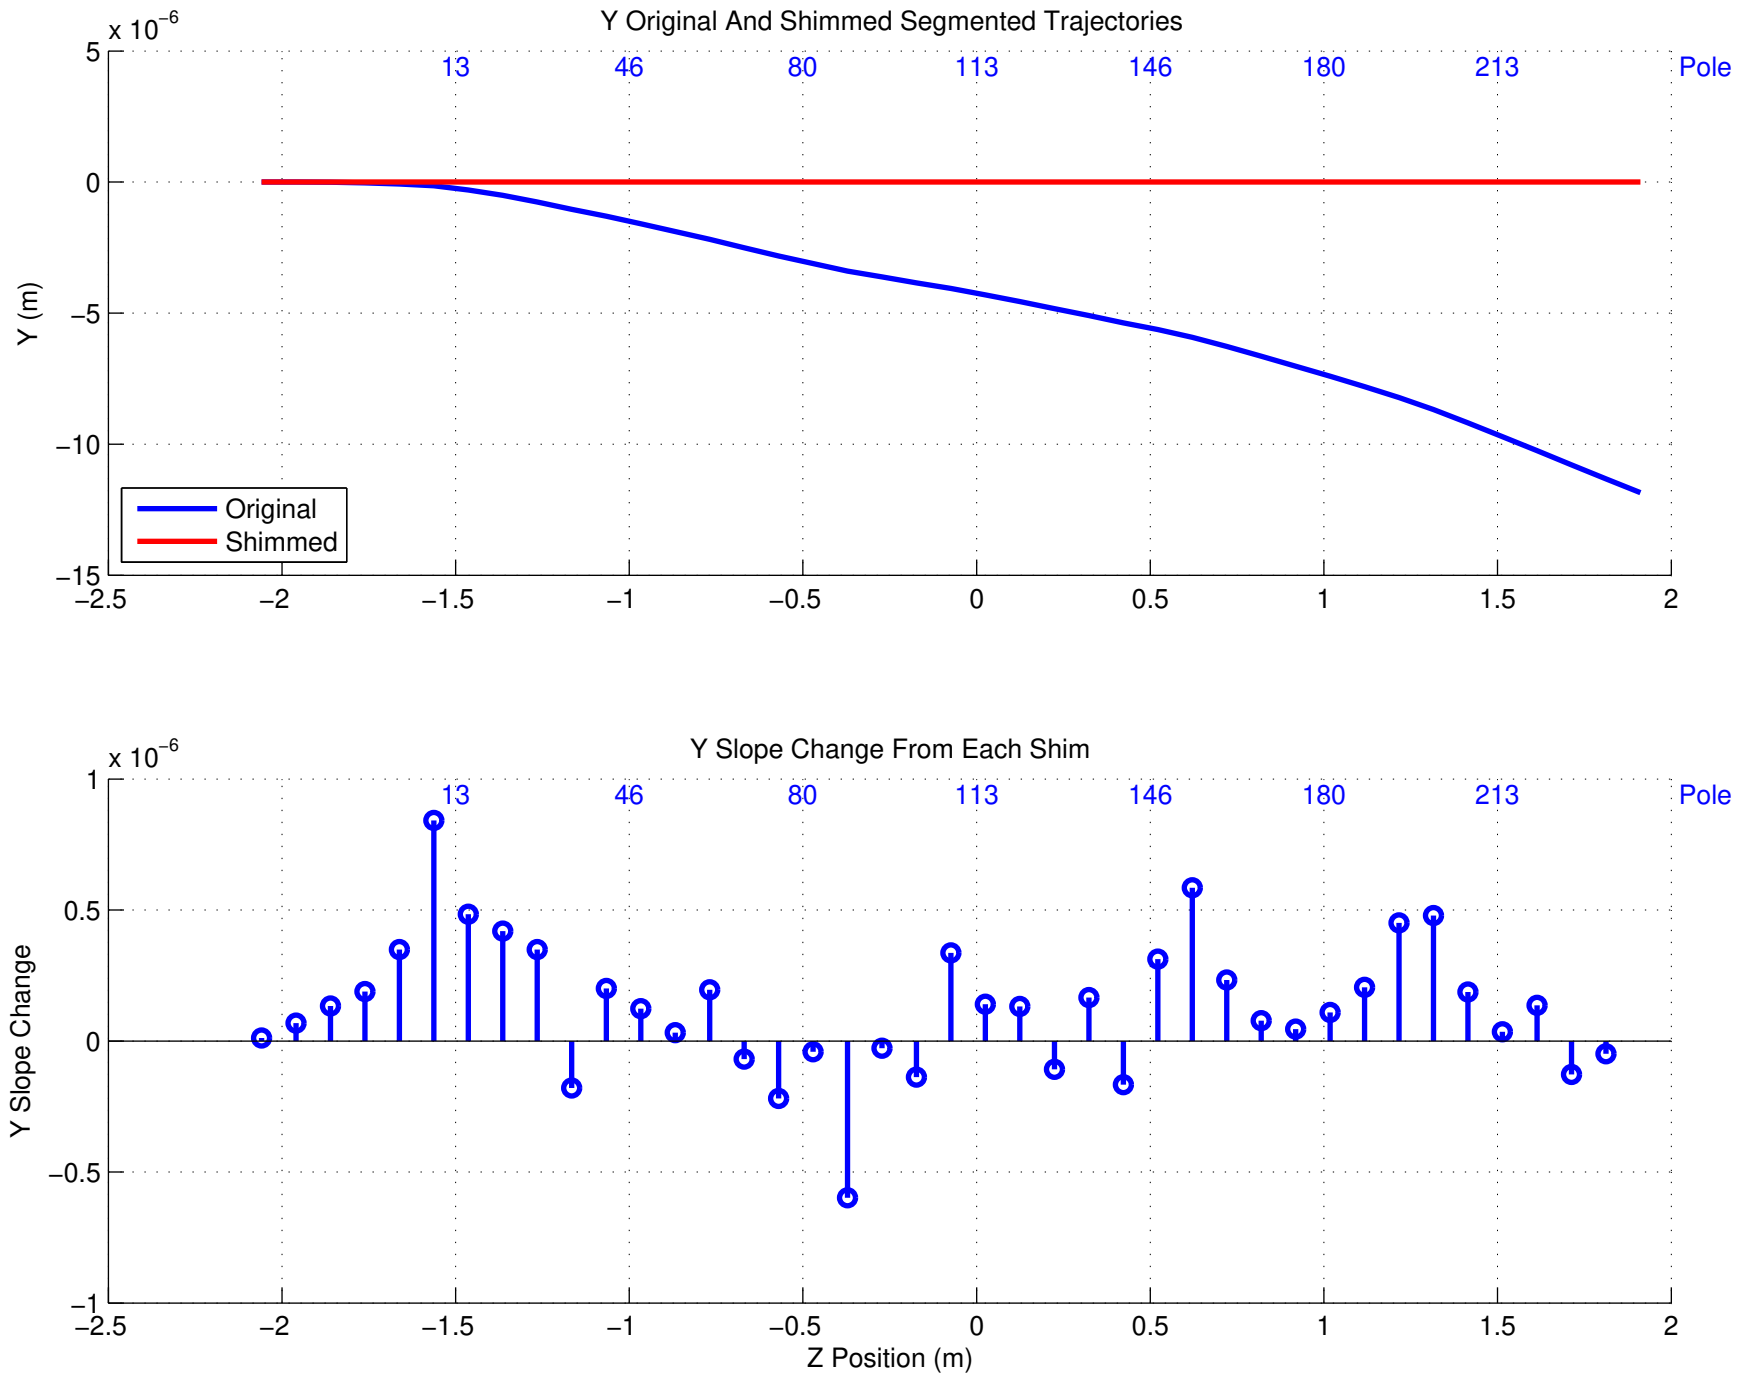
Y Original And Shimmed Segmented Trajectories
x 10^-6
13
46
80
113
146
180
213
Pole
Y (m)
Original
Shimmed
Y Slope Change From Each Shim
Y Slope Change
Z Position (m)

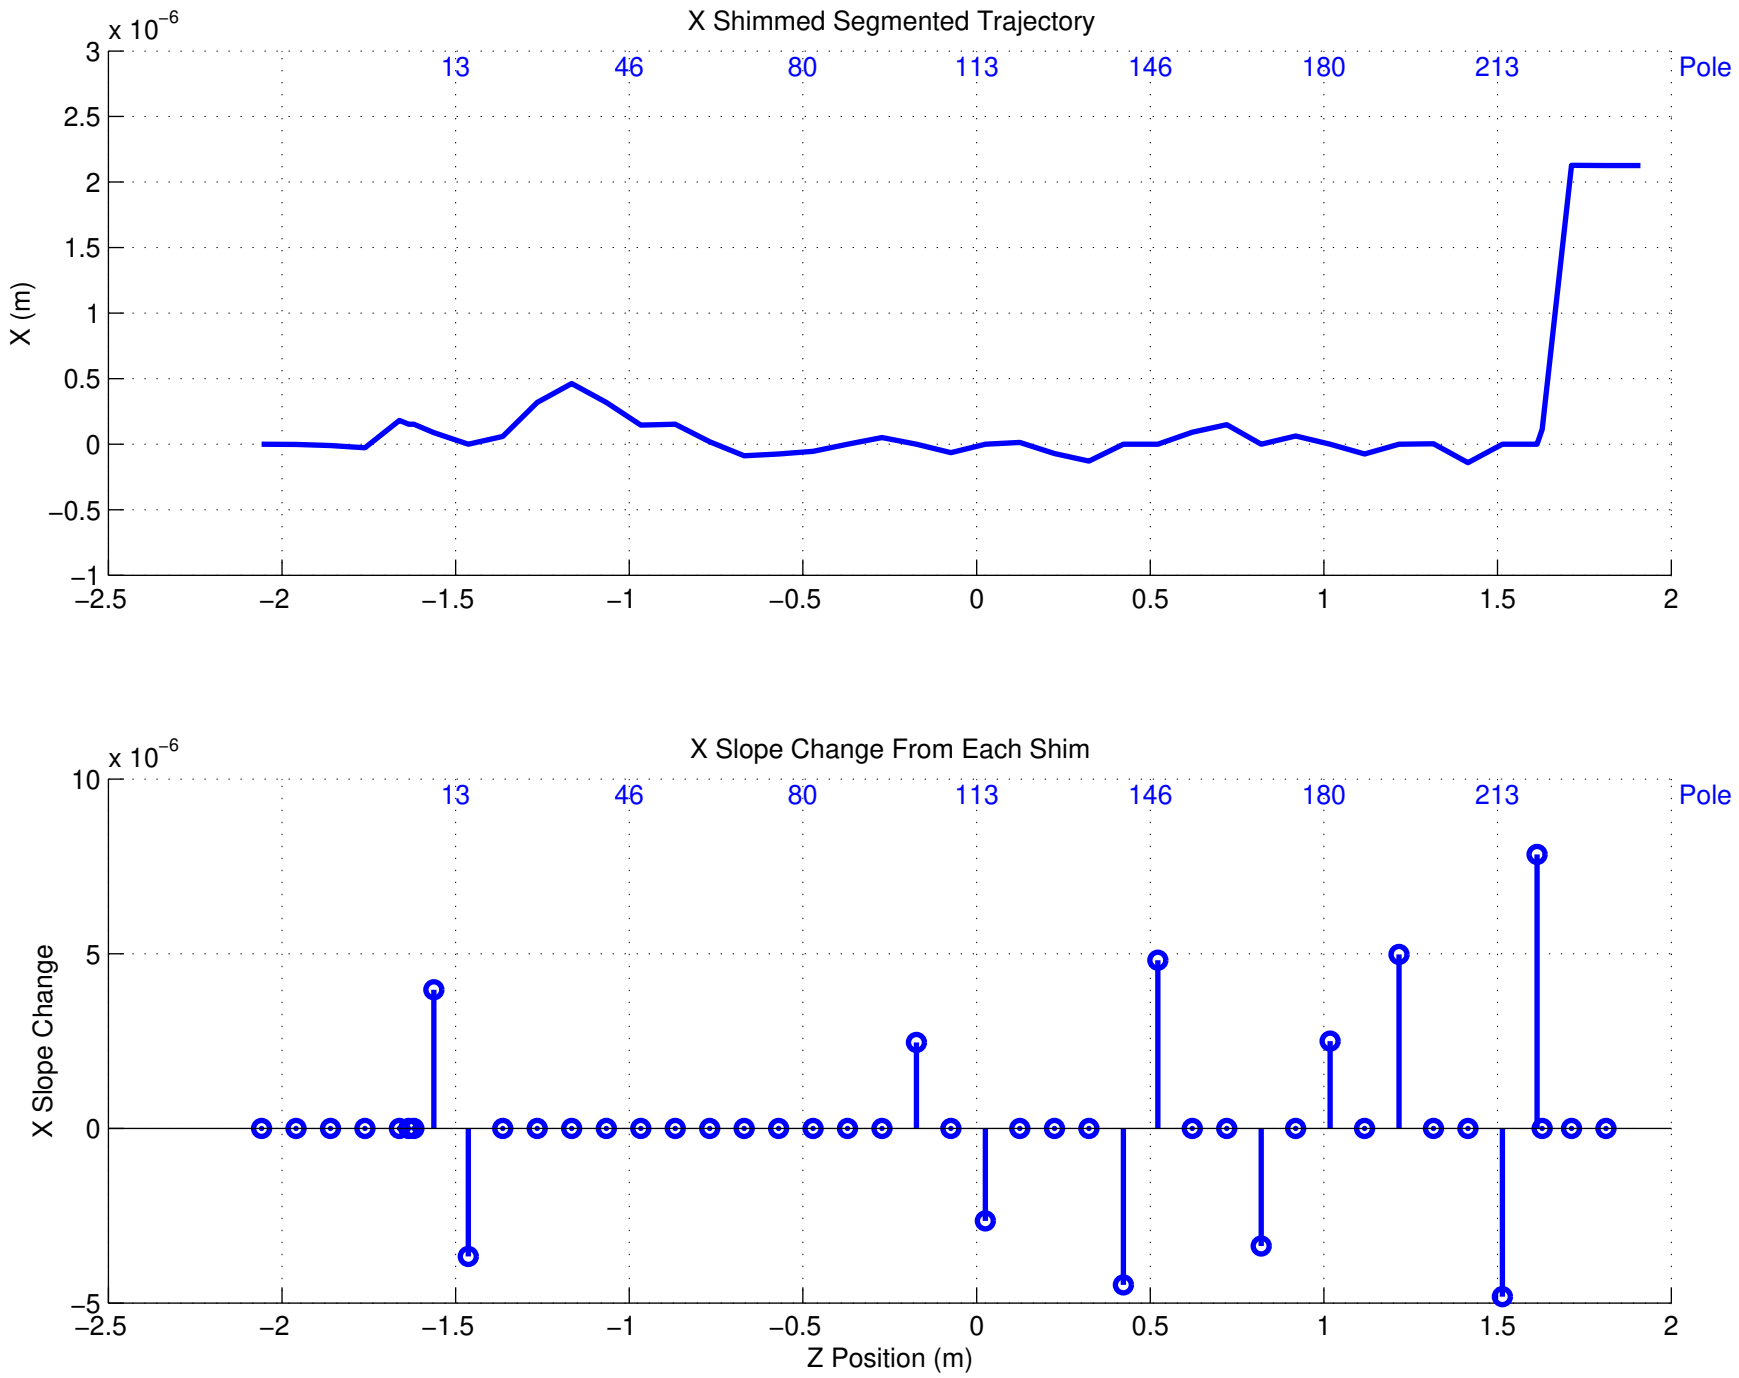
X Shimmed Segmented Trajectory
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
X Slope Change From Each Shim
X Slope Change
Z Position (m)

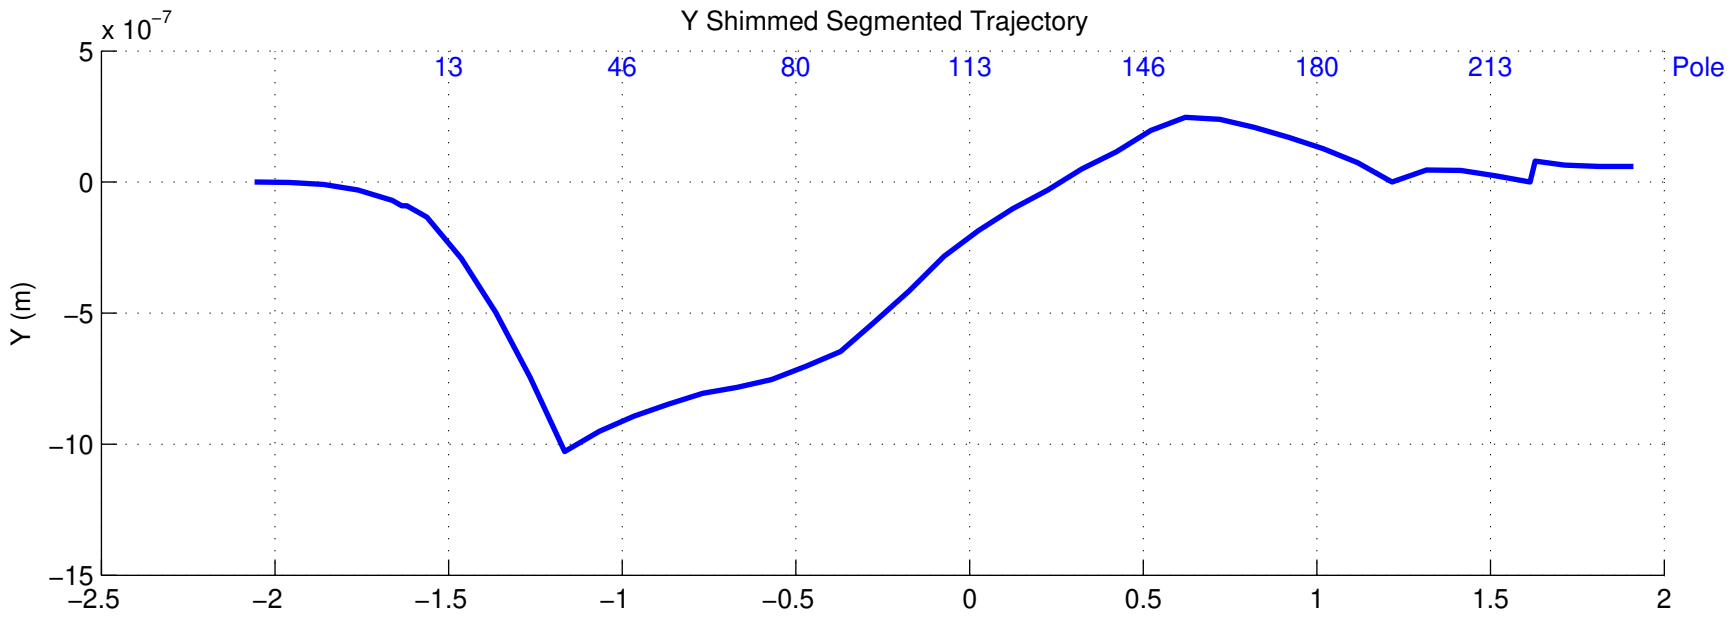
Y Shimmed Segmented Trajectory
x 10^-7
13
46
80
113
146
180
213
Pole
Y (m)
5
0
−5
−10
−15
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

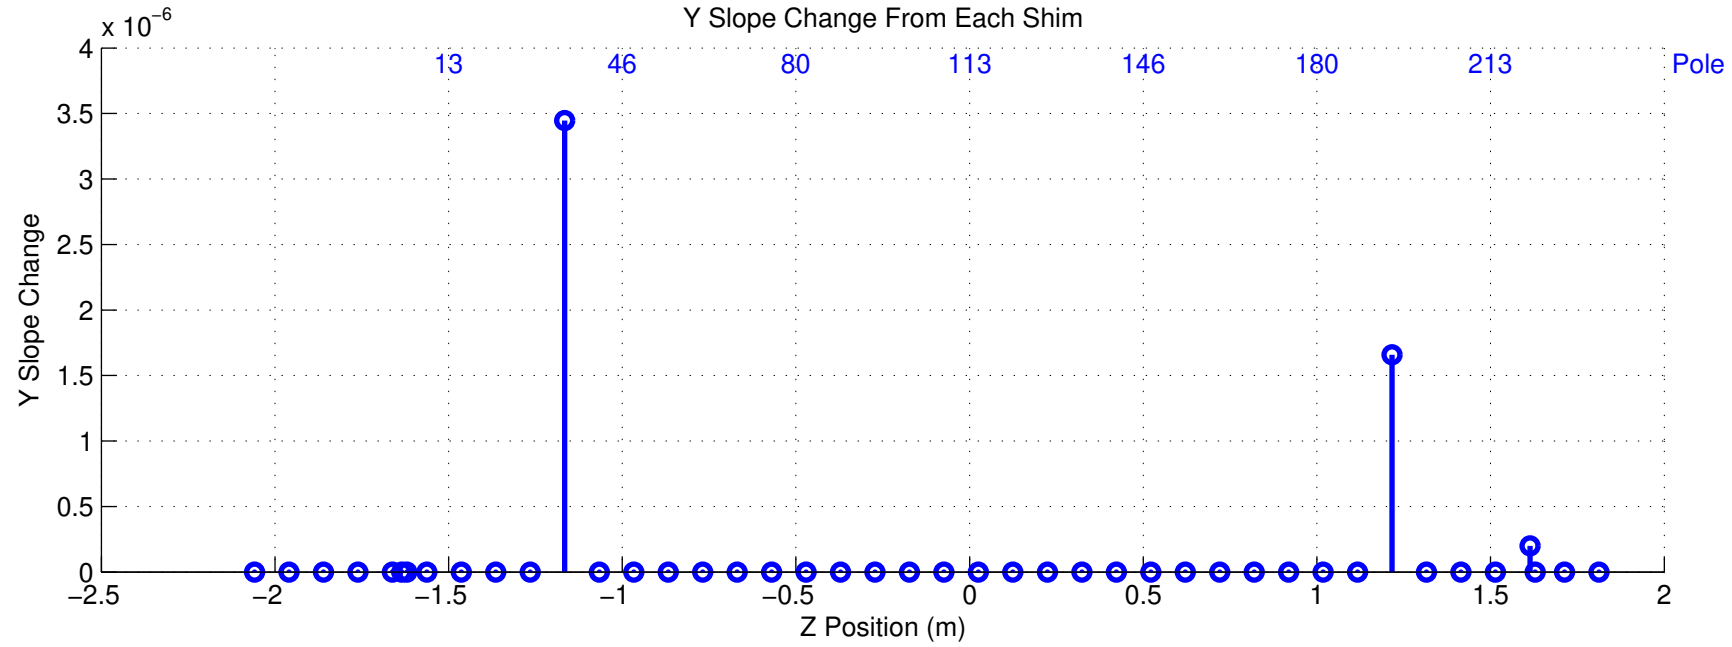
Y Slope Change From Each Shim
x 10^-6
13
46
80
113
146
180
213
Pole
Y Slope Change
4
3.5
3
2.5
2
1.5
1
0.5
0
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

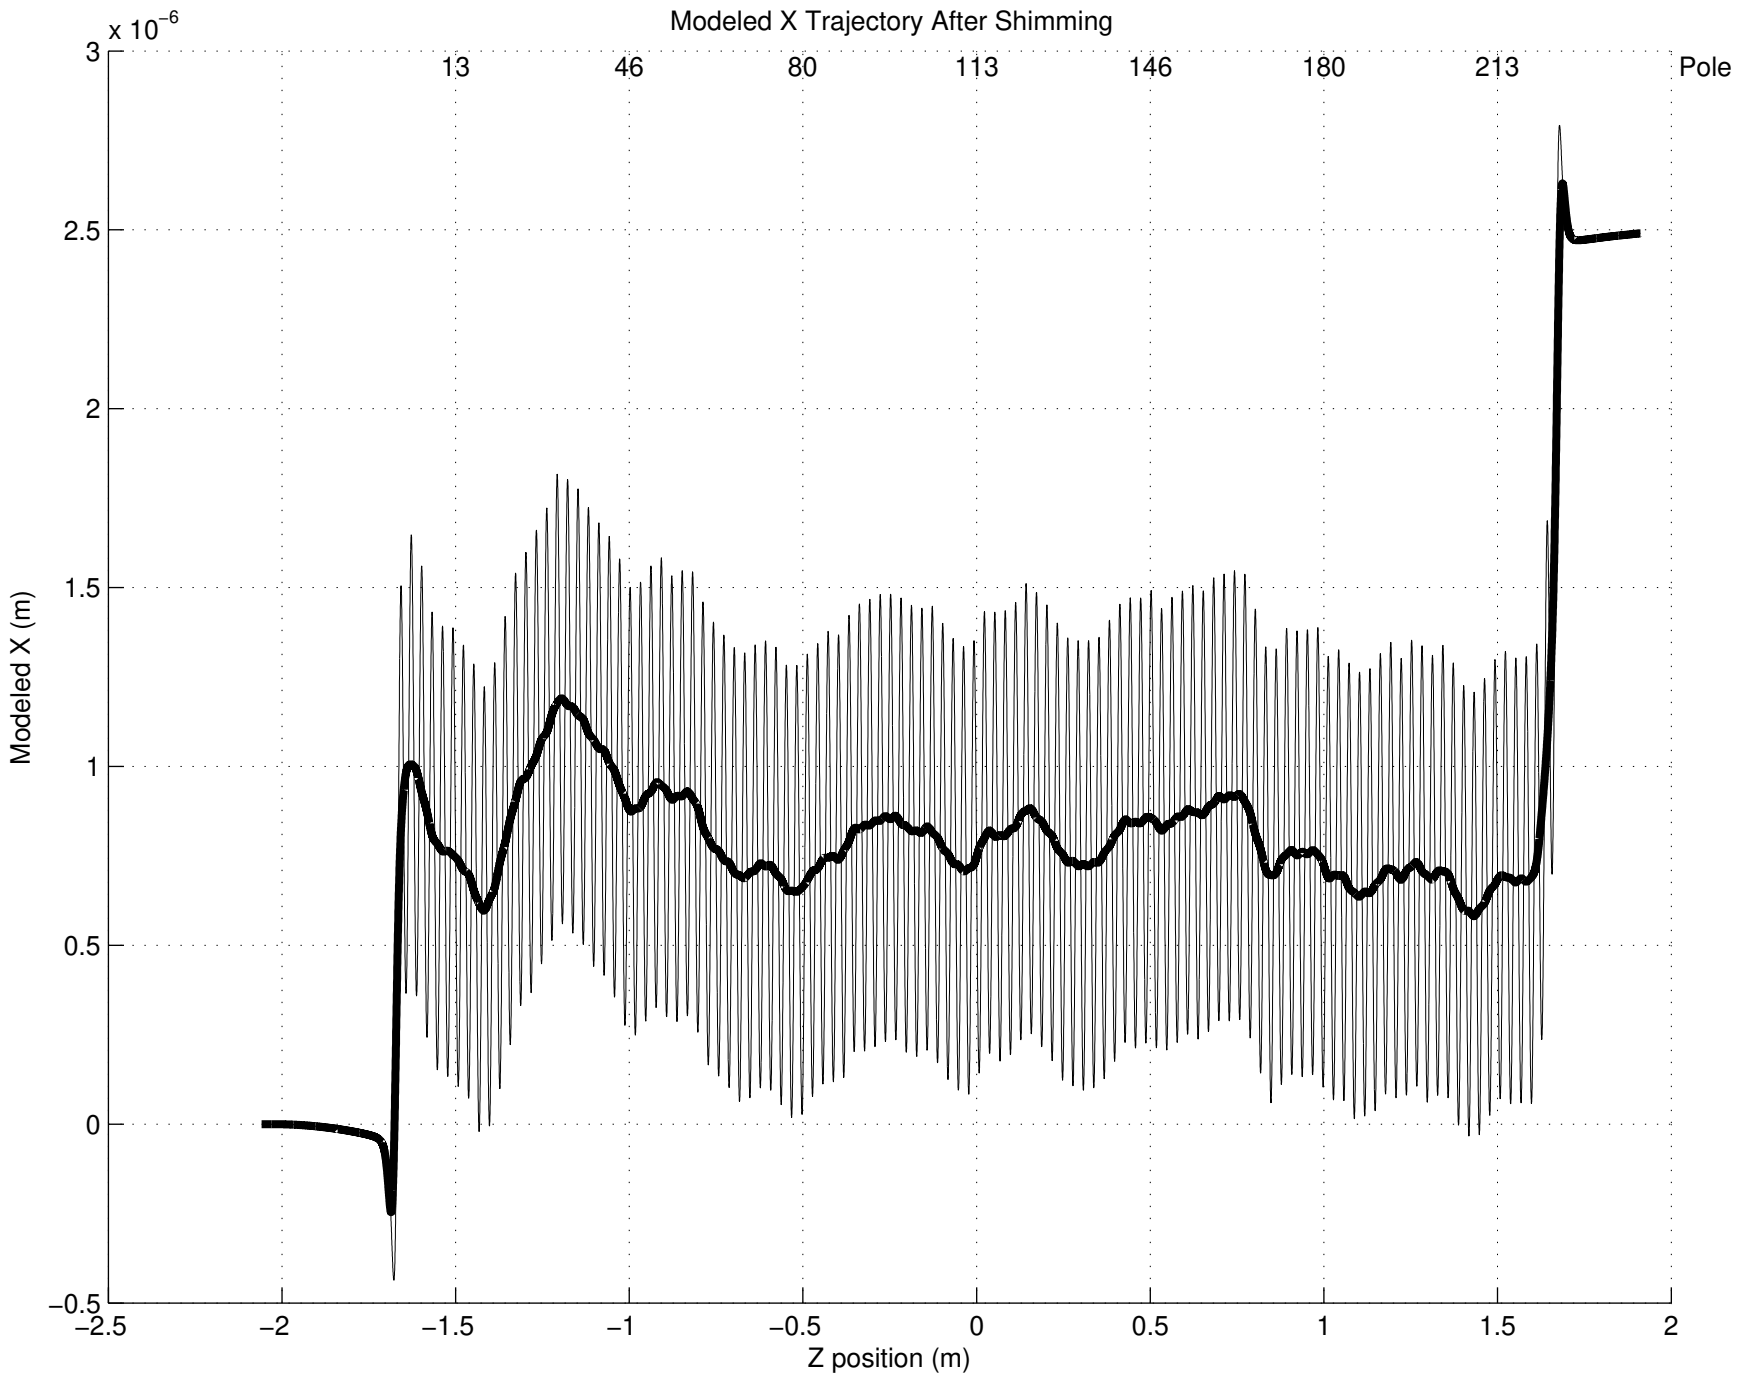
Modeled X Trajectory After Shimming
x 10^-6
3
2.5
2
1.5
1
0.5
0
−0.5
13
46
80
113
146
180
213
Pole
Modeled X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

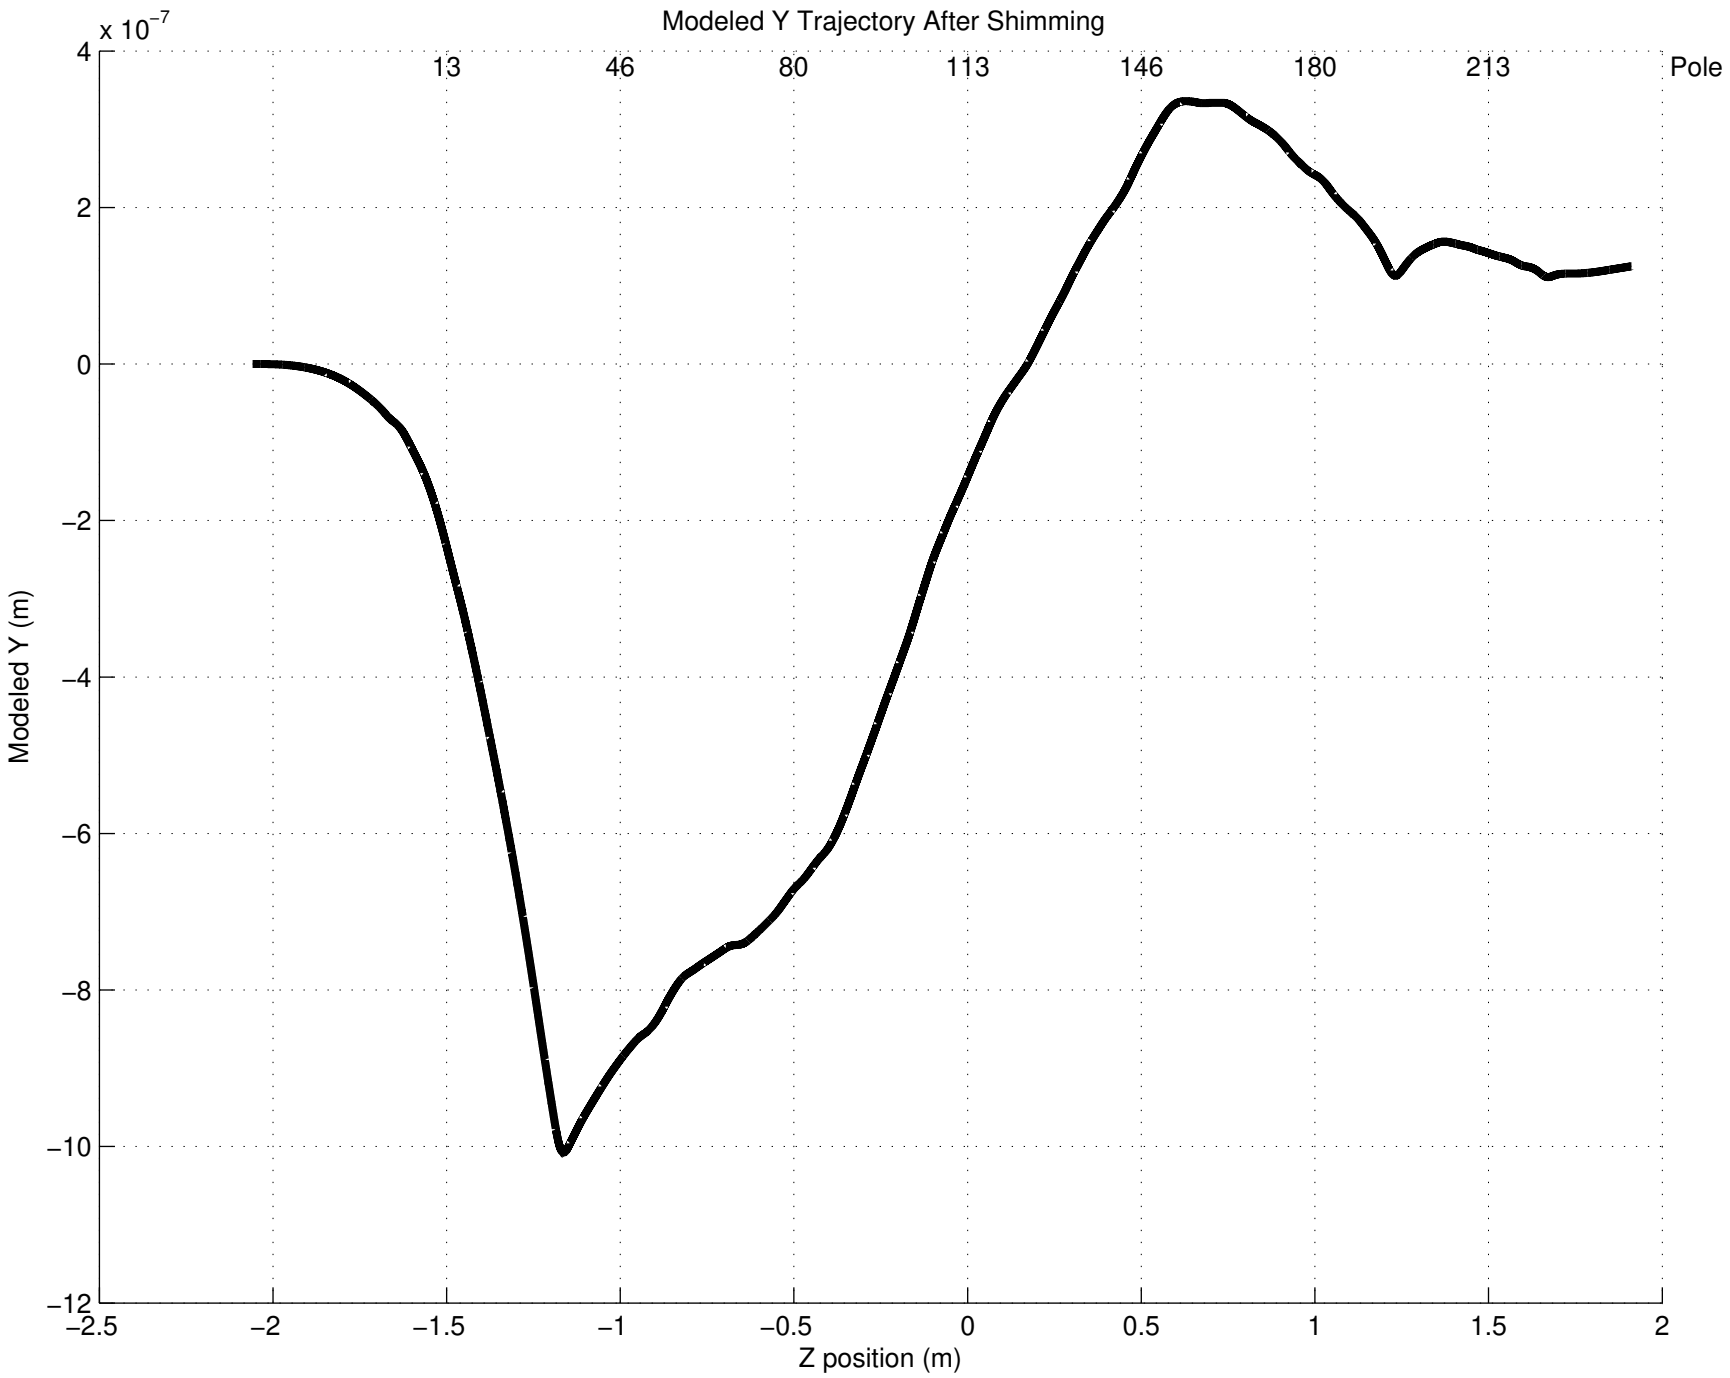
Modeled Y Trajectory After Shimming
x 10^-7
13
46
80
113
146
180
213
Pole
4
2
0
−2
−4
−6
−8
−10
−12
Modeled Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

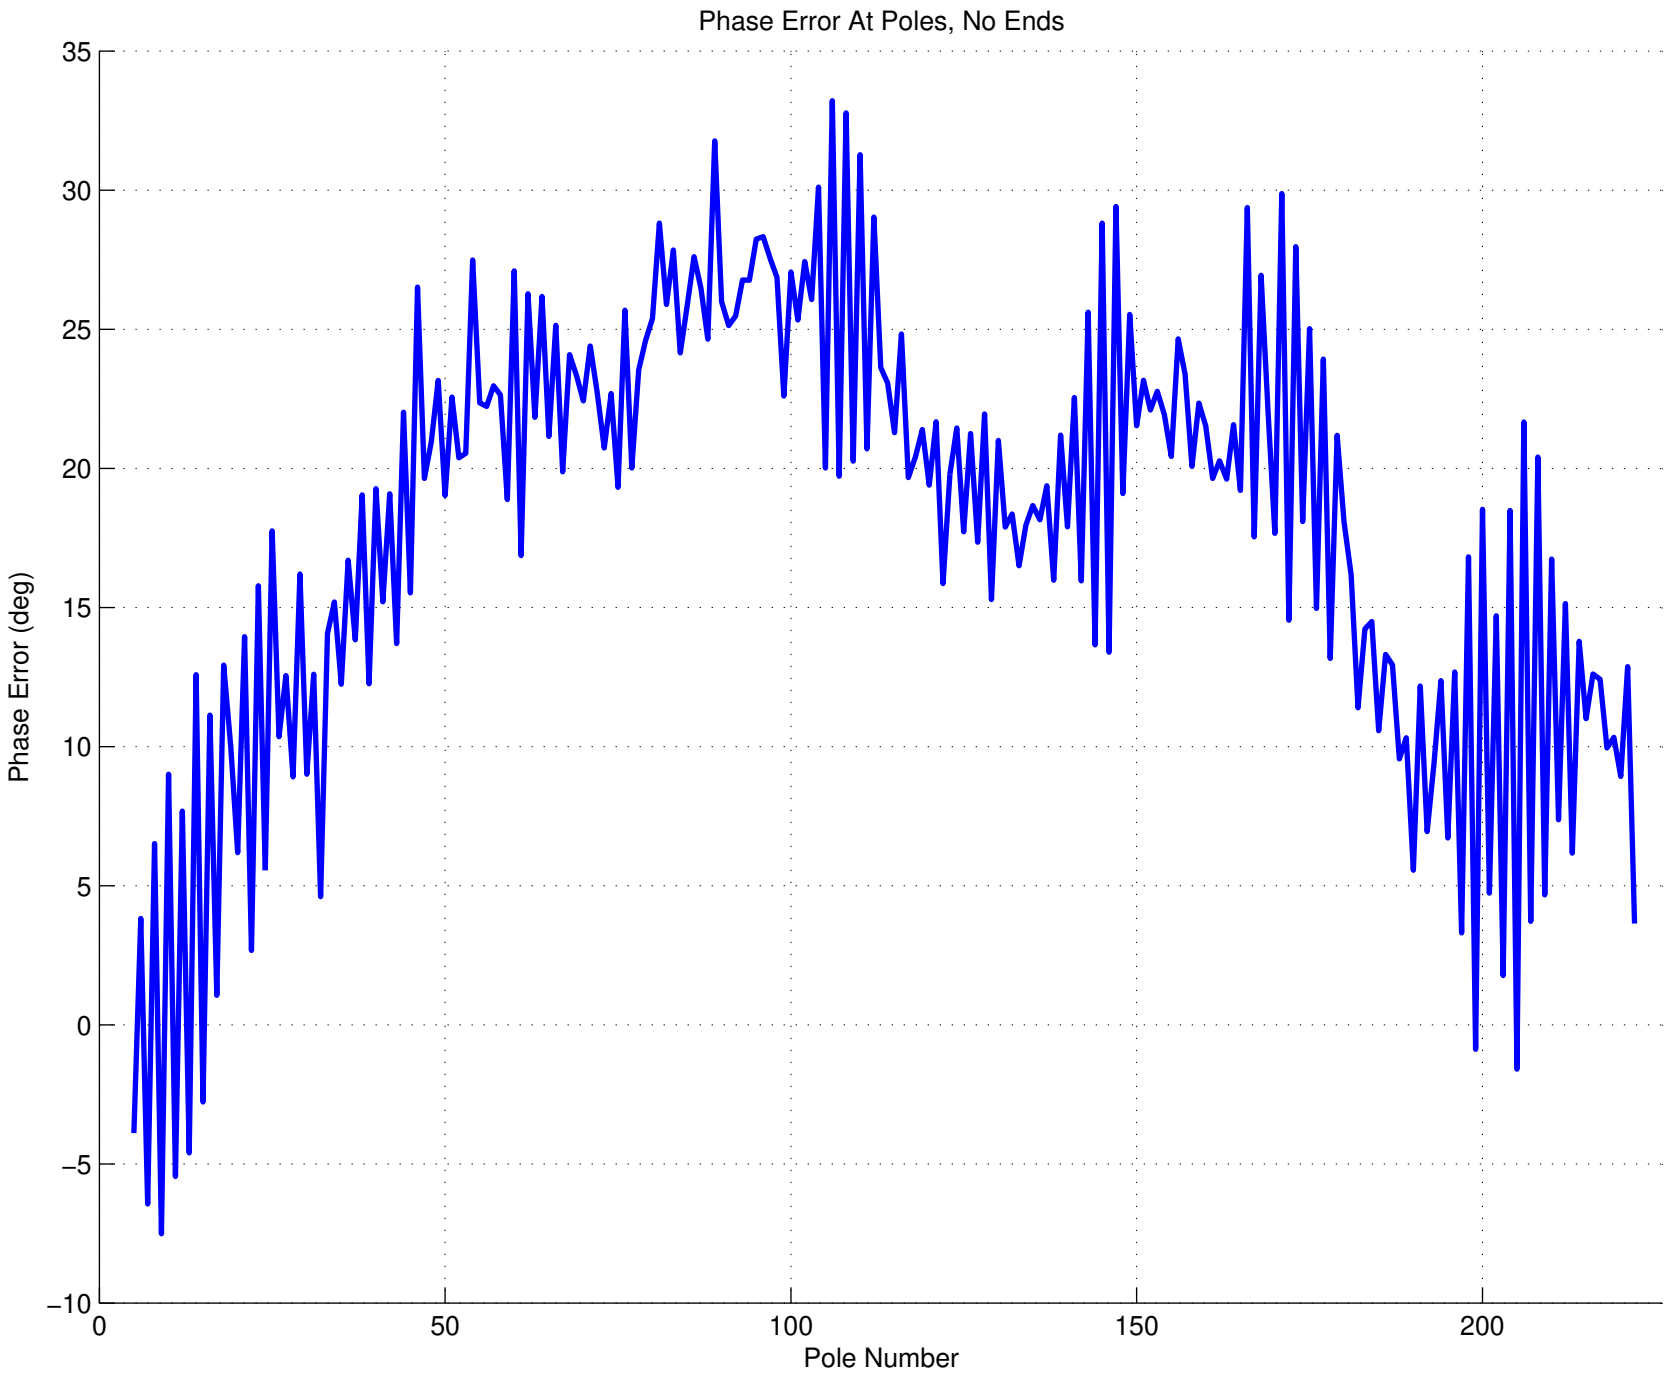
Phase Error At Poles, No Ends
Phase Error (deg)
Pole Number
35
30
25
20
15
10
5
0
−5
−10
0
50
100
150
200

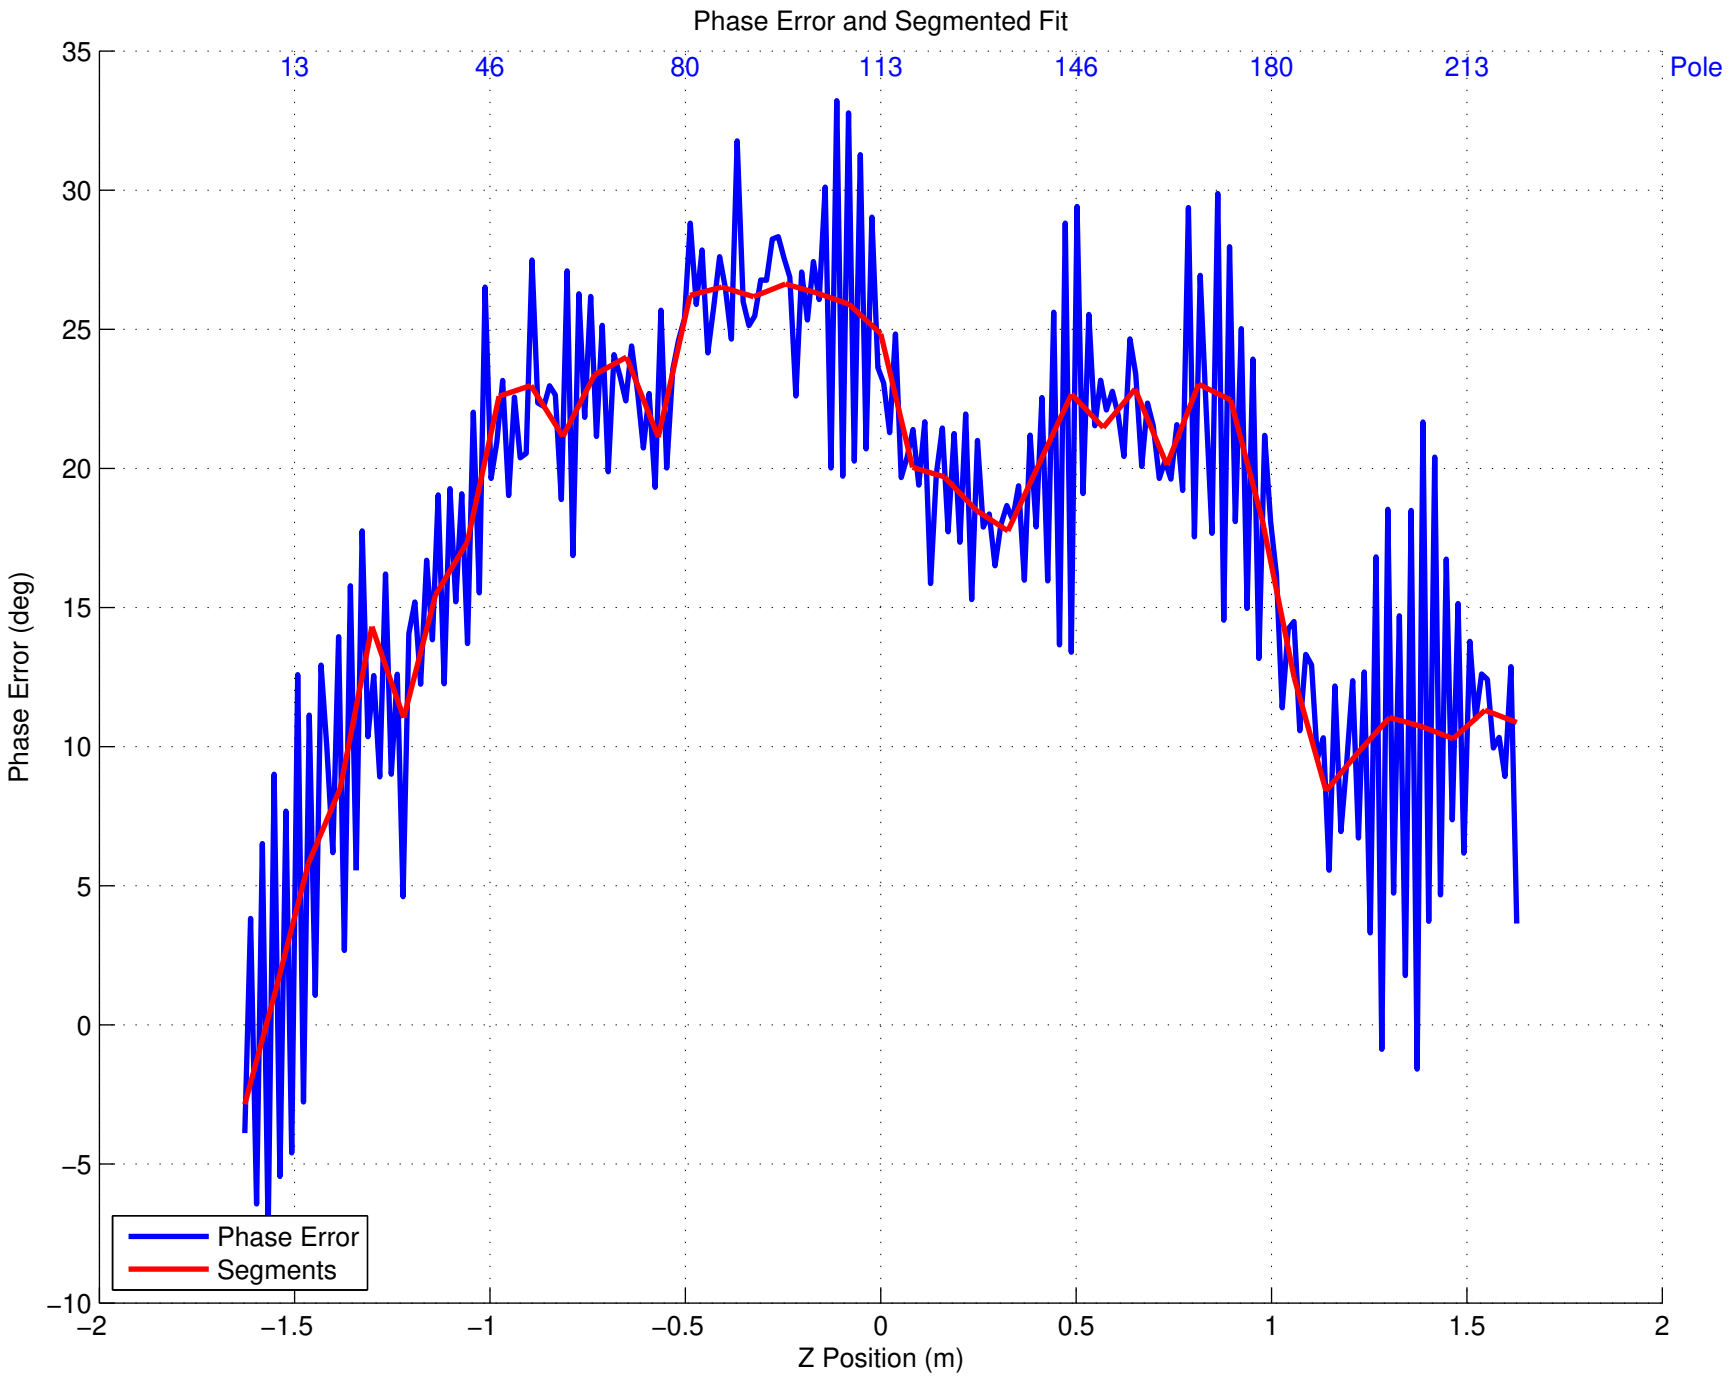
Phase Error and Segmented Fit
13
46
80
113
146
180
213
Pole
35
30
25
20
15
10
5
0
−5
−10
Phase Error (deg)
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Phase Error
Segments

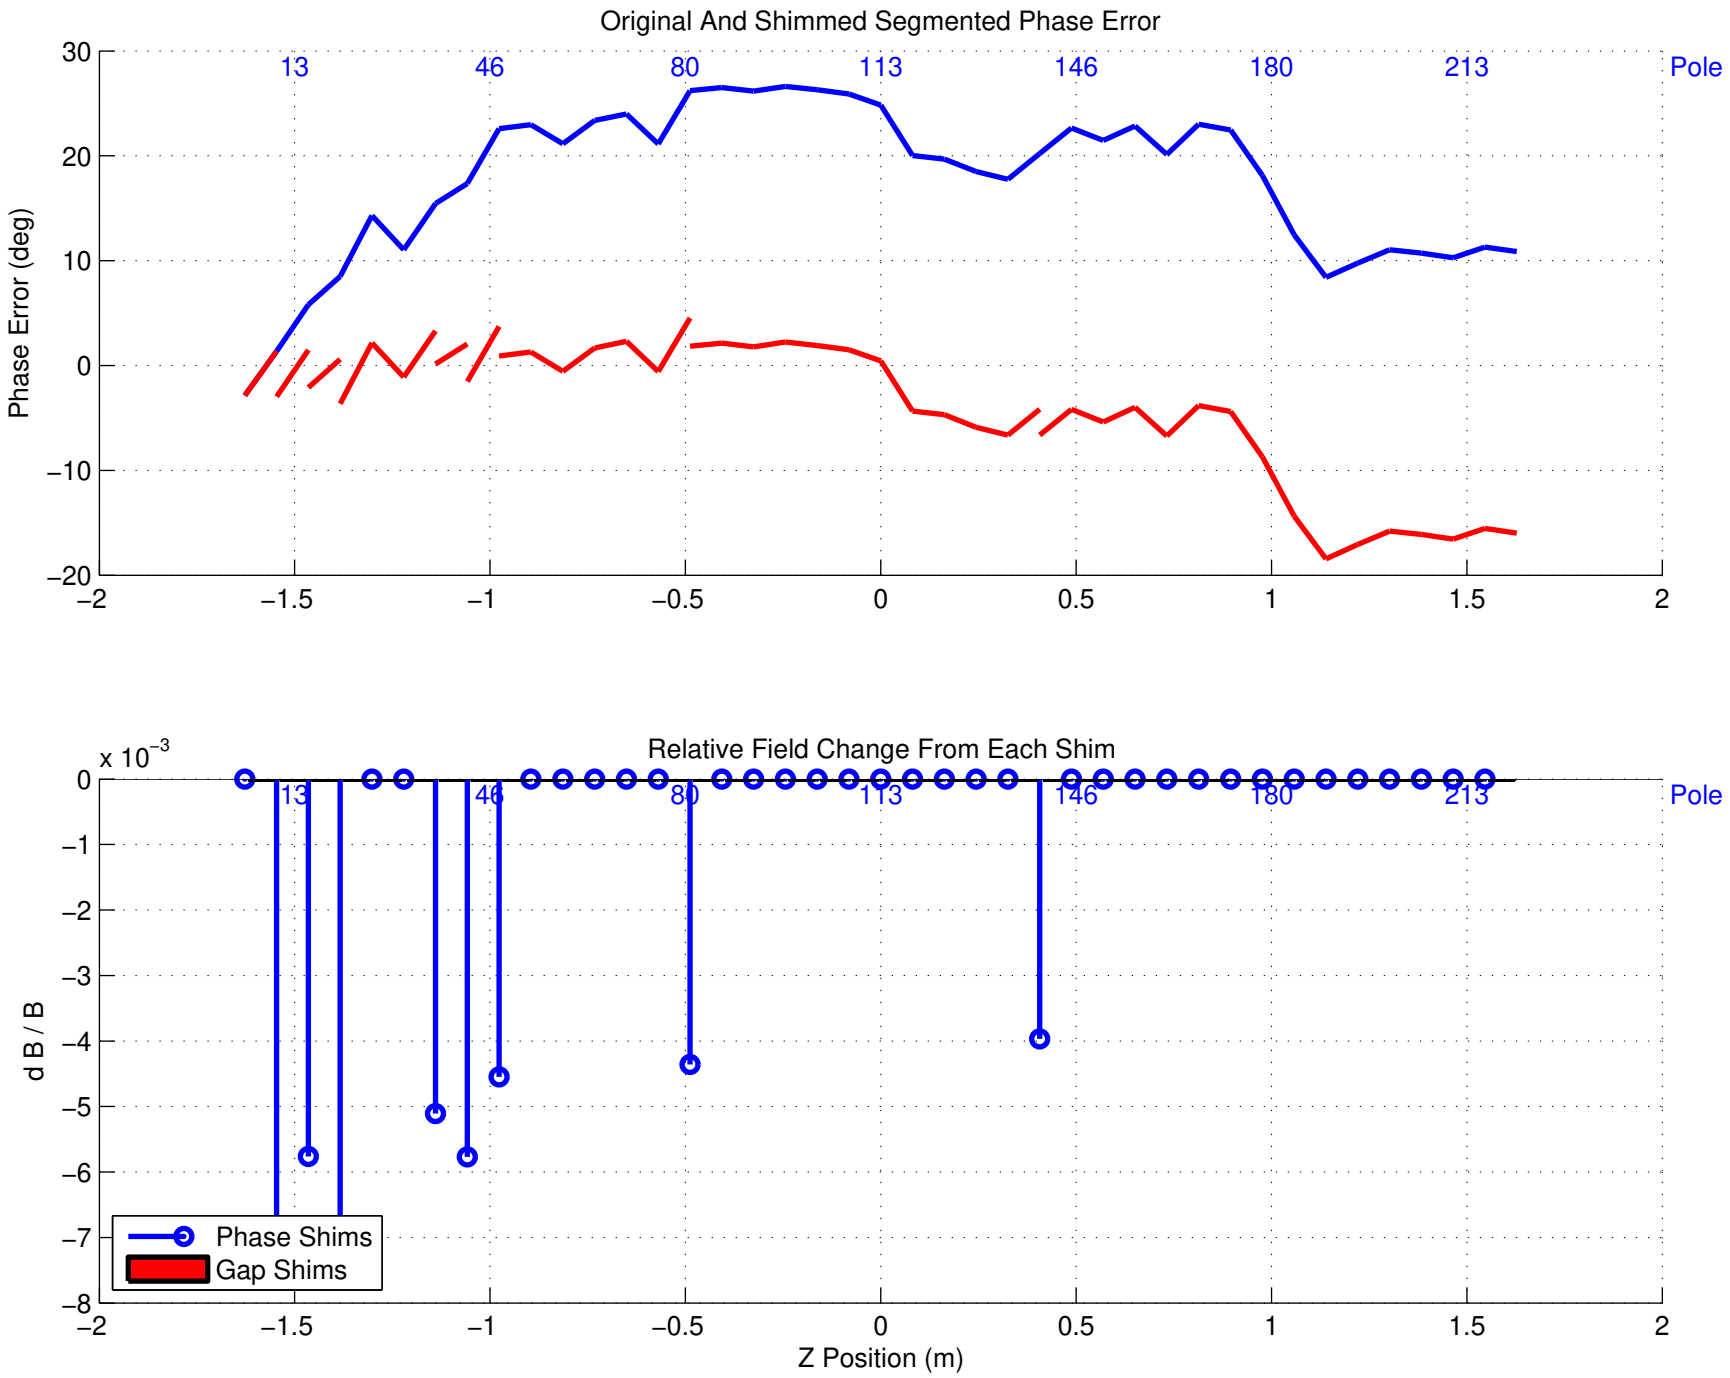
Original And Shimmed Segmented Phase Error
Phase Error (deg)
30
20
10
0
−10
−20
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
0
−1
−2
−3
−4
−5
−6
−7
−8
Phase Shims
Gap Shims
Z Position (m)

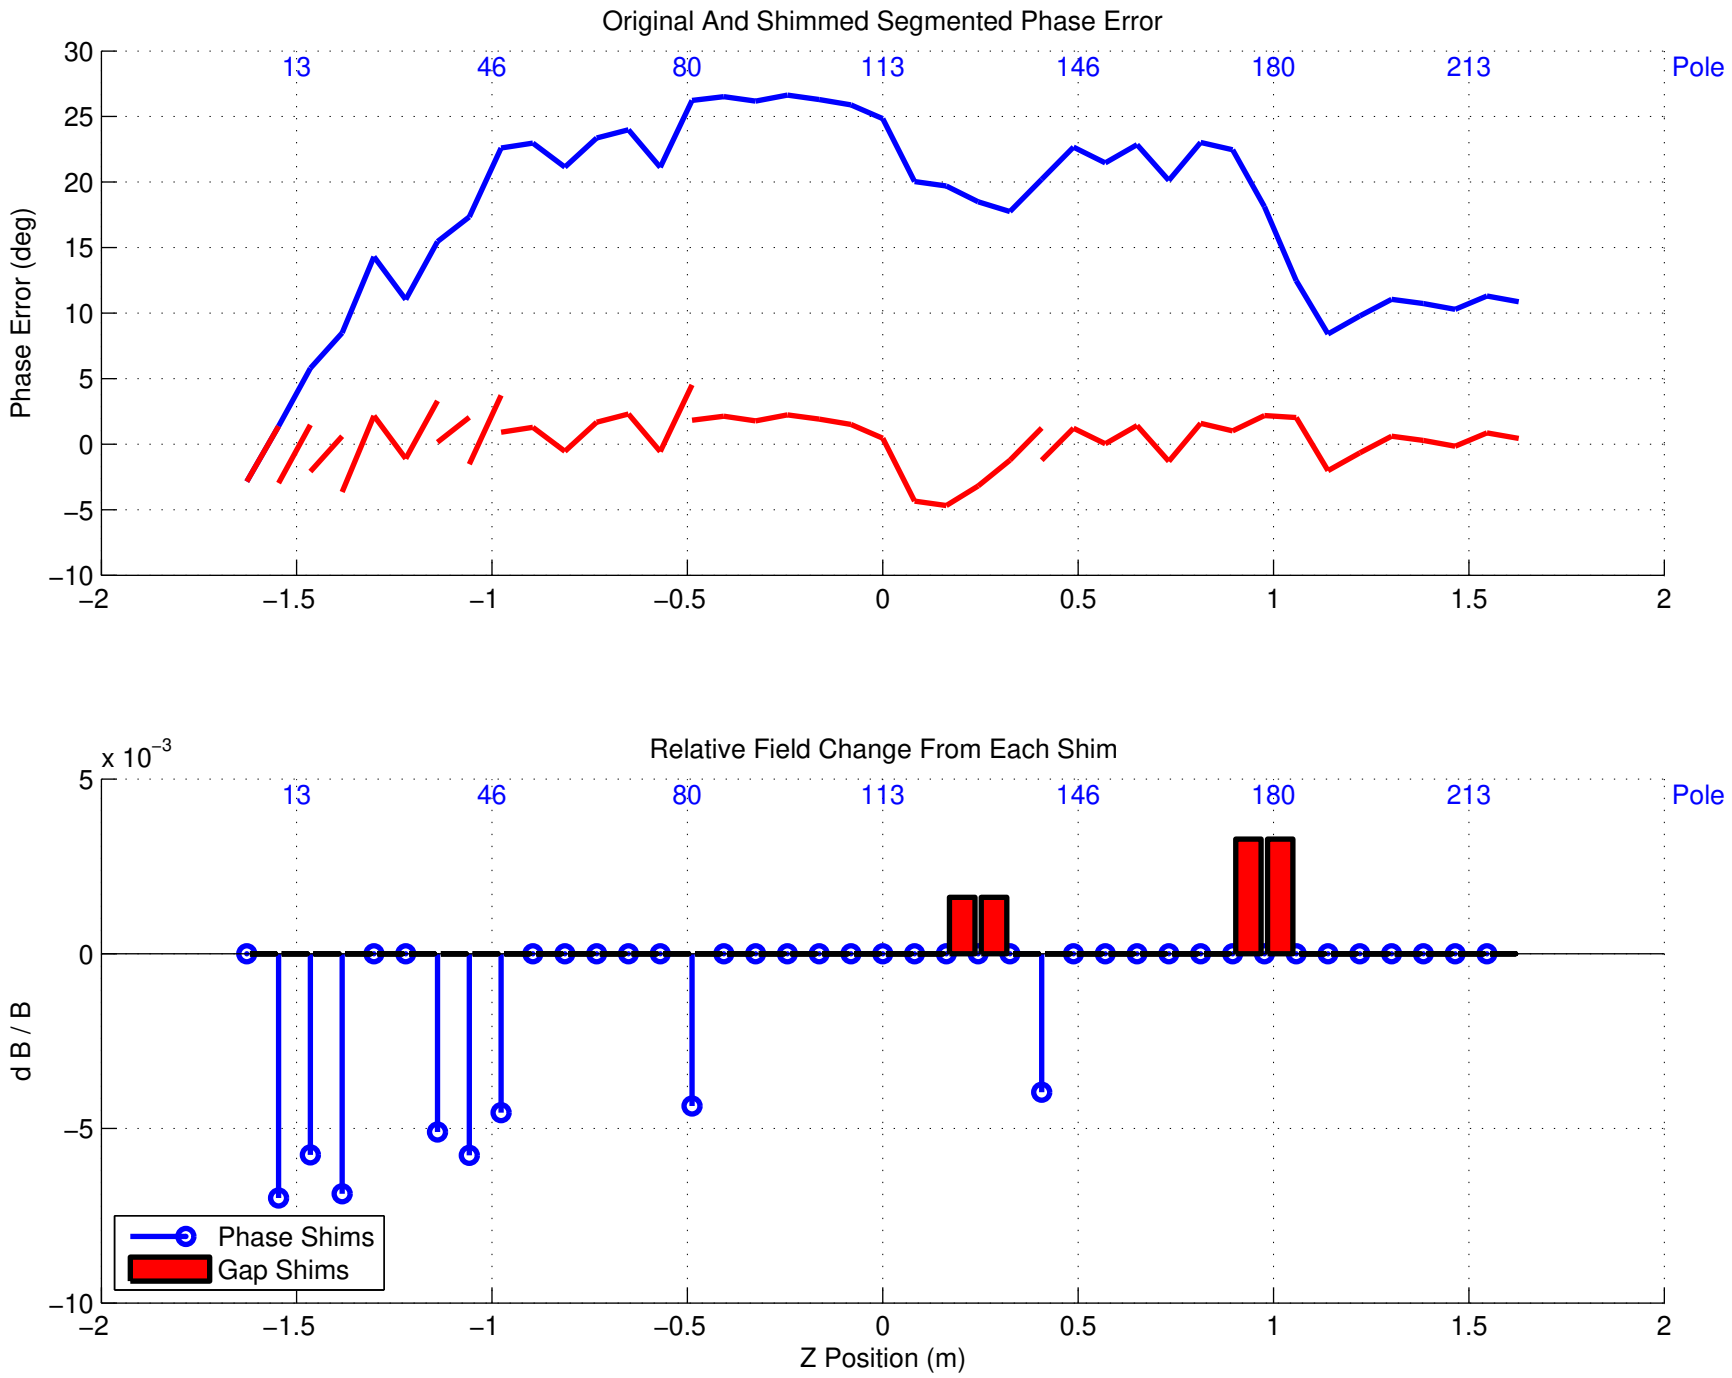
Original And Shimmed Segmented Phase Error
Phase Error (deg)
Pole
13
46
80
113
146
180
213
30
25
20
15
10
5
0
−5
−10
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
Phase Shims
Gap Shims
Z Position (m)

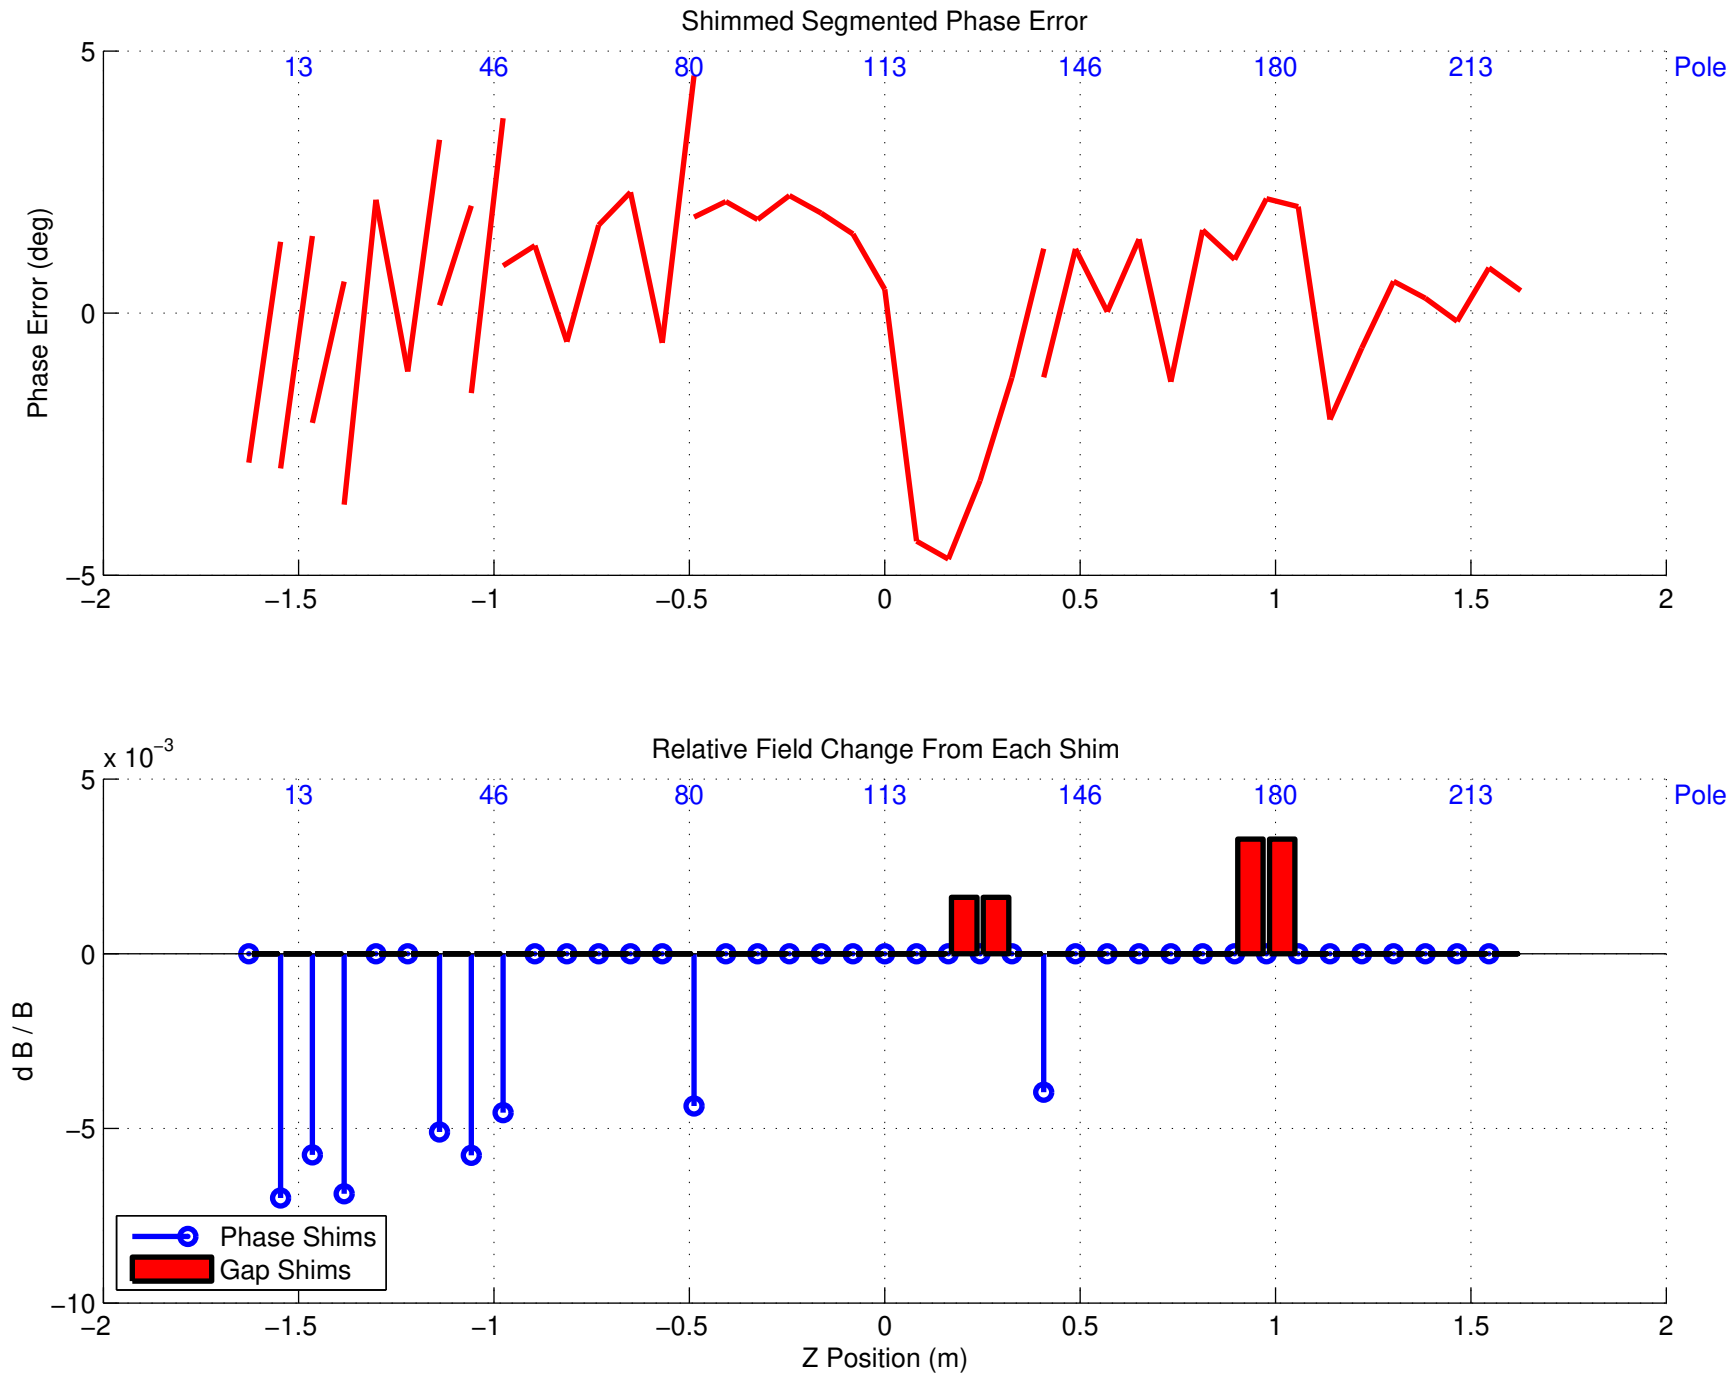
Shimmed Segmented Phase Error
Phase Error (deg)
5
0
−5
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
5
0
−5
−10
Phase Shims
Gap Shims
Z Position (m)

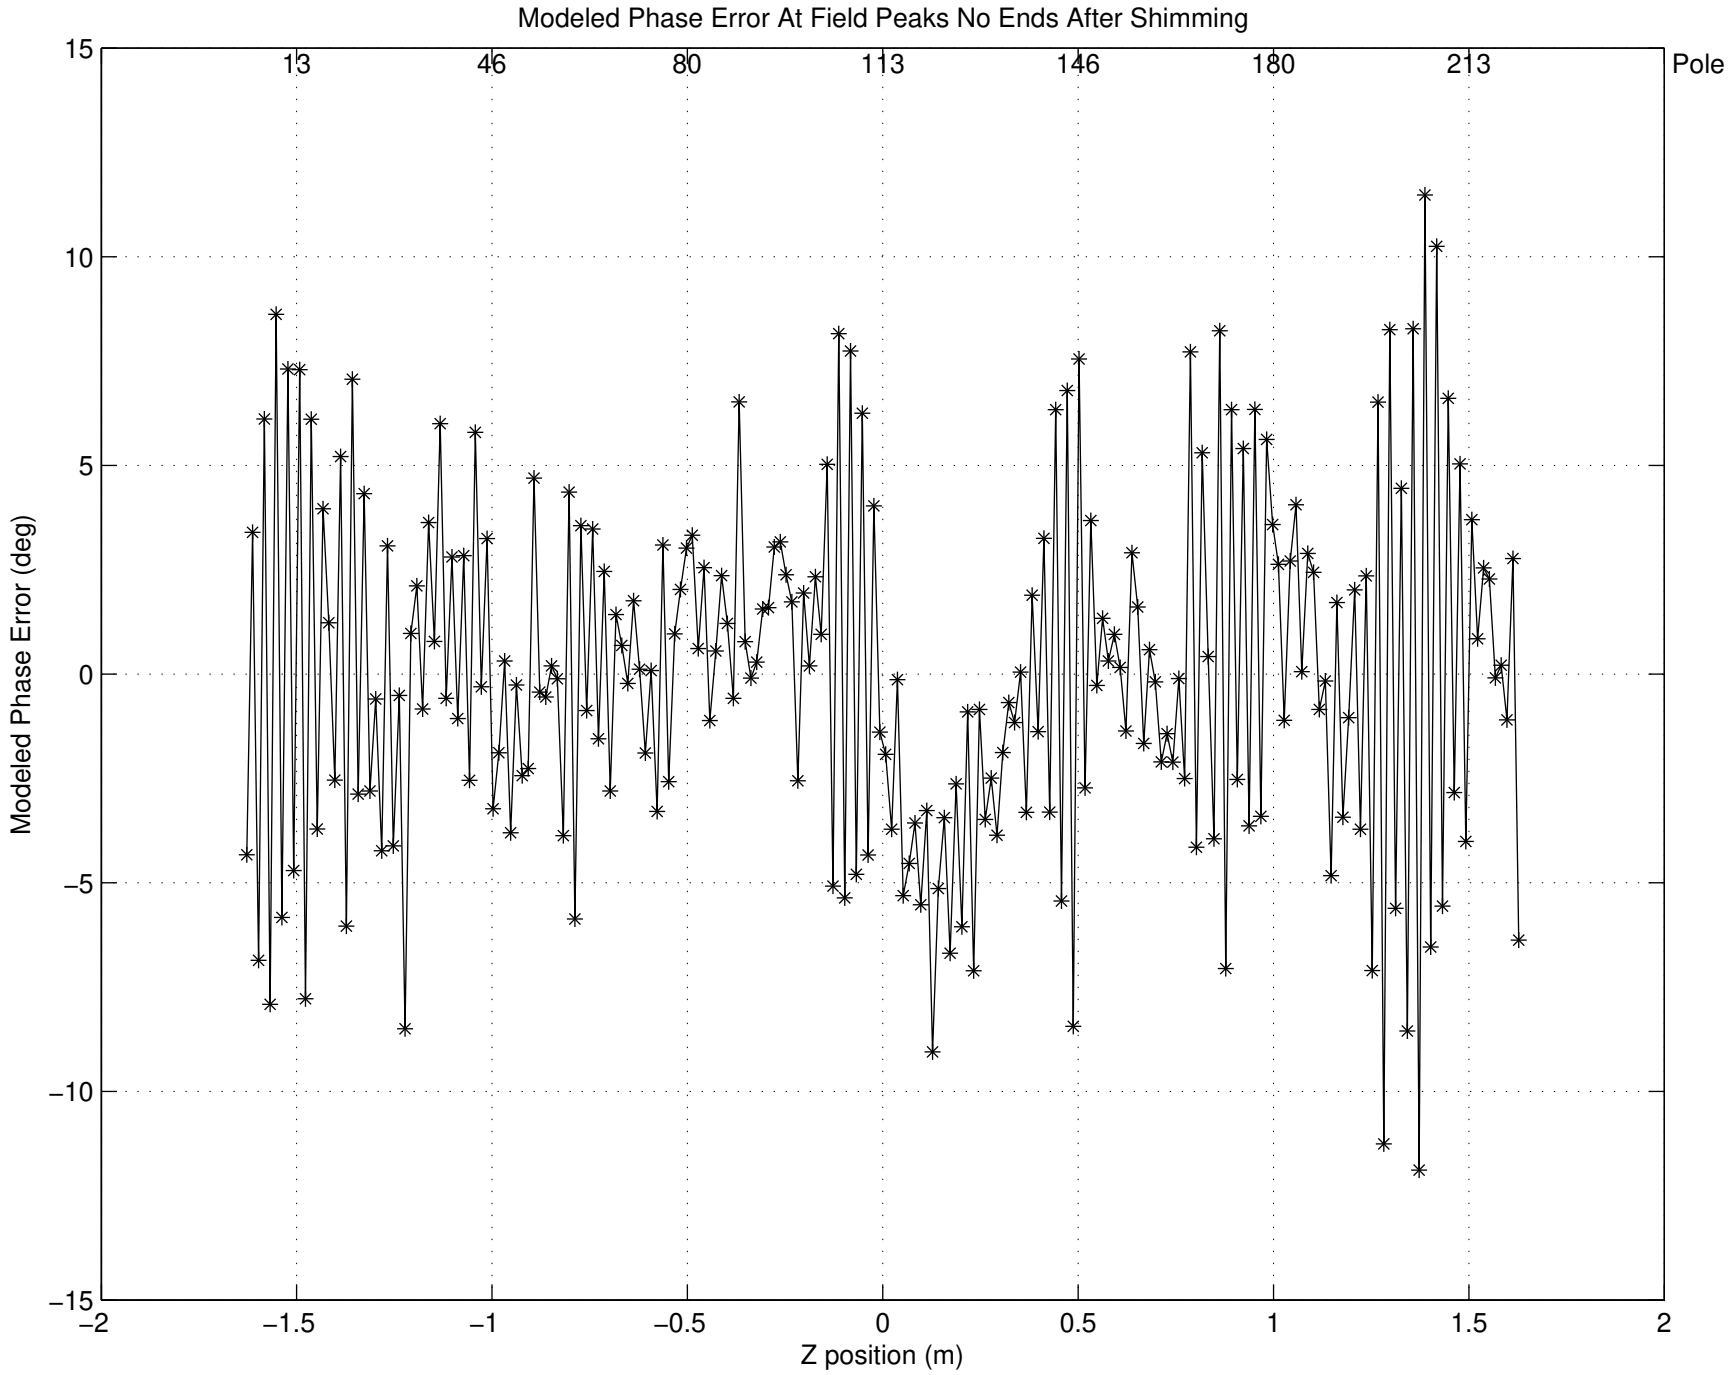

Phase Error: Ave = 0.000000 deg, RMS = 4.282685 deg