SLAC Magnetic Measurements

Planar Insertion Device Shim Analysis

Parameters:
INPUT−FILE−DIR =S:\MagData\LCLS\Undulator\L143−112000−10\DATASET0001\Rough Tuning\Z Scans\Run 075\
INPUT−FILE−NAME =x+00000−y+000−bscanz.dat
INPUT−FILE−TYPE =ZVXYBXYH
CORR−REQUIRED =1
GAMMA =26665.23
NOM−LAMBDA−U =0.03
NOM−K−VALUE =3.494
NOM−LAMBDA−R =1.4987e−010
NUM−POLES =226
NUM−END−POLES =4
CELL−LENGTH =3.656

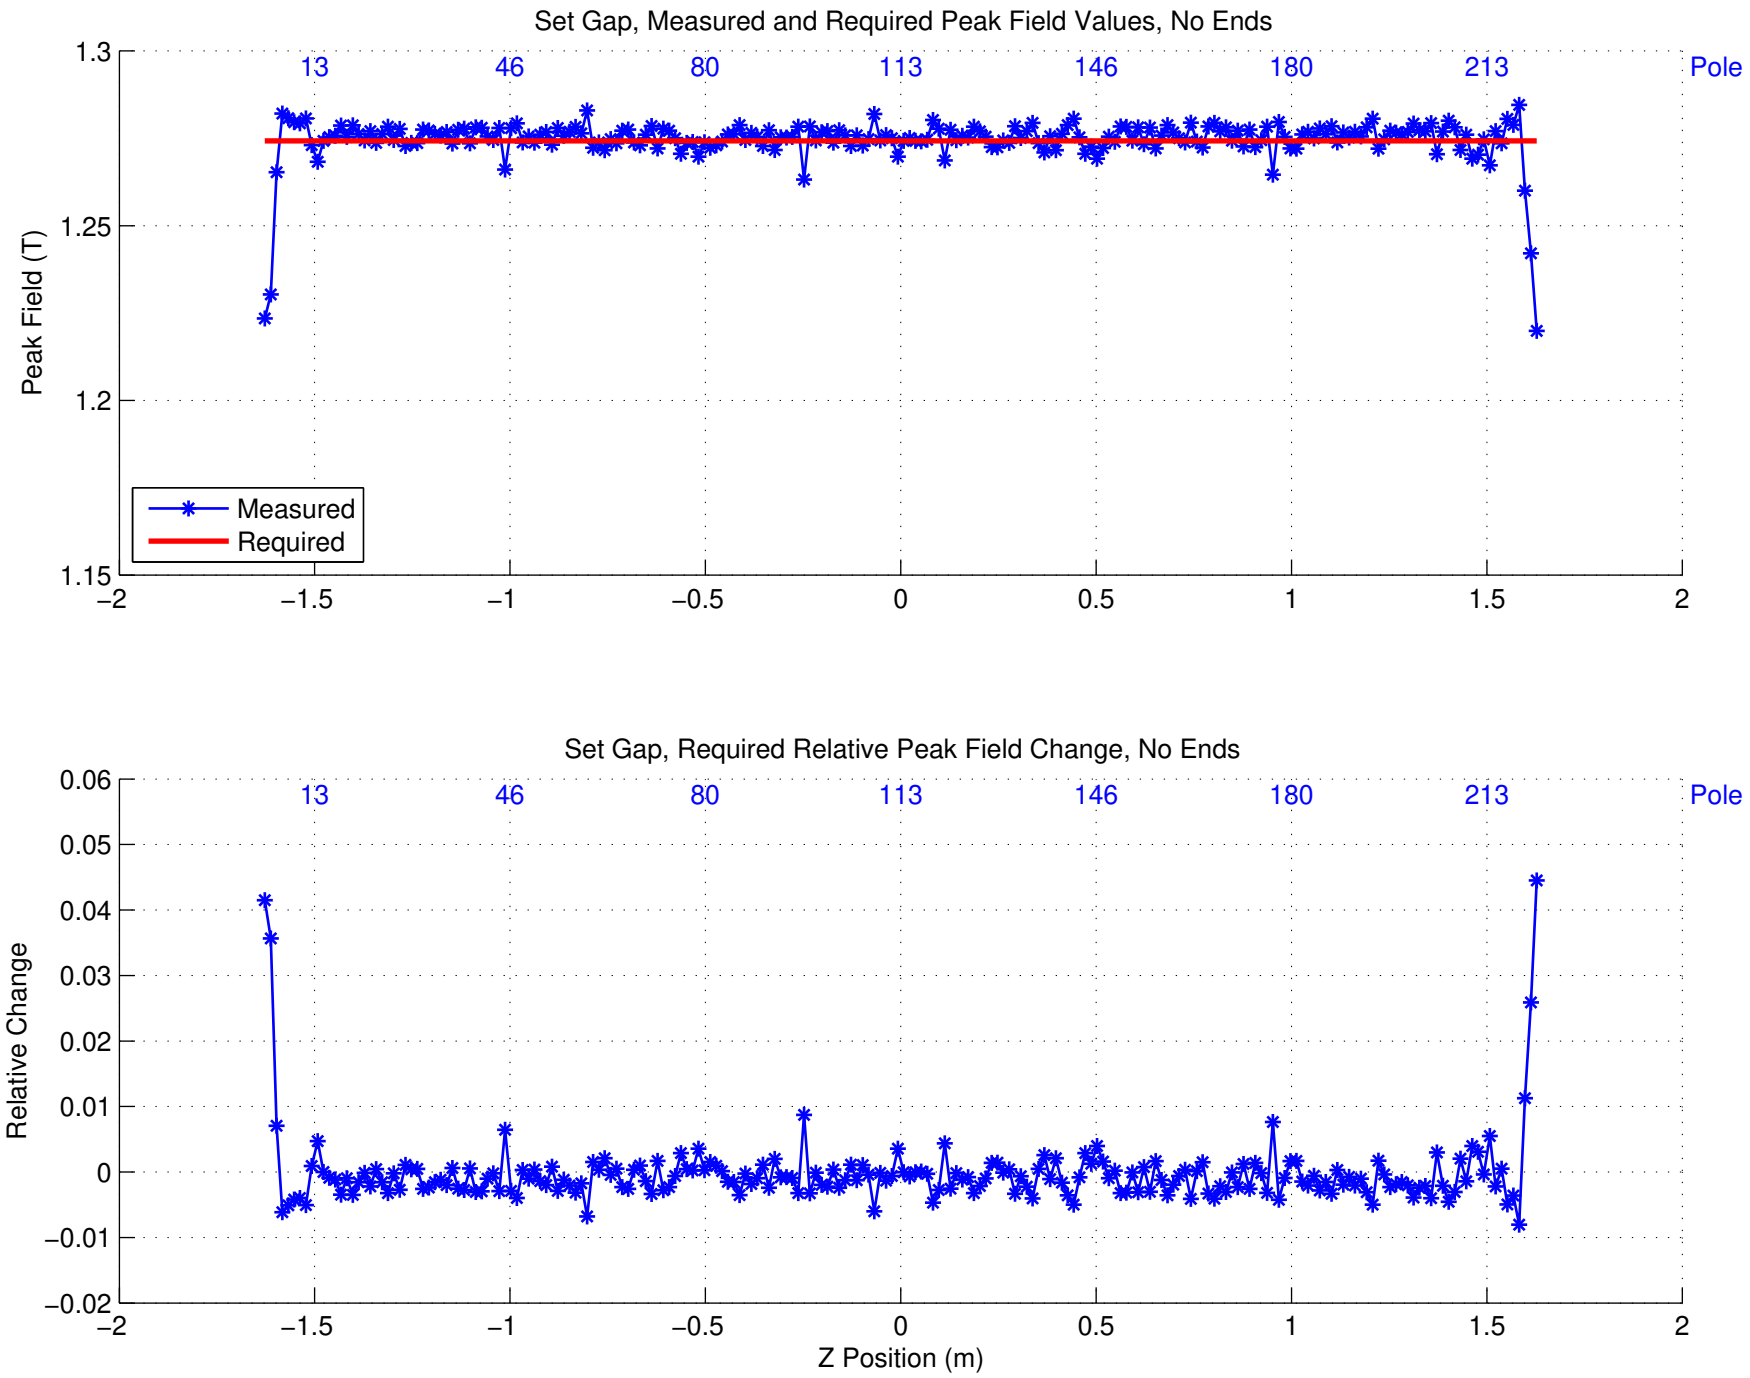
Set Gap, Measured and Required Peak Field Values, No Ends
13
46
80
113
146
180
213
Pole
1.3
1.25
1.2
1.15
Peak Field (T)
Measured
Required
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Set Gap, Required Relative Peak Field Change, No Ends
13
46
80
113
146
180
213
Pole
0.06
0.05
0.04
0.03
0.02
0.01
0
−0.01
−0.02
Relative Change
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

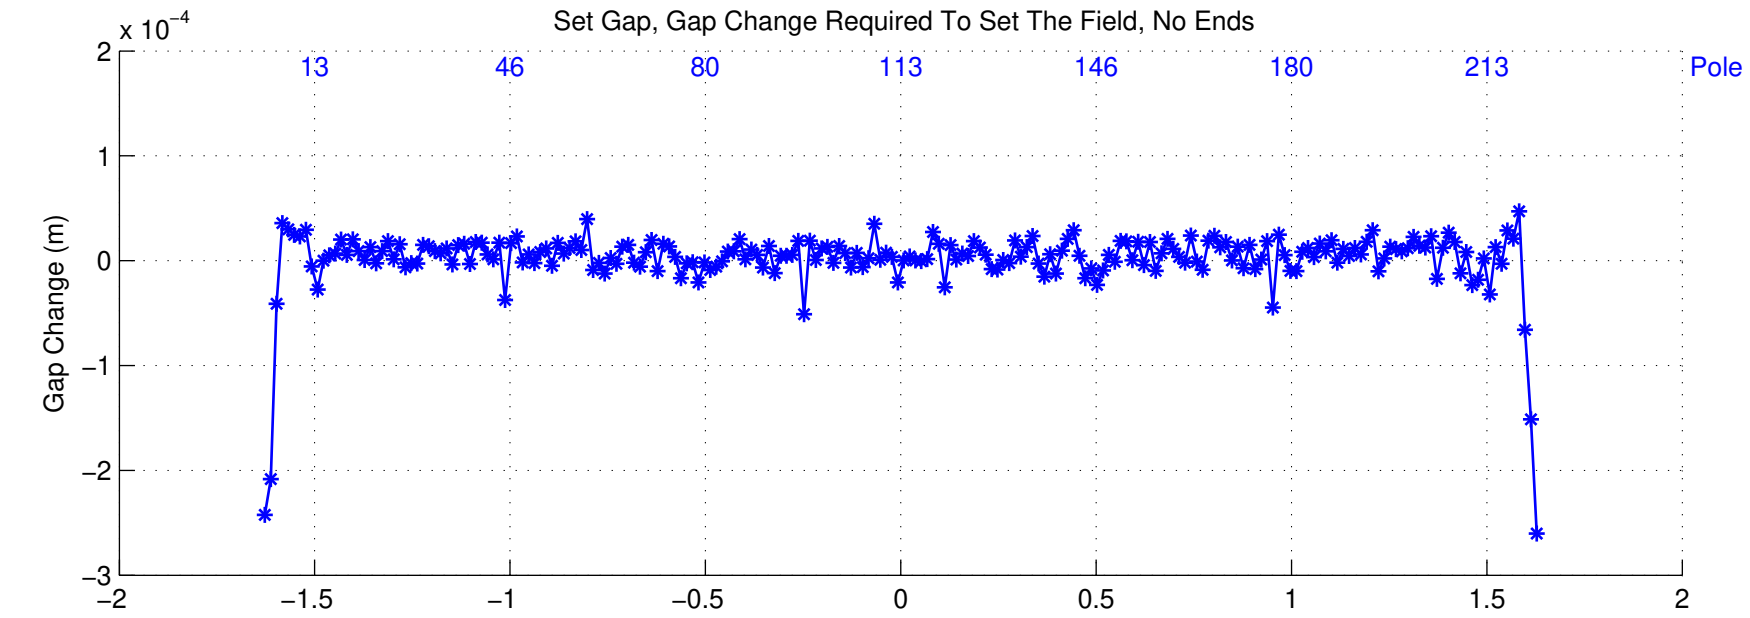
Set Gap, Gap Change Required To Set The Field, No Ends
x 10^-4
Gap Change (m)
13
46
80
113
146
180
213
Pole
2
1
0
−1
−2
−3
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

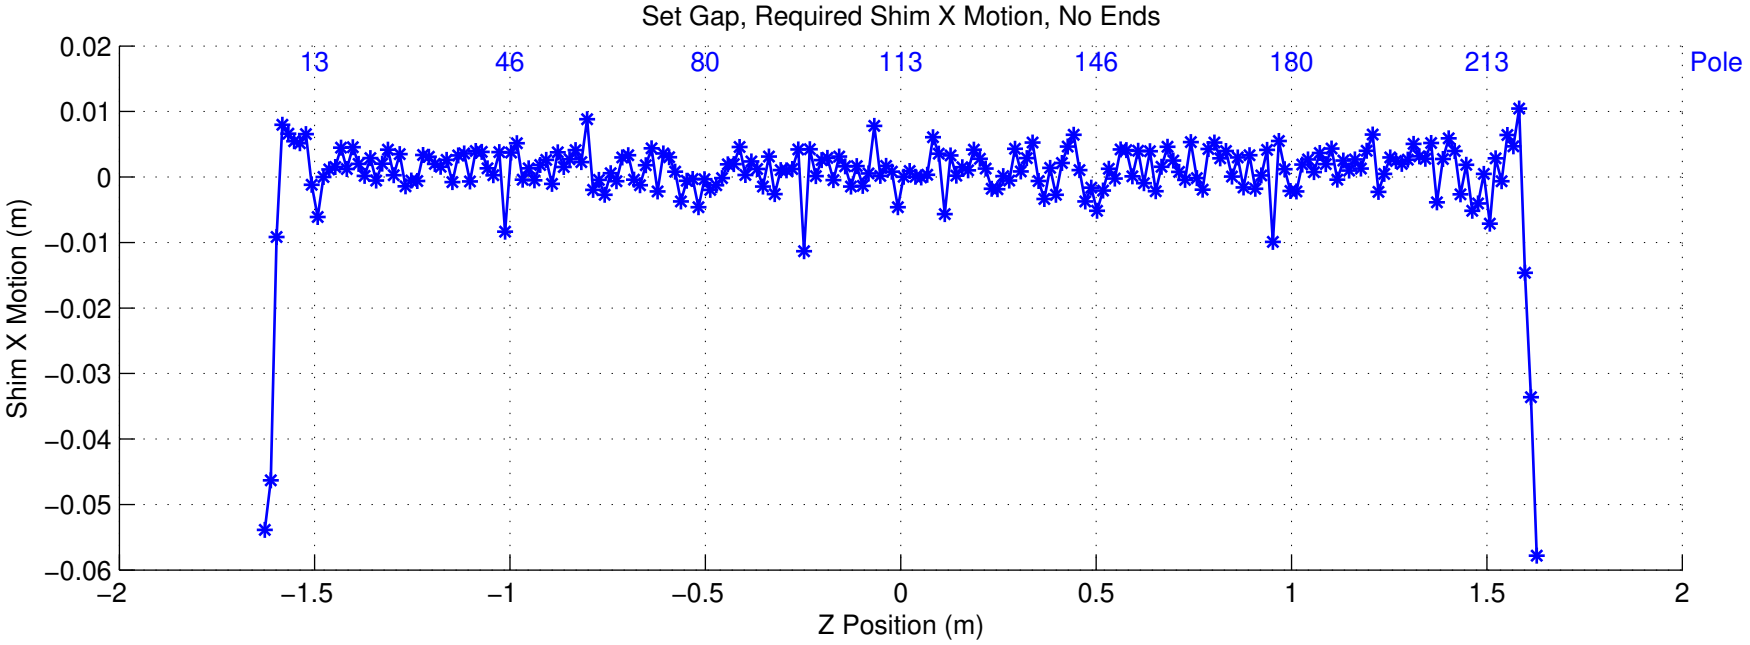
Set Gap, Required Shim X Motion, No Ends
Shim X Motion (m)
13
46
80
113
146
180
213
Pole
0.02
0.01
0
−0.01
−0.02
−0.03
−0.04
−0.05
−0.06
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

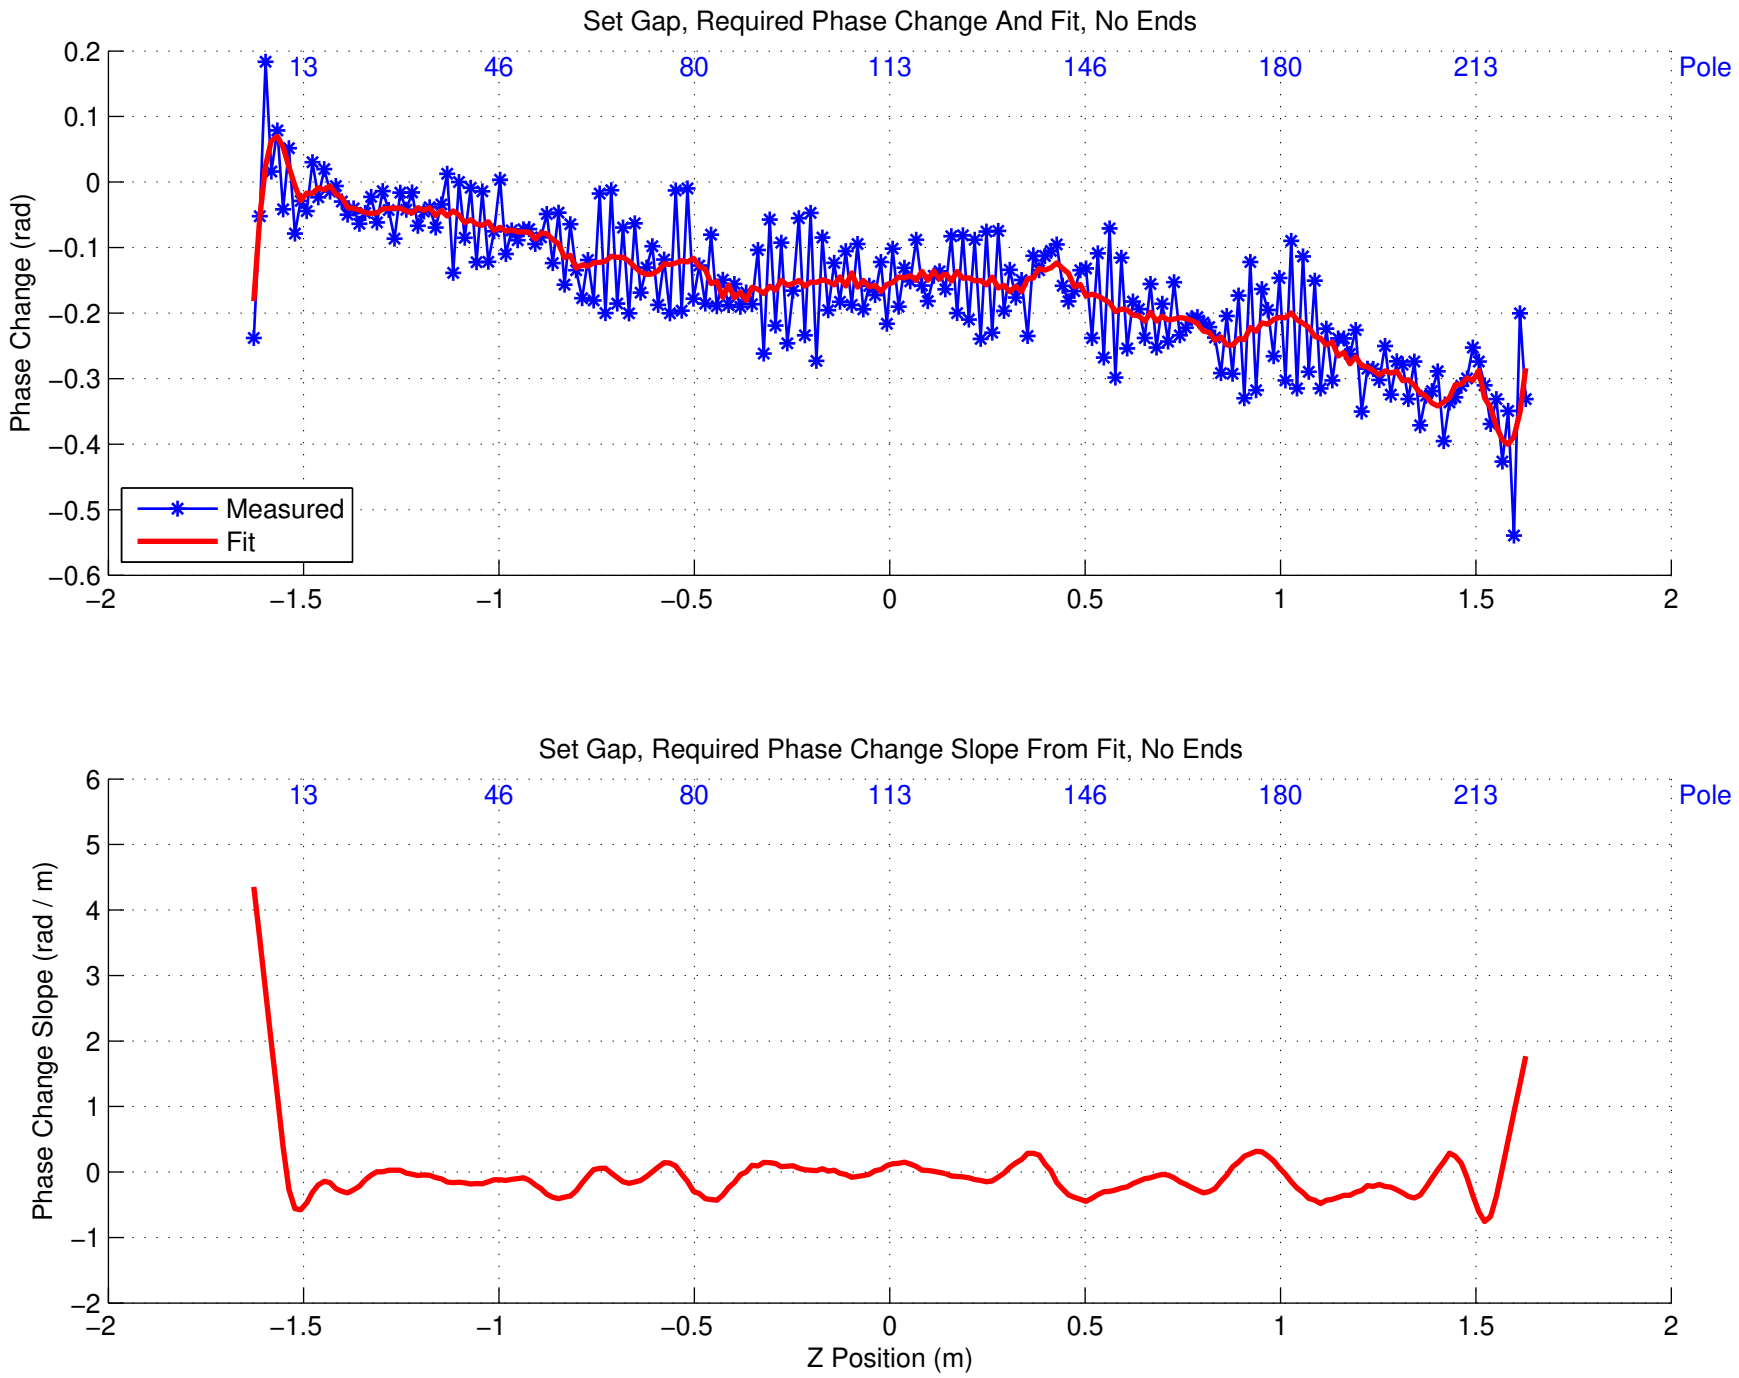
Set Gap, Required Phase Change And Fit, No Ends
13
46
80
113
146
180
213
Pole
Phase Change (rad)
0.2
0.1
0
−0.1
−0.2
−0.3
−0.4
−0.5
−0.6
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Measured
Fit
Set Gap, Required Phase Change Slope From Fit, No Ends
13
46
80
113
146
180
213
Pole
Phase Change Slope (rad / m)
6
5
4
3
2
1
0
−1
−2
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

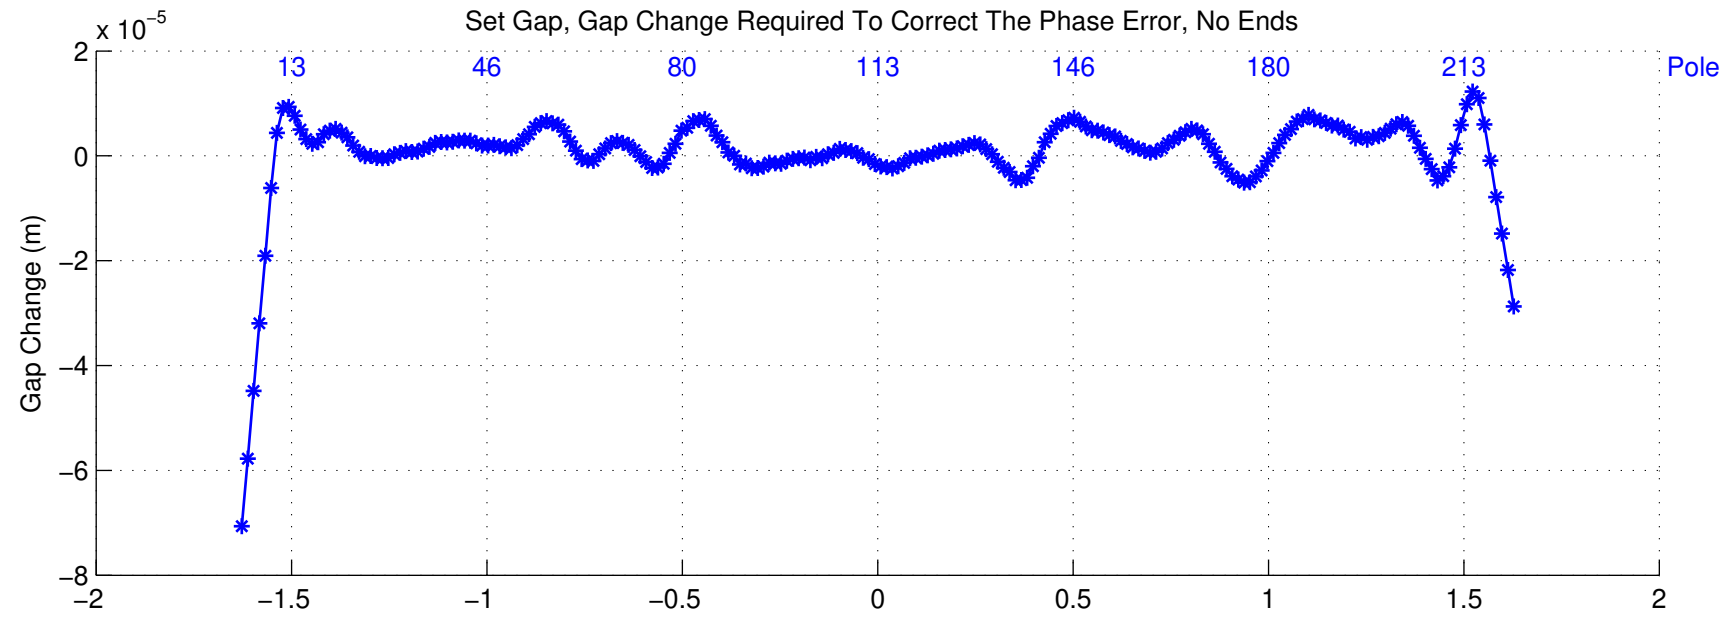
Set Gap, Gap Change Required To Correct The Phase Error, No Ends
x 10^-5
Gap Change (m)
2
0
−2
−4
−6
−8
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

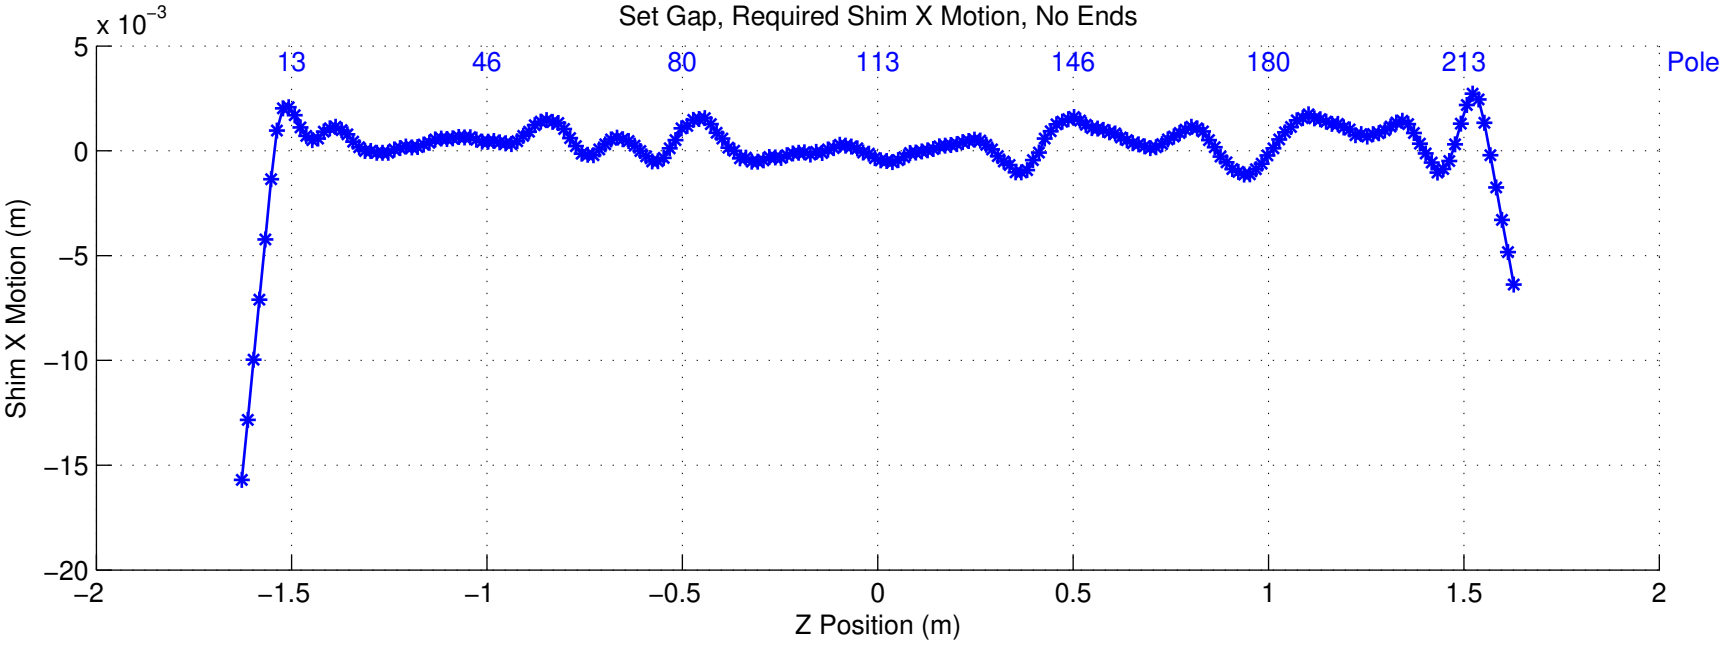
Set Gap, Required Shim X Motion, No Ends
x 10^-3
Shim X Motion (m)
5
0
−5
−10
−15
−20
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

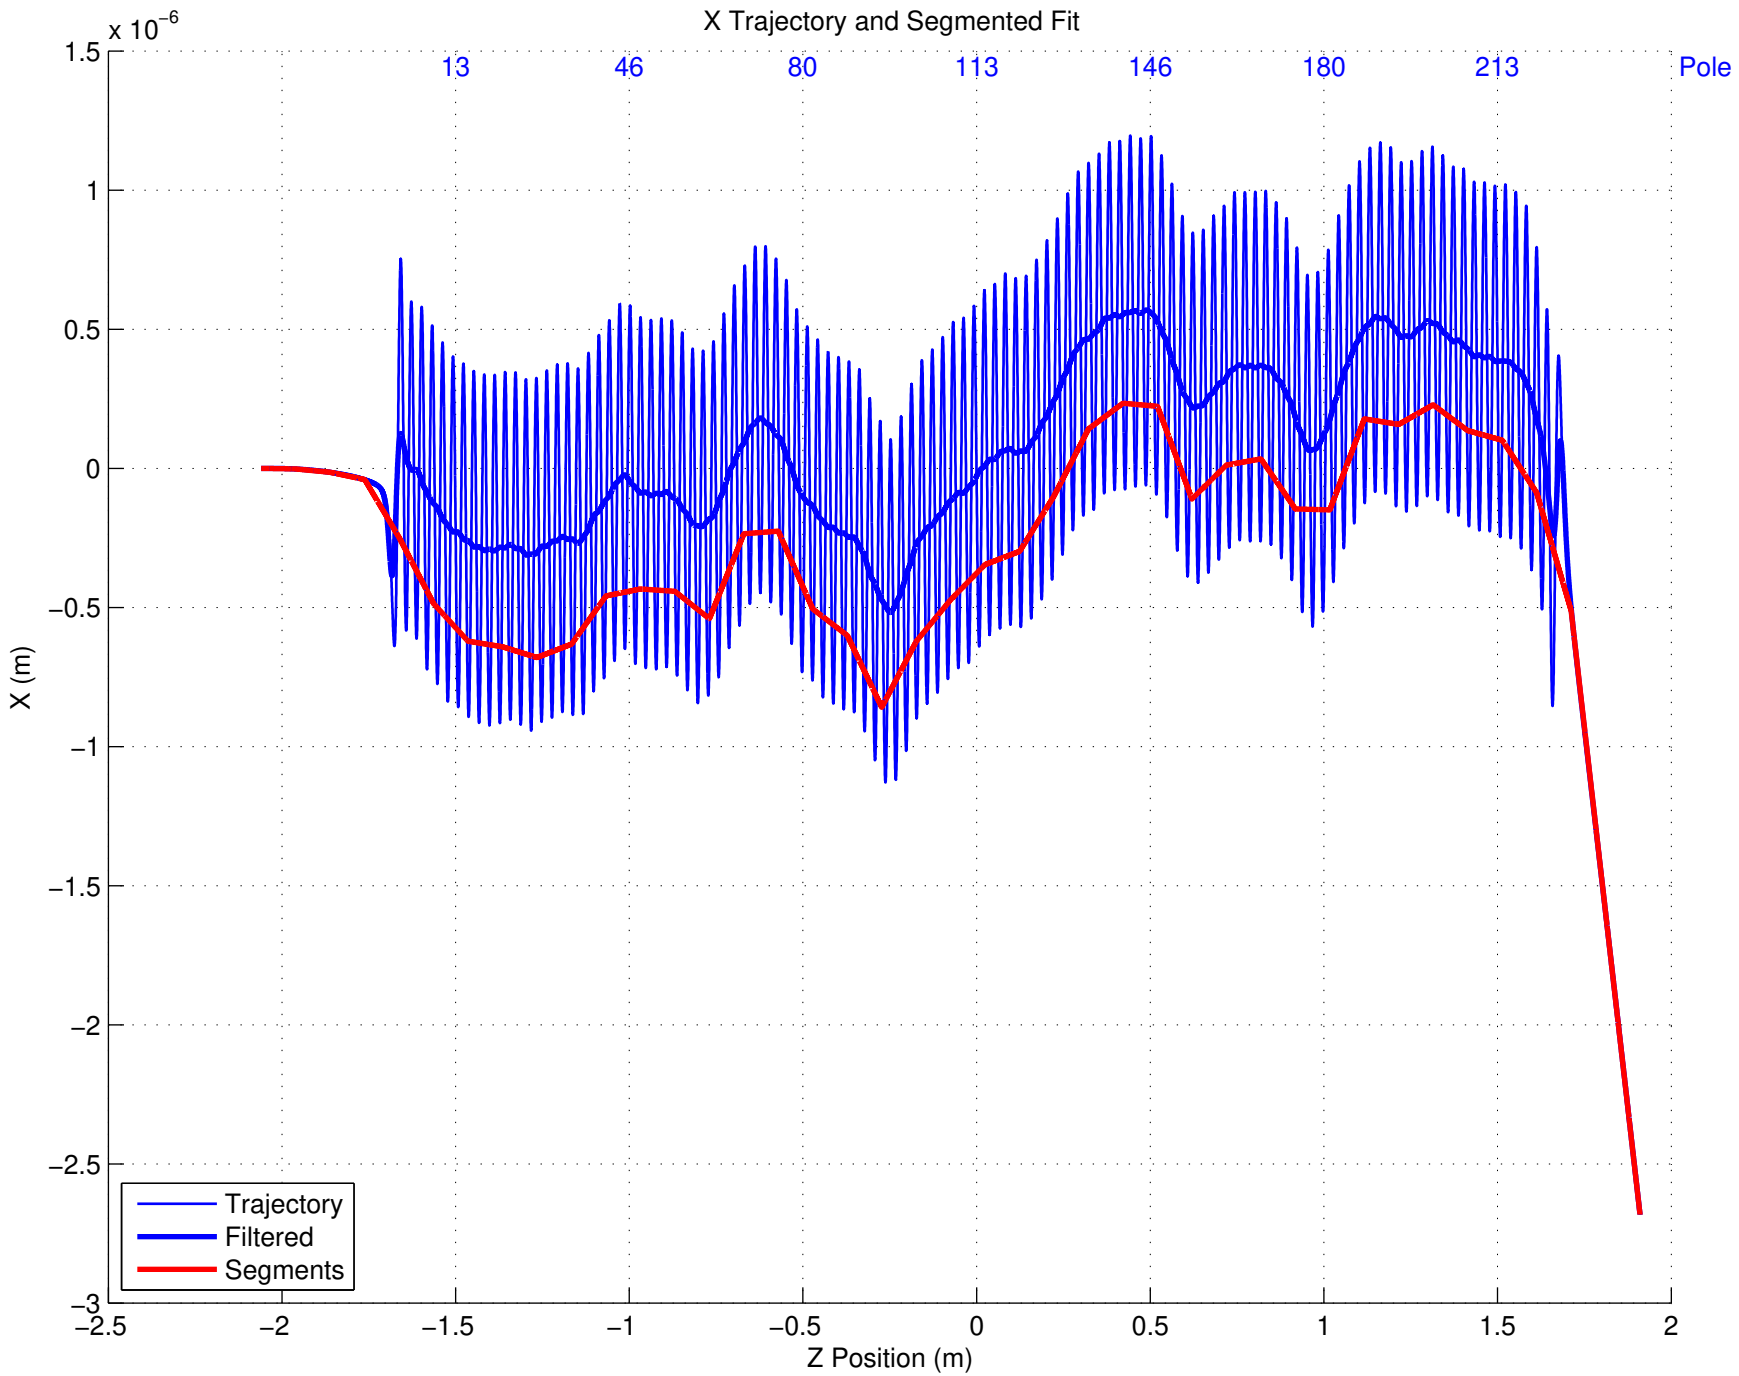
X Trajectory and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
1.5
1
0.5
0
−0.5
−1
−1.5
−2
−2.5
−3
X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

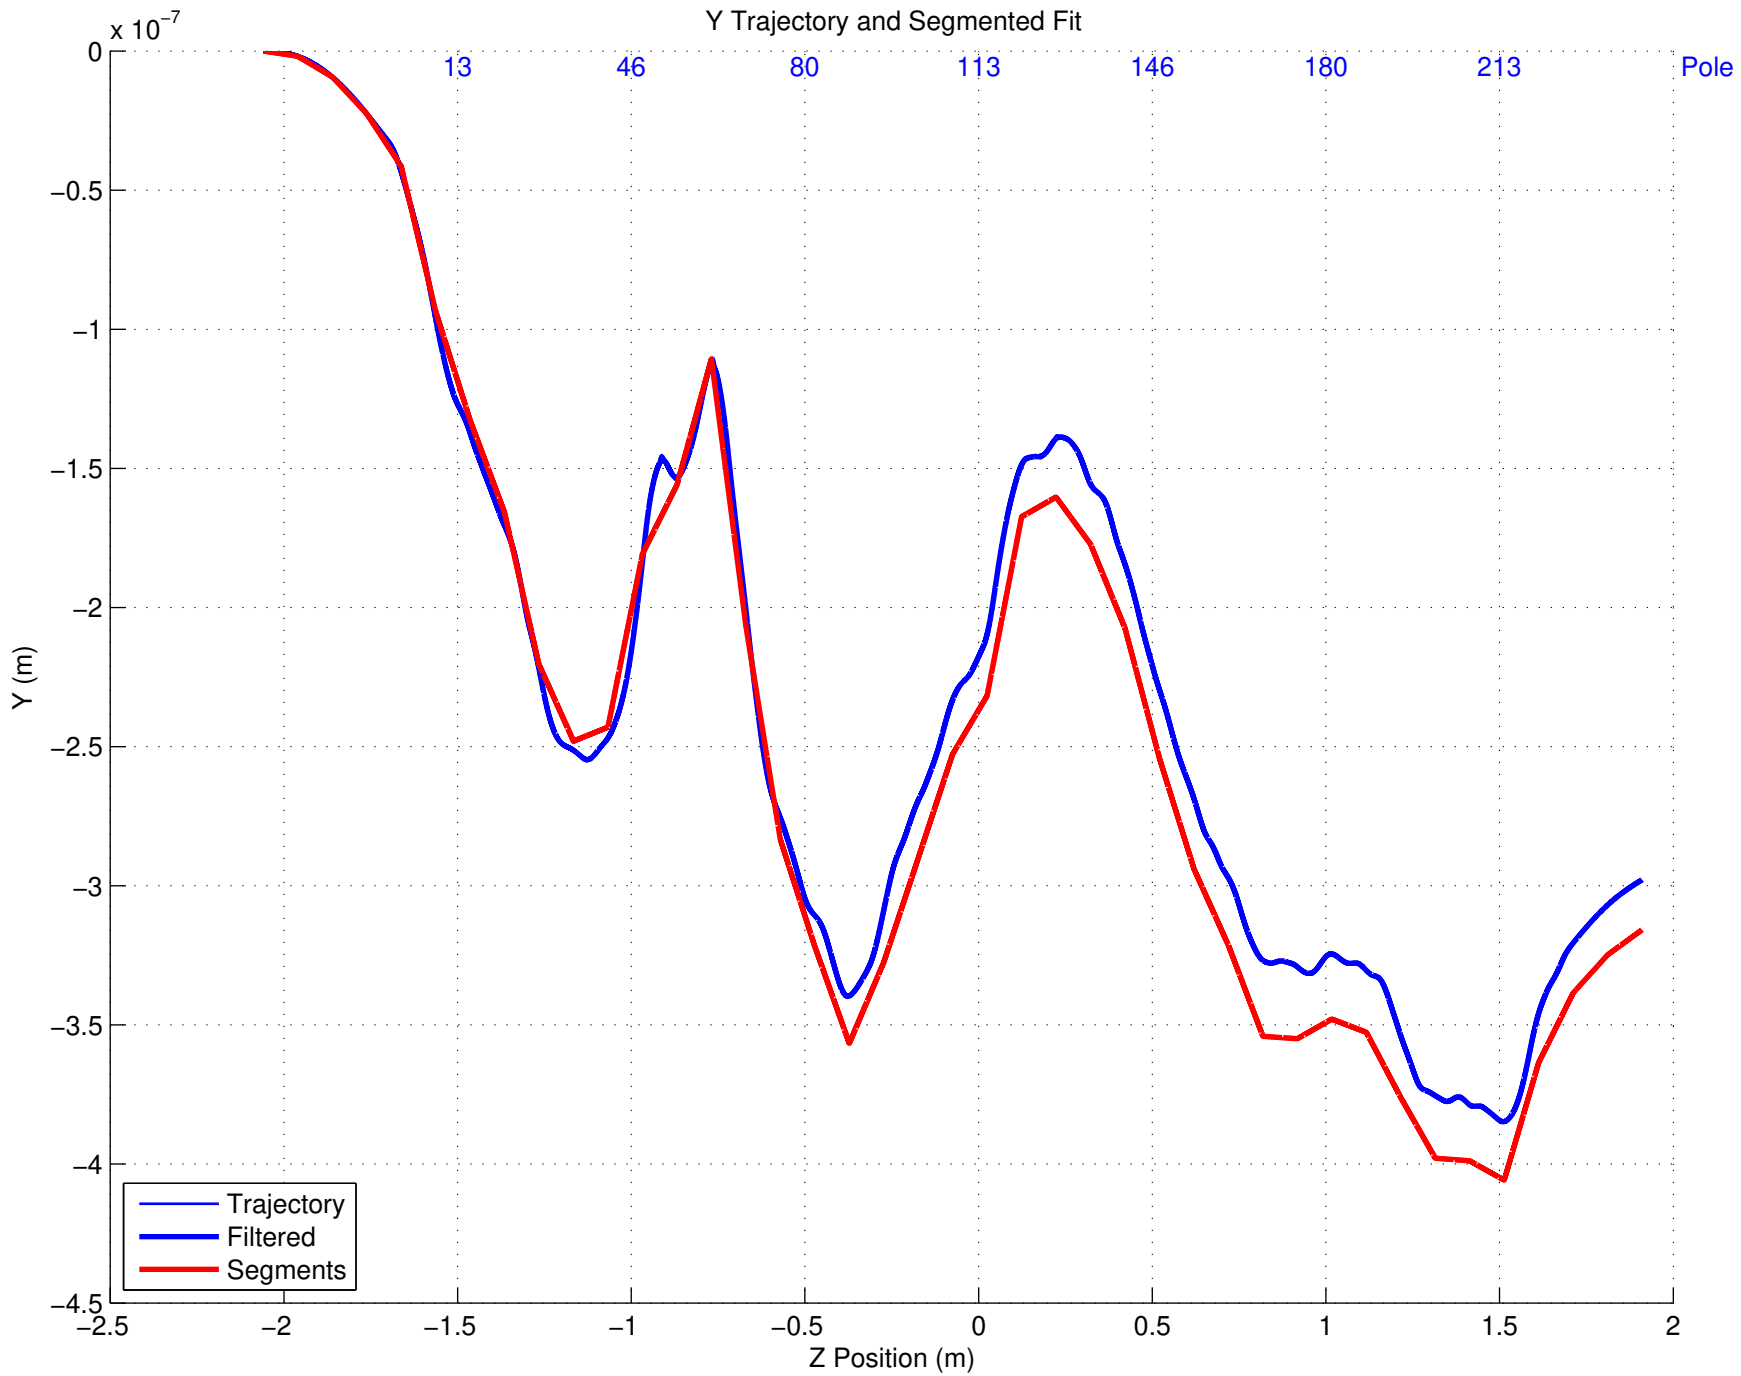
Y Trajectory and Segmented Fit
x 10^-7
0
−0.5
−1
−1.5
−2
−2.5
−3
−3.5
−4
−4.5
13
46
80
113
146
180
213
Pole
Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

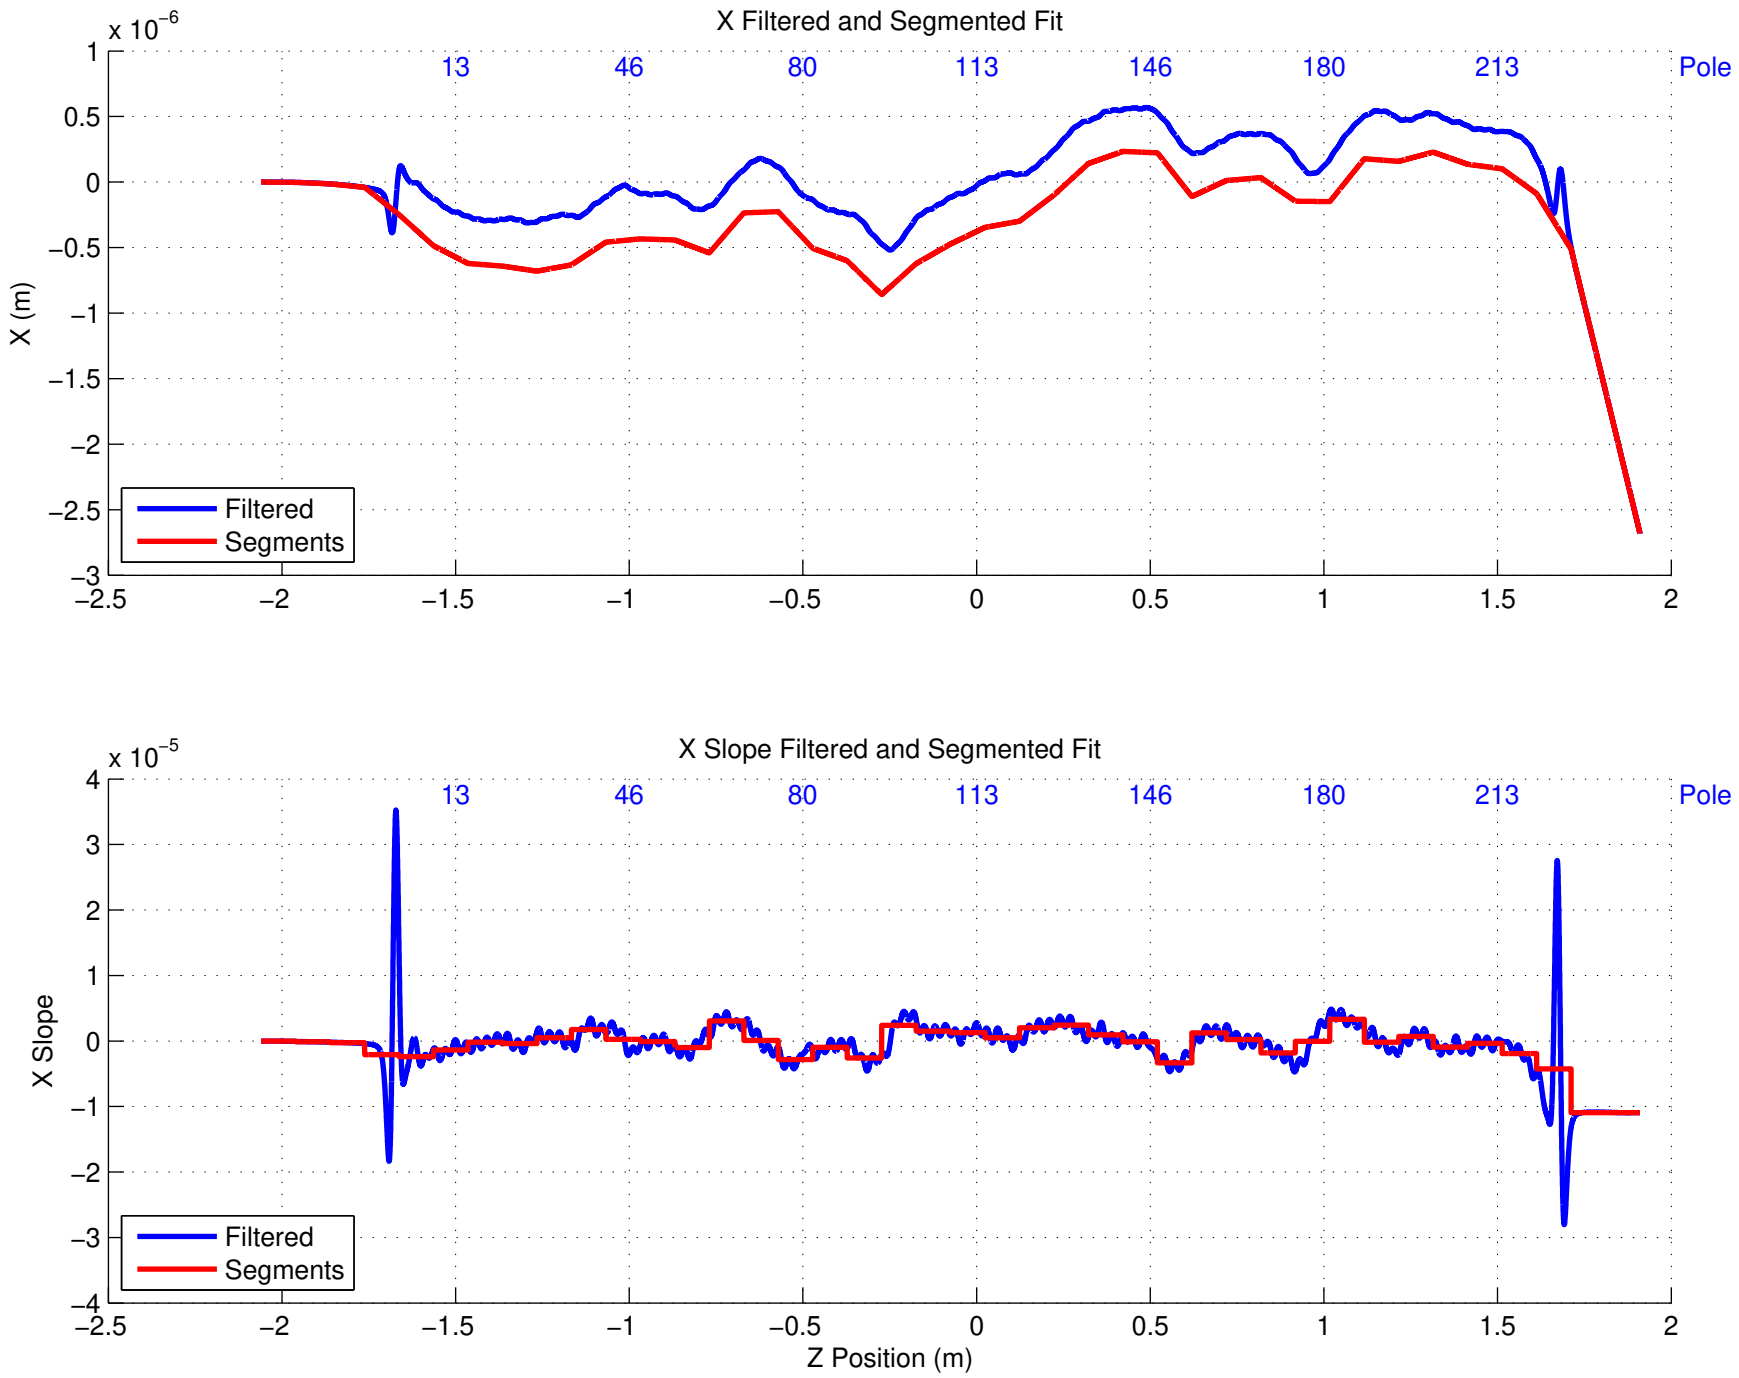
X Filtered and Segmented Fit
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
X Slope Filtered and Segmented Fit
x 10^-5
X Slope
Z Position (m)

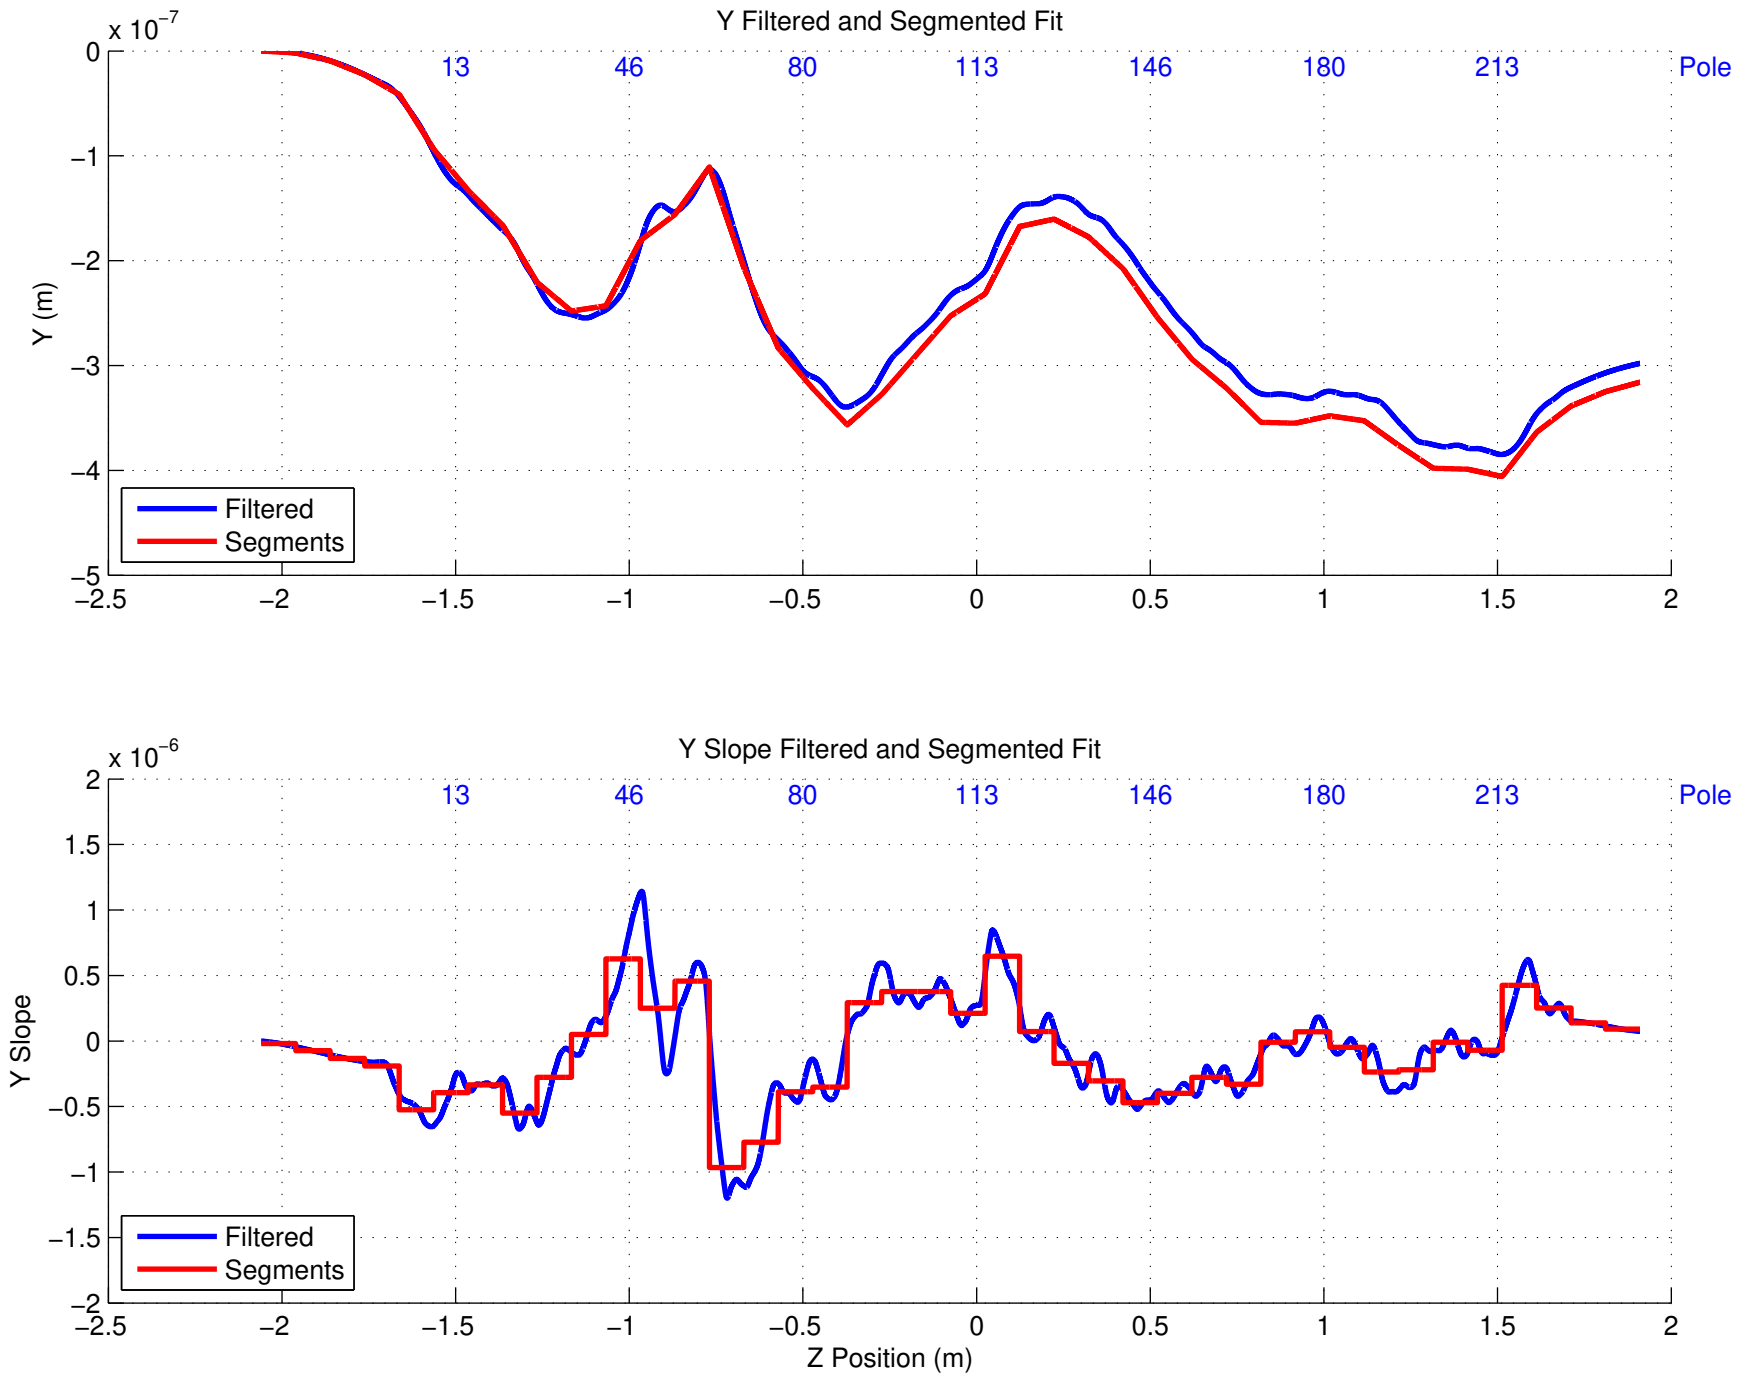
Y Filtered and Segmented Fit
x 10^-7
Y (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
Y Slope Filtered and Segmented Fit
x 10^-6
Y Slope
Z Position (m)

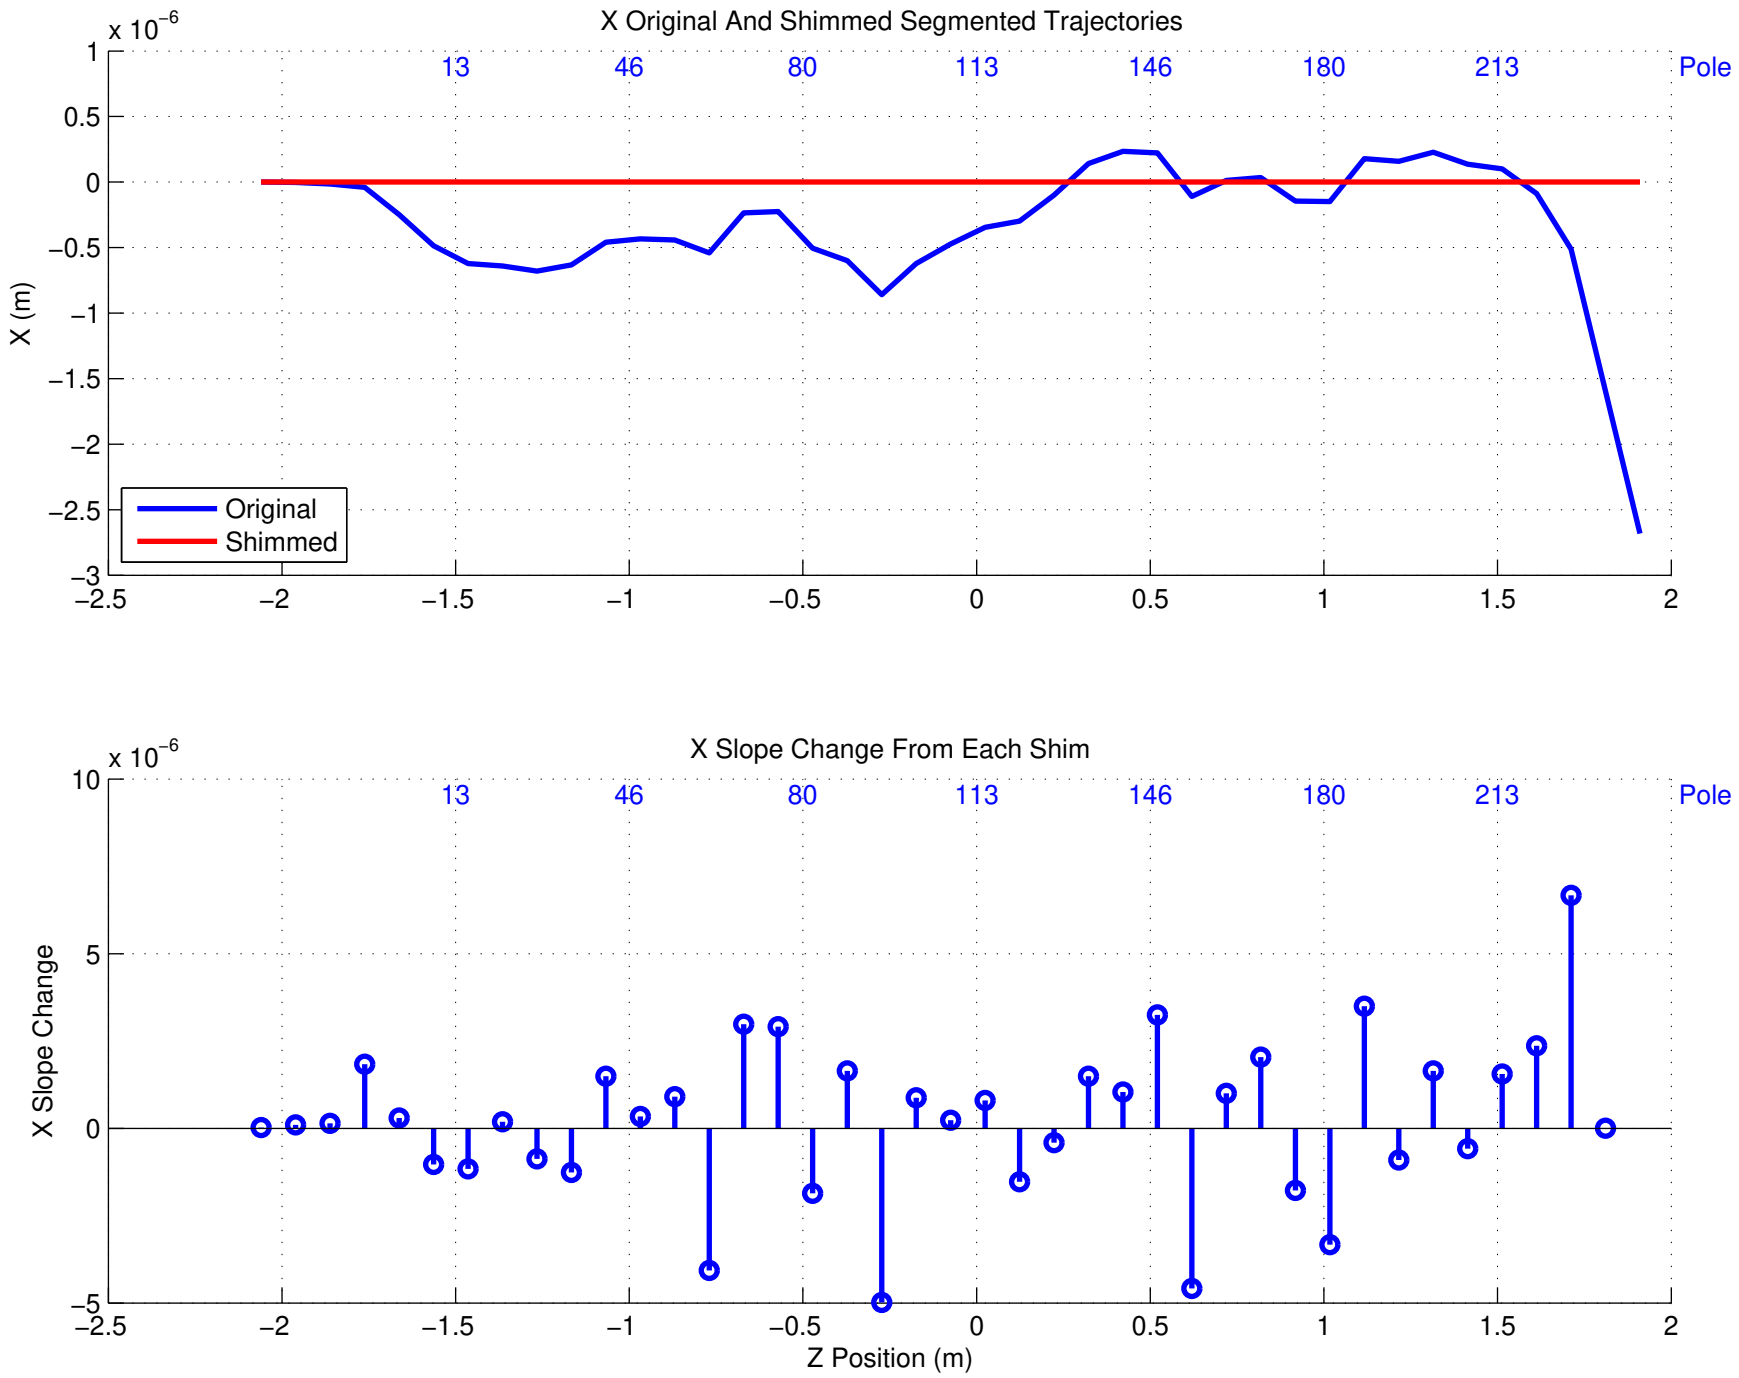
X Original And Shimmed Segmented Trajectories
x 10^-6
13
46
80
113
146
180
213
Pole
X (m)
Original
Shimmed
X Slope Change From Each Shim
X Slope Change
Z Position (m)

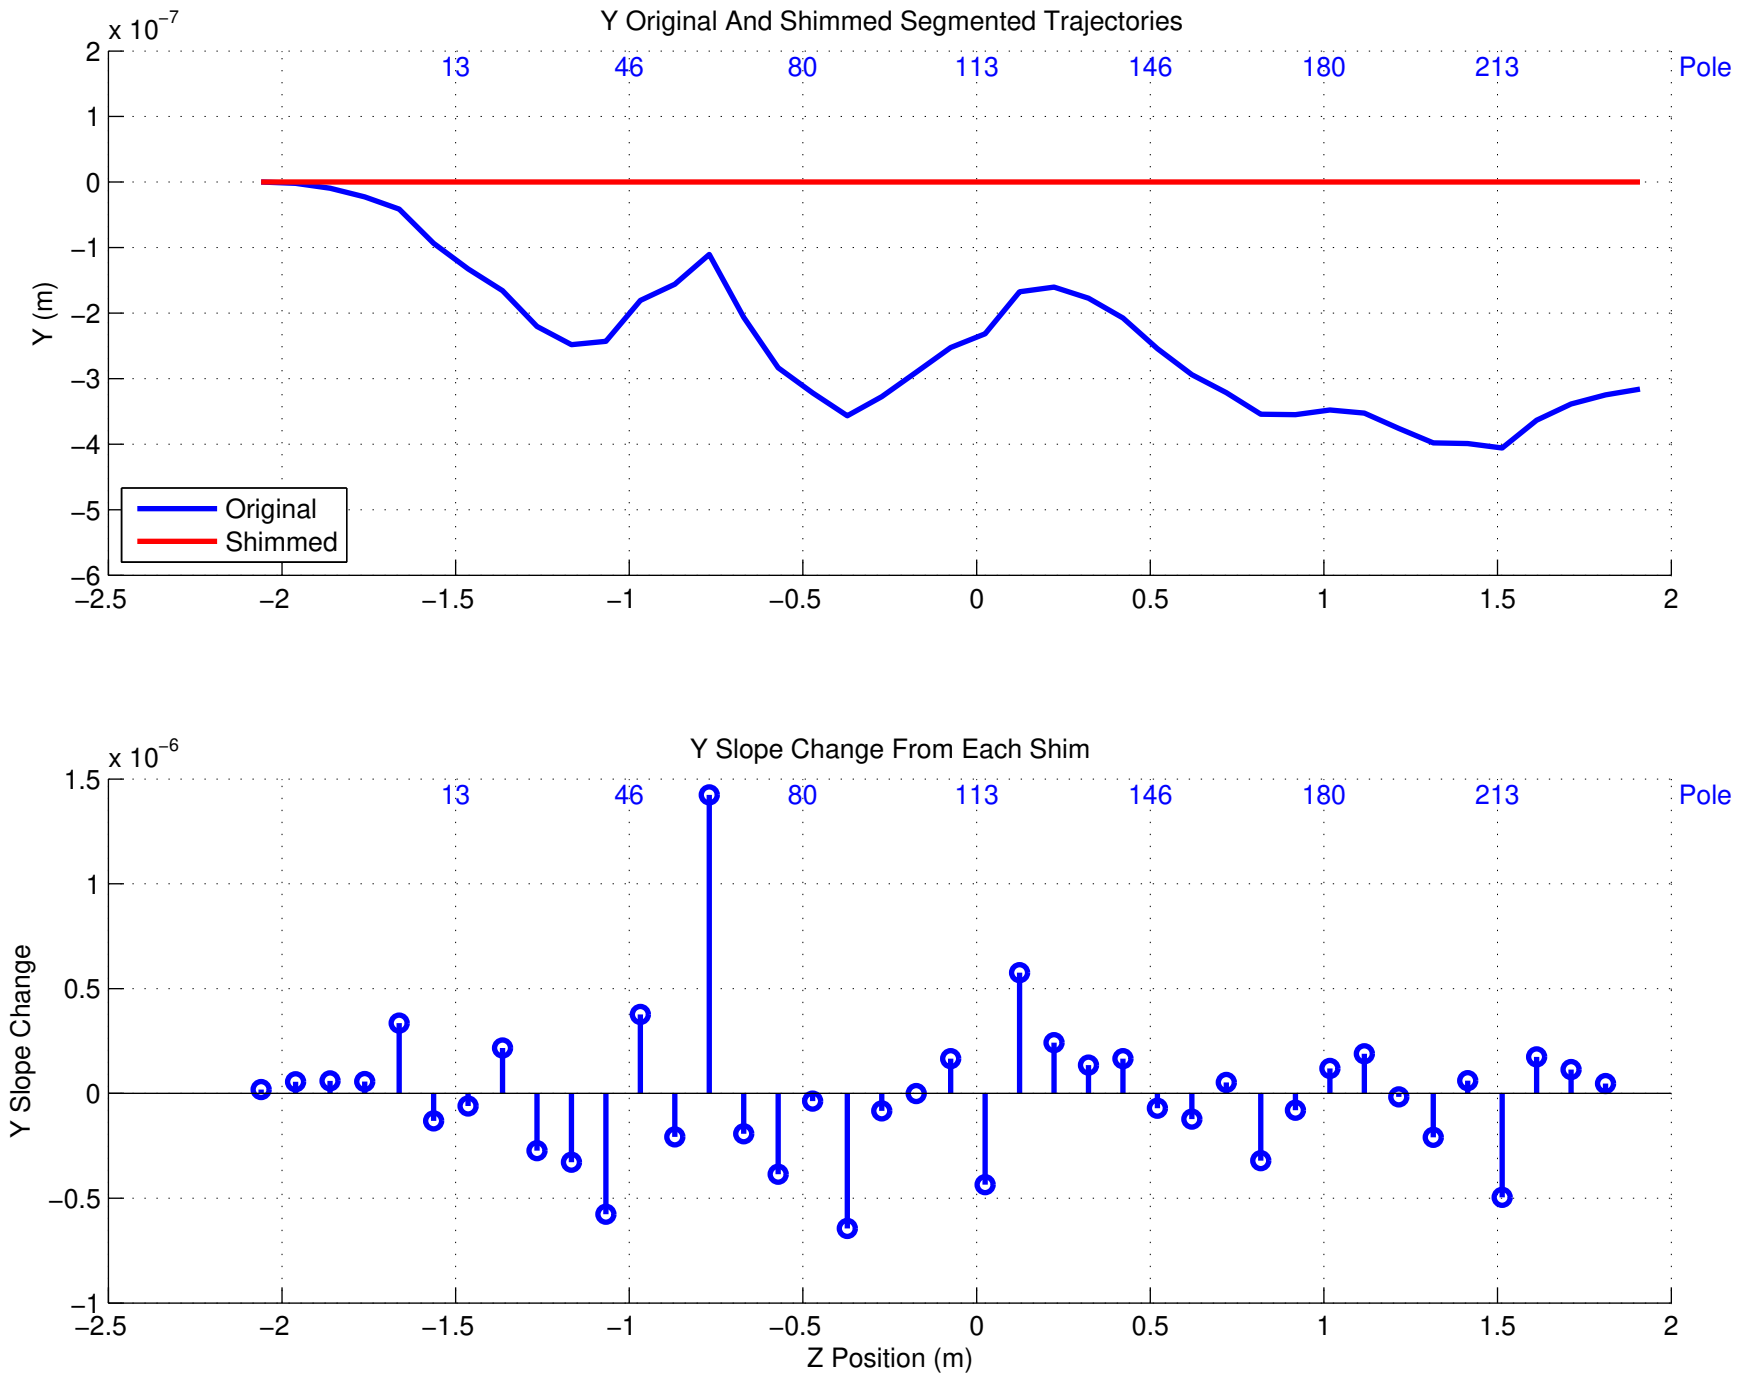
Y Original And Shimmed Segmented Trajectories
x 10^-7
13
46
80
113
146
180
213
Pole
Y (m)
Original
Shimmed
Y Slope Change From Each Shim
x 10^-6
Y Slope Change
Z Position (m)

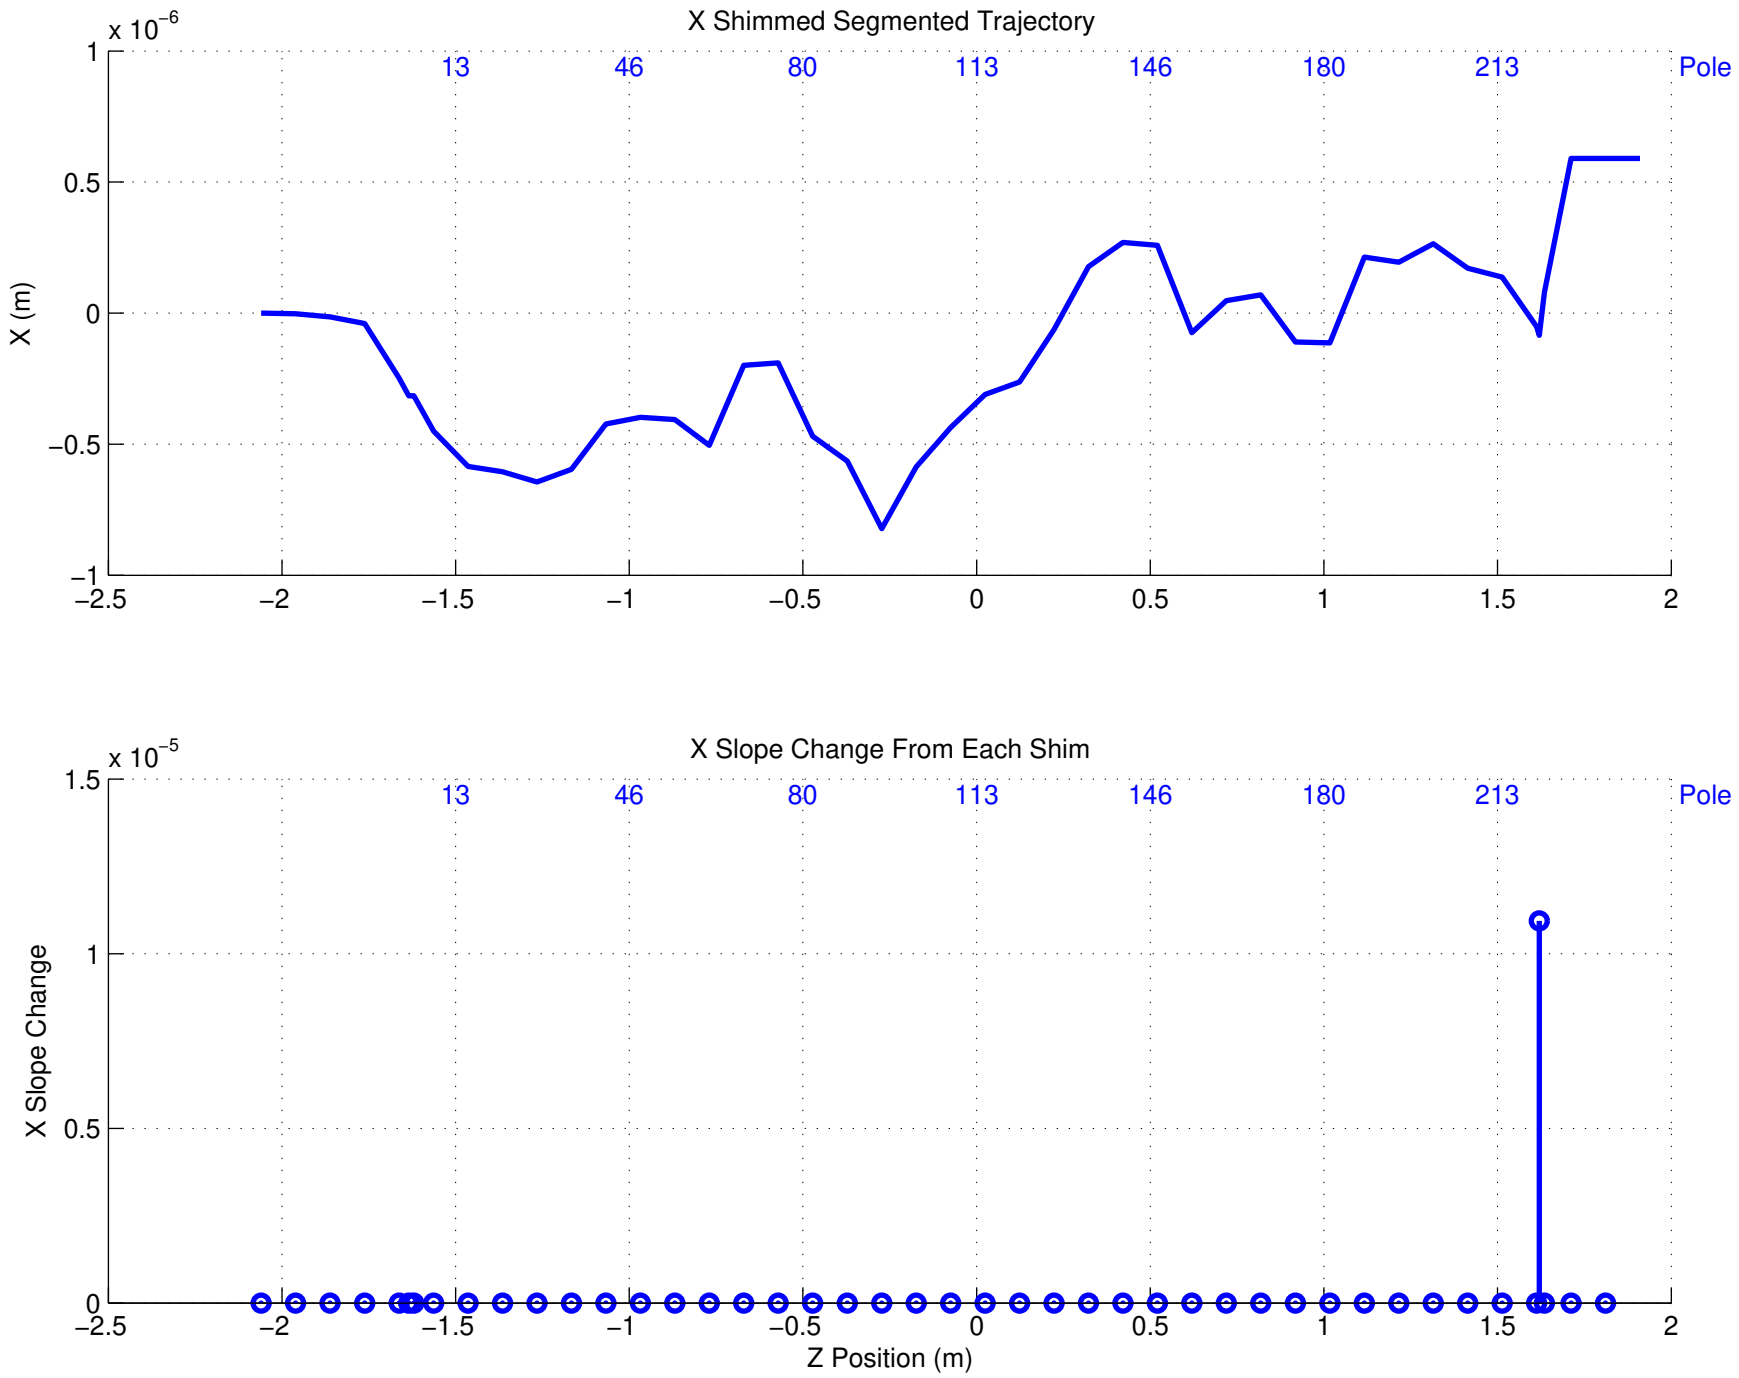
X Shimmed Segmented Trajectory
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
1
0.5
0
−0.5
−1
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
X Slope Change From Each Shim
x 10^-5
X Slope Change
1.5
1
0.5
0
Z Position (m)

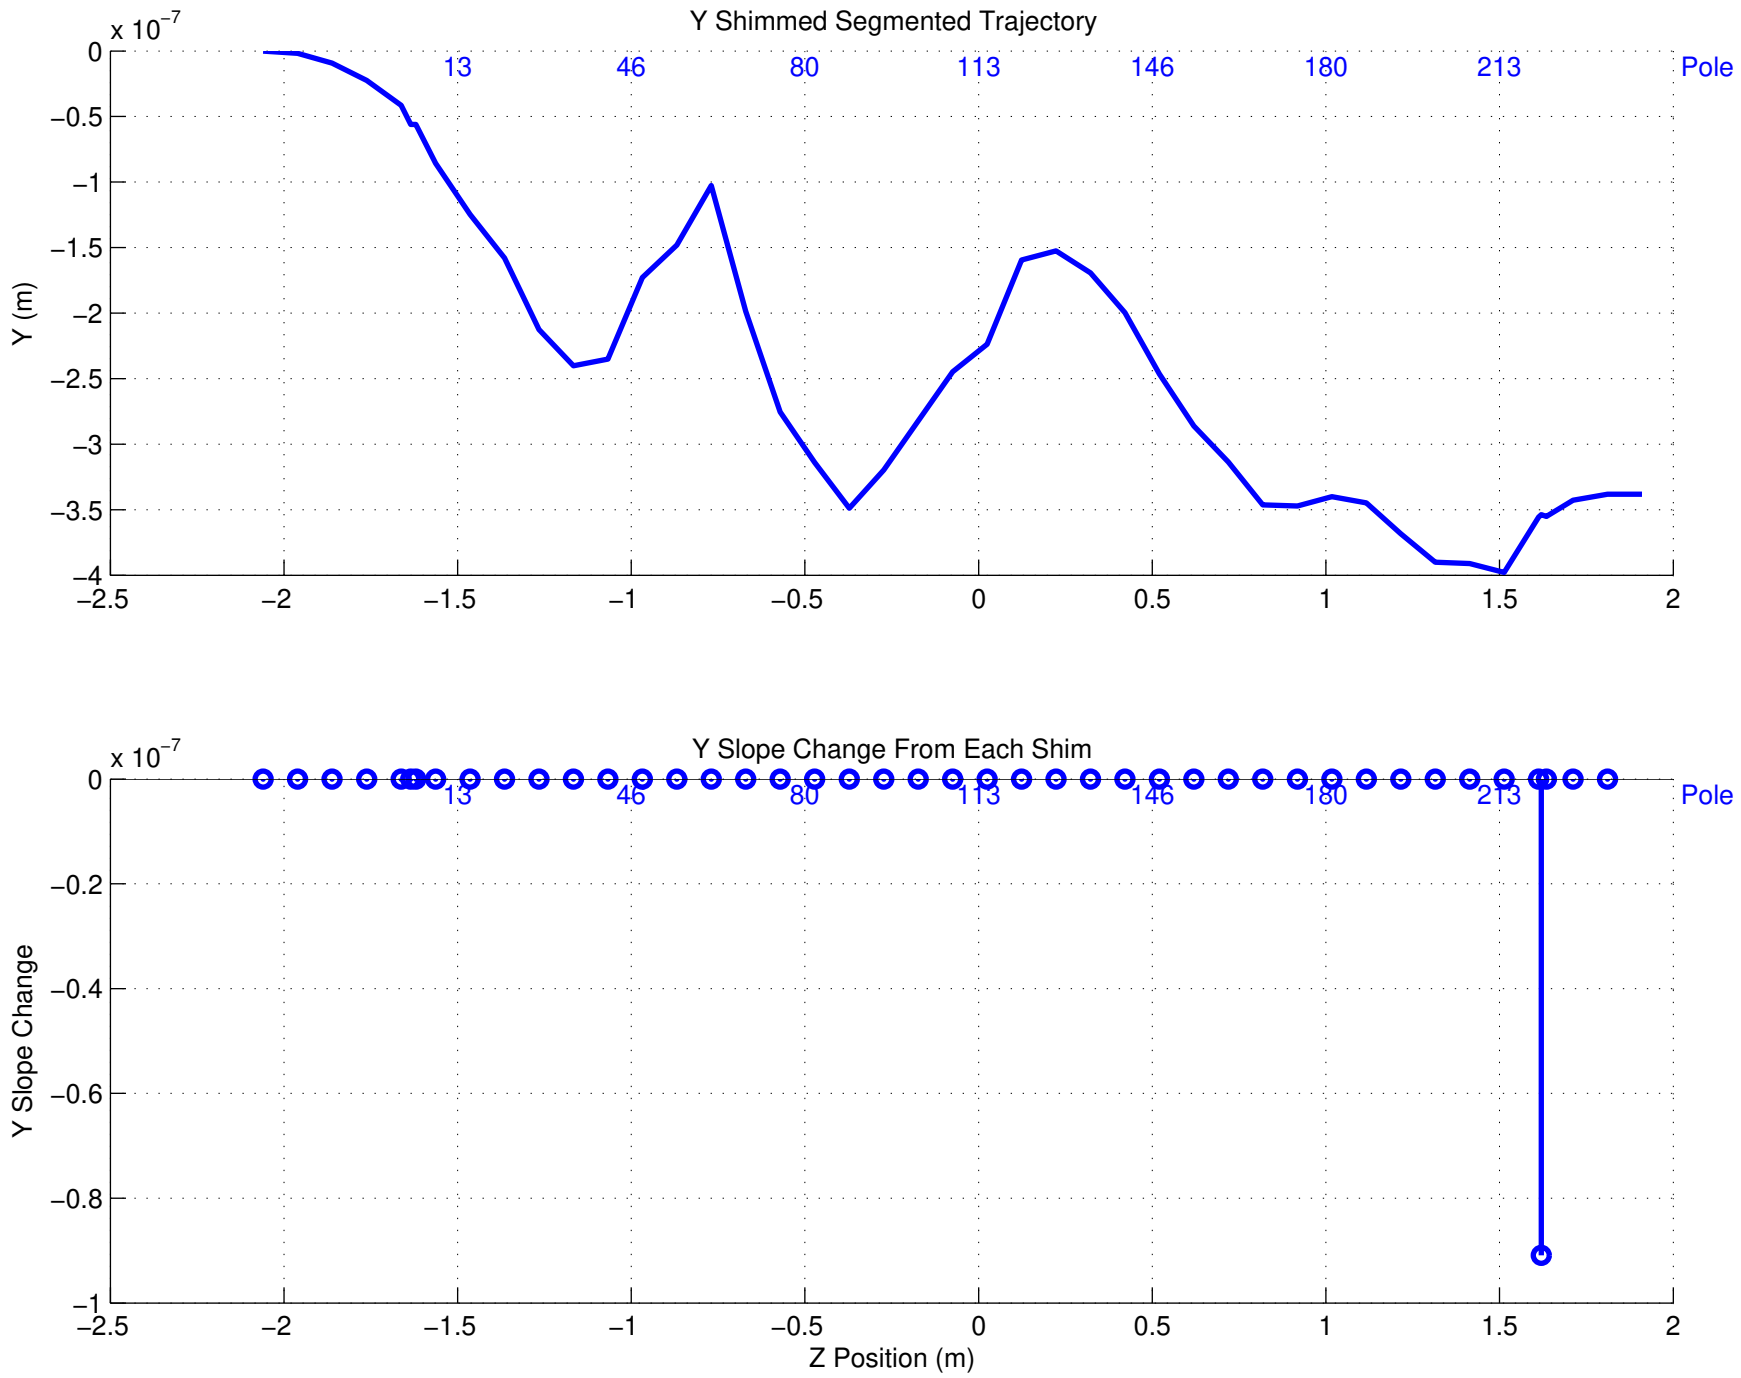
Y Shimmed Segmented Trajectory
x 10^-7
Y (m)
13
46
80
113
146
180
213
Pole
Y Slope Change From Each Shim
Y Slope Change
Z Position (m)

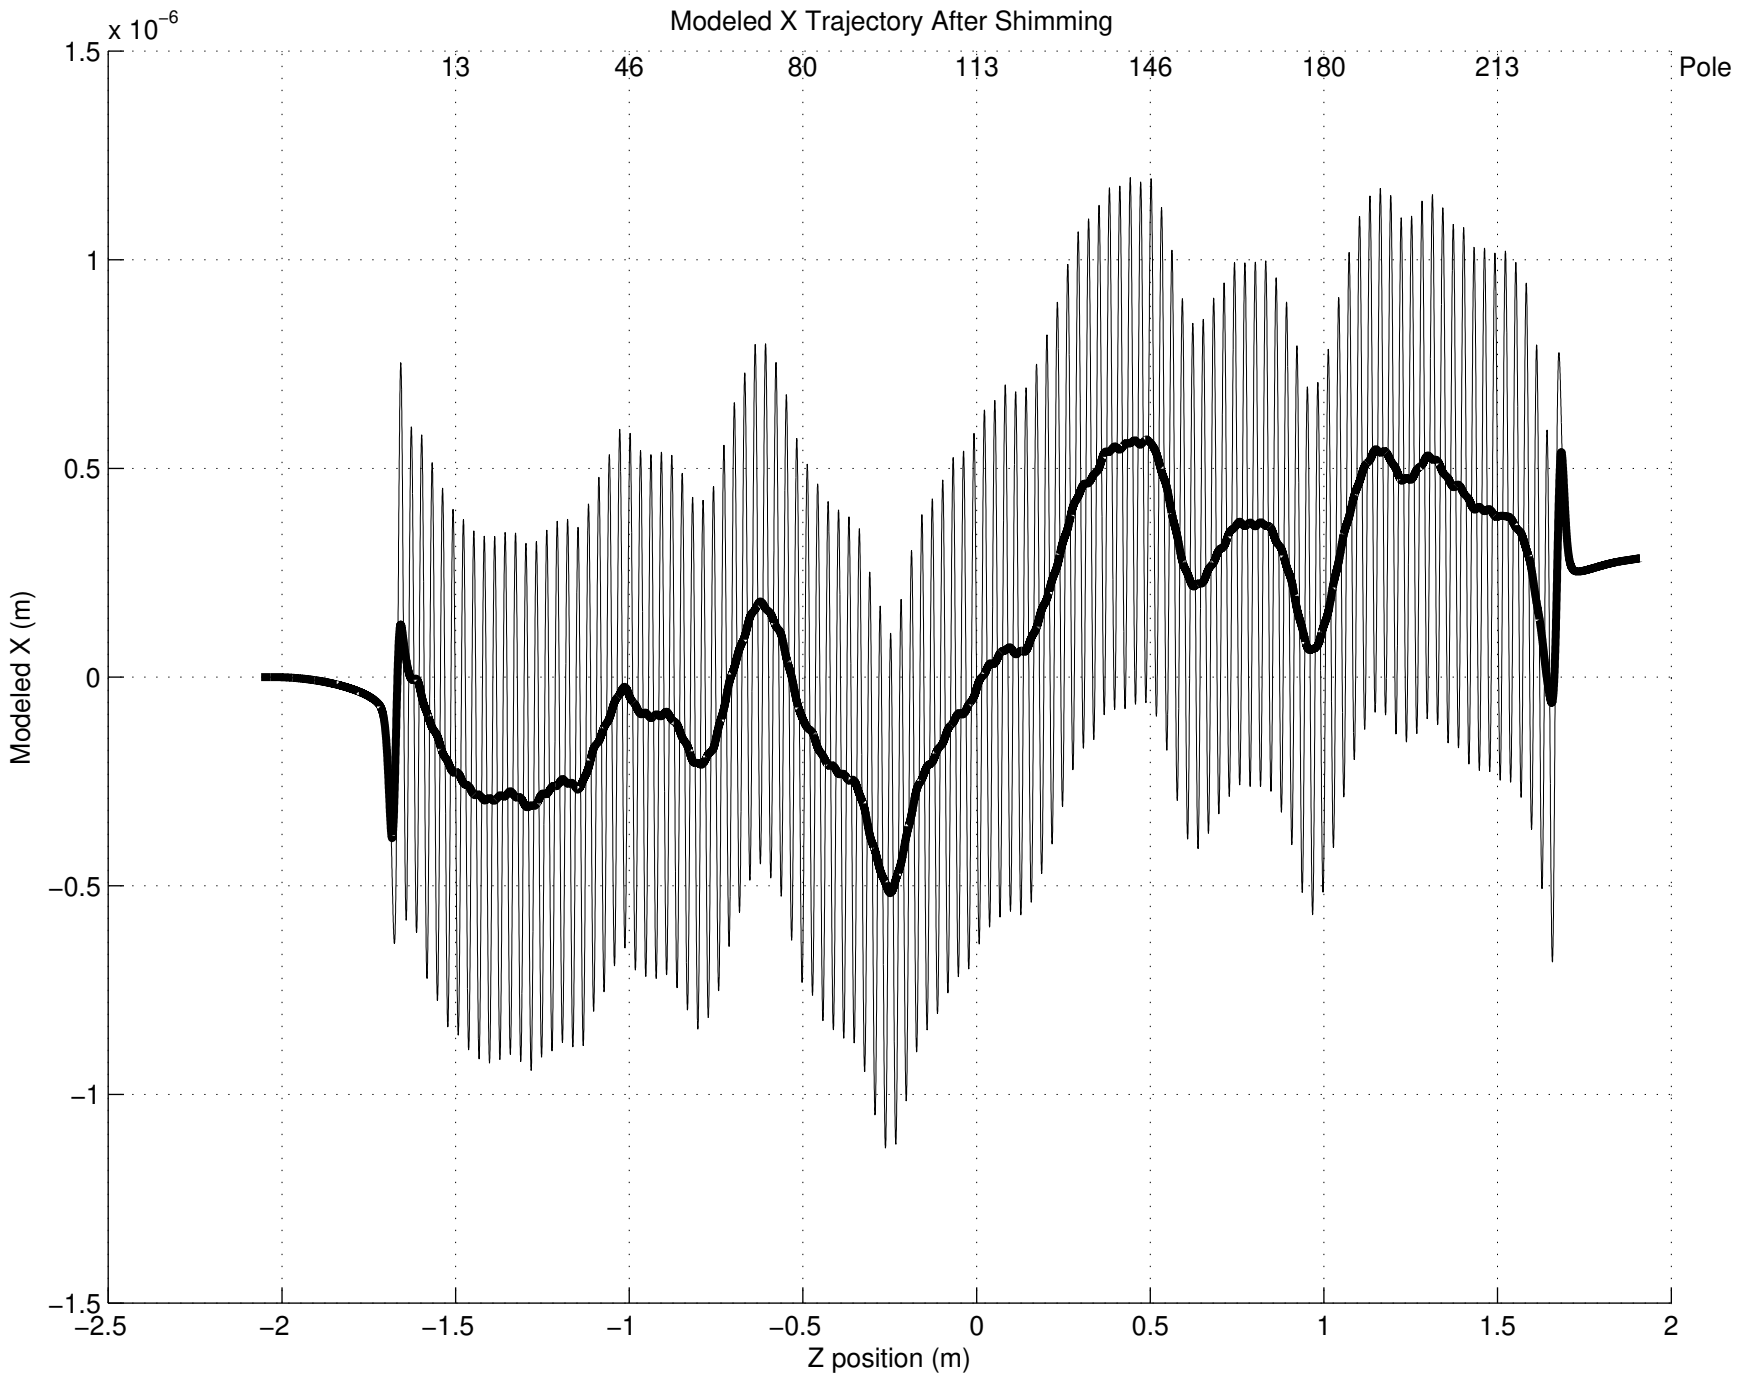
Modeled X Trajectory After Shimming
x 10^-6
1.5
1
0.5
0
−0.5
−1
−1.5
Modeled X (m)
13
46
80
113
146
180
213
Pole
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

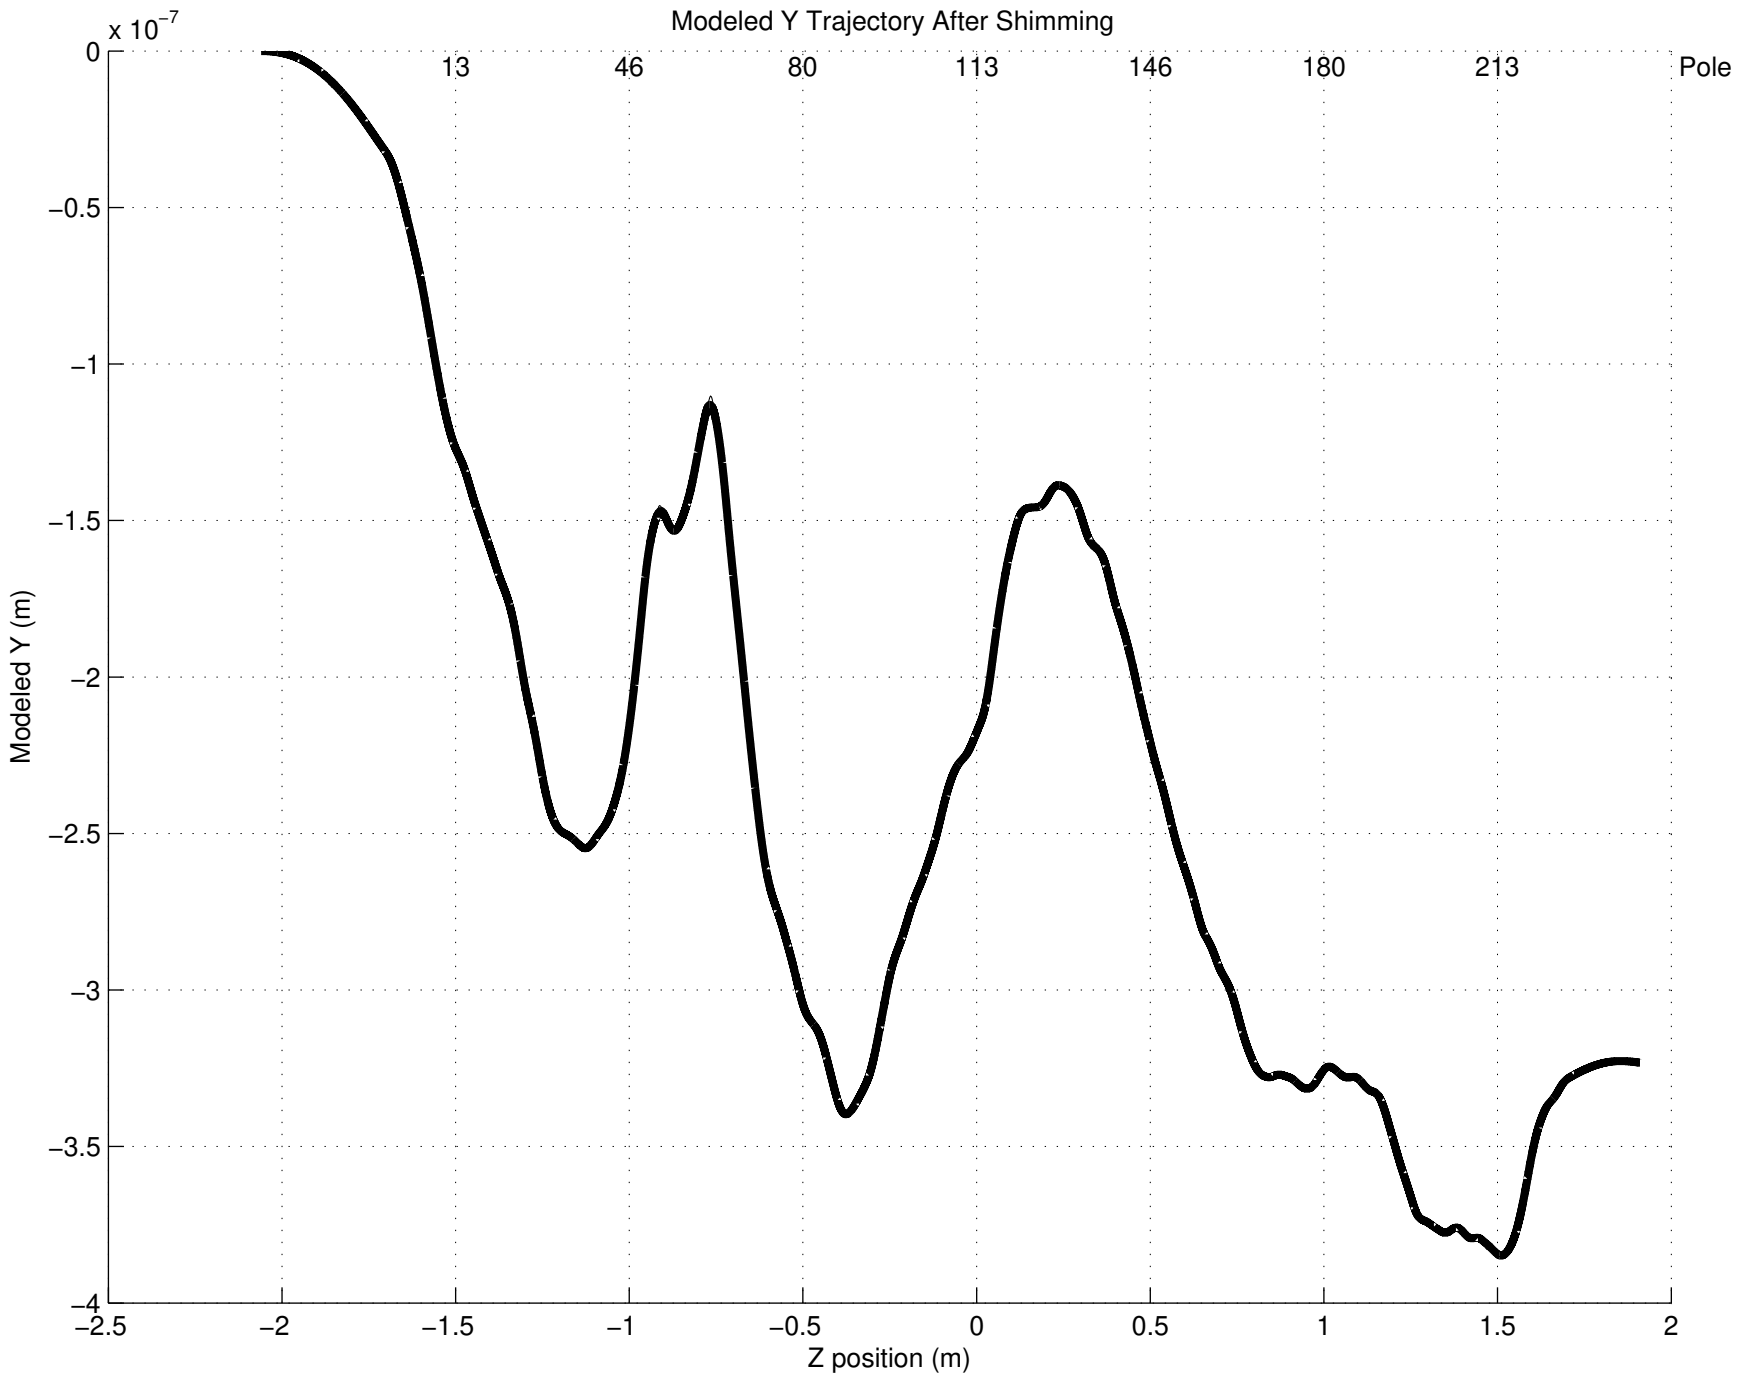
Modeled Y Trajectory After Shimming
x 10^-7
0
−0.5
−1
−1.5
−2
−2.5
−3
−3.5
−4
13
46
80
113
146
180
213
Pole
Modeled Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

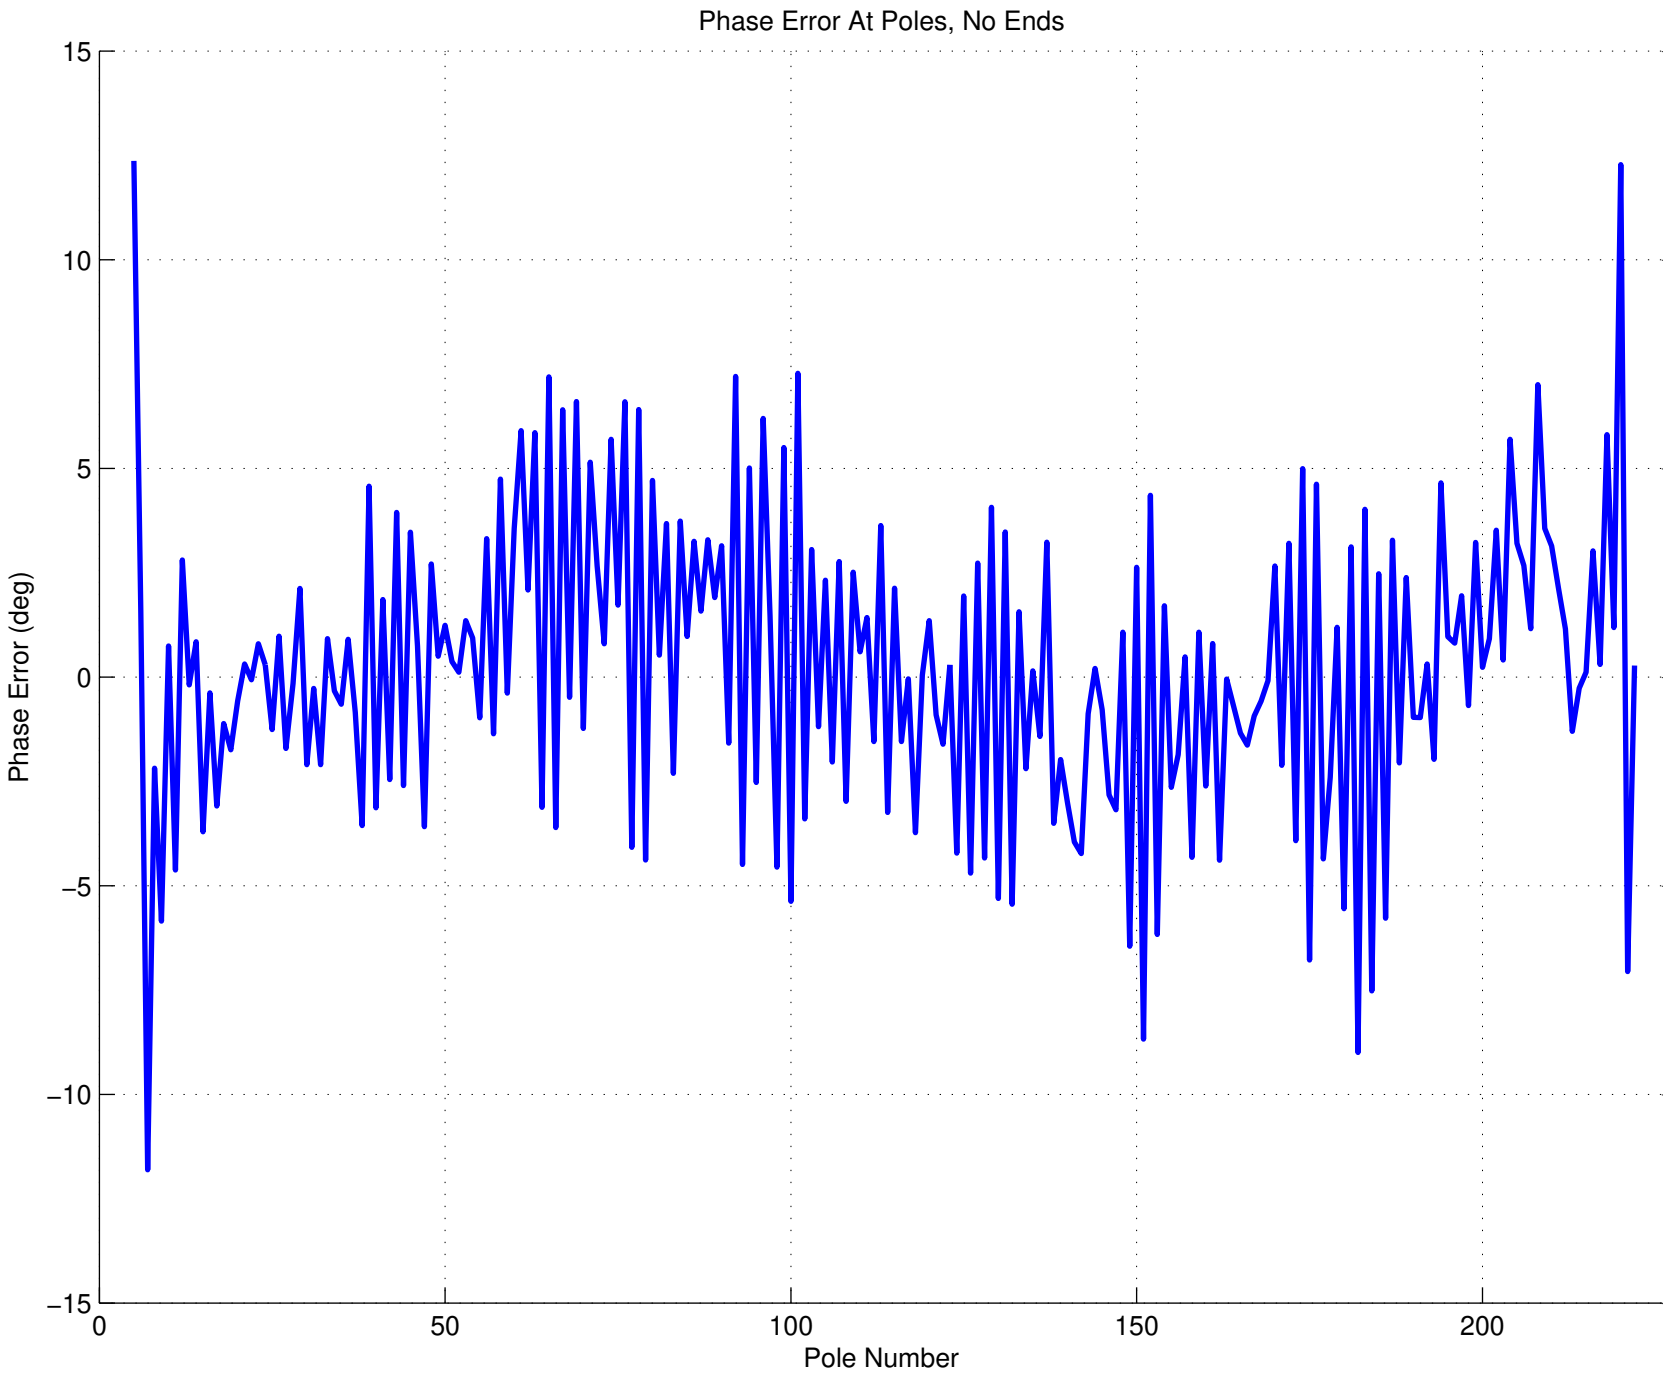
Phase Error At Poles, No Ends
Phase Error (deg)
Pole Number
15
10
5
0
−5
−10
−15
0
50
100
150
200

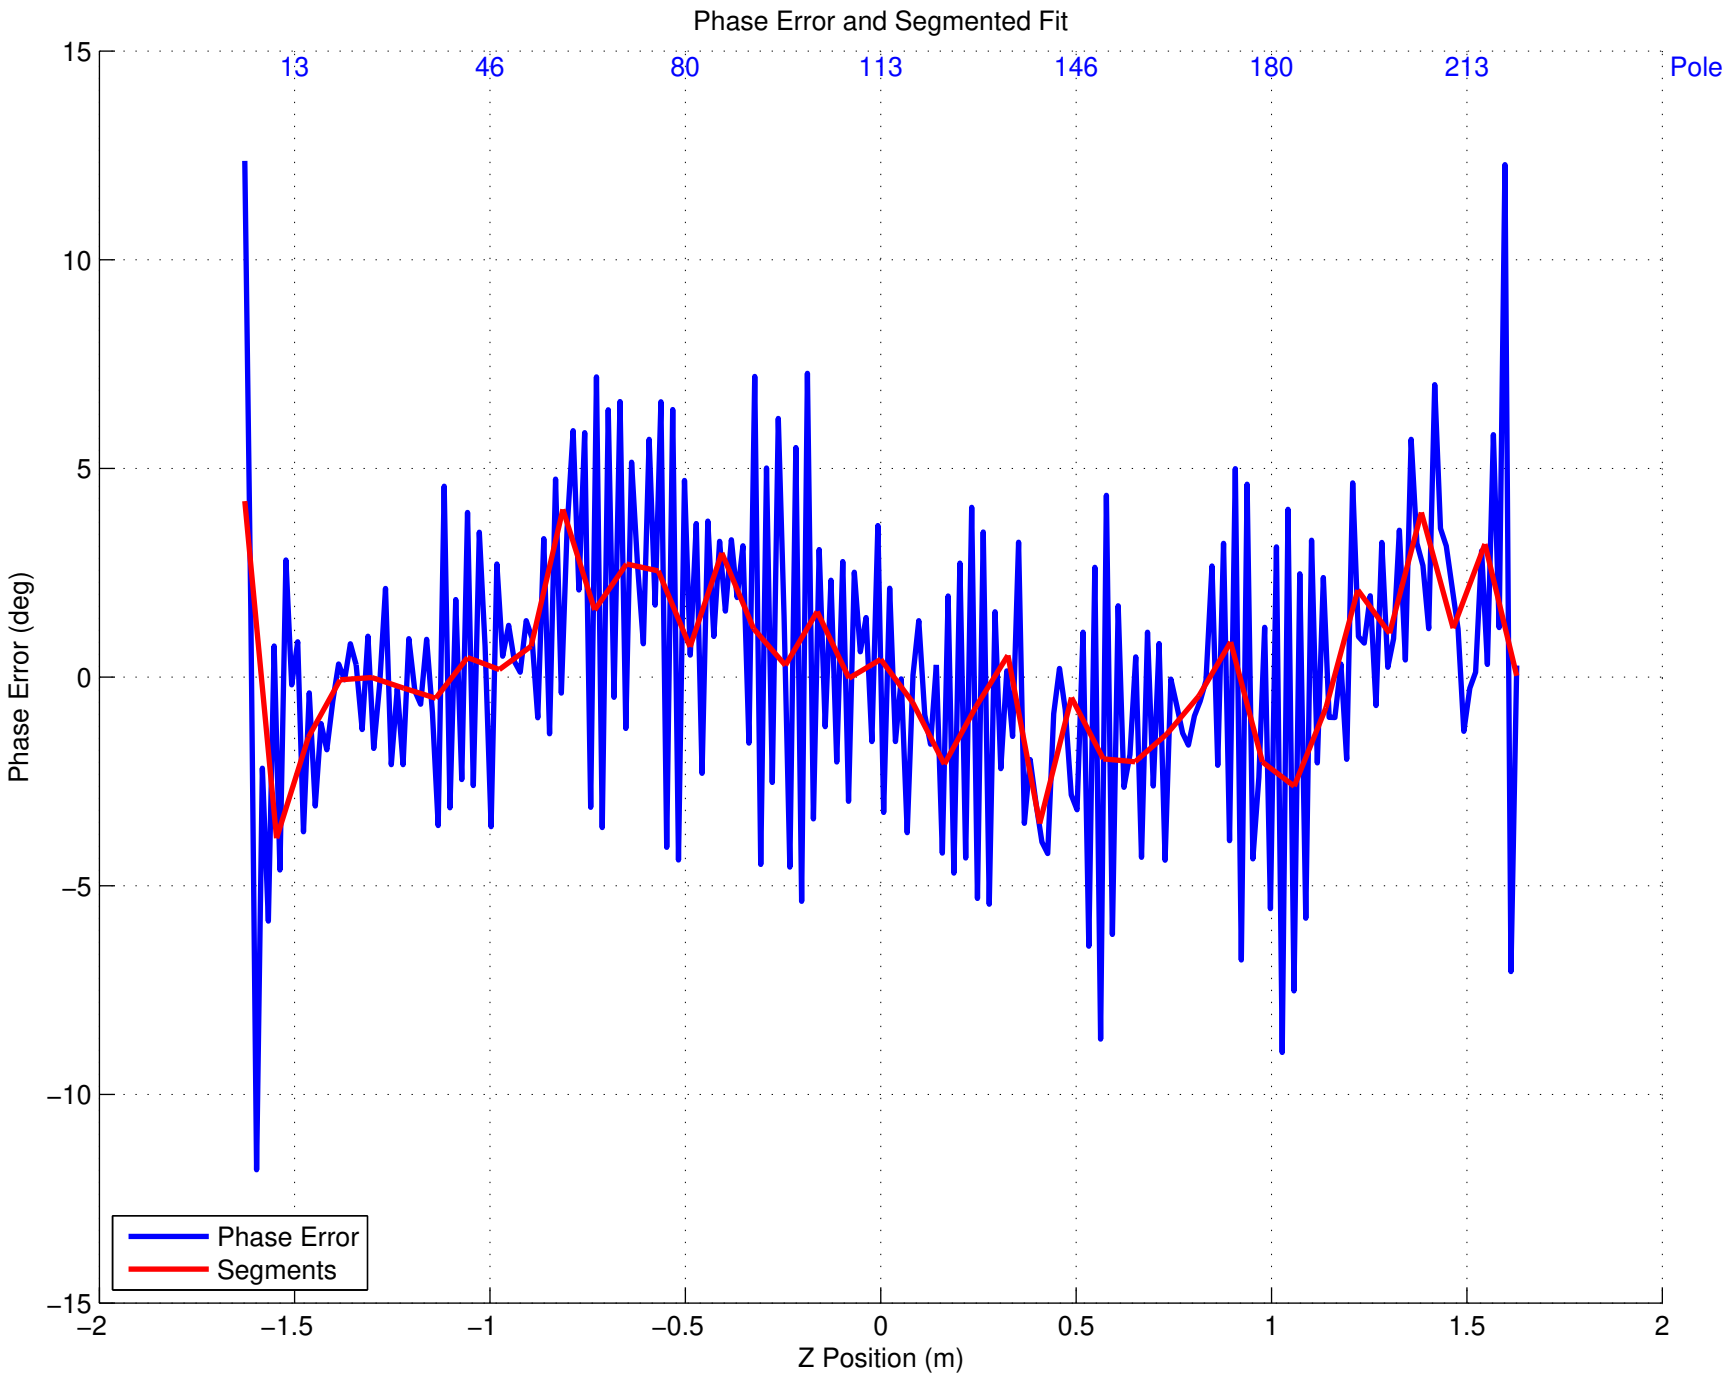
Phase Error and Segmented Fit
13
46
80
113
146
180
213
Pole
15
10
5
0
−5
−10
−15
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Phase Error (deg)
Z Position (m)
Phase Error
Segments

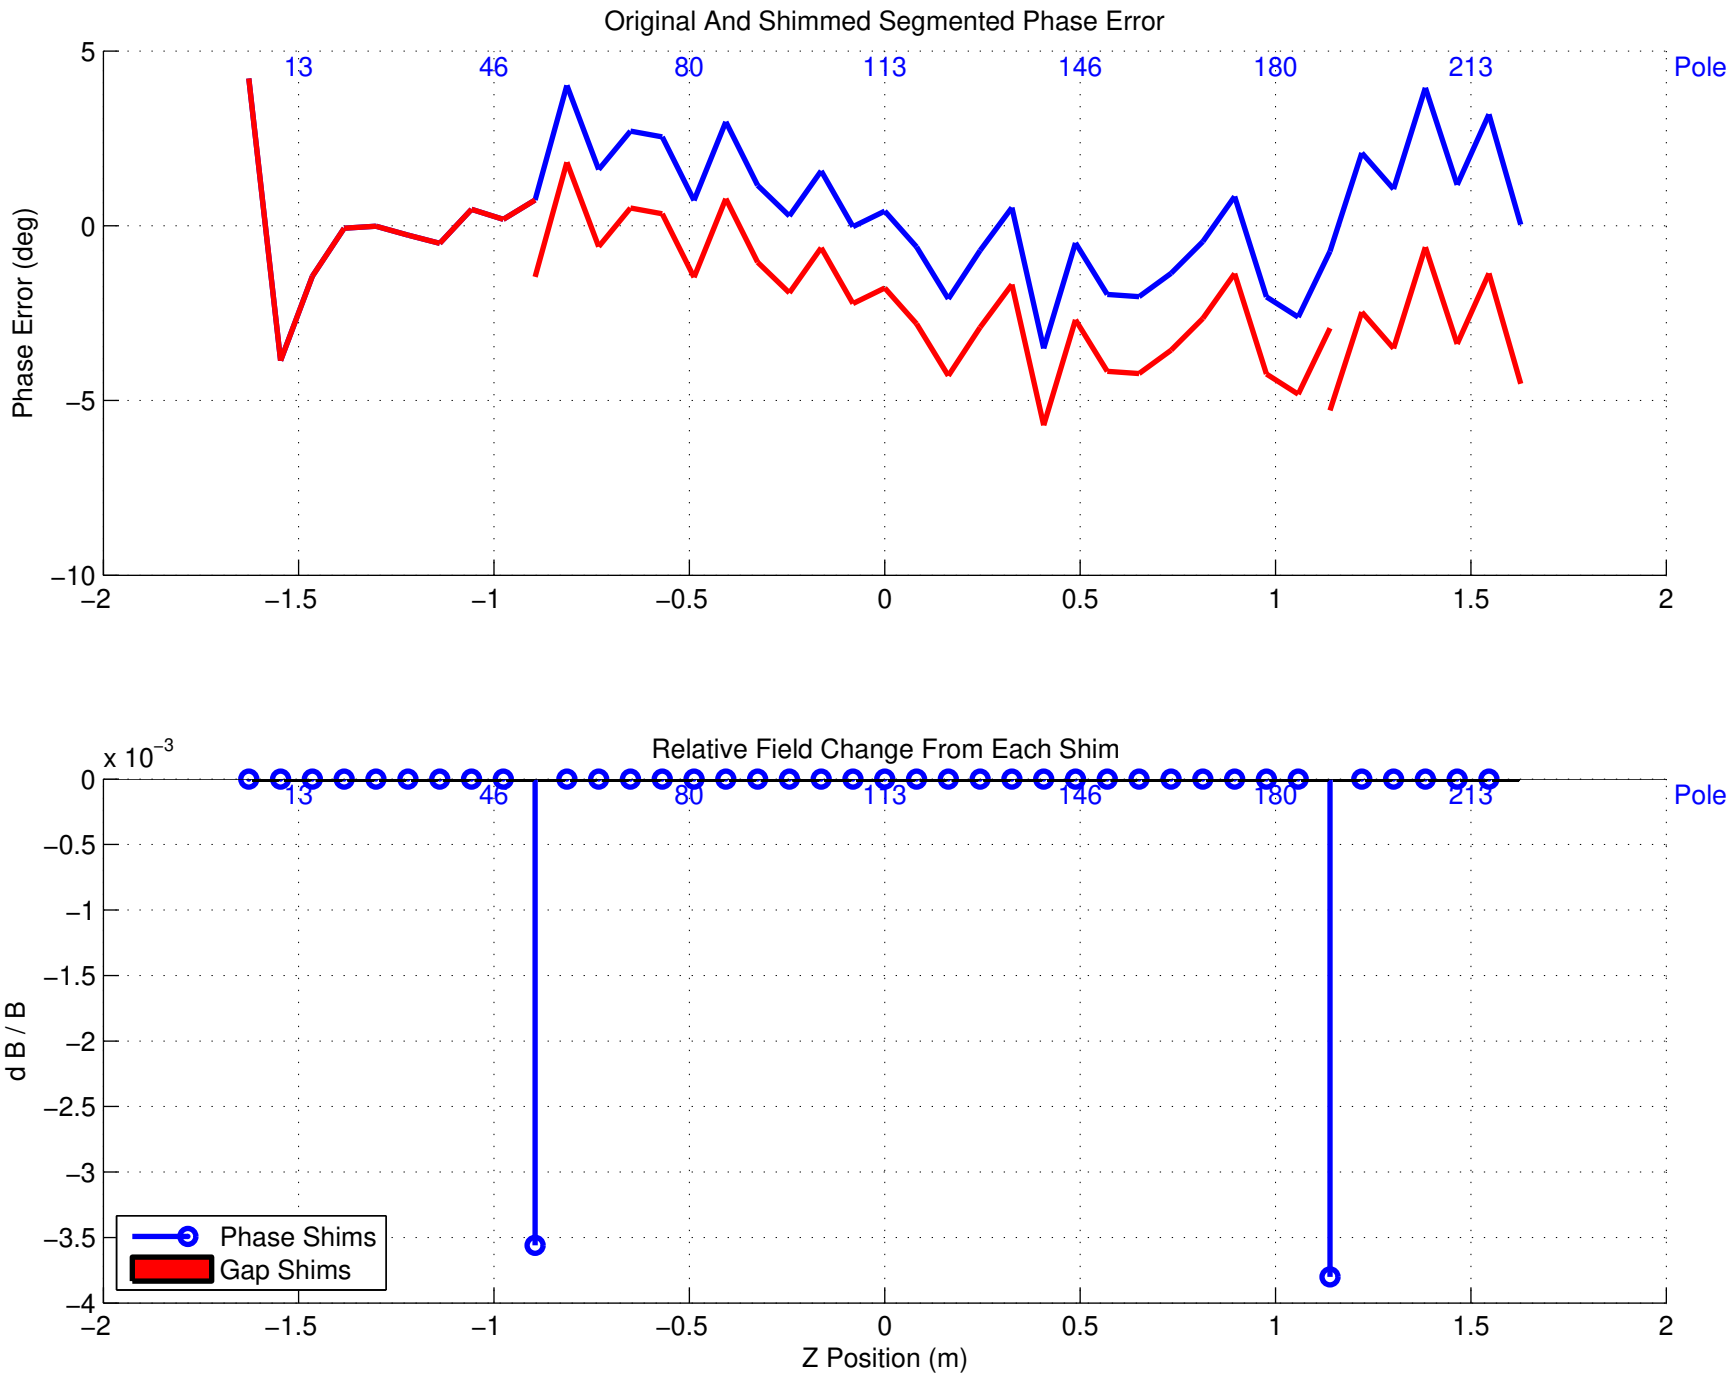
Original And Shimmed Segmented Phase Error
Phase Error (deg)
Pole
13
46
80
113
146
180
213
5
0
−5
−10
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
Z Position (m)
Phase Shims
Gap Shims
−0.5
−1
−1.5
−2
−2.5
−3
−3.5
−4

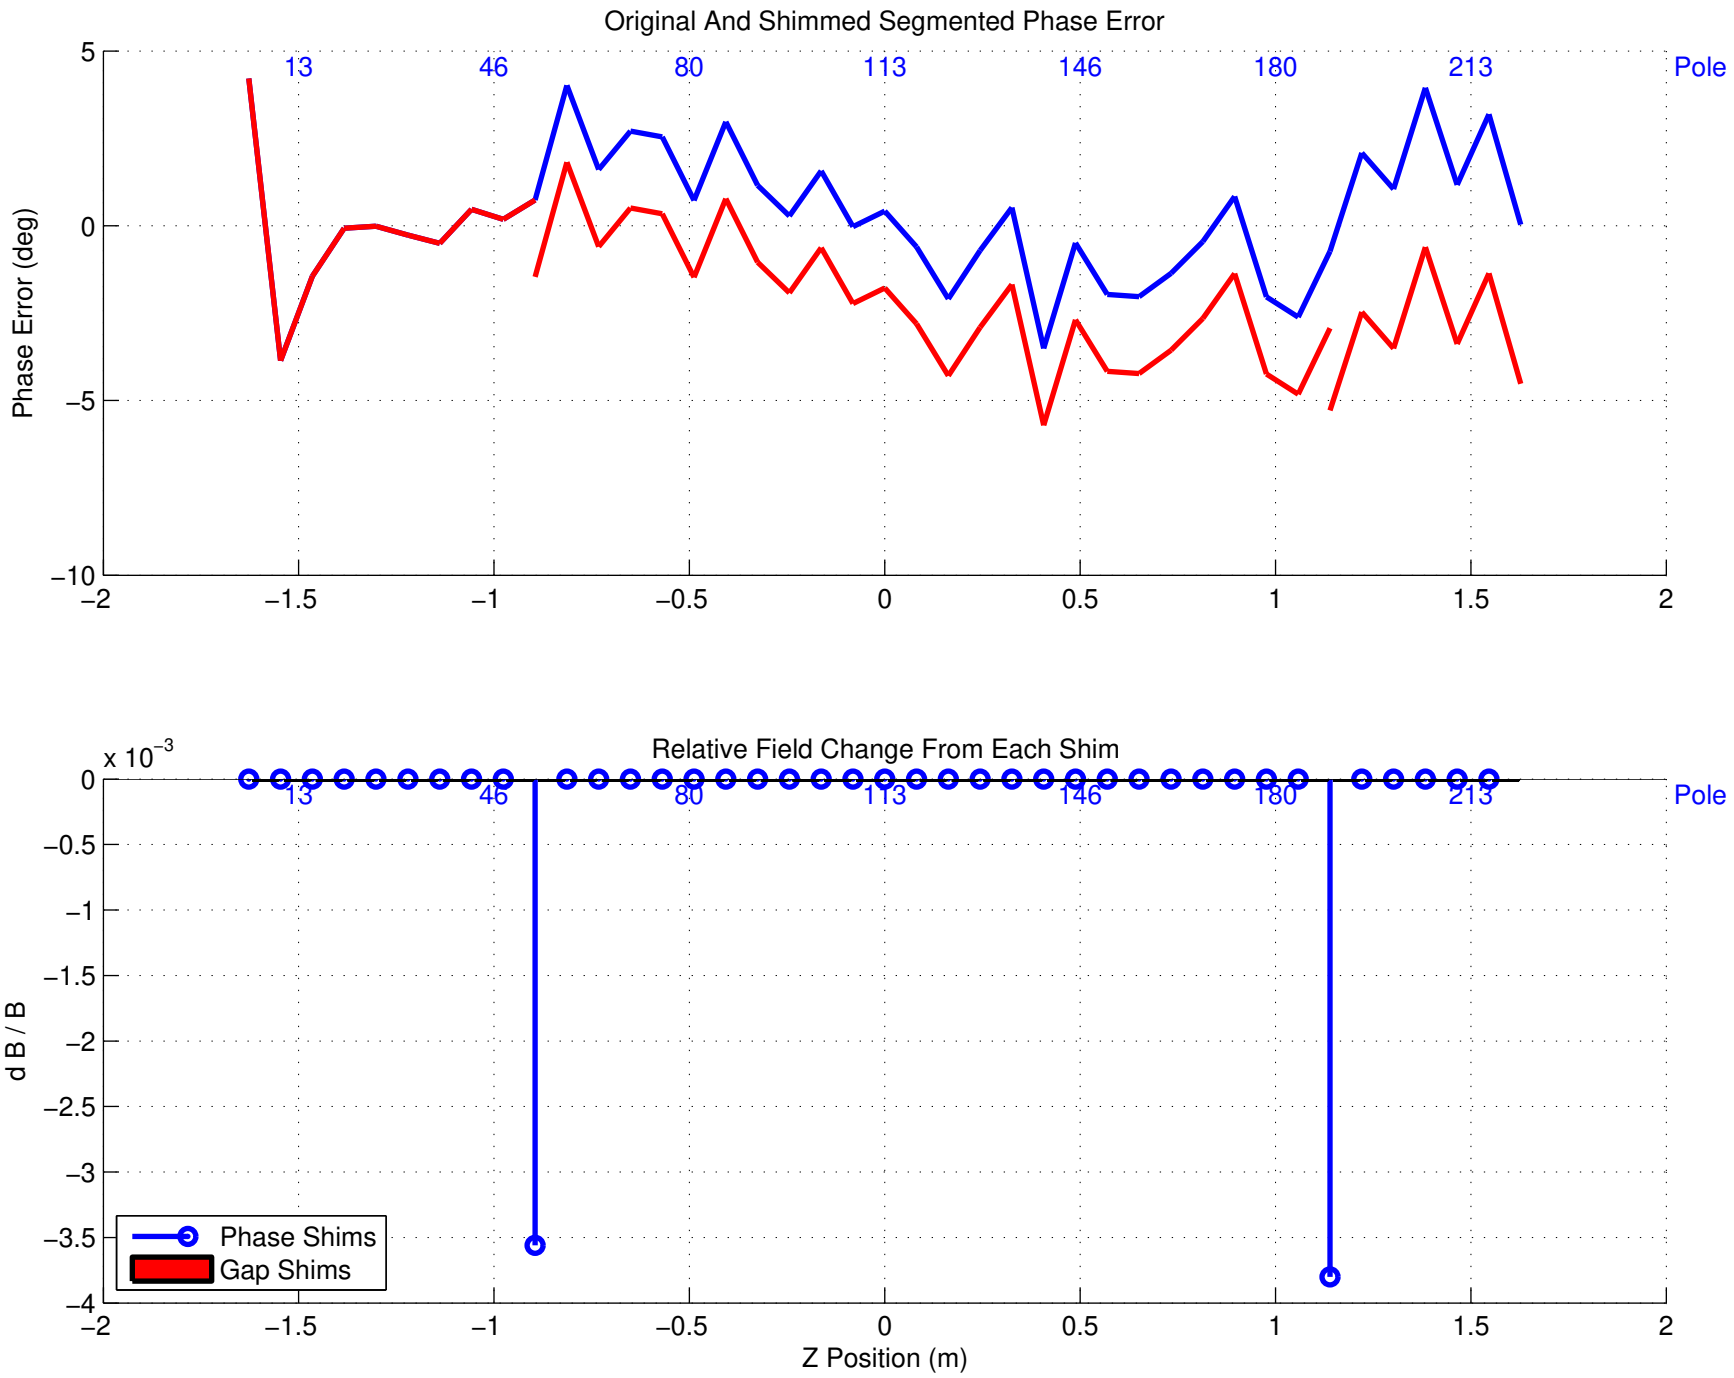
Original And Shimmed Segmented Phase Error
Phase Error (deg)
Pole
13
46
80
113
146
180
213
5
0
−5
−10
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
Z Position (m)
Phase Shims
Gap Shims
−0.5
−1
−1.5
−2
−2.5
−3
−3.5
−4

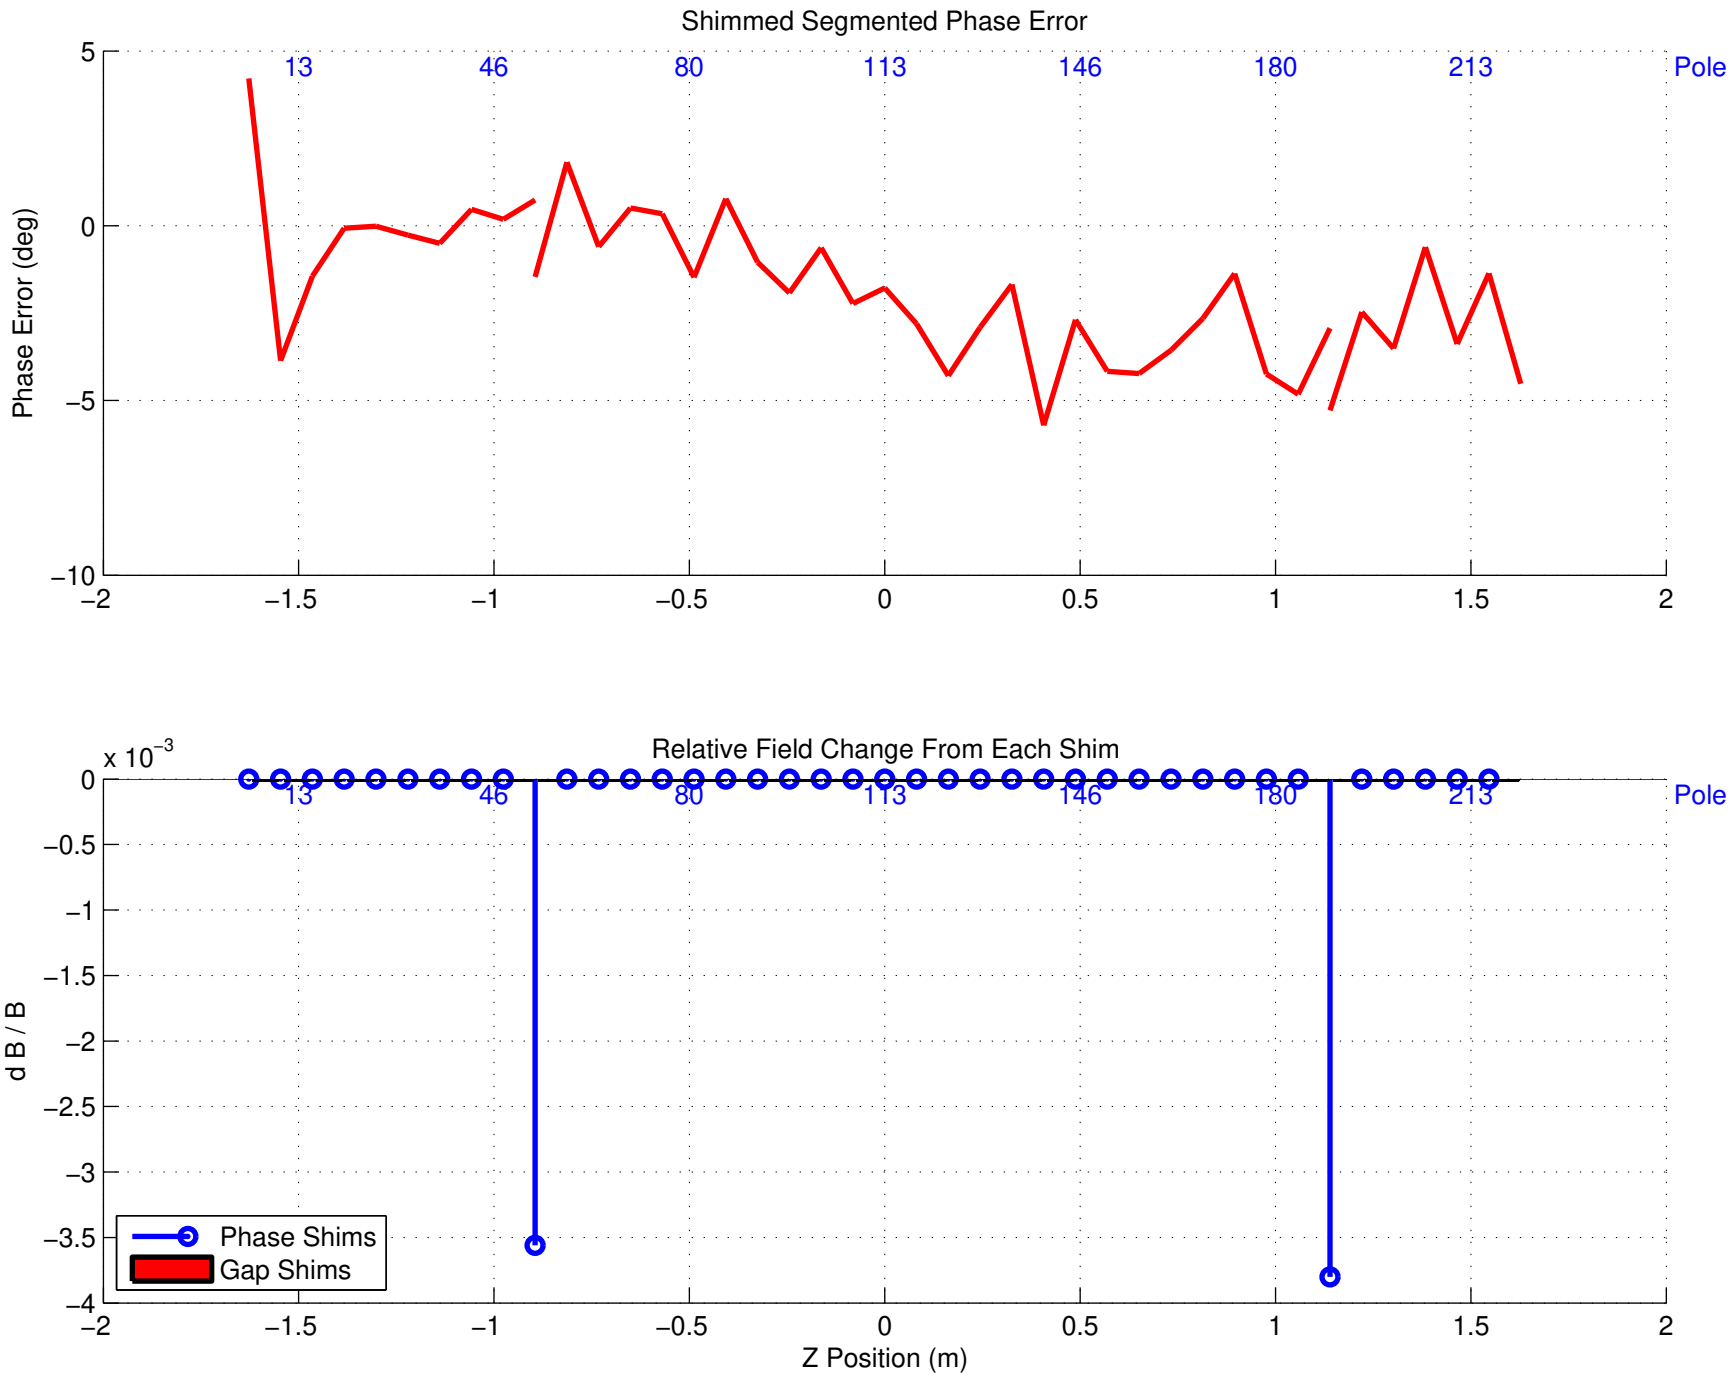
Shimmed Segmented Phase Error
Phase Error (deg)
5
0
−5
−10
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
0
−0.5
−1
−1.5
−2
−2.5
−3
−3.5
−4
Phase Shims
Gap Shims
Z Position (m)

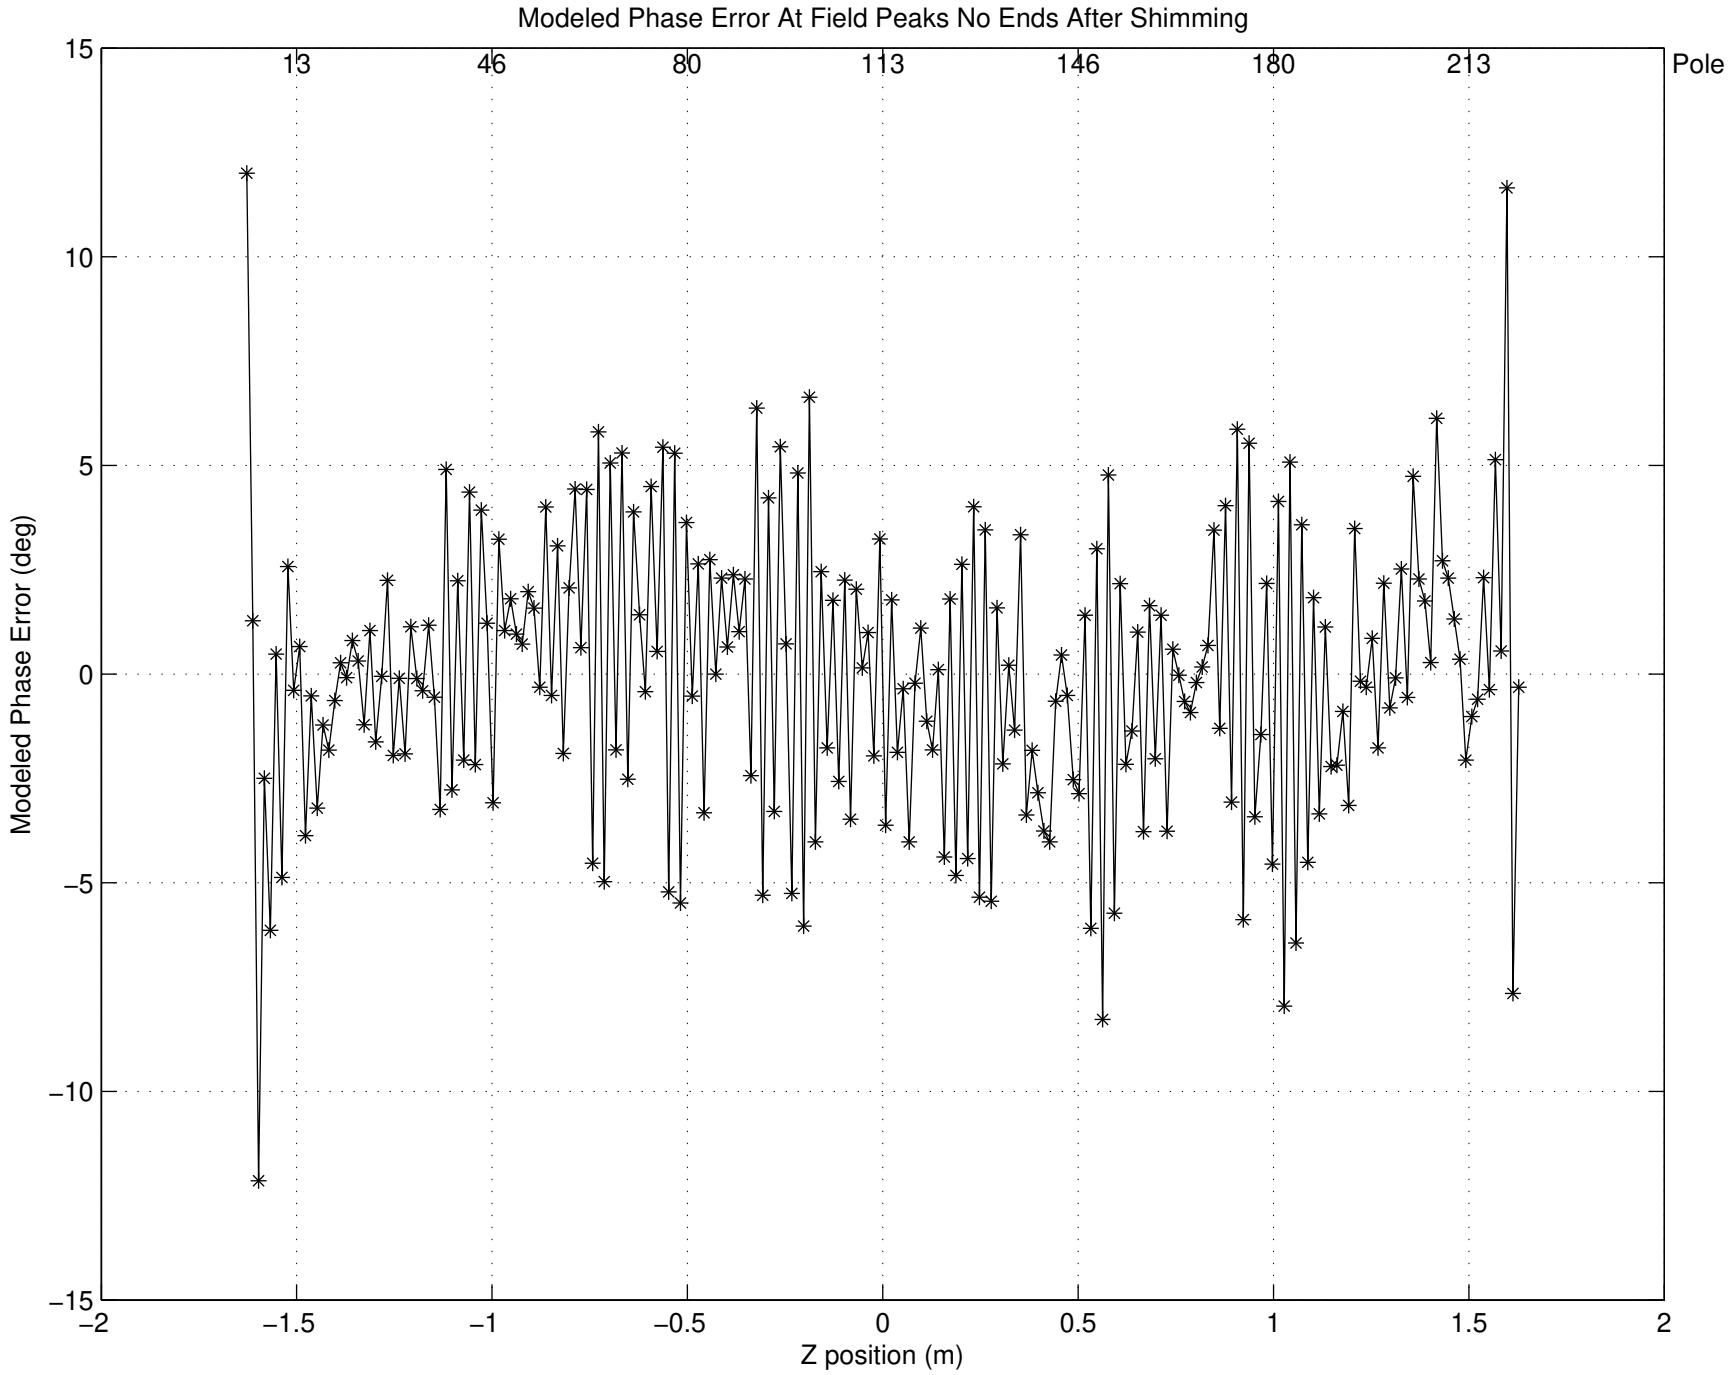

Phase Error: Ave = 0.000000 deg, RMS = 3.433334 deg