SLAC Magnetic Measurements

Planar Insertion Device Shim Analysis

Parameters:
INPUT−FILE−DIR =S:\MagData\LCLS\Undulator\L143−112000−30\DATASET0001\Rough Tuning\Z Scans\Run 007\
INPUT−FILE−NAME =x+00000−y+000−bscanz.dat
INPUT−FILE−TYPE =ZVXYBXYH
CORR−REQUIRED =1
GAMMA =26663.19
NOM−LAMBDA−U =0.03
NOM−K−VALUE =3.4936
NOM−LAMBDA−R =1.4986e−010
NUM−POLES =226
NUM−END−POLES =4
CELL−LENGTH =3.656

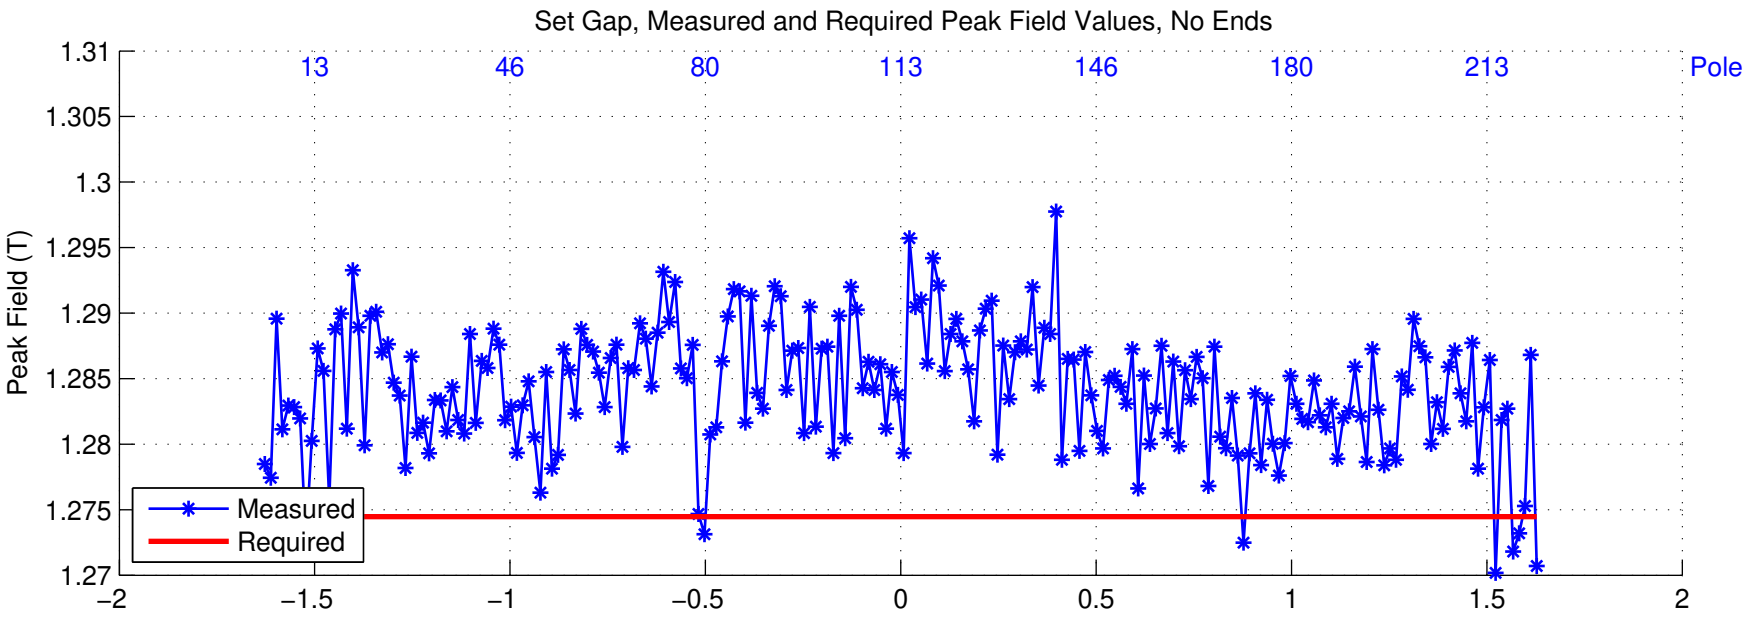
Set Gap, Measured and Required Peak Field Values, No Ends
13
46
80
113
146
180
213
Pole
Peak Field (T)
1.31
1.305
1.3
1.295
1.29
1.285
1.28
1.275
1.27
Measured
Required
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

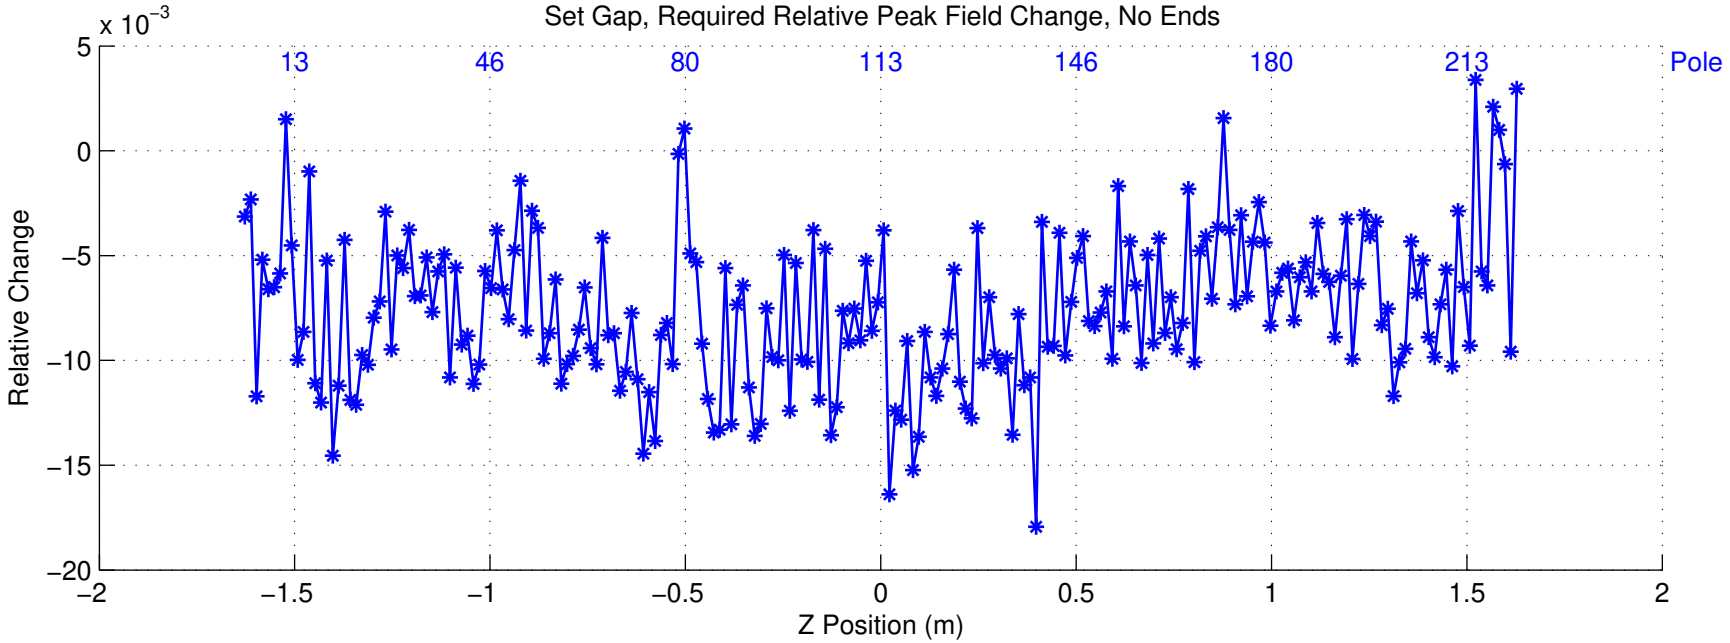
Set Gap, Required Relative Peak Field Change, No Ends
x 10^-3
13
46
80
113
146
180
213
Pole
Relative Change
5
0
−5
−10
−15
−20
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

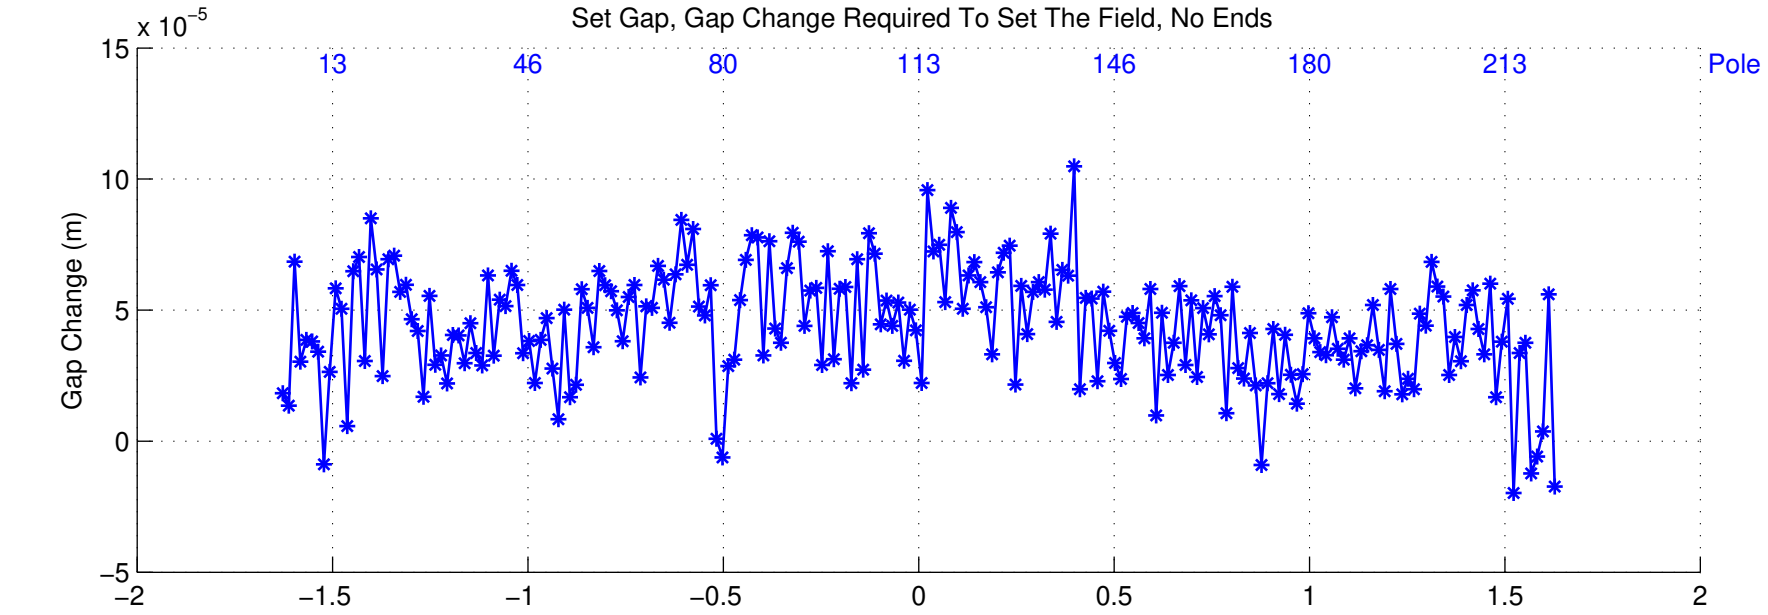
Set Gap, Gap Change Required To Set The Field, No Ends
x 10^-5
Gap Change (m)
13
46
80
113
146
180
213
Pole
15
10
5
0
−5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

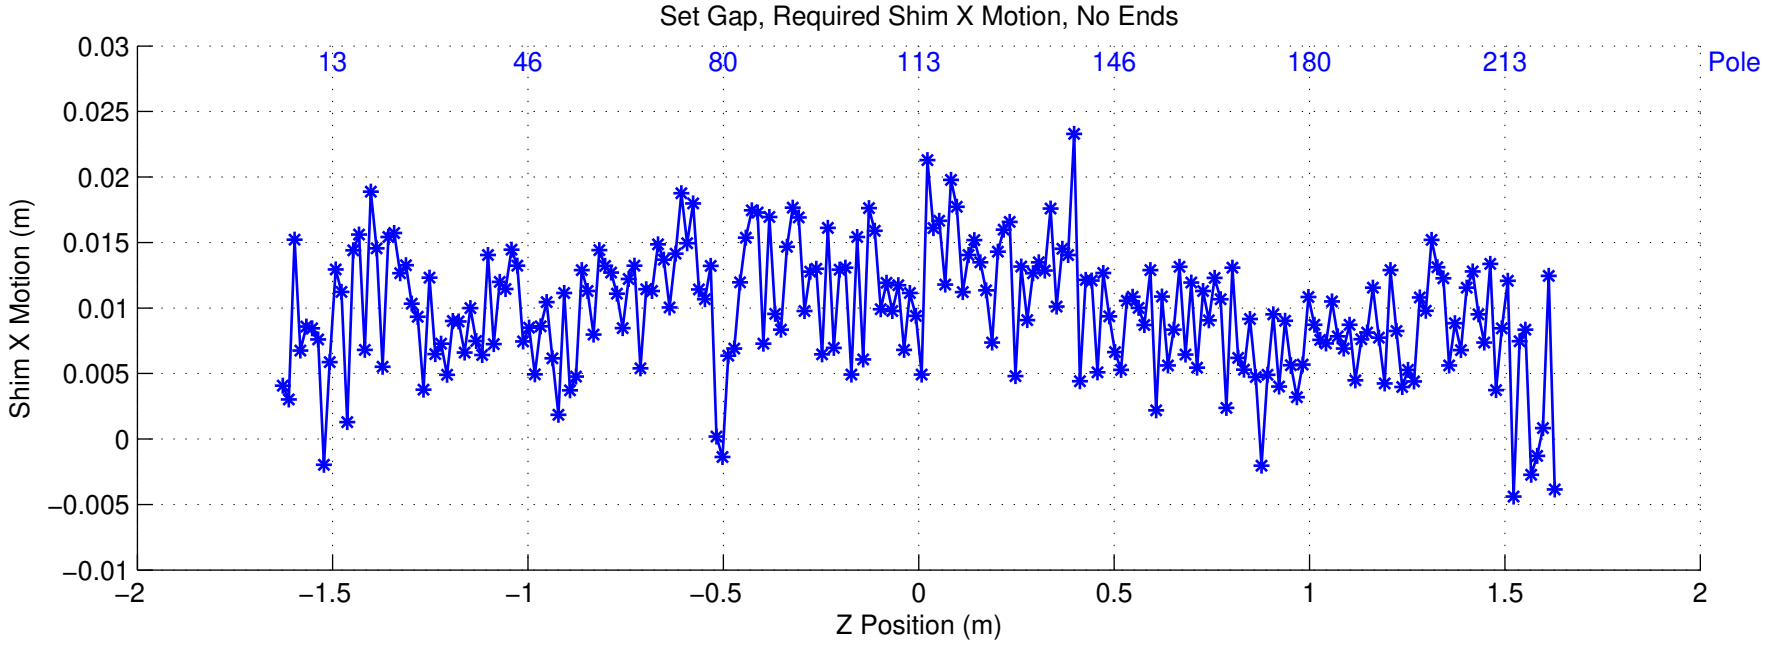
Set Gap, Required Shim X Motion, No Ends
Shim X Motion (m)
13
46
80
113
146
180
213
Pole
0.03
0.025
0.02
0.015
0.01
0.005
0
−0.005
−0.01
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

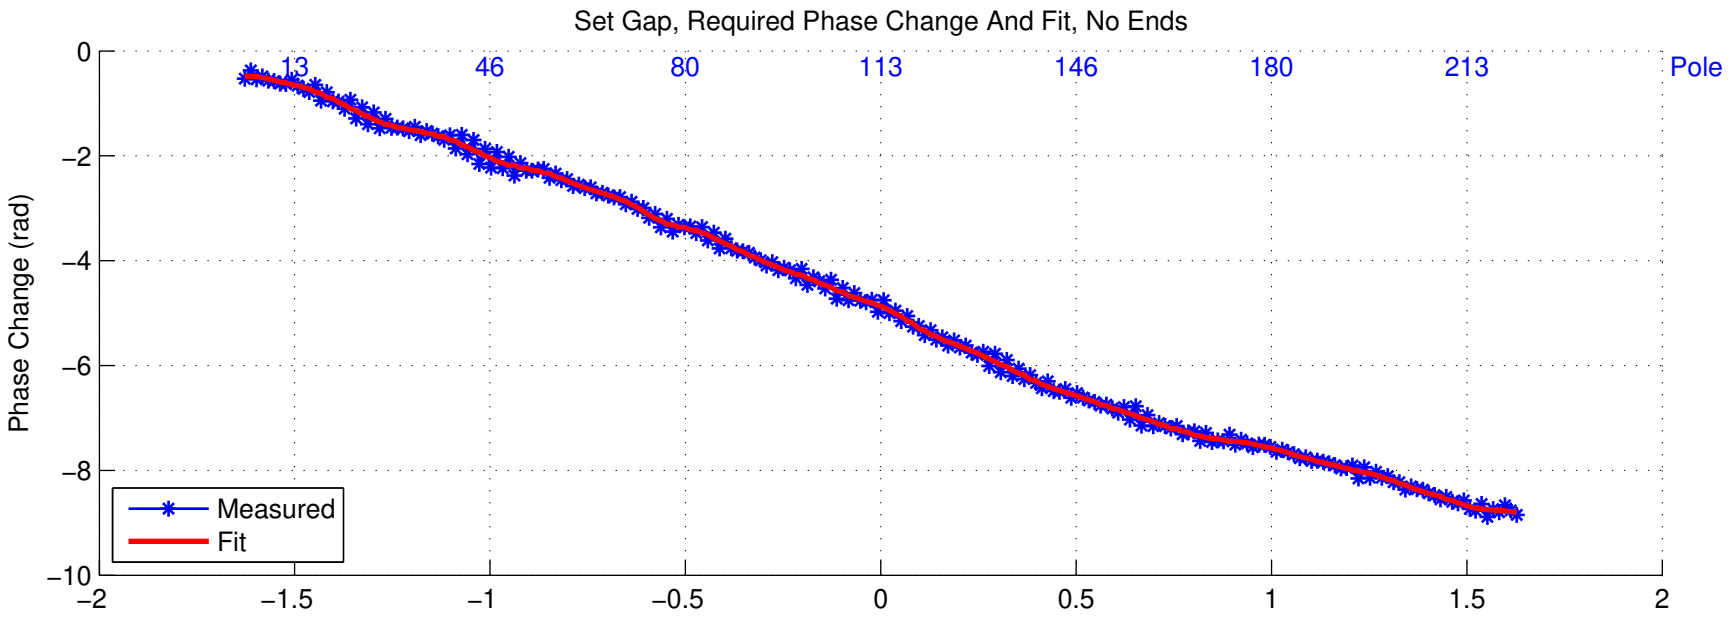
Set Gap, Required Phase Change And Fit, No Ends
13
46
80
113
146
180
213
Pole
Phase Change (rad)
0
−2
−4
−6
−8
−10
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Measured
Fit

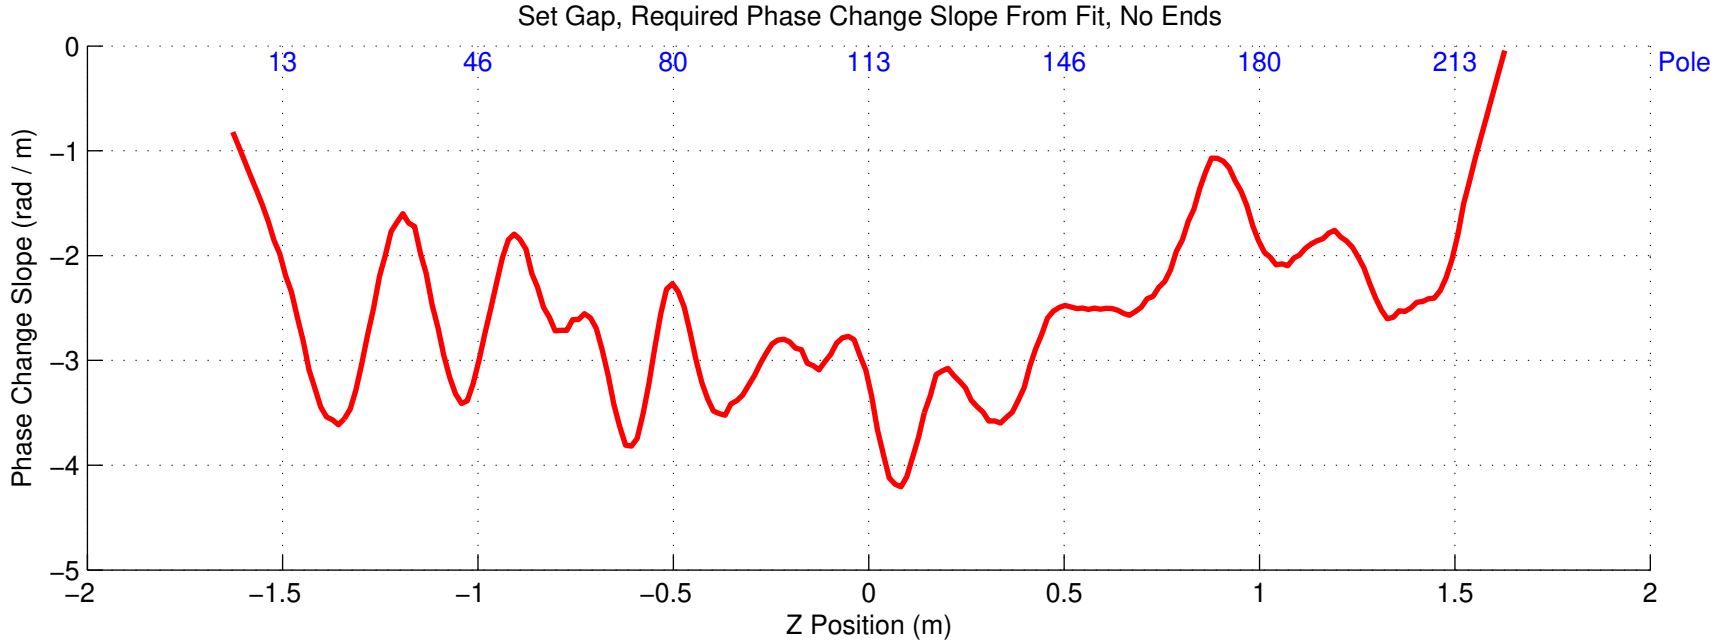
Set Gap, Required Phase Change Slope From Fit, No Ends
13
46
80
113
146
180
213
Pole
Phase Change Slope (rad / m)
0
−1
−2
−3
−4
−5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

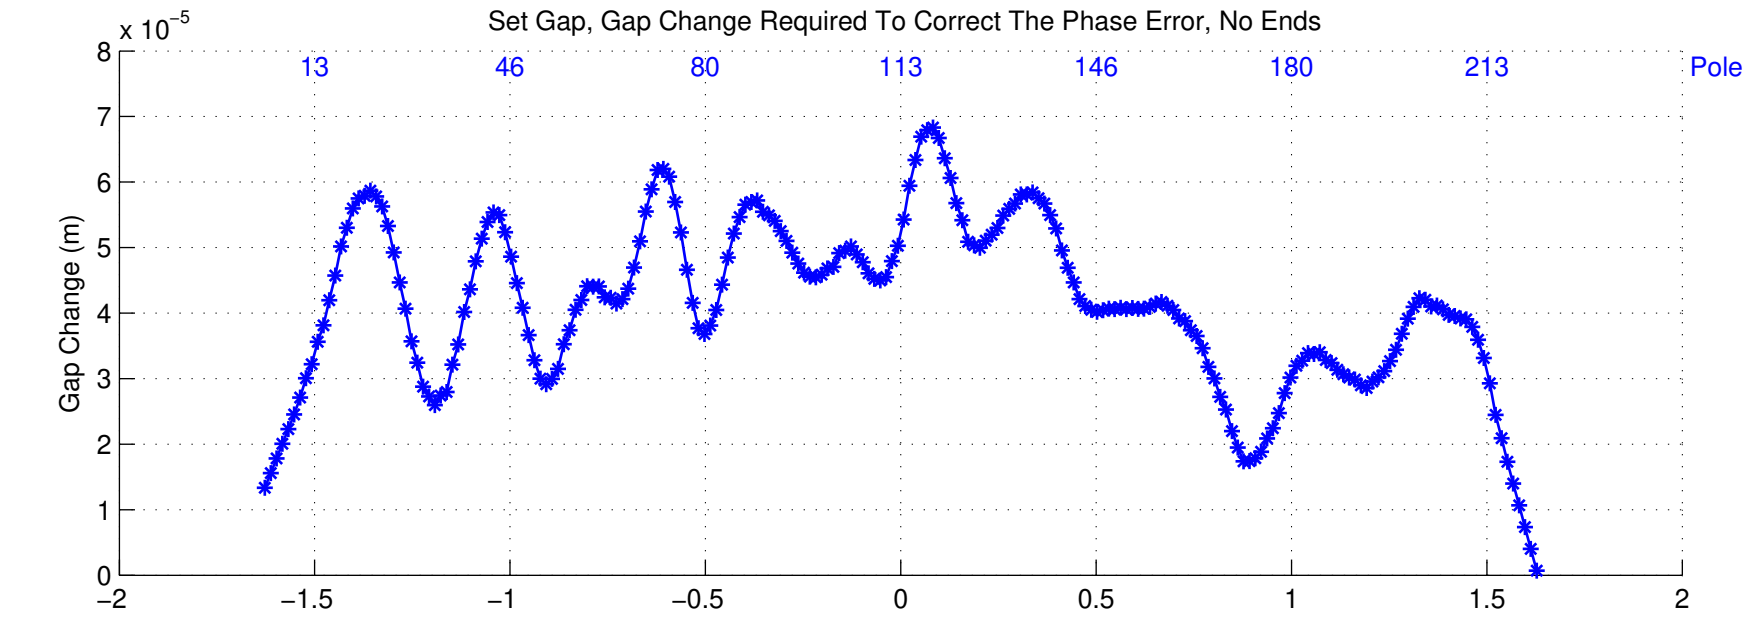
Set Gap, Gap Change Required To Correct The Phase Error, No Ends
x 10^-5
Gap Change (m)
13
46
80
113
146
180
213
Pole
8
7
6
5
4
3
2
1
0
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

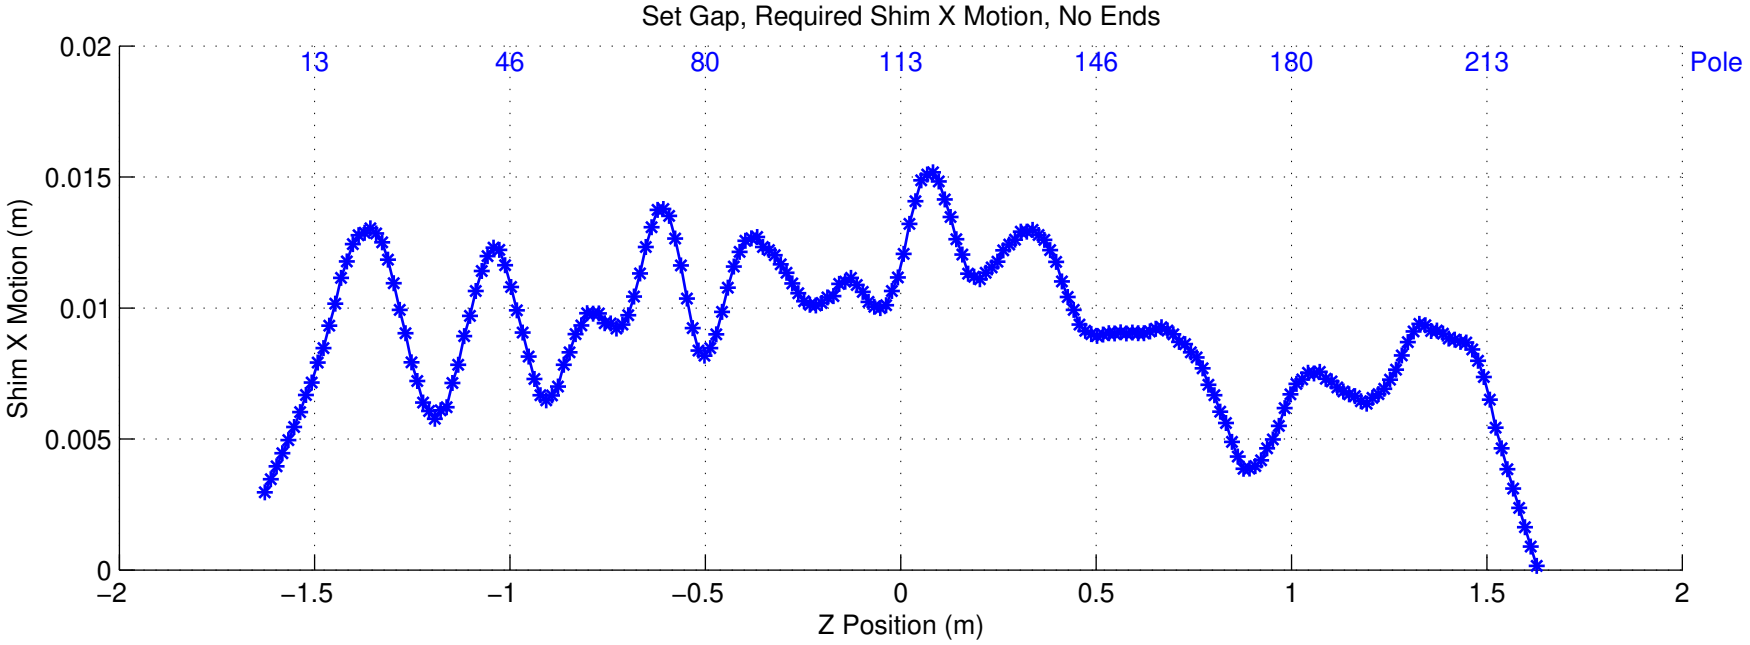
Set Gap, Required Shim X Motion, No Ends
Shim X Motion (m)
13
46
80
113
146
180
213
Pole
0.02
0.015
0.01
0.005
0
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

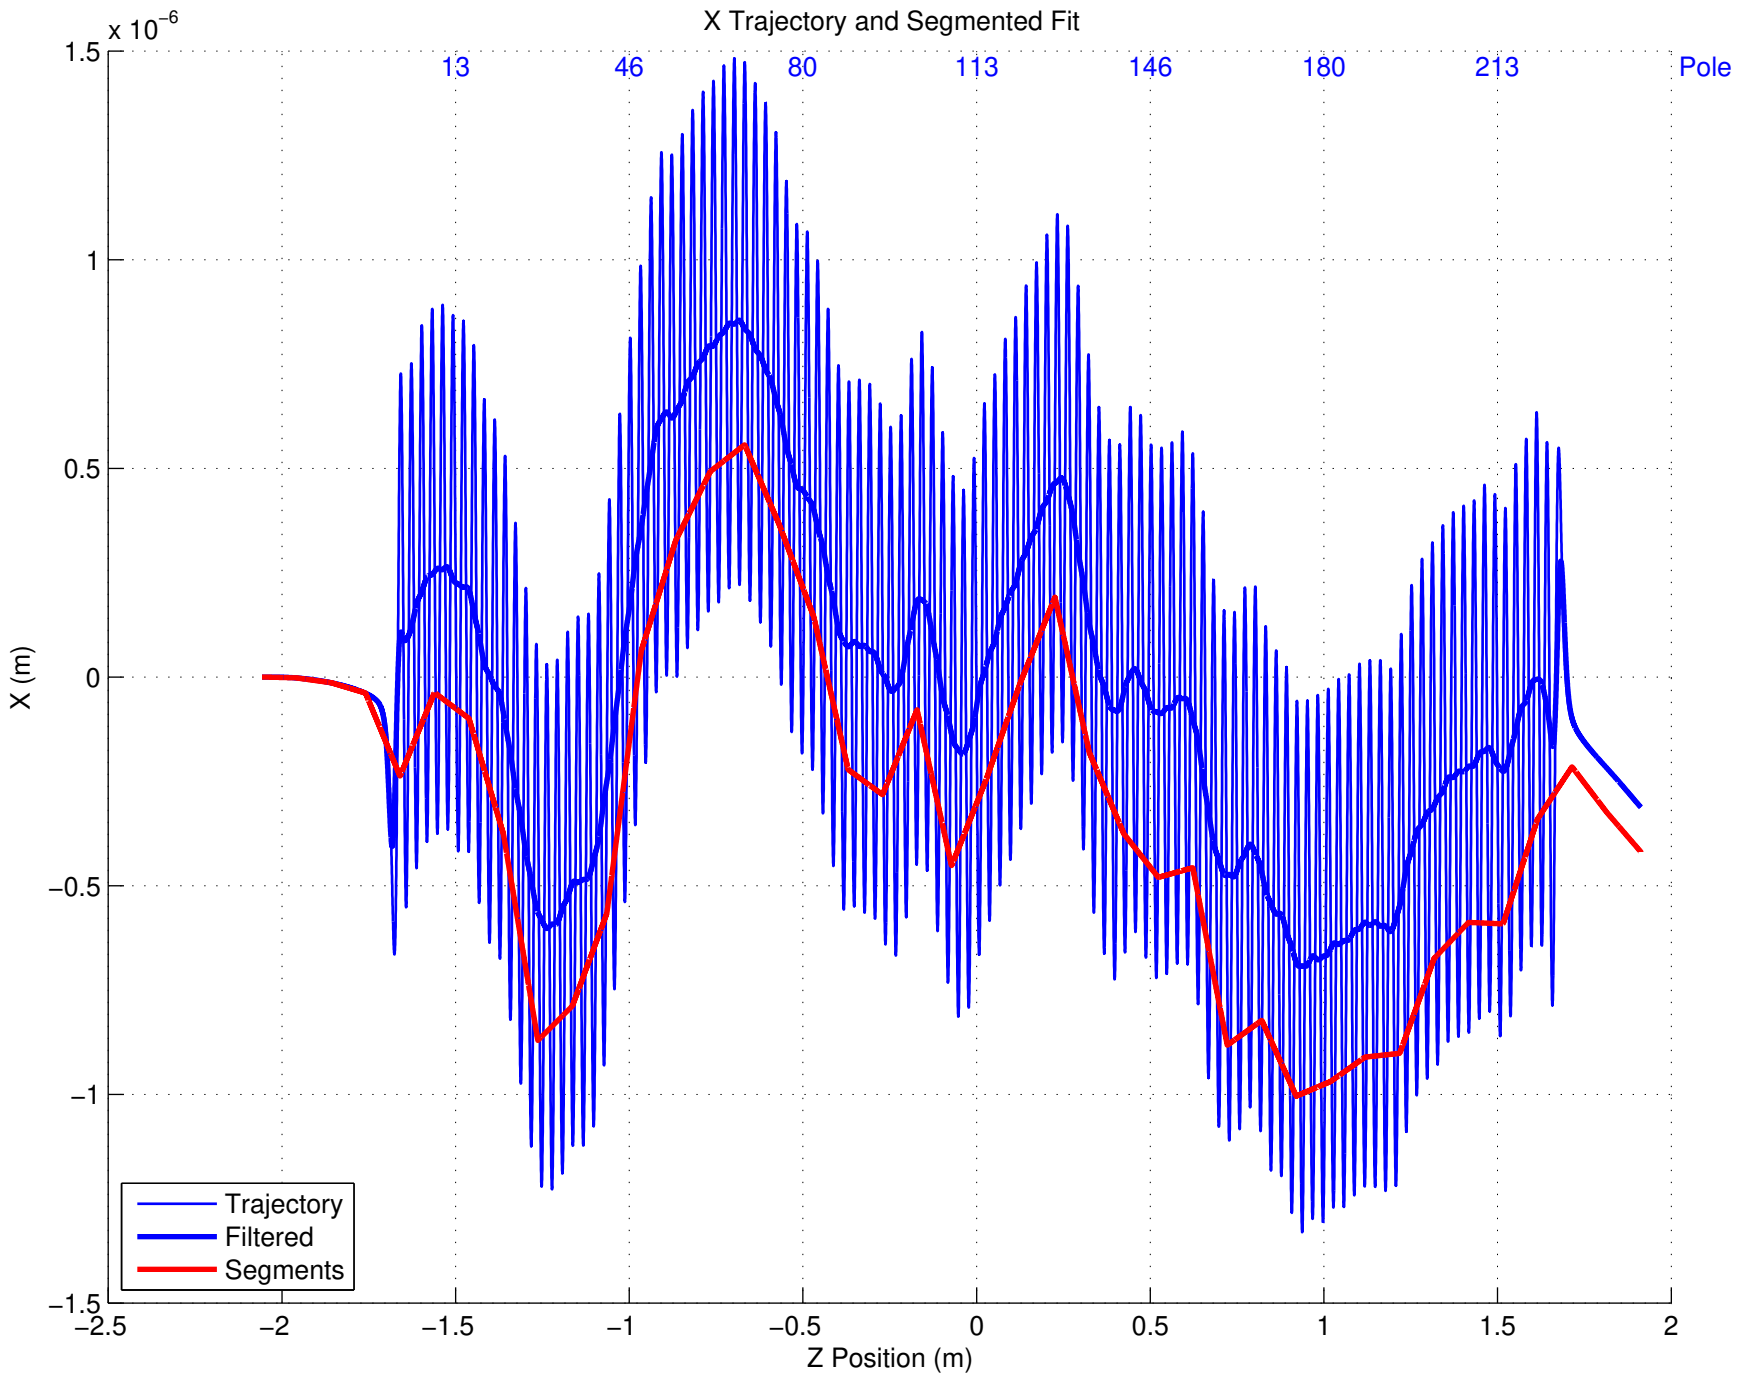
X Trajectory and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
1.5
1
0.5
0
−0.5
−1
−1.5
X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

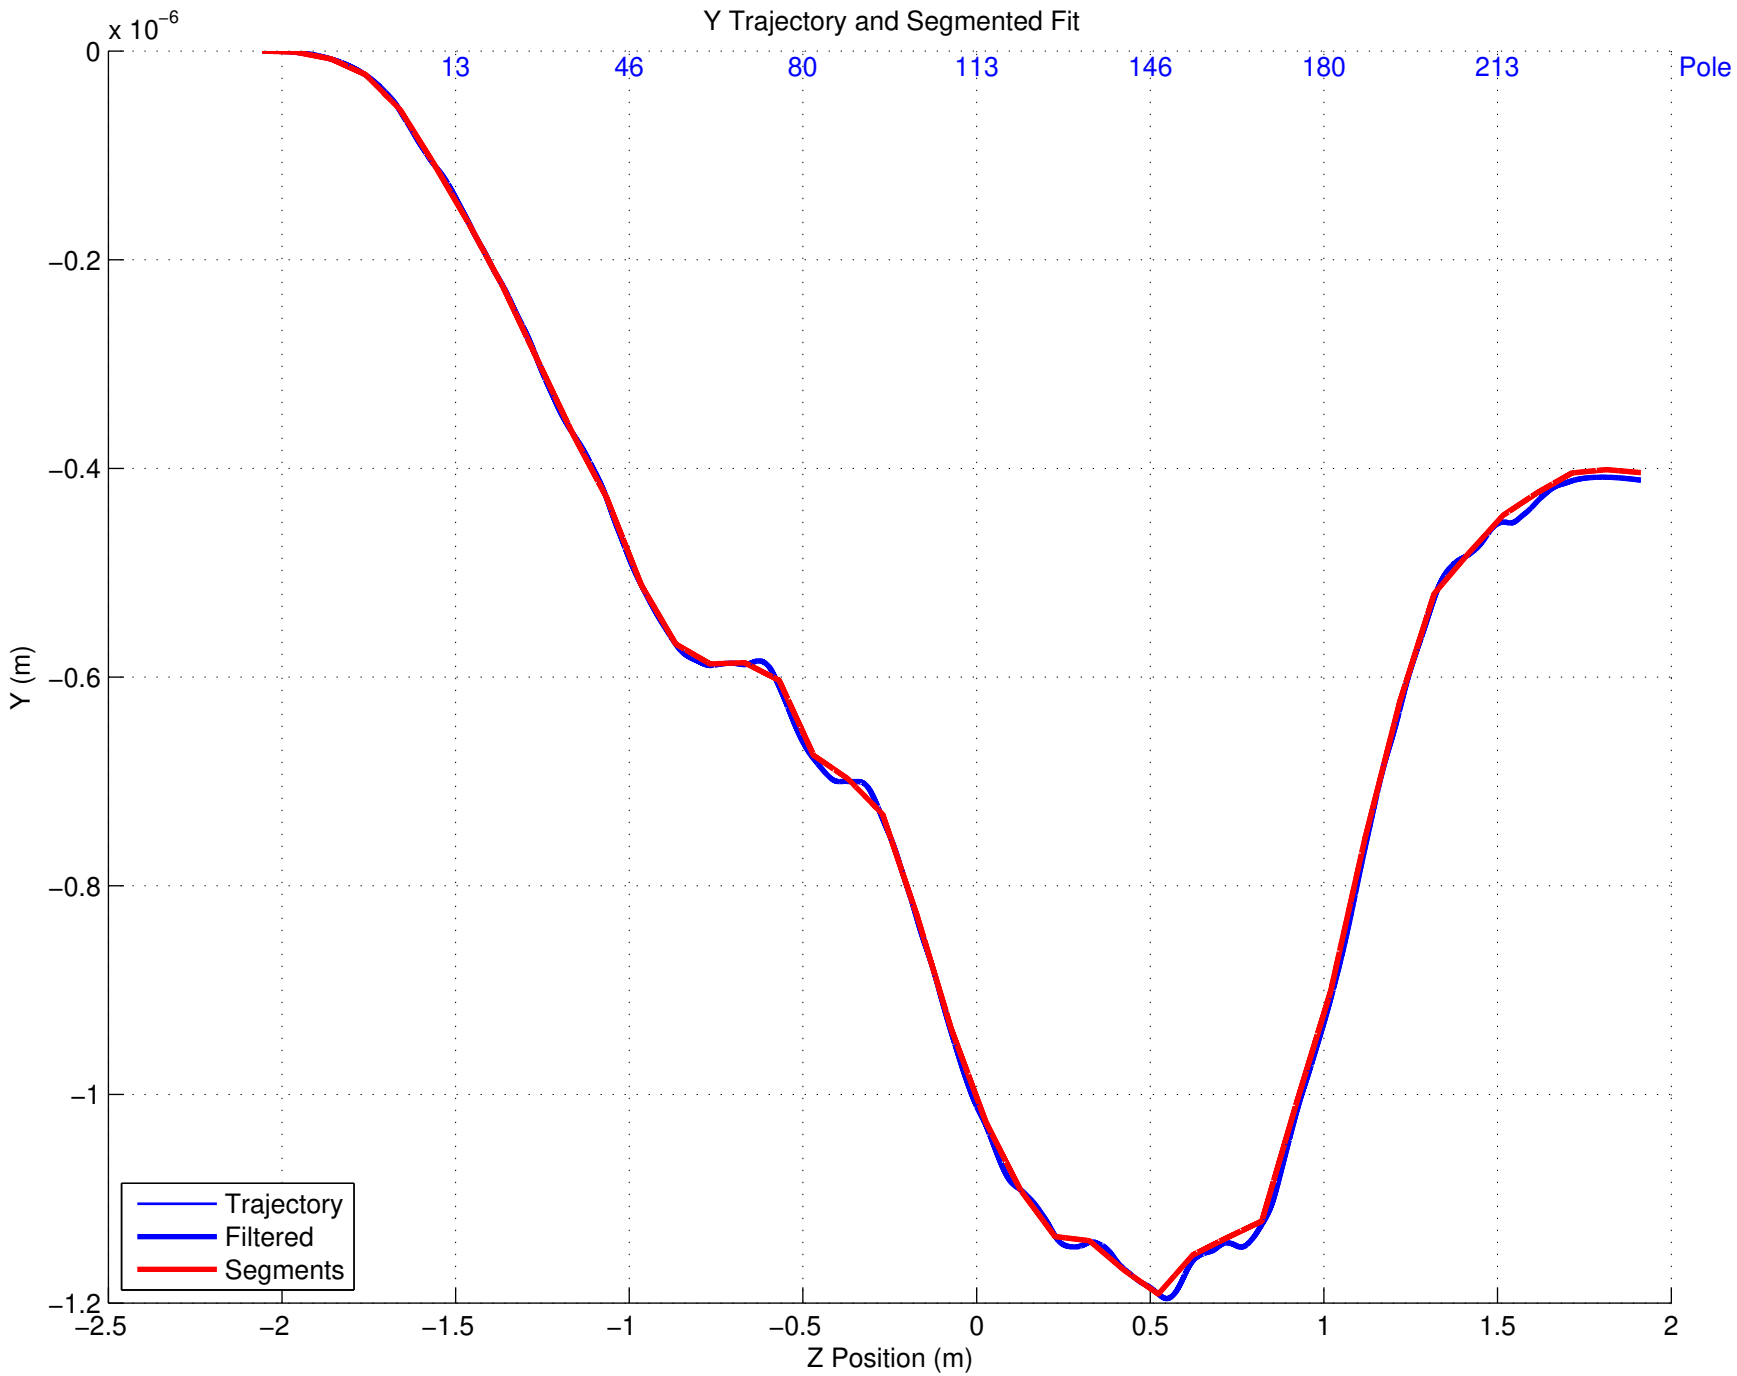
Y Trajectory and Segmented Fit
x 10^-6
0
−0.2
−0.4
−0.6
−0.8
−1
−1.2
Y (m)
13
46
80
113
146
180
213
Pole
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

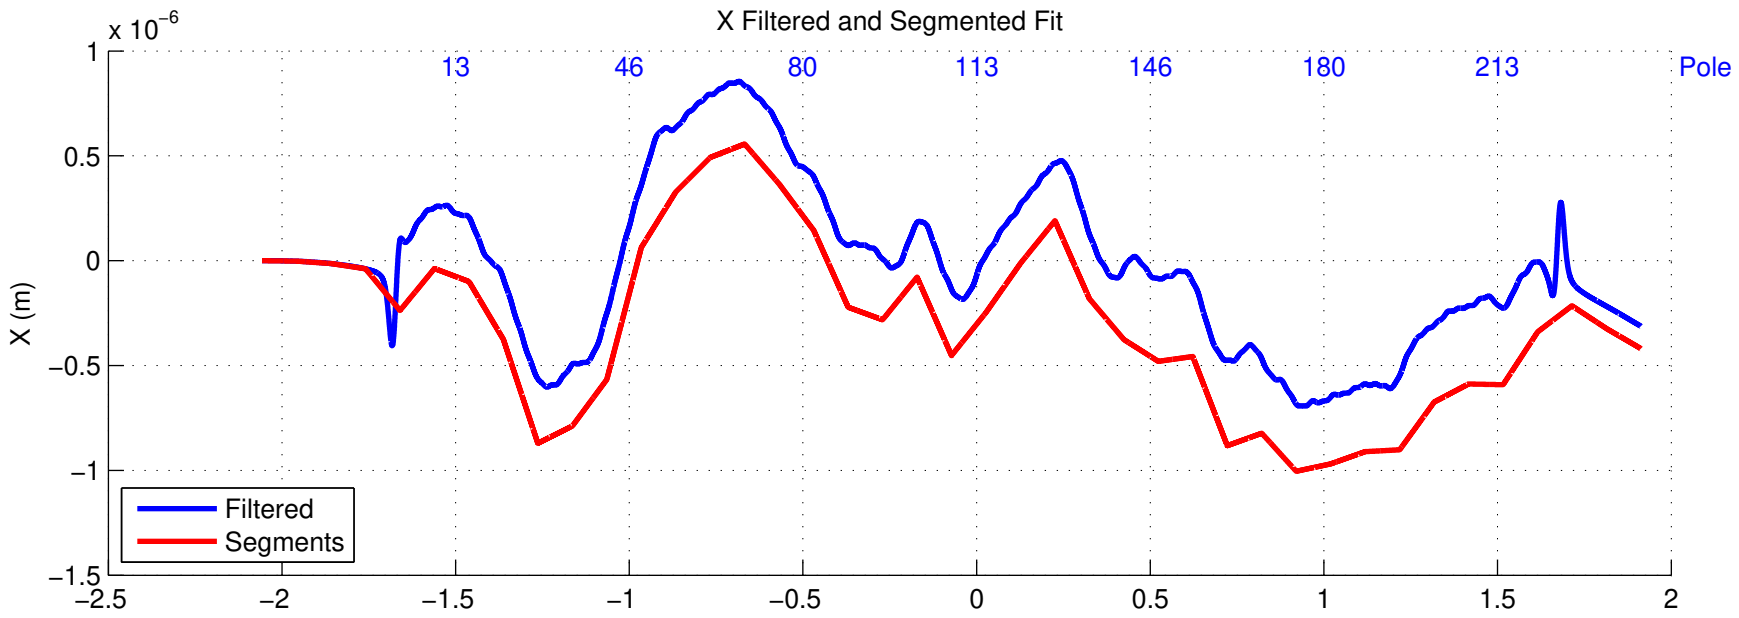
X Filtered and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
X (m)
Filtered
Segments

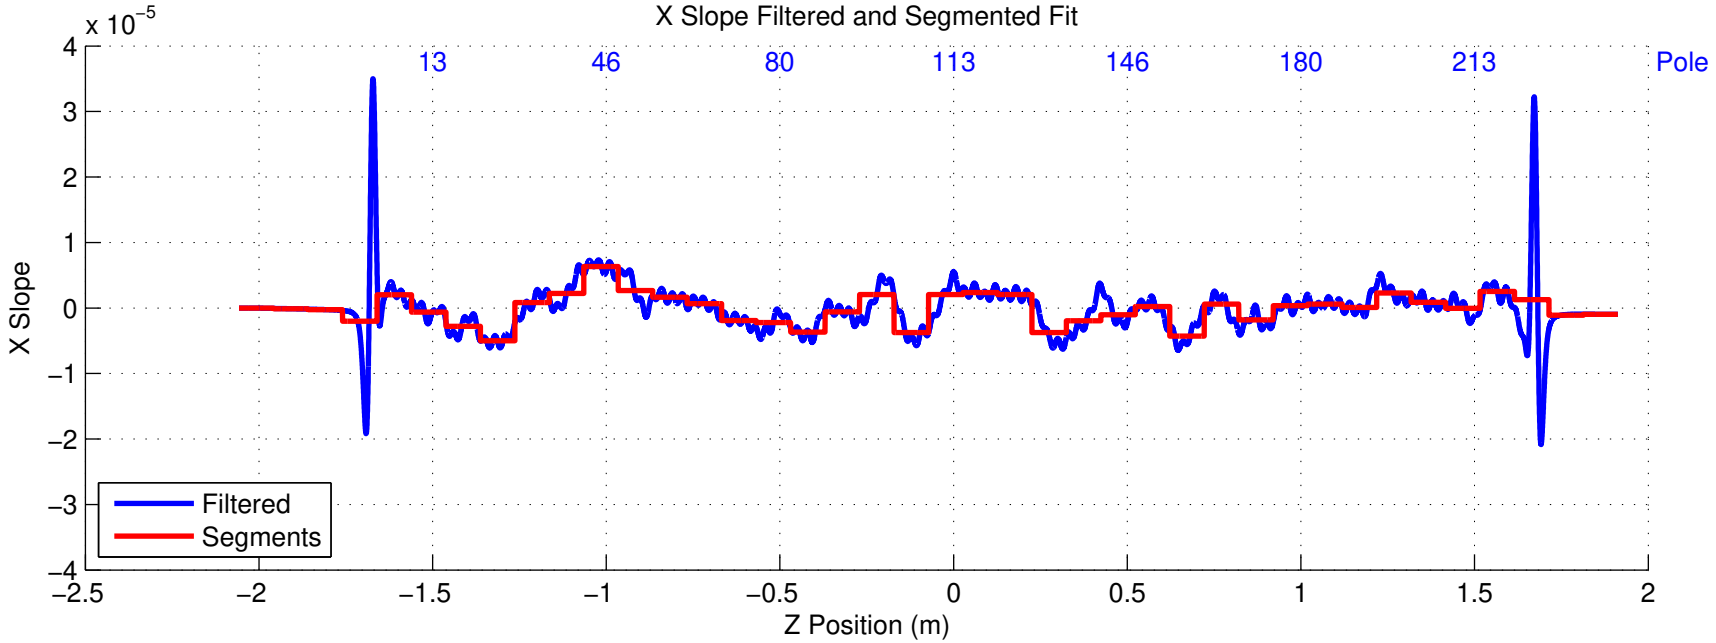
X Slope Filtered and Segmented Fit
x 10^-5
13
46
80
113
146
180
213
Pole
X Slope
Filtered
Segments
Z Position (m)

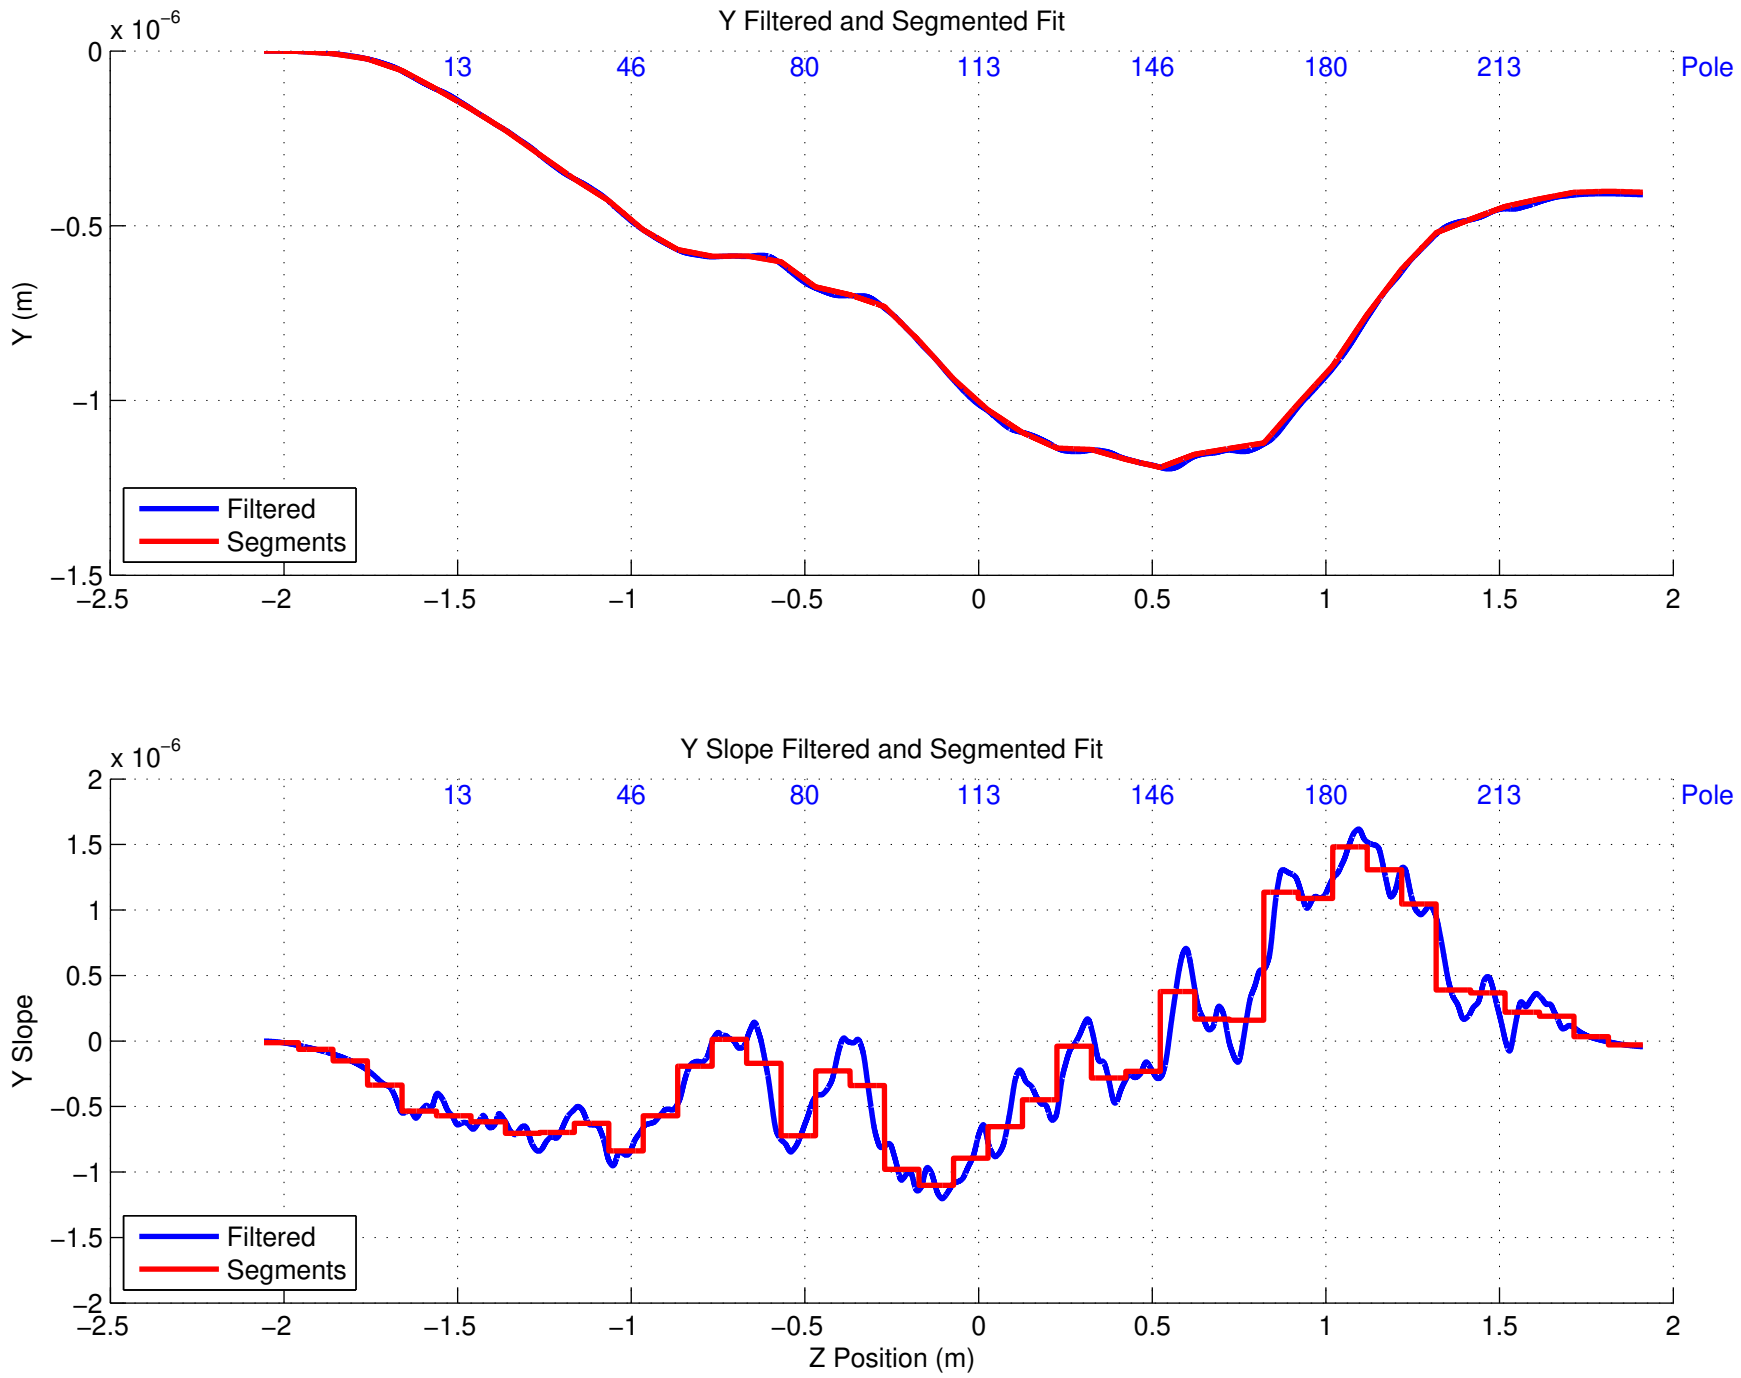
Y Filtered and Segmented Fit
x 10^-6
0
−0.5
−1
−1.5
Y (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Y Slope Filtered and Segmented Fit
x 10^-6
2
1.5
1
0.5
0
−0.5
−1
−1.5
−2
Y Slope
Z Position (m)

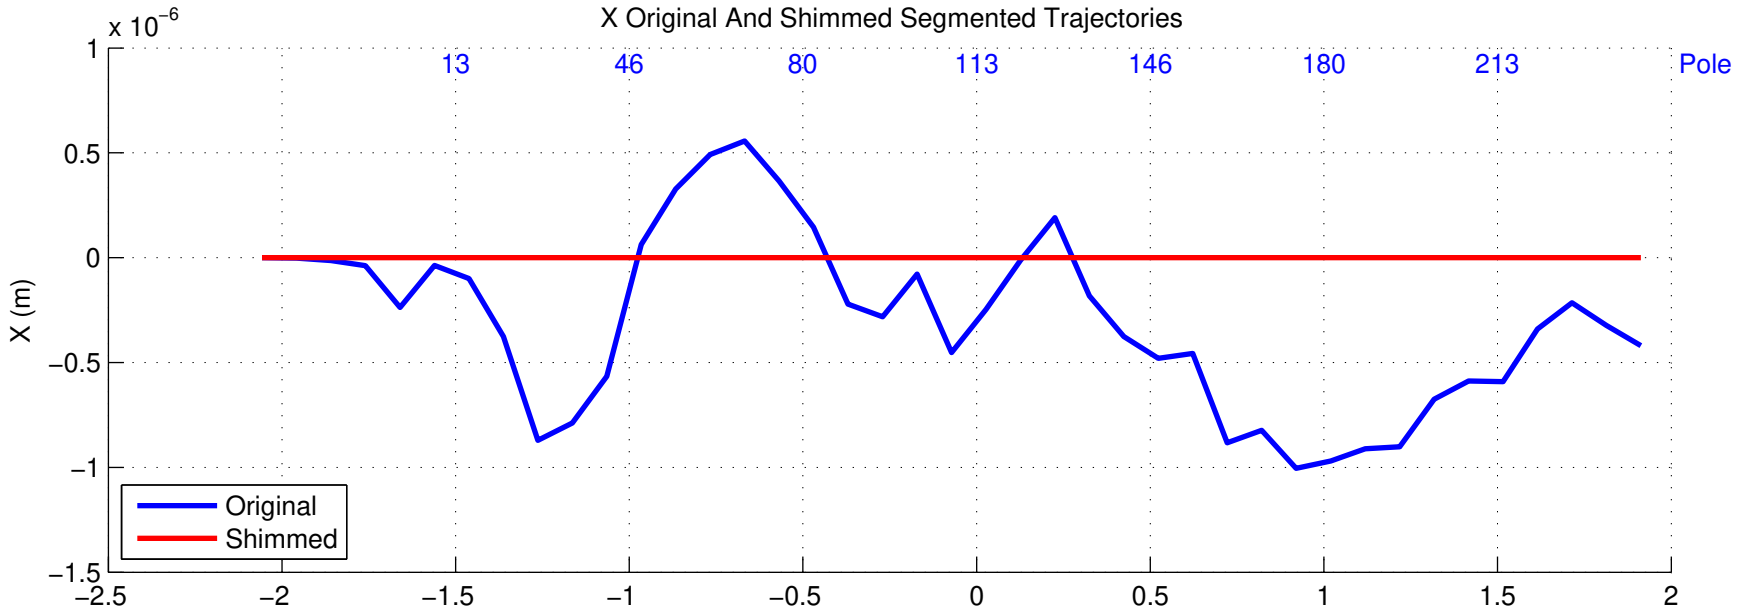
X Original And Shimmed Segmented Trajectories
x 10^-6
13
46
80
113
146
180
213
Pole
X (m)
Original
Shimmed

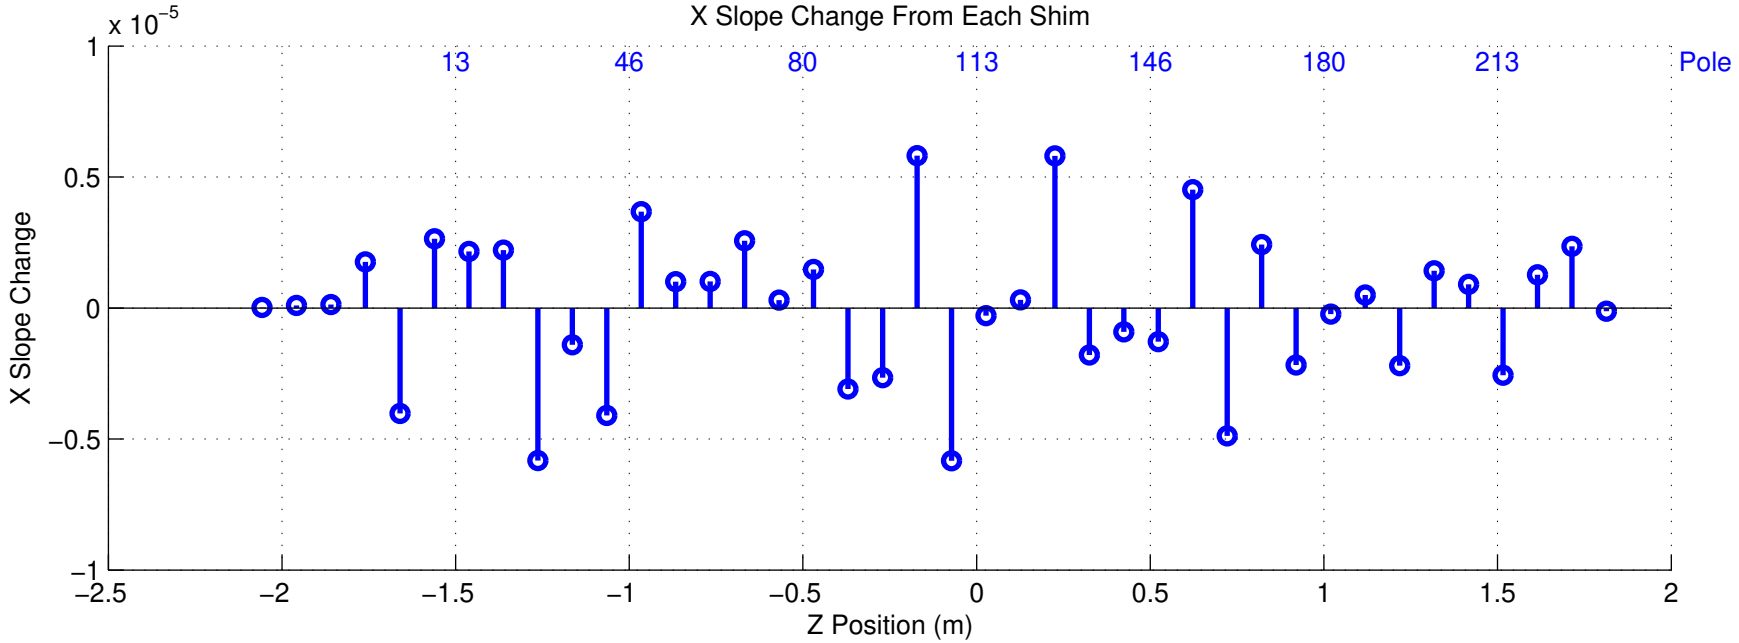
X Slope Change From Each Shim
x 10^-5
13
46
80
113
146
180
213
Pole
X Slope Change
Z Position (m)

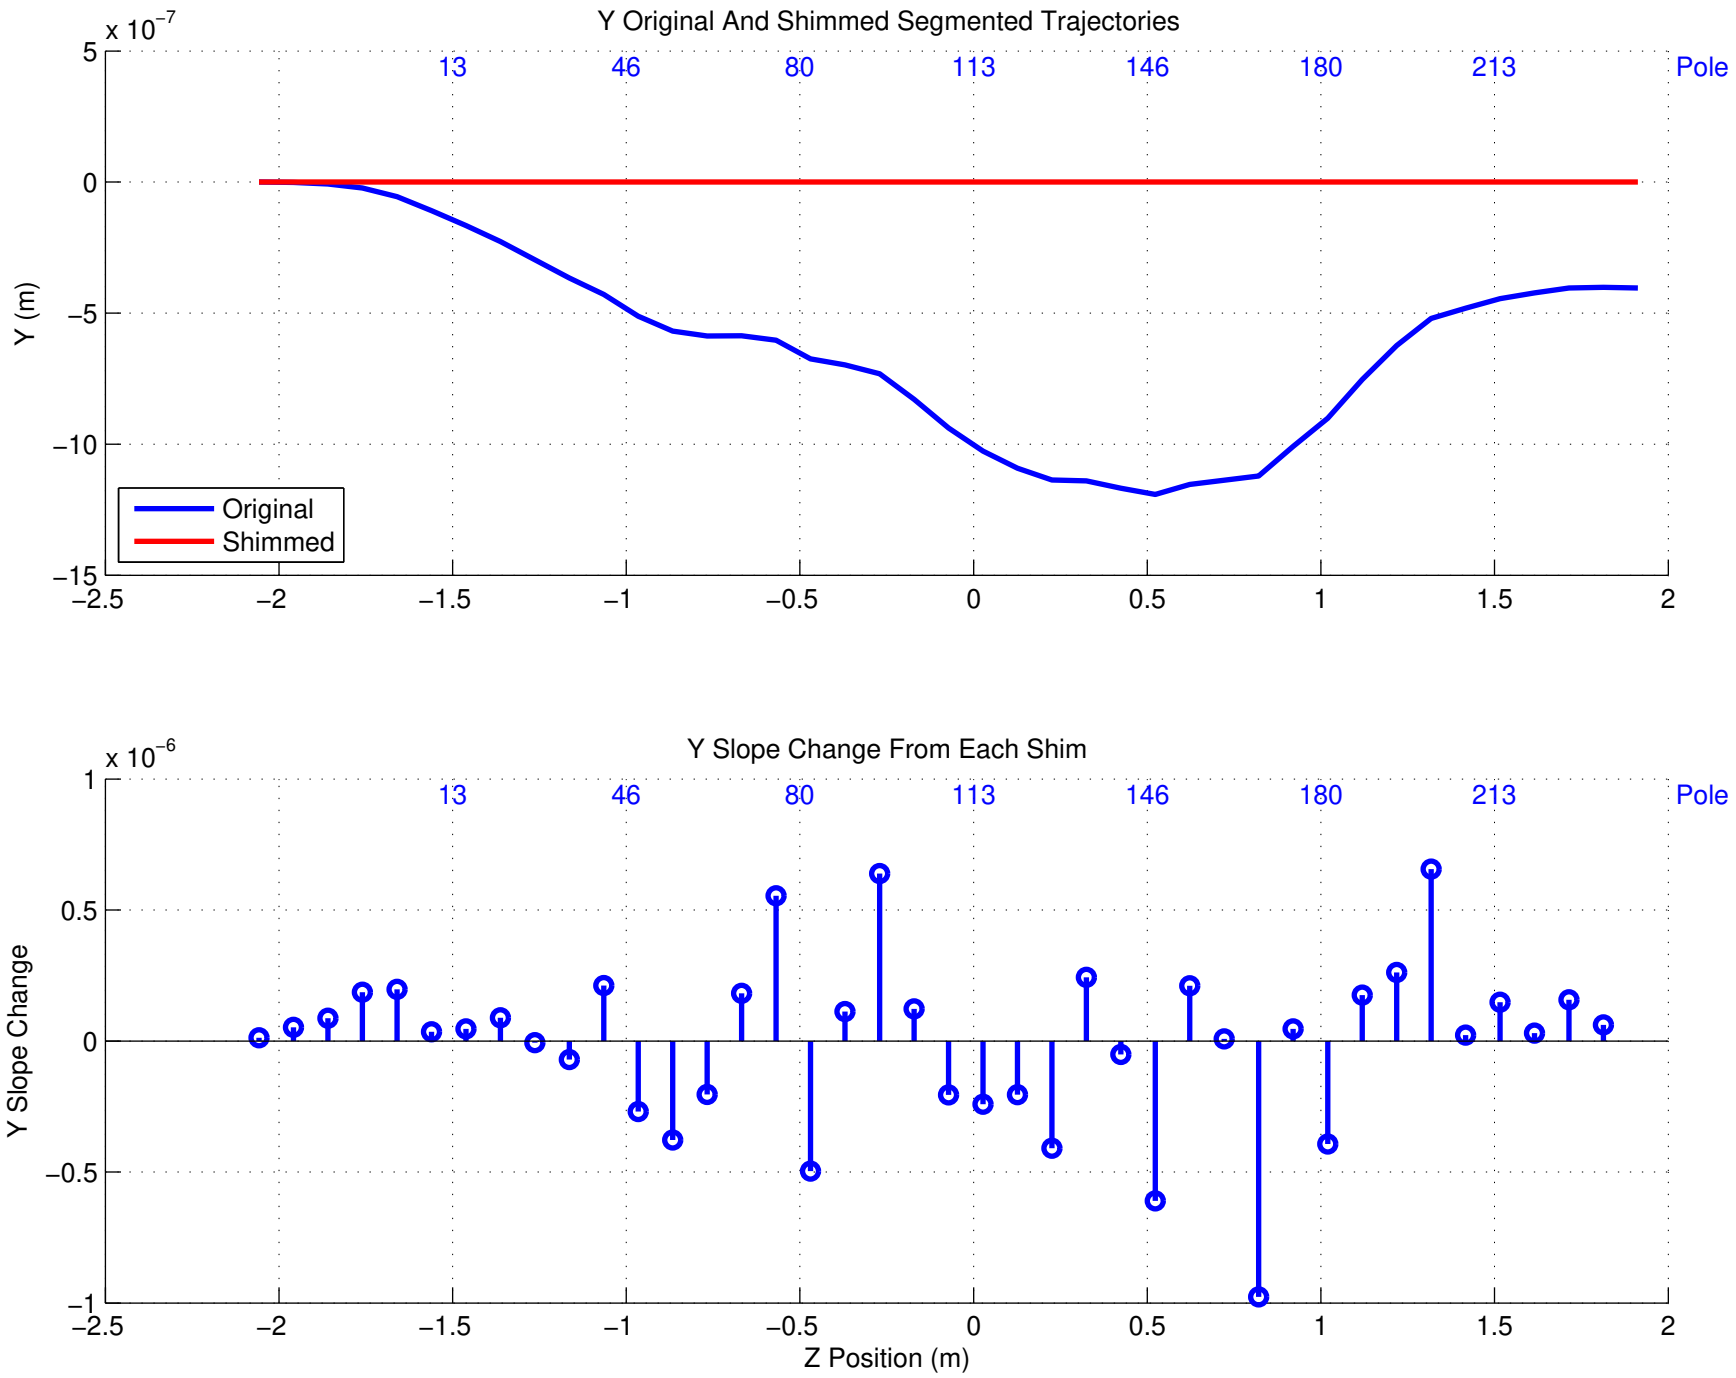
Y Original And Shimmed Segmented Trajectories
x 10^-7
5
0
−5
−10
−15
Y (m)
13
46
80
113
146
180
213
Pole
Original
Shimmed
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Y Slope Change From Each Shim
x 10^-6
1
0.5
0
−0.5
−1
Y Slope Change
Z Position (m)

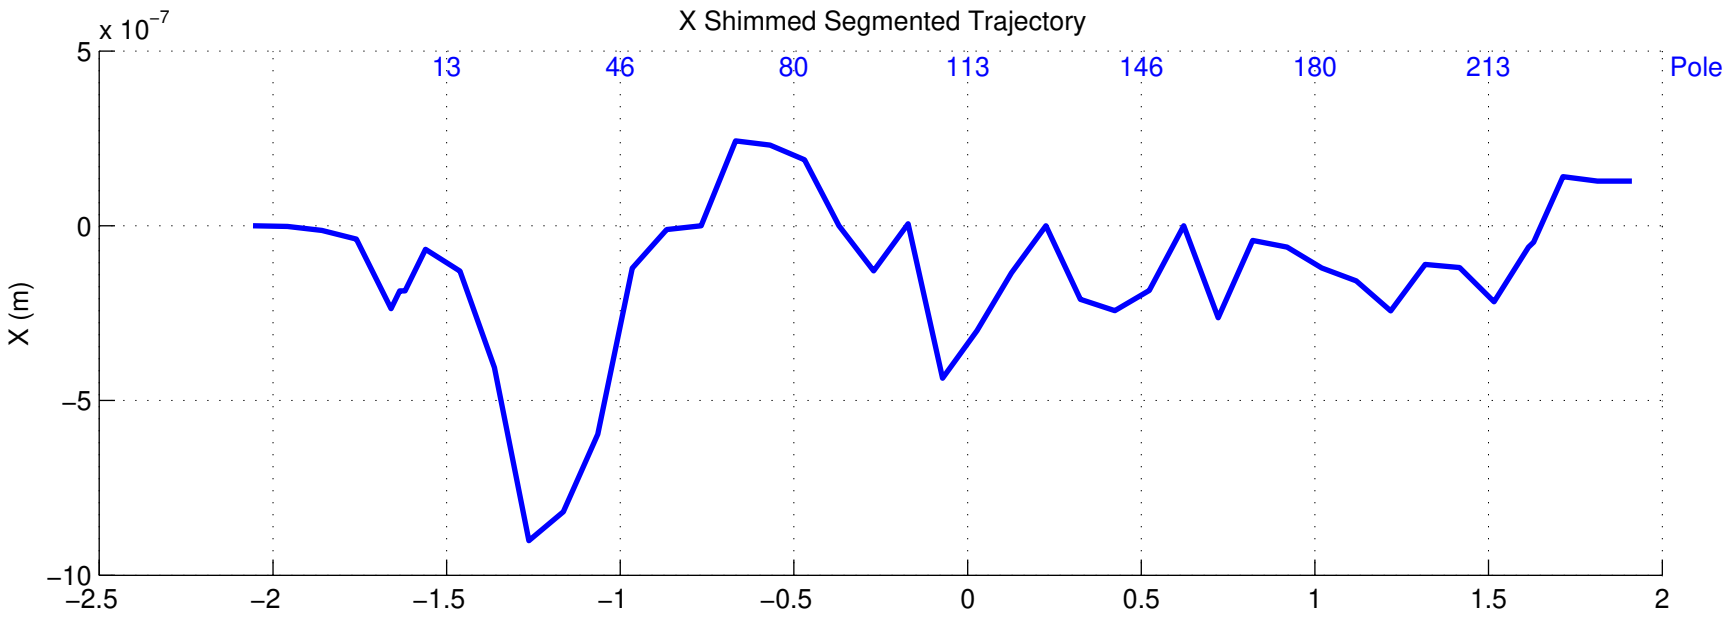
X Shimmed Segmented Trajectory
x 10^-7
X (m)
13
46
80
113
146
180
213
Pole
5
0
−5
−10
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

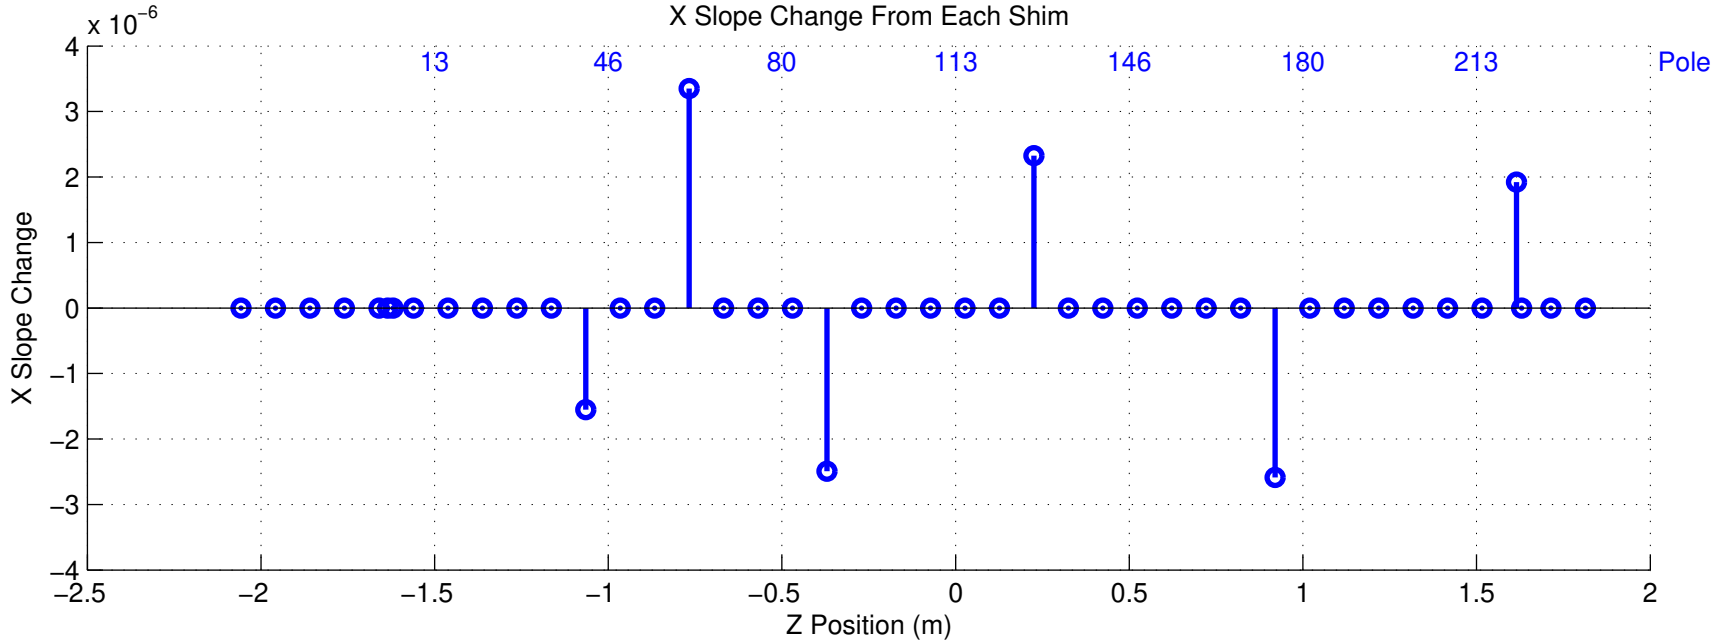
X Slope Change From Each Shim
x 10^-6
X Slope Change
13
46
80
113
146
180
213
Pole
4
3
2
1
0
−1
−2
−3
−4
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

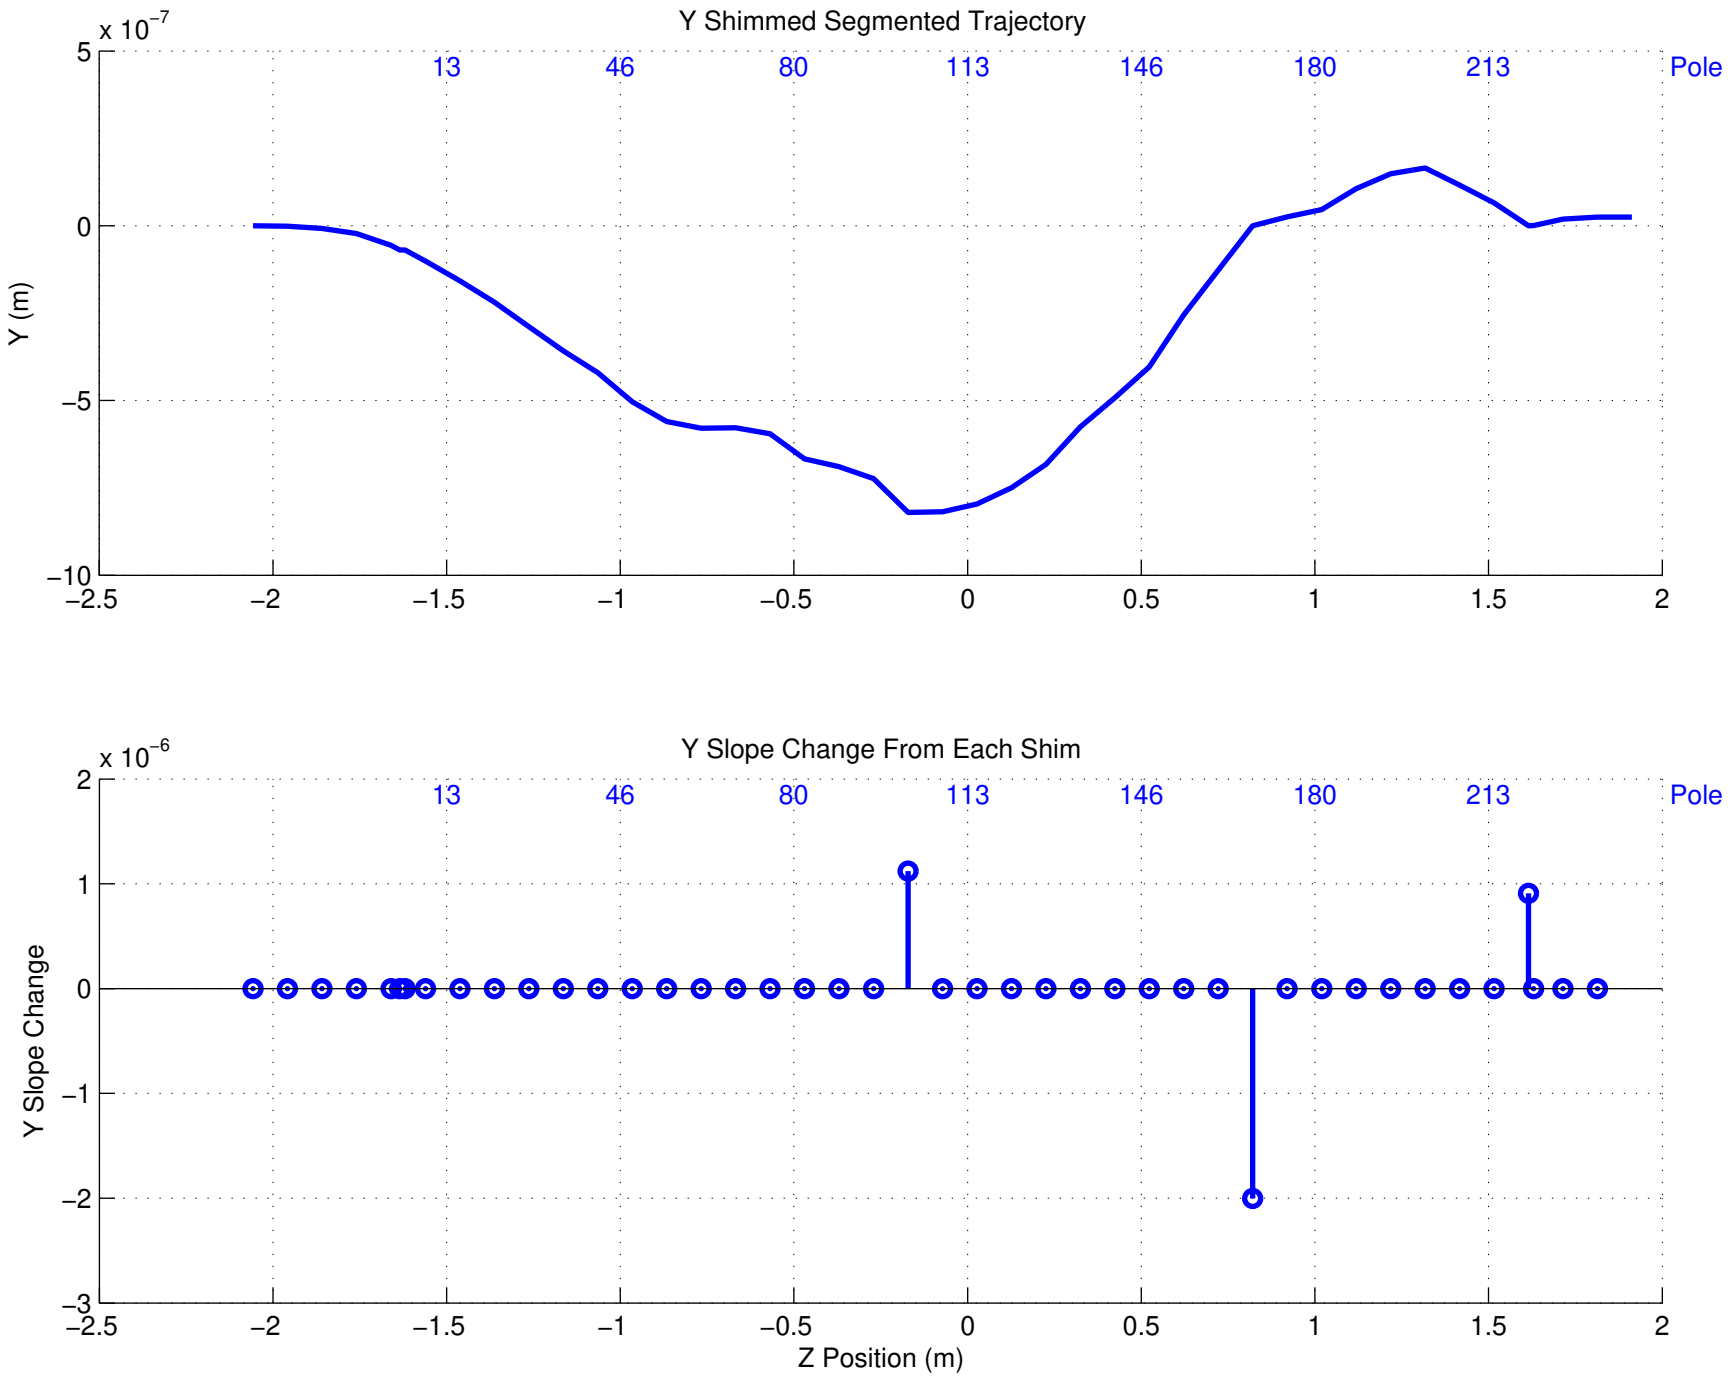
Y Shimmed Segmented Trajectory
x 10^-7
Y (m)
13
46
80
113
146
180
213
Pole
Y Slope Change From Each Shim
x 10^-6
Y Slope Change
Z Position (m)

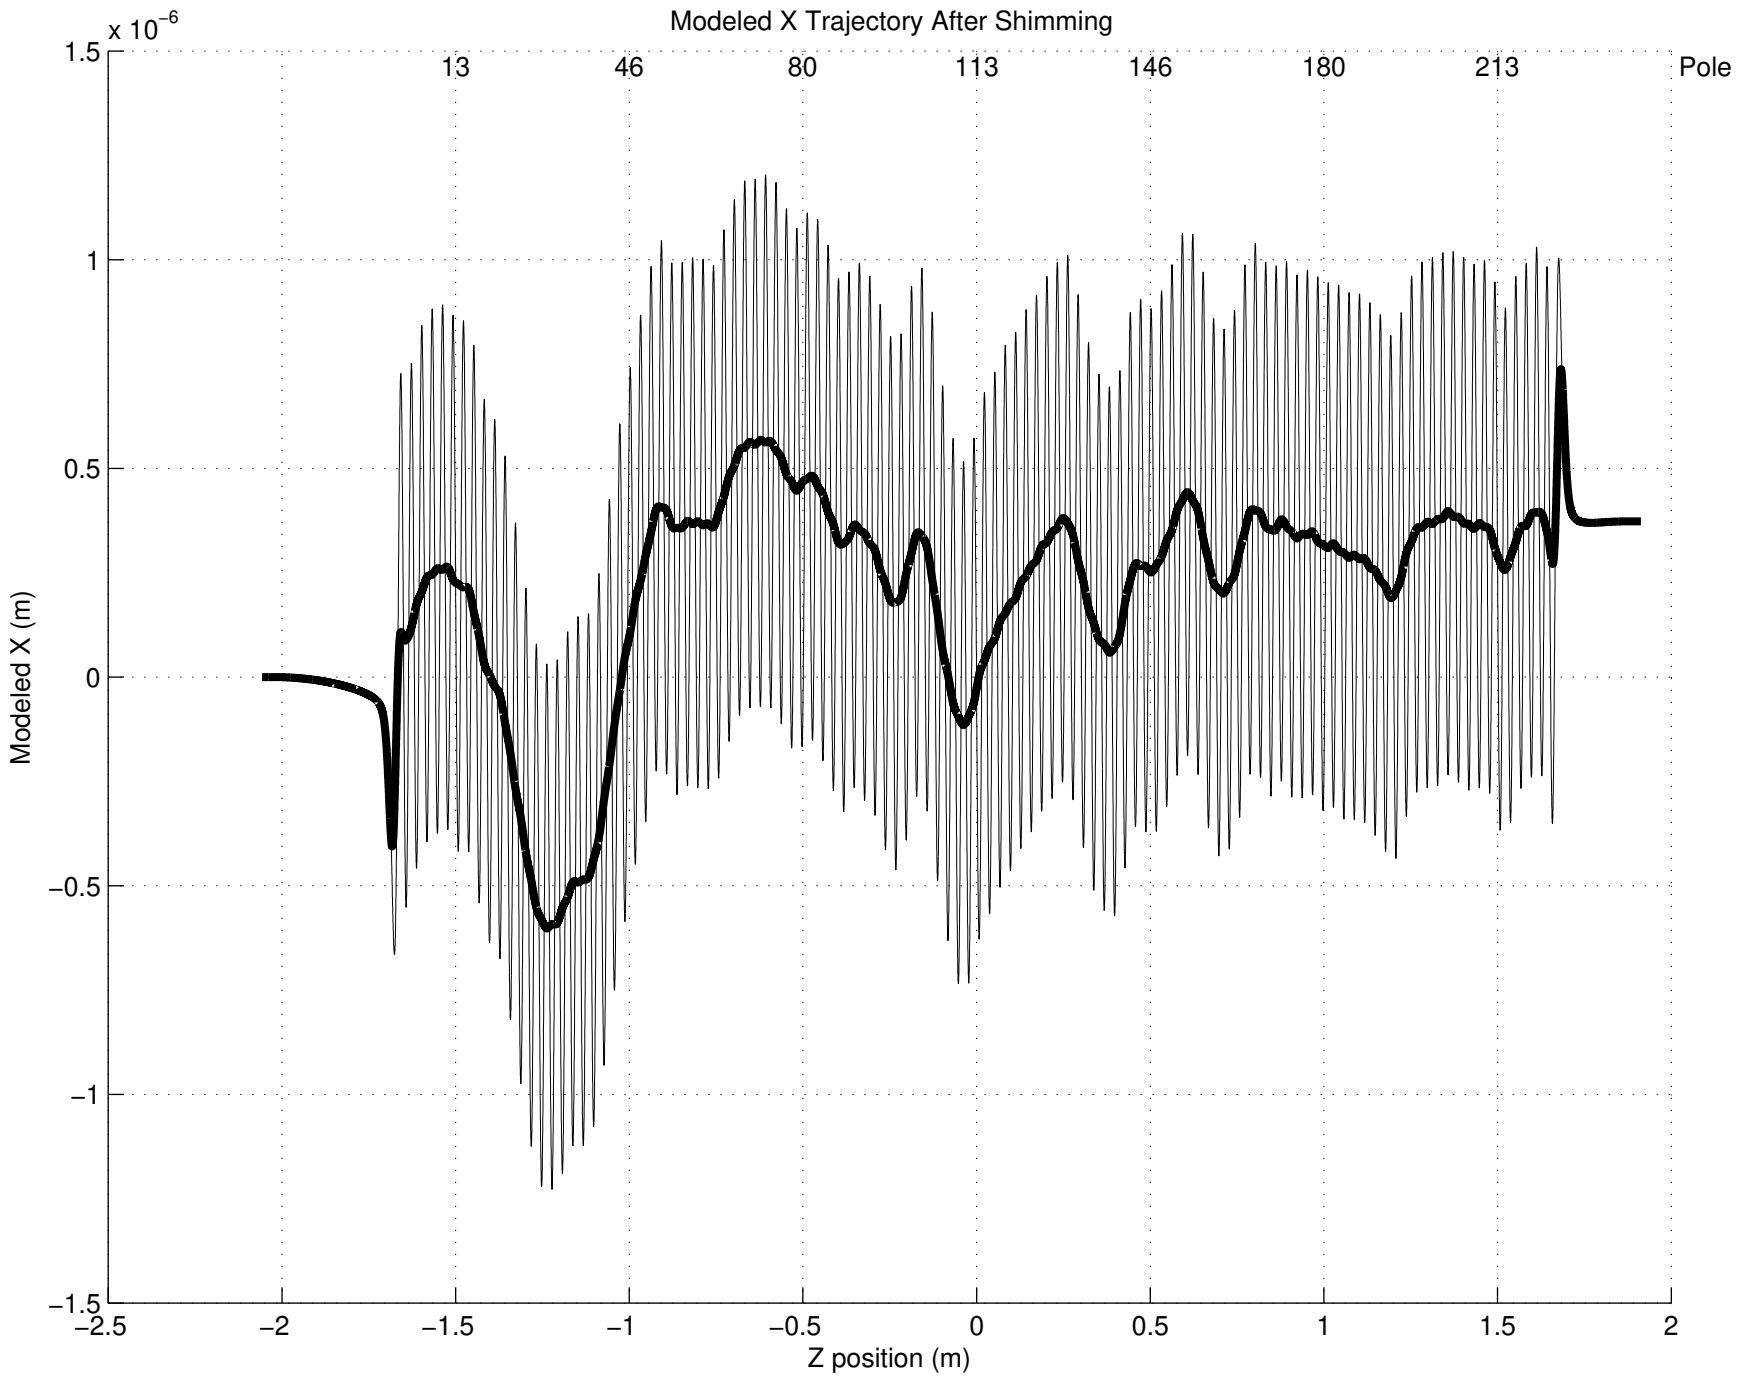
Modeled X Trajectory After Shimming
x 10^-6
1.5
1
0.5
0
−0.5
−1
−1.5
13
46
80
113
146
180
213
Pole
Modeled X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

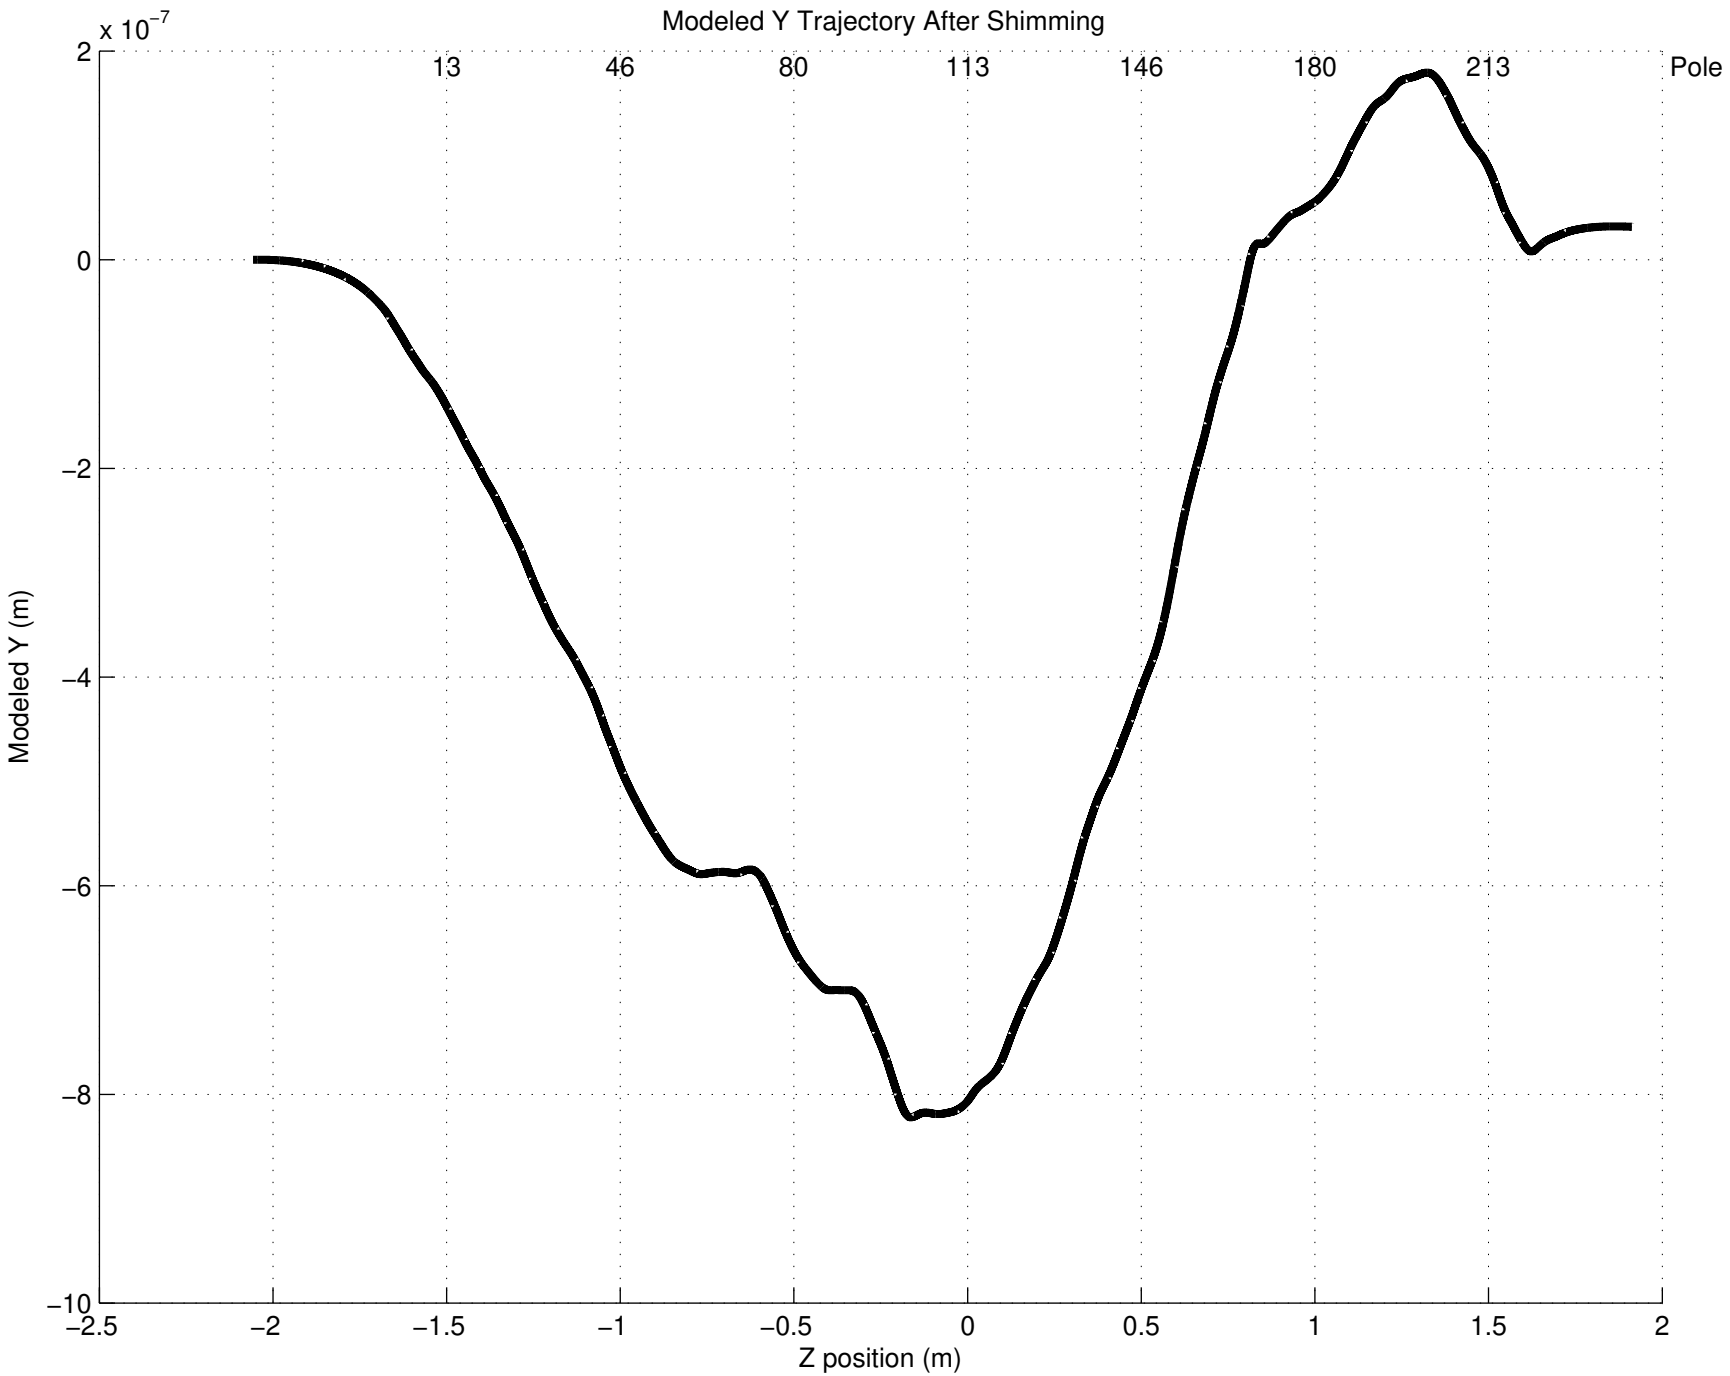
Modeled Y Trajectory After Shimming
x 10^-7
2
0
−2
−4
−6
−8
−10
13
46
80
113
146
180
213
Pole
Modeled Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

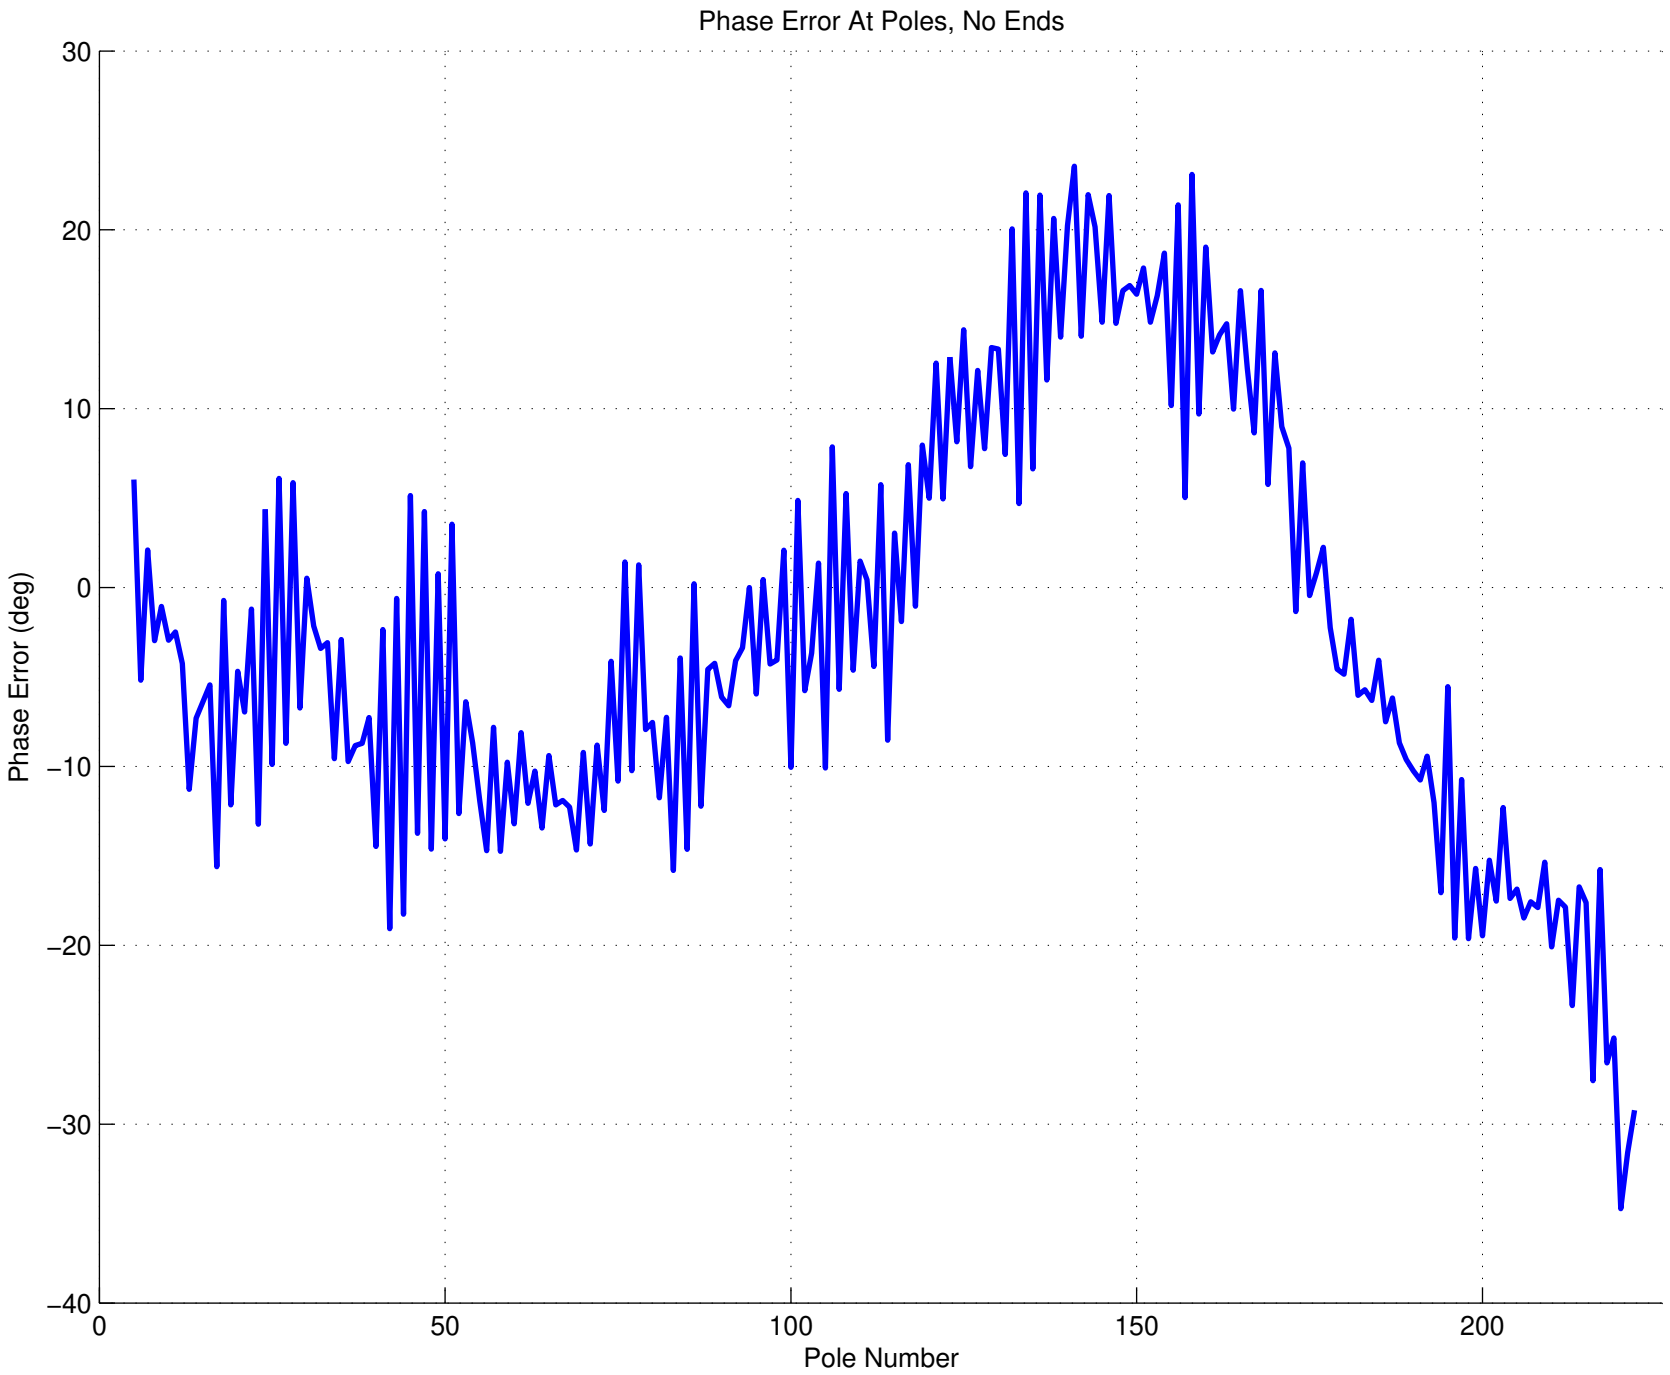
Phase Error At Poles, No Ends
Phase Error (deg)
Pole Number
30
20
10
0
−10
−20
−30
−40
0
50
100
150
200

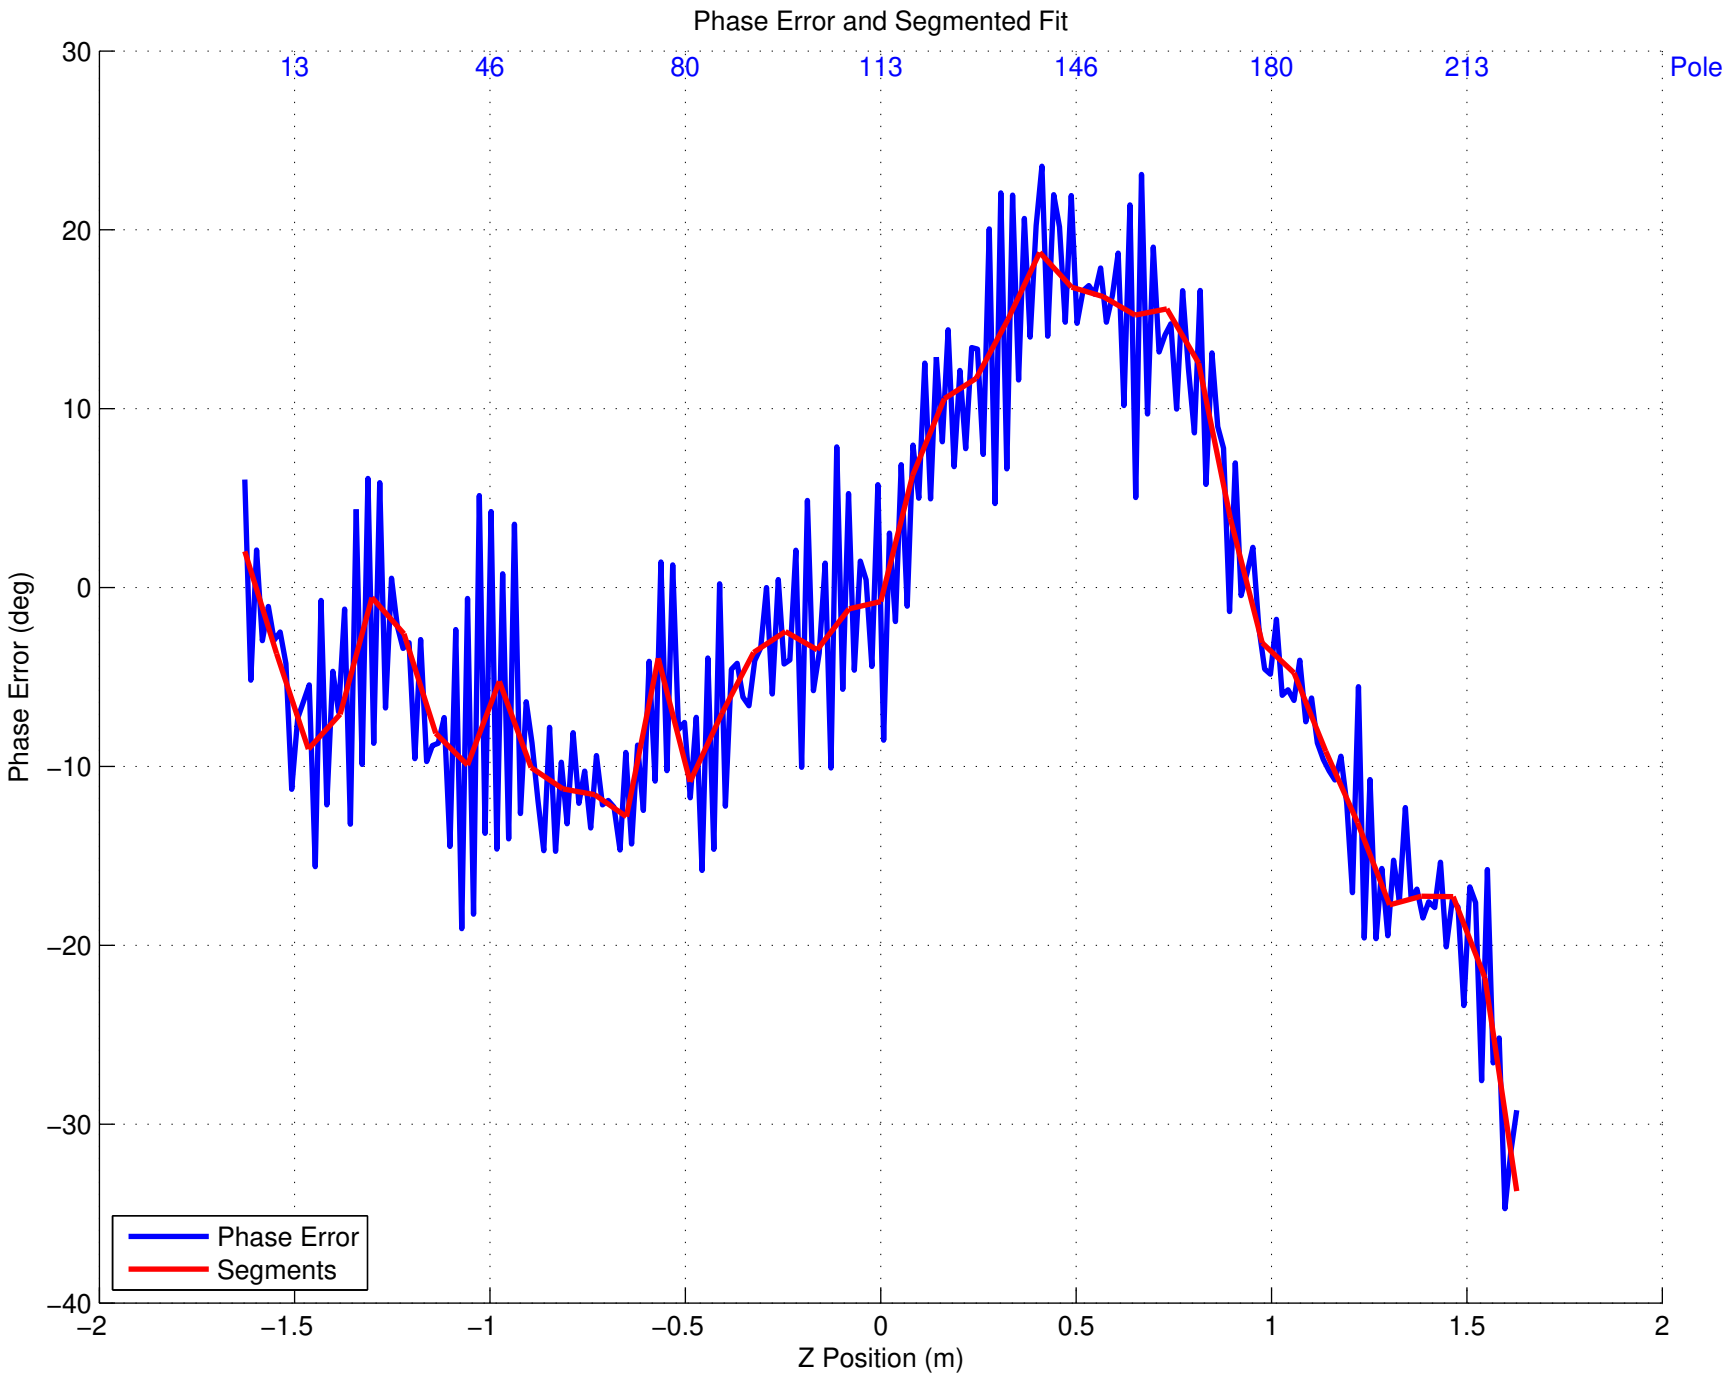
Phase Error and Segmented Fit
13
46
80
113
146
180
213
Pole
30
20
10
0
−10
−20
−30
−40
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Phase Error (deg)
Z Position (m)
Phase Error
Segments

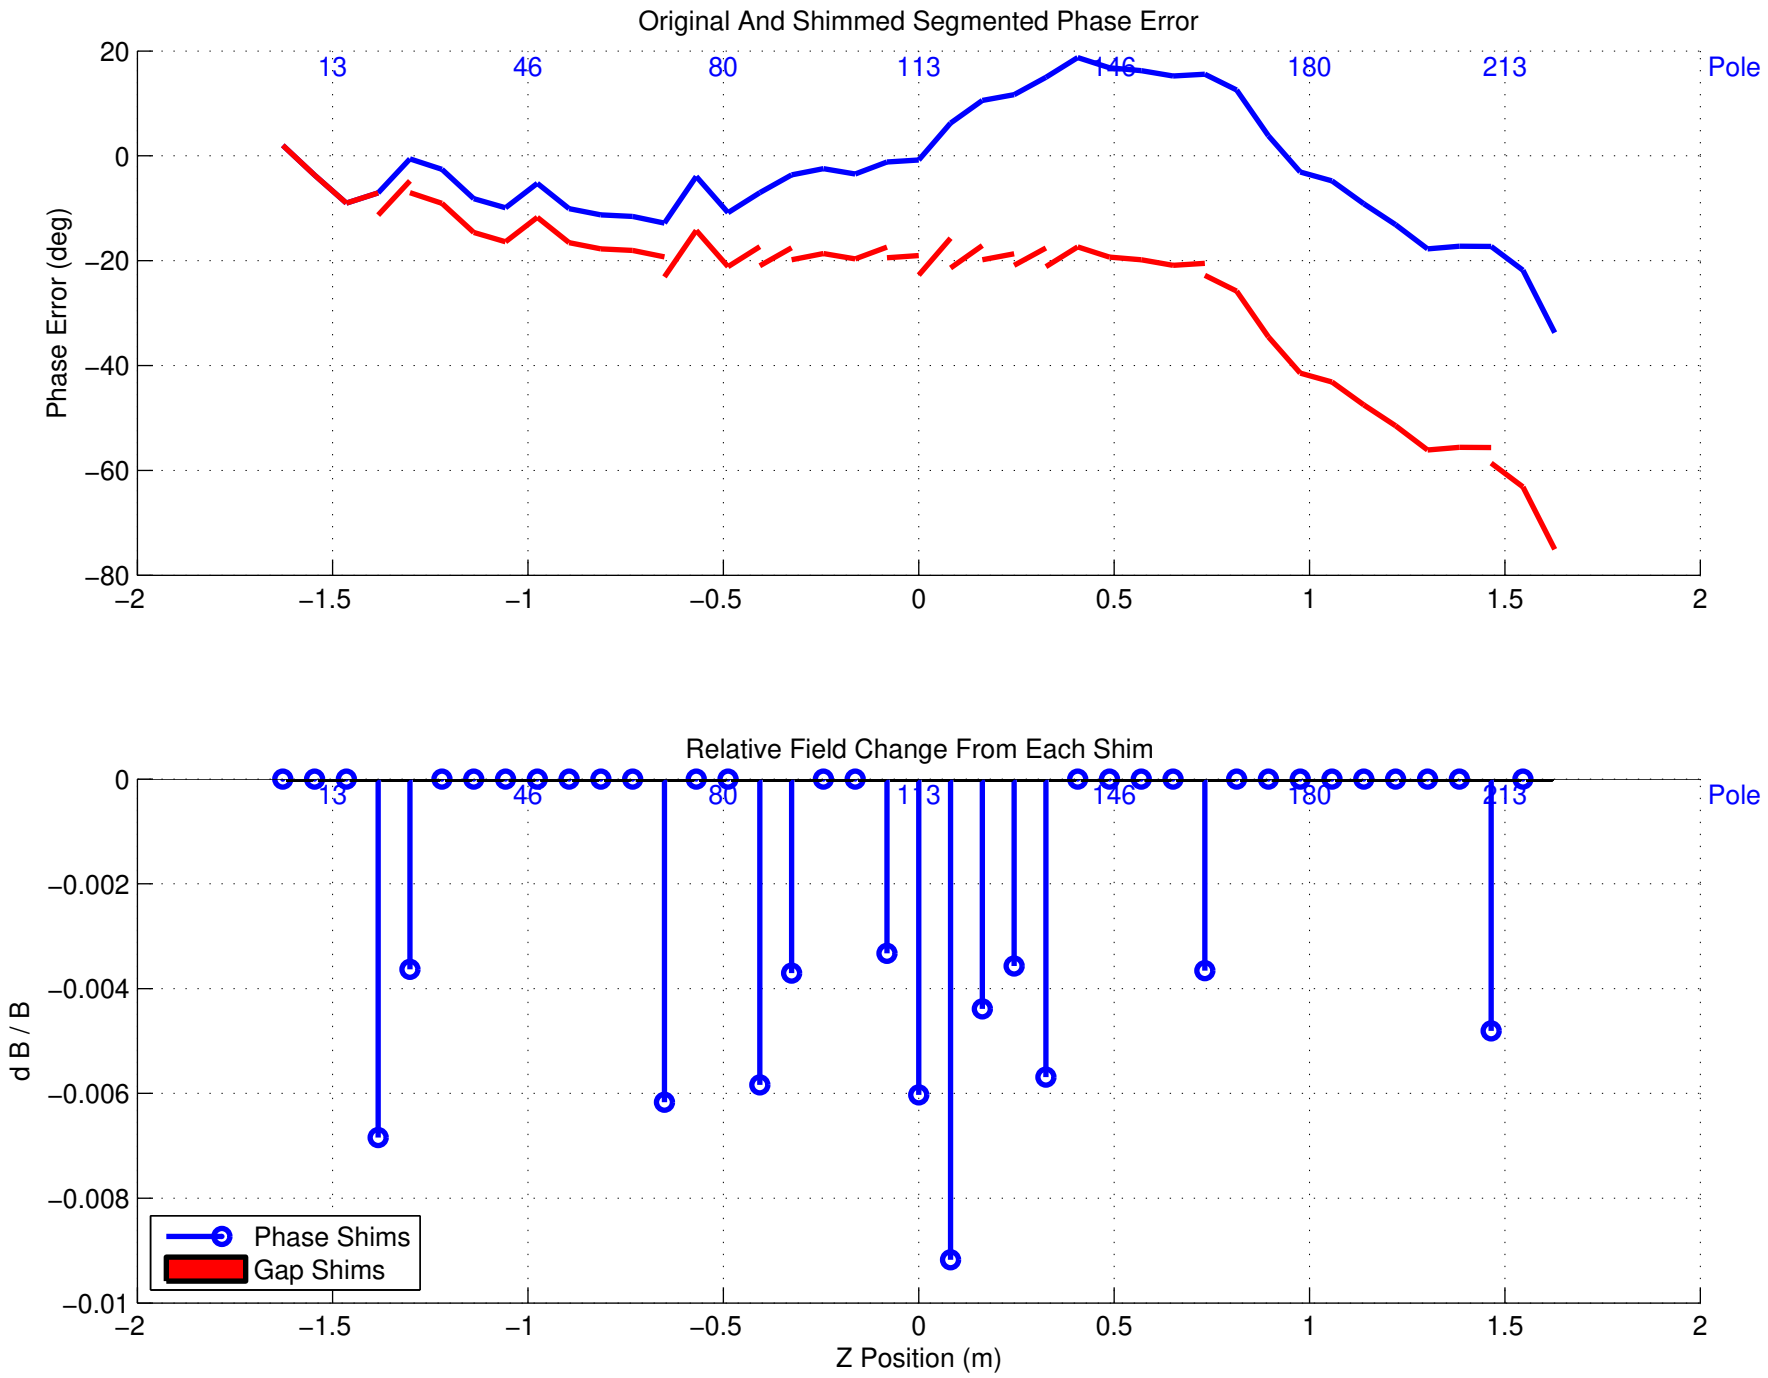
Original And Shimmed Segmented Phase Error
Phase Error (deg)
20
0
−20
−40
−60
−80
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
d B / B
0
−0.002
−0.004
−0.006
−0.008
−0.01
Phase Shims
Gap Shims
Z Position (m)

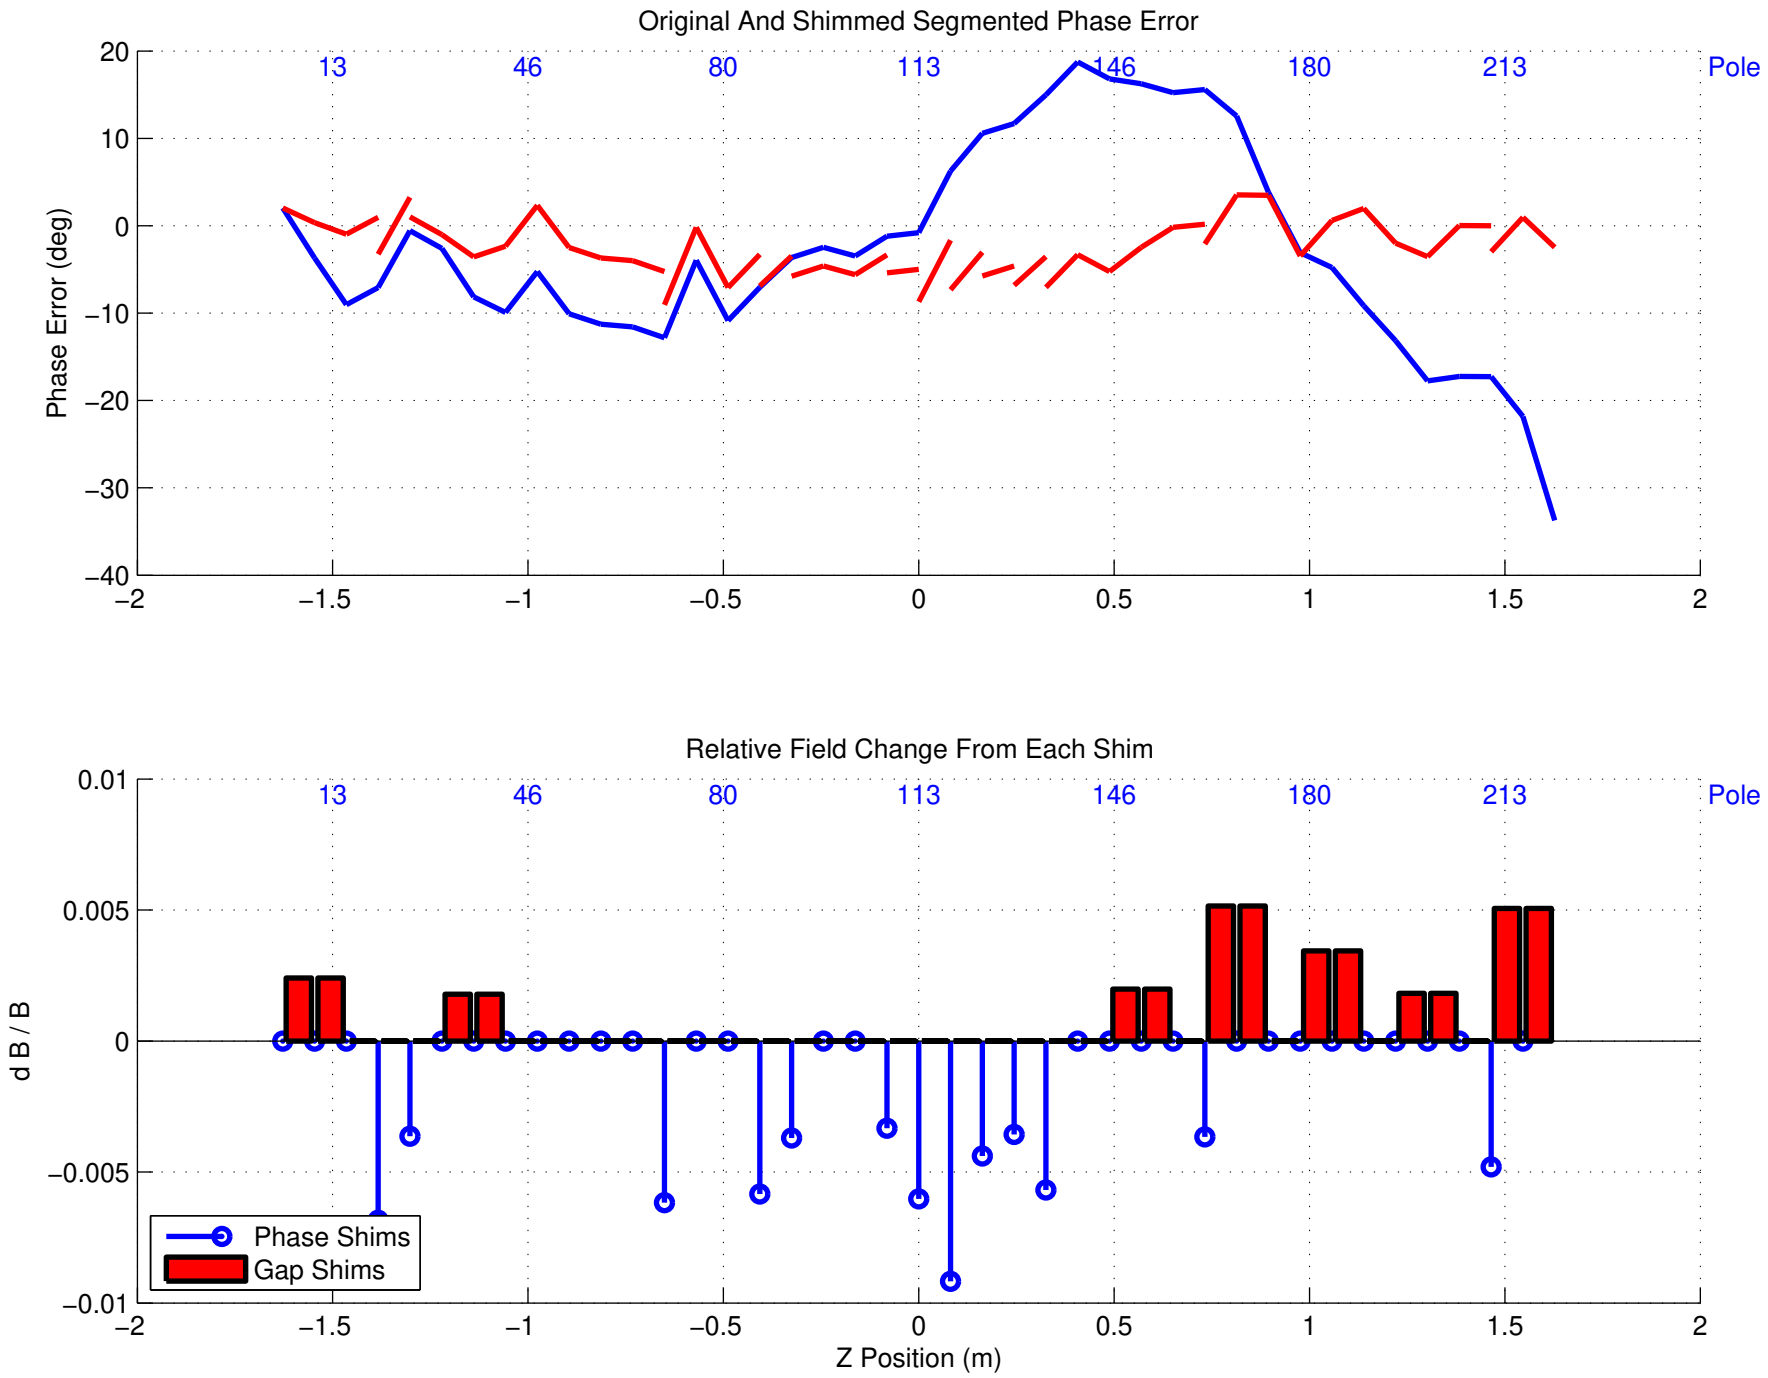
Original And Shimmed Segmented Phase Error
13
46
80
113
146
180
213
Pole
Phase Error (deg)
20
10
0
−10
−20
−30
−40
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
d B / B
0.01
0.005
0
−0.005
−0.01
Phase Shims
Gap Shims
Z Position (m)

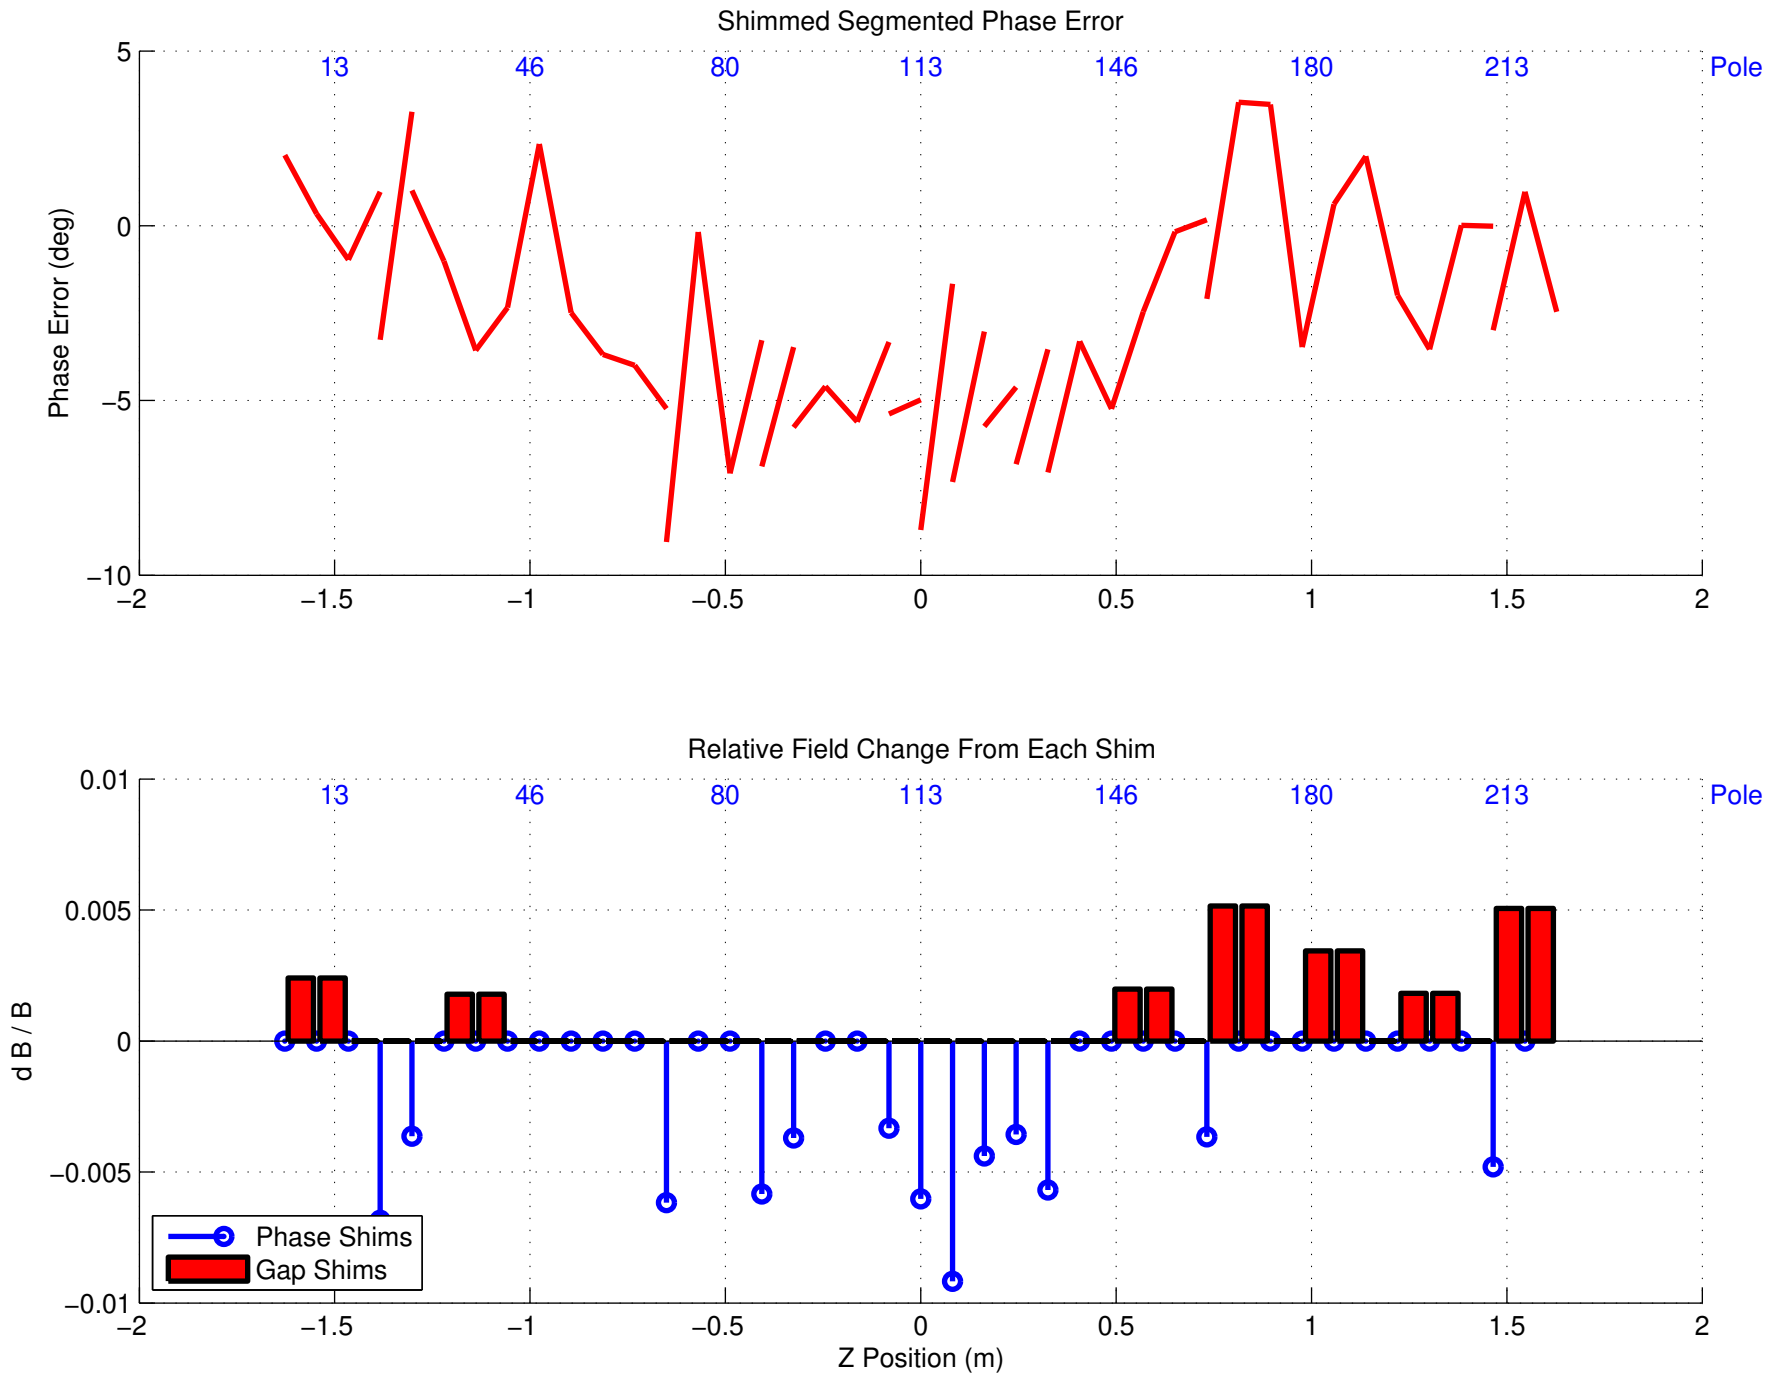
Shimmed Segmented Phase Error
13
46
80
113
146
180
213
Pole
Phase Error (deg)
5
0
−5
−10
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
13
46
80
113
146
180
213
Pole
d B / B
0.01
0.005
0
−0.005
−0.01
Phase Shims
Gap Shims
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

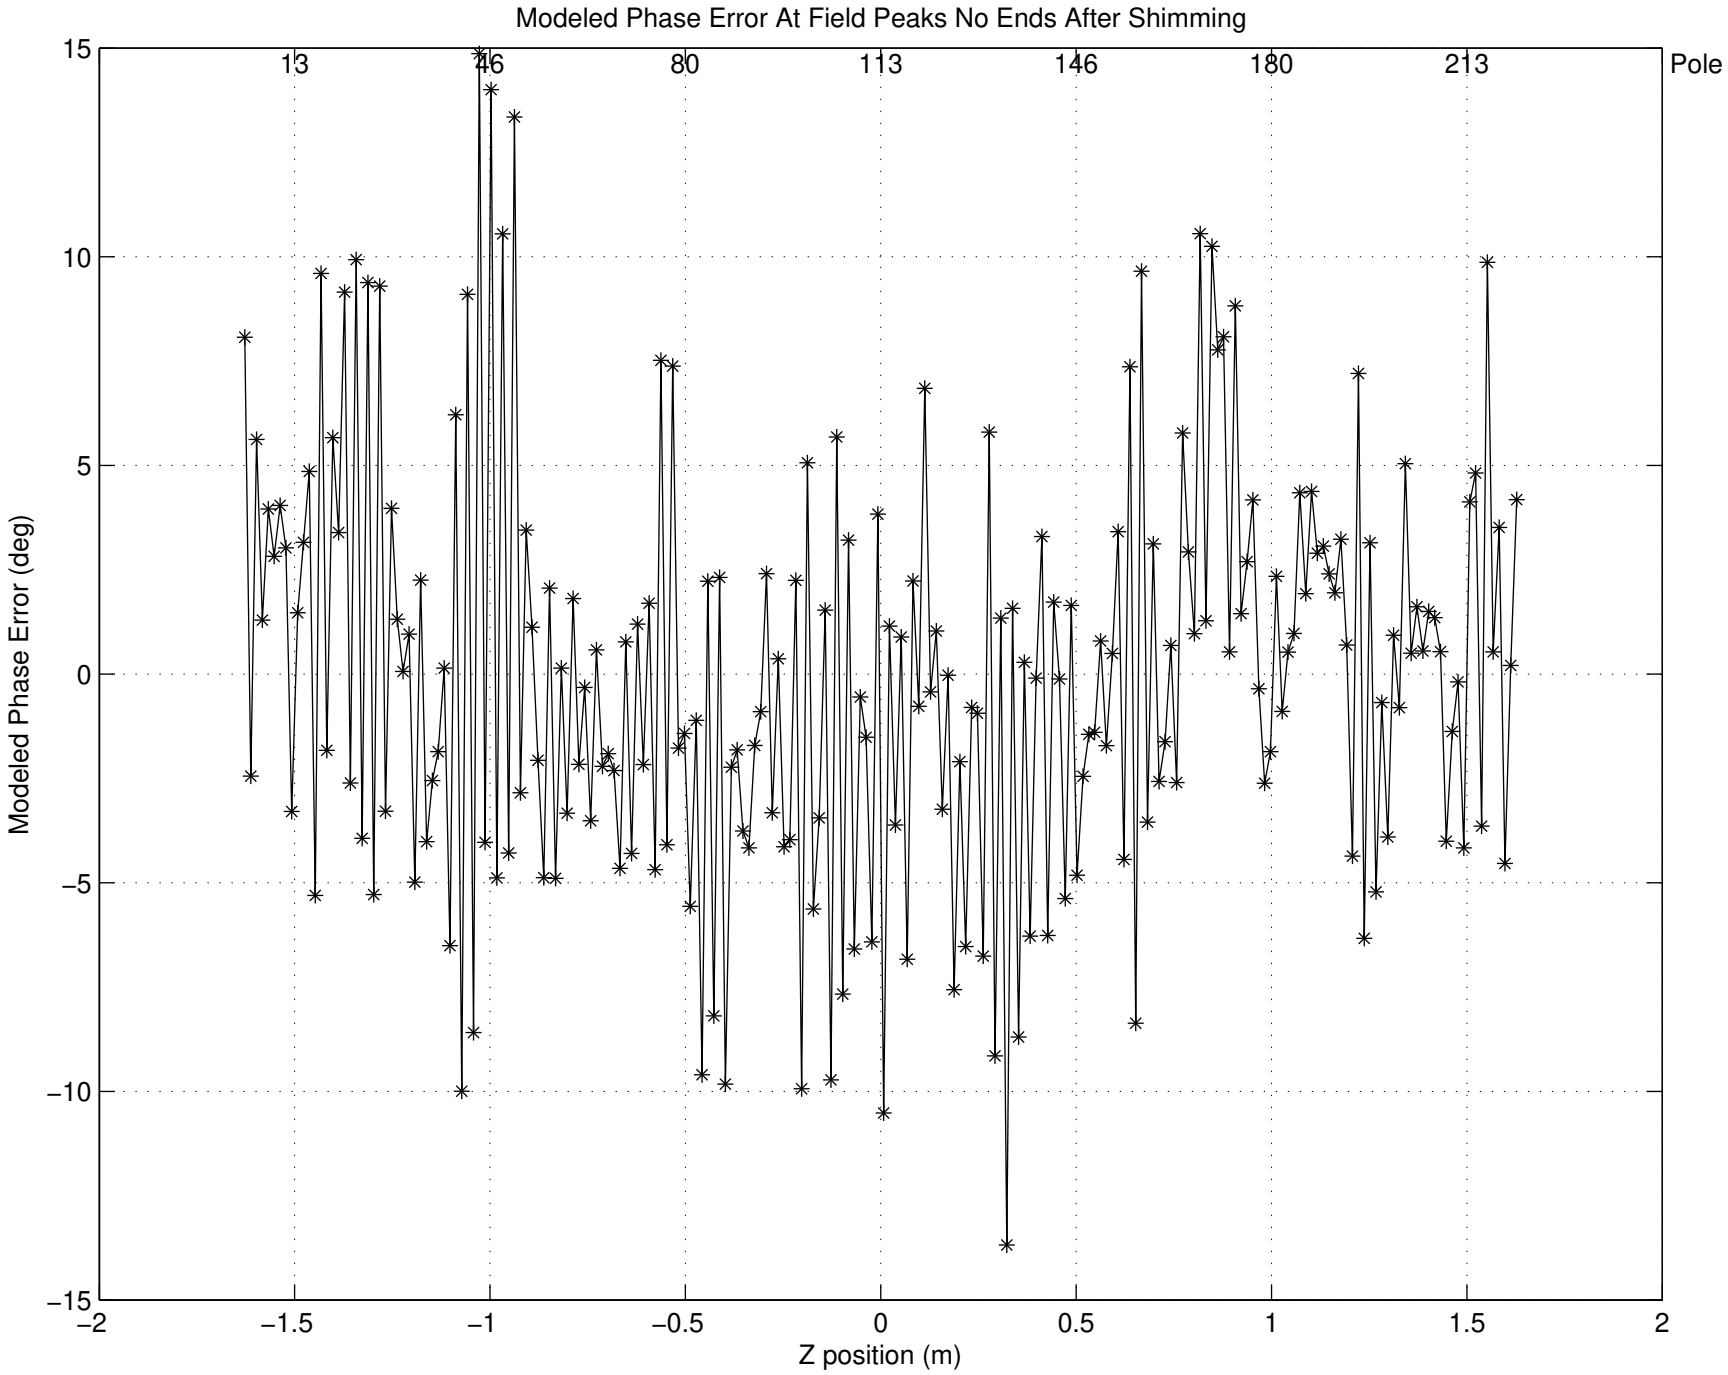

Phase Error: Ave = 0.000000 deg, RMS = 4.988959 deg