SLAC Magnetic Measurements

Planar Insertion Device Shim Analysis

Parameters:
INPUT−FILE−DIR =S:\MagData\LCLS\Undulator\L143−112000−36\DATASET0001\Rough Tuning\Z Scans\Run 002\
INPUT−FILE−NAME =x+00000−y+000−bscanz.dat
INPUT−FILE−TYPE =ZVXYBXYH
CORR−REQUIRED =1
GAMMA =26682.25
NOM−LAMBDA−U =0.03
NOM−K−VALUE =3.4977
NOM−LAMBDA−R =1.4995e−010
NUM−POLES =226
NUM−END−POLES =4
CELL−LENGTH =3.656

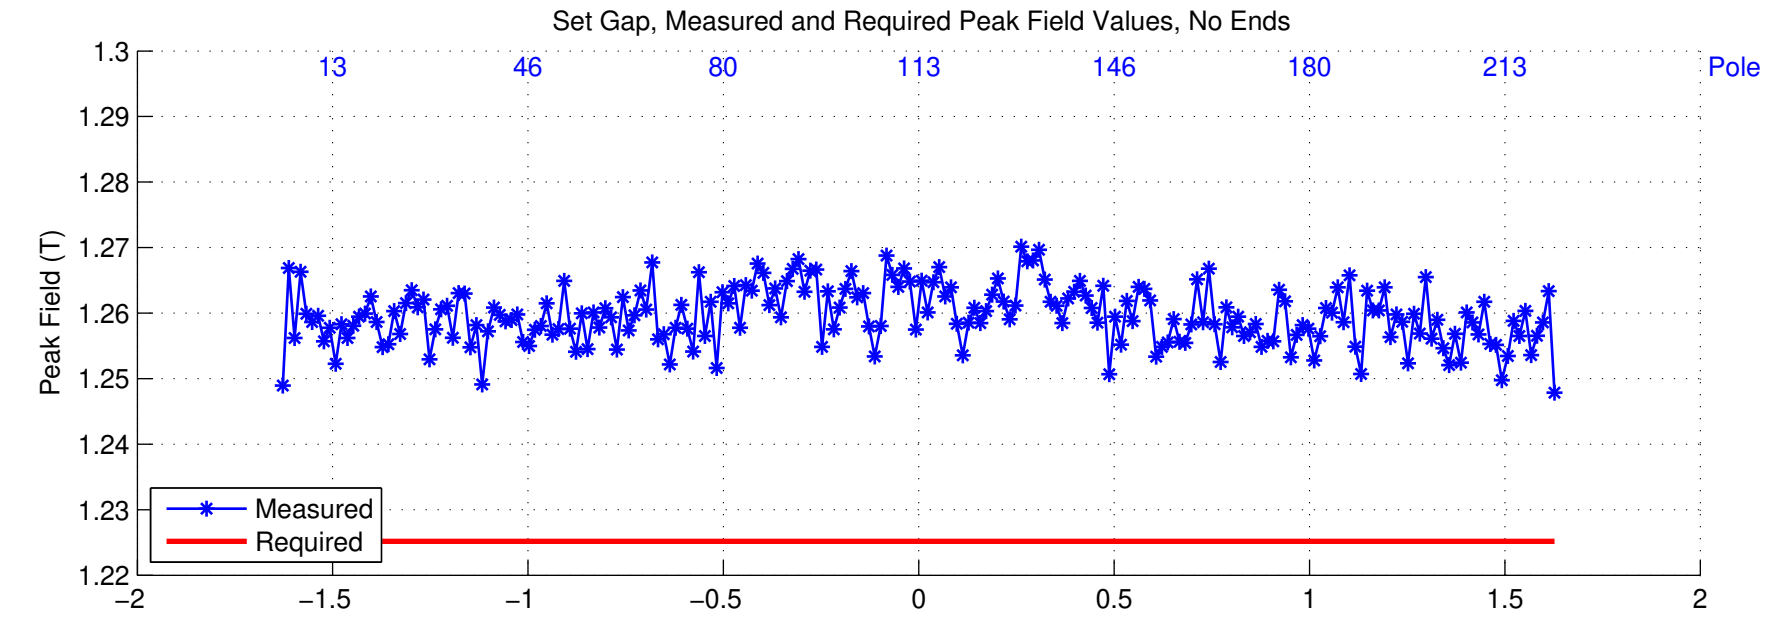
Set Gap, Measured and Required Peak Field Values, No Ends
13
46
80
113
146
180
213
Pole
Peak Field (T)
1.3
1.29
1.28
1.27
1.26
1.25
1.24
1.23
1.22
Measured
Required
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

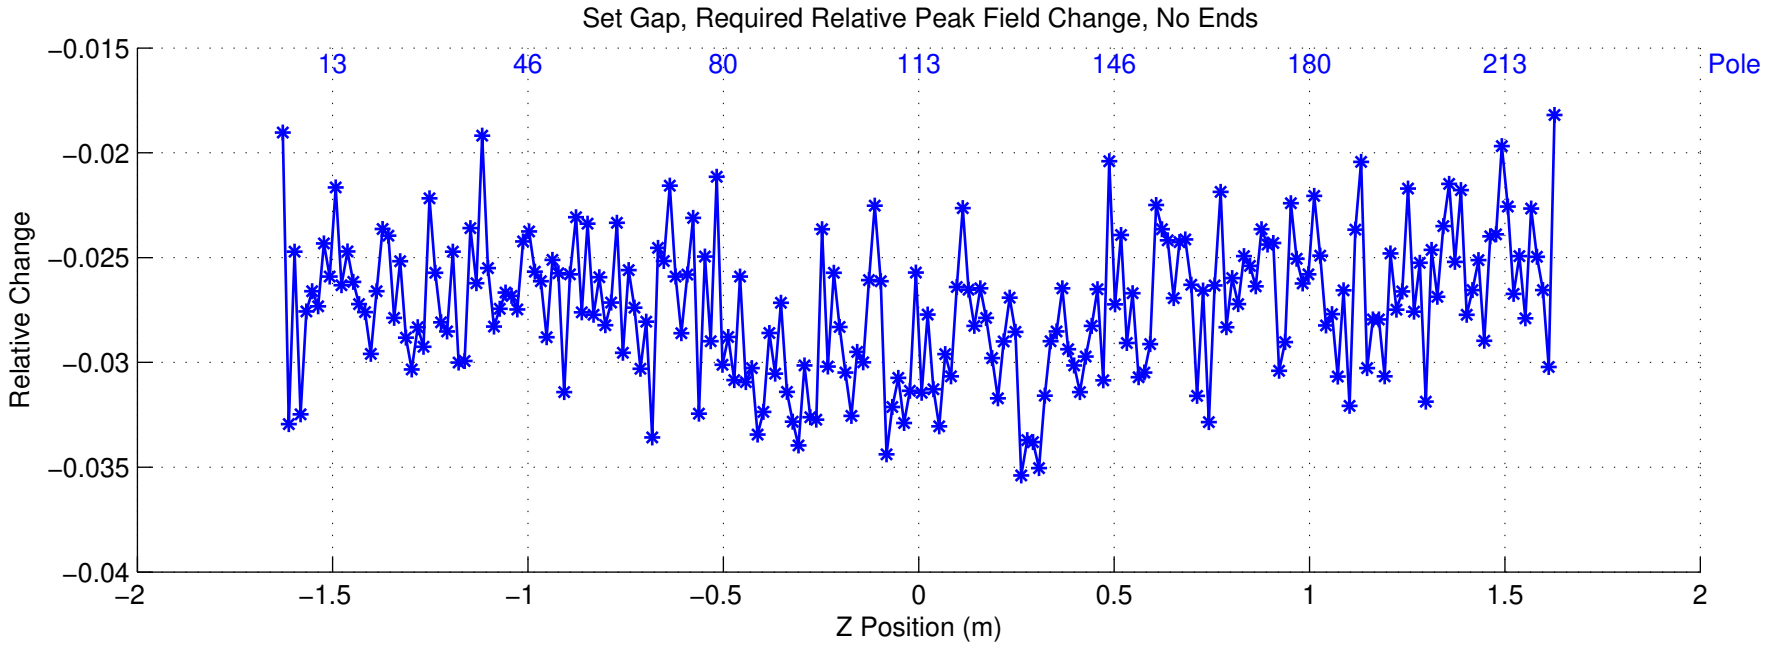
Set Gap, Required Relative Peak Field Change, No Ends
13
46
80
113
146
180
213
Pole
Relative Change
−0.015
−0.02
−0.025
−0.03
−0.035
−0.04
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

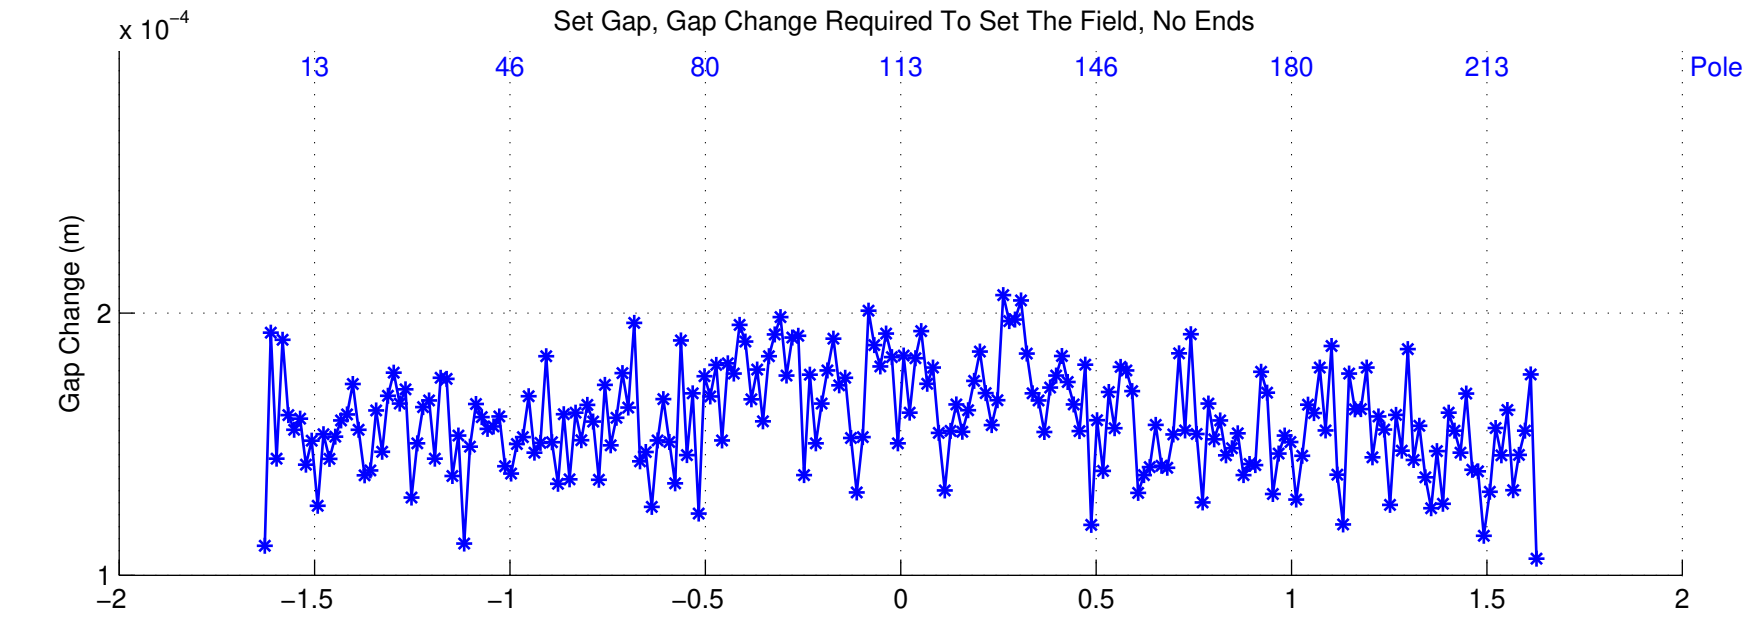
Set Gap, Gap Change Required To Set The Field, No Ends
x 10^-4
13
46
80
113
146
180
213
Pole
Gap Change (m)
2
1
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

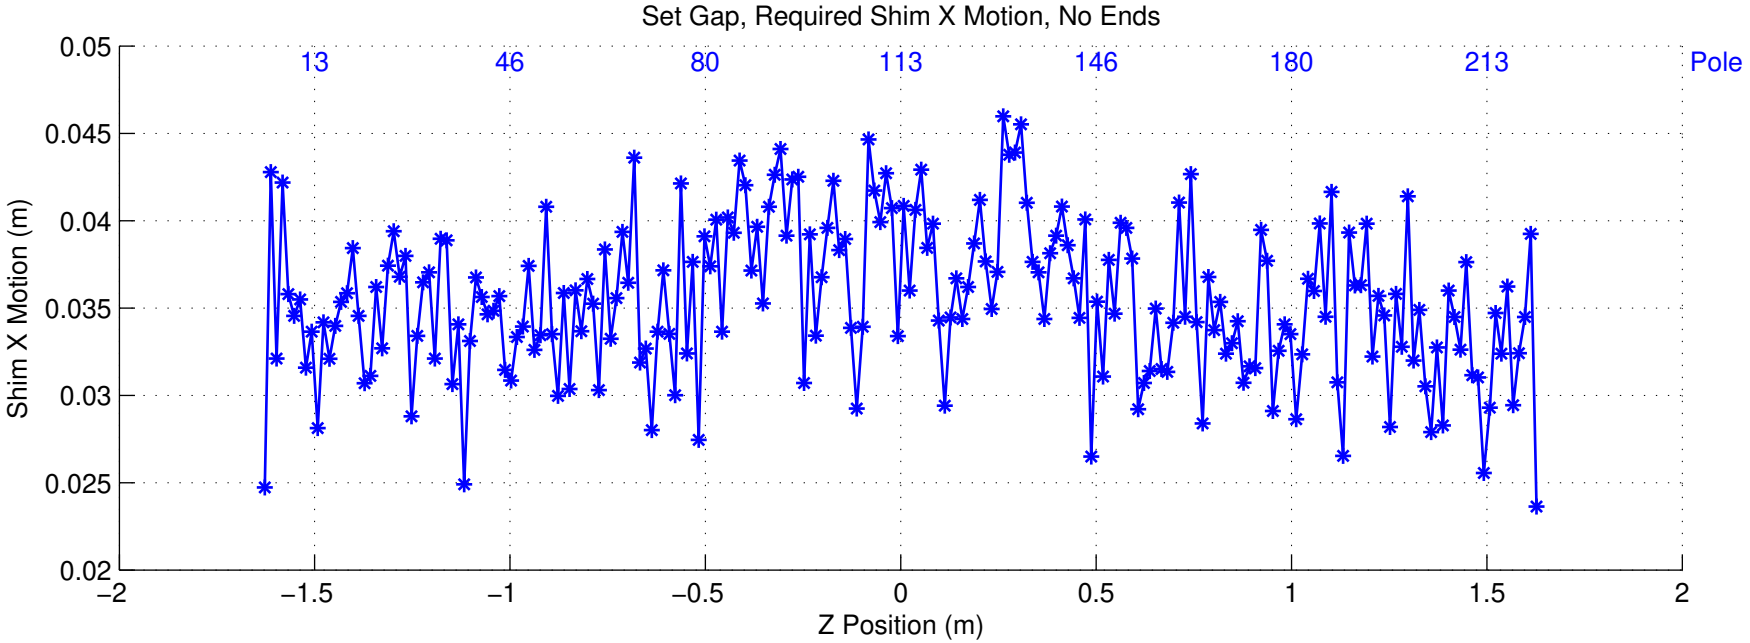
Set Gap, Required Shim X Motion, No Ends
13
46
80
113
146
180
213
Pole
Shim X Motion (m)
0.05
0.045
0.04
0.035
0.03
0.025
0.02
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

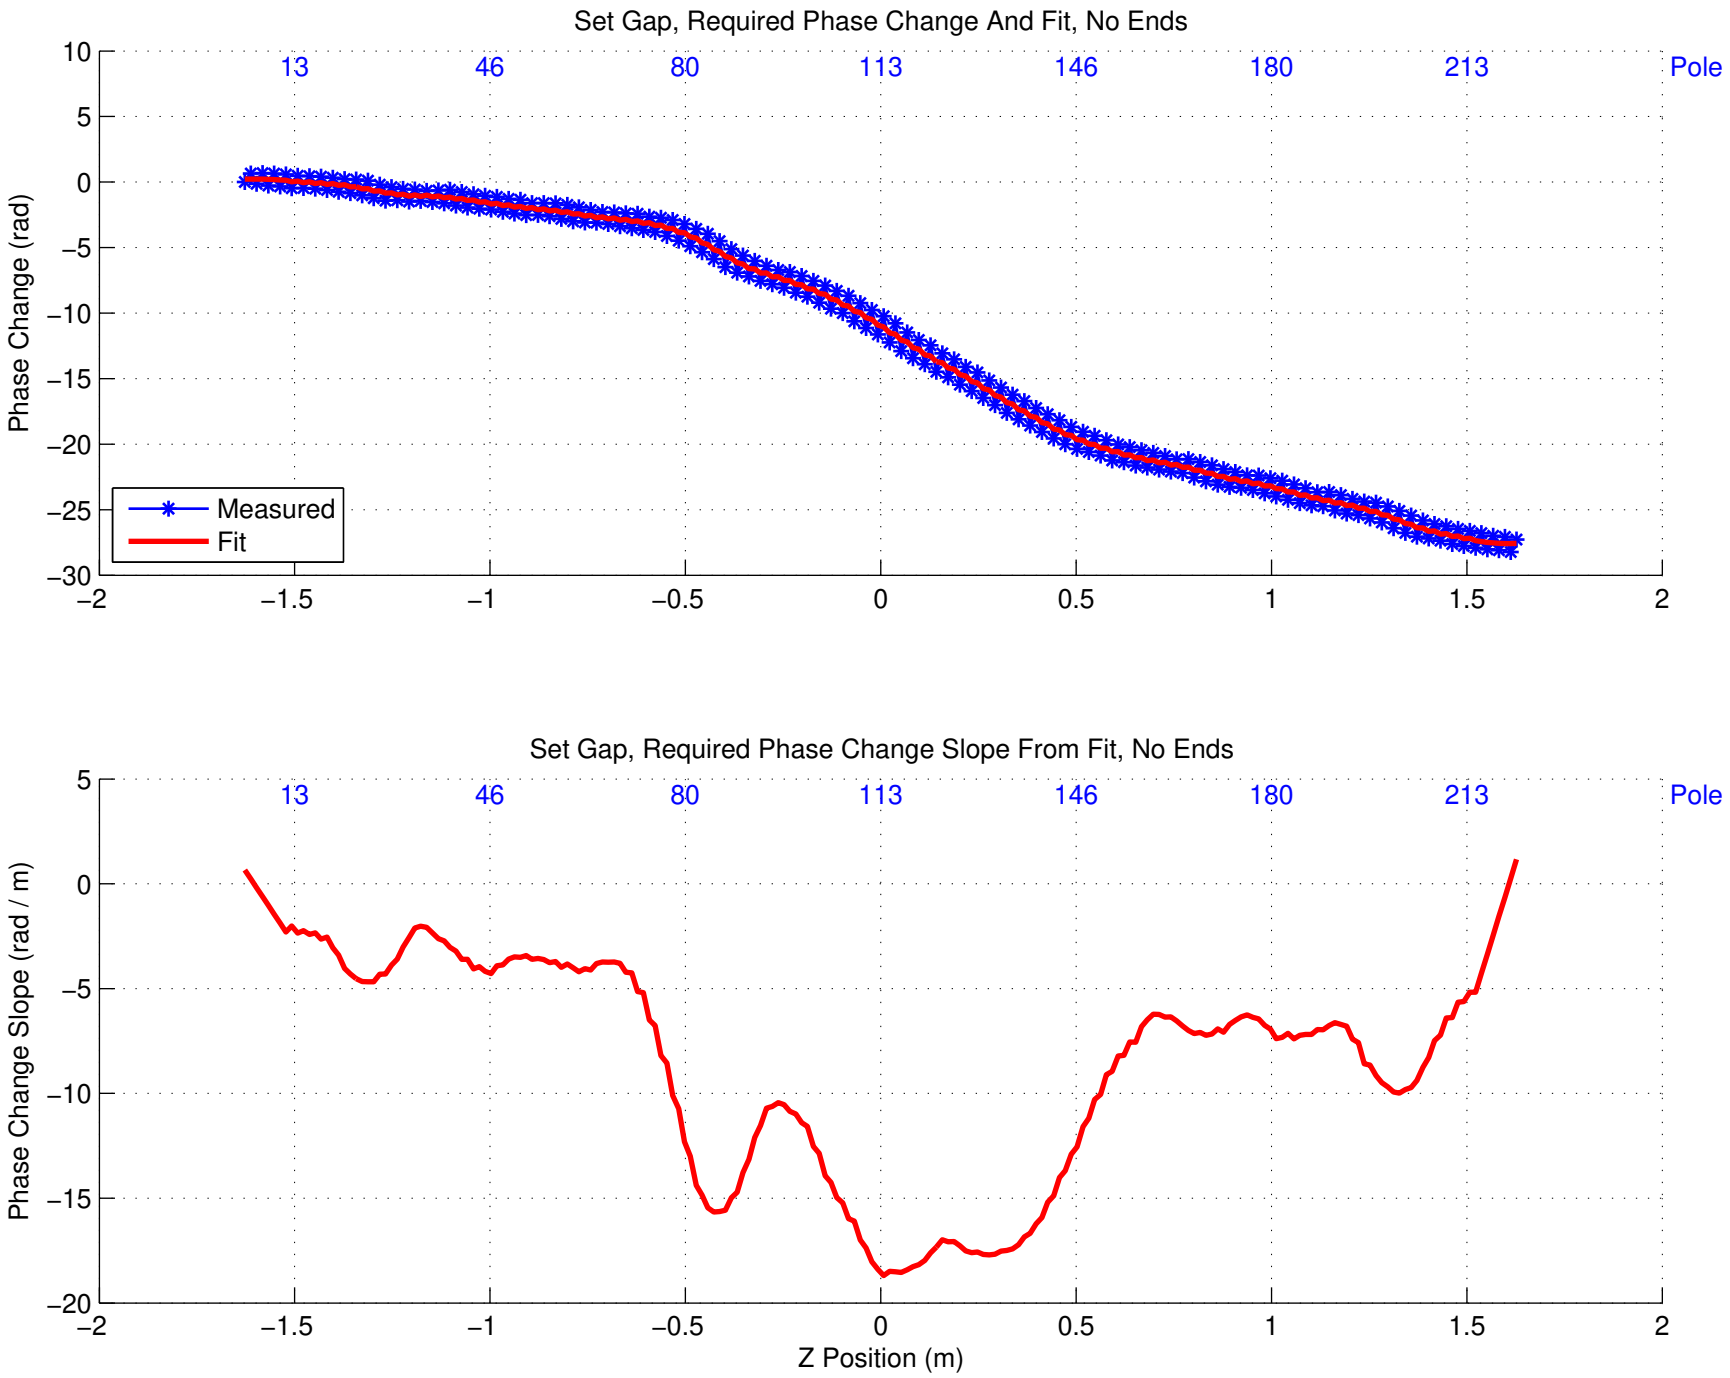
Set Gap, Required Phase Change And Fit, No Ends
13
46
80
113
146
180
213
Pole
Phase Change (rad)
Measured
Fit
Set Gap, Required Phase Change Slope From Fit, No Ends
Phase Change Slope (rad / m)
Z Position (m)

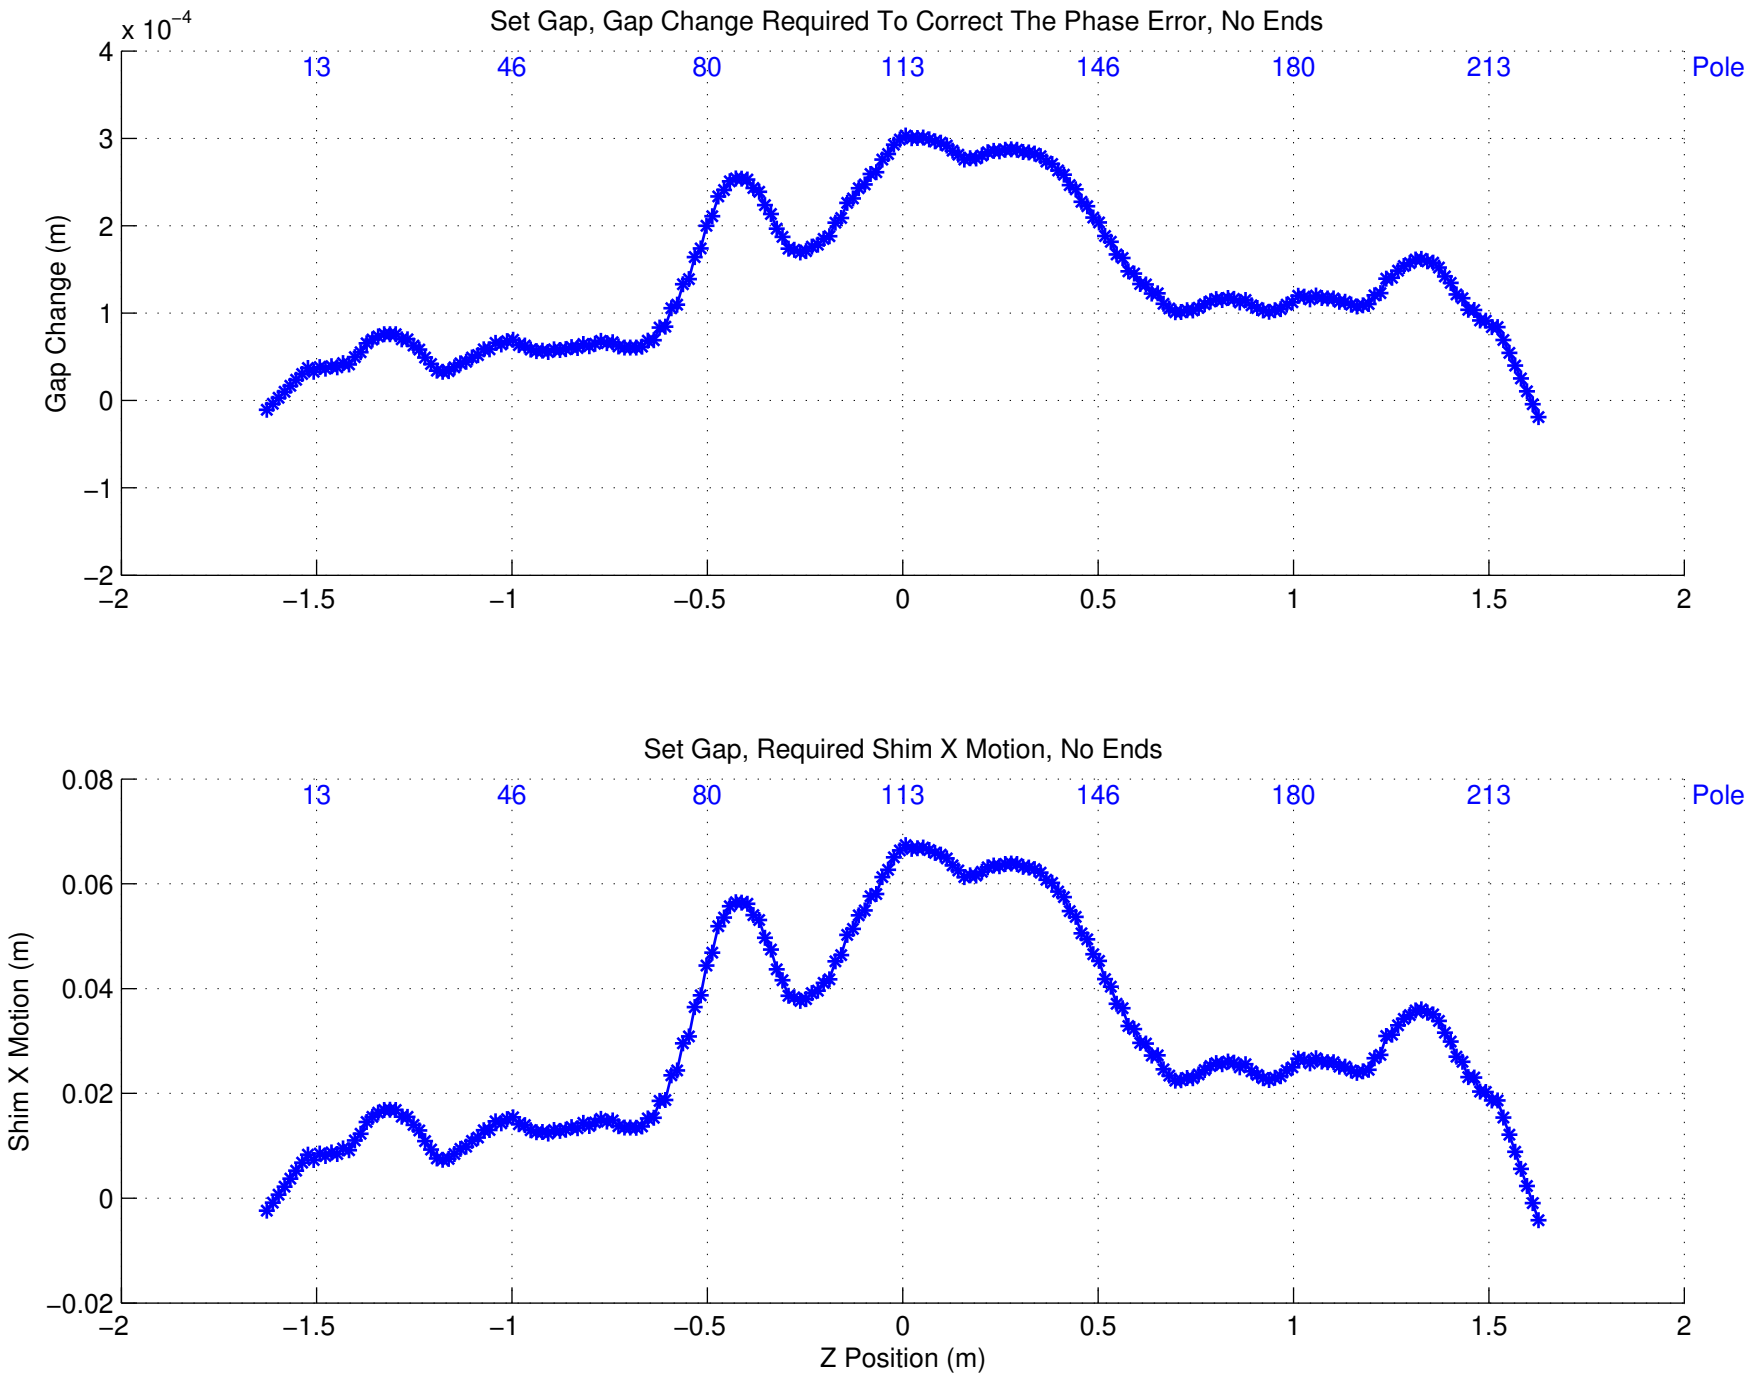
Set Gap, Gap Change Required To Correct The Phase Error, No Ends
x 10^-4
Gap Change (m)
13
46
80
113
146
180
213
Pole
Set Gap, Required Shim X Motion, No Ends
Shim X Motion (m)
Z Position (m)

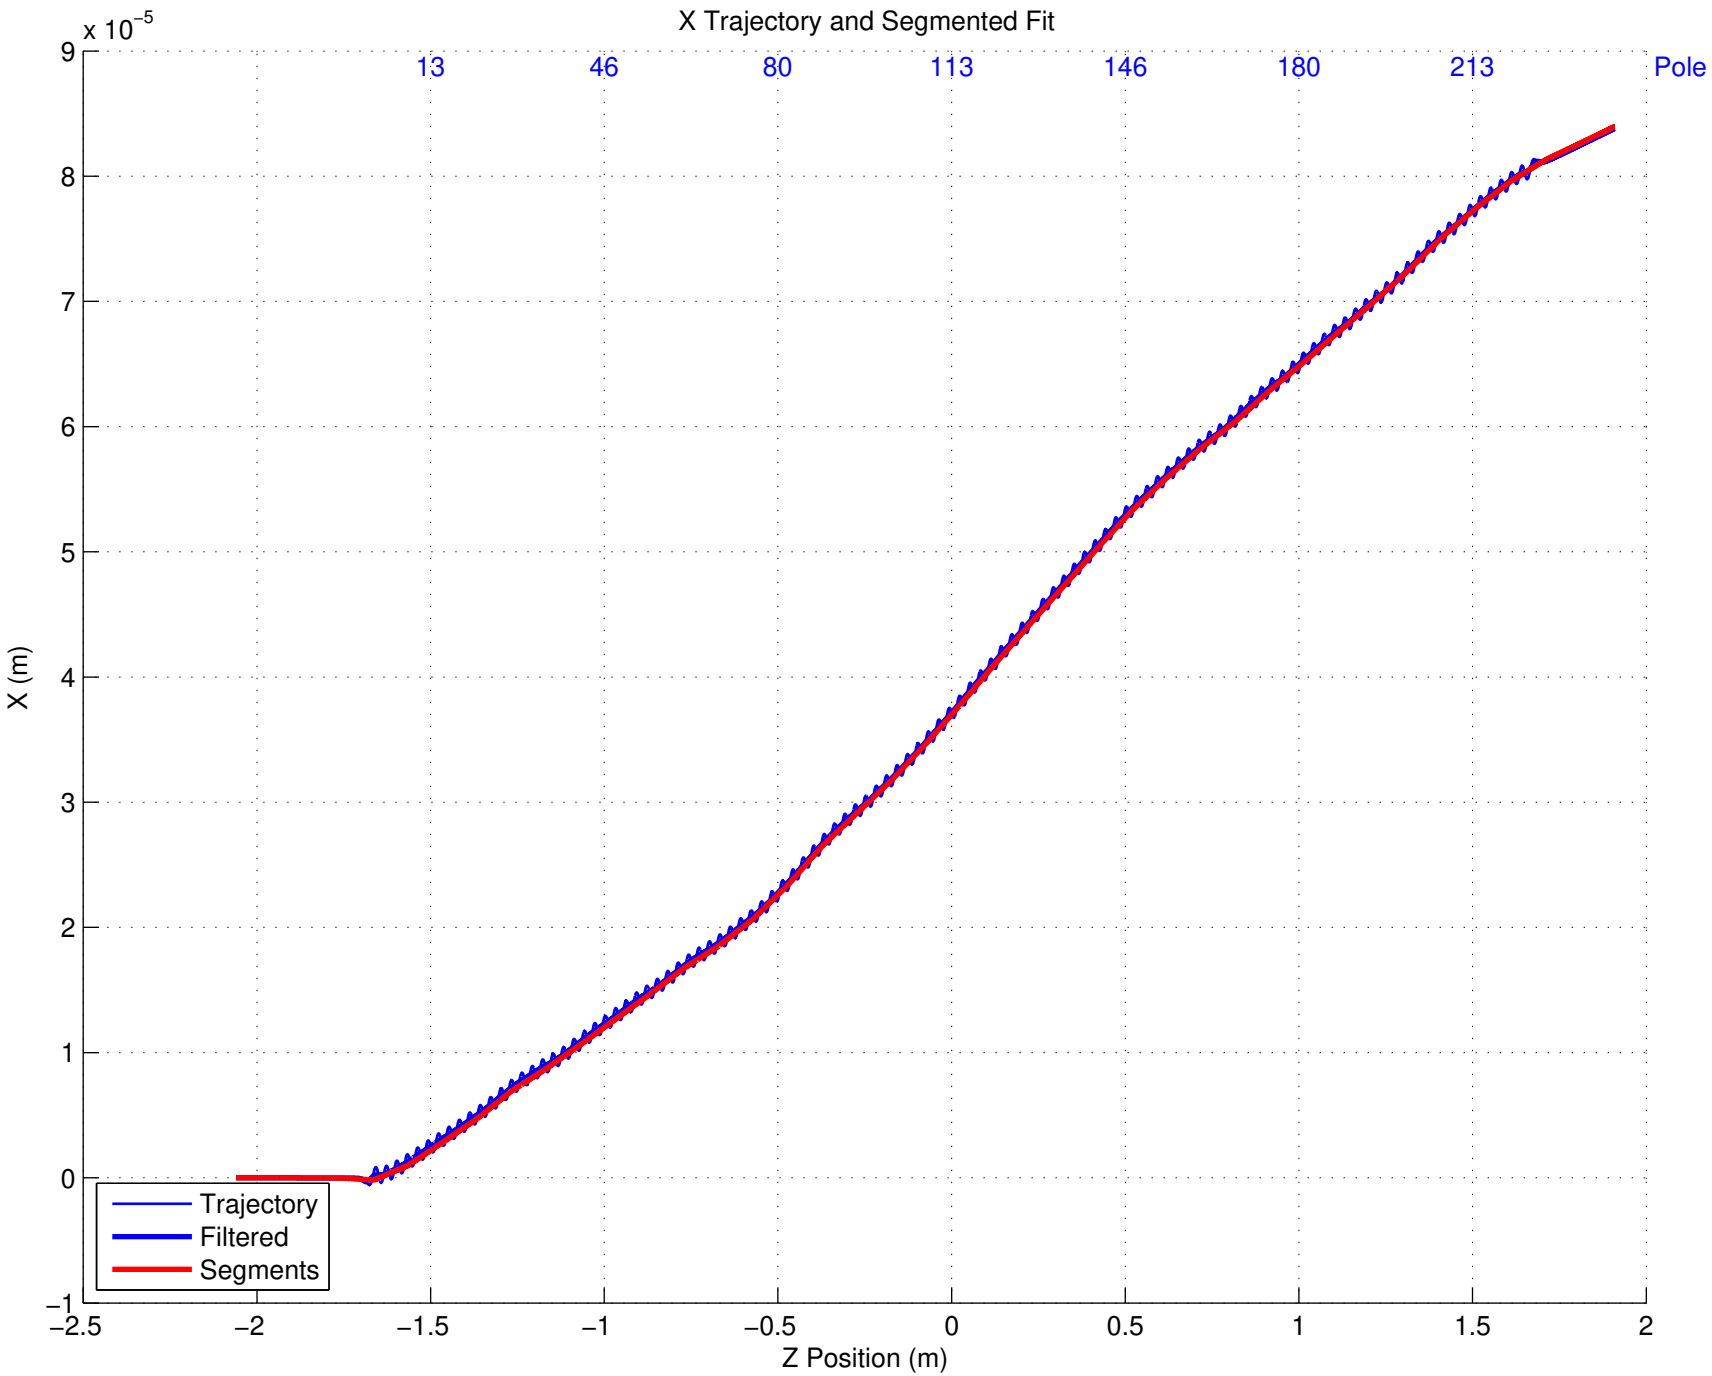
X Trajectory and Segmented Fit
x 10^-5
13
46
80
113
146
180
213
Pole
9
8
7
6
5
4
3
2
1
0
−1
X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

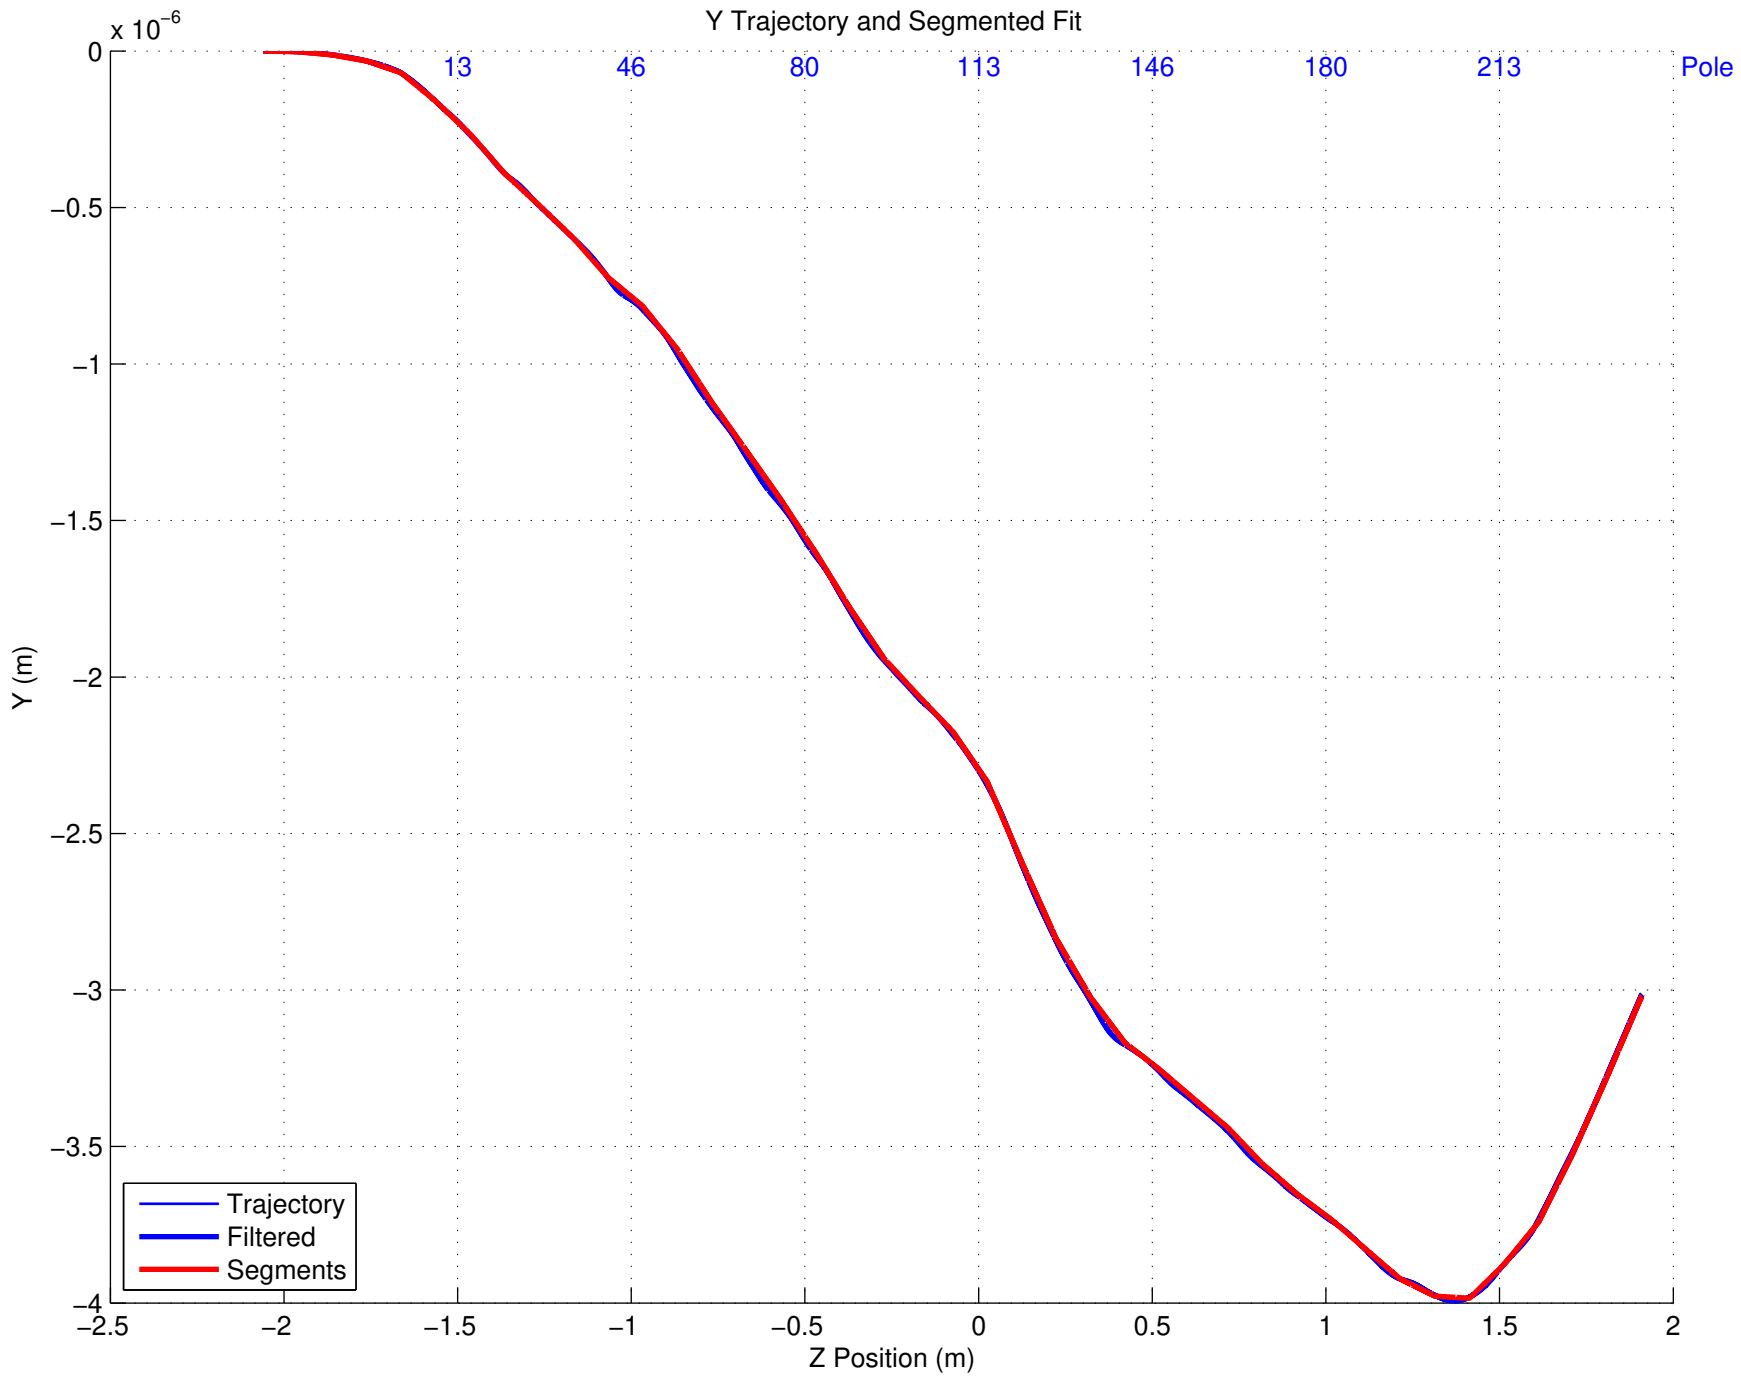
Y Trajectory and Segmented Fit
x 10^-6
0
−0.5
−1
−1.5
−2
−2.5
−3
−3.5
−4
13
46
80
113
146
180
213
Pole
Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

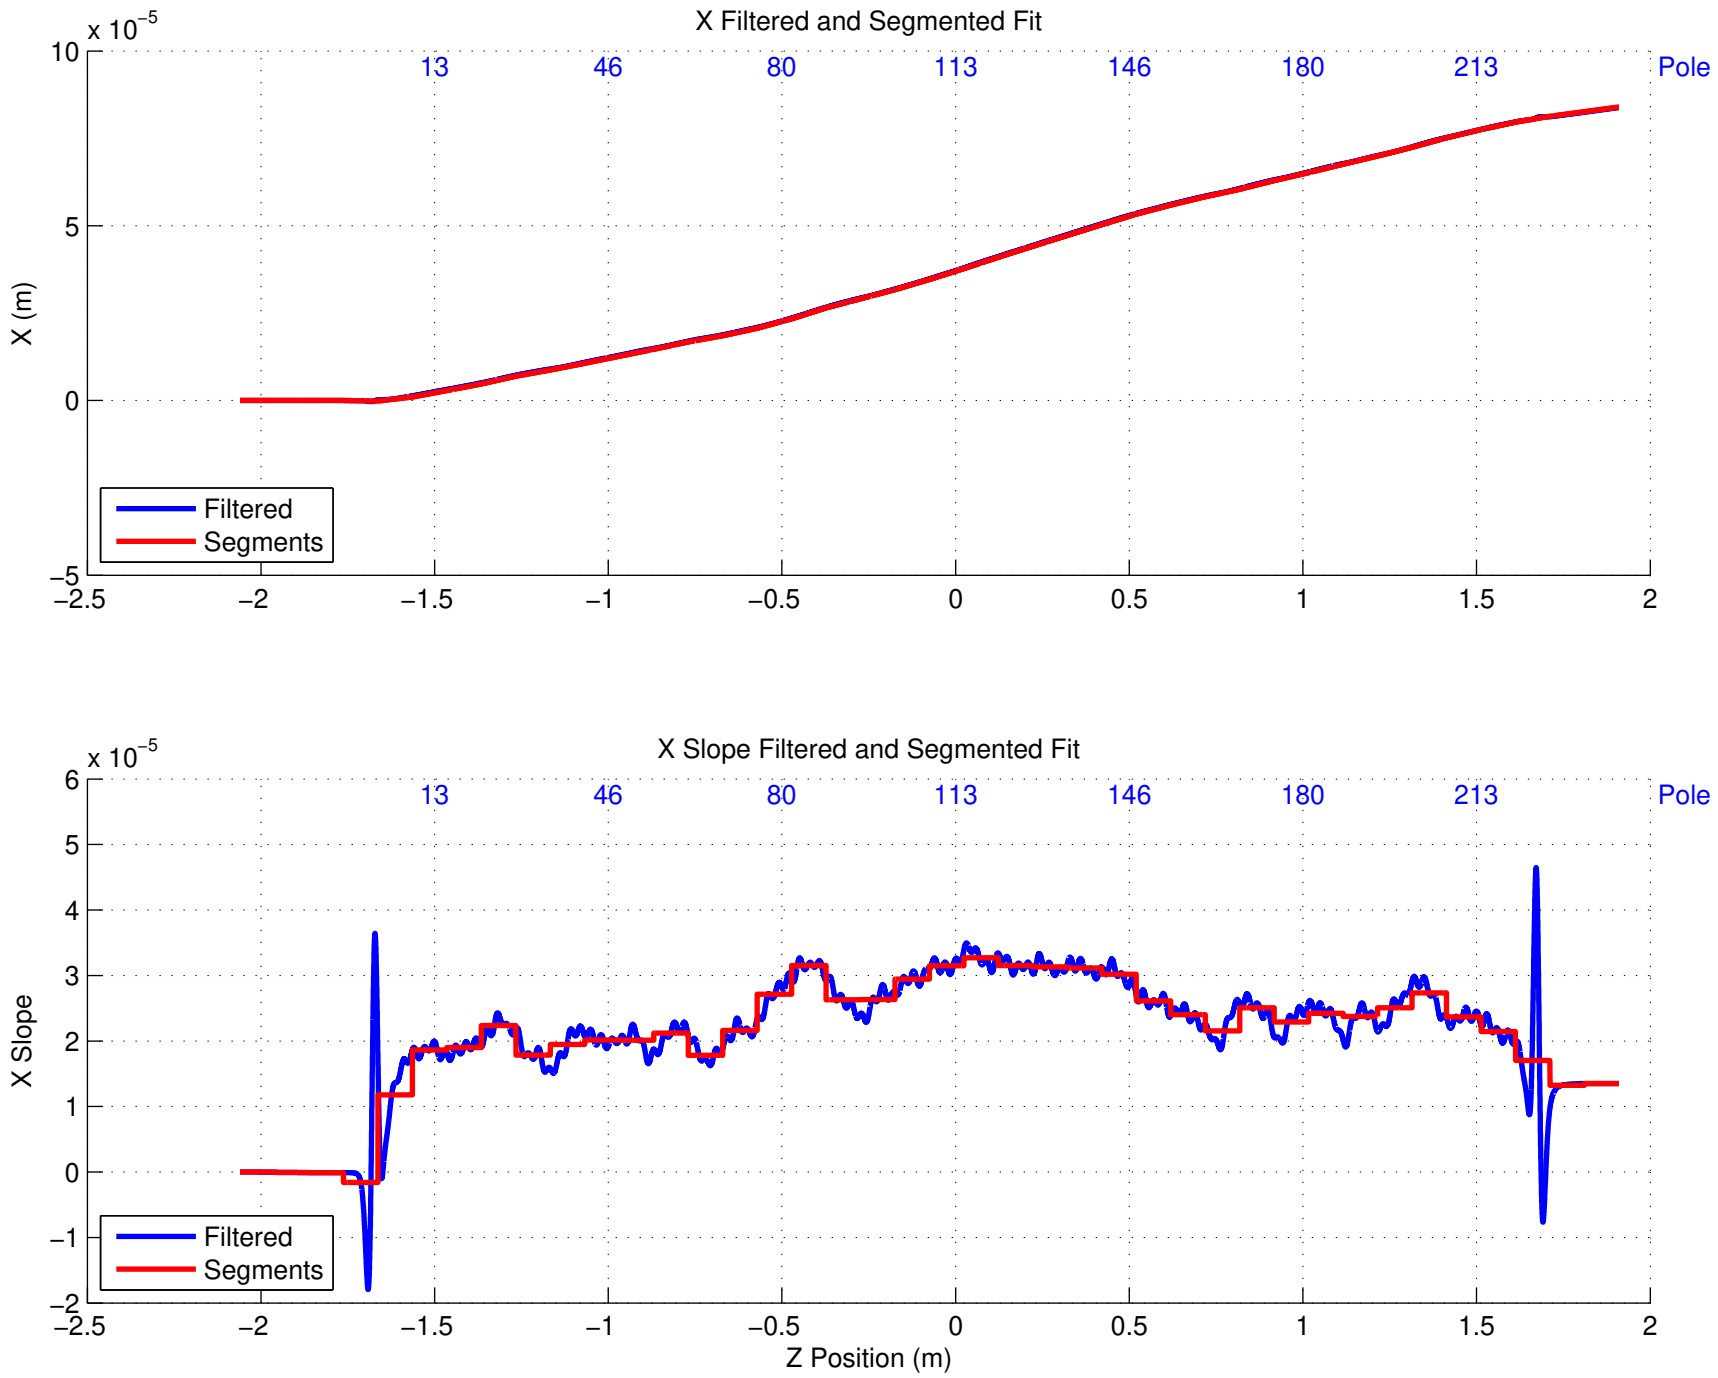
X Filtered and Segmented Fit
x 10^-5
10
5
0
−5
X (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
X Slope Filtered and Segmented Fit
x 10^-5
6
5
4
3
2
1
0
−1
−2
X Slope
Z Position (m)

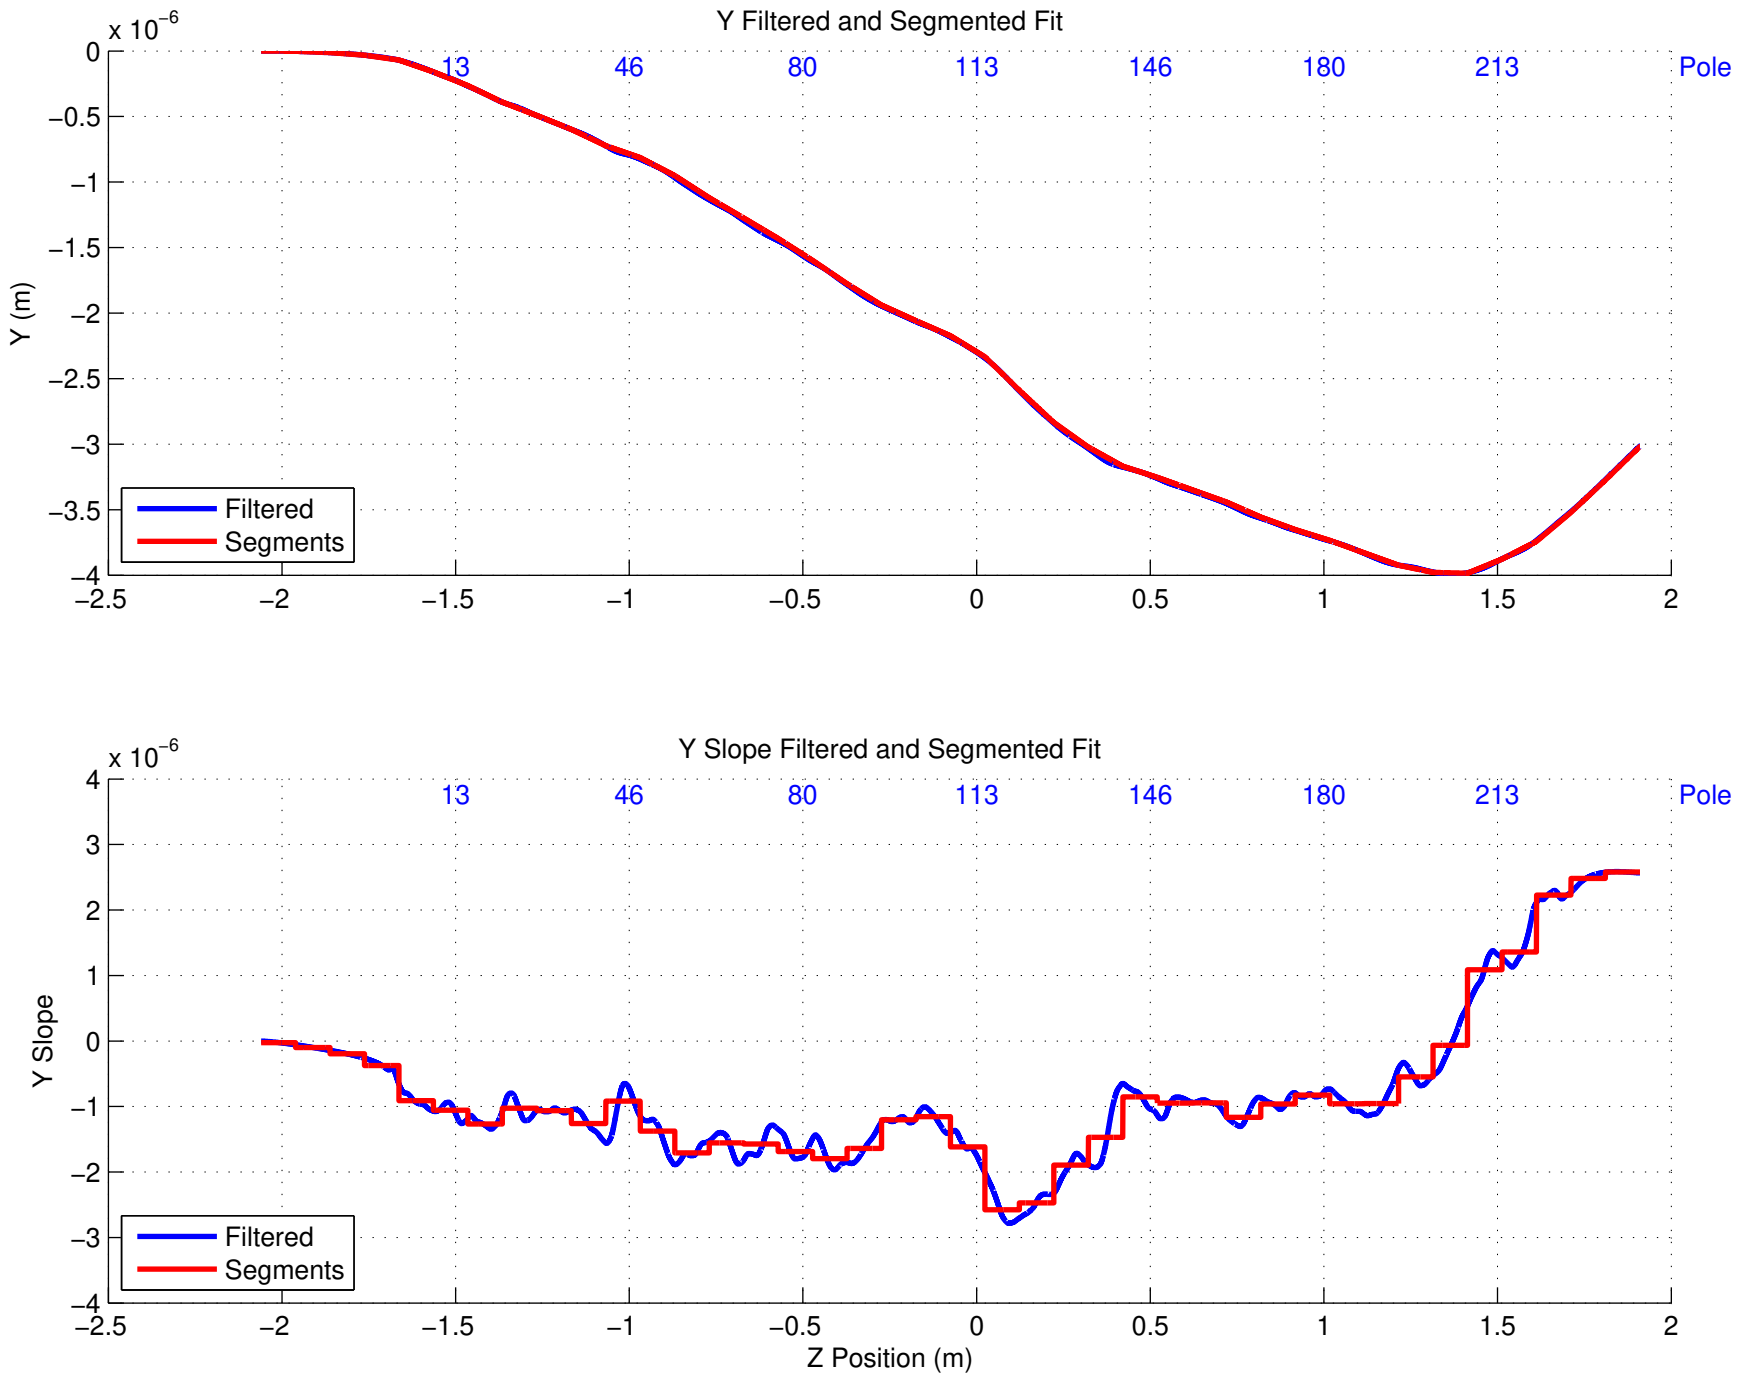
Y Filtered and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
Y (m)
Filtered
Segments
Y Slope Filtered and Segmented Fit
x 10^-6
Y Slope
Z Position (m)

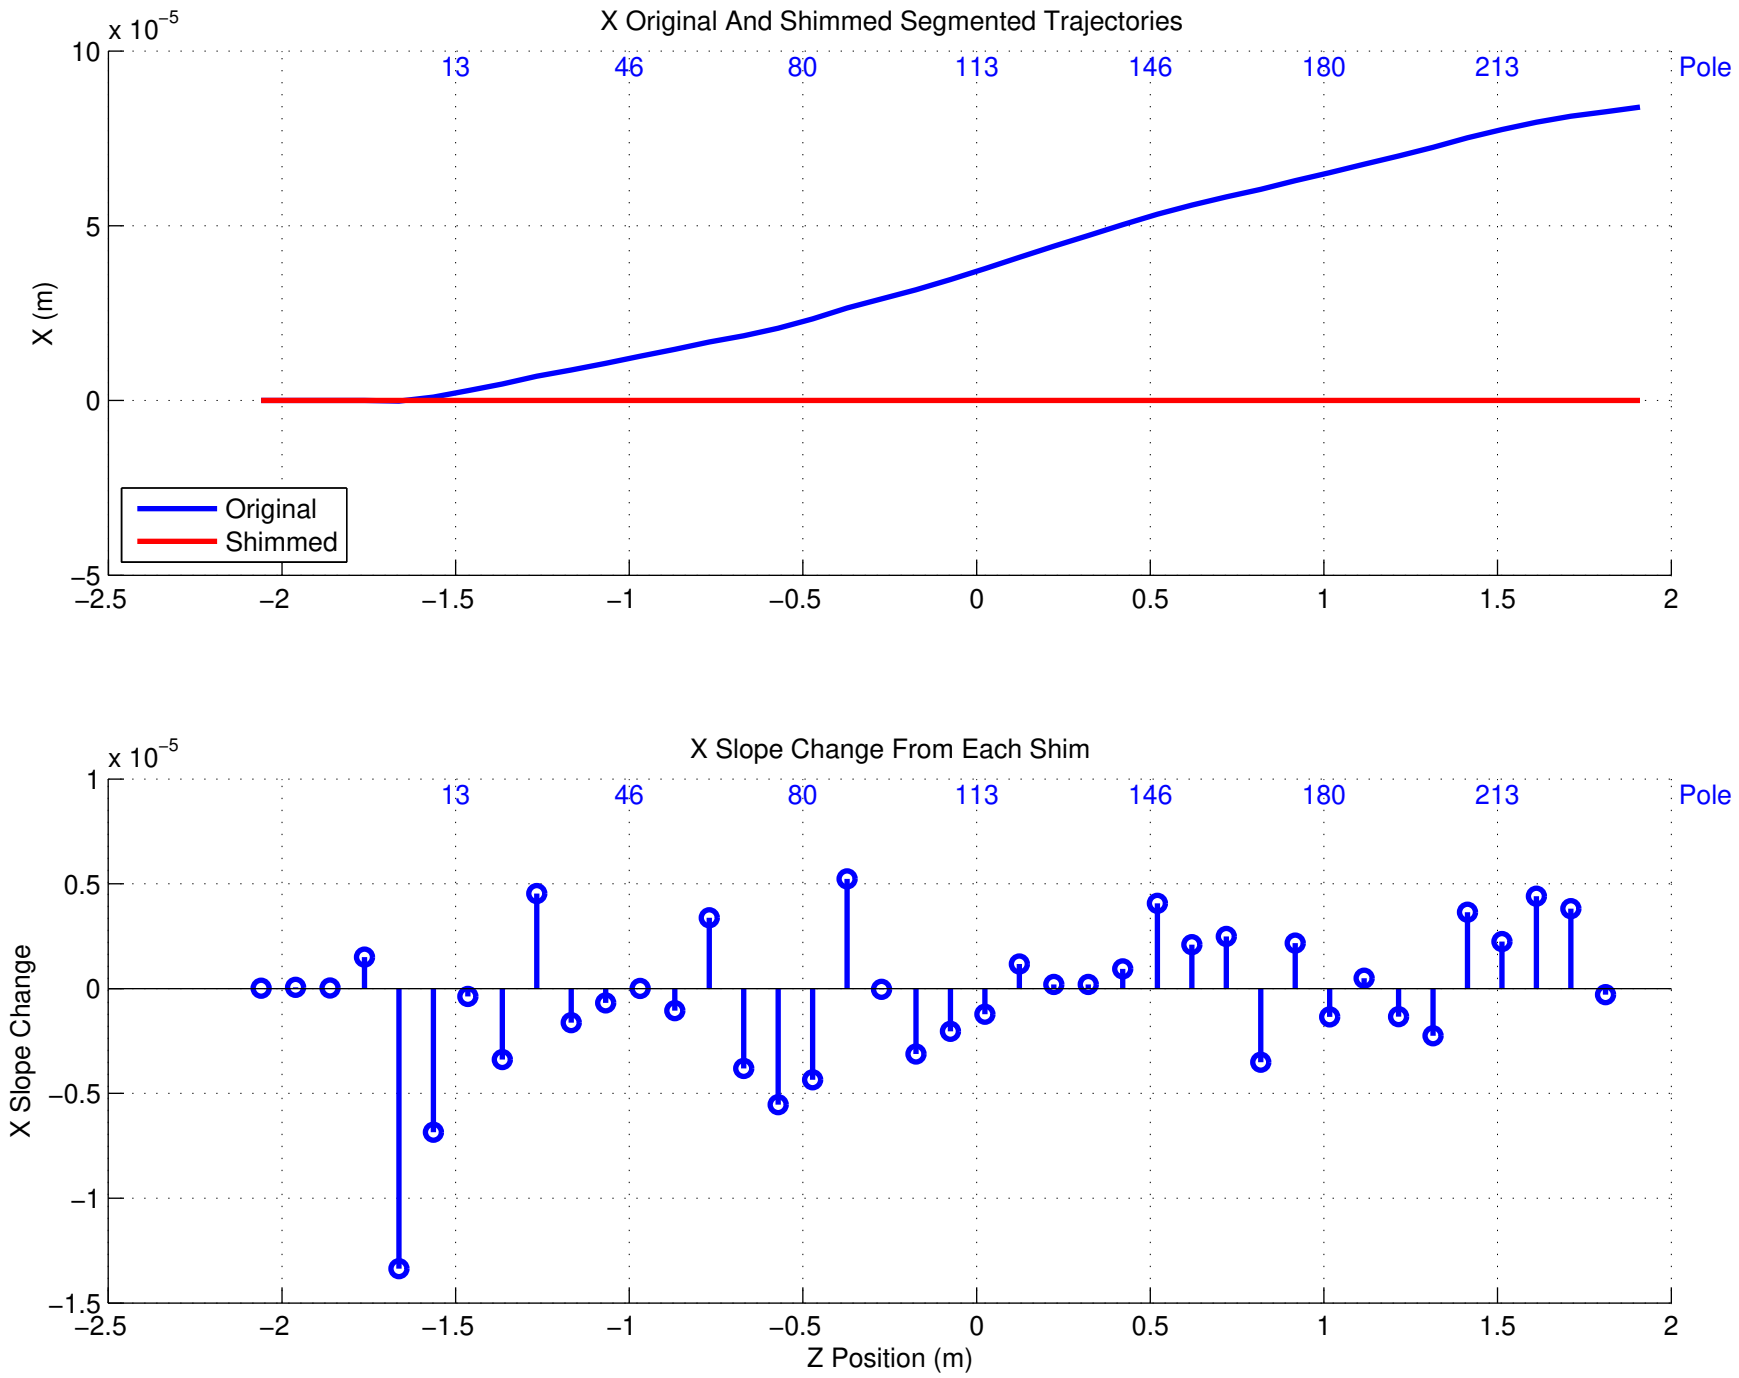
X Original And Shimmed Segmented Trajectories
x 10^-5
10
5
0
−5
X (m)
13
46
80
113
146
180
213
Pole
Original
Shimmed
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
X Slope Change From Each Shim
x 10^-5
1
0.5
0
−0.5
−1
−1.5
X Slope Change
Z Position (m)

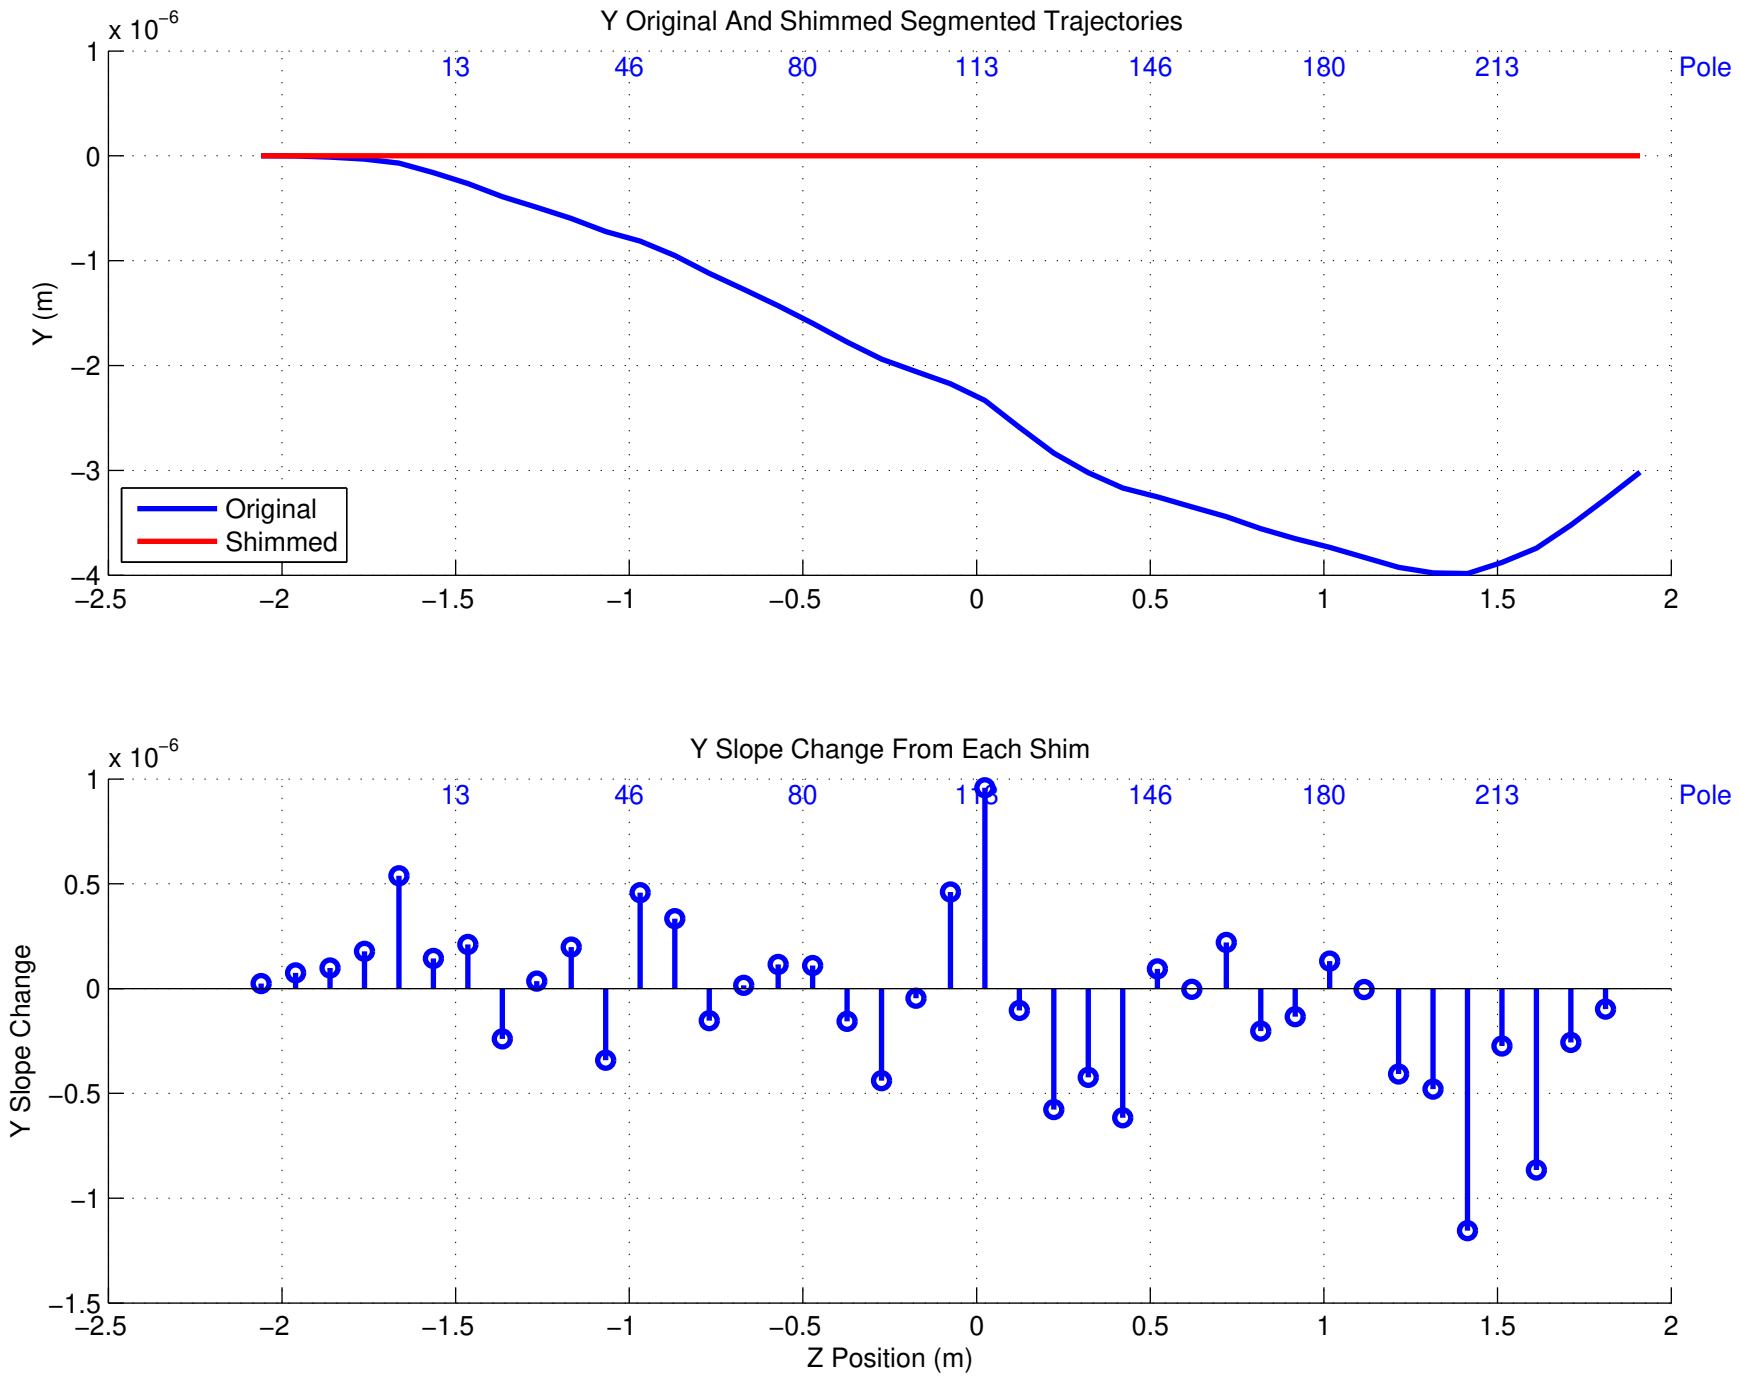
Y Original And Shimmed Segmented Trajectories
x 10^-6
13
46
80
113
146
180
213
Pole
Y (m)
Original
Shimmed
Y Slope Change From Each Shim
Y Slope Change
Z Position (m)

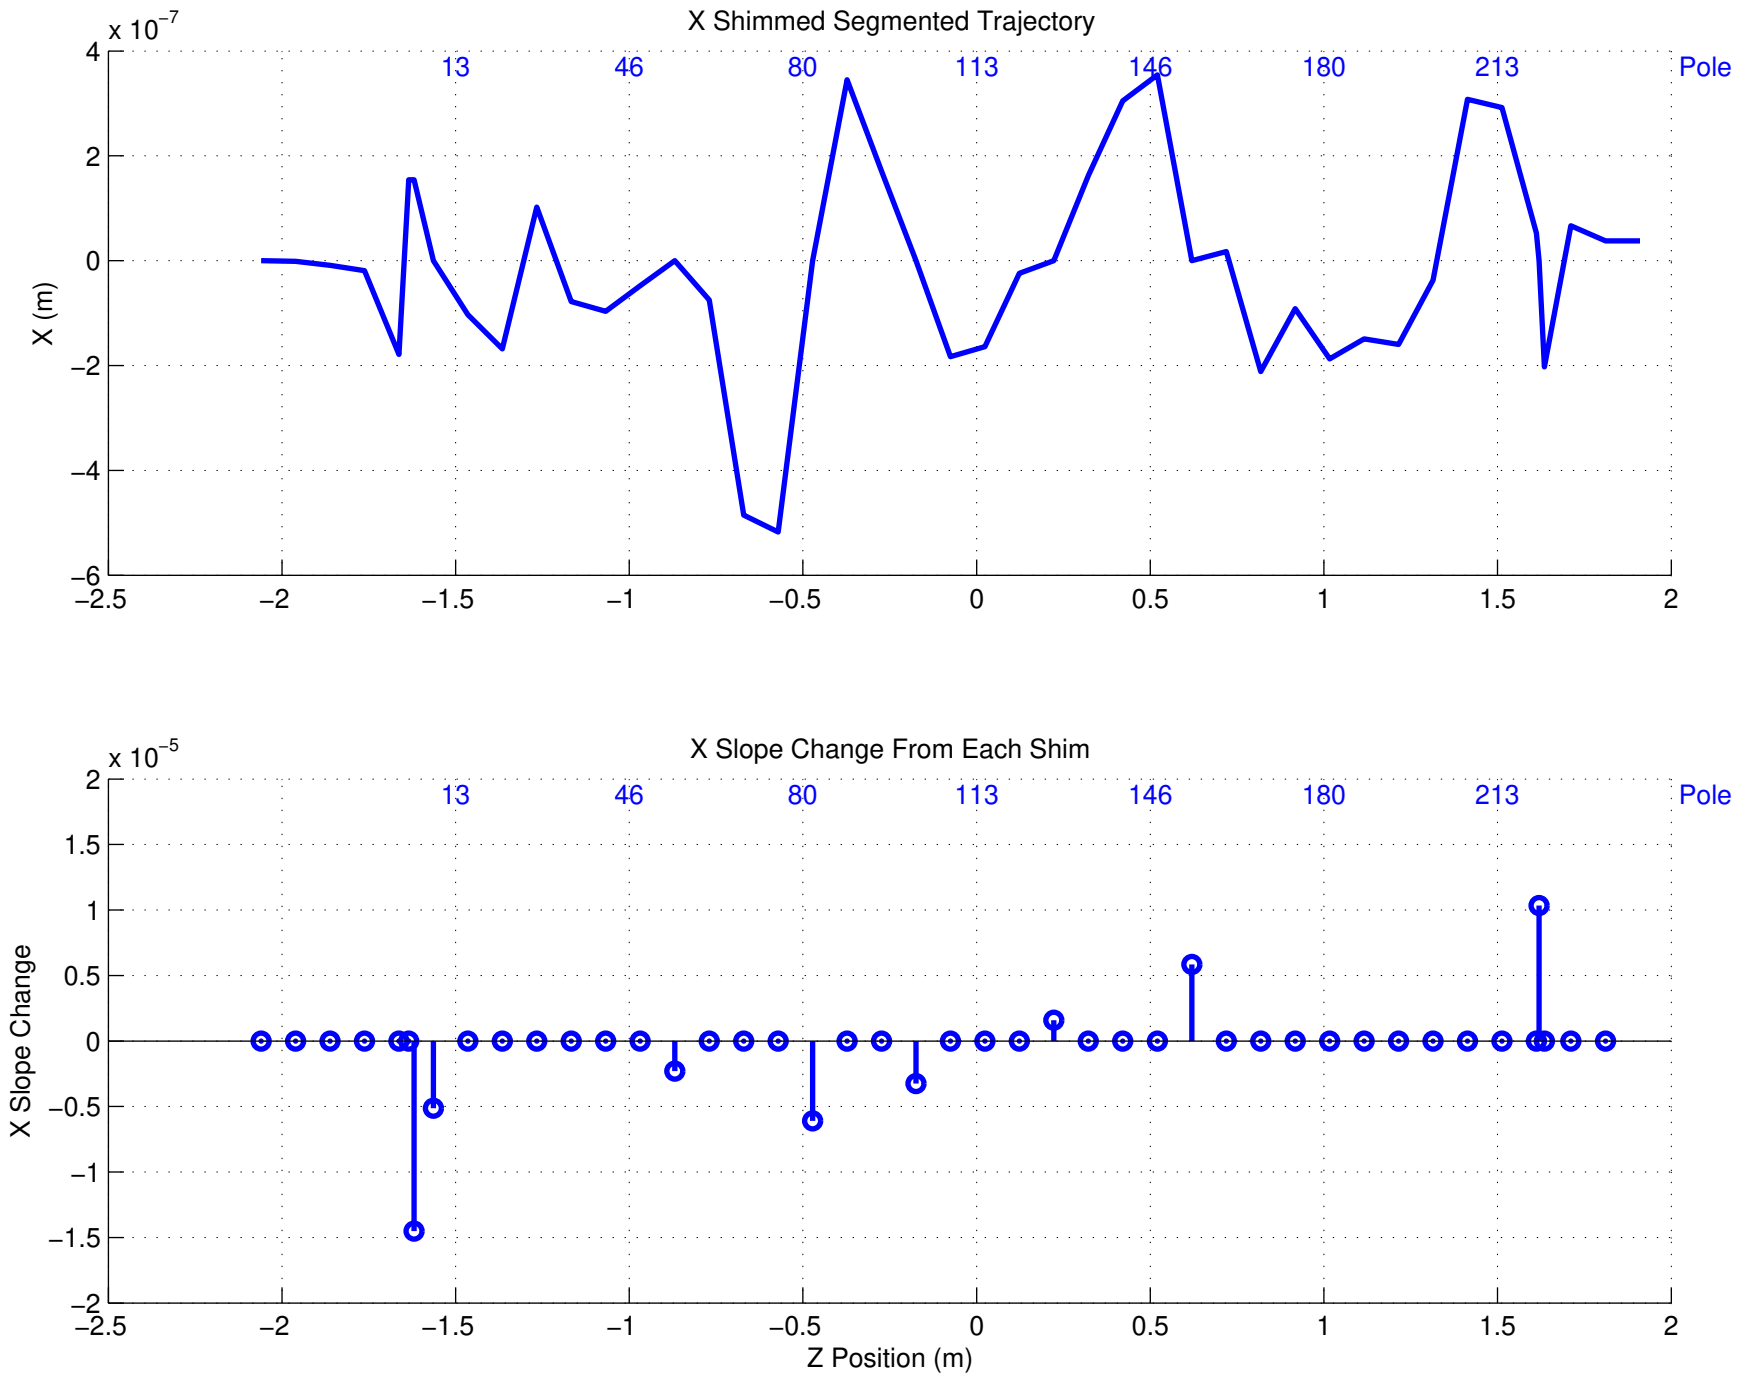
X Shimmed Segmented Trajectory
x 10^-7
X (m)
13
46
80
113
146
180
213
Pole
4
2
0
−2
−4
−6
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
X Slope Change From Each Shim
x 10^-5
X Slope Change
Z Position (m)
1.5
1
0.5
−0.5
−1
−1.5

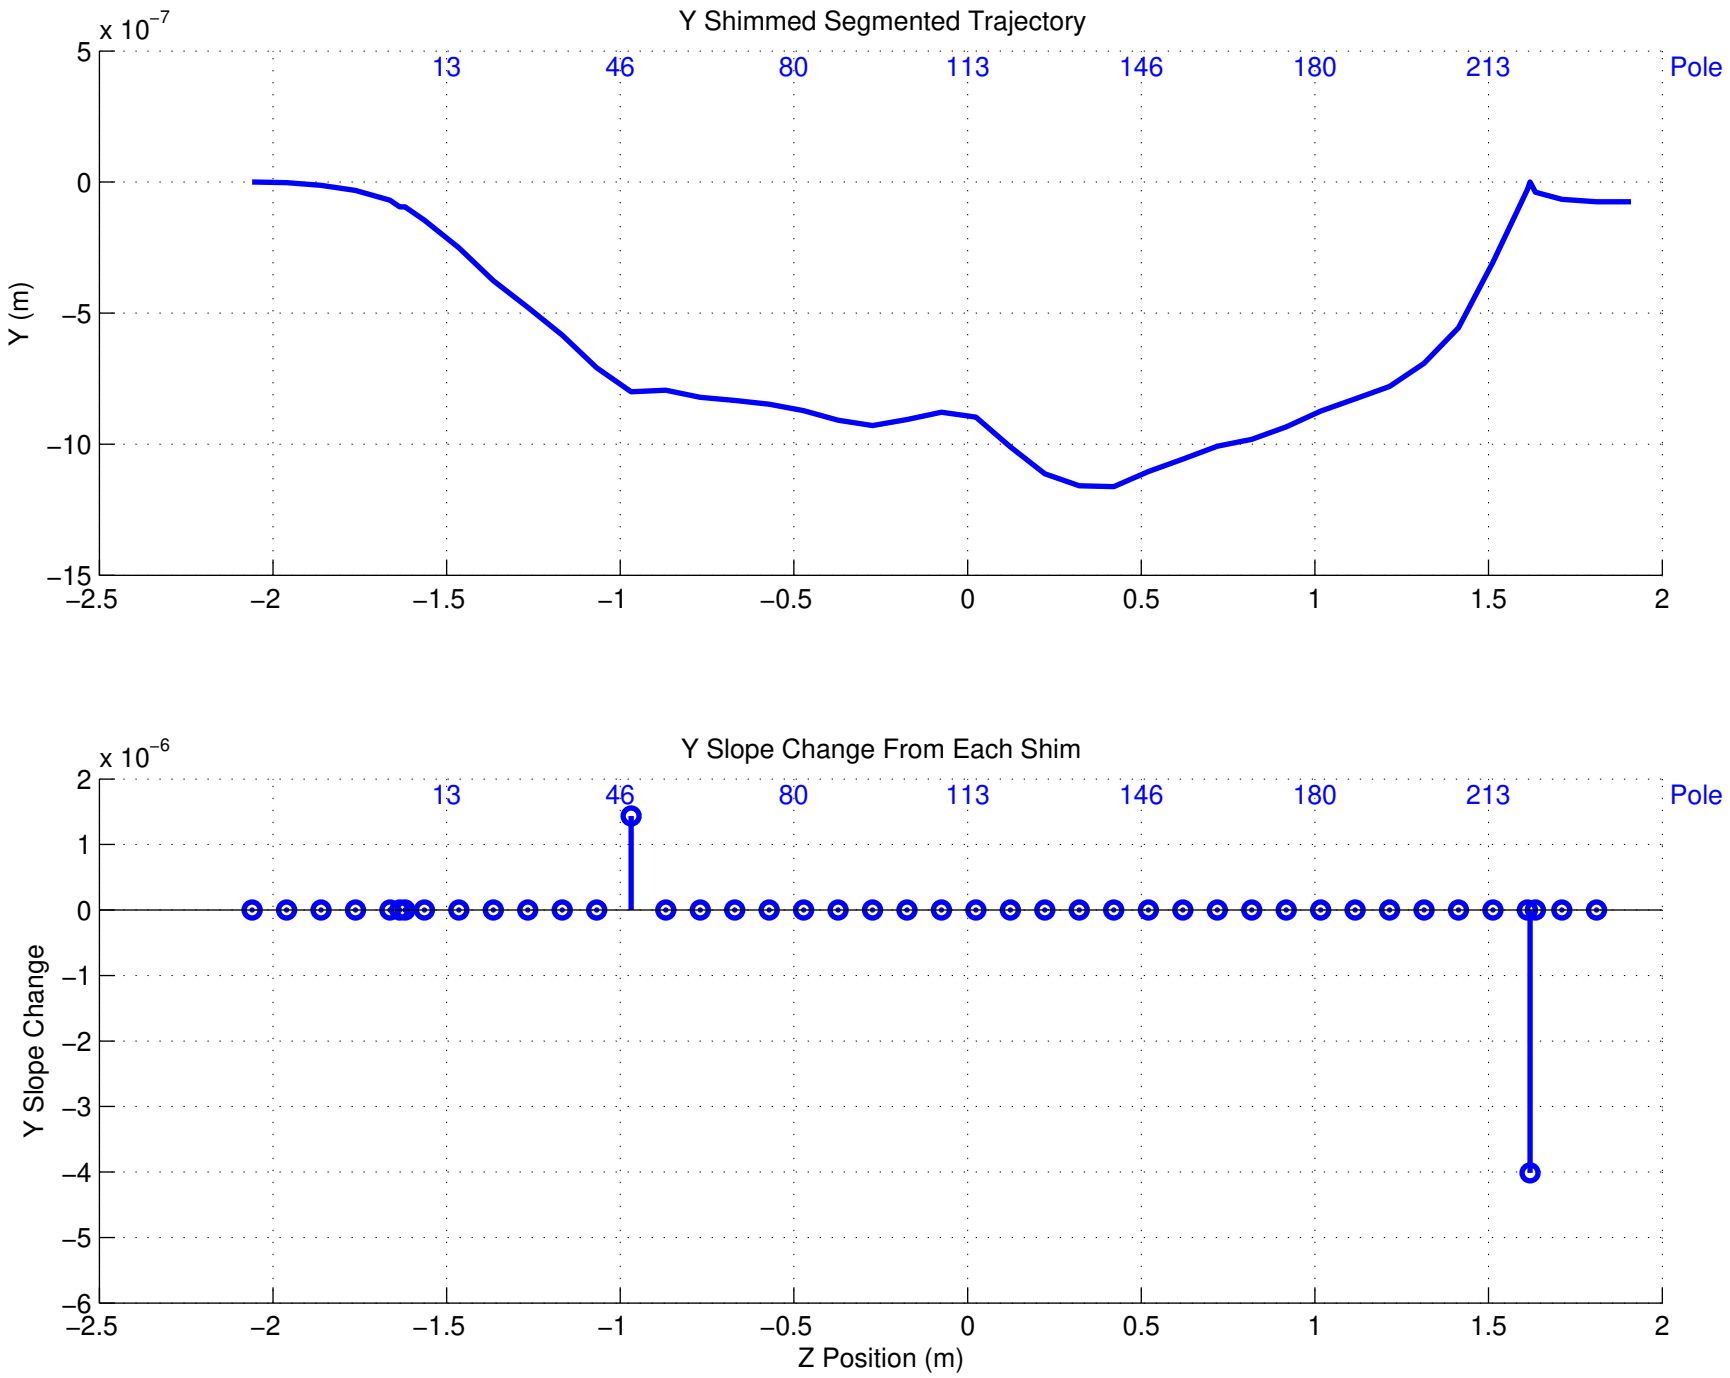
Y Shimmed Segmented Trajectory
x 10^-7
5
0
−5
−10
−15
Y (m)
13
46
80
113
146
180
213
Pole
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Y Slope Change From Each Shim
x 10^-6
2
1
0
−1
−2
−3
−4
−5
−6
Y Slope Change
Z Position (m)

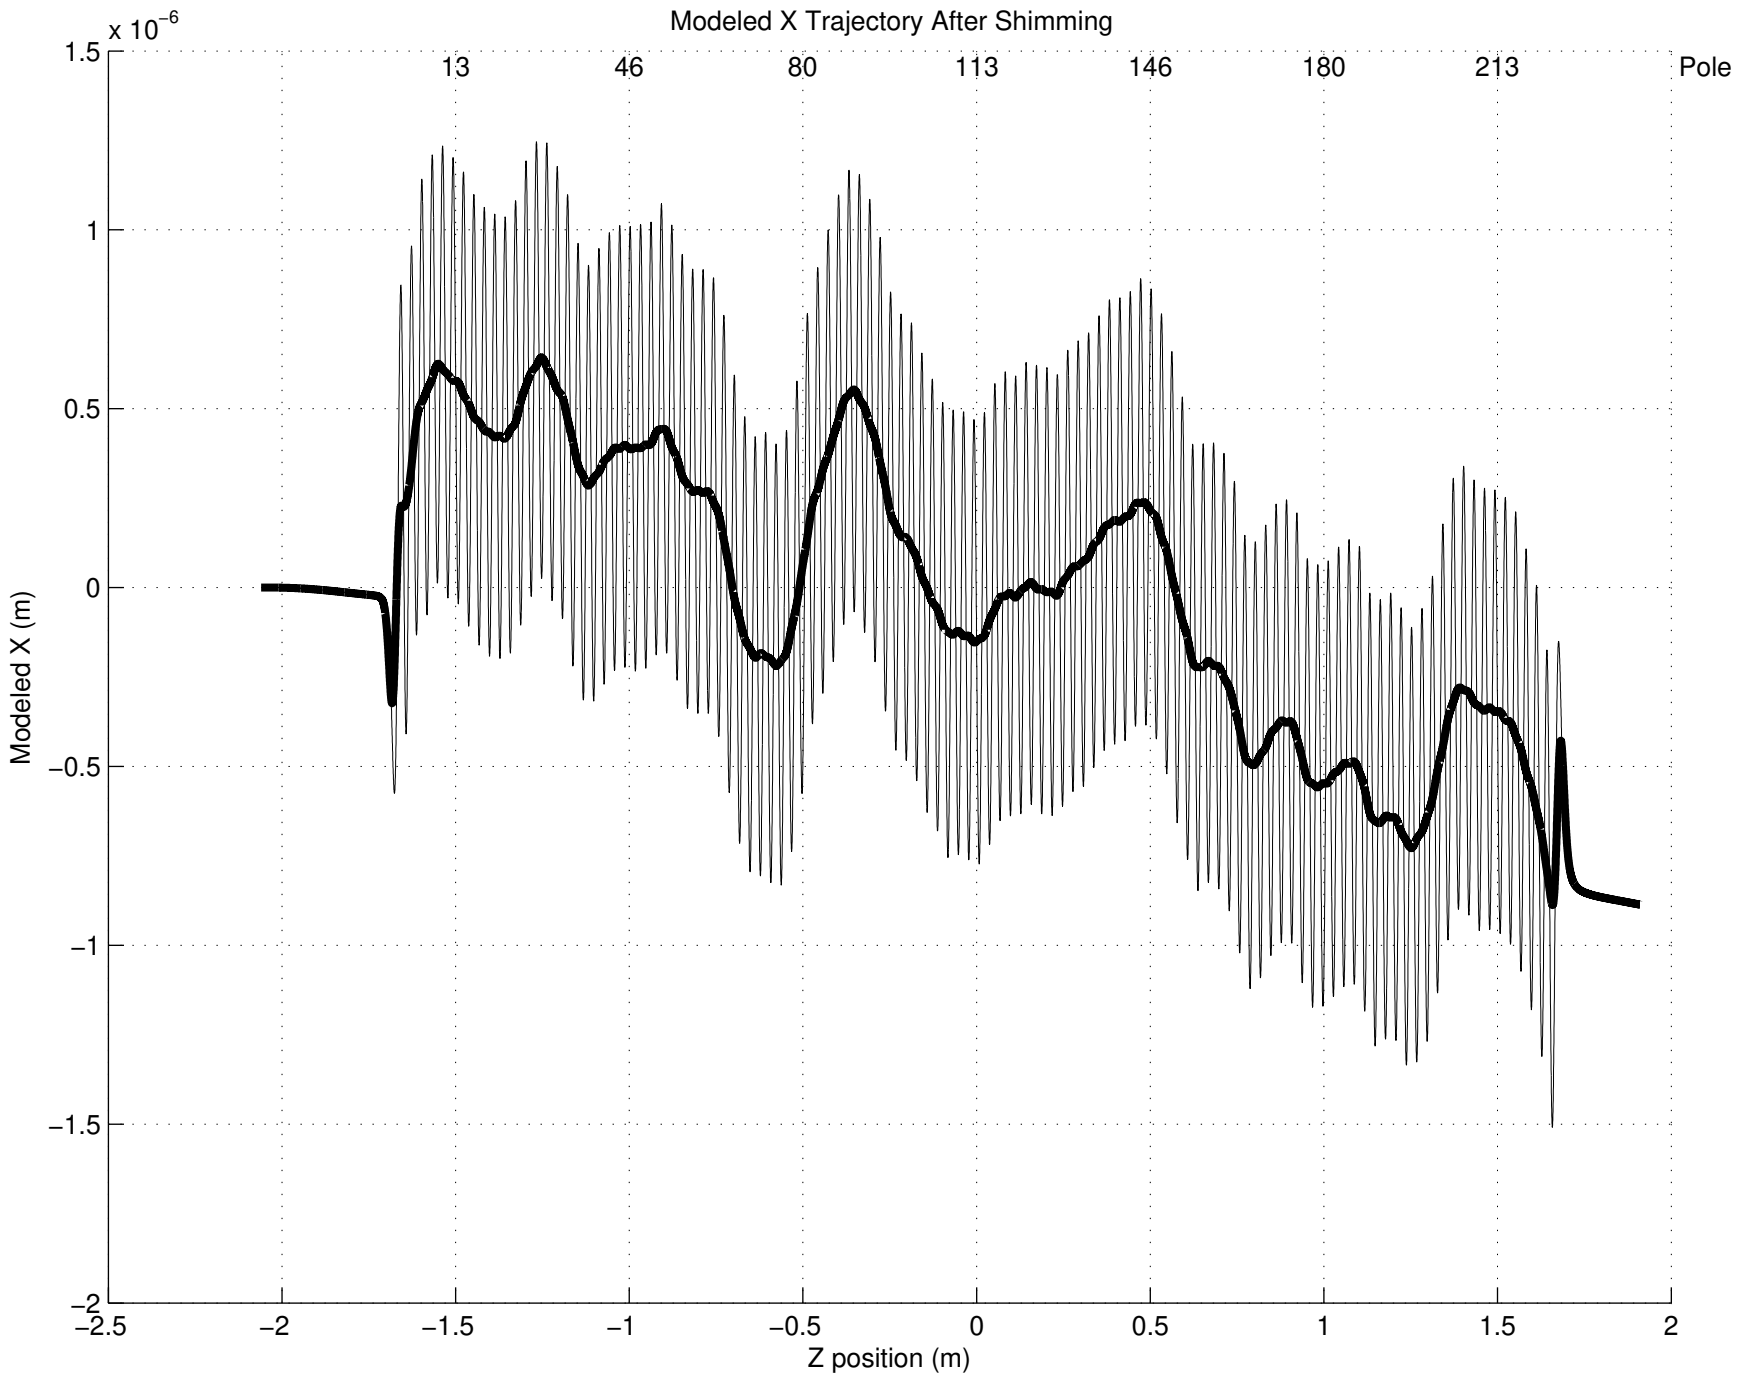
Modeled X Trajectory After Shimming
x 10^-6
13
46
80
113
146
180
213
Pole
1.5
1
0.5
0
−0.5
−1
−1.5
−2
Modeled X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

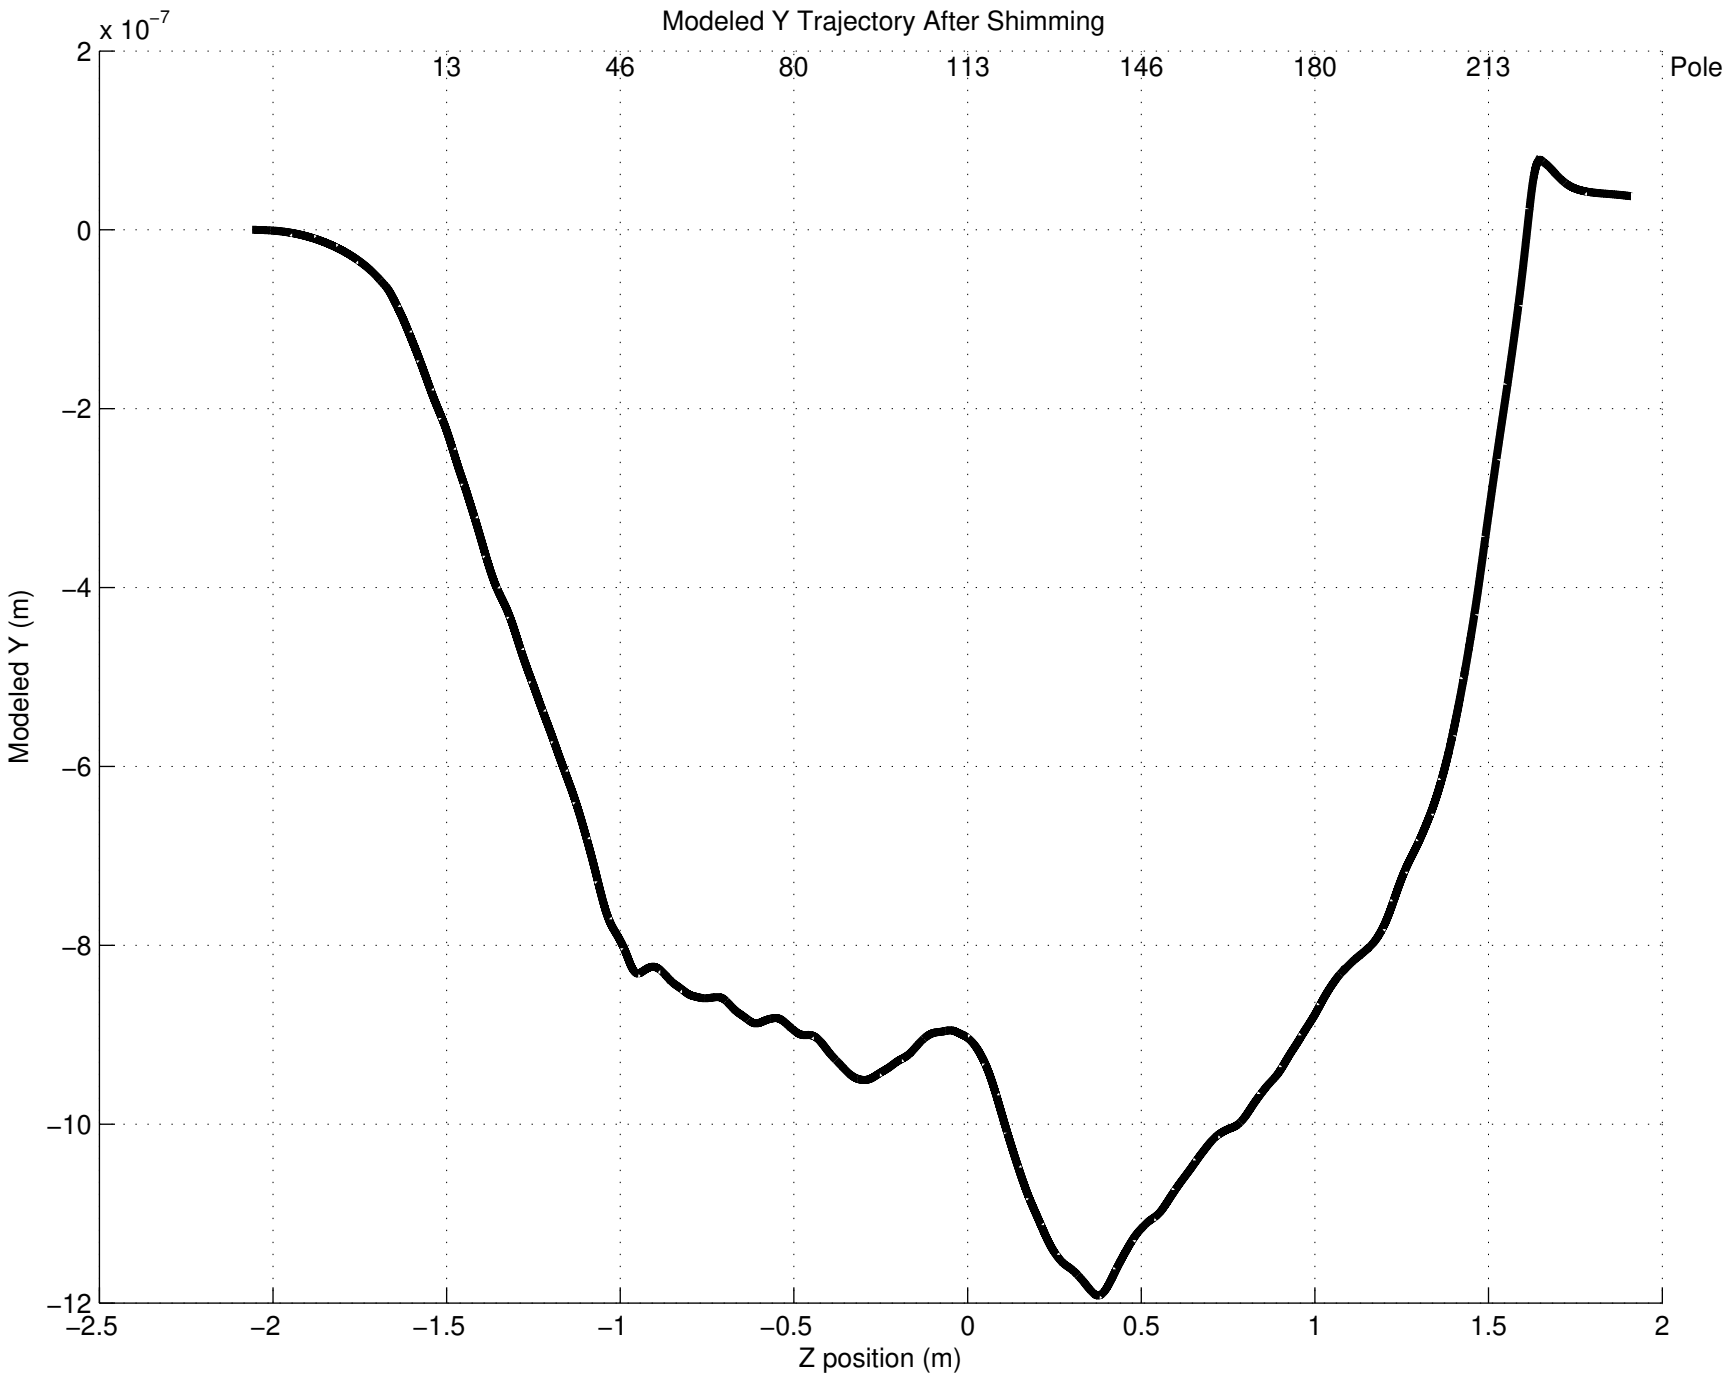
Modeled Y Trajectory After Shimming
x 10^-7
2
0
−2
−4
−6
−8
−10
−12
13
46
80
113
146
180
213
Pole
Modeled Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

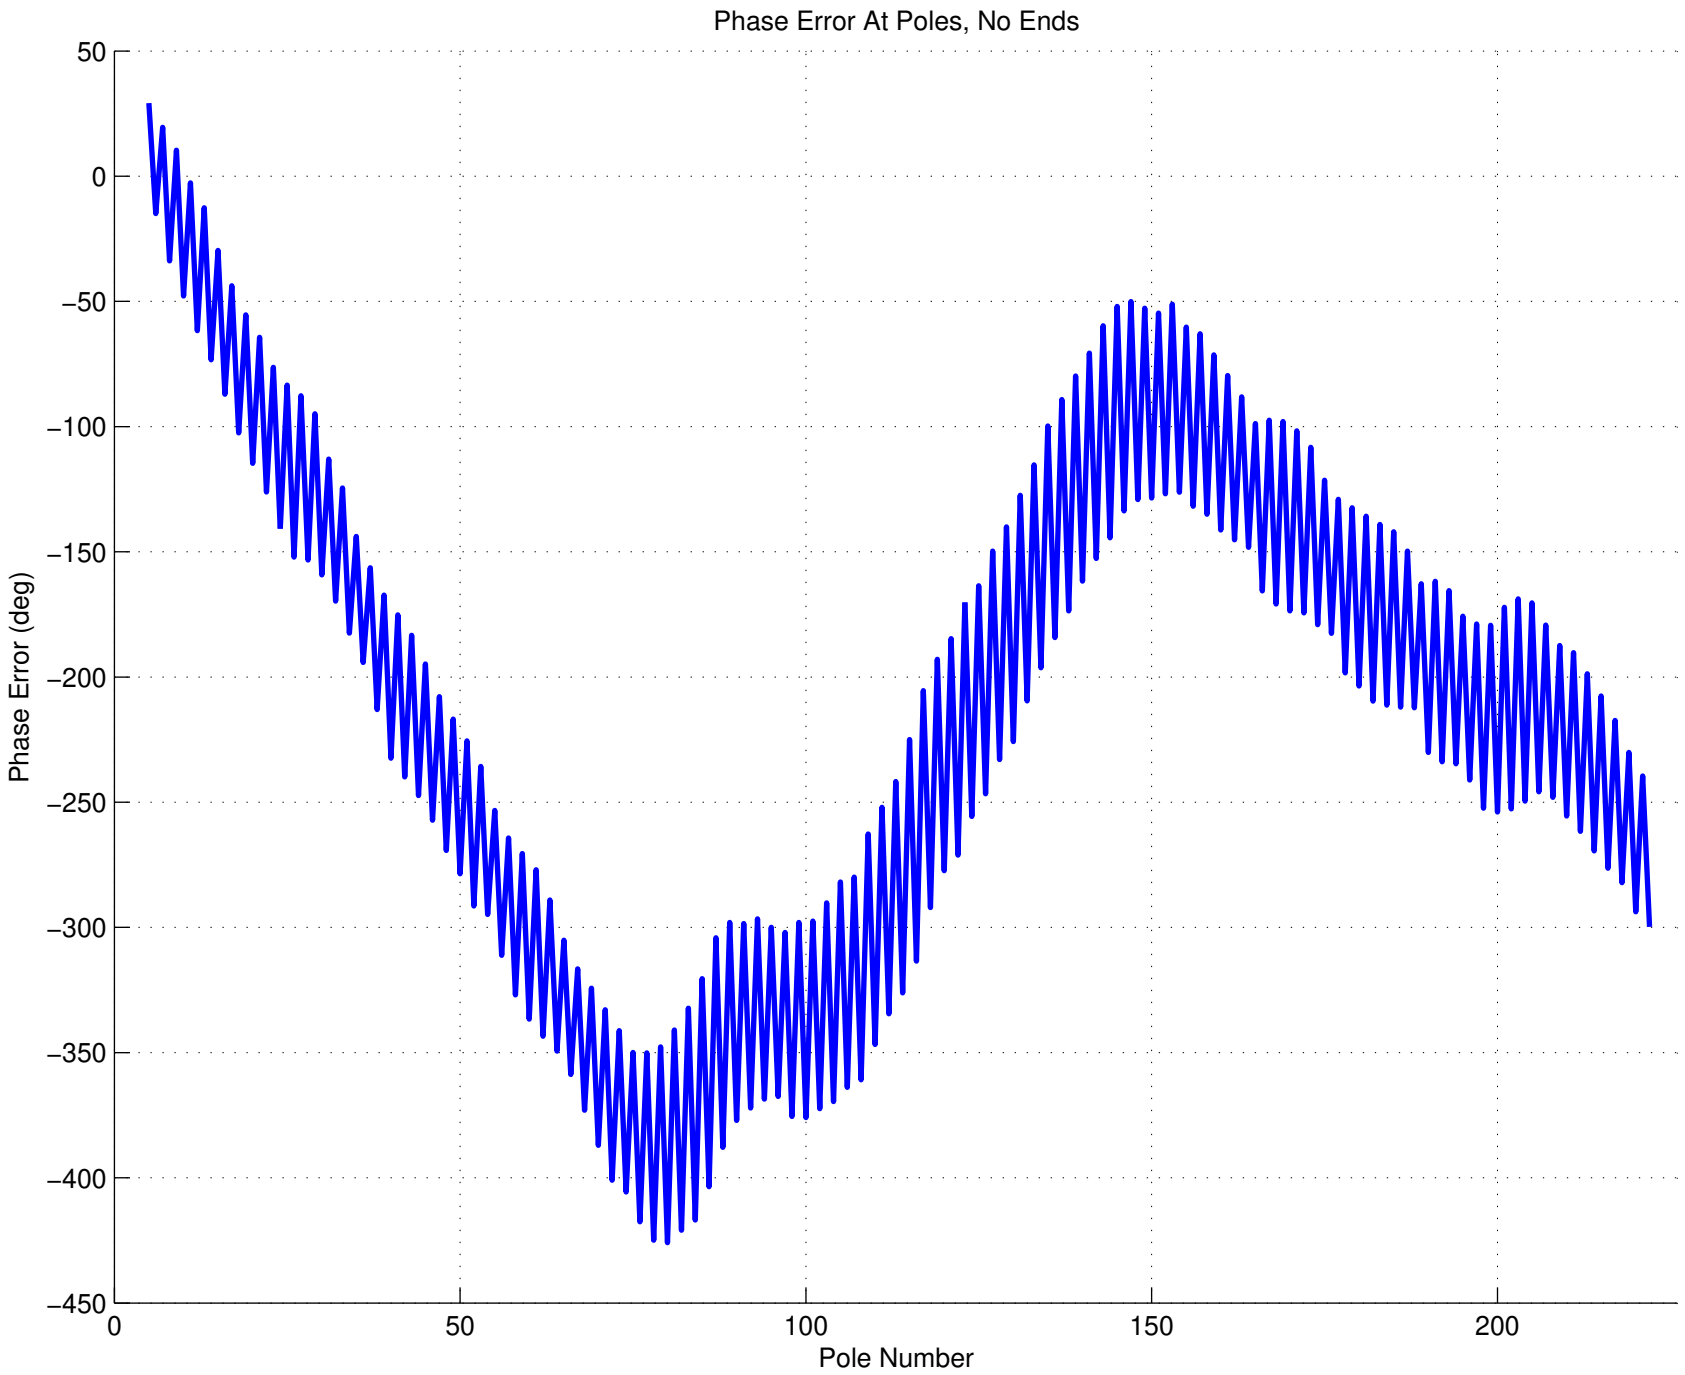
Phase Error At Poles, No Ends
Phase Error (deg)
Pole Number
50
0
−50
−100
−150
−200
−250
−300
−350
−400
−450
0
50
100
150
200

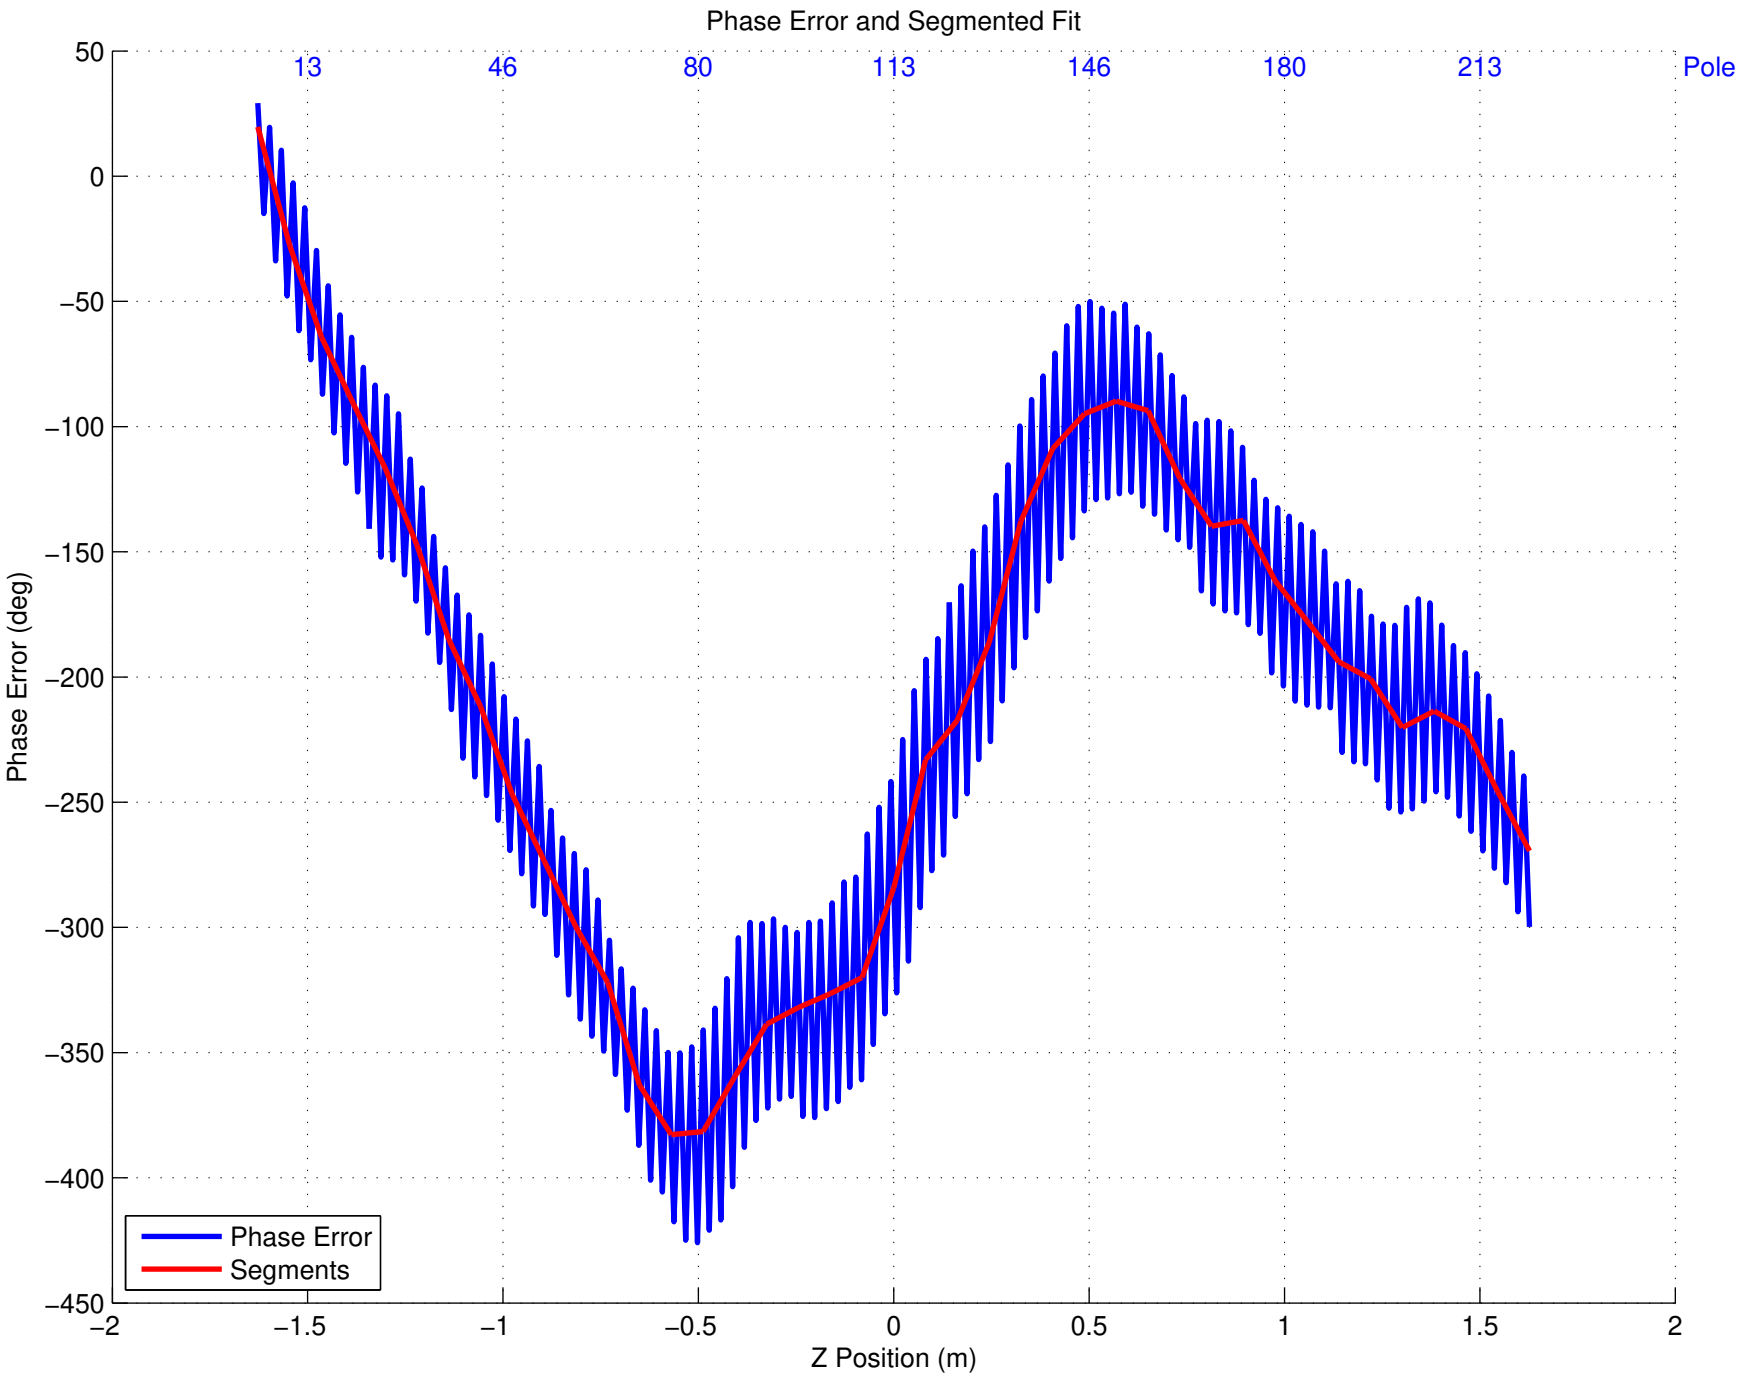
Phase Error and Segmented Fit
13
46
80
113
146
180
213
Pole
50
0
−50
−100
−150
−200
−250
−300
−350
−400
−450
Phase Error (deg)
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Phase Error
Segments

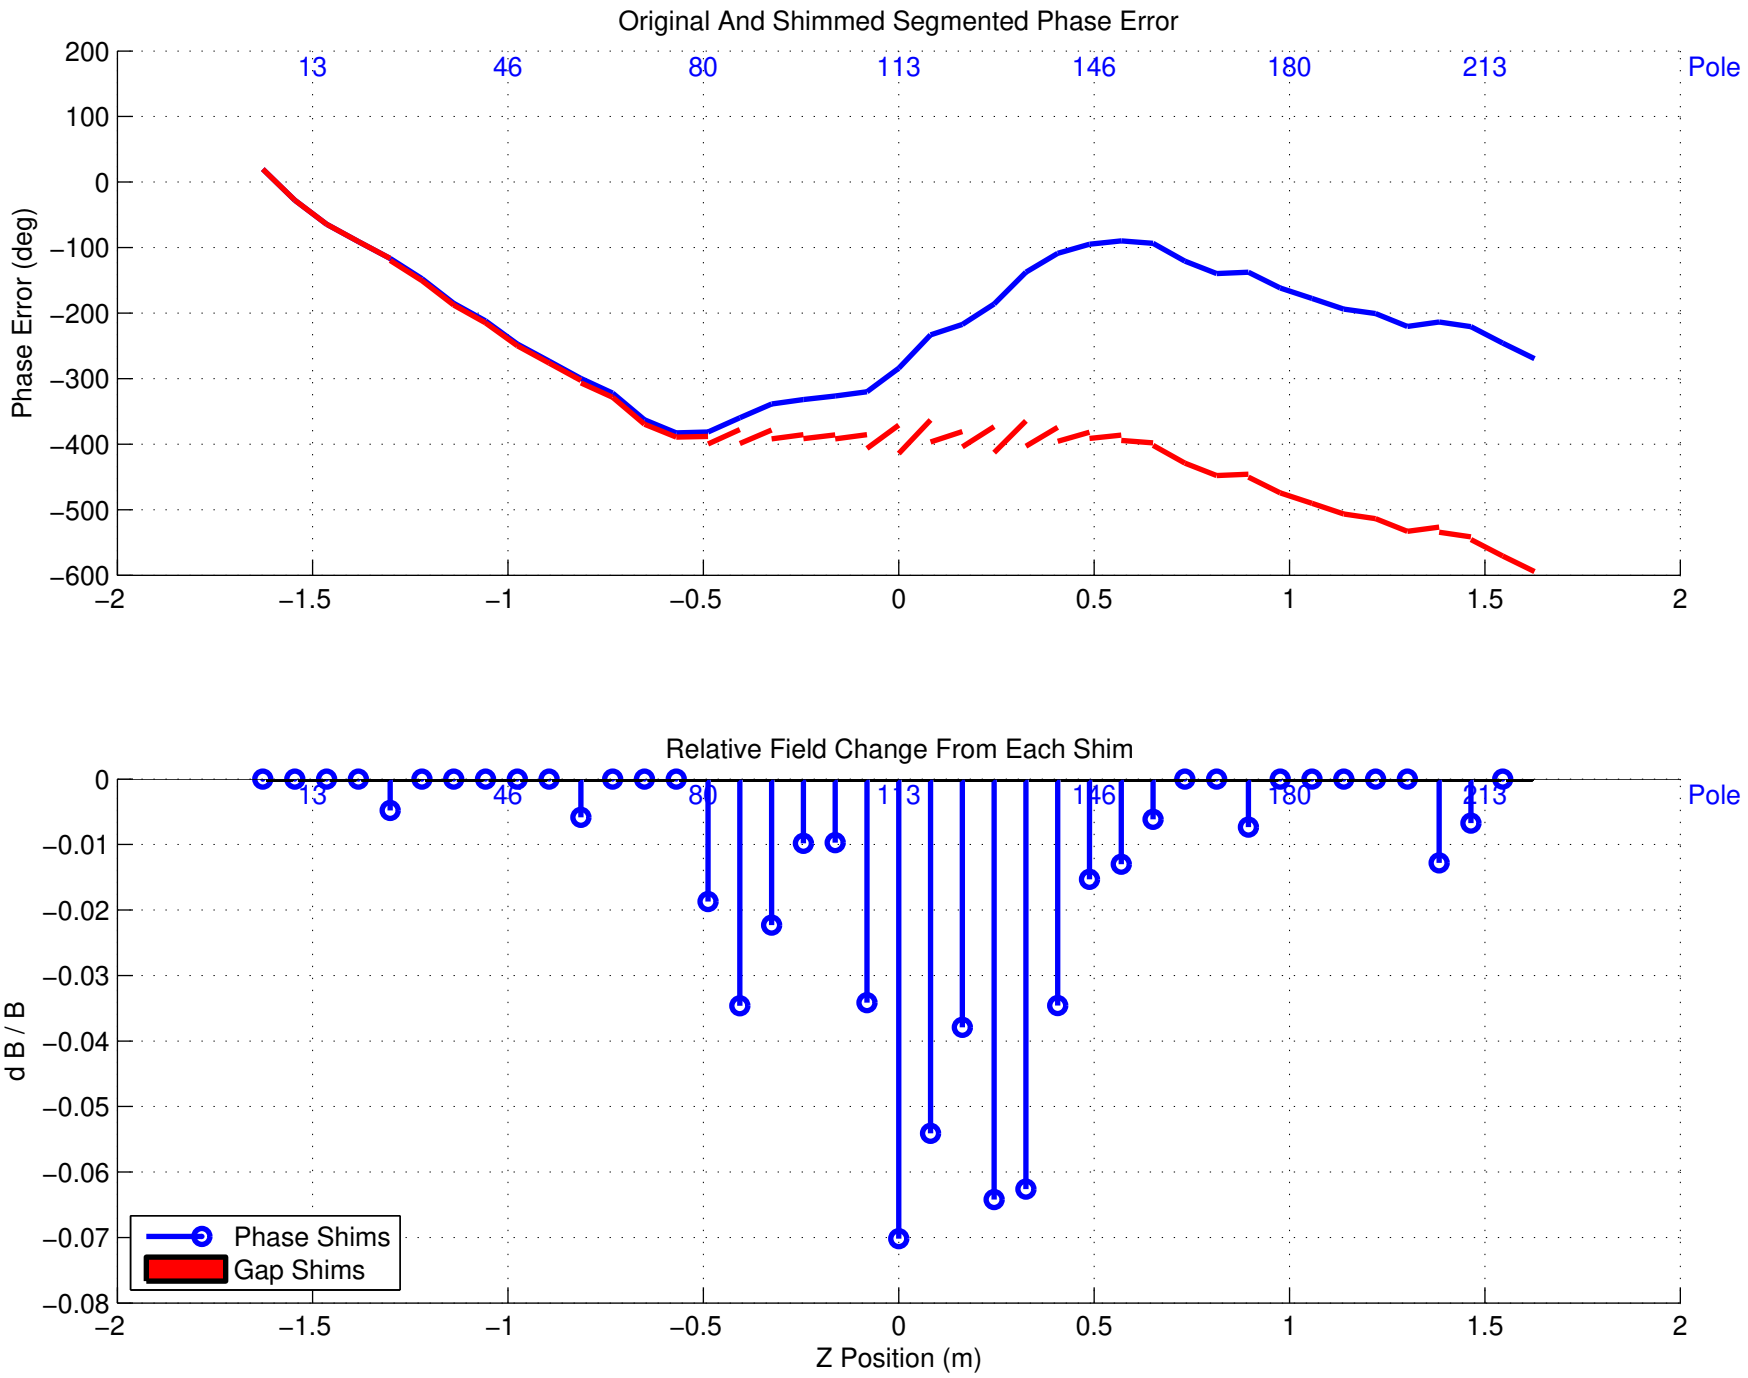
Original And Shimmed Segmented Phase Error
Phase Error (deg)
200
100
0
−100
−200
−300
−400
−500
−600
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
d B / B
0
−0.01
−0.02
−0.03
−0.04
−0.05
−0.06
−0.07
−0.08
Phase Shims
Gap Shims
Z Position (m)

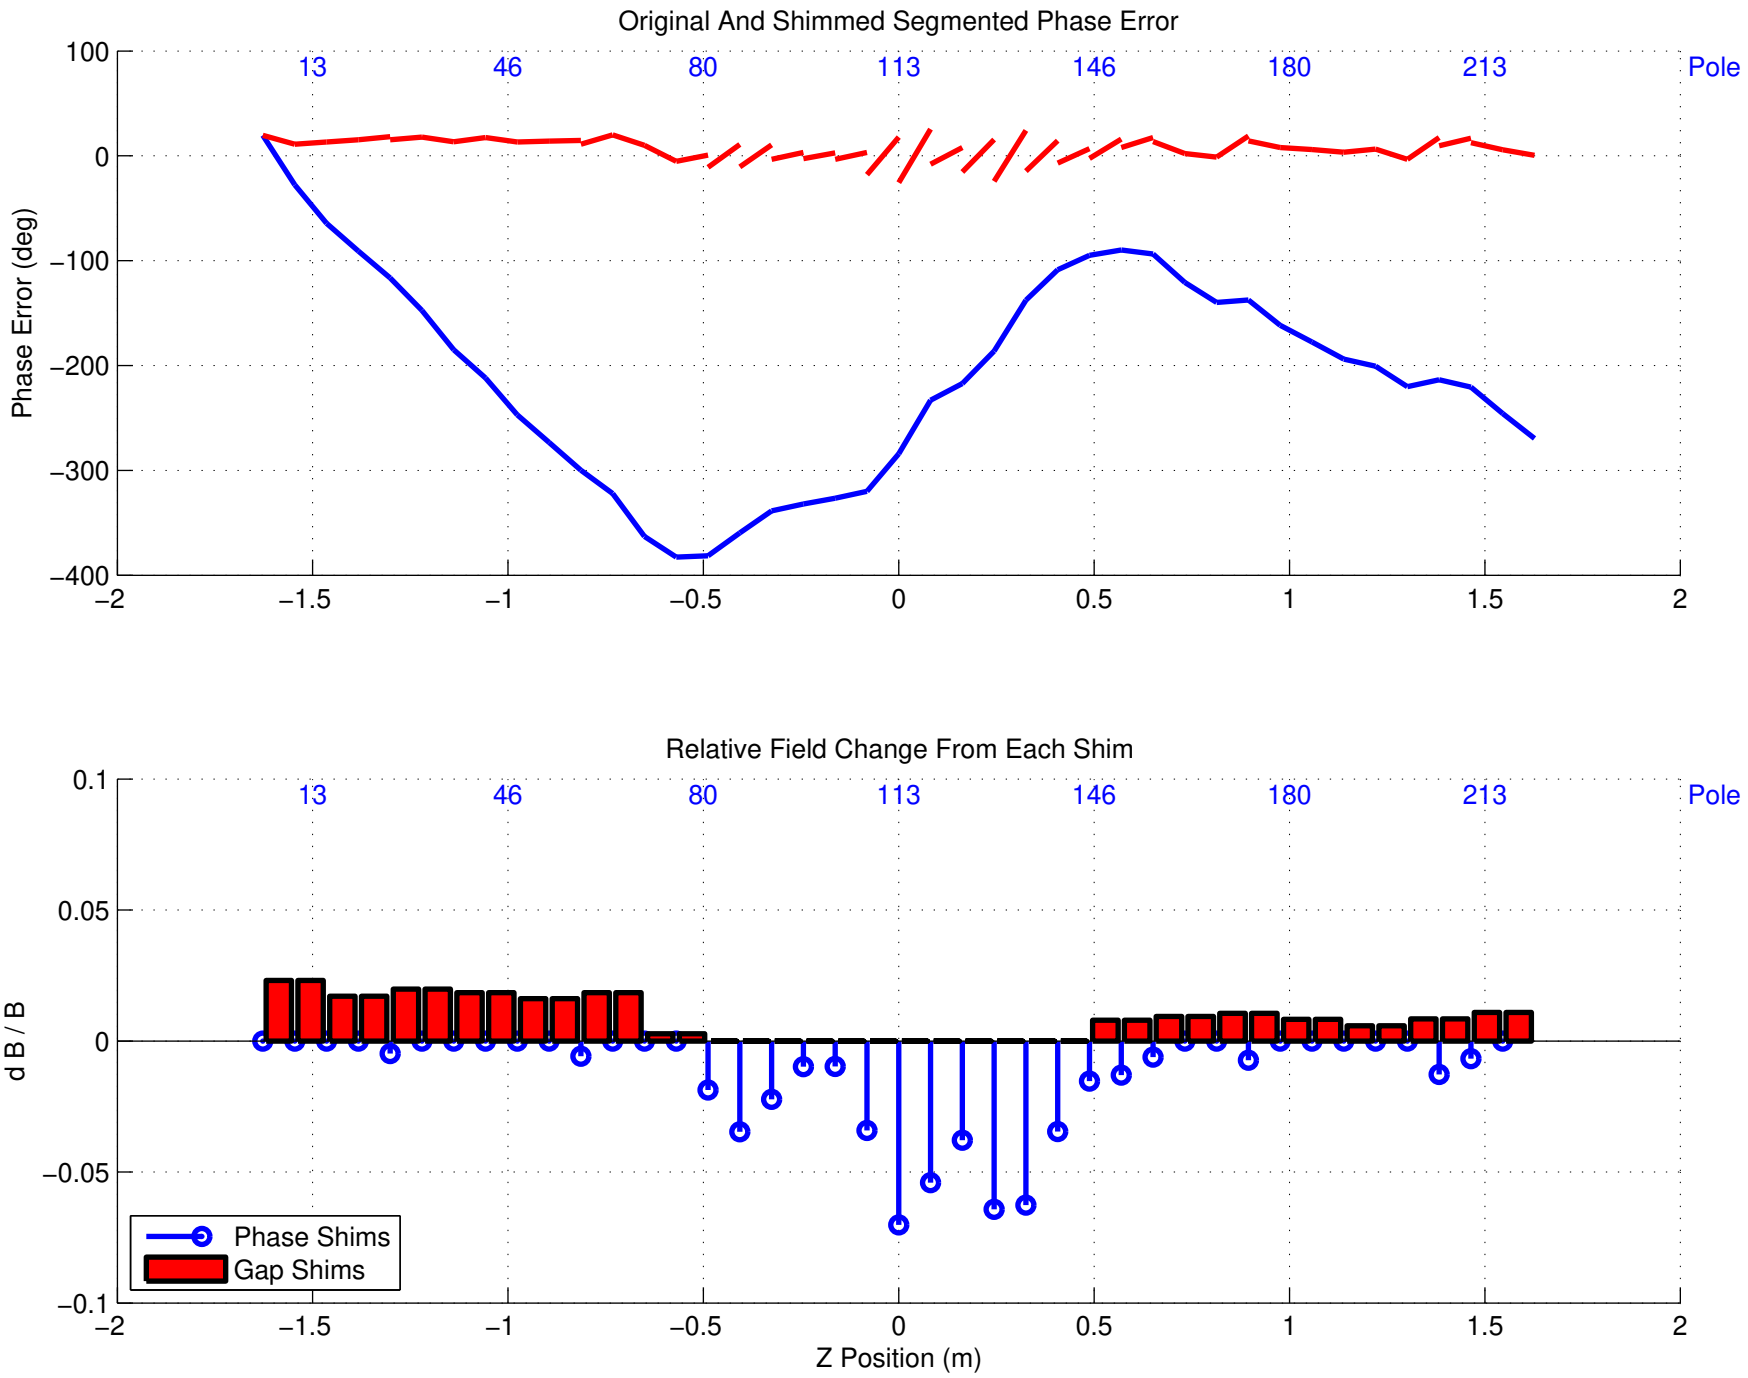
Original And Shimmed Segmented Phase Error
Phase Error (deg)
100
0
−100
−200
−300
−400
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
d B / B
0.1
0.05
0
−0.05
−0.1
Phase Shims
Gap Shims
Z Position (m)

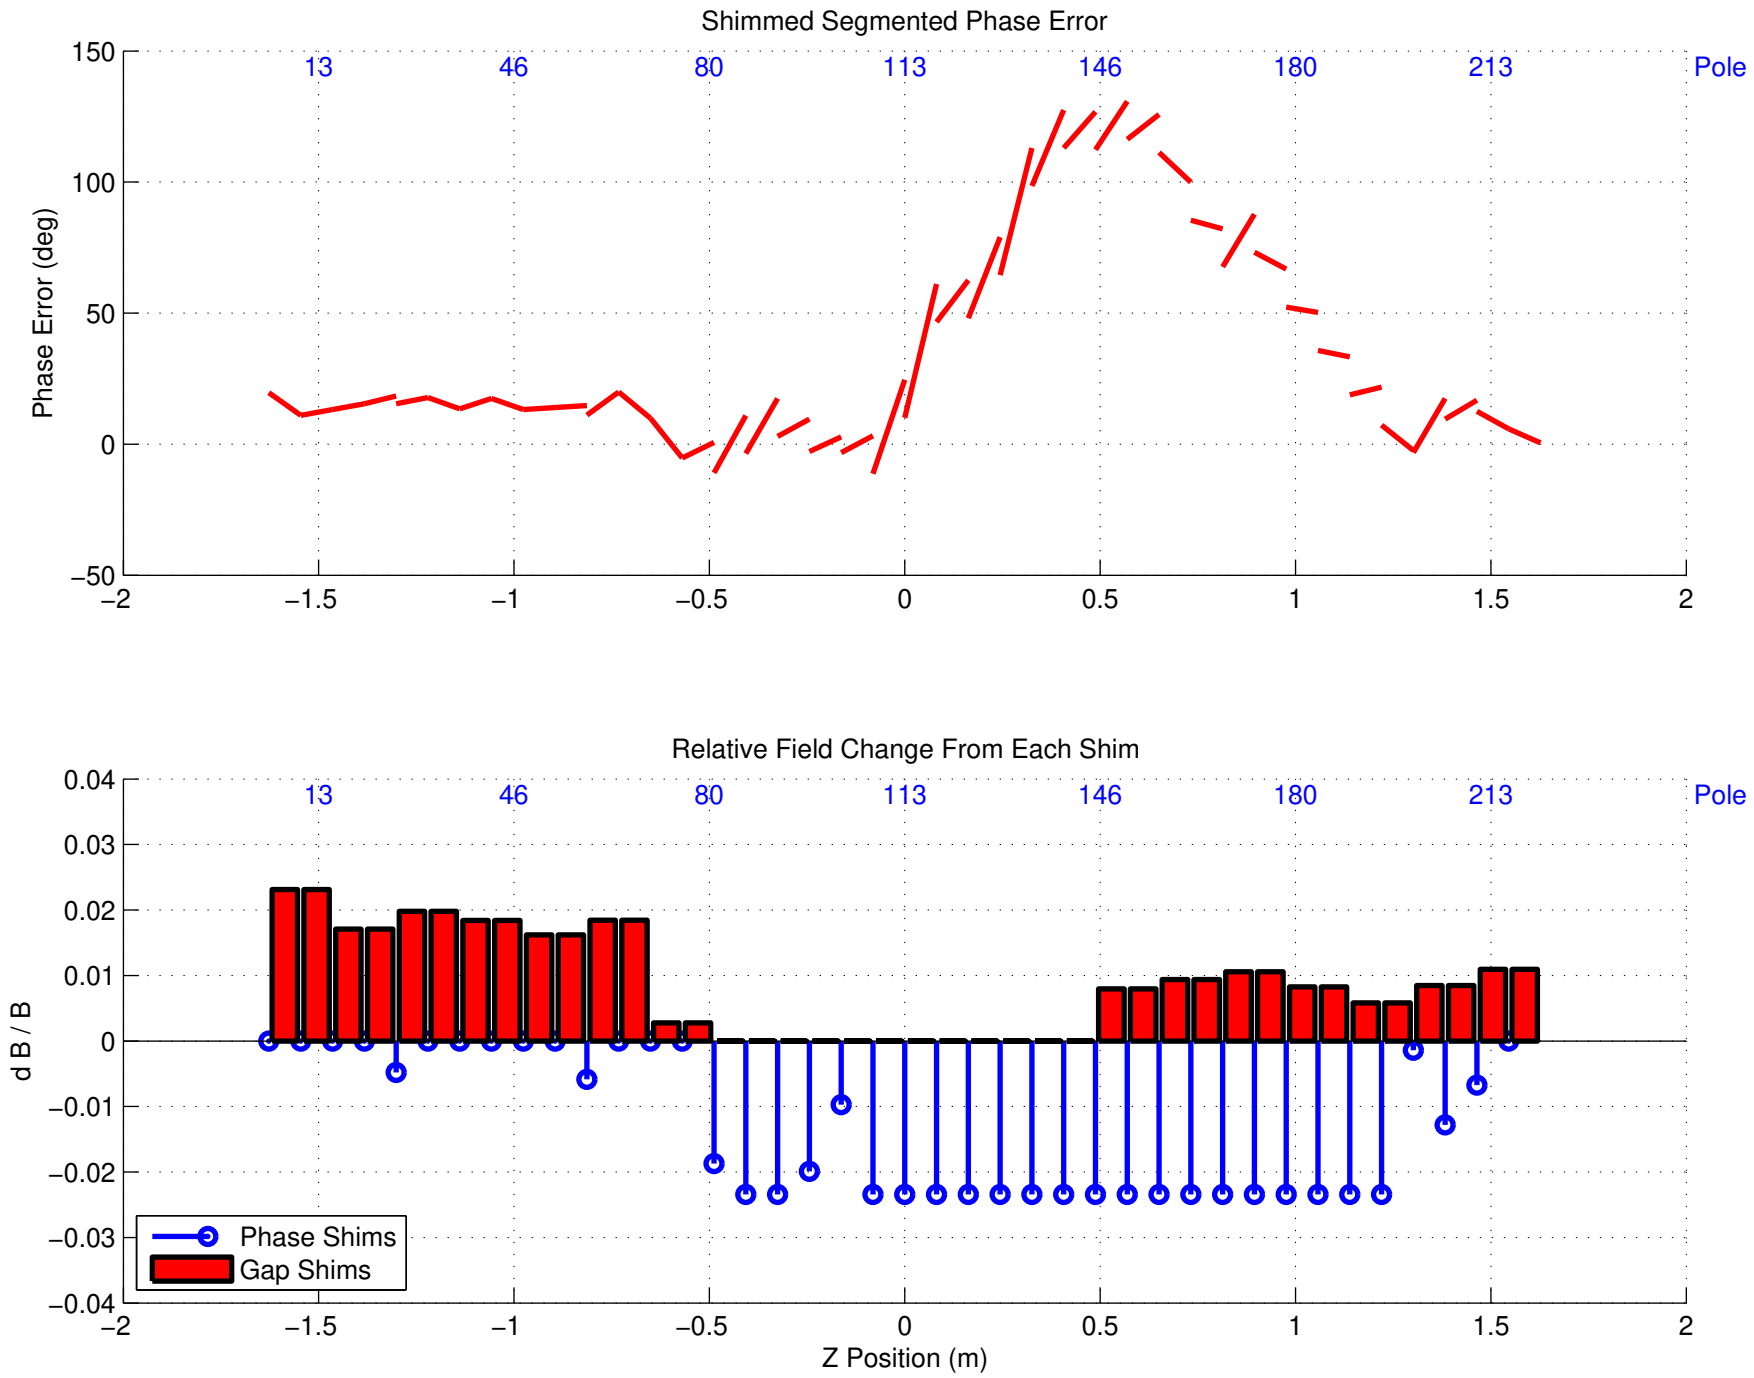
Shimmed Segmented Phase Error
Phase Error (deg)
150
100
50
0
−50
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
d B / B
0.04
0.03
0.02
0.01
0
−0.01
−0.02
−0.03
−0.04
Phase Shims
Gap Shims
Z Position (m)

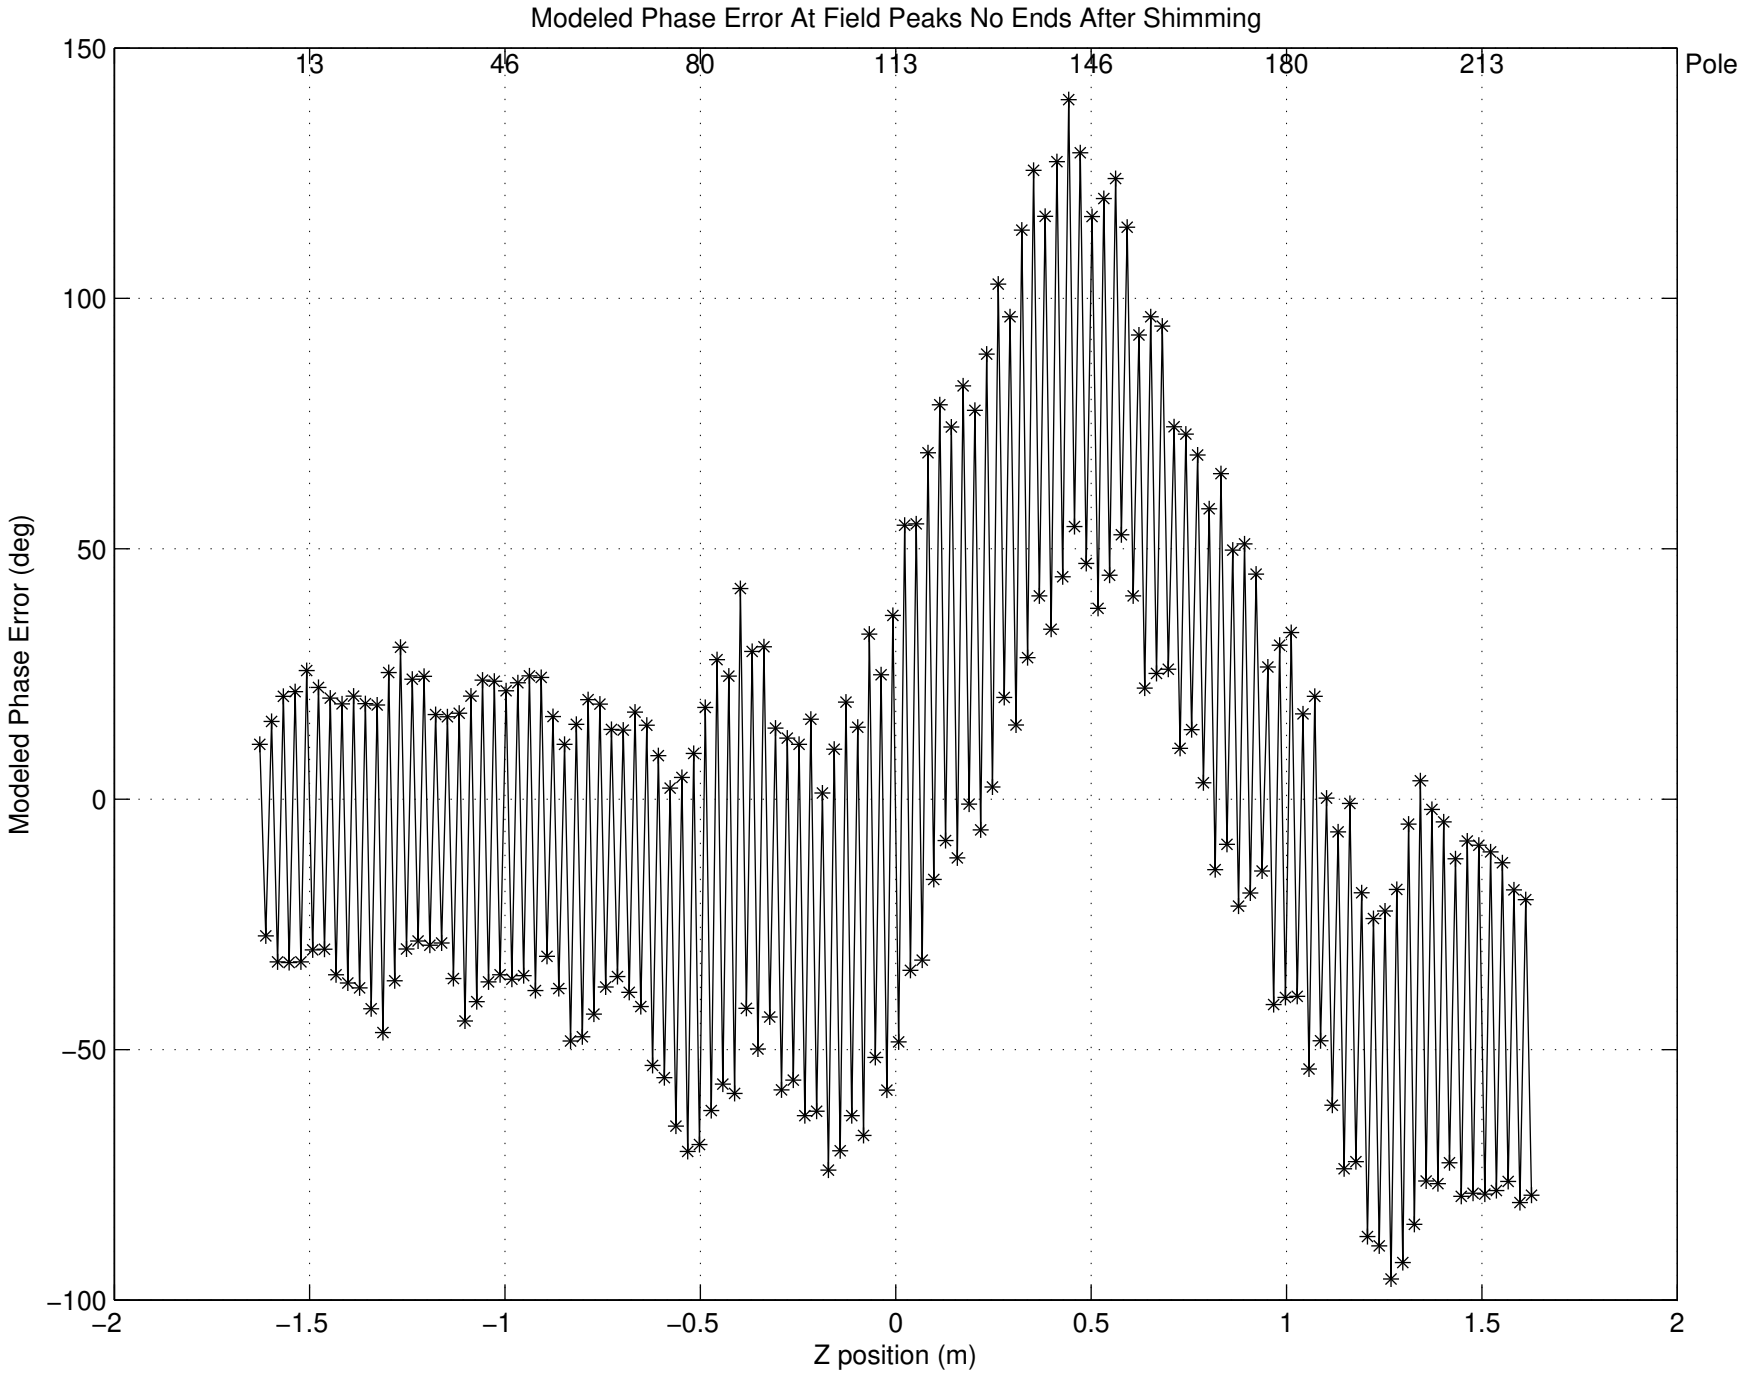

Phase Error: Ave = 0.000000 deg, RMS = 51.474711 deg