```
SLAC Magnetic Measurements

Hall Probe Array Analysis
*************************

Parameters:
INPUT-FILE-DIR =V:\MET\MagServe\MagData\DELTA\Delta Data 2015\New Measurements\Run 137 HD Spreadsheet 260 Meas\N
INPUT-FILE-NAME =DUTestOutput.dat
INPUT-FILE-TYPE =ZVXYZVXYZH
UND-POL-MODE =N208          K scan Mode -8 Kd1.5453 Kind 2
PROBE1-BX-CALIB-FILE =V:\MET\MagServe\MagData\DELTA\Delta Data 2015\New Measurements\Yurii Hall Probe Calibrations\S
PROBE1-BY-CALIB-FILE =V:\MET\MagServe\MagData\DELTA\Delta Data 2015\New Measurements\Yurii Hall Probe Calibrations\S
PROBE2-BX-CALIB-FILE =V:\MET\MagServe\MagData\DELTA\Delta Data 2015\New Measurements\Yurii Hall Probe Calibrations\S
PROBE2-BY-CALIB-FILE =V:\MET\MagServe\MagData\DELTA\Delta Data 2015\New Measurements\Yurii Hall Probe Calibrations\S
NUM-ZERO-GAUSS-MEAS =200
PROBE2-OFFSET-DIR =Y
```

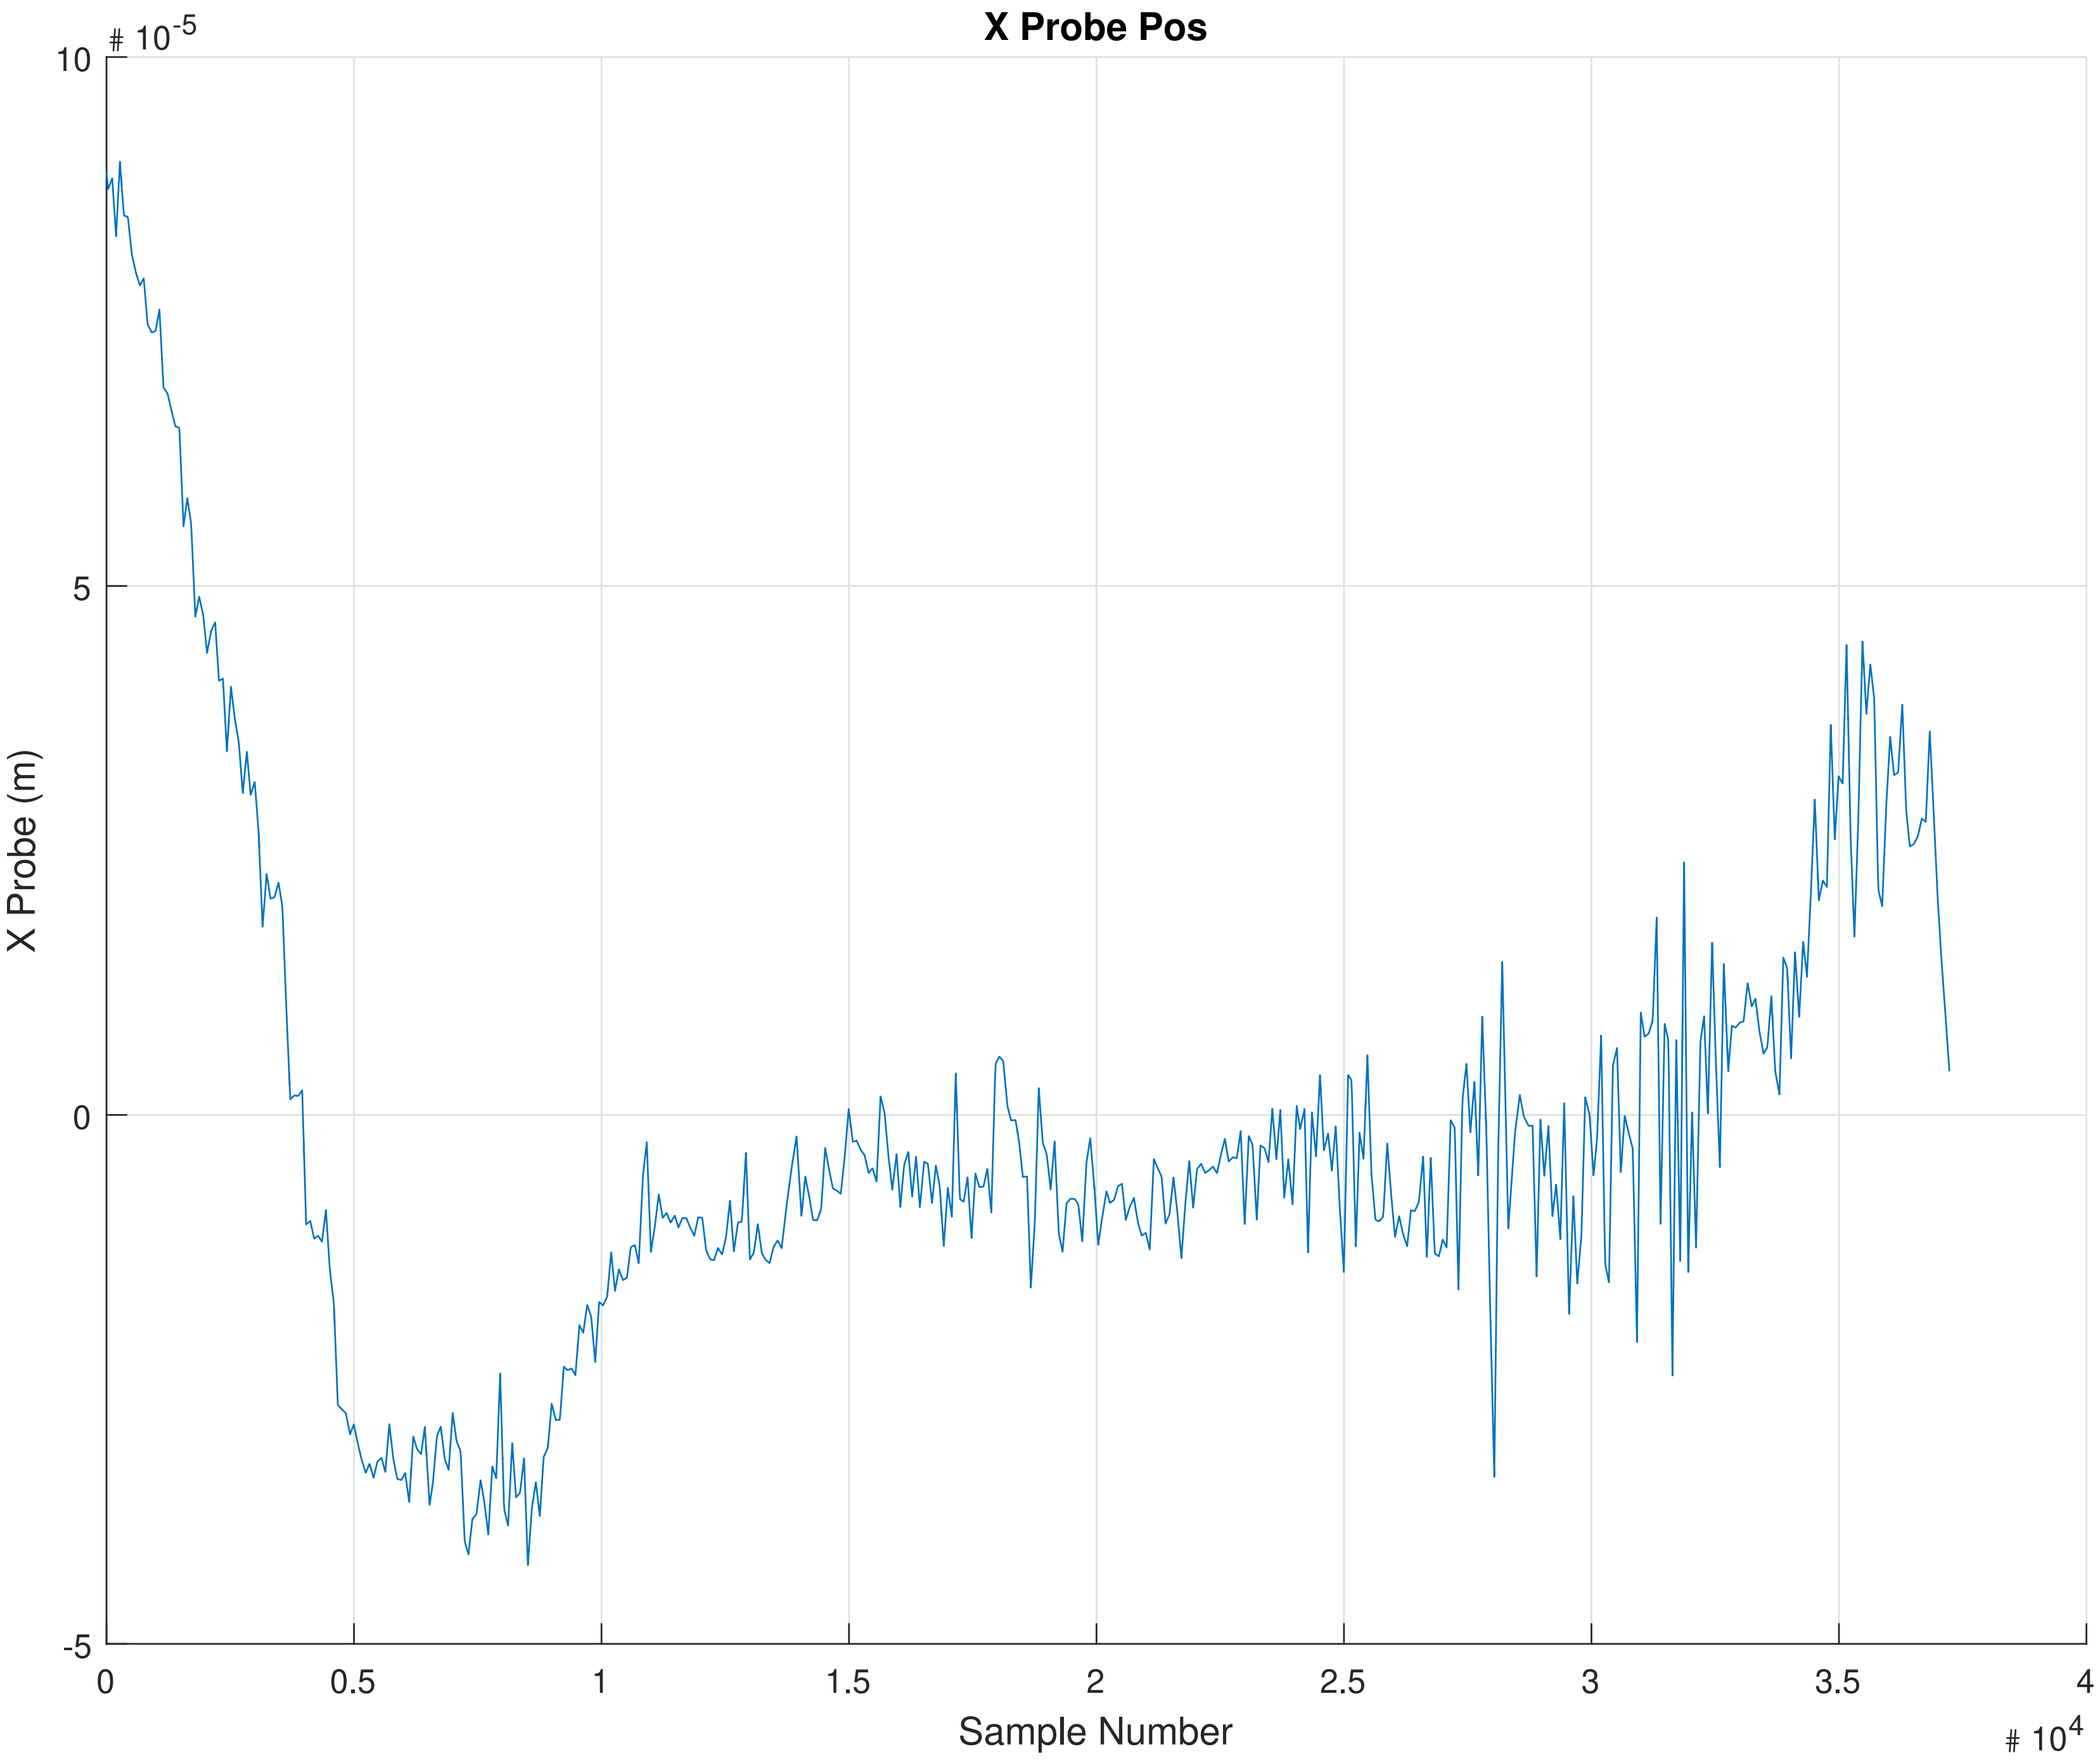
X Probe Pos
10-5
10
5
0
-5
X Probe (m)
0
0.5
1
1.5
2
2.5
3
3.5
4
Sample Number
10^4

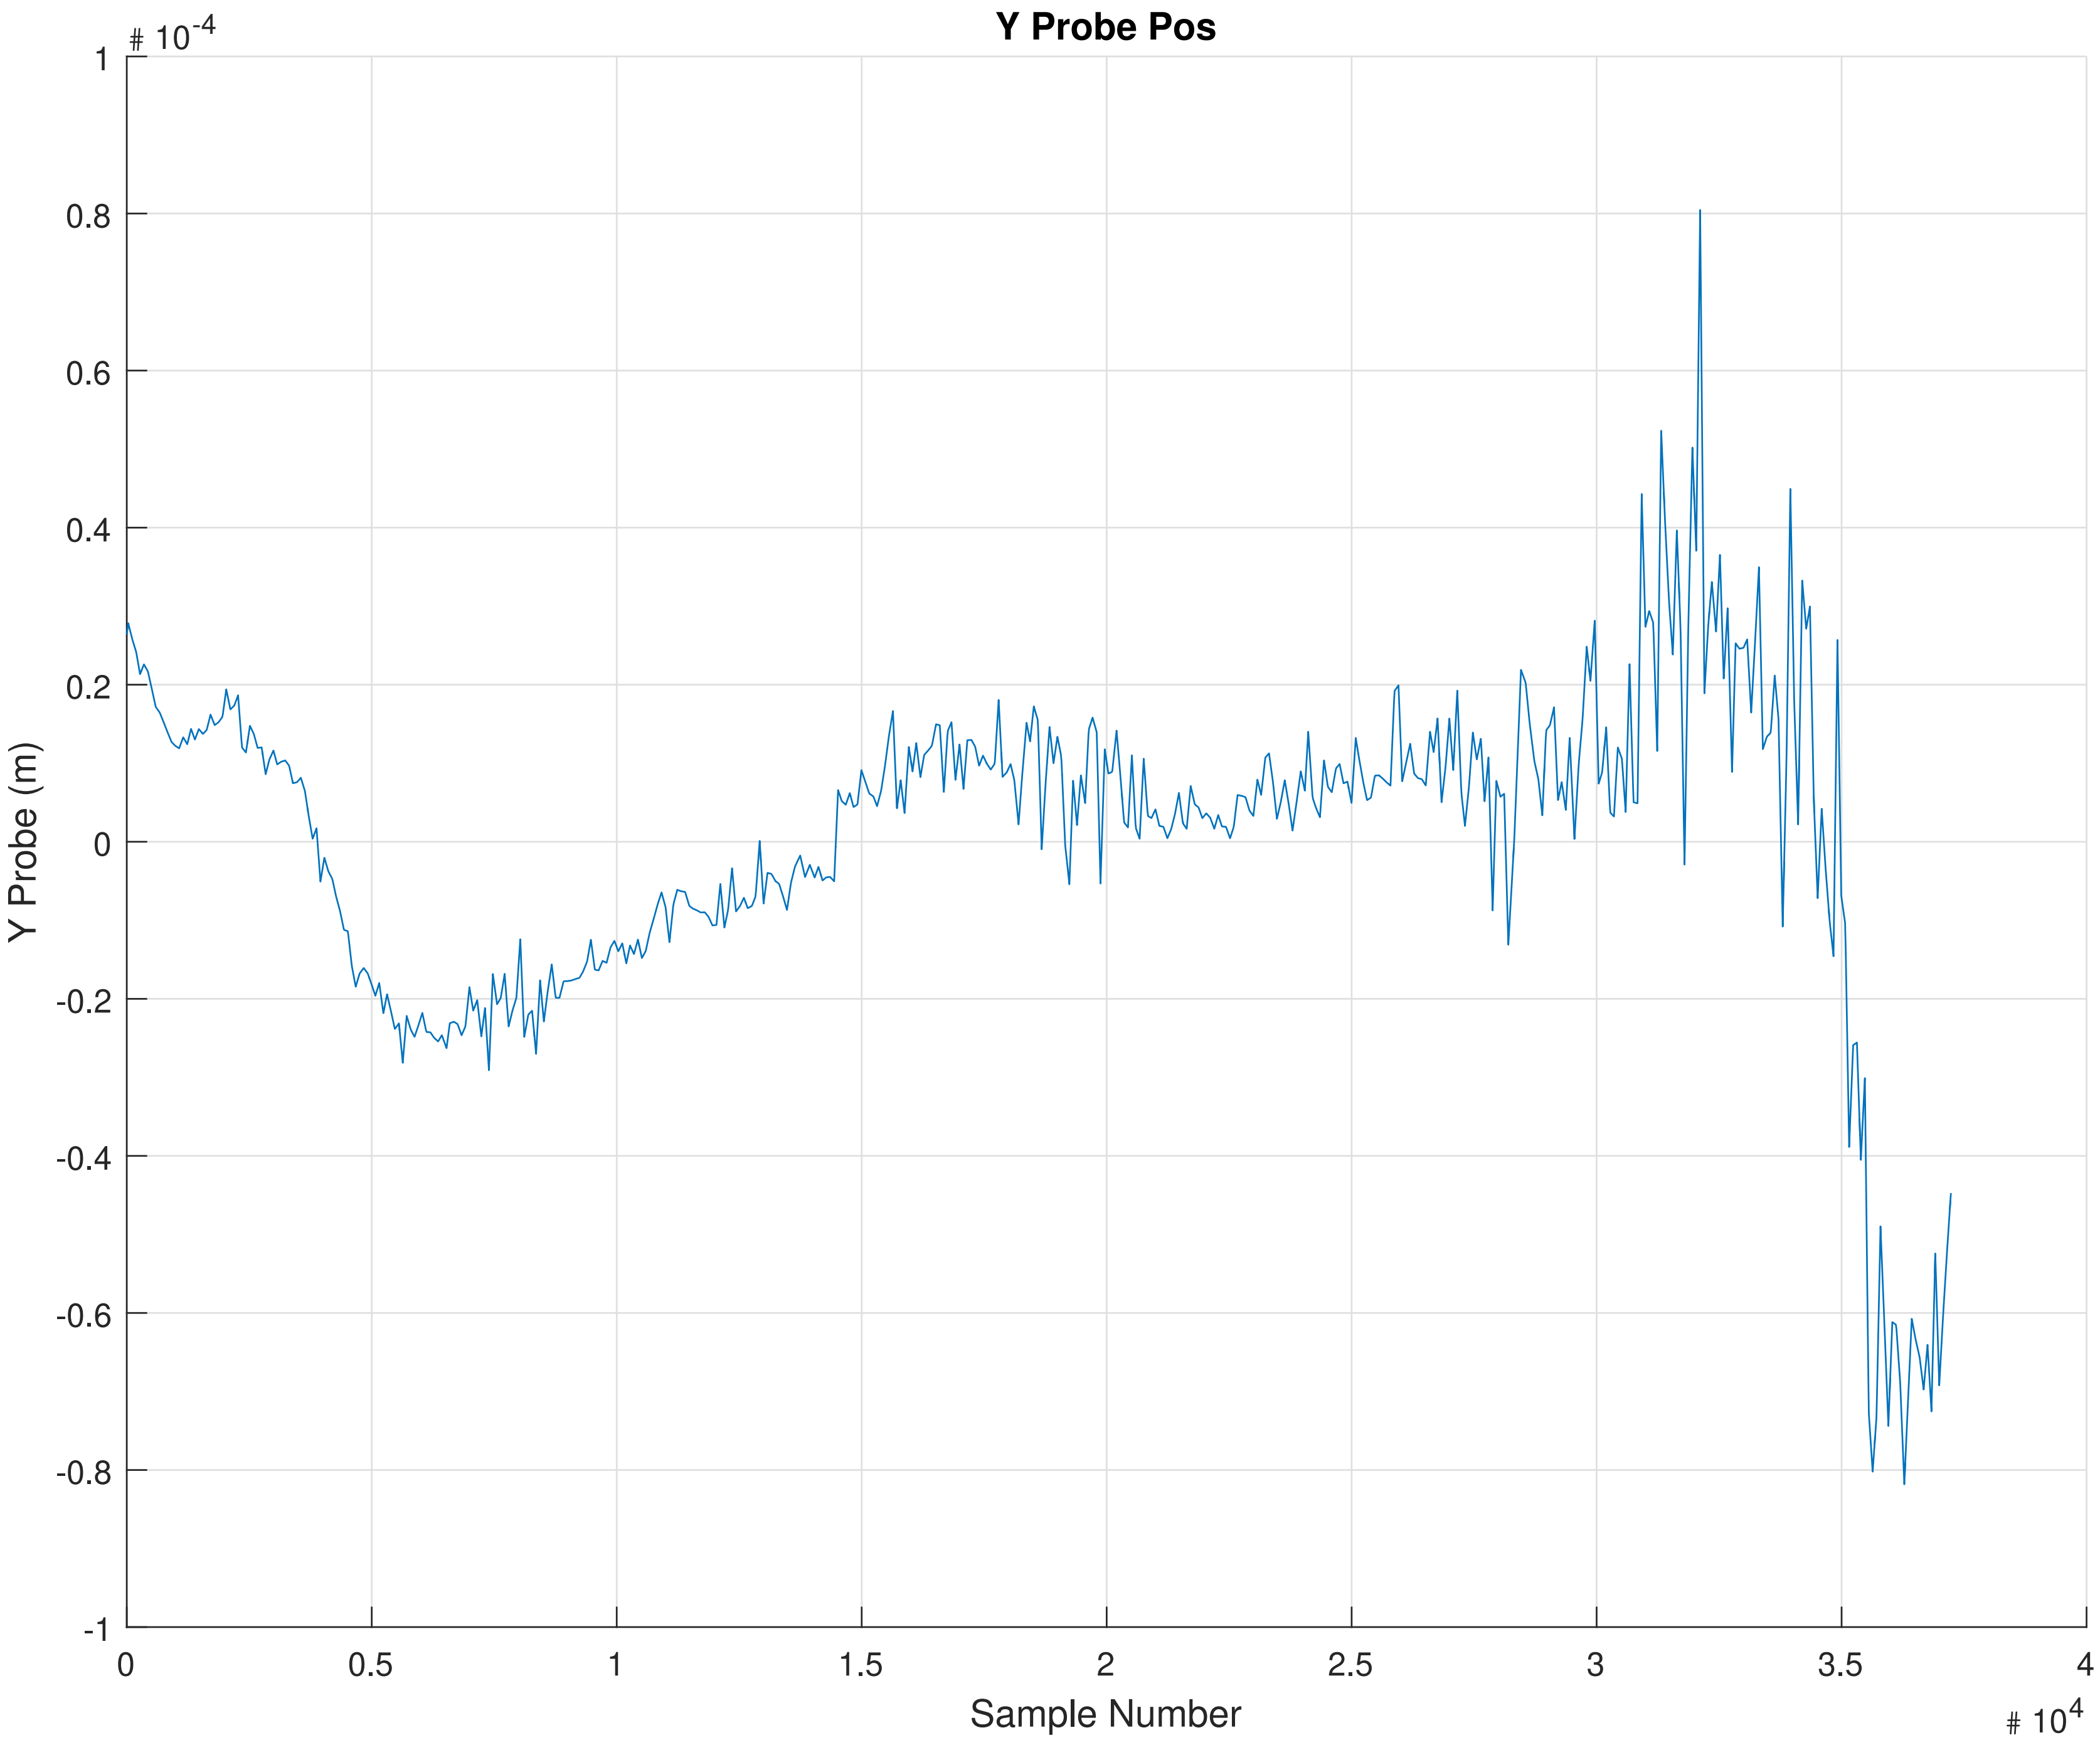
Y Probe Pos
10^-4
1
0.8
0.6
0.4
0.2
0
-0.2
-0.4
-0.6
-0.8
-1
Y Probe (m)
0
0.5
1
1.5
2
2.5
3
3.5
4
Sample Number
10^4

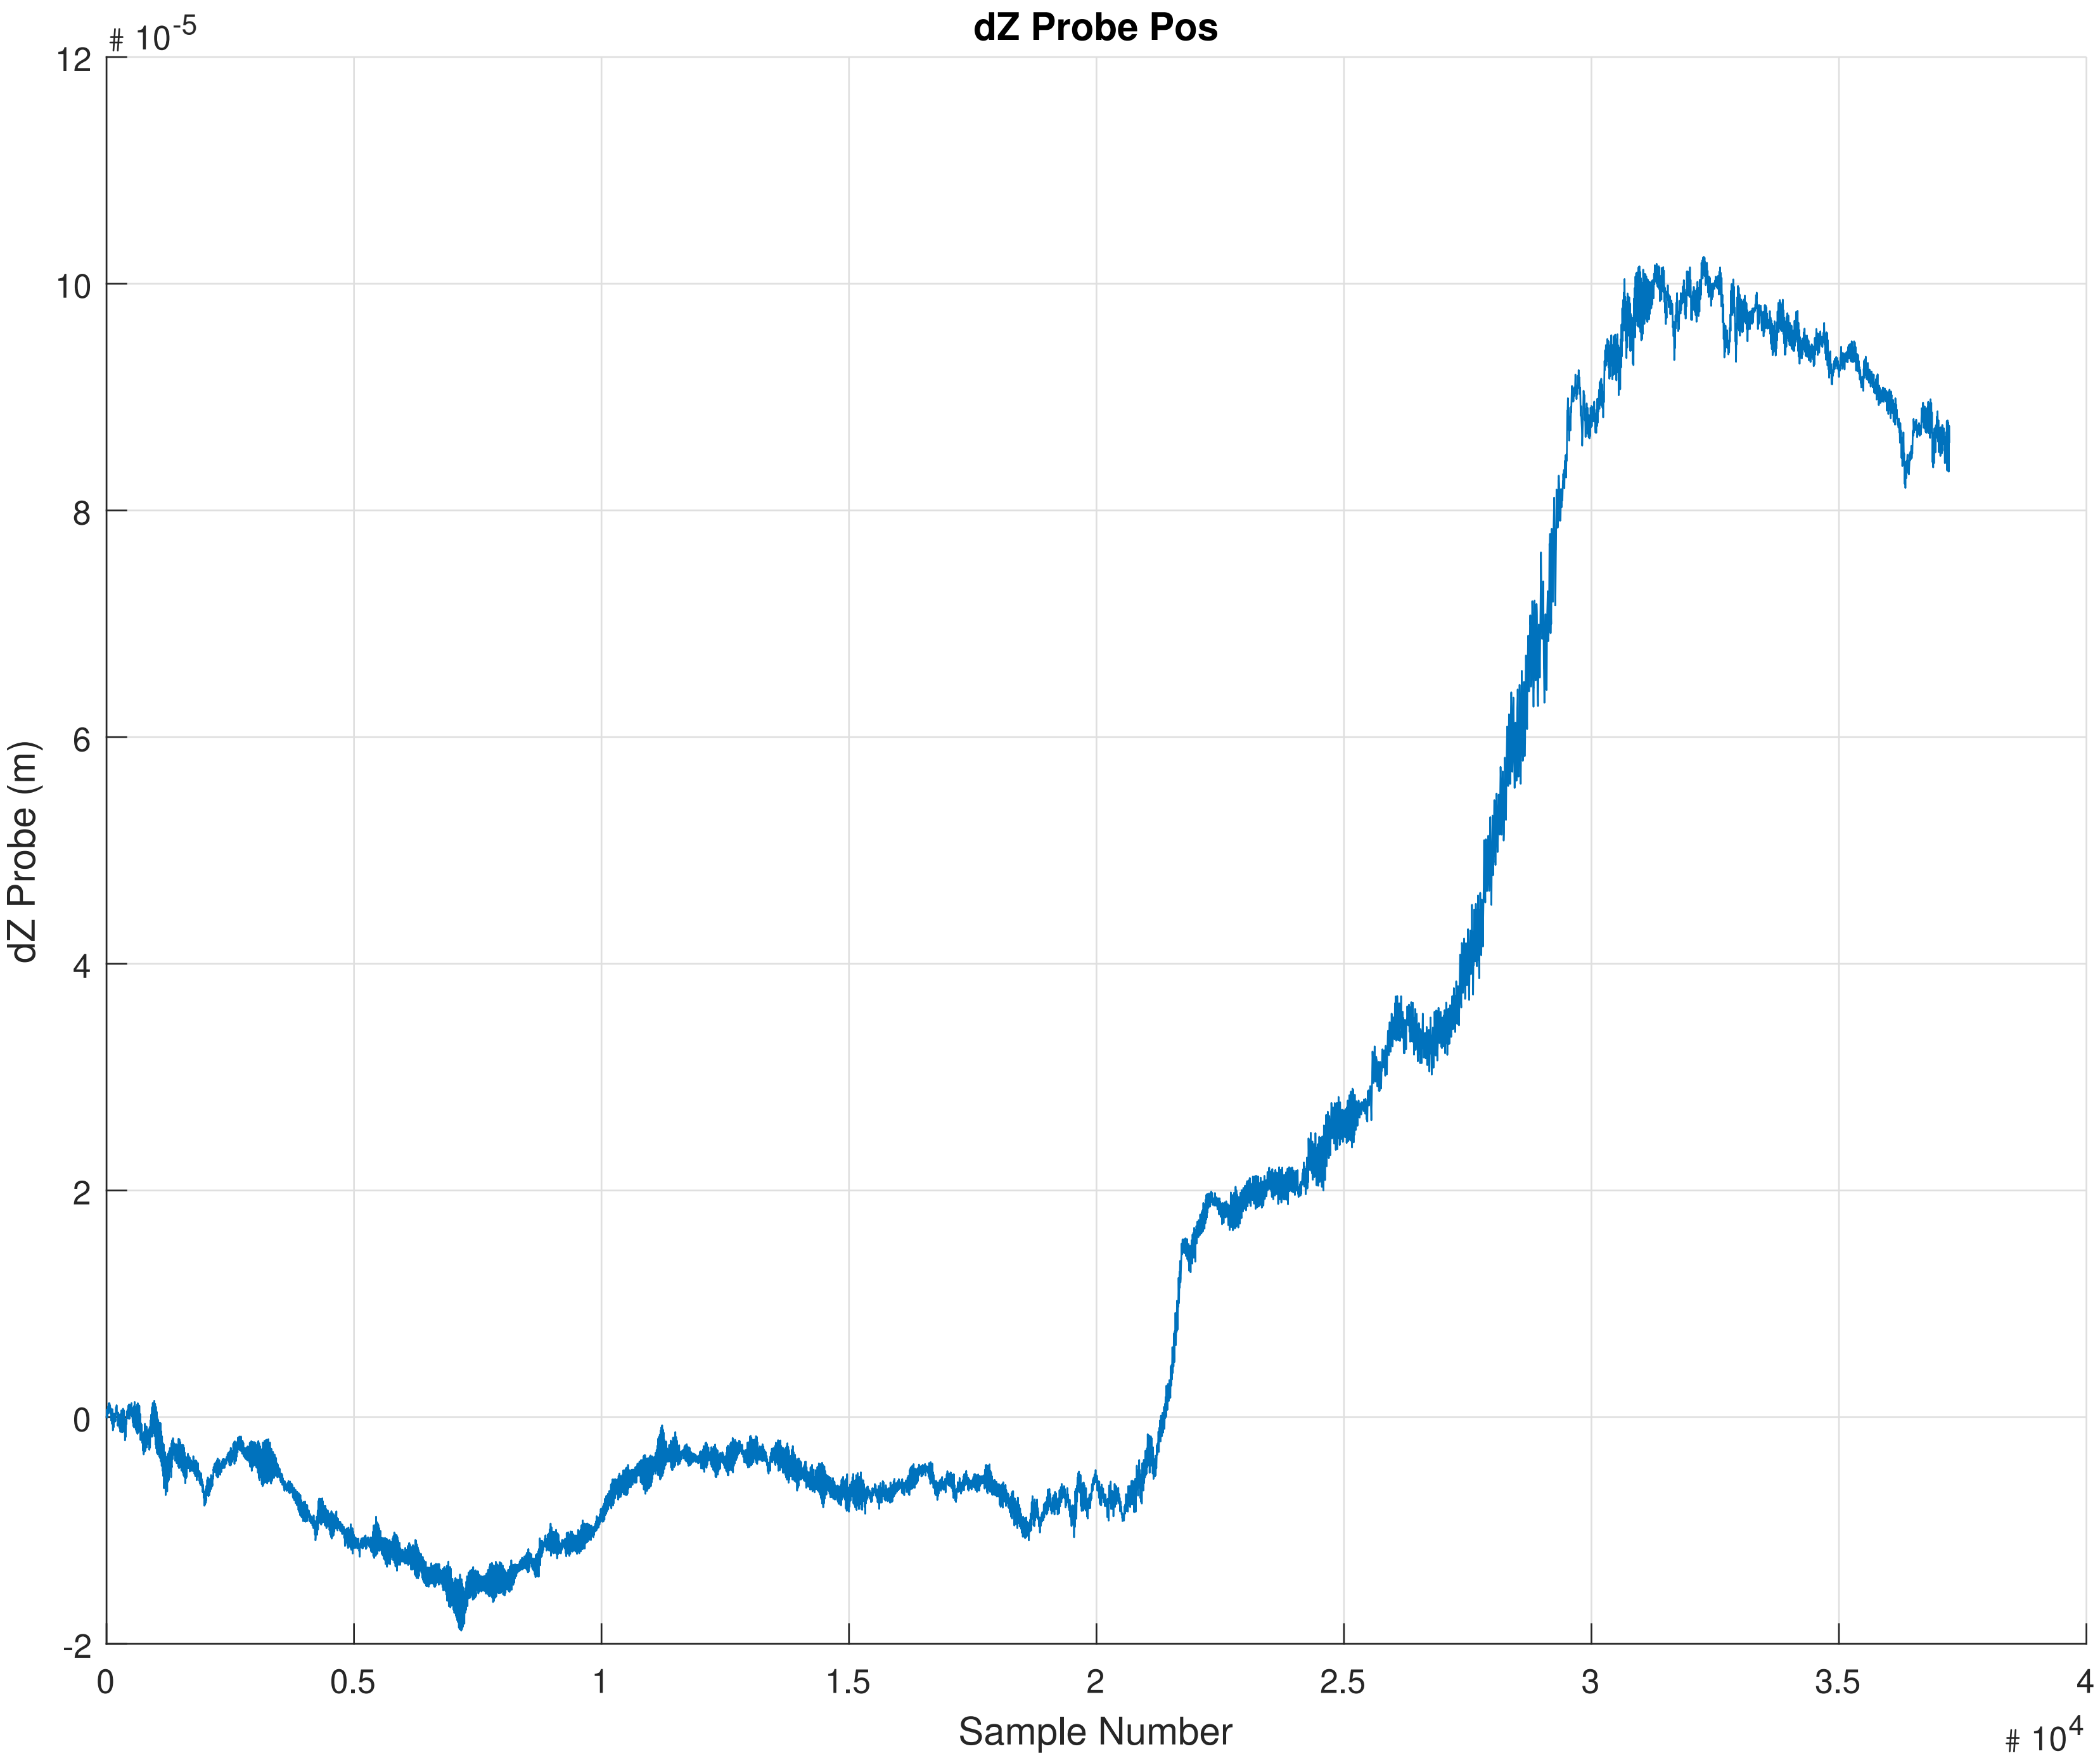
dZ Probe Pos
10^-5
12
10
8
6
4
2
0
-2
dZ Probe (m)
0
0.5
1
1.5
2
2.5
3
3.5
4
Sample Number
10^4

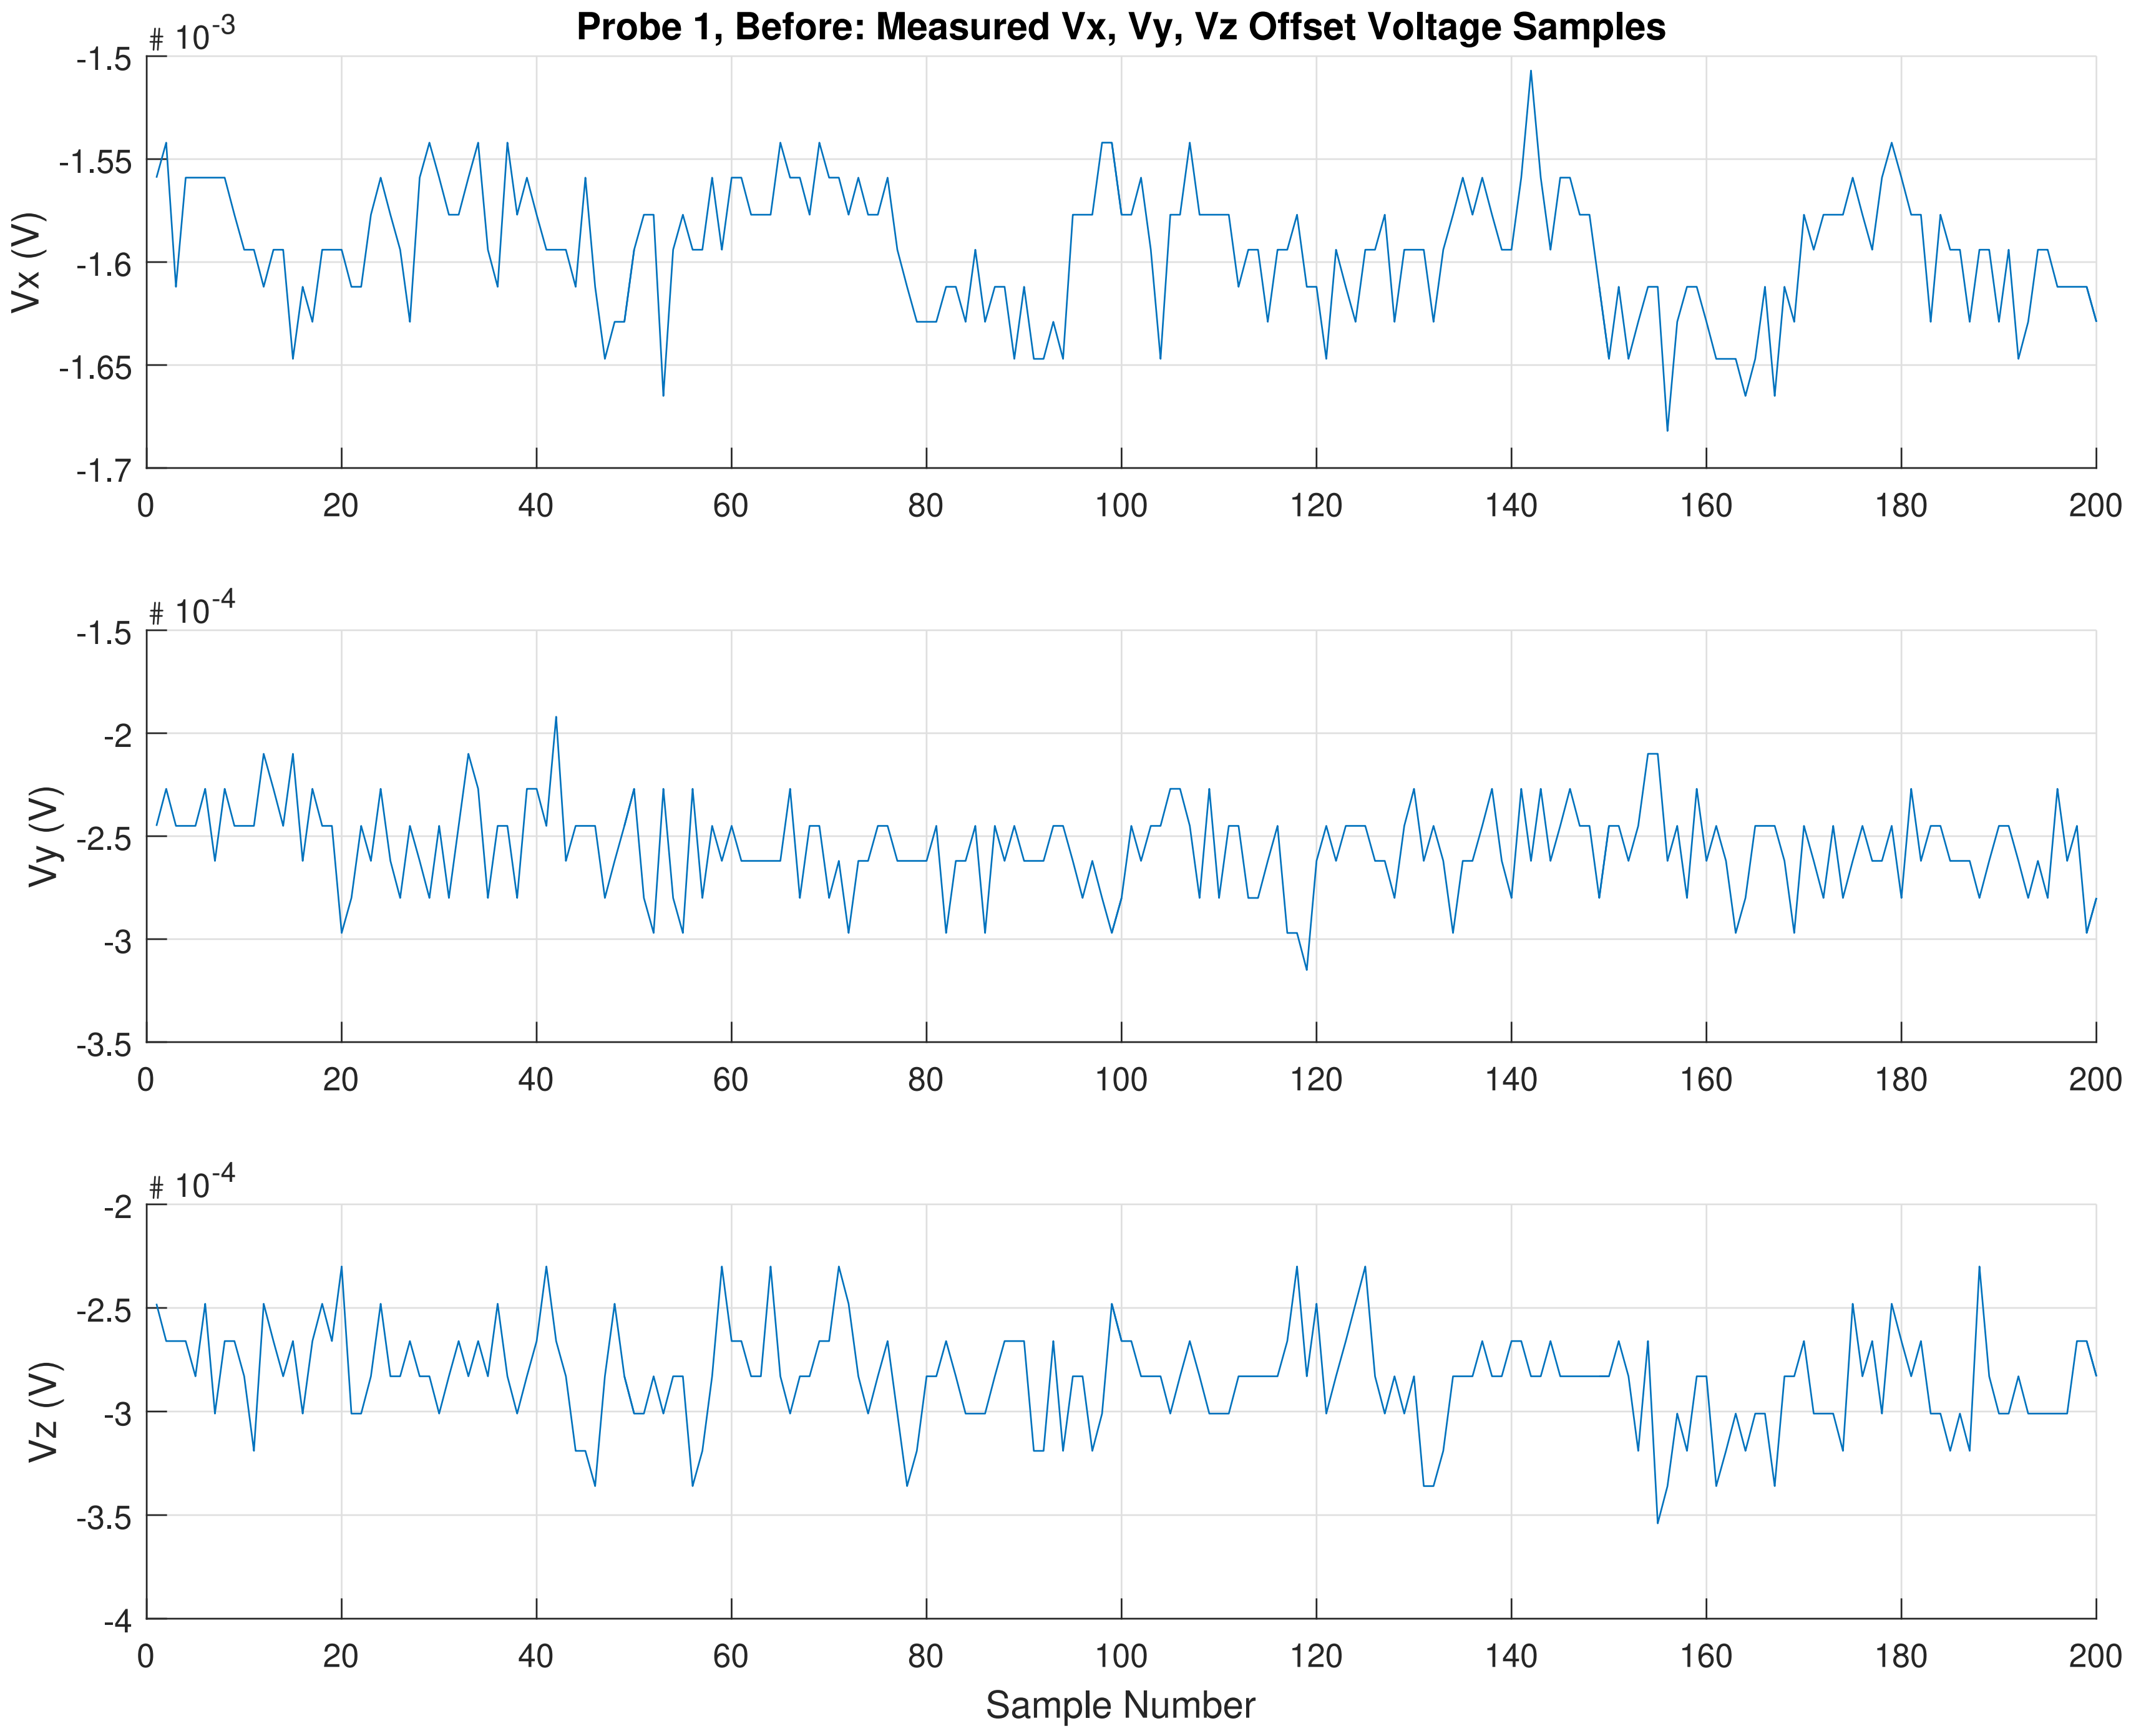
Probe 1, Before: Measured Vx, Vy, Vz Offset Voltage Samples
10^-3
-1.5
-1.55
-1.6
-1.65
-1.7
Vx (V)
0
20
40
60
80
100
120
140
160
180
200
10^-4
-1.5
-2
-2.5
-3
-3.5
Vy (V)
0
20
40
60
80
100
120
140
160
180
200
10^-4
-2
-2.5
-3
-3.5
-4
Vz (V)
0
20
40
60
80
100
120
140
160
180
200
Sample Number

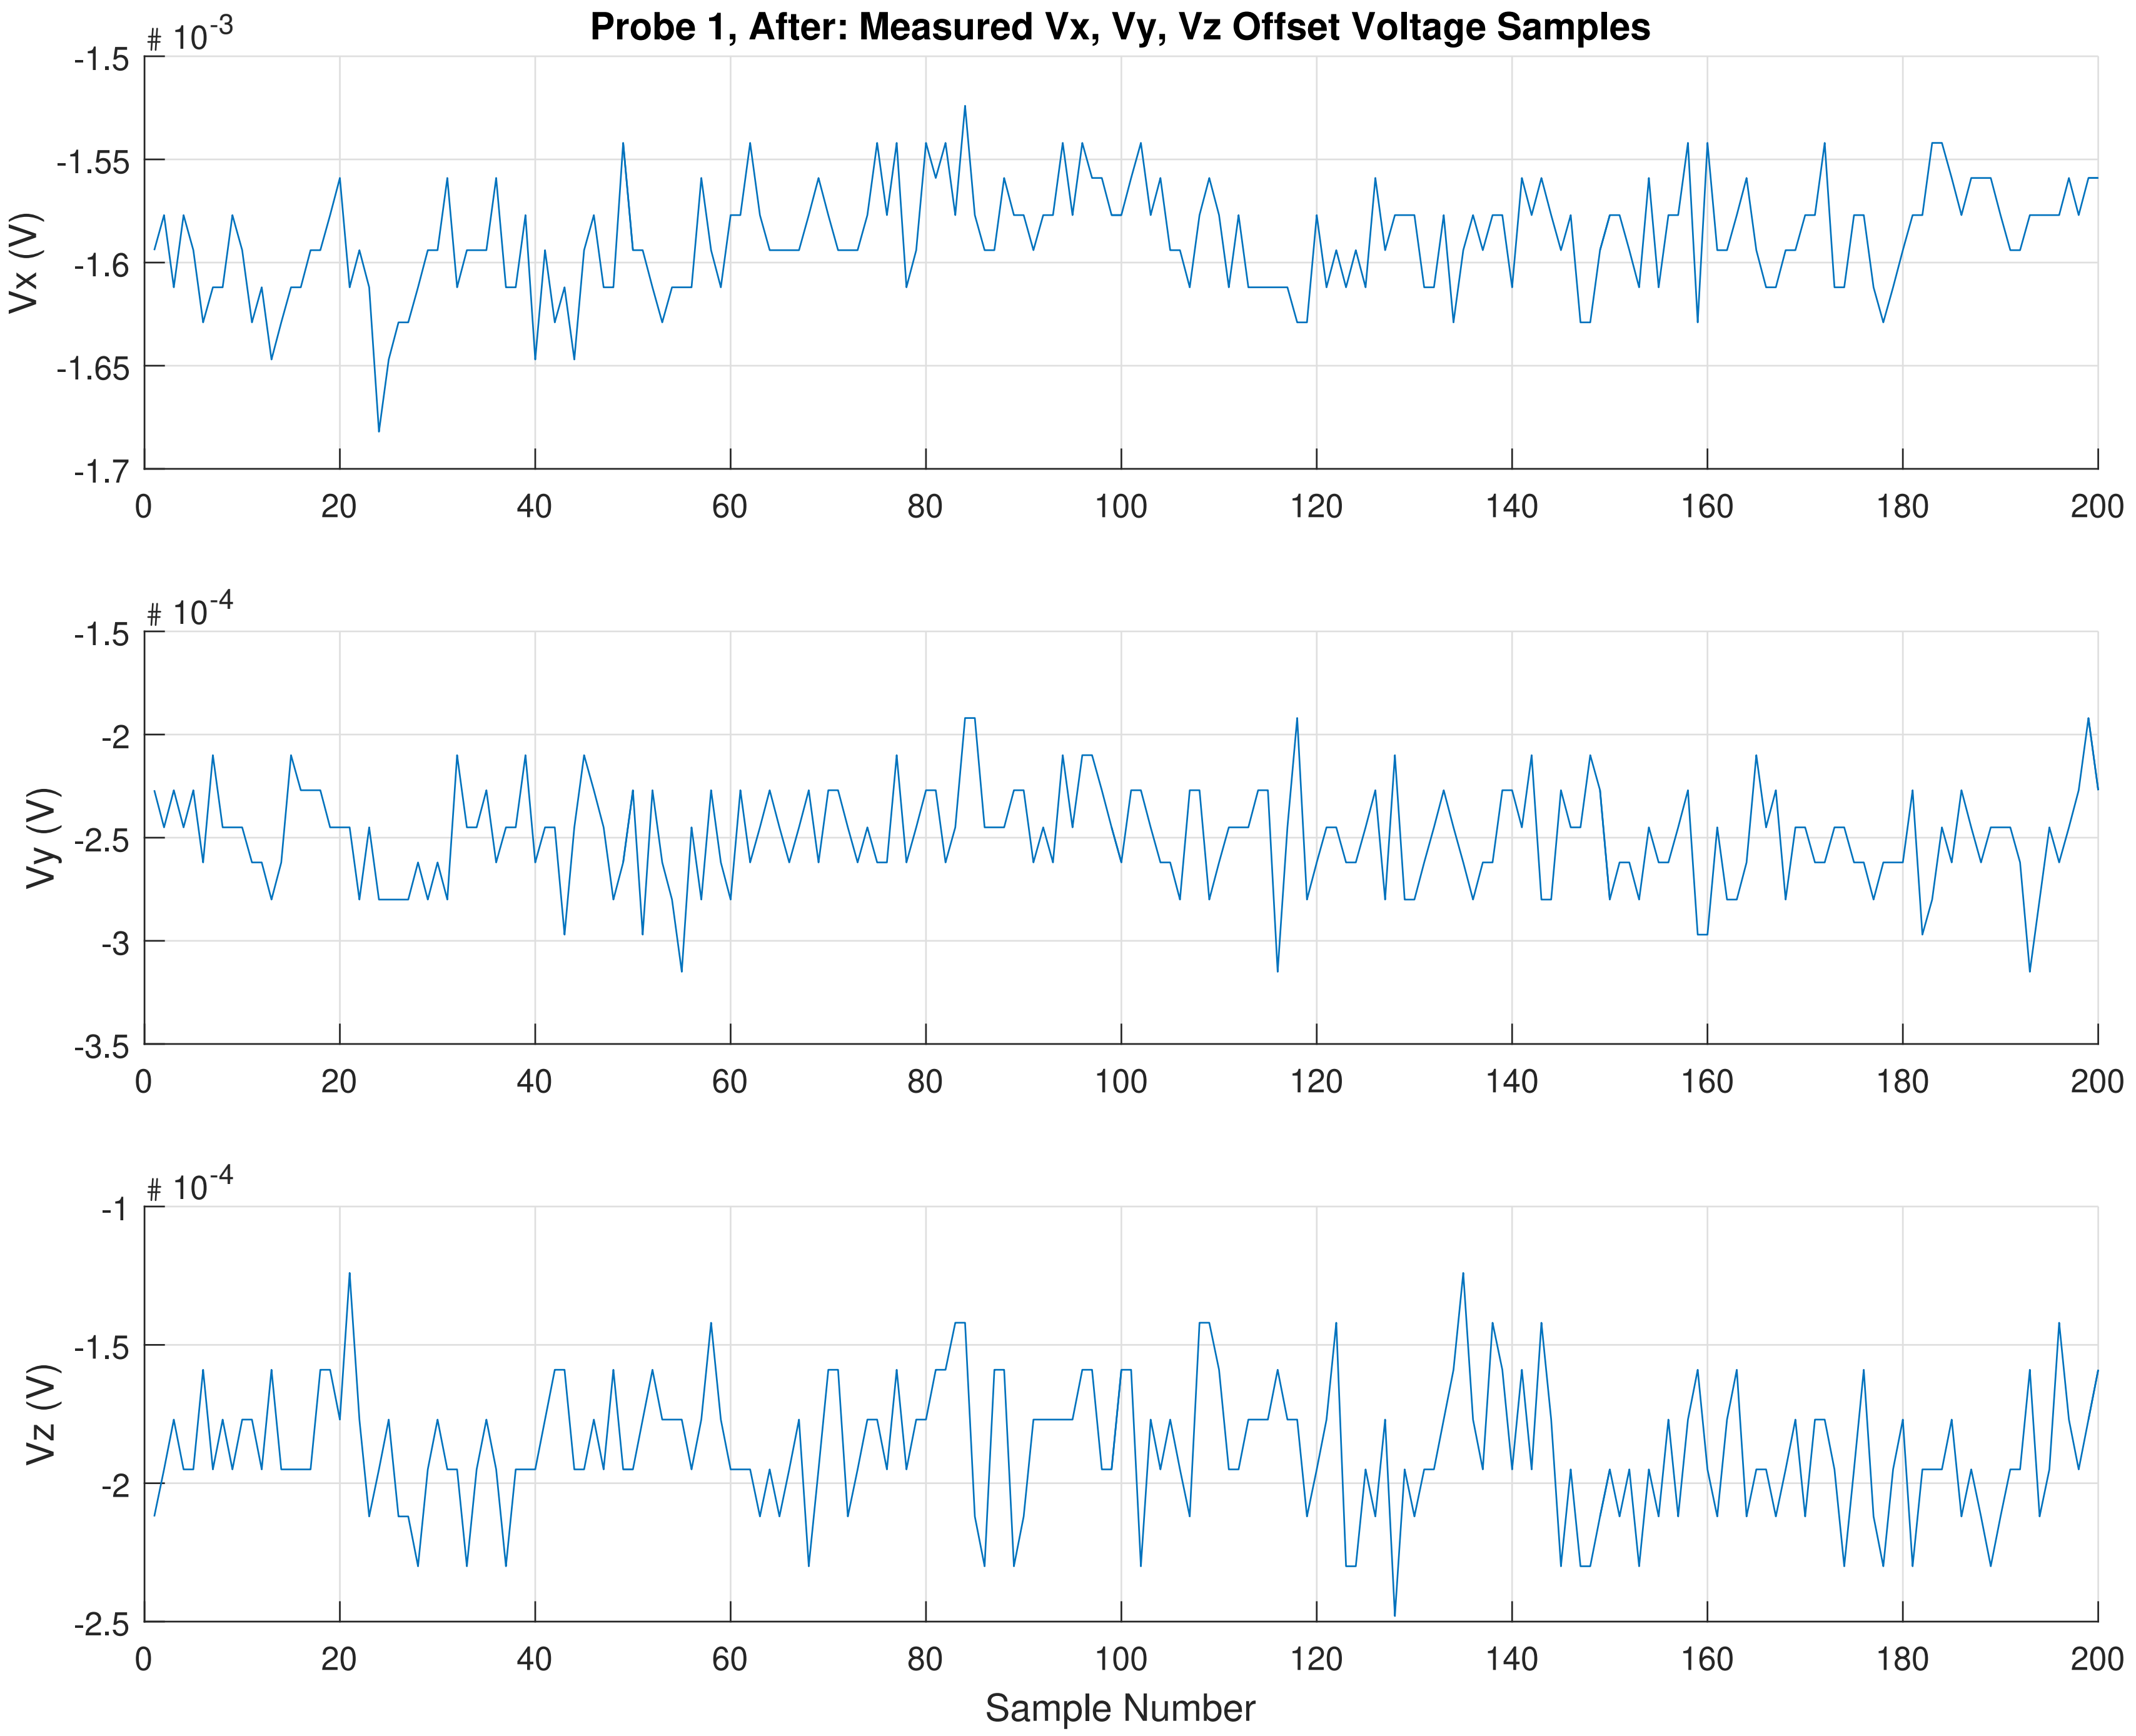
Probe 1, After: Measured Vx, Vy, Vz Offset Voltage Samples
10-3
-1.5
-1.55
-1.6
-1.65
-1.7
Vx (V)
0
20
40
60
80
100
120
140
160
180
200
10-4
-1.5
-2
-2.5
-3
-3.5
Vy (V)
0
20
40
60
80
100
120
140
160
180
200
10-4
-1
-1.5
-2
-2.5
Vz (V)
0
20
40
60
80
100
120
140
160
180
200
Sample Number


Probe 2, Before: Measured Vx, Vy, Vz Offset Voltage Samples

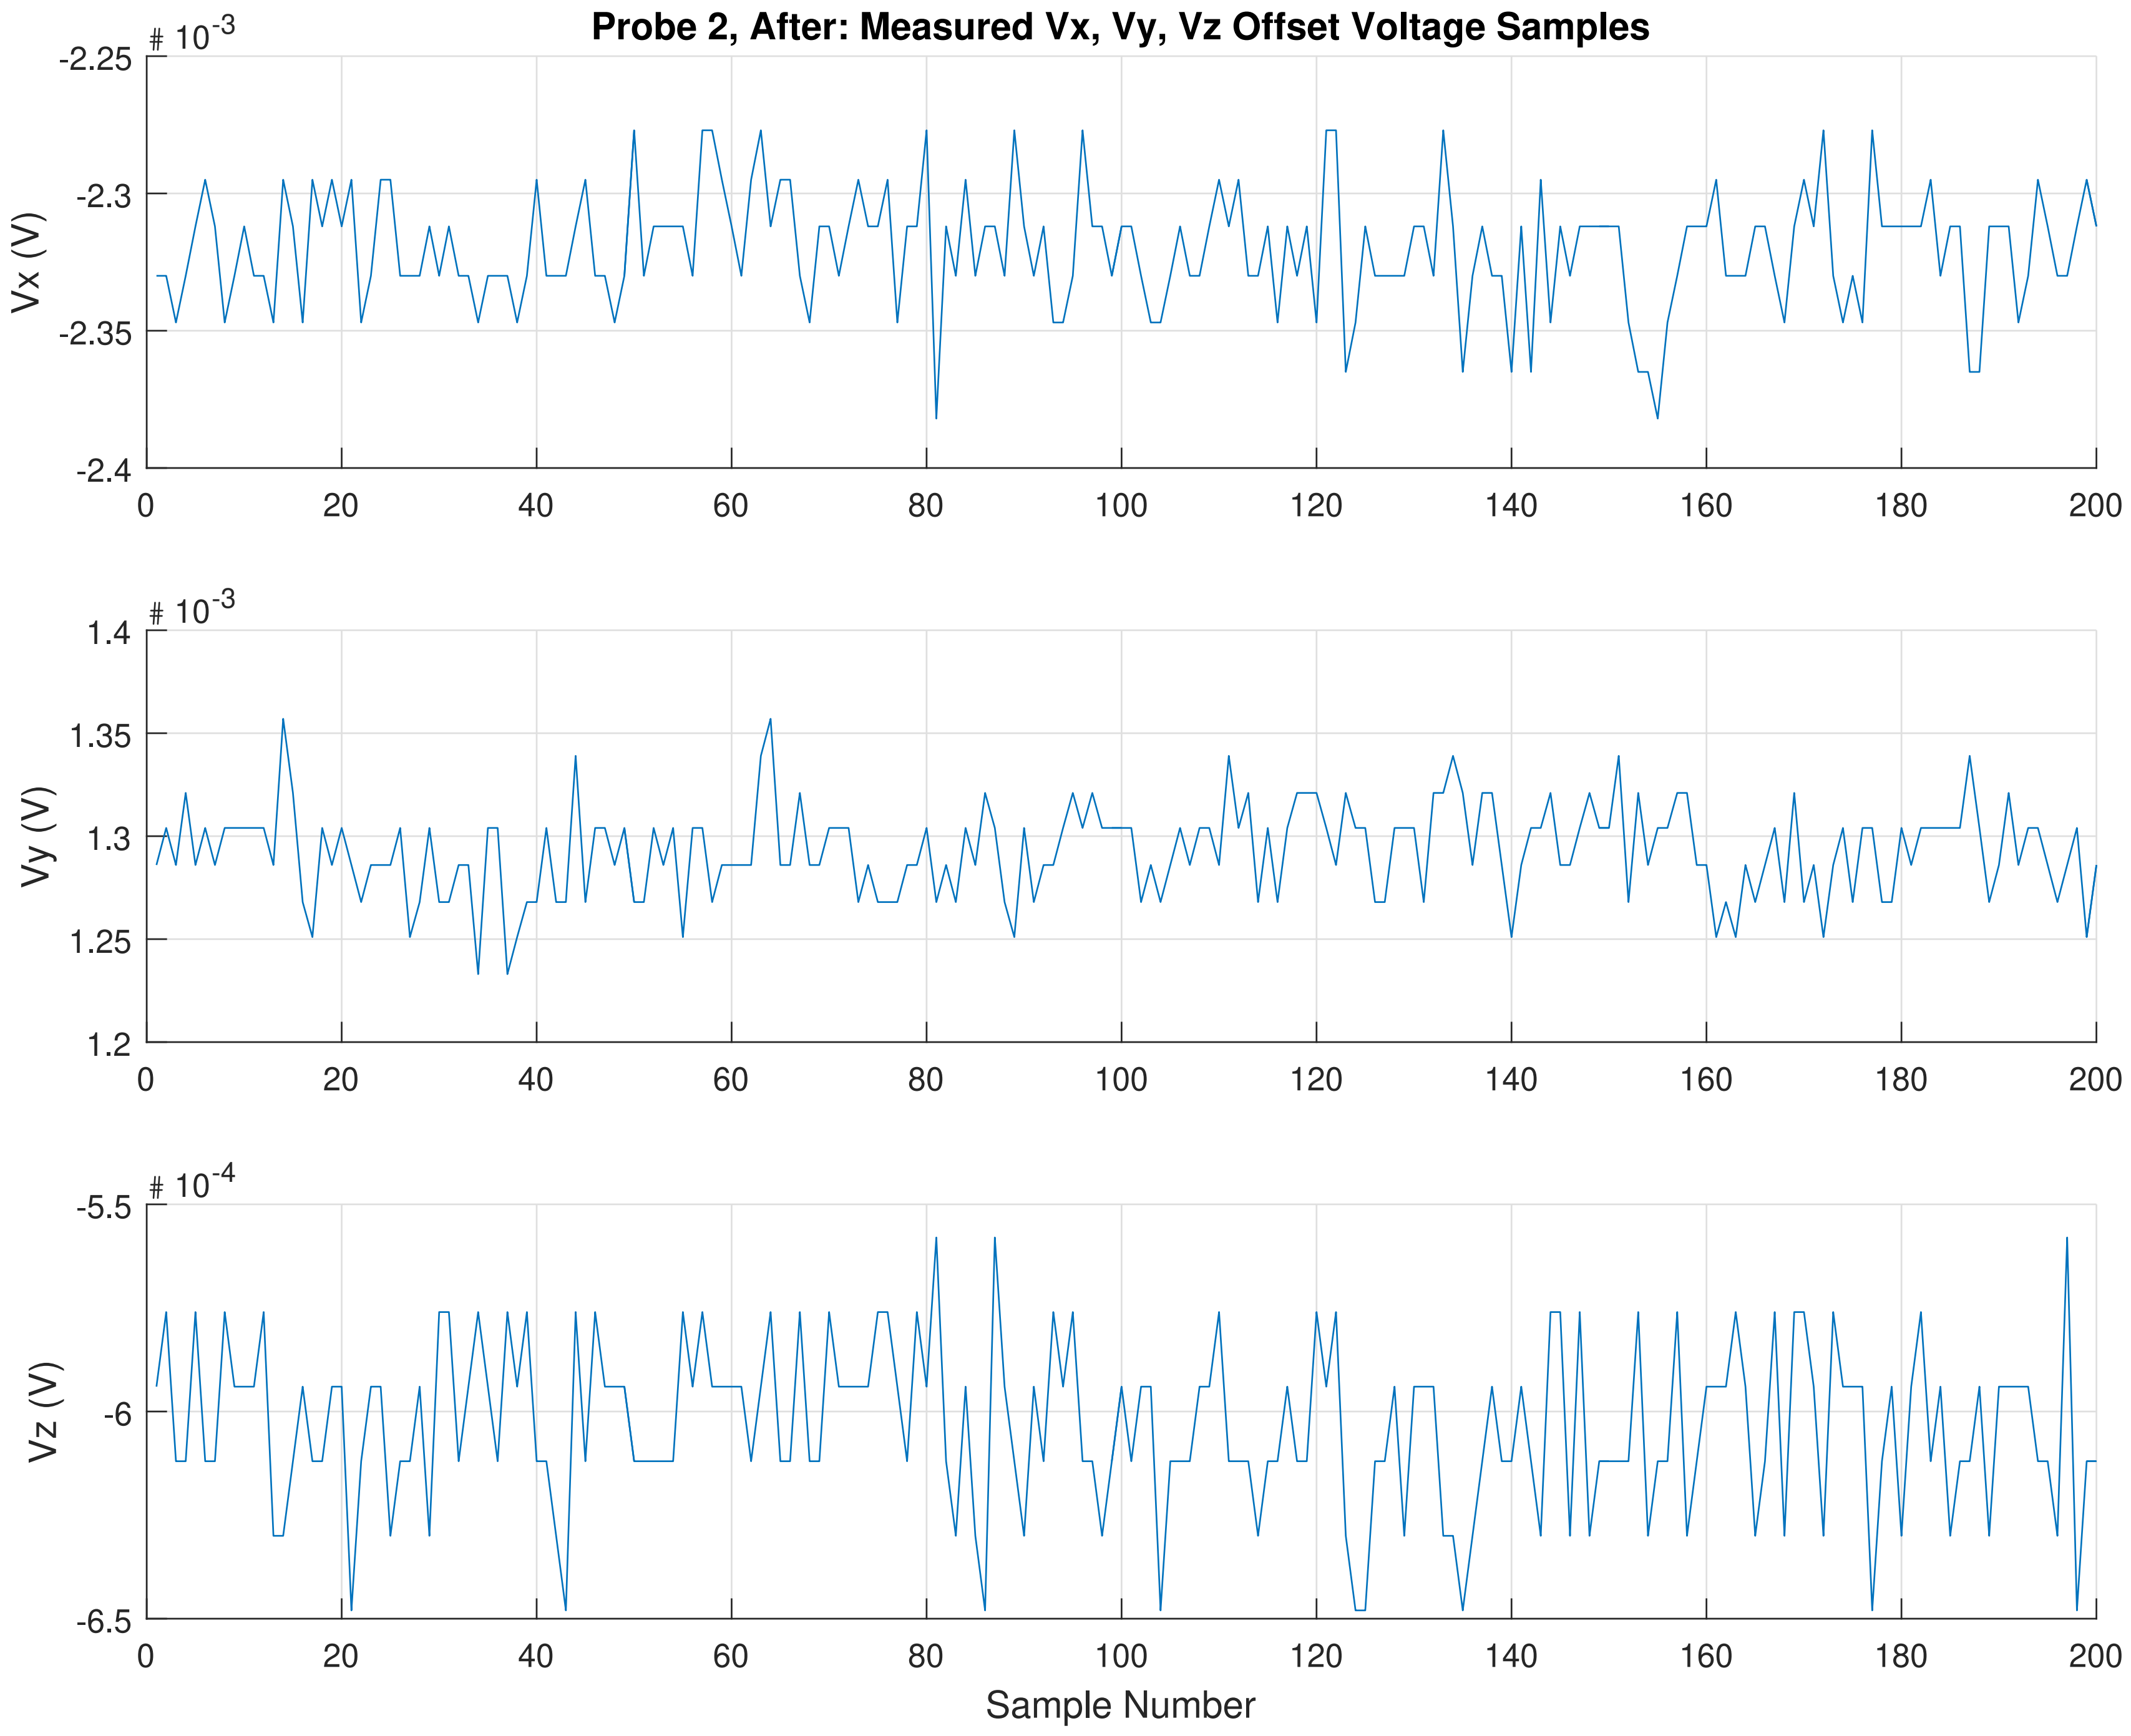
Probe 2, After: Measured Vx, Vy, Vz Offset Voltage Samples
10^{-3}
-2.25
-2.3
-2.35
-2.4
Vx (V)
0
20
40
60
80
100
120
140
160
180
200
10^{-3}
1.4
1.35
1.3
1.25
1.2
Vy (V)
0
20
40
60
80
100
120
140
160
180
200
10^{-4}
-5.5
-6
-6.5
Vz (V)
0
20
40
60
80
100
120
140
160
180
200
Sample Number

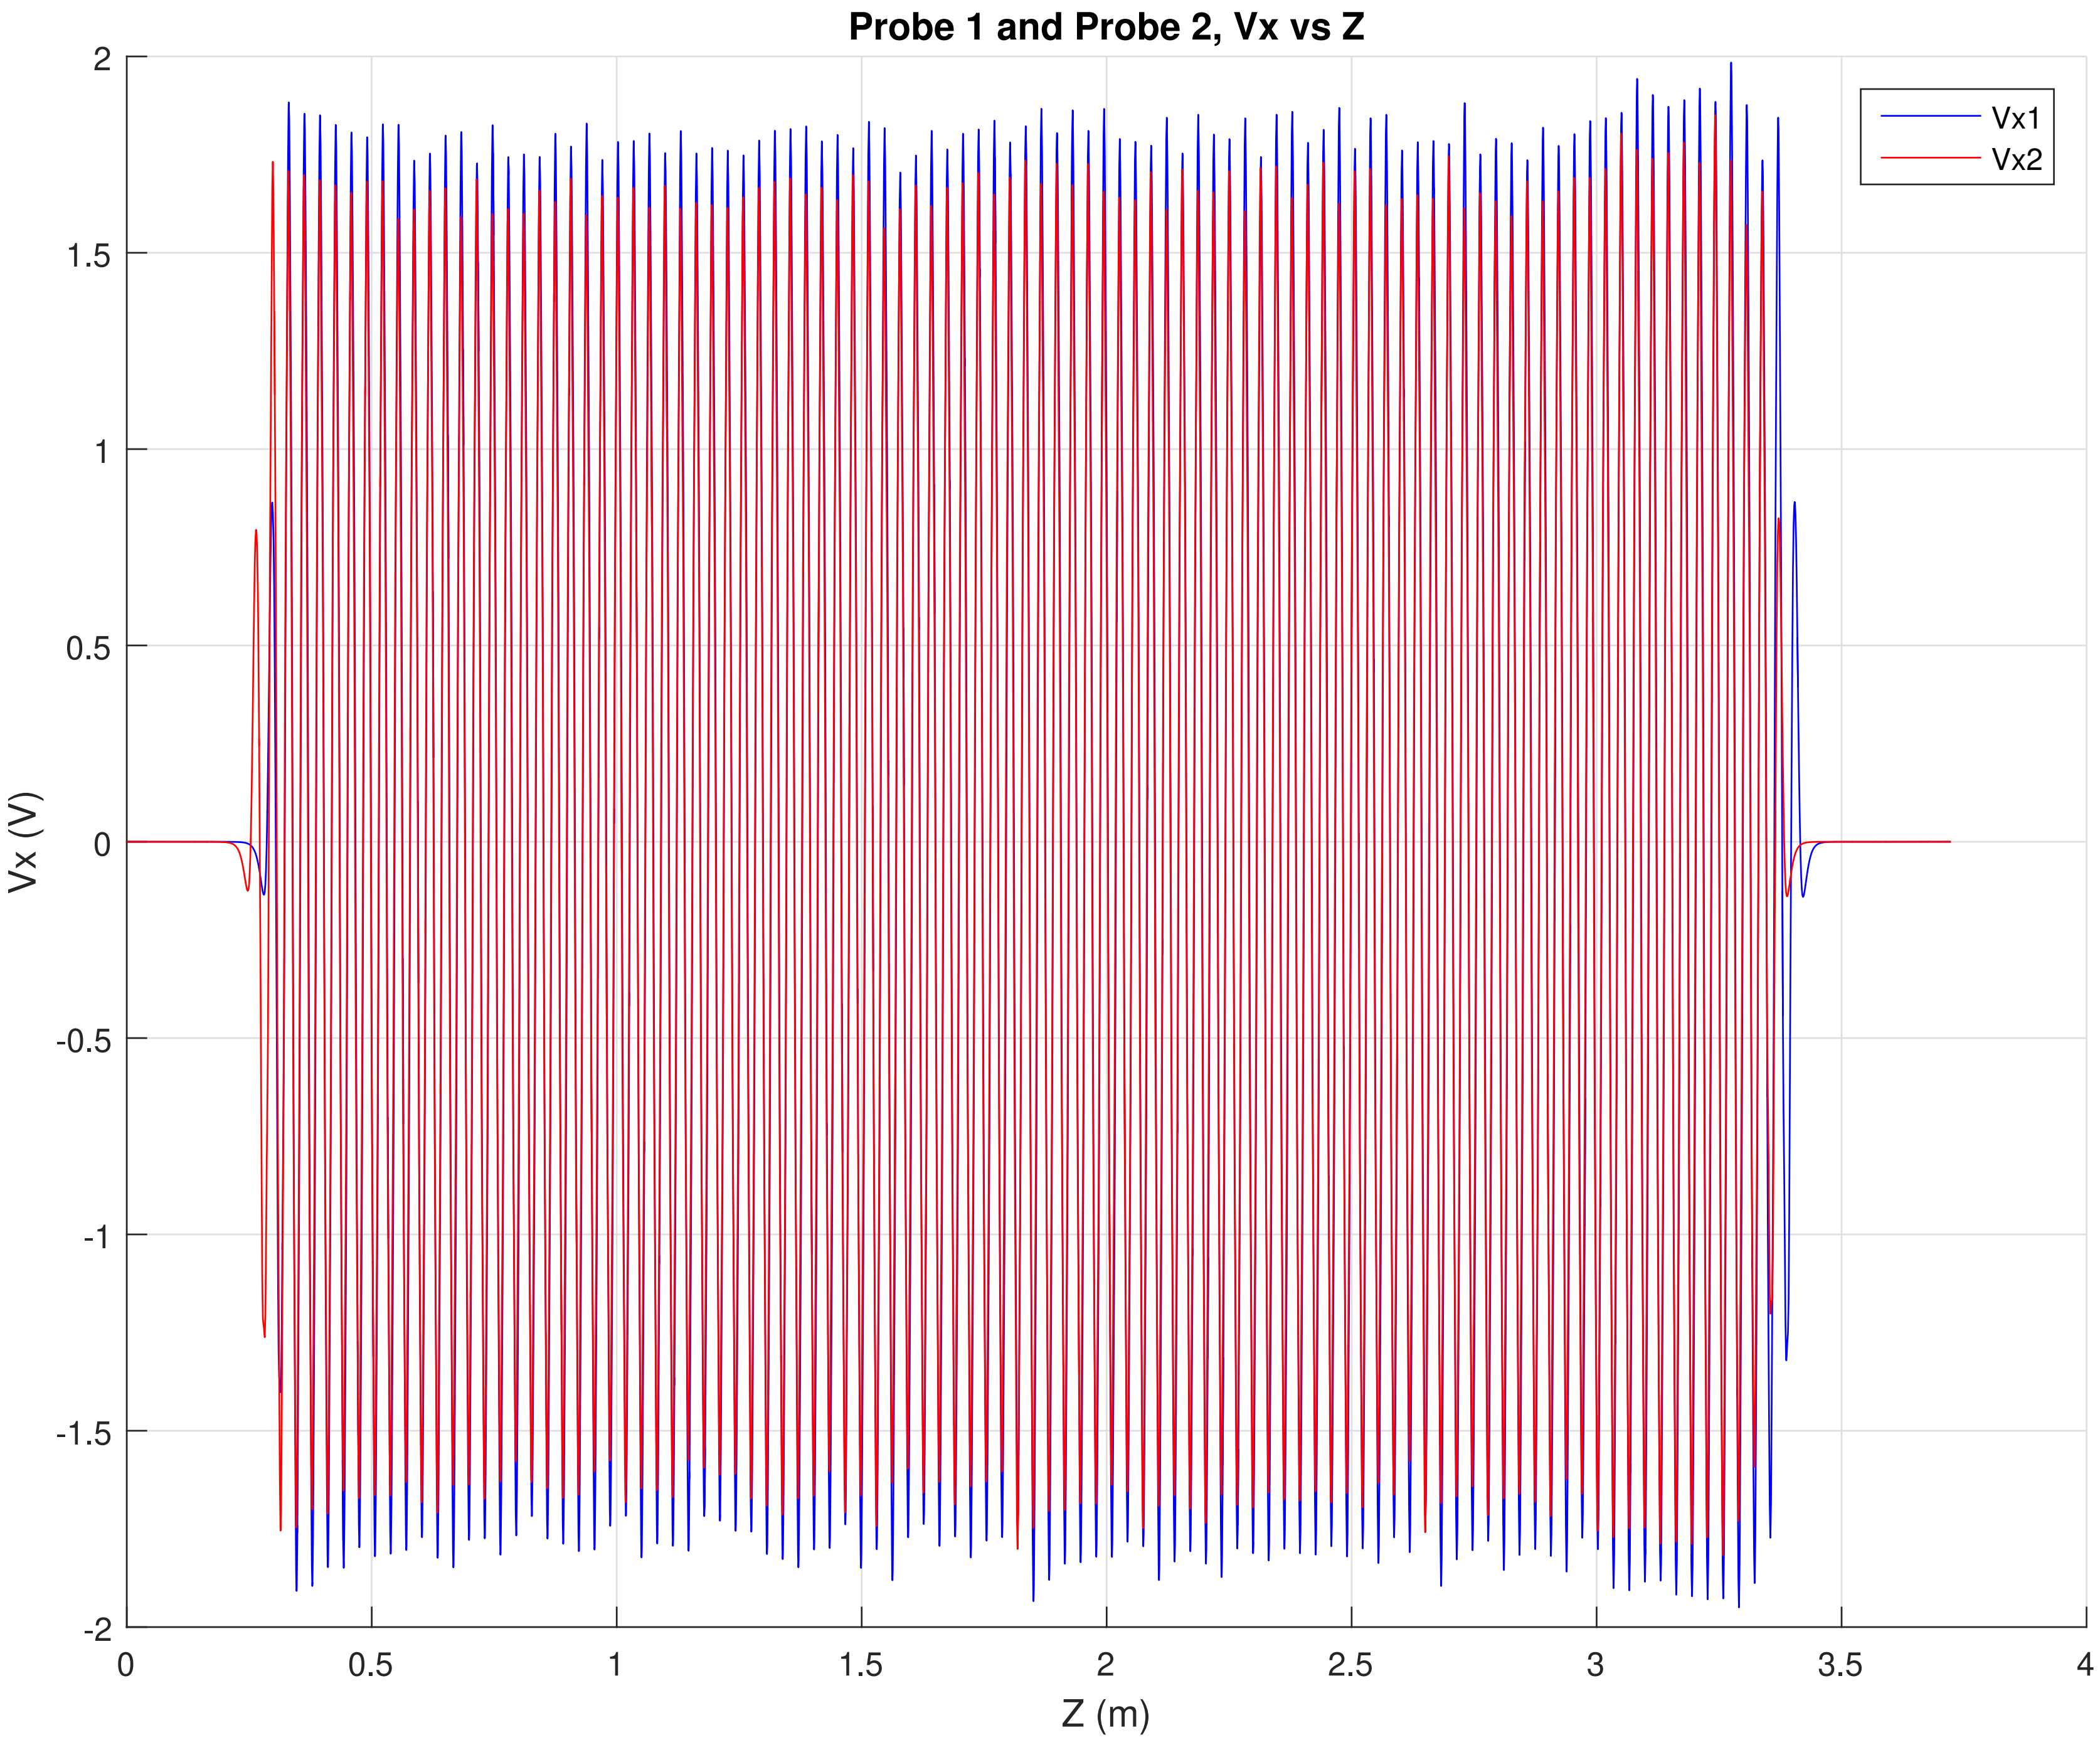
Probe 1 and Probe 2, Vx vs Z
Vx1
Vx2
Vx (V)
2
1.5
1
0.5
0
-0.5
-1
-1.5
-2
Z (m)
0
0.5
1
1.5
2
2.5
3
3.5
4

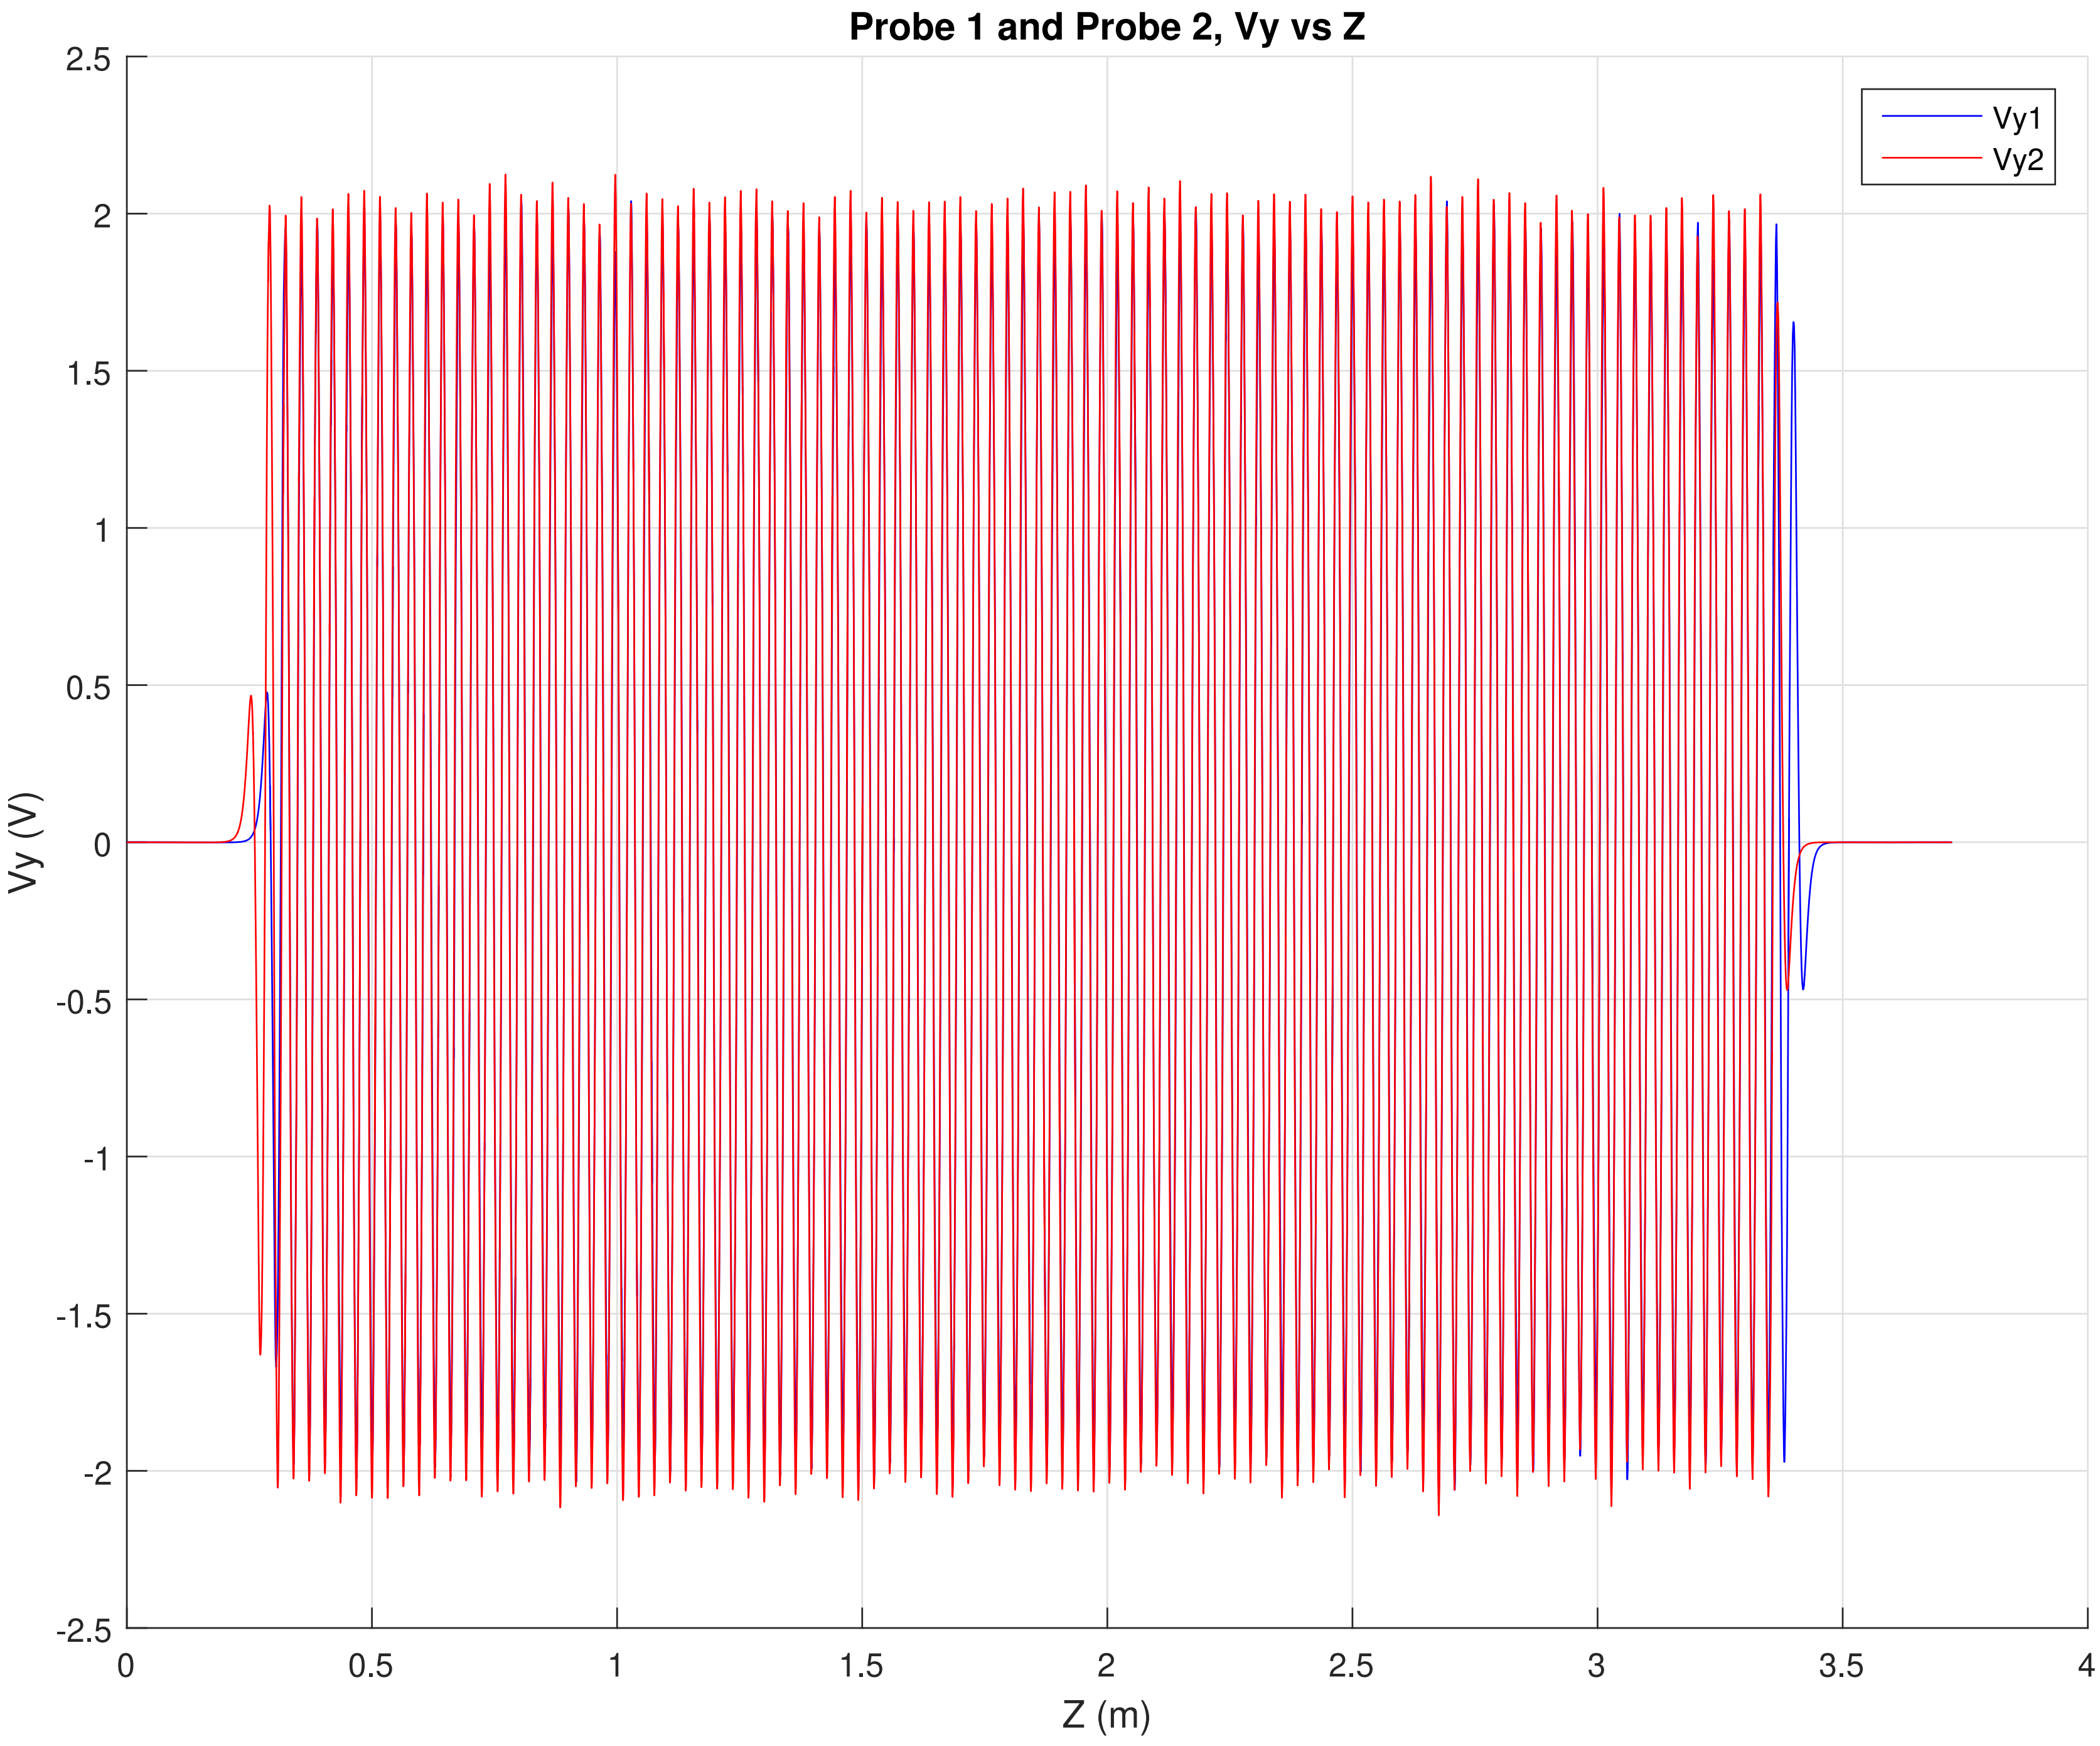
Probe 1 and Probe 2, Vy vs Z
Vy1
Vy2
Vy (V)
Z (m)
2.5
2
1.5
1
0.5
0
-0.5
-1
-1.5
-2
-2.5
0
0.5
1
1.5
2
2.5
3
3.5
4

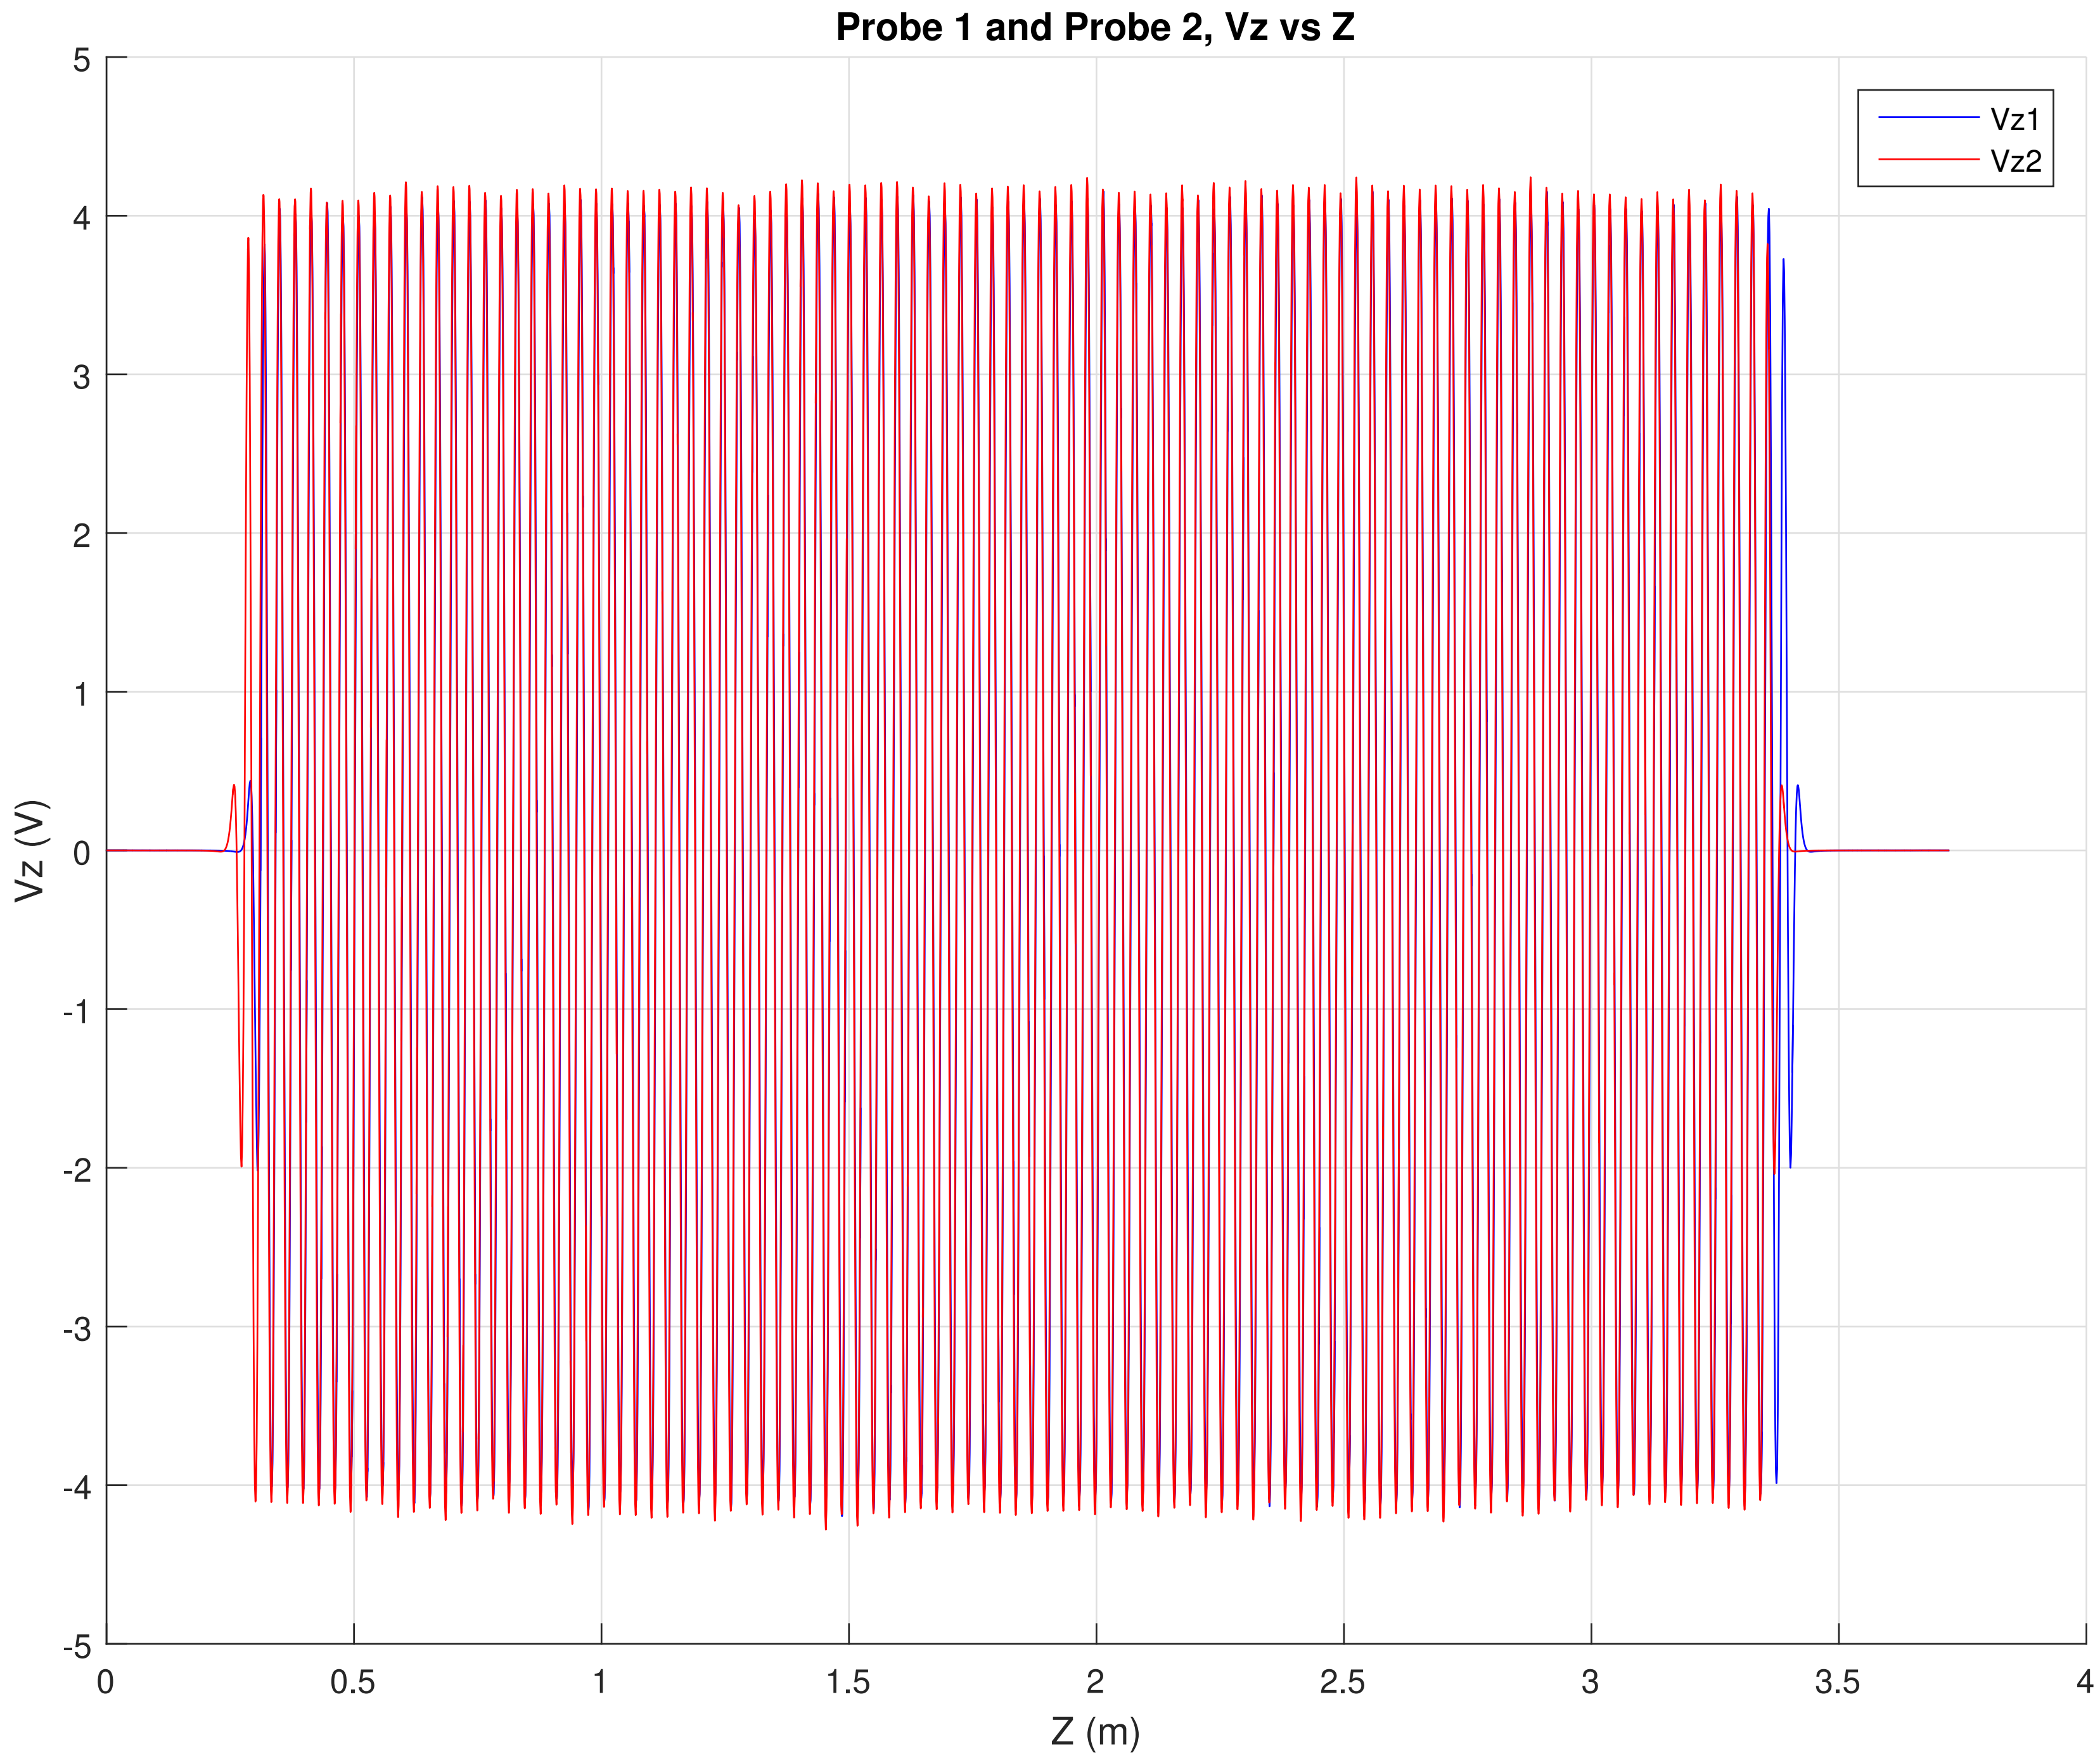
Probe 1 and Probe 2, Vz vs Z
Vz1
Vz2
Vz (V)
5
4
3
2
1
0
-1
-2
-3
-4
-5
Z (m)
0
0.5
1
1.5
2
2.5
3
3.5
4

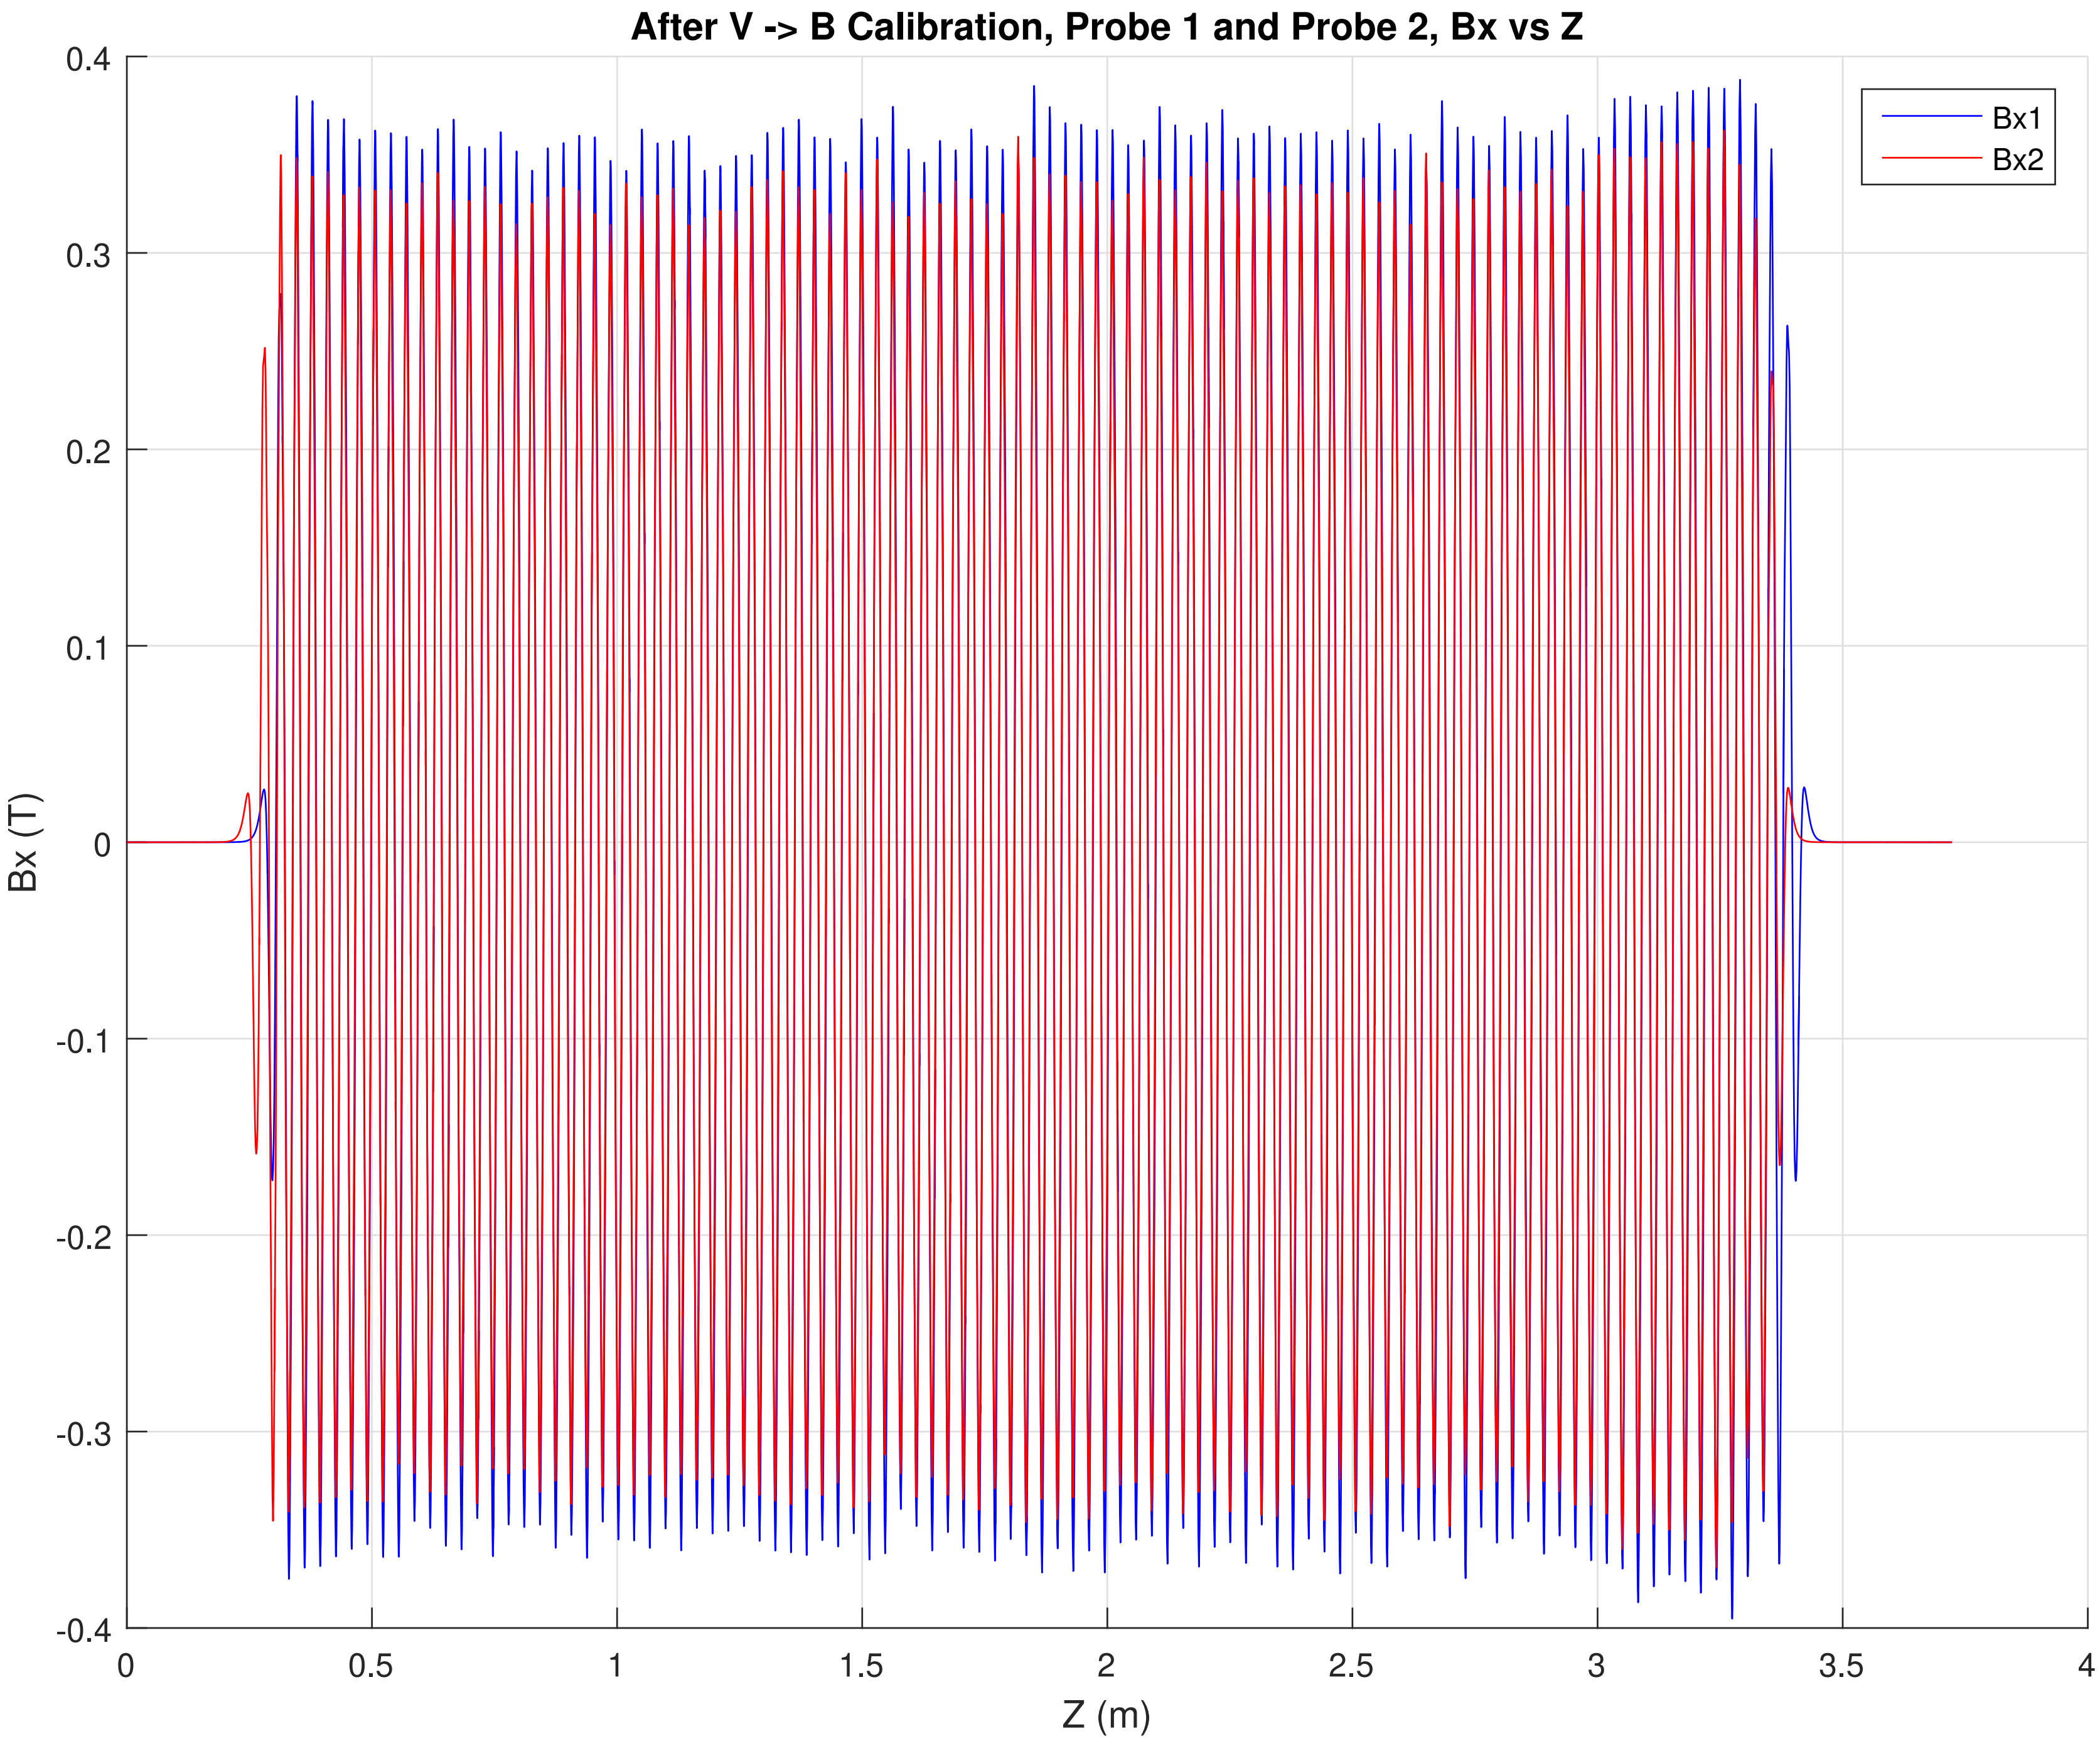
After V -> B Calibration, Probe 1 and Probe 2, Bx vs Z
Bx (T)
0.4
0.3
0.2
0.1
0
-0.1
-0.2
-0.3
-0.4
Z (m)
0
0.5
1
1.5
2
2.5
3
3.5
4
Bx1
Bx2

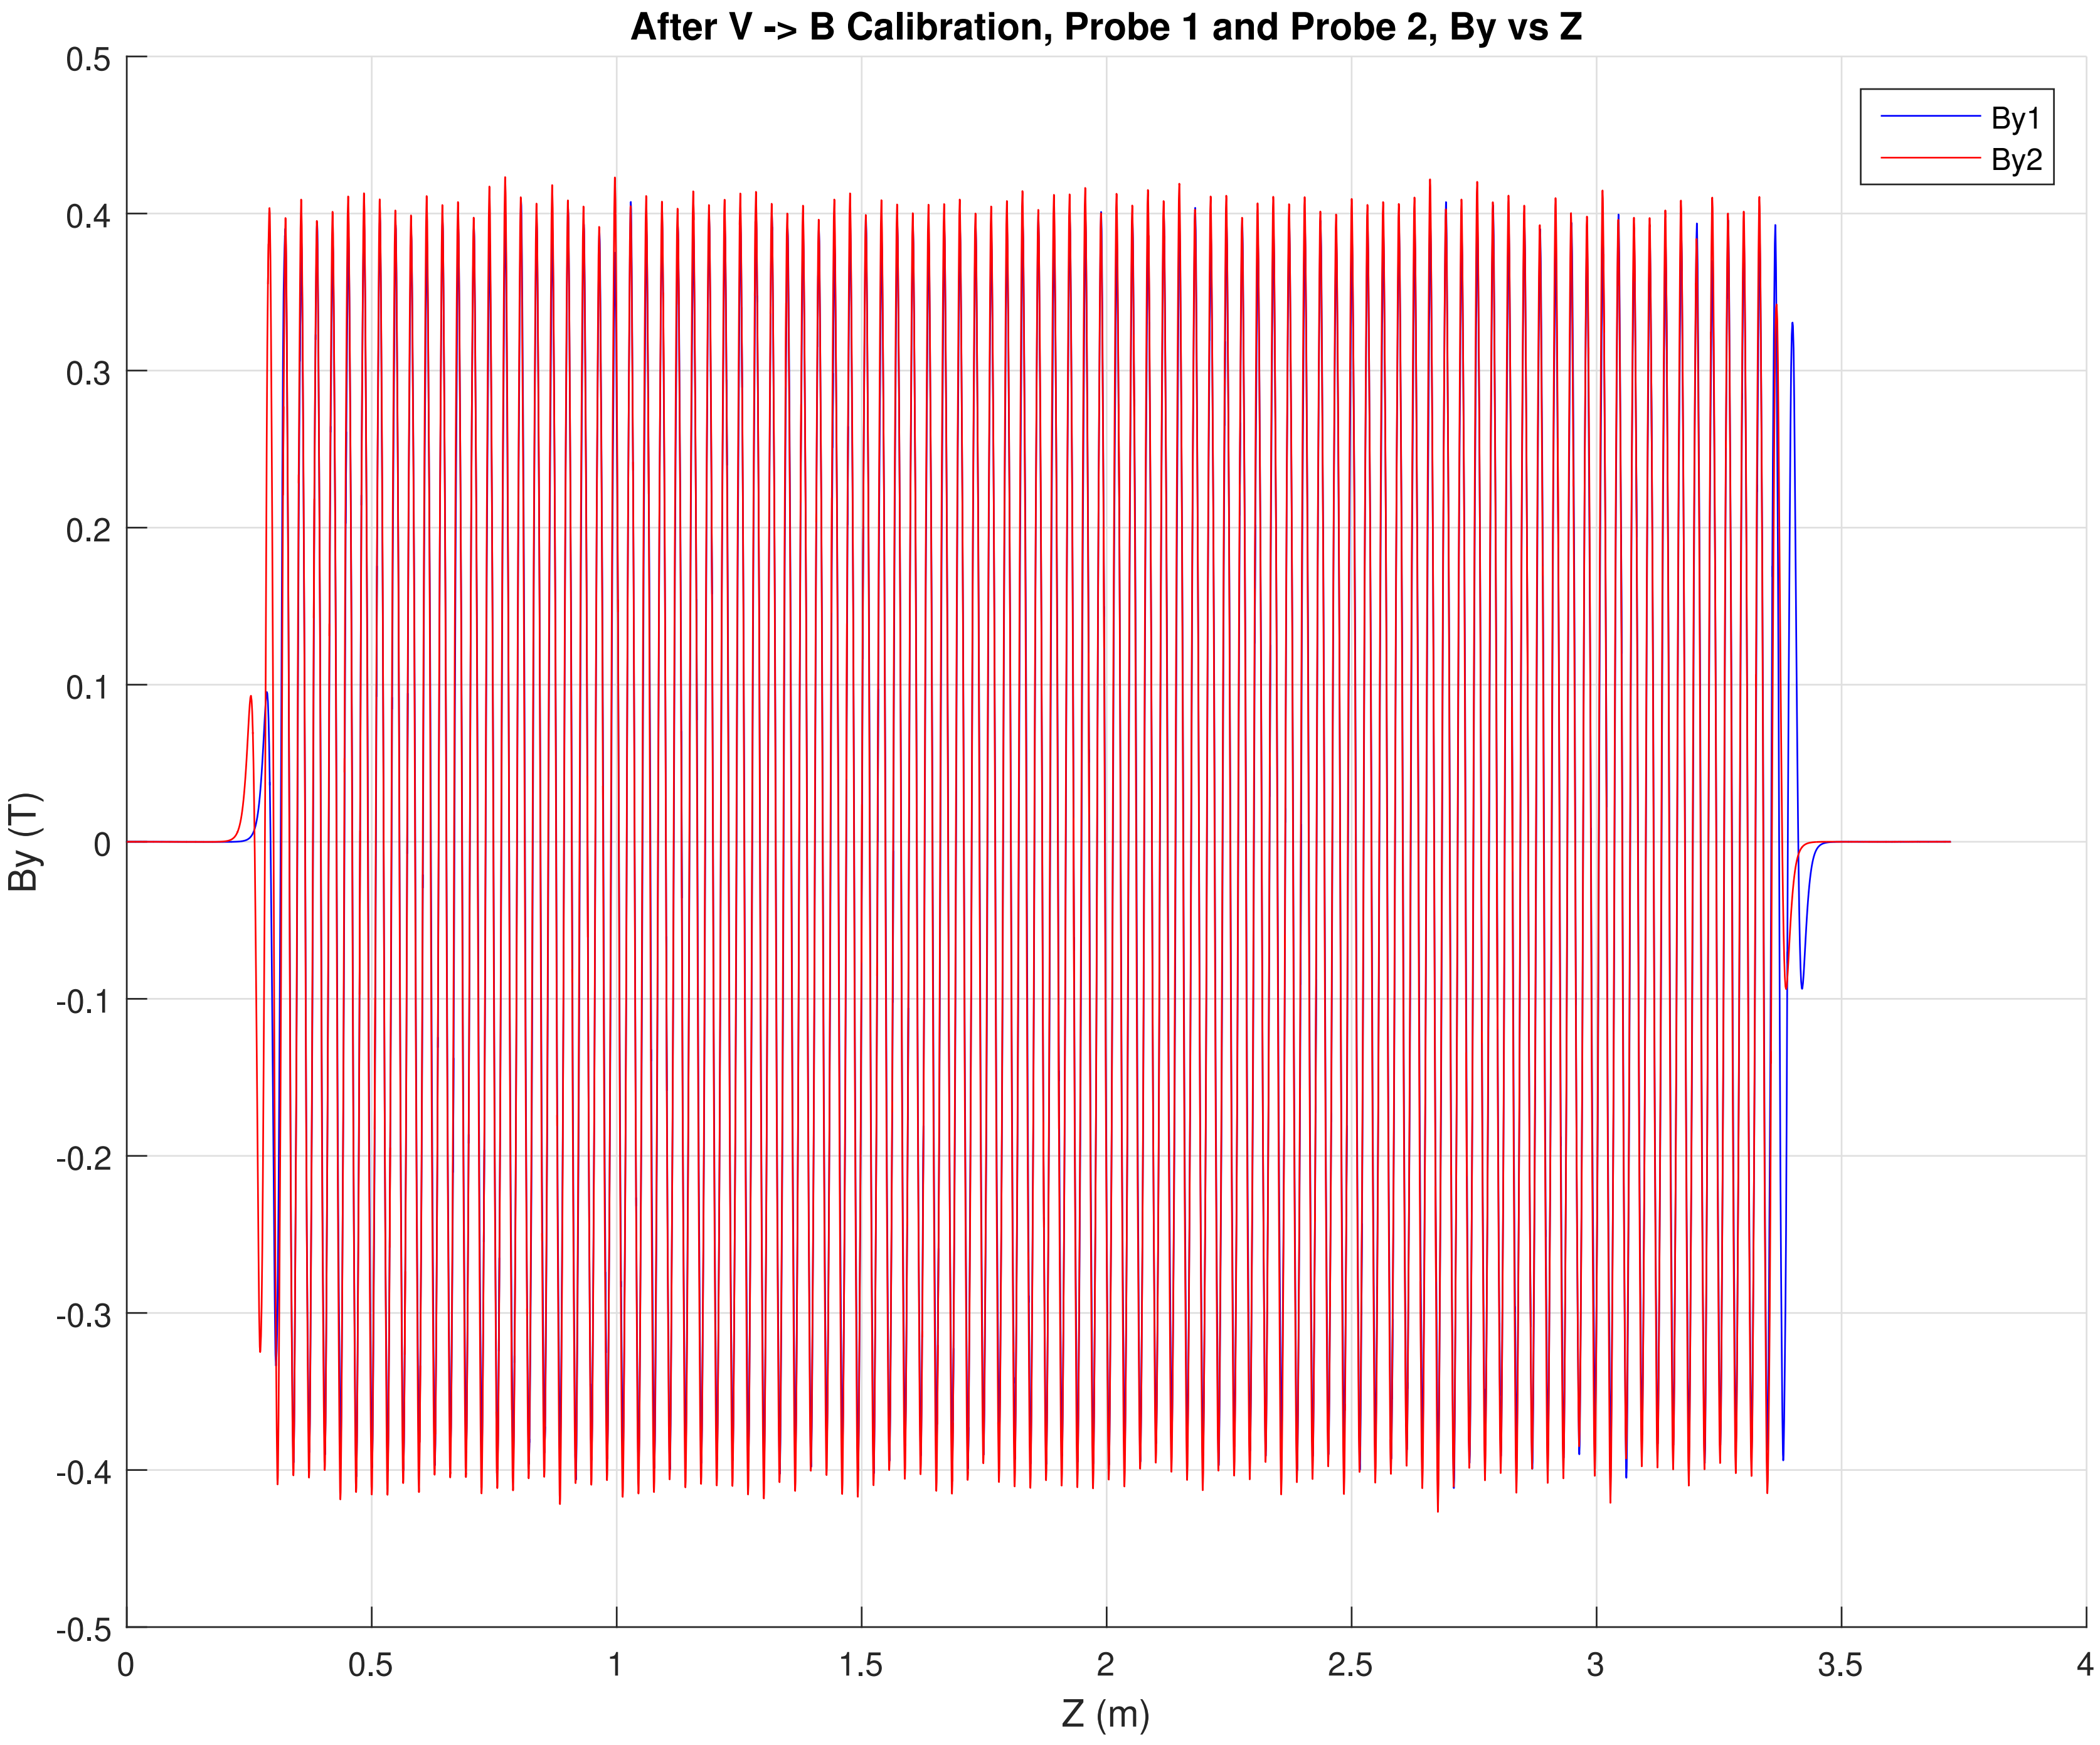
After V -> B Calibration, Probe 1 and Probe 2, By vs Z
By (T)
Z (m)
By1
By2
0.5
0.4
0.3
0.2
0.1
0
-0.1
-0.2
-0.3
-0.4
-0.5
0
0.5
1
1.5
2
2.5
3
3.5
4

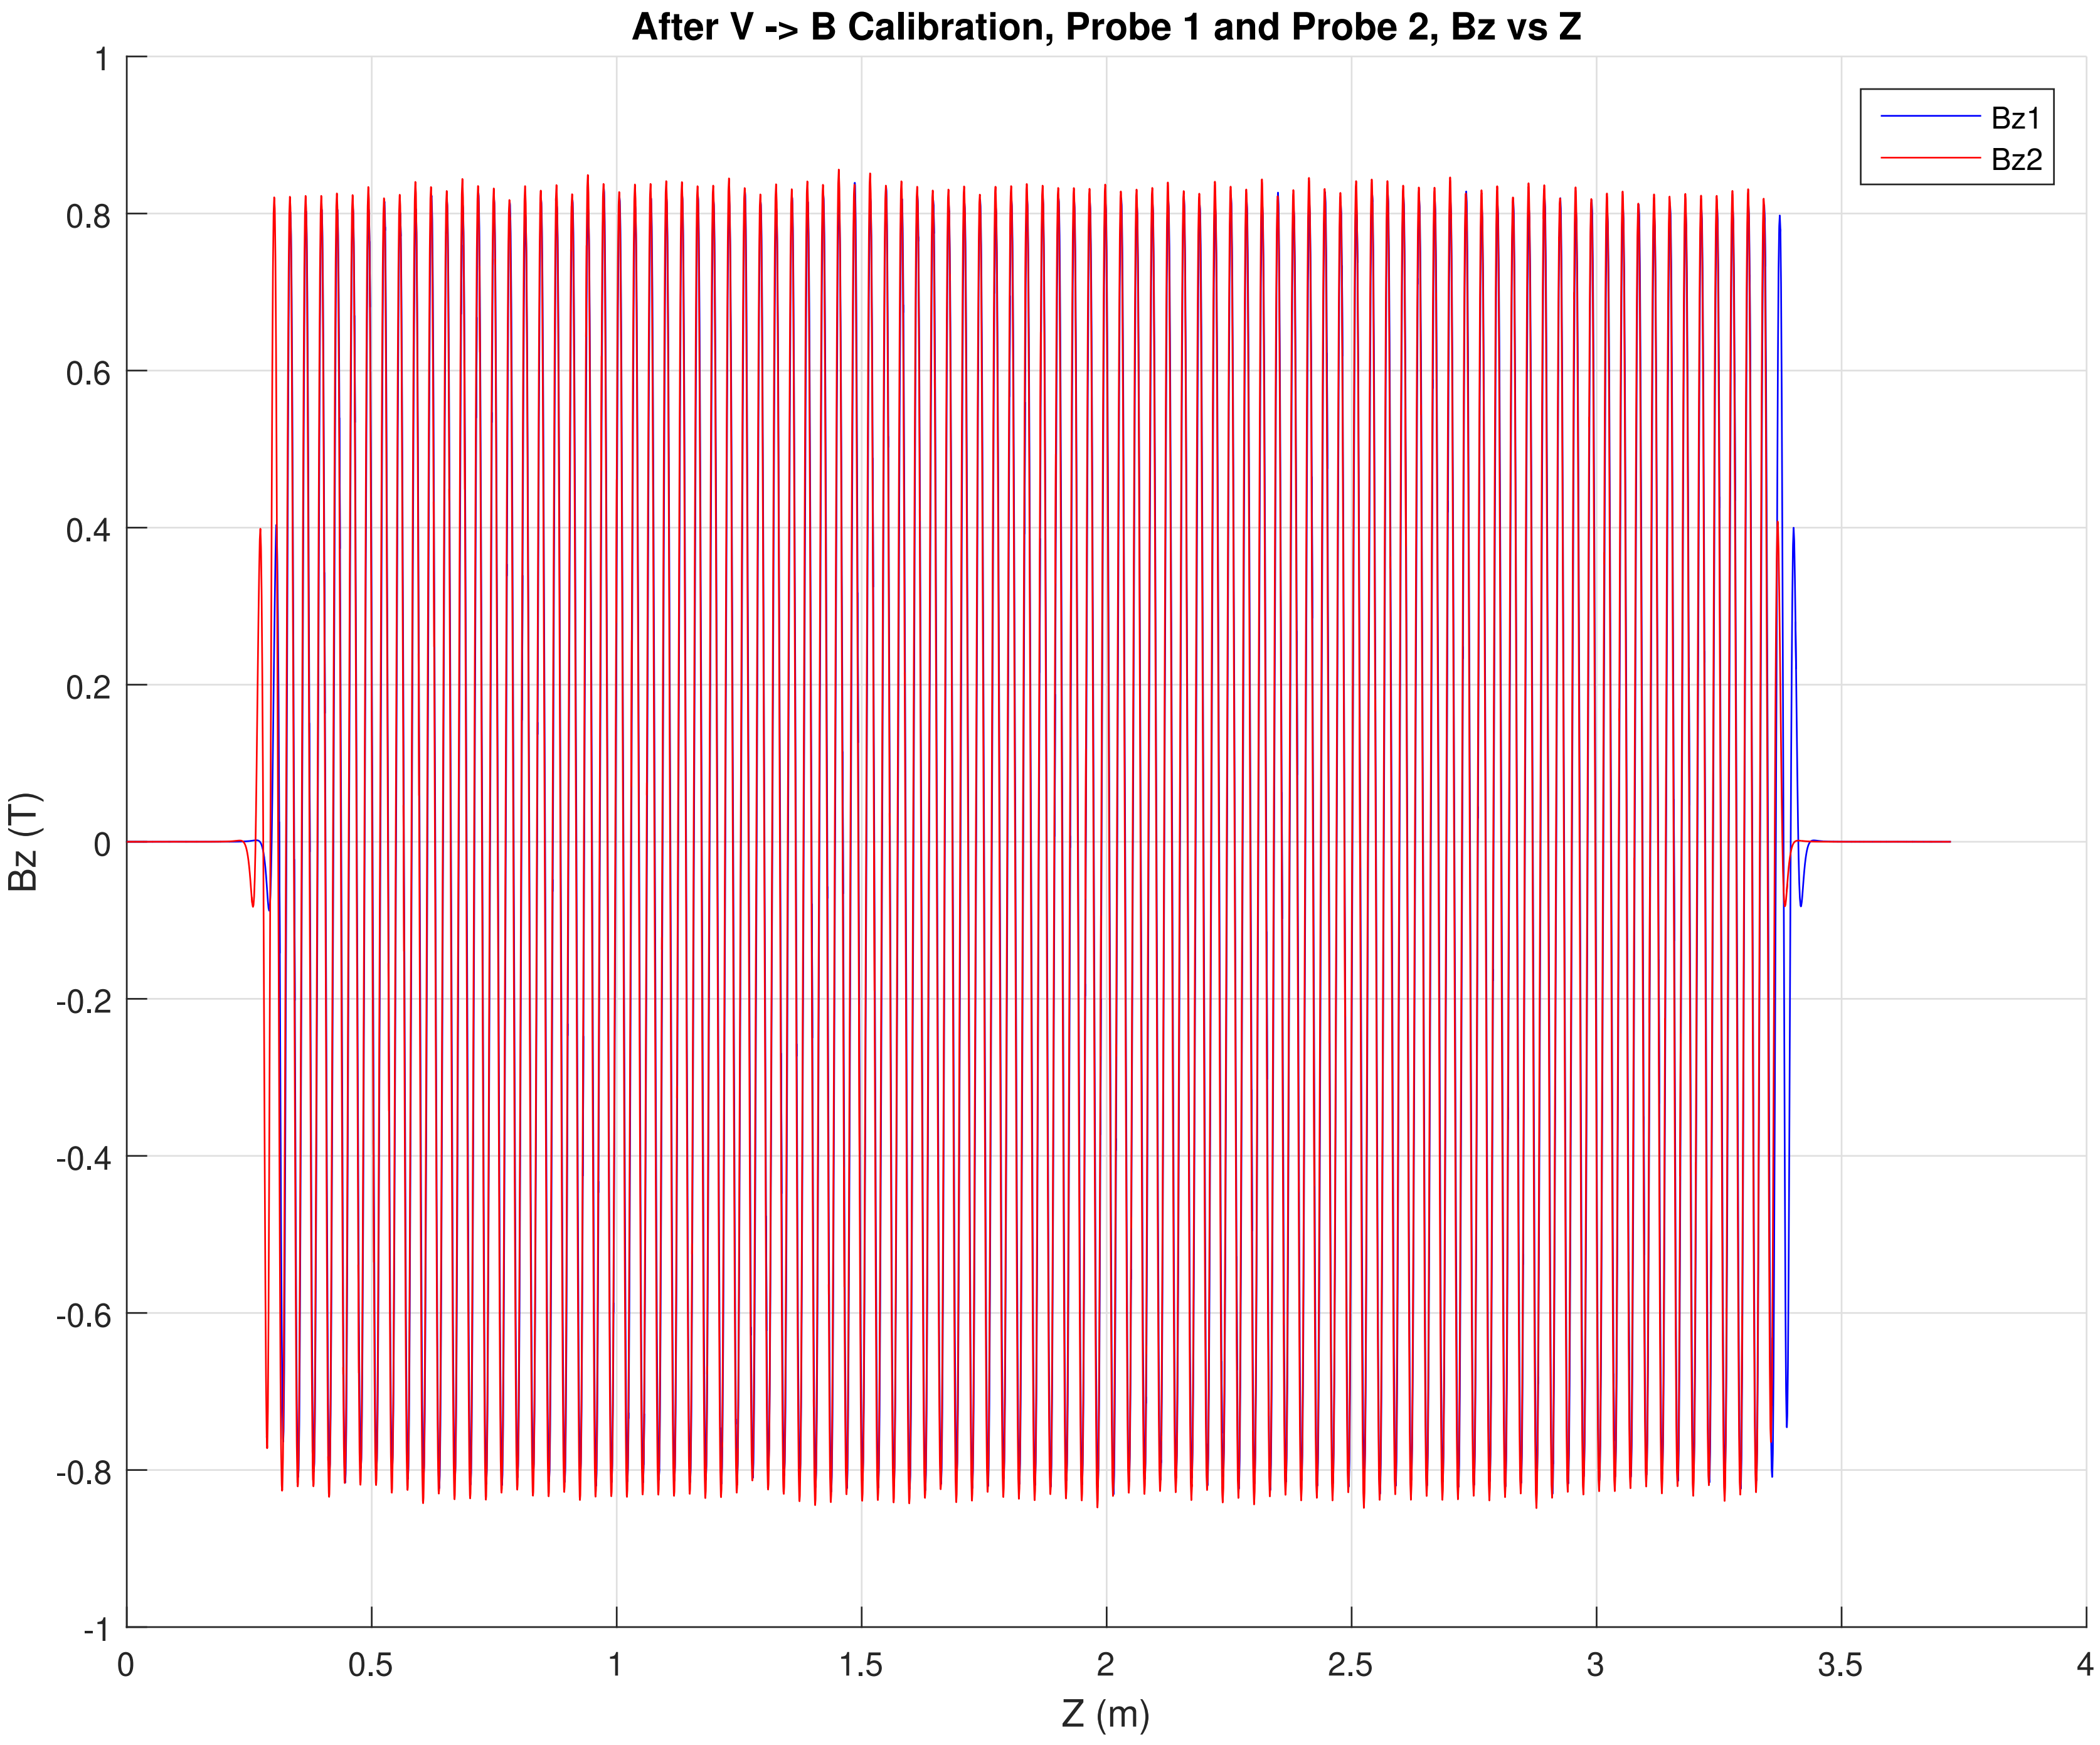

After V -> B Calibration, Probe 1 and Probe 2, Bz vs Z
Bz1
Bz2
Bz (T)
1
0.8
0.6
0.4
0.2
0
-0.2
-0.4
-0.6
-0.8
-1
0
0.5
1
1.5
2
2.5
3
3.5
4
Z (m)

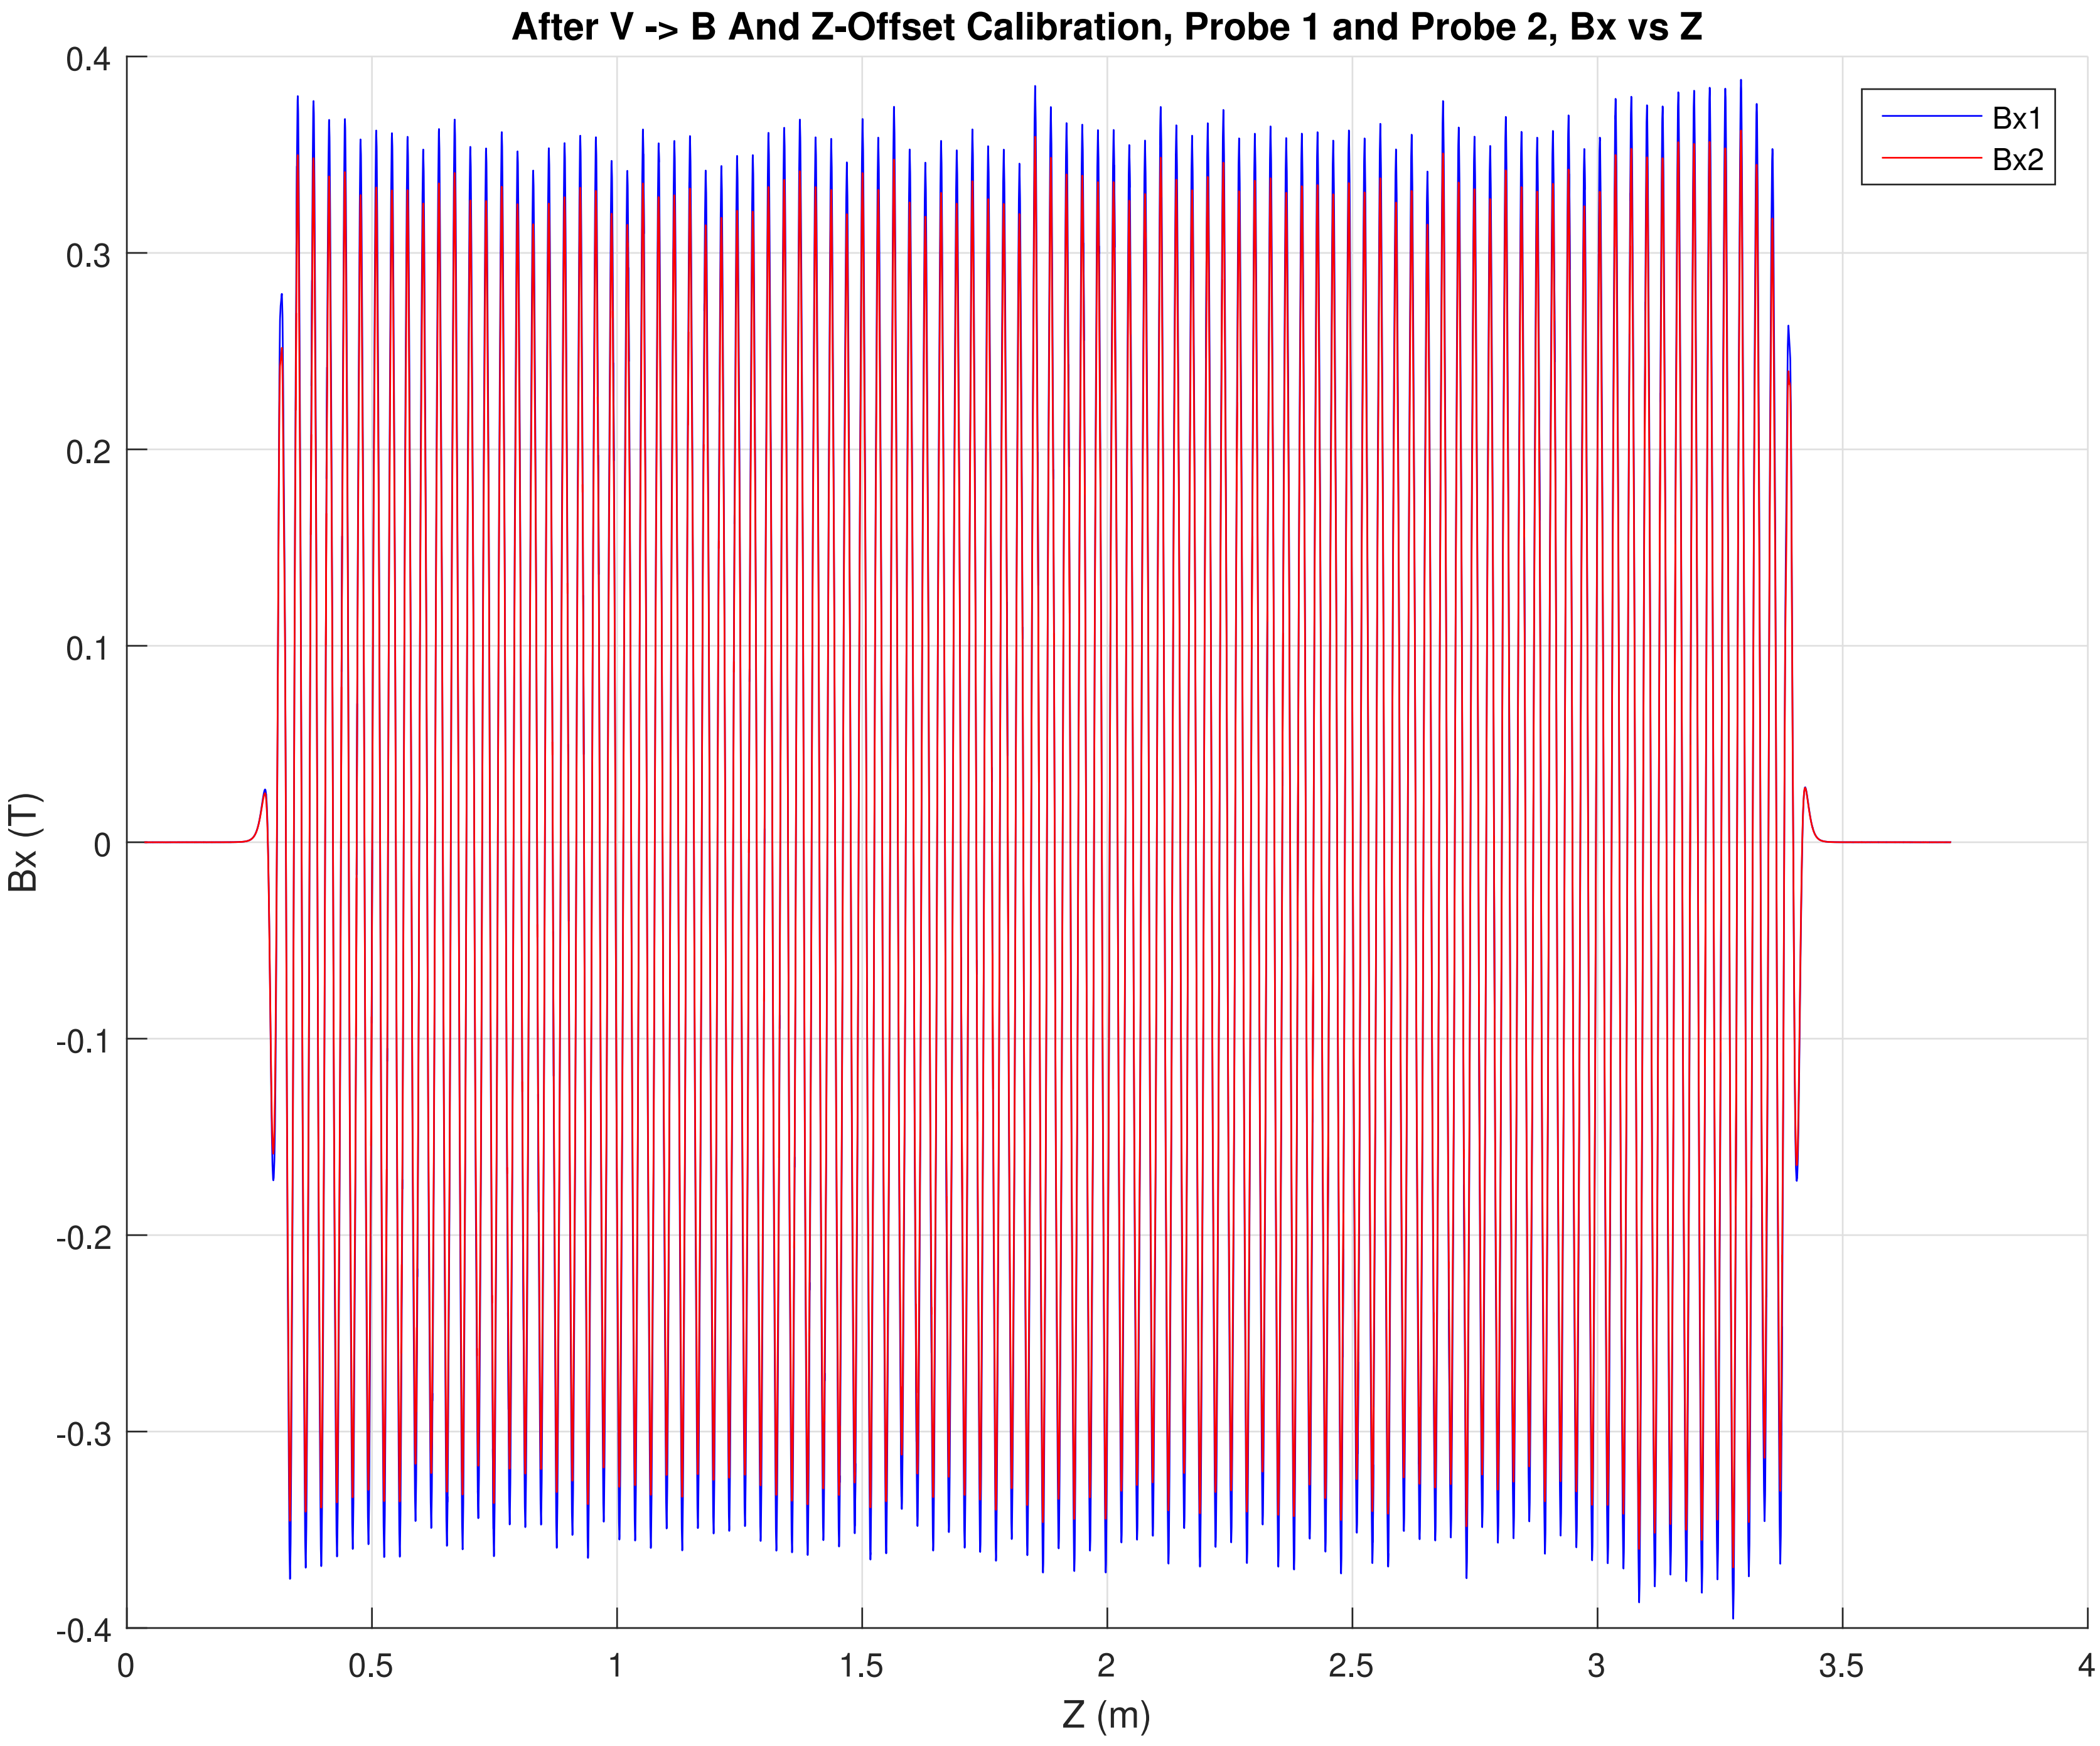
After V -> B And Z-Offset Calibration, Probe 1 and Probe 2, Bx vs Z
Bx1
Bx2
Bx (T)
0.4
0.3
0.2
0.1
0
-0.1
-0.2
-0.3
-0.4
Z (m)
0
0.5
1
1.5
2
2.5
3
3.5
4

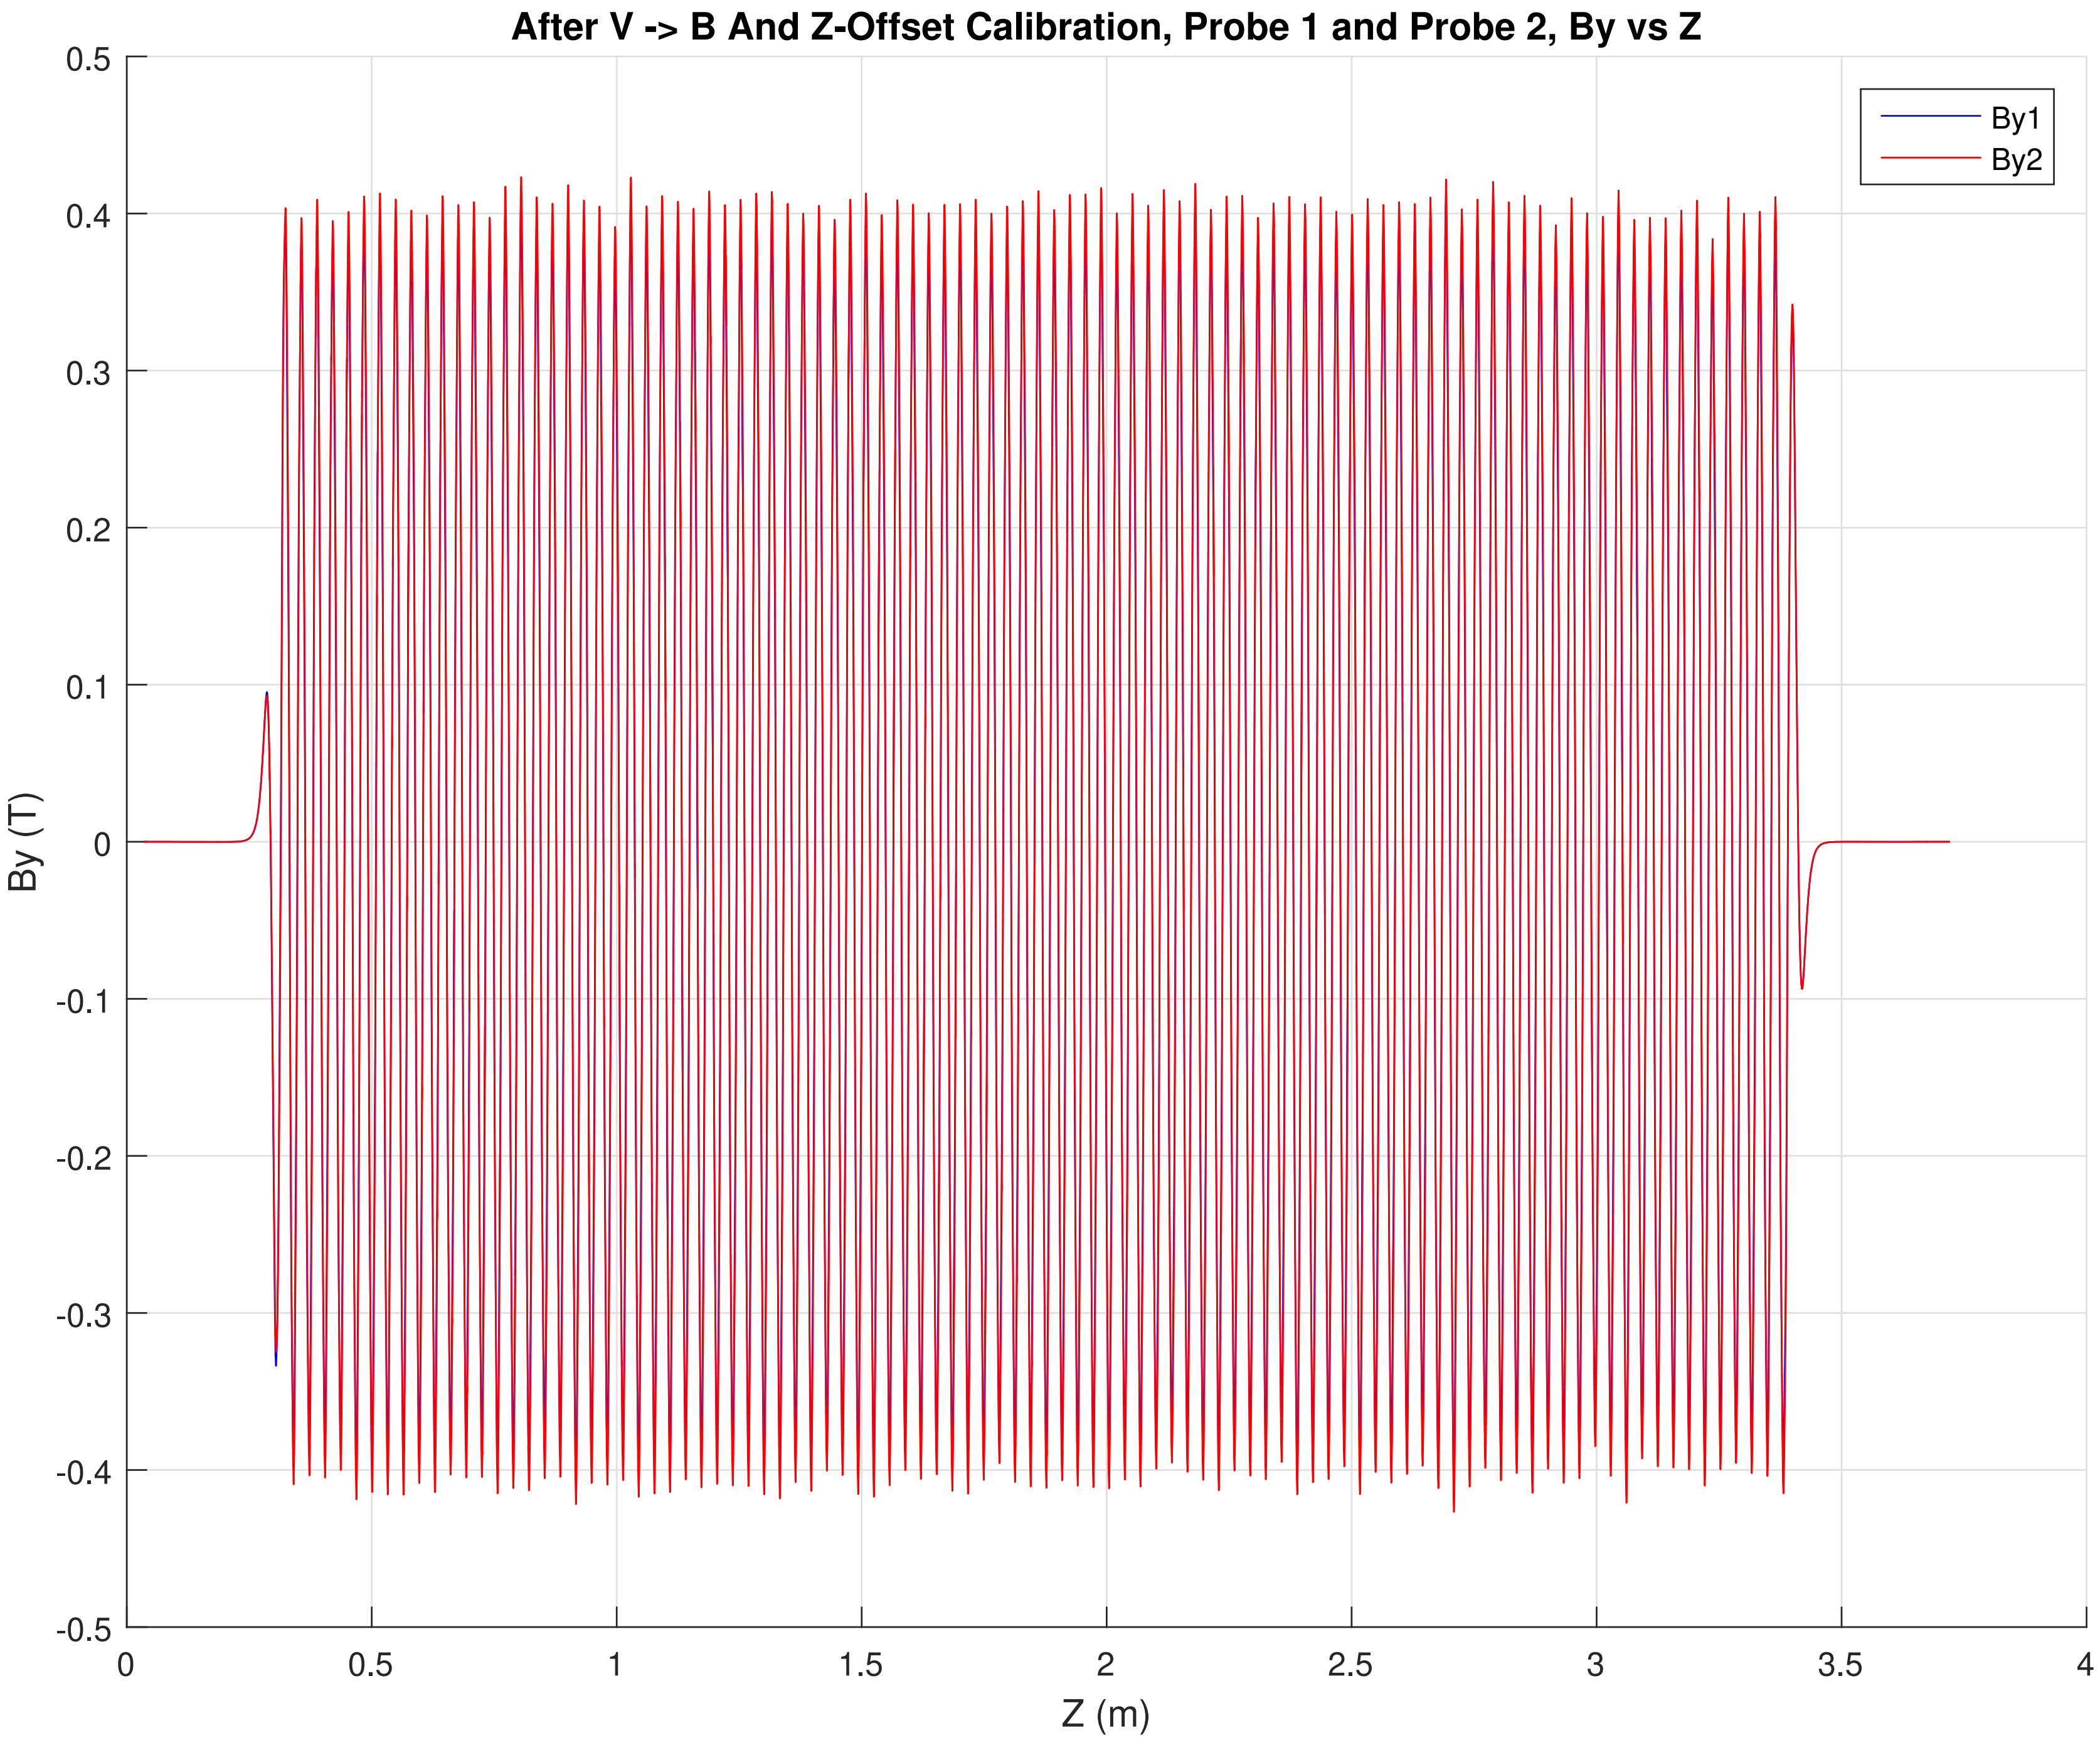
After V -> B And Z-Offset Calibration, Probe 1 and Probe 2, By vs Z
By1
By2
By (T)
0.5
0.4
0.3
0.2
0.1
0
-0.1
-0.2
-0.3
-0.4
-0.5
0
0.5
1
1.5
2
2.5
3
3.5
4
Z (m)

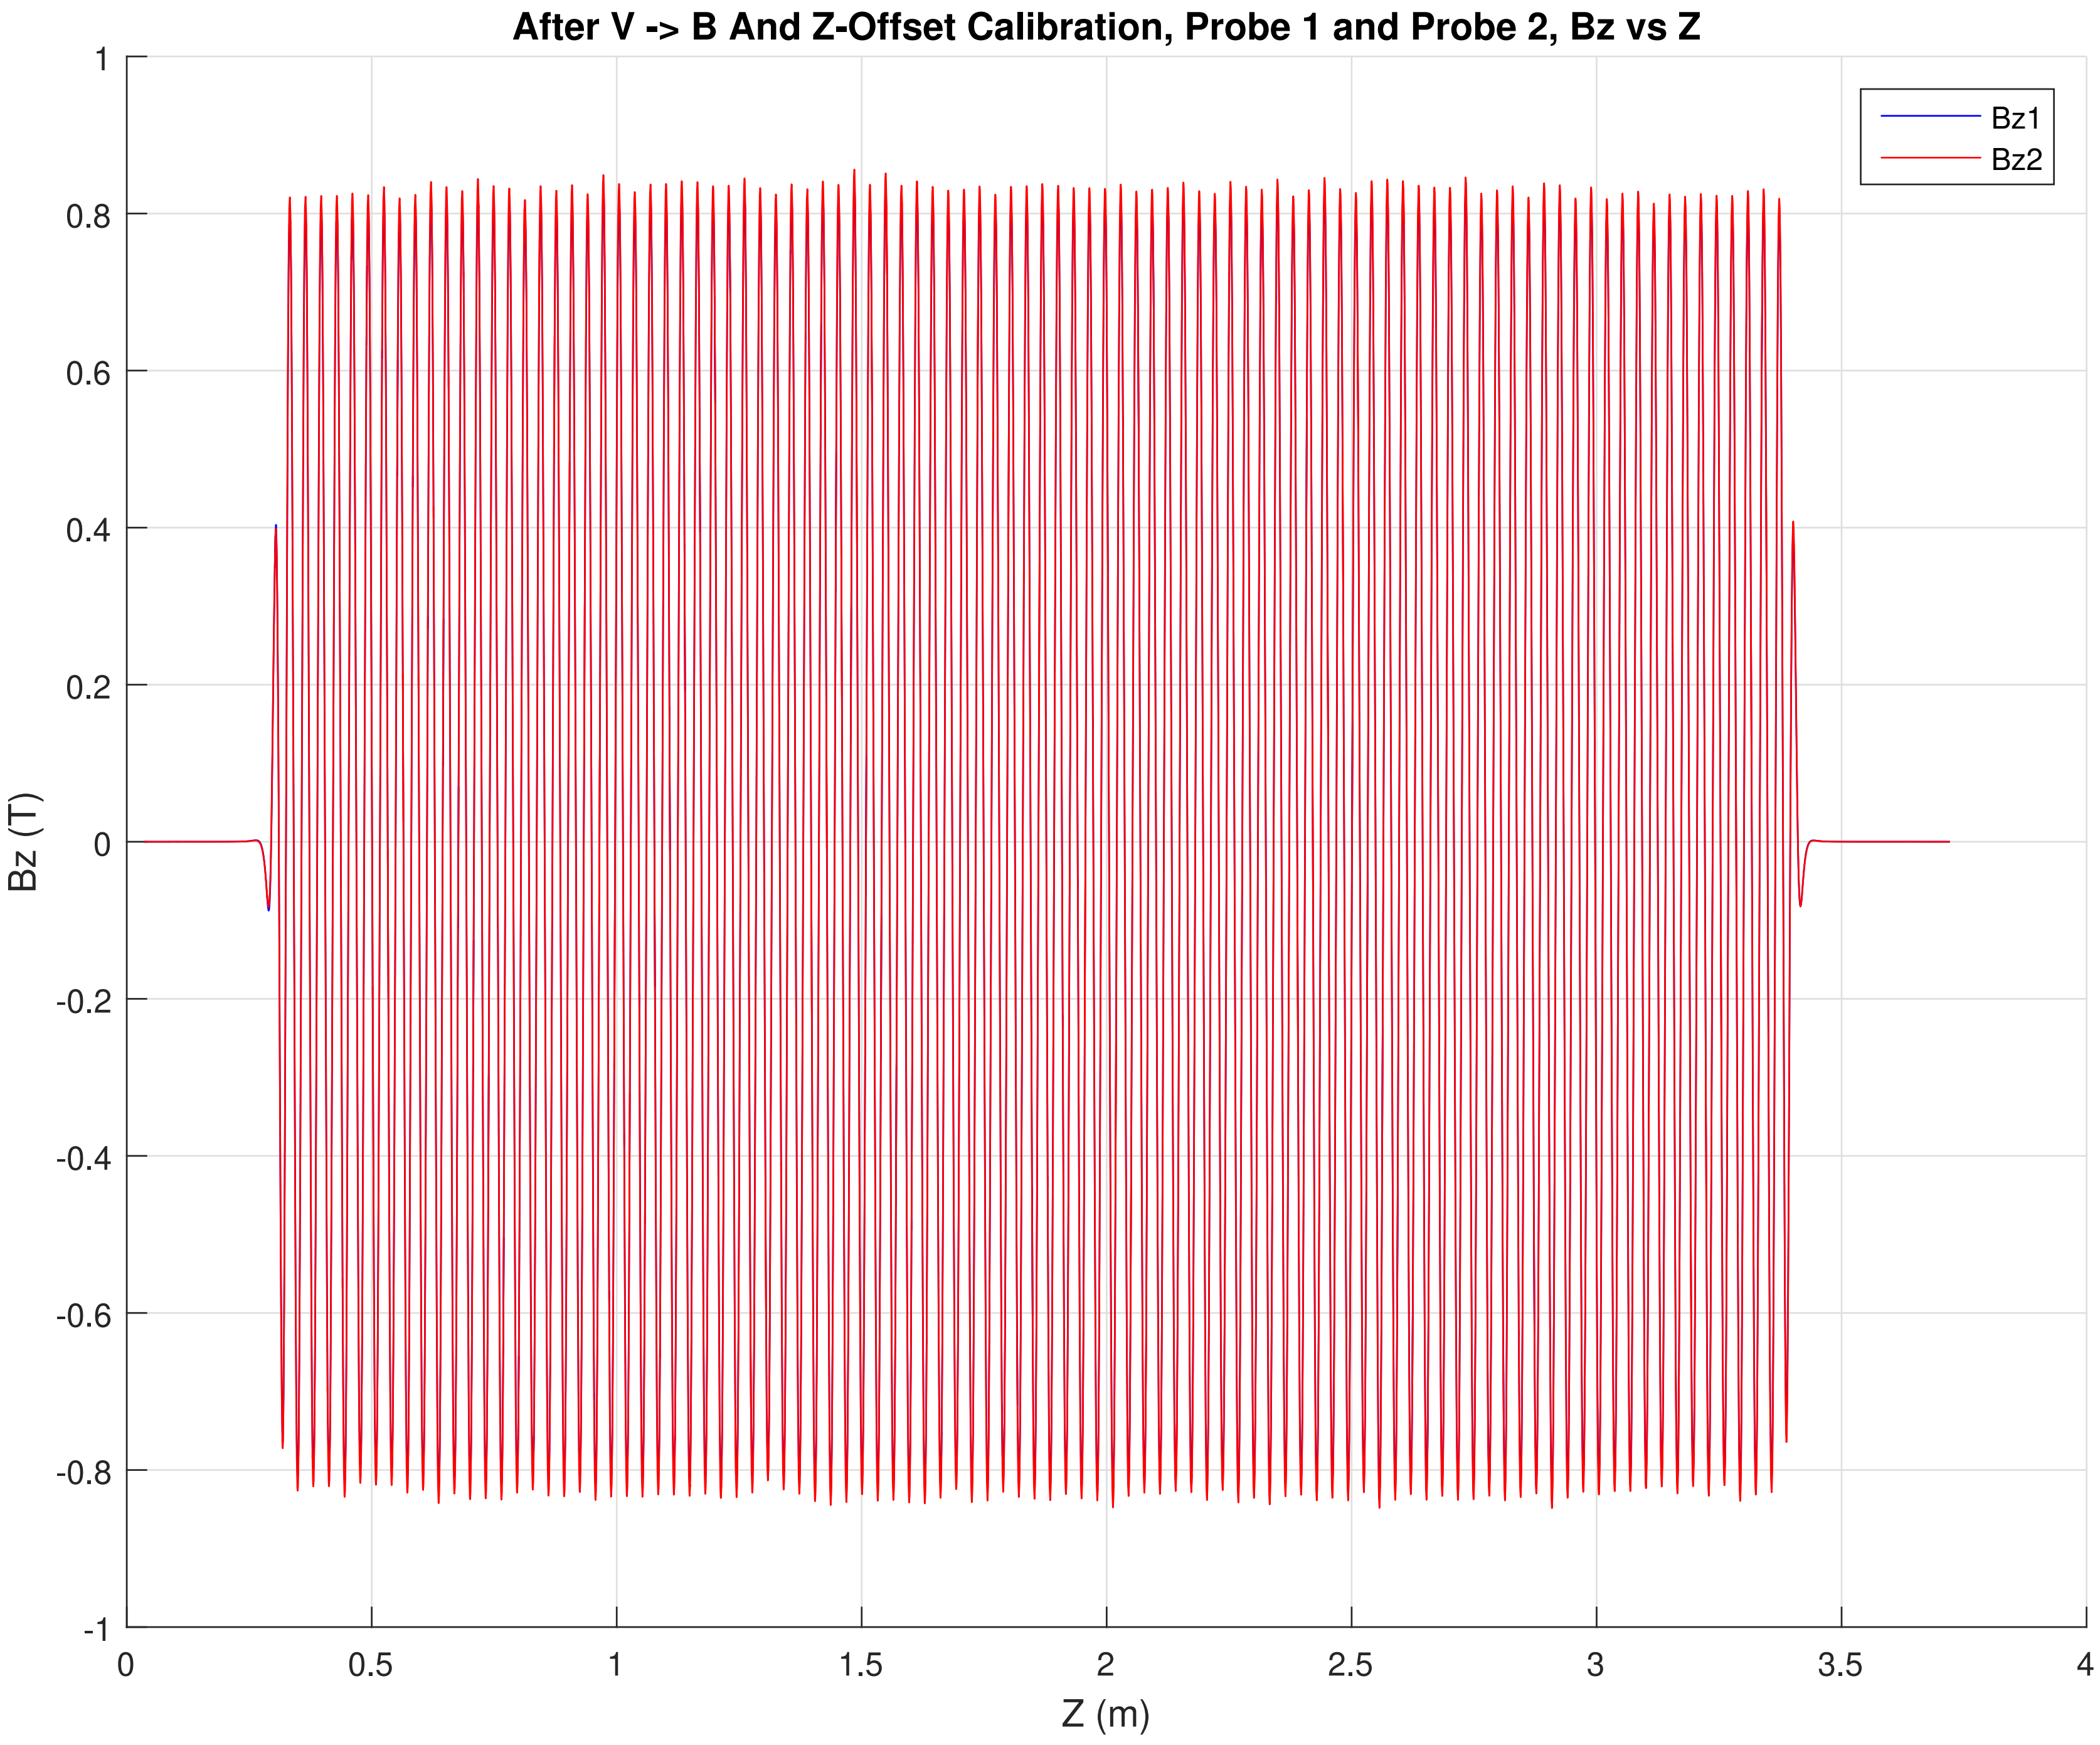
After V -> B And Z-Offset Calibration, Probe 1 and Probe 2, Bz vs Z
Bz1
Bz2
Bz (T)
1
0.8
0.6
0.4
0.2
0
-0.2
-0.4
-0.6
-0.8
-1
Z (m)
0
0.5
1
1.5
2
2.5
3
3.5
4

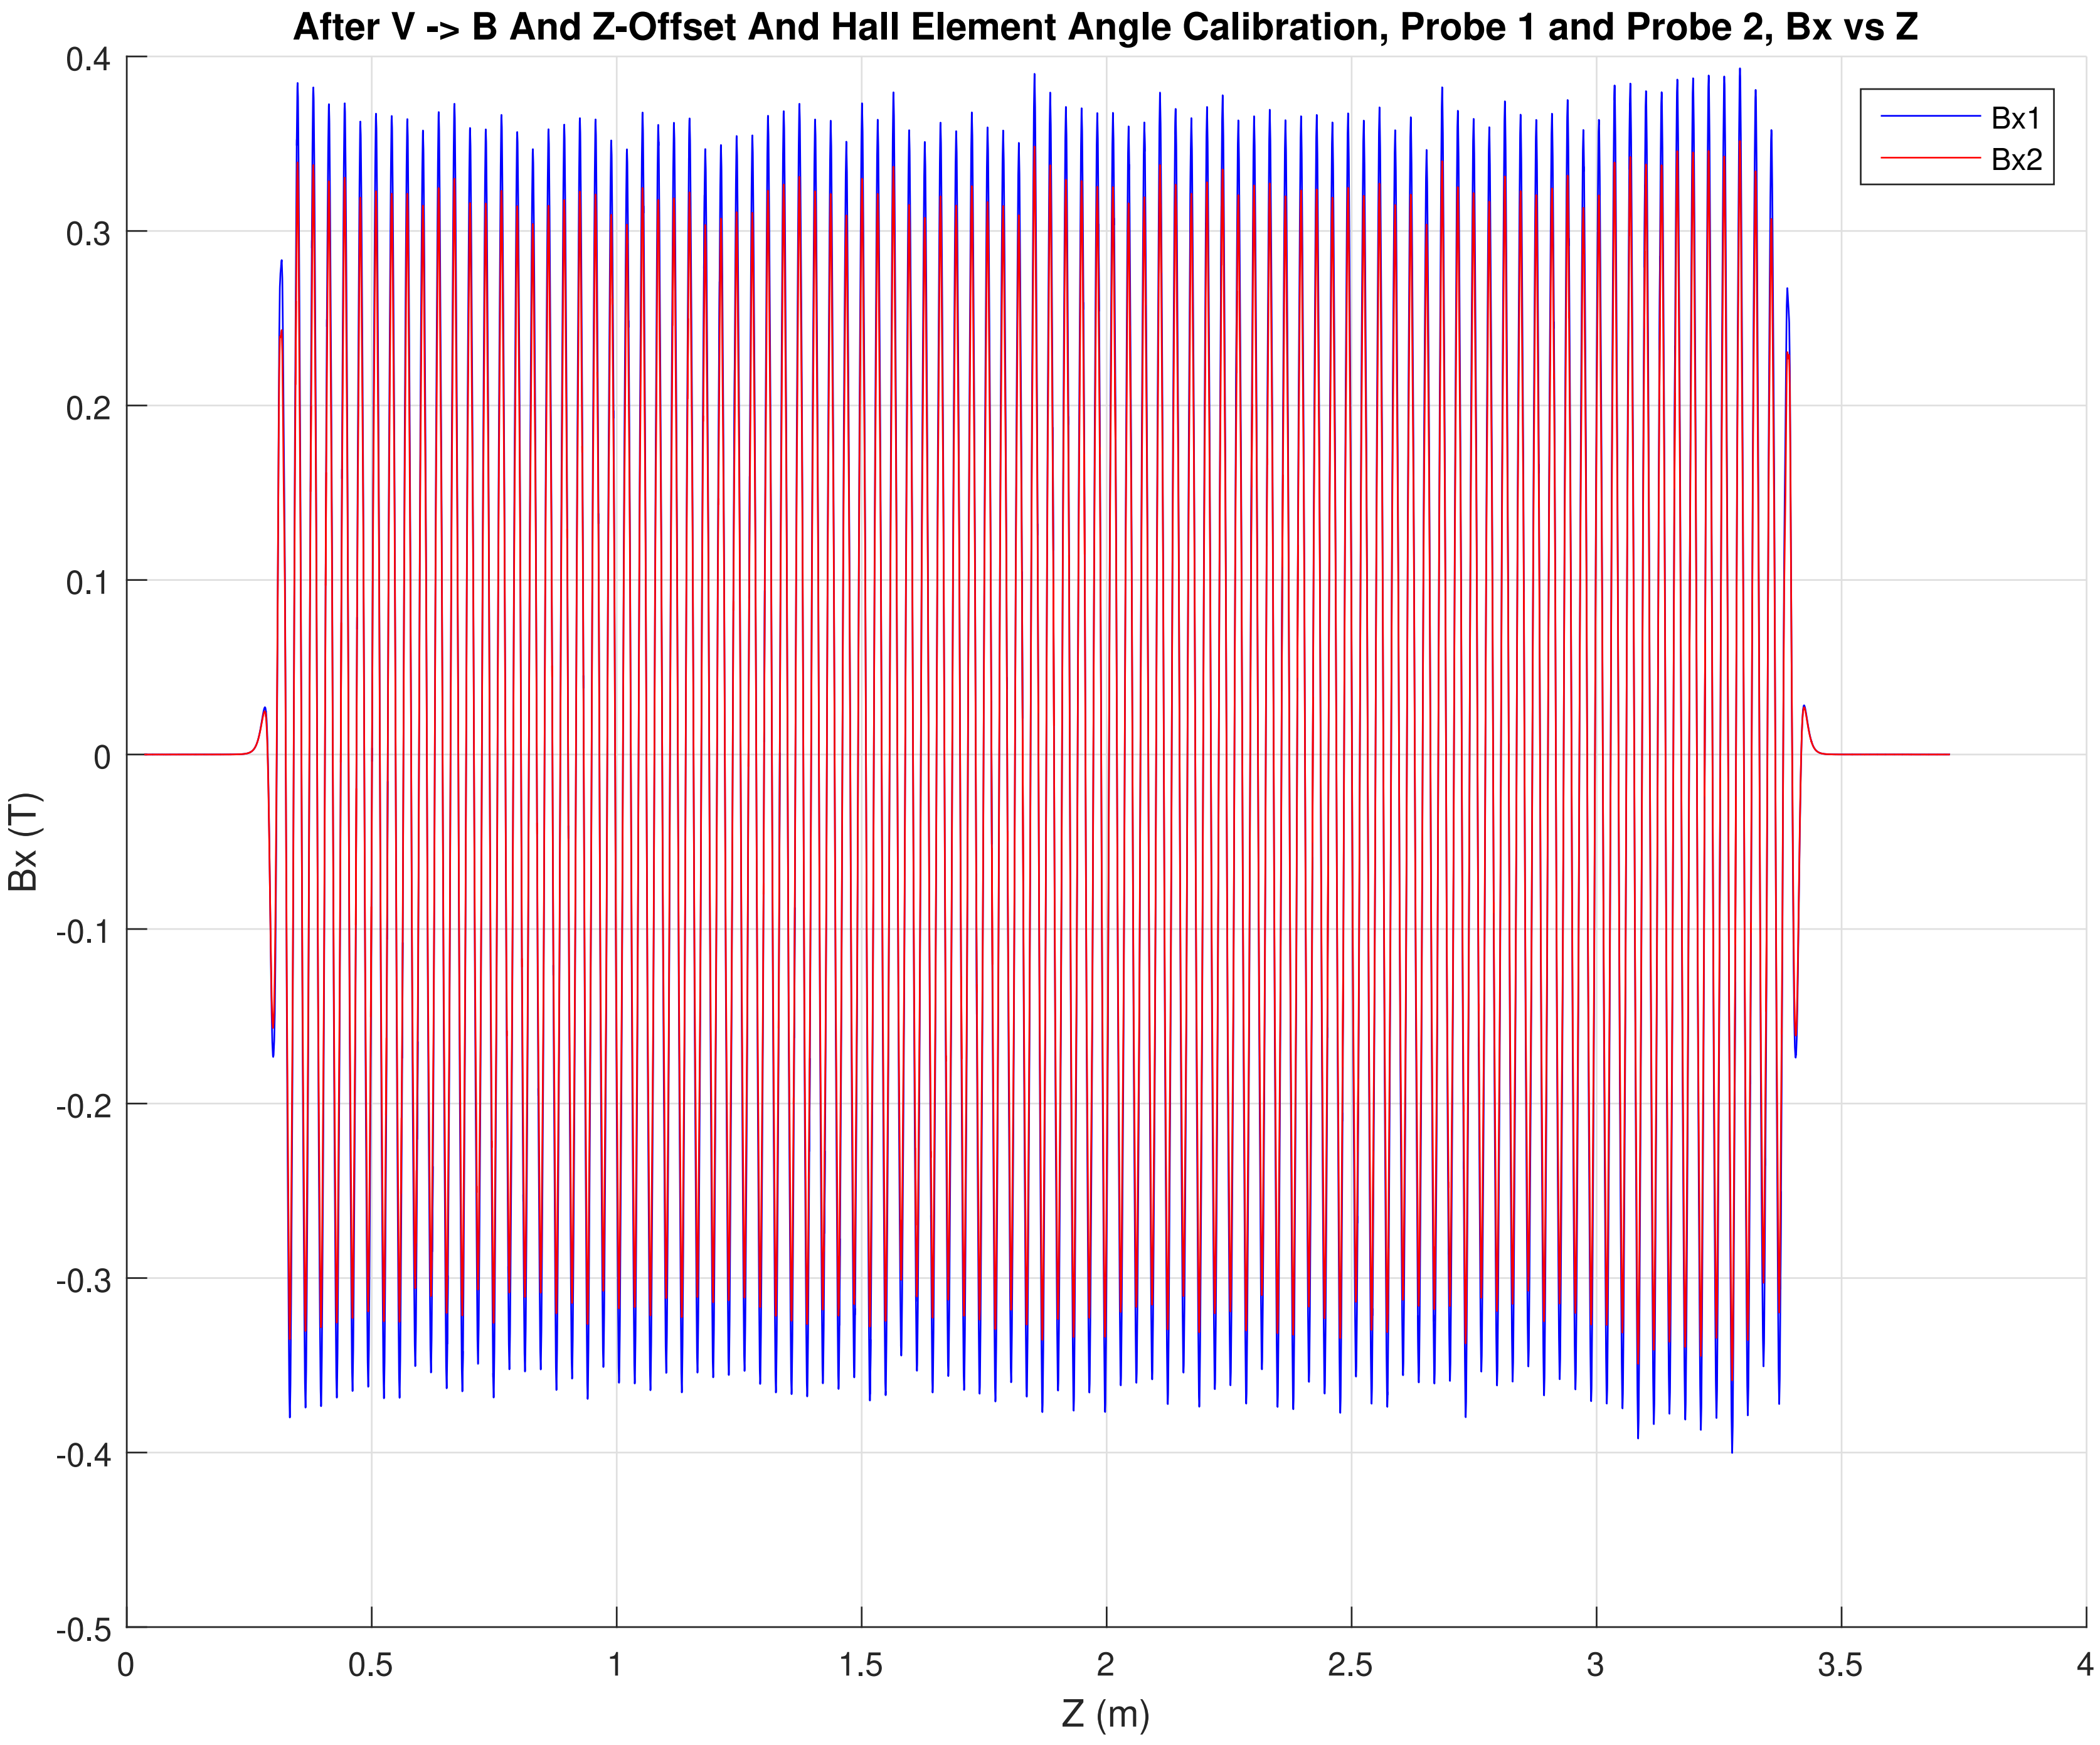
After V -> B And Z-Offset And Hall Element Angle Calibration, Probe 1 and Probe 2, Bx vs Z
Bx (T)
0.4
0.3
0.2
0.1
0
-0.1
-0.2
-0.3
-0.4
-0.5
Z (m)
0
0.5
1
1.5
2
2.5
3
3.5
4
Bx1
Bx2

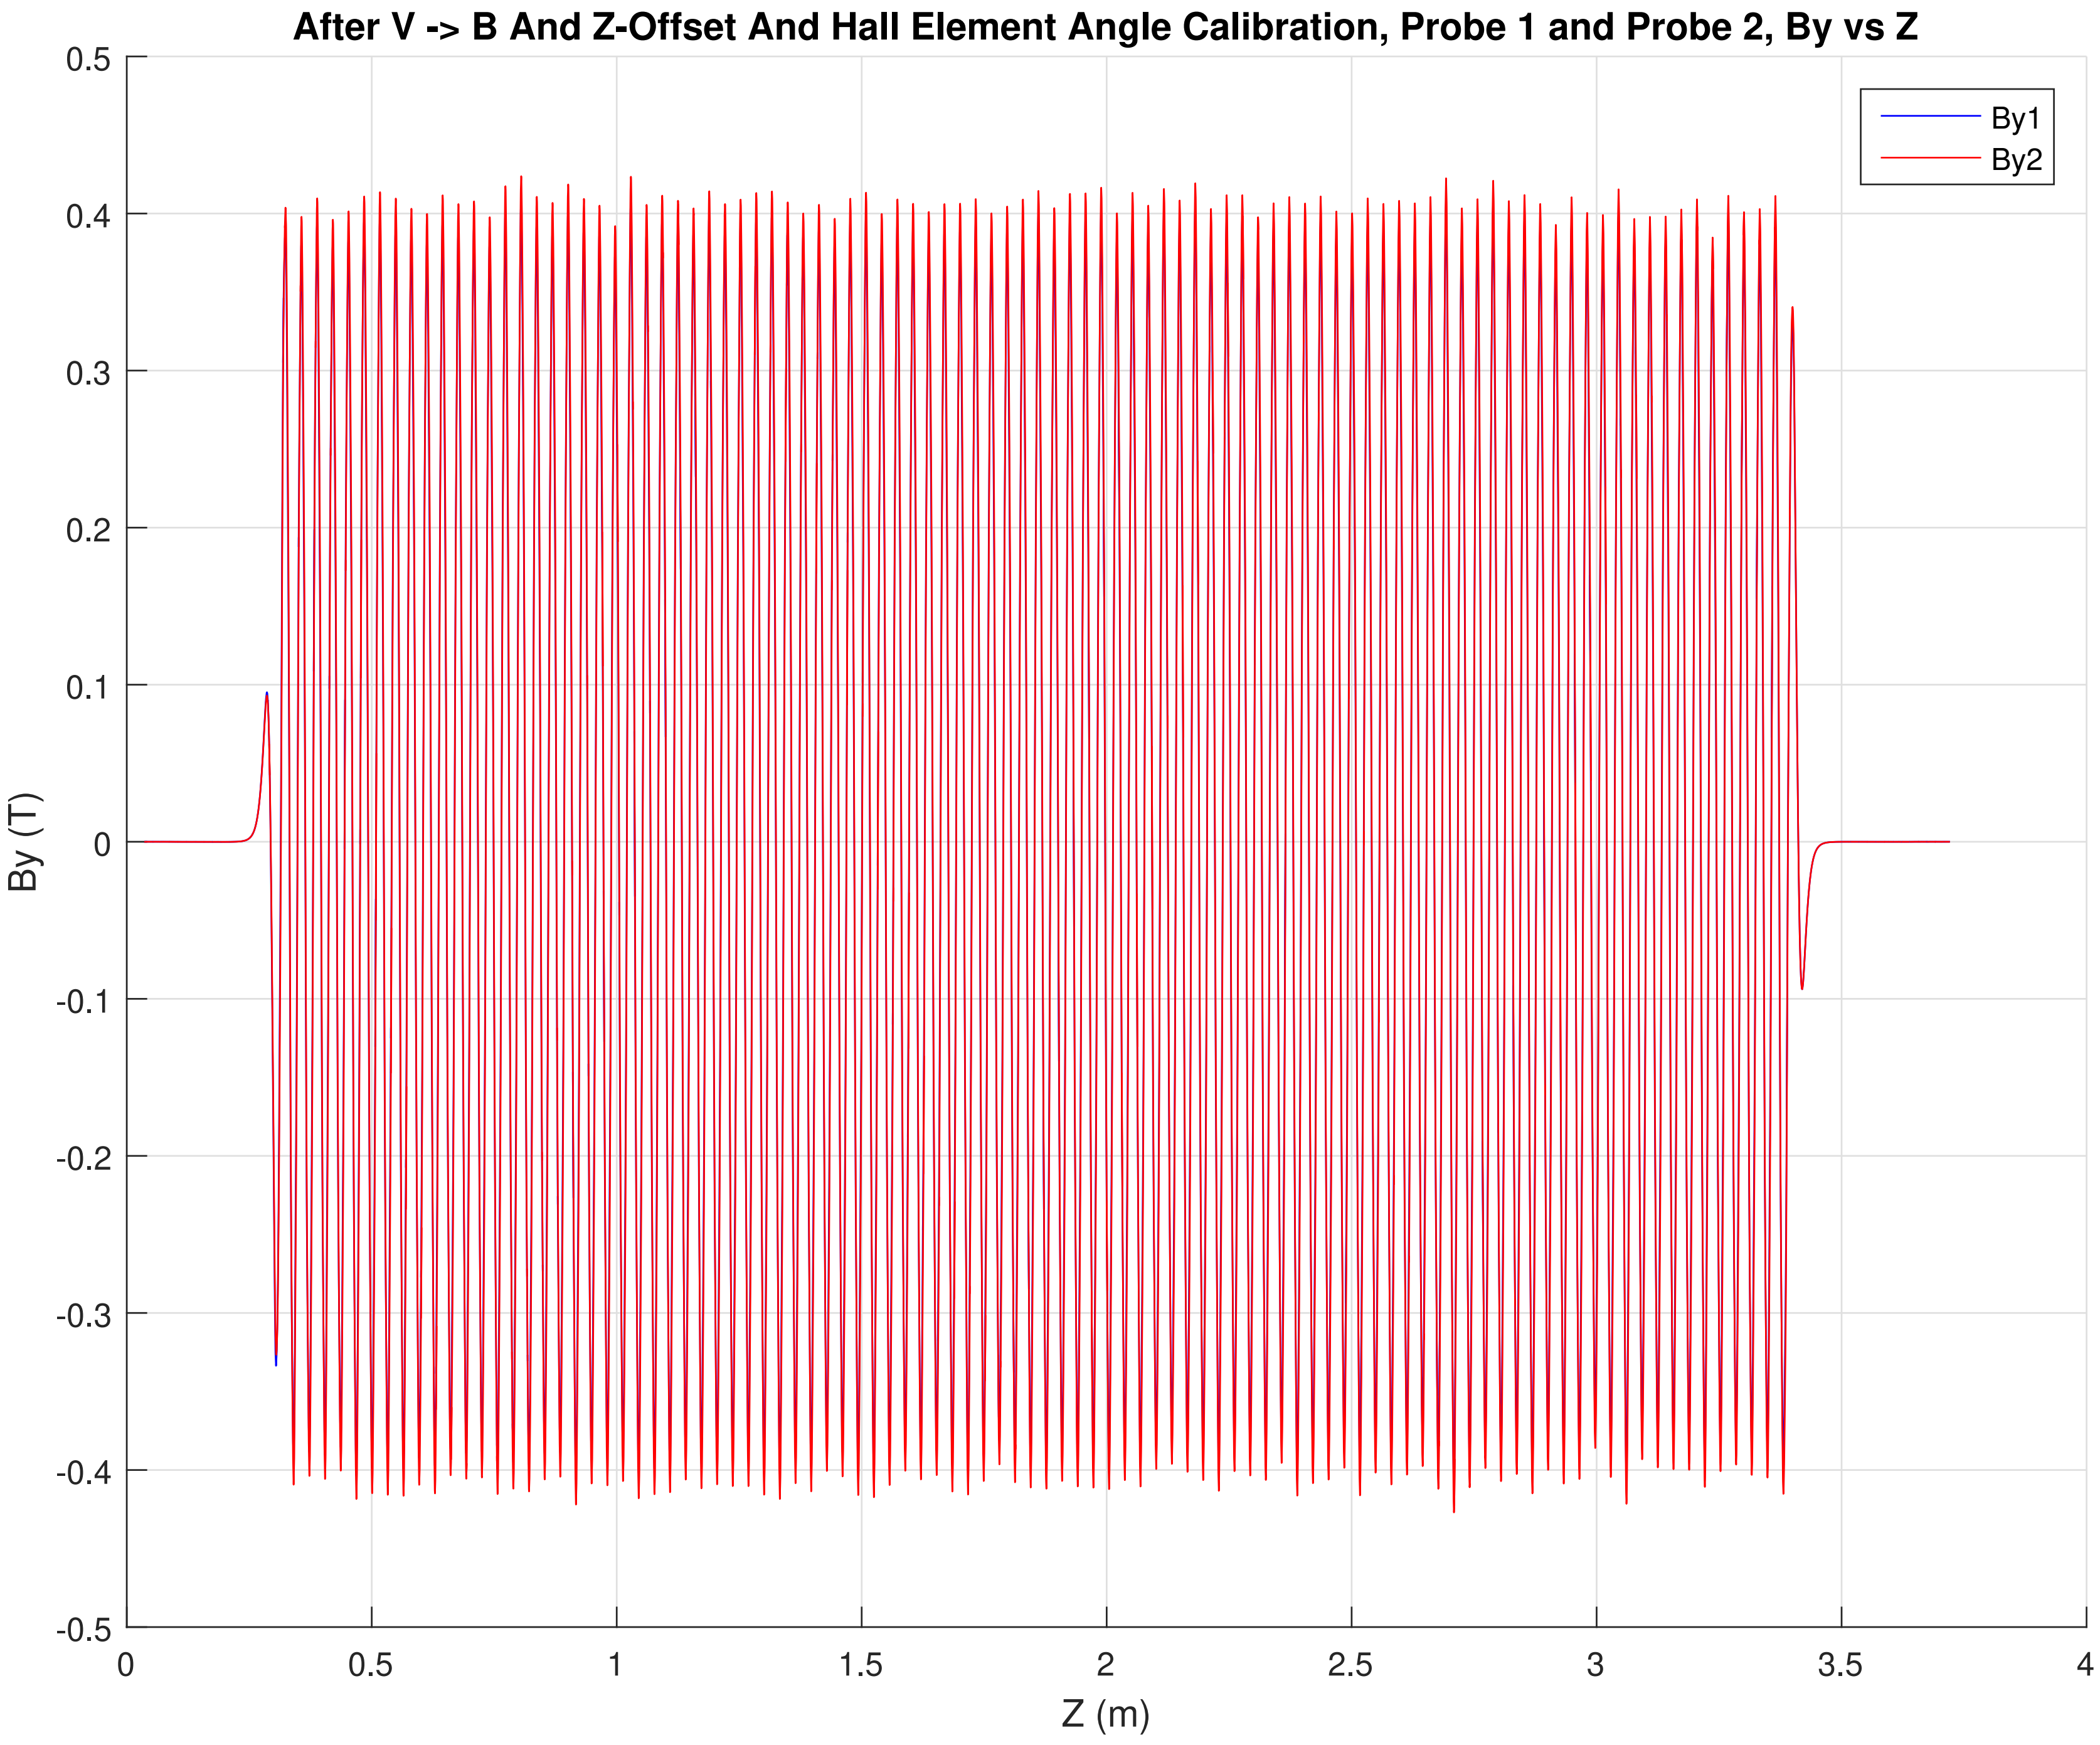
After V -> B And Z-Offset And Hall Element Angle Calibration, Probe 1 and Probe 2, By vs Z
By1
By2
By (T)
Z (m)
0.5
0.4
0.3
0.2
0.1
0
-0.1
-0.2
-0.3
-0.4
-0.5
0
0.5
1
1.5
2
2.5
3
3.5
4

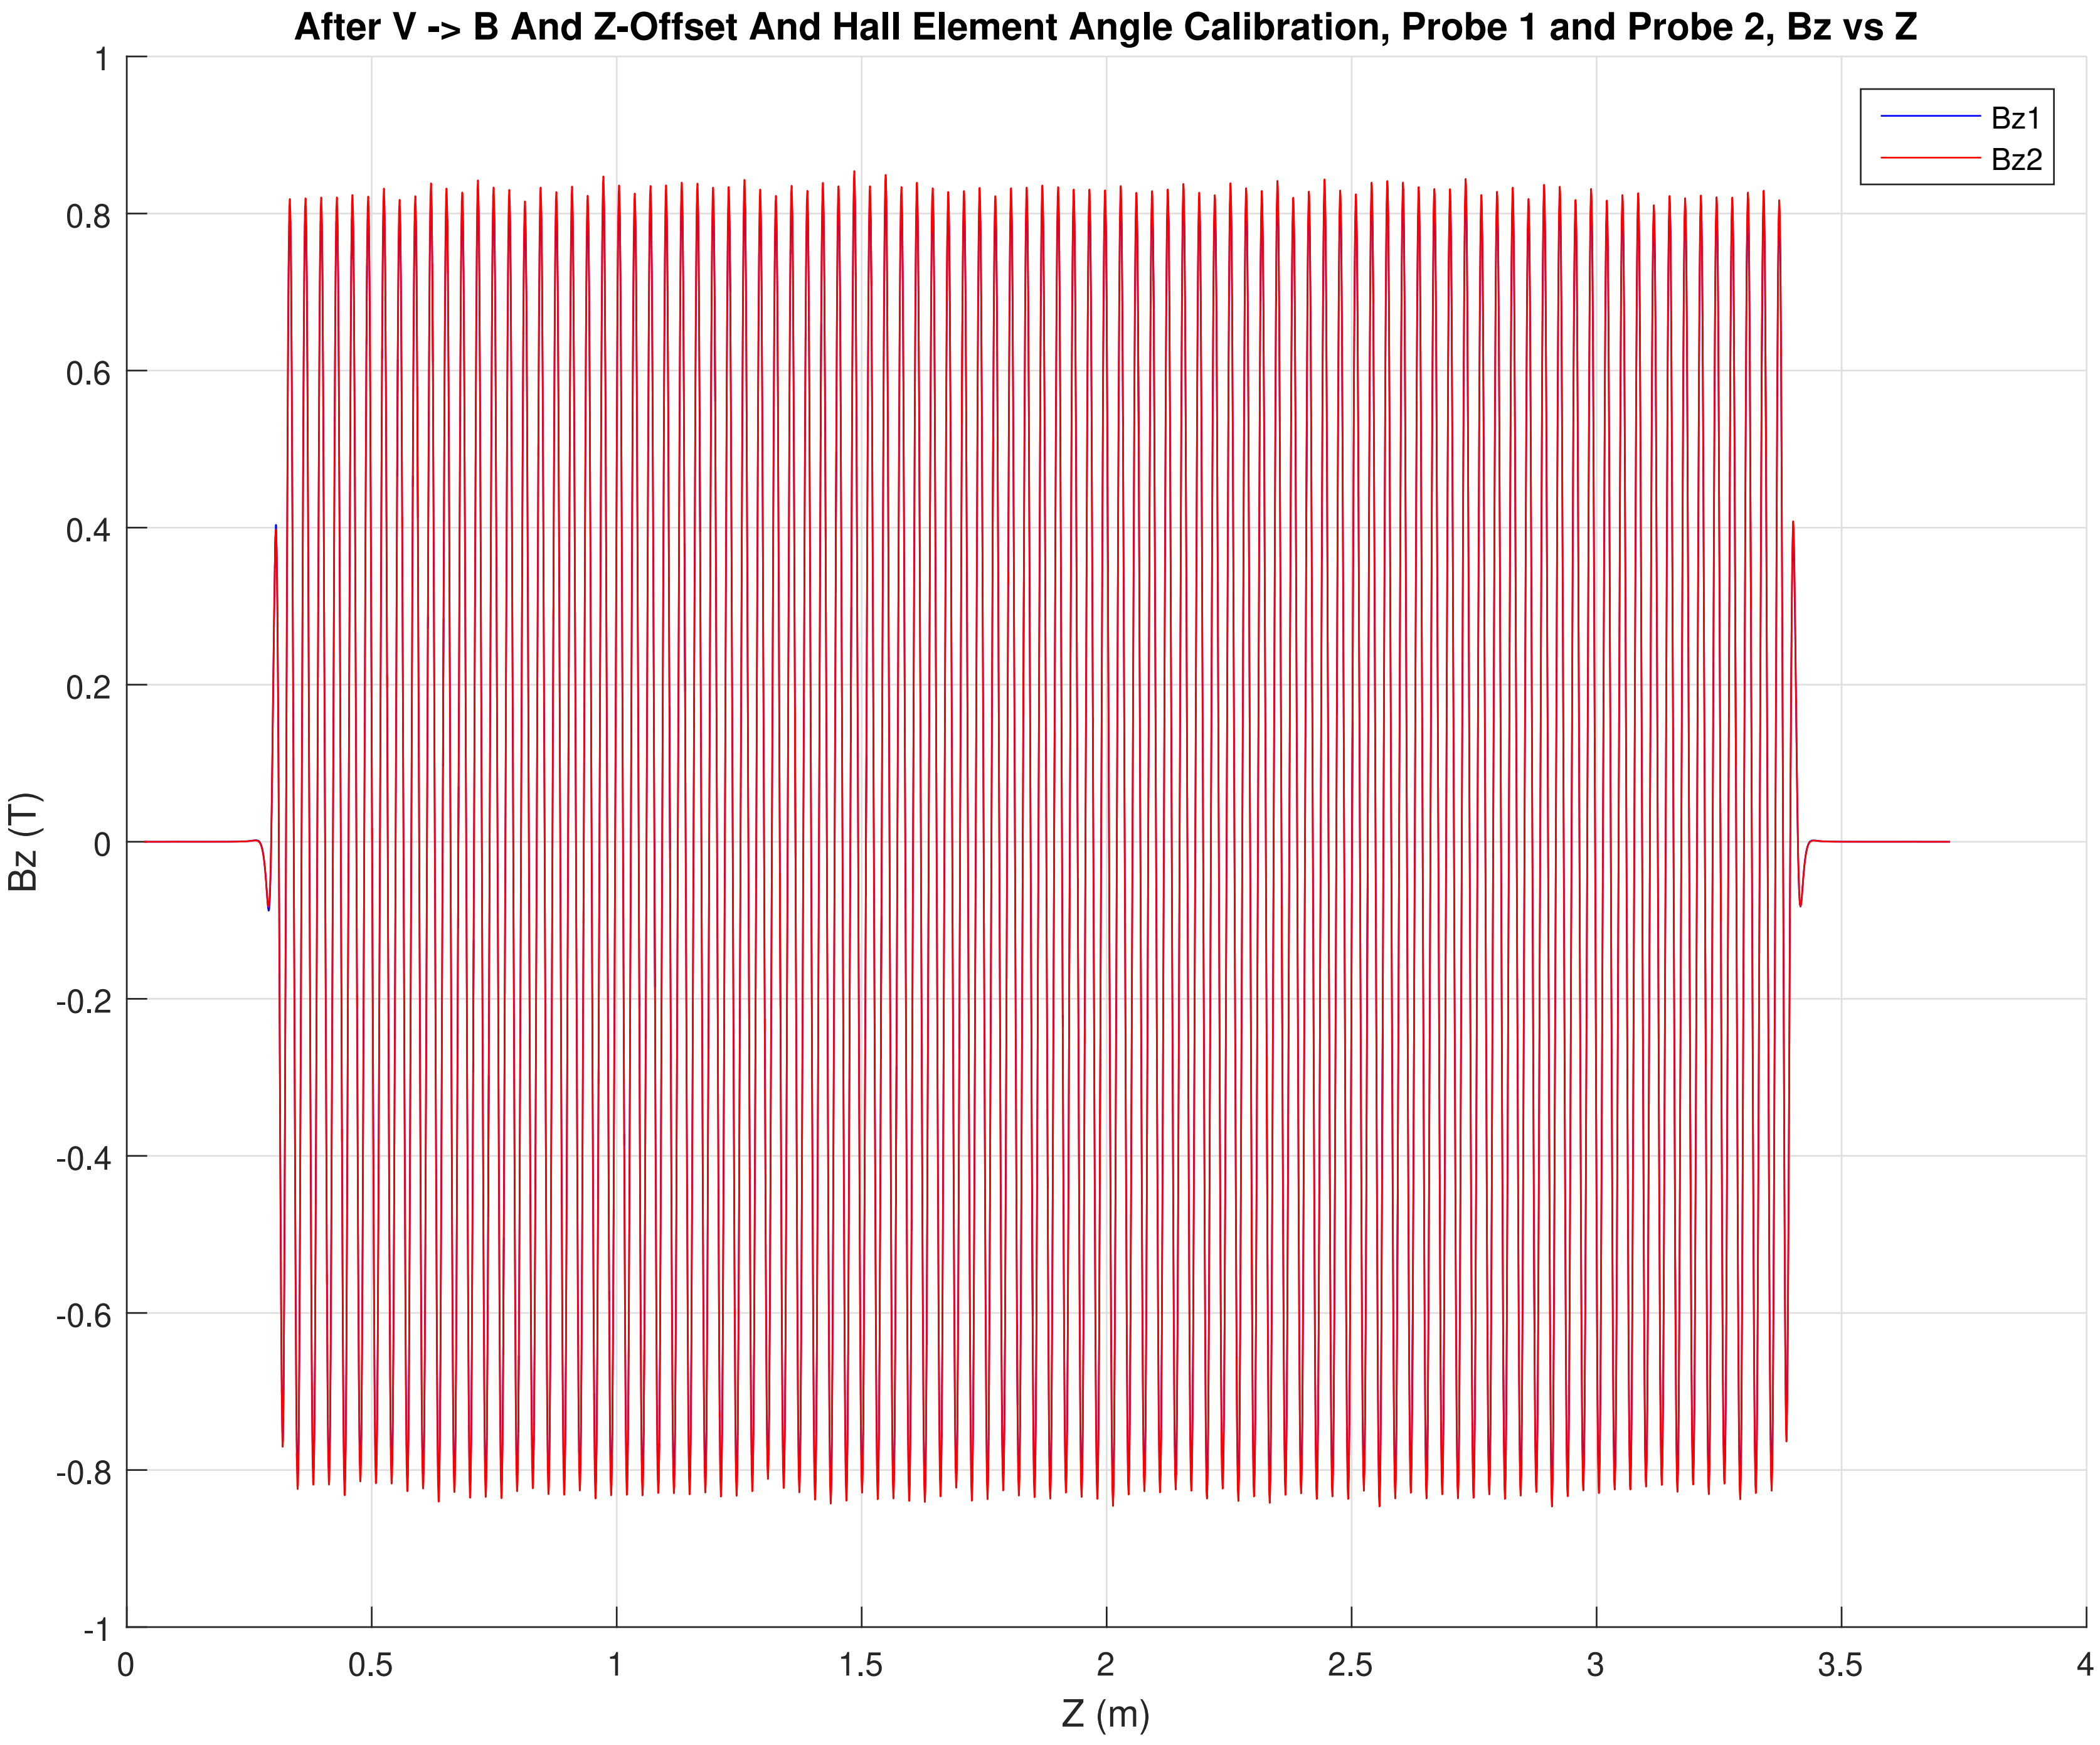
After V -> B And Z-Offset And Hall Element Angle Calibration, Probe 1 and Probe 2, Bz vs Z
Bz1
Bz2
Bz (T)
1
0.8
0.6
0.4
0.2
0
-0.2
-0.4
-0.6
-0.8
-1
0
0.5
1
1.5
2
2.5
3
3.5
4
Z (m)

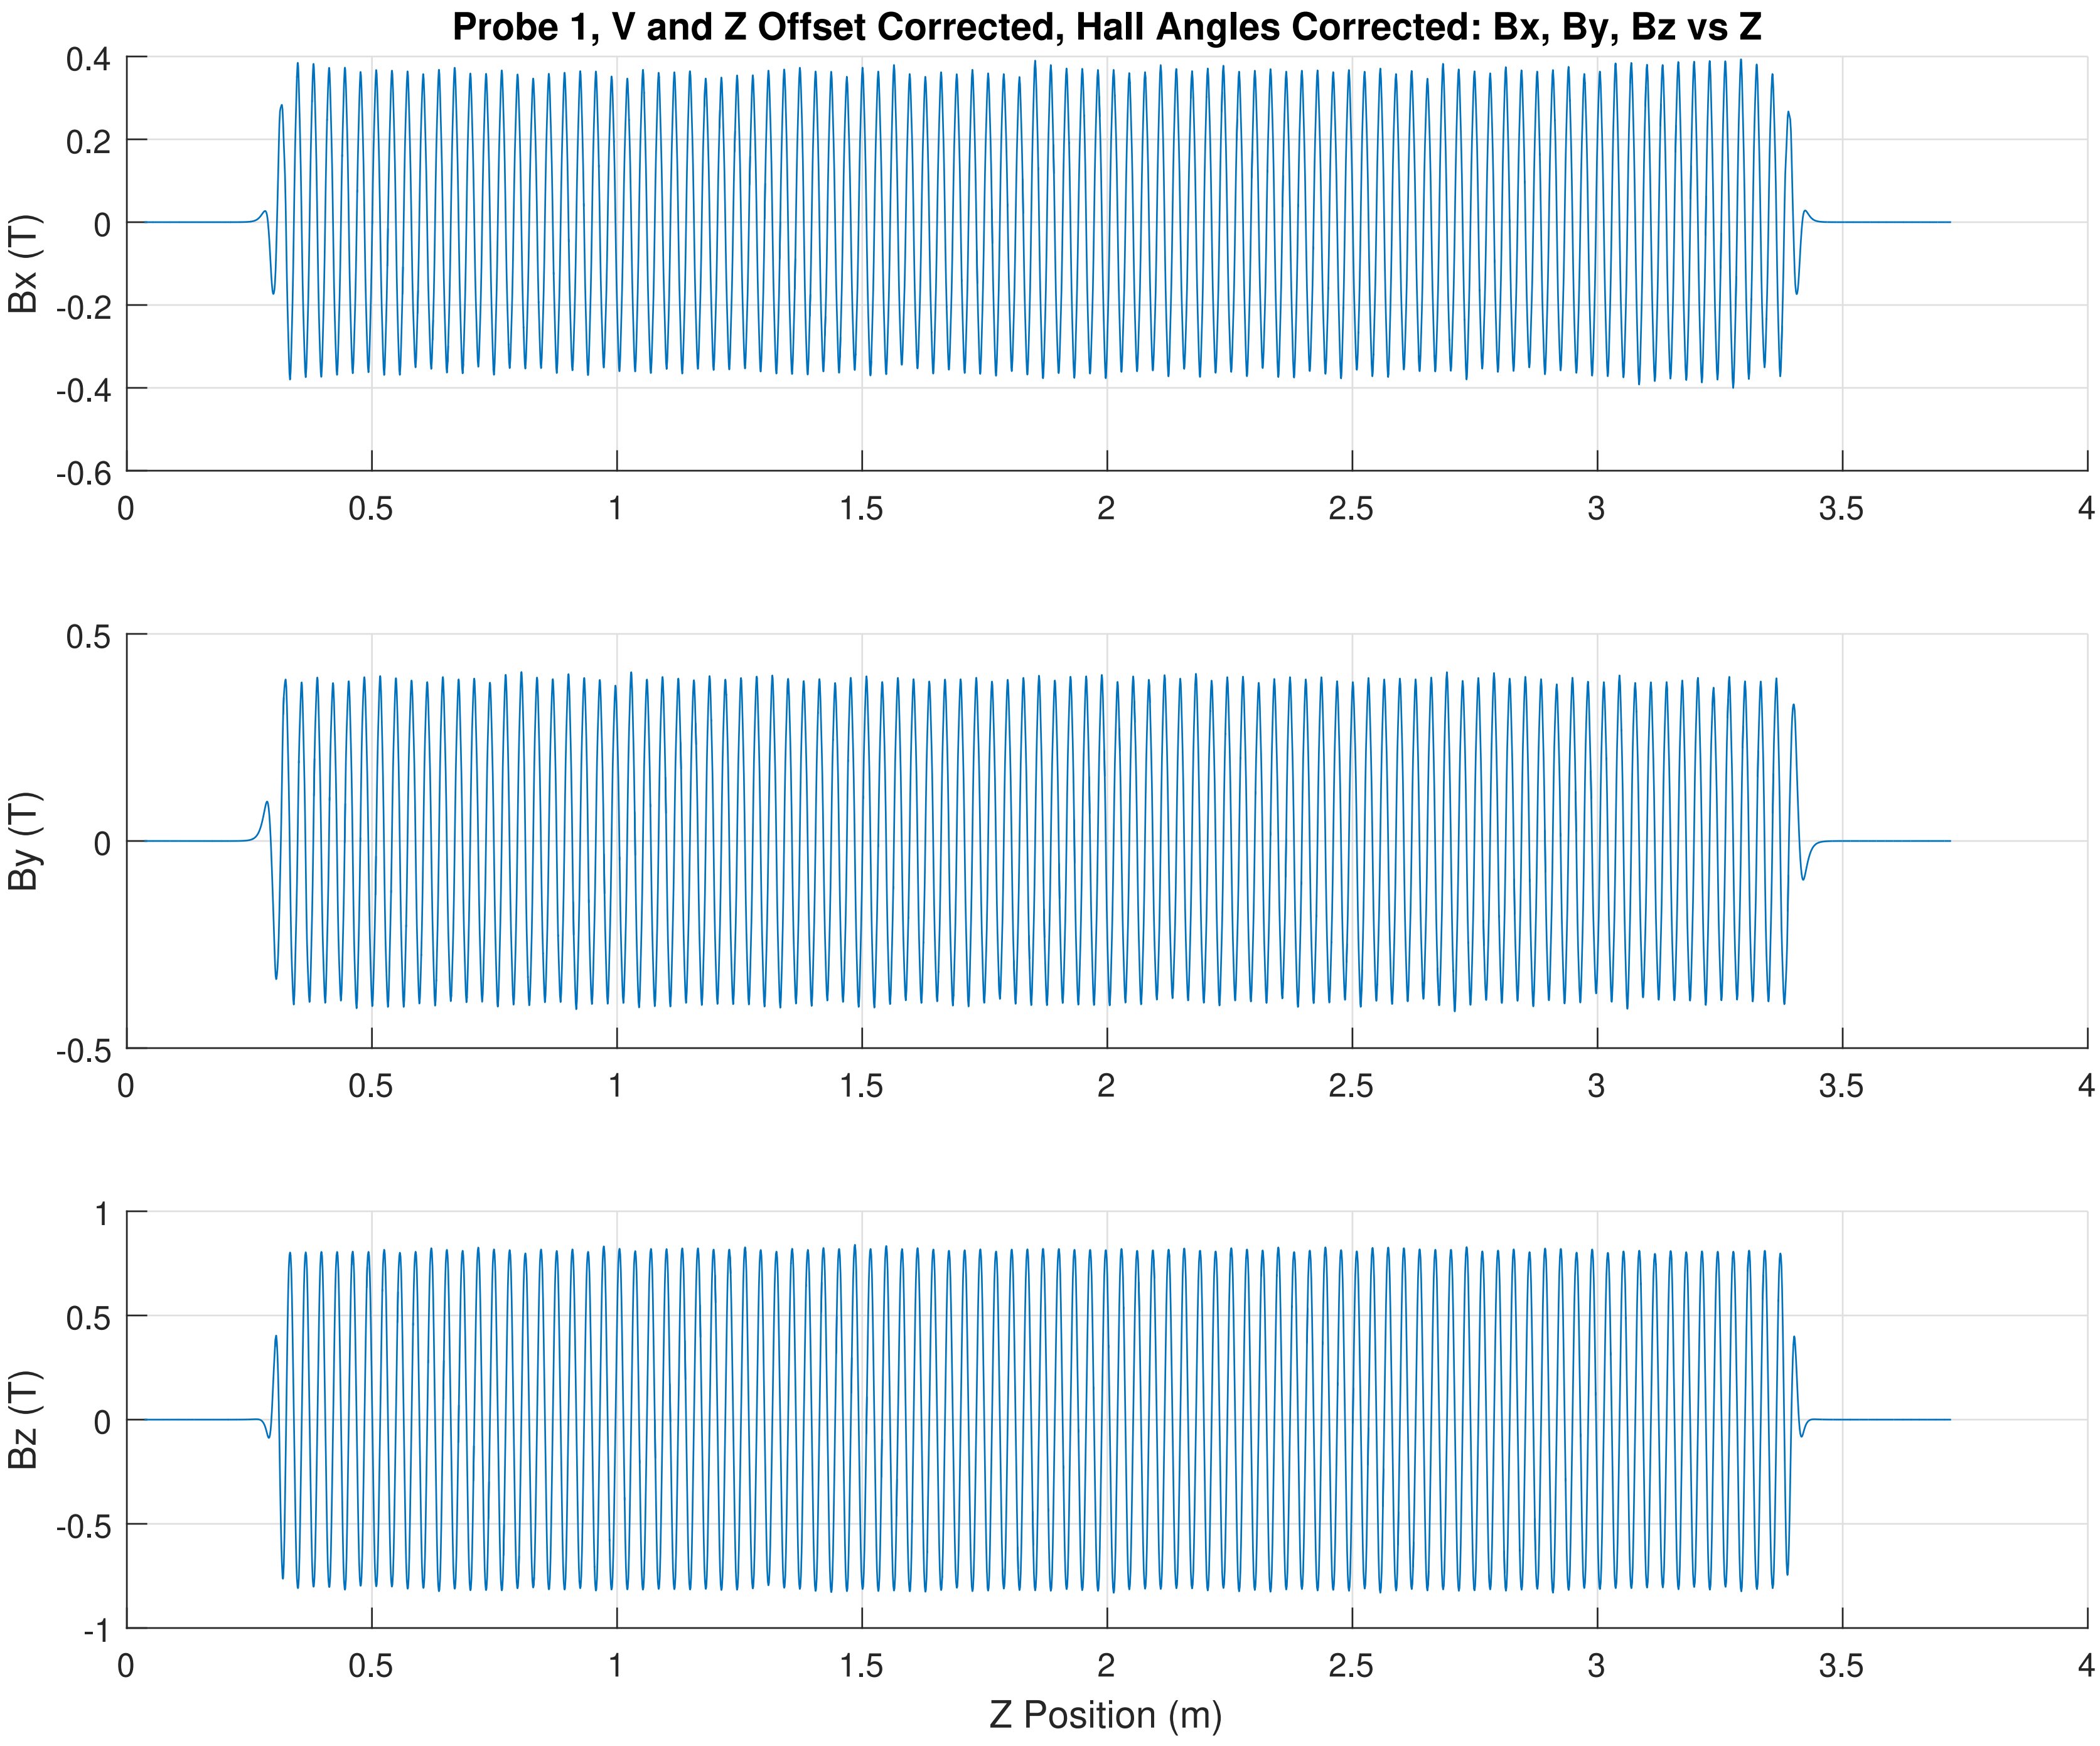
Probe 1, V and Z Offset Corrected, Hall Angles Corrected: Bx, By, Bz vs Z
Bx (T)
0.4
0.2
0
-0.2
-0.4
-0.6
By (T)
0.5
0
-0.5
Bz (T)
1
0.5
0
-0.5
-1
0
0.5
1
1.5
2
2.5
3
3.5
4
Z Position (m)

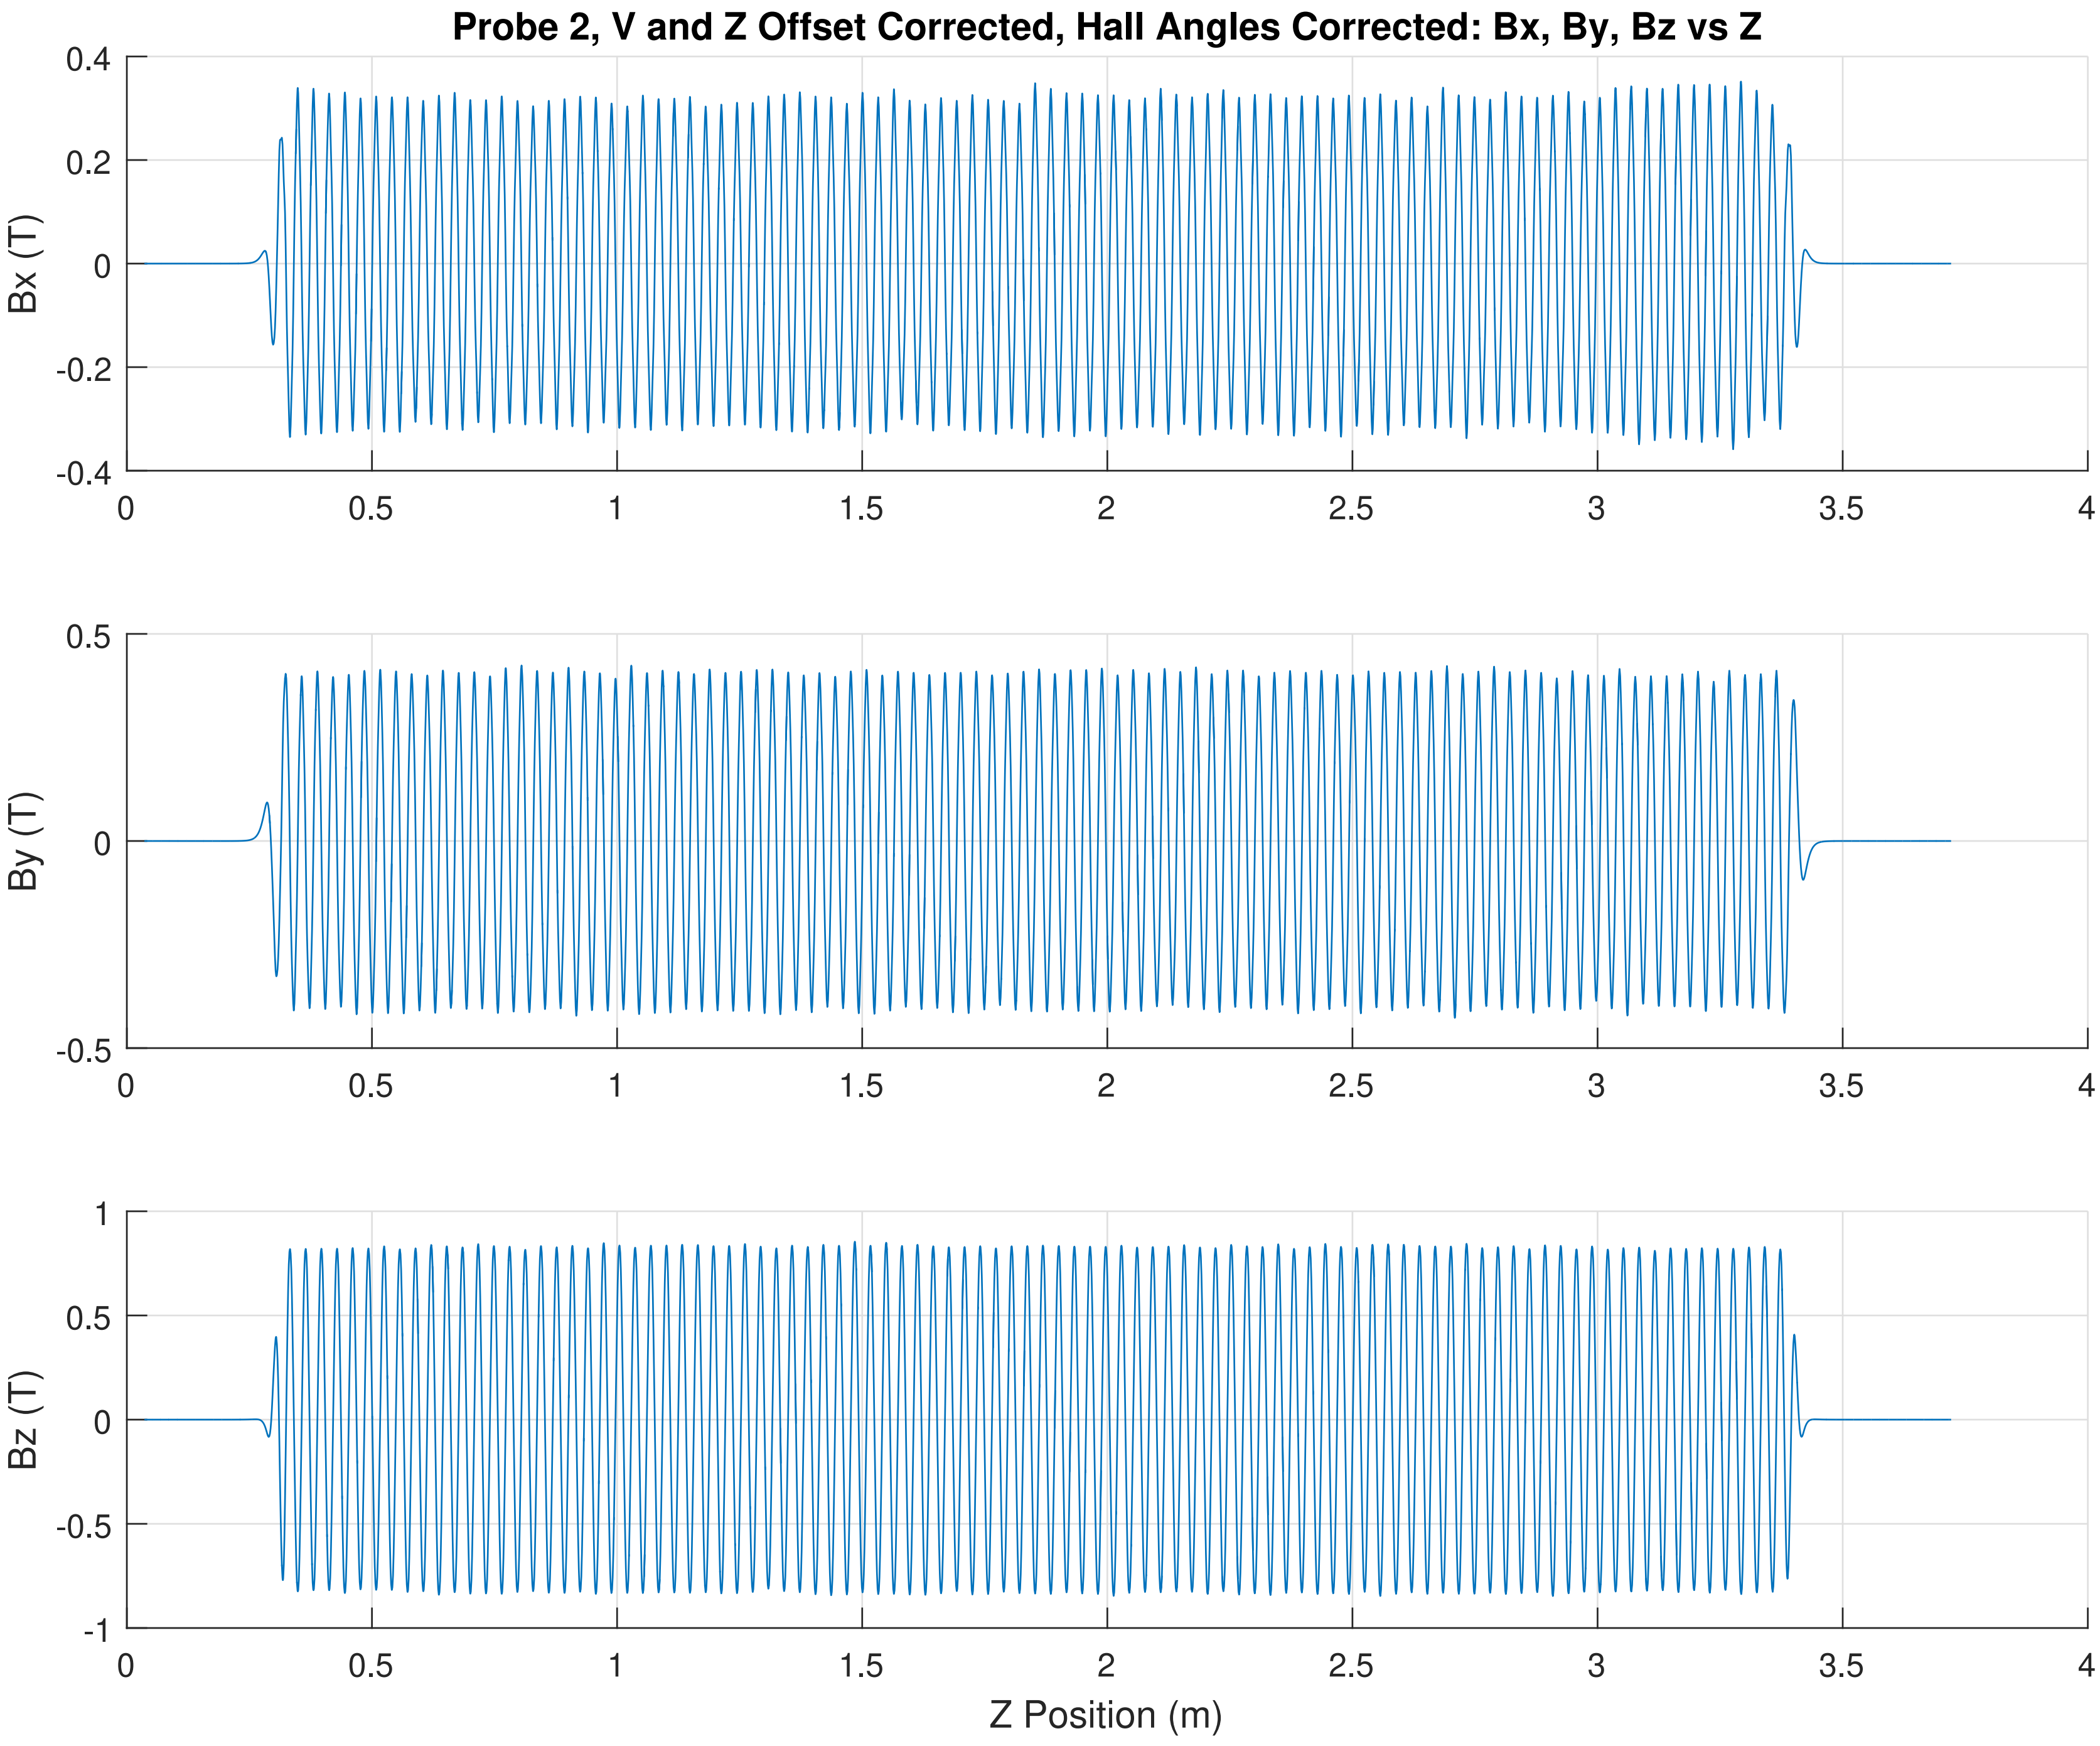
Probe 2, V and Z Offset Corrected, Hall Angles Corrected: Bx, By, Bz vs Z
Bx (T)
0.4
0.2
0
-0.2
-0.4
0
0.5
1
1.5
2
2.5
3
3.5
4
By (T)
0.5
0
-0.5
0
0.5
1
1.5
2
2.5
3
3.5
4
Bz (T)
1
0.5
0
-0.5
-1
0
0.5
1
1.5
2
2.5
3
3.5
4
Z Position (m)

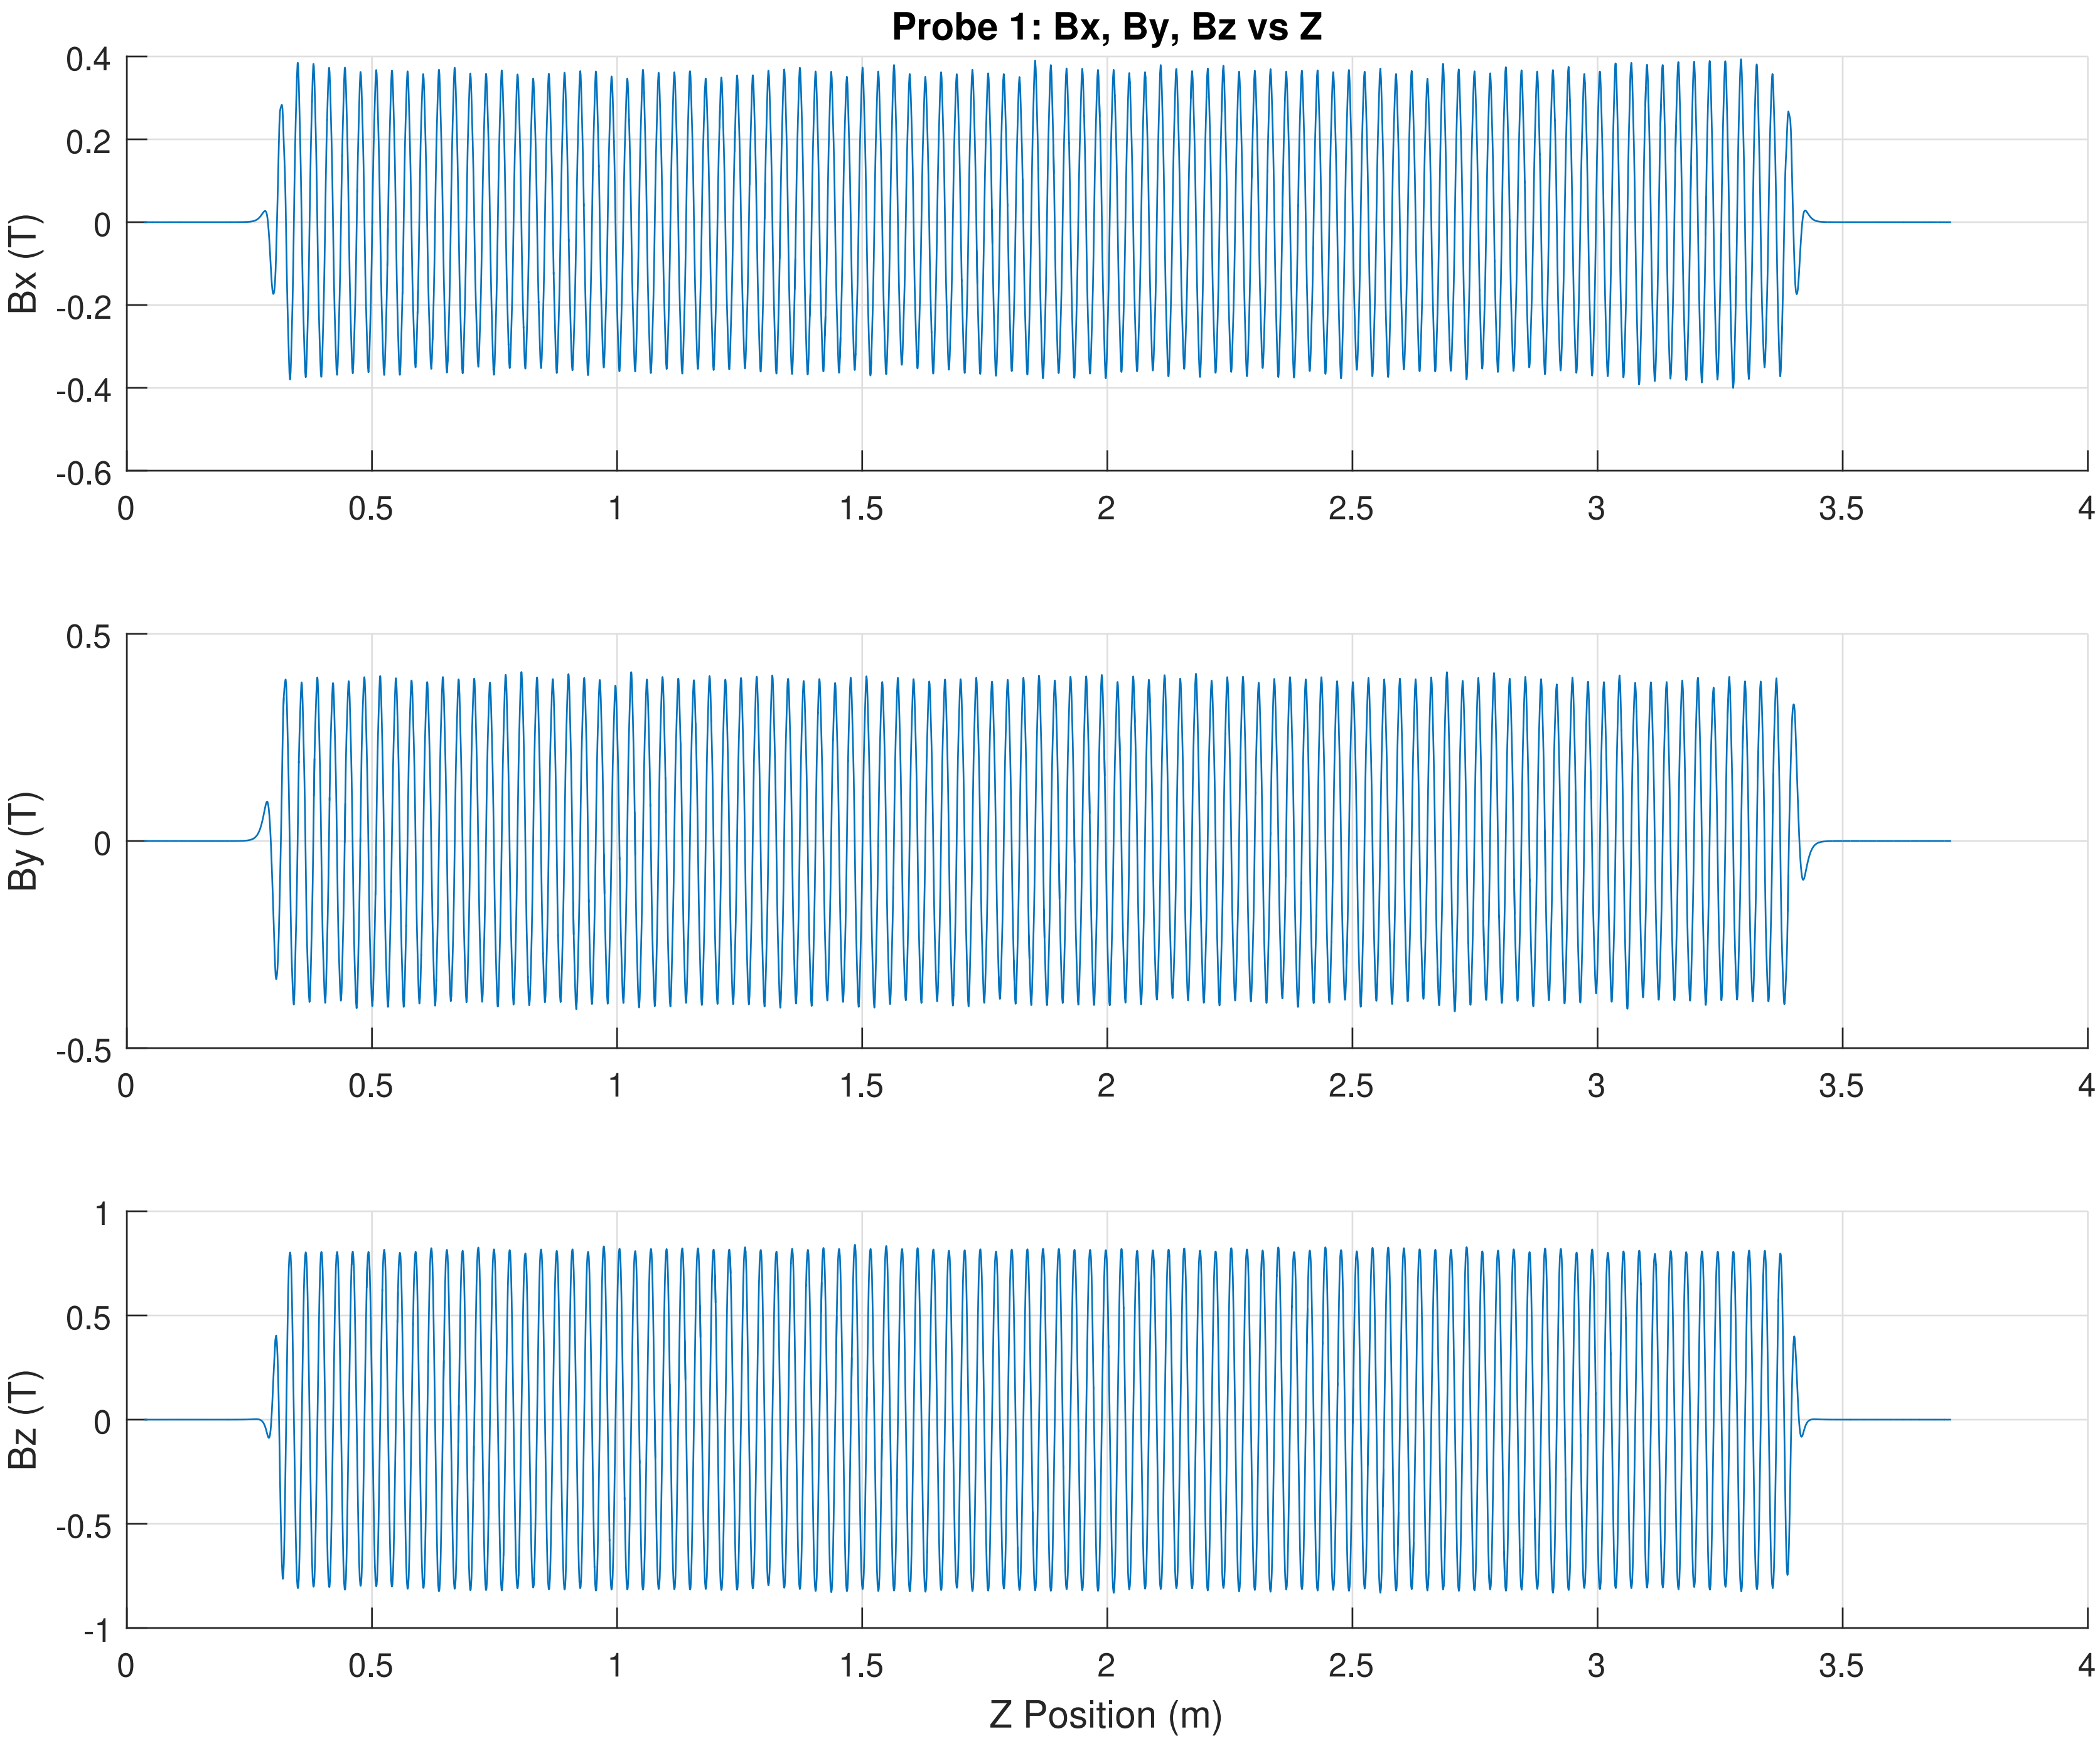
Probe 1: Bx, By, Bz vs Z
Bx (T)
0.4
0.2
0
-0.2
-0.4
-0.6
0
0.5
1
1.5
2
2.5
3
3.5
4
By (T)
0.5
0
-0.5
0
0.5
1
1.5
2
2.5
3
3.5
4
Bz (T)
1
0.5
0
-0.5
-1
0
0.5
1
1.5
2
2.5
3
3.5
4
Z Position (m)

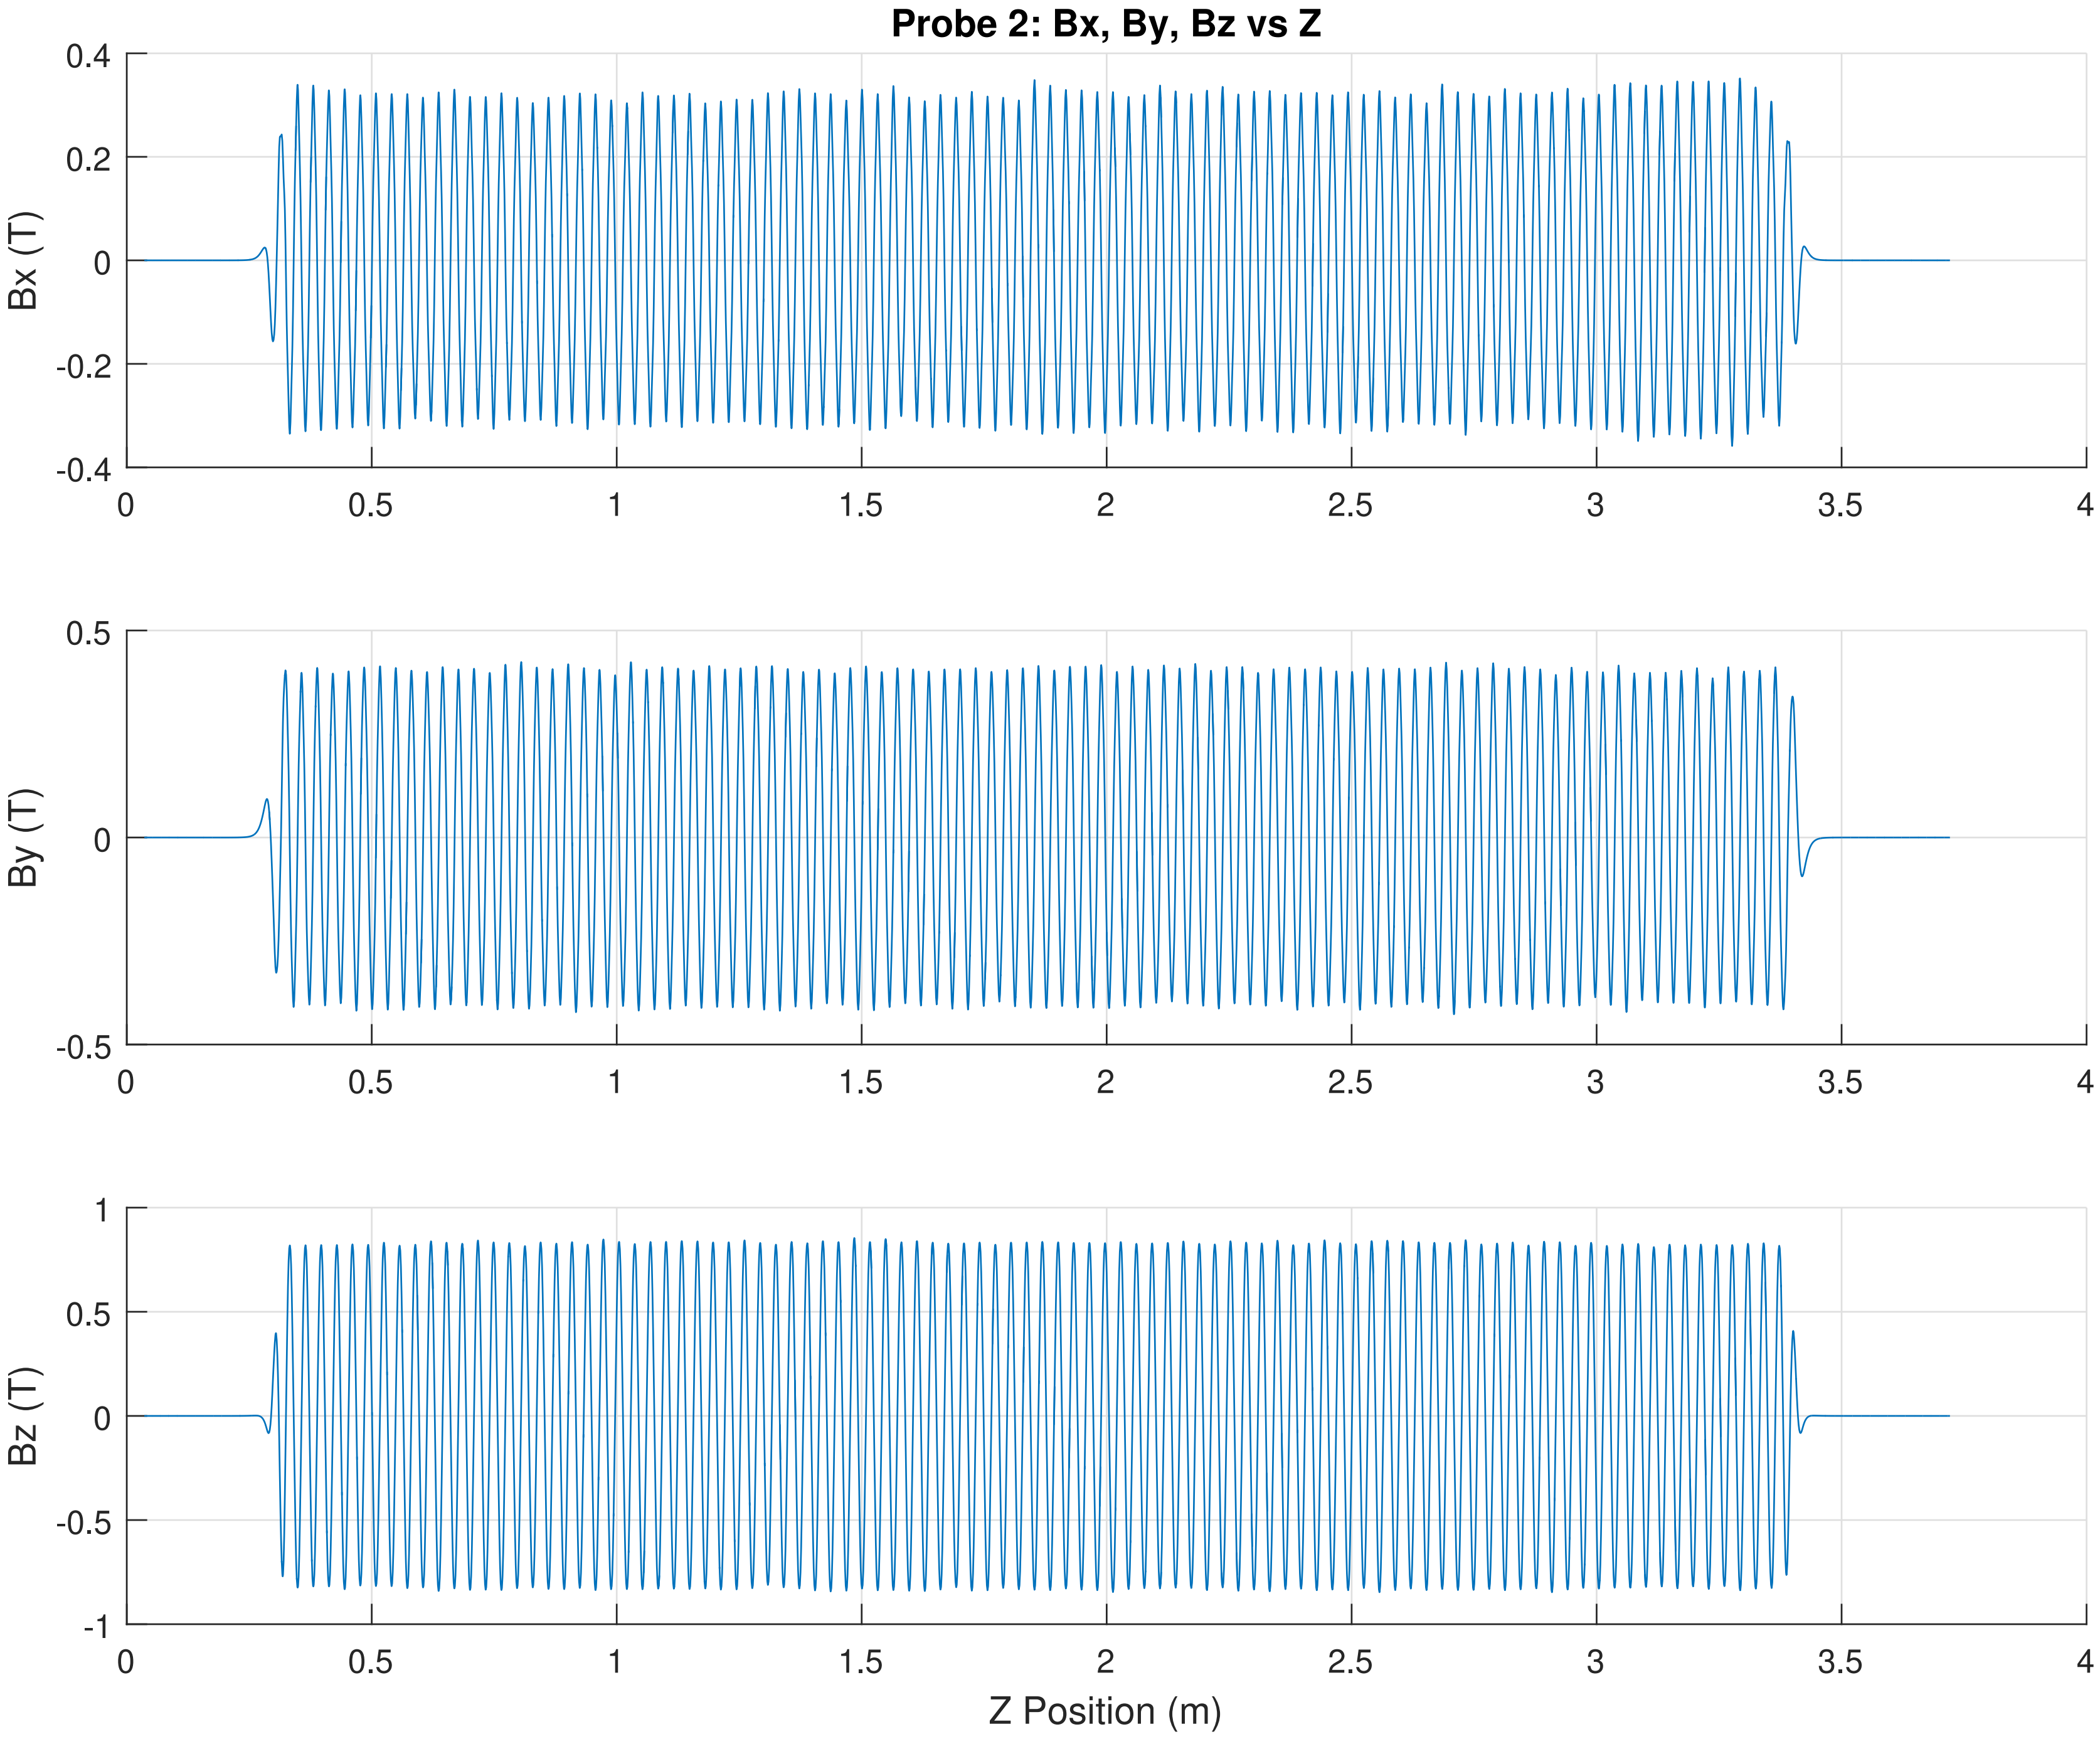
Probe 2: Bx, By, Bz vs Z
Bx (T)
0.4
0.2
0
-0.2
-0.4
0
0.5
1
1.5
2
2.5
3
3.5
4
By (T)
0.5
0
-0.5
0
0.5
1
1.5
2
2.5
3
3.5
4
Bz (T)
1
0.5
0
-0.5
-1
0
0.5
1
1.5
2
2.5
3
3.5
4
Z Position (m)

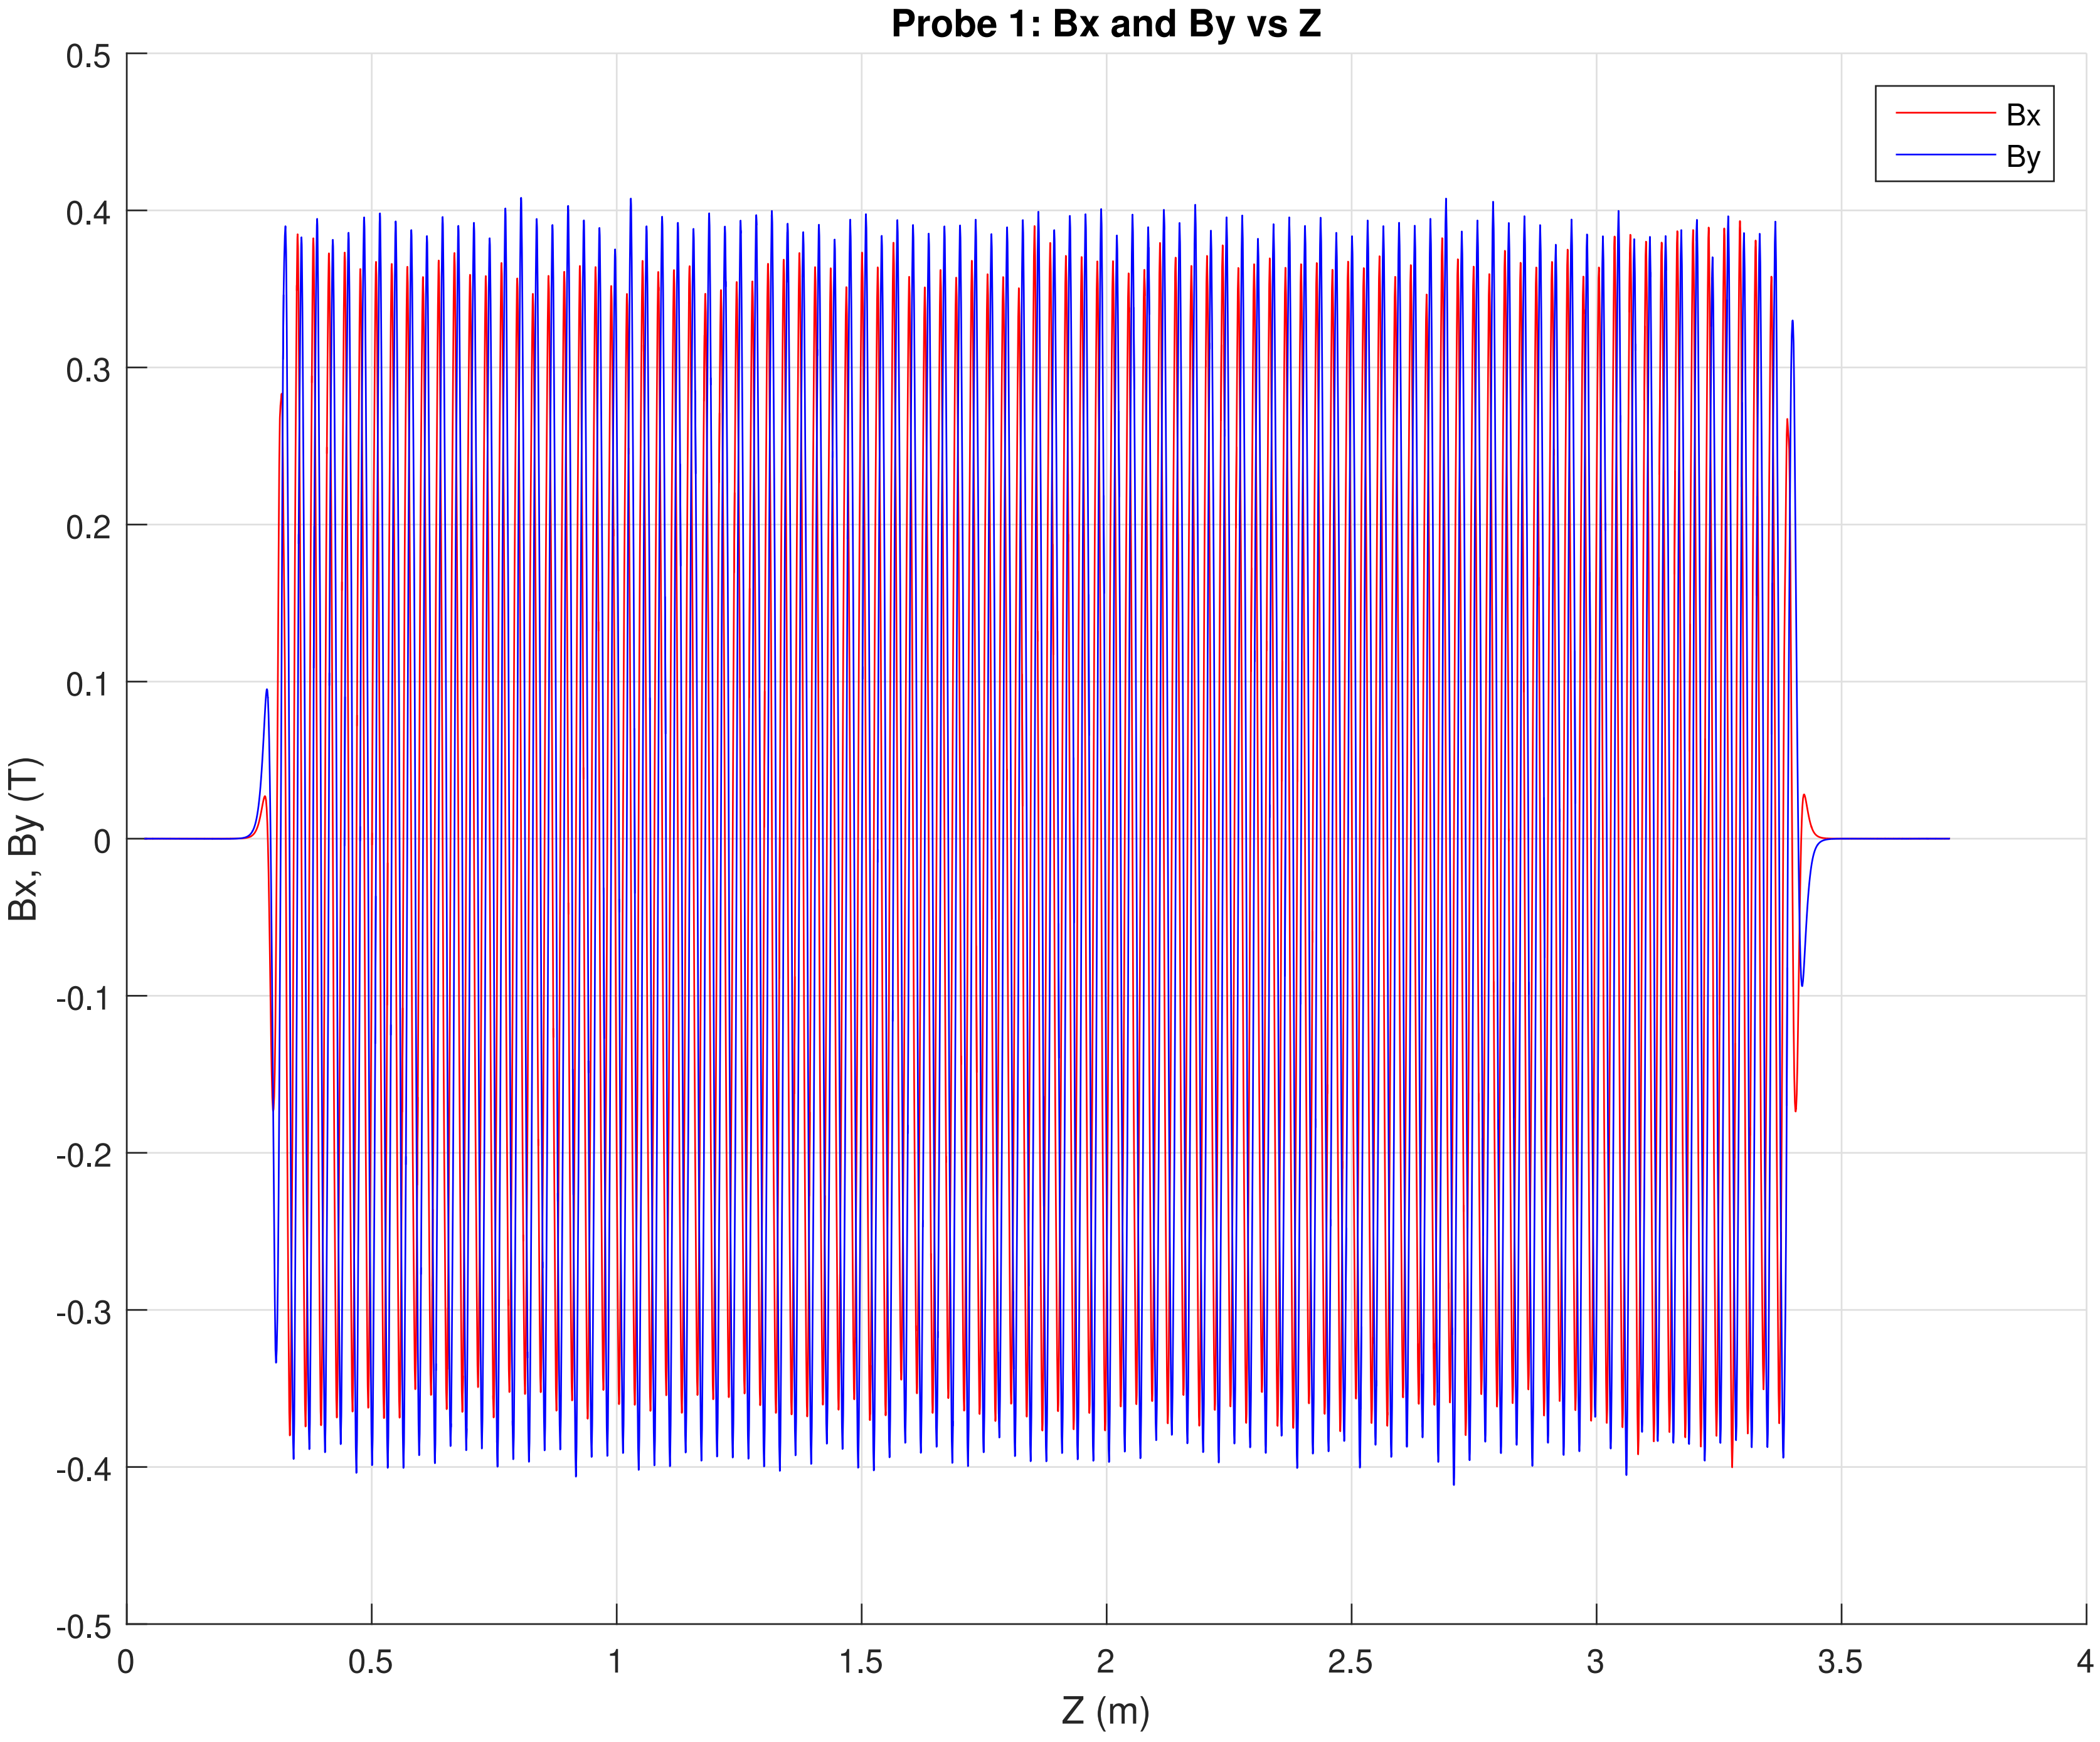
Probe 1: Bx and By vs Z
Bx
By
Bx, By (T)
Z (m)
0.5
0.4
0.3
0.2
0.1
0
-0.1
-0.2
-0.3
-0.4
-0.5
0
0.5
1
1.5
2
2.5
3
3.5
4

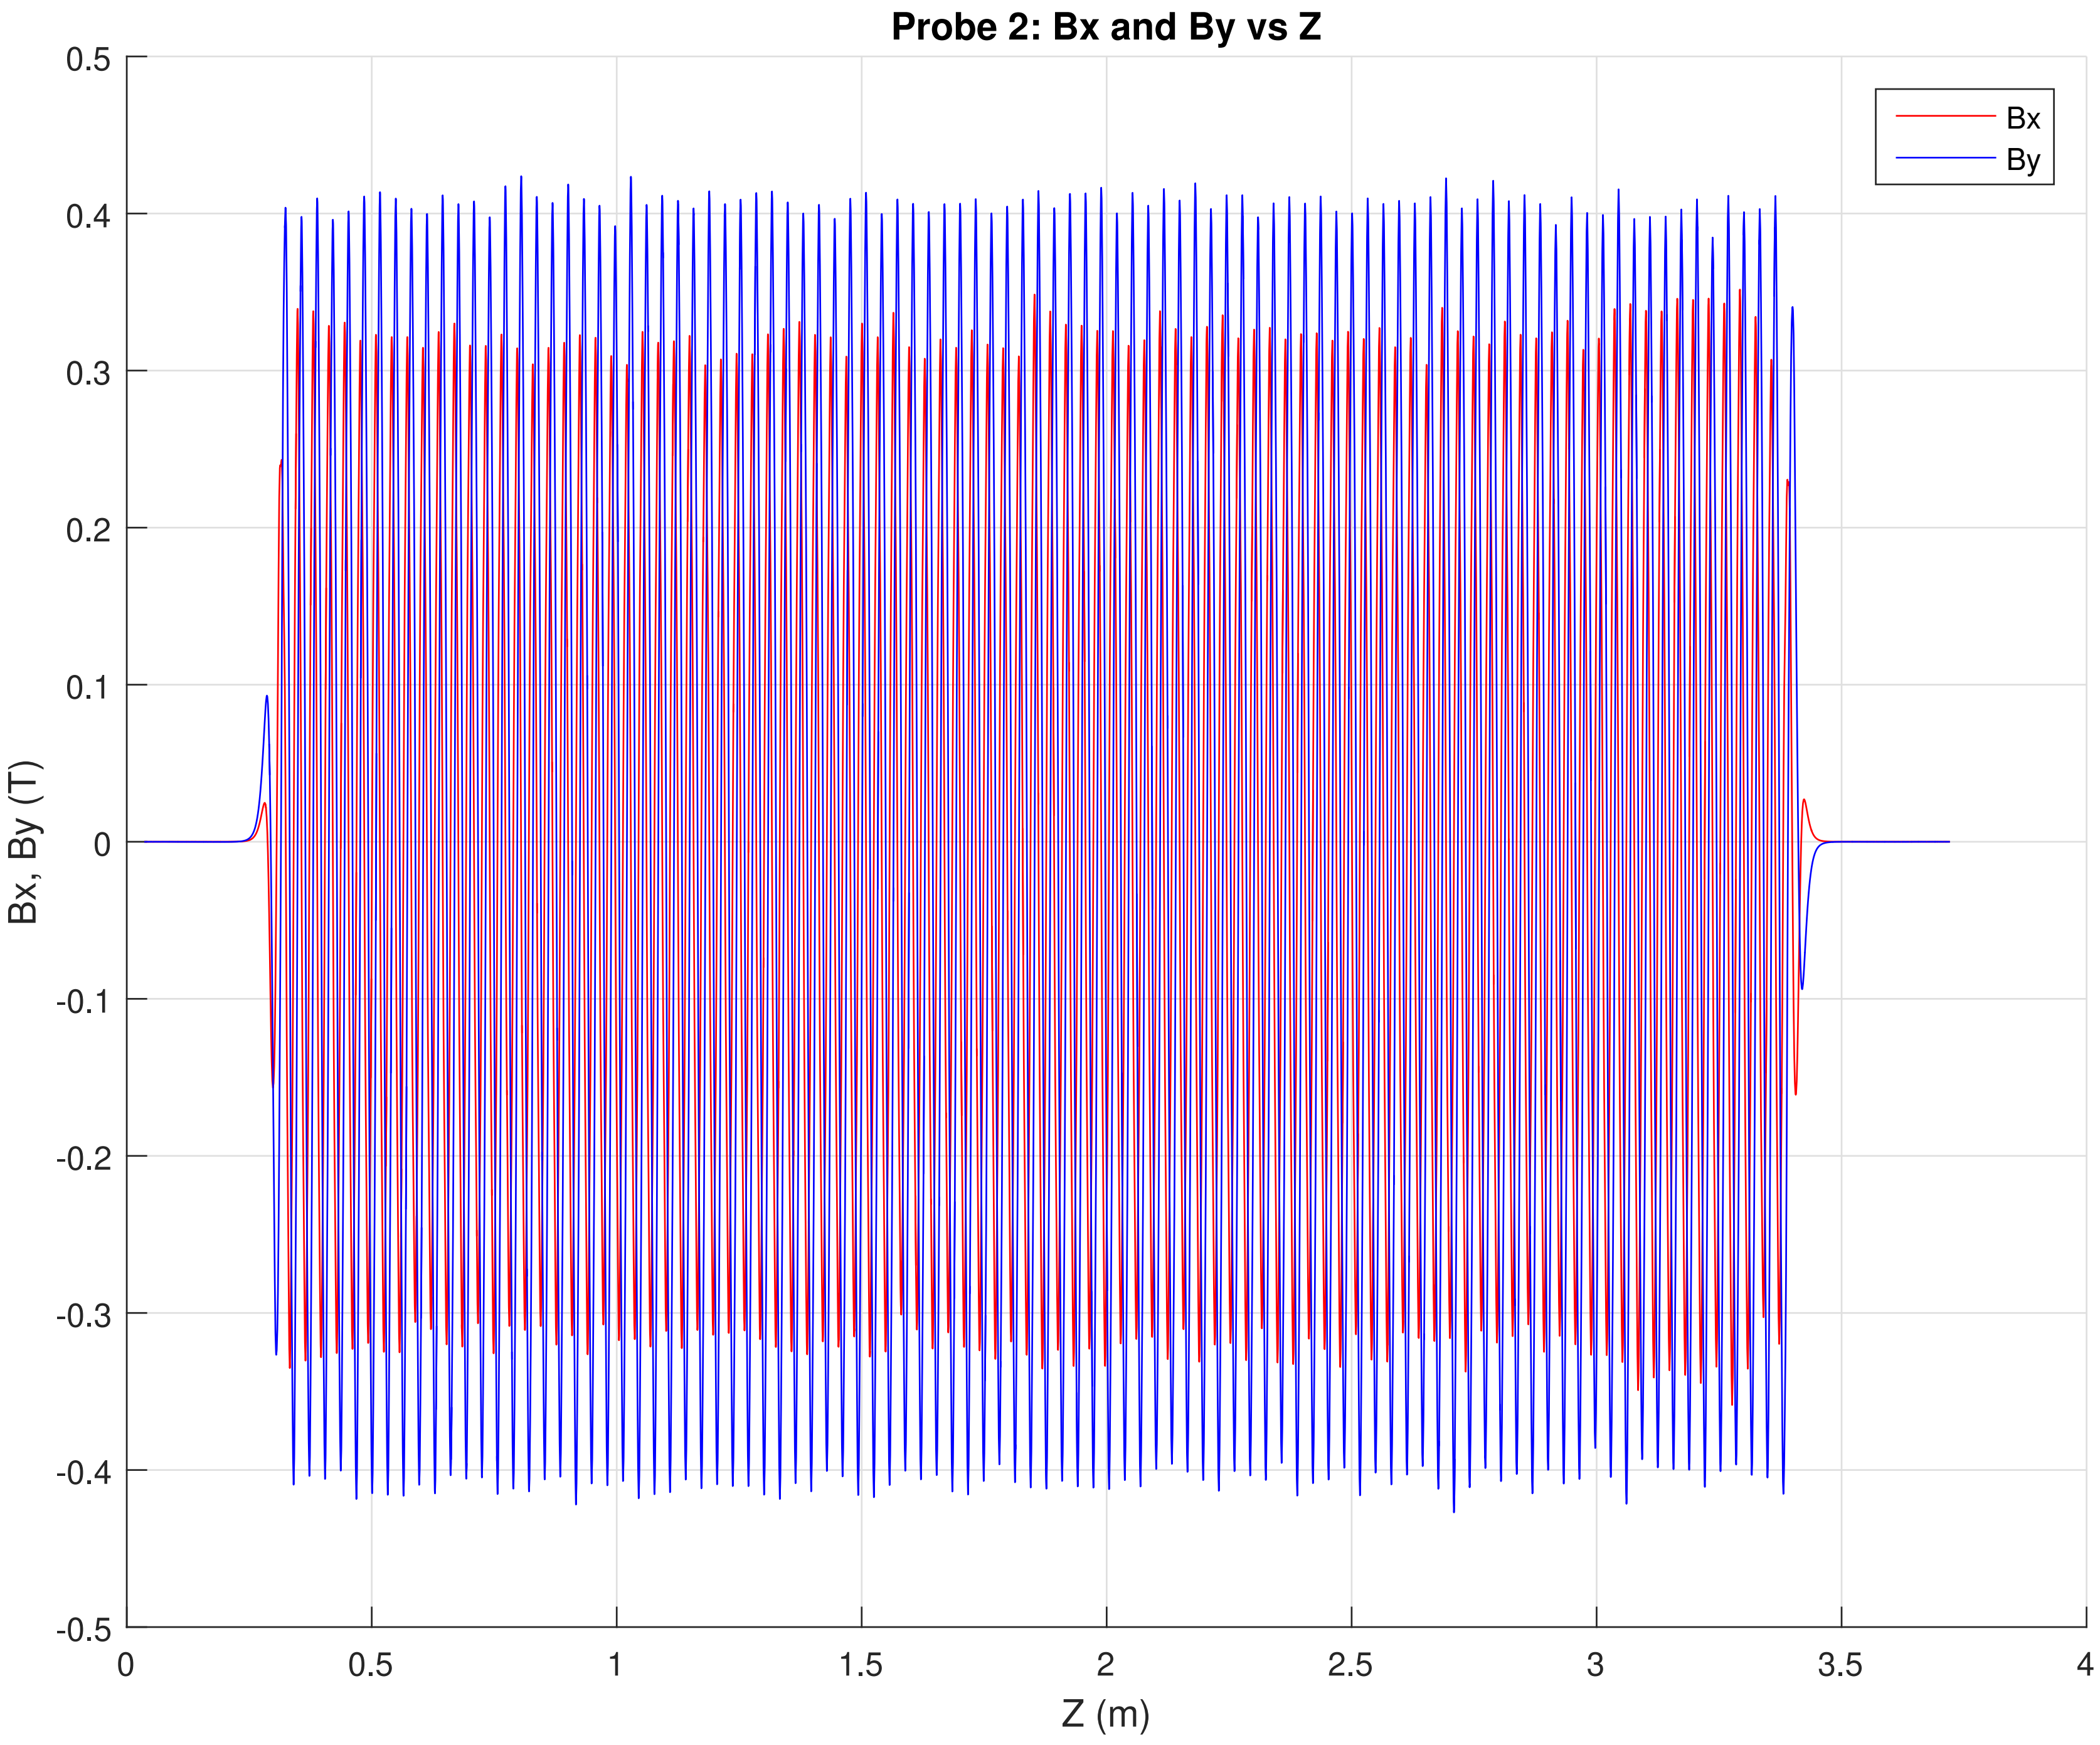
Probe 2: Bx and By vs Z
Bx
By
Bx, By (T)
Z (m)
0.5
0.4
0.3
0.2
0.1
0
-0.1
-0.2
-0.3
-0.4
-0.5
0
0.5
1
1.5
2
2.5
3
3.5
4

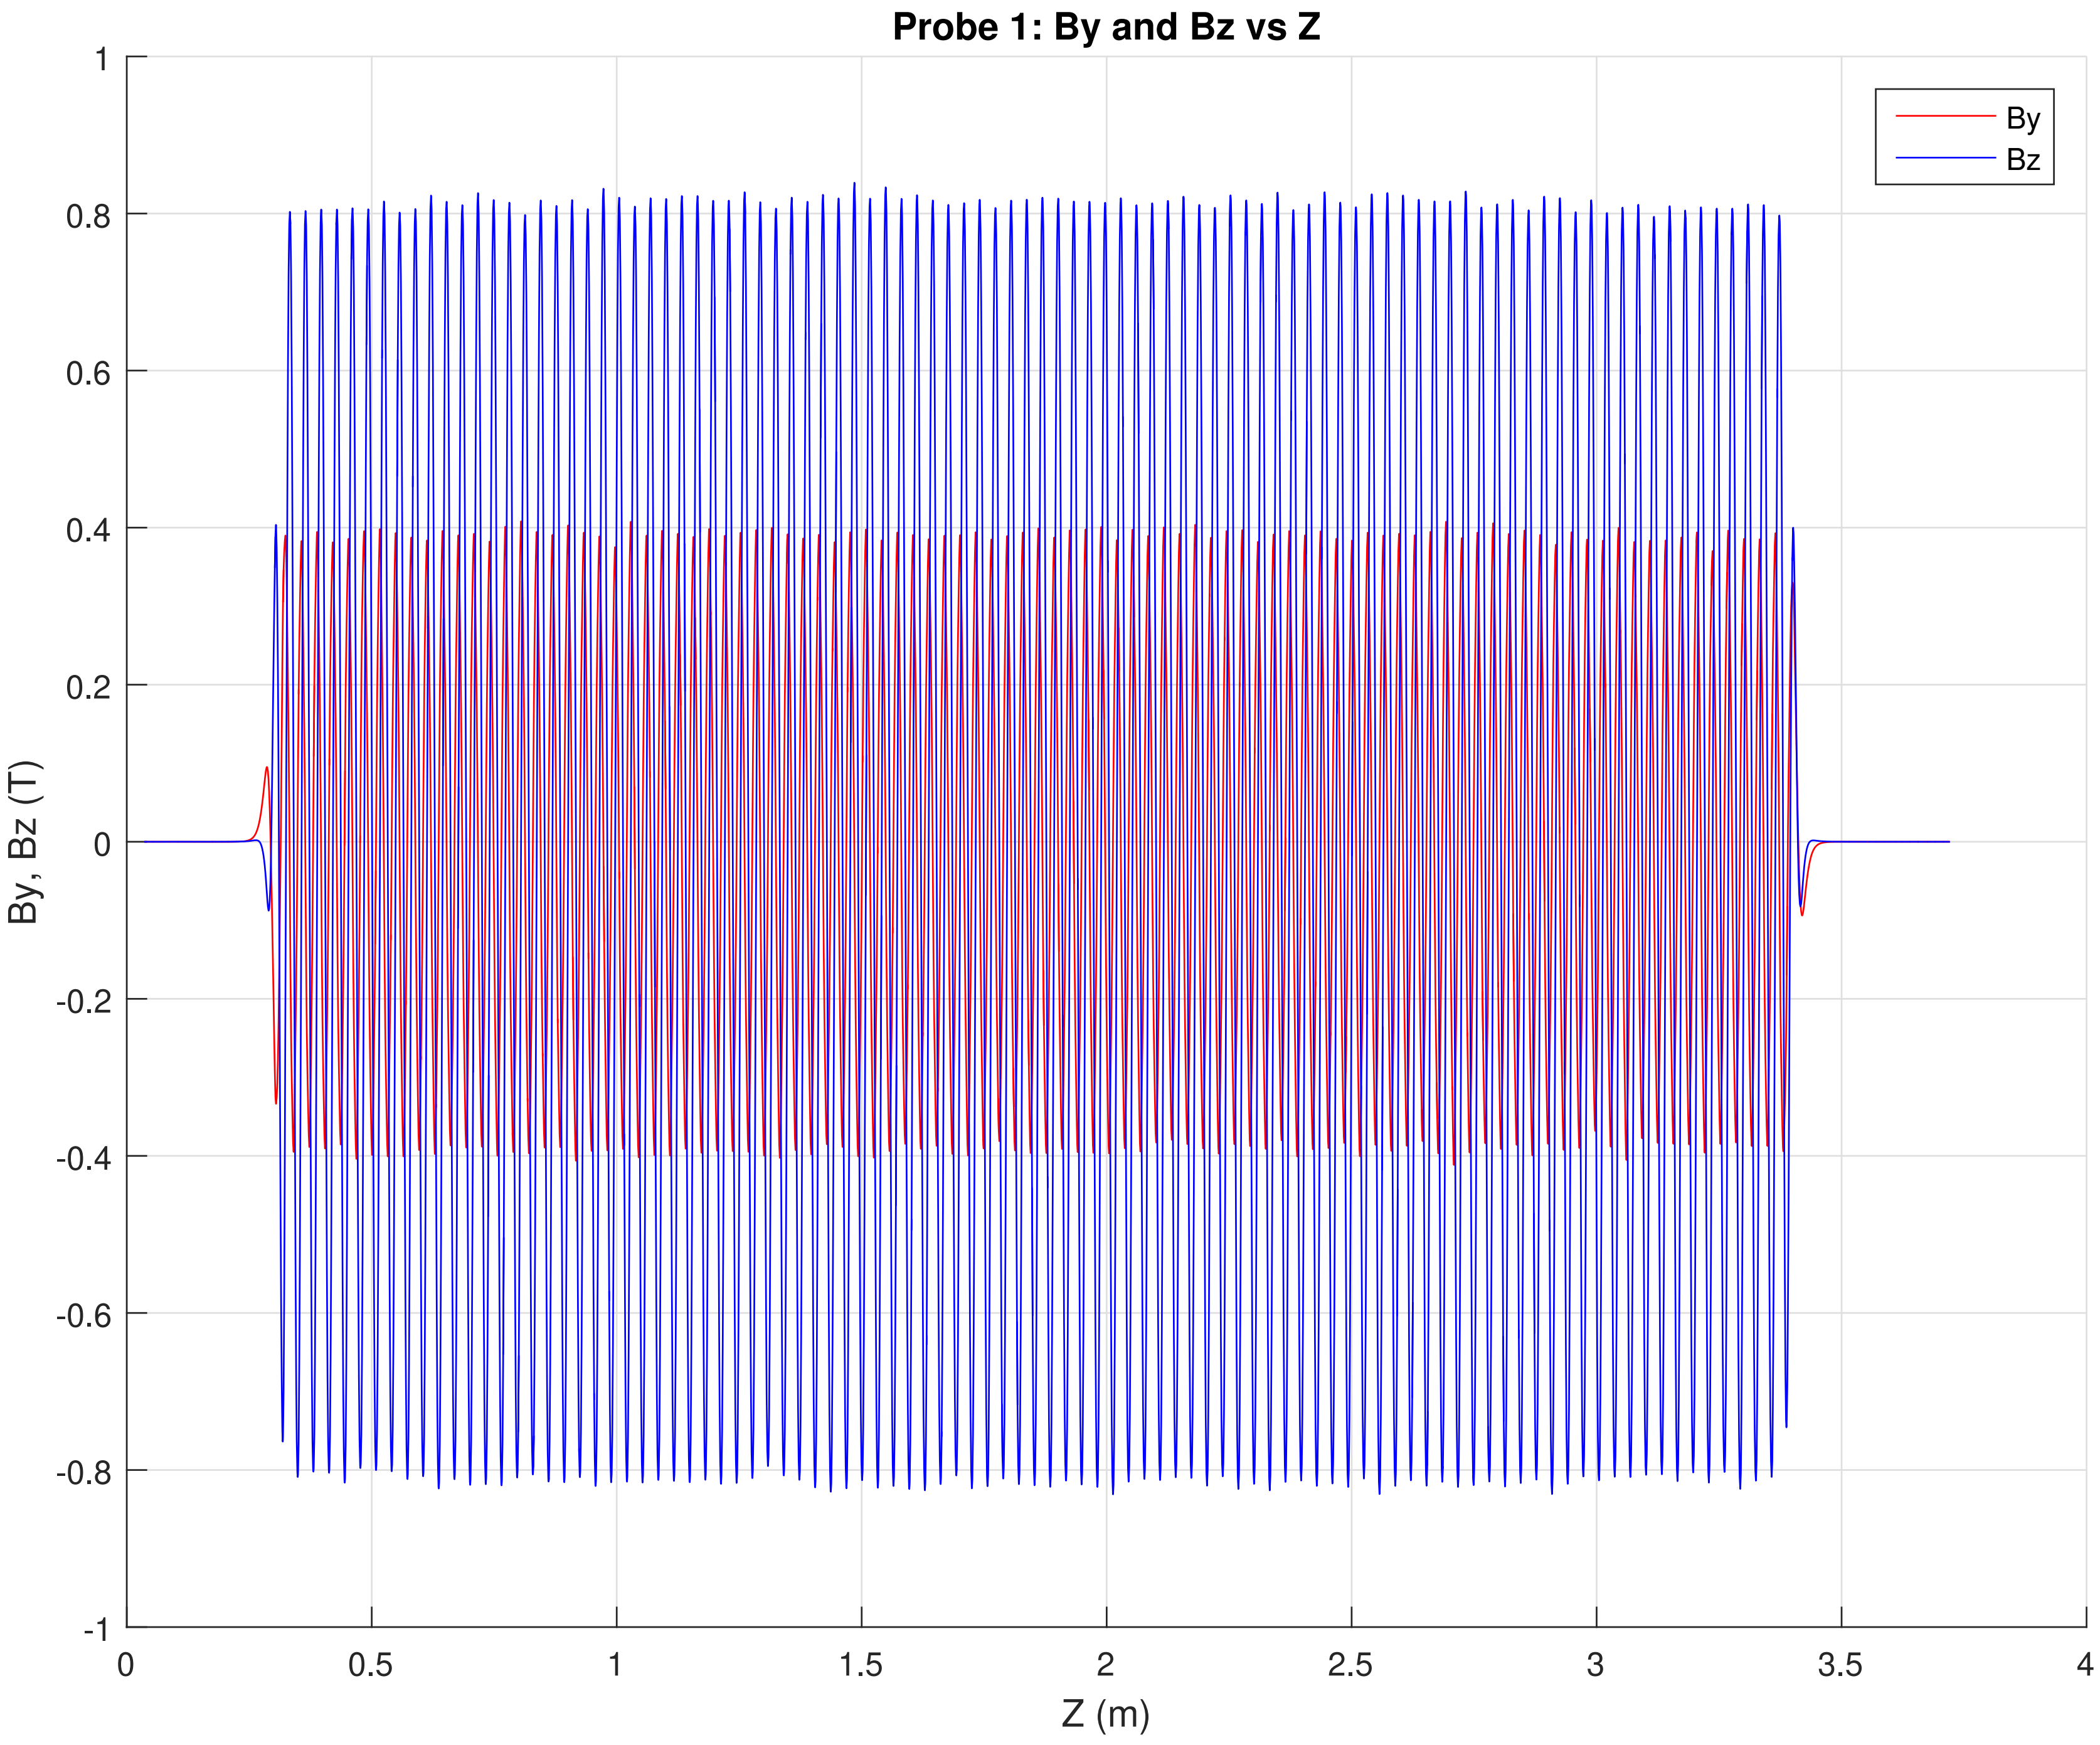
Probe 1: By and Bz vs Z
By
Bz
By, Bz (T)
Z (m)
1
0.8
0.6
0.4
0.2
0
-0.2
-0.4
-0.6
-0.8
-1
0
0.5
1
1.5
2
2.5
3
3.5
4

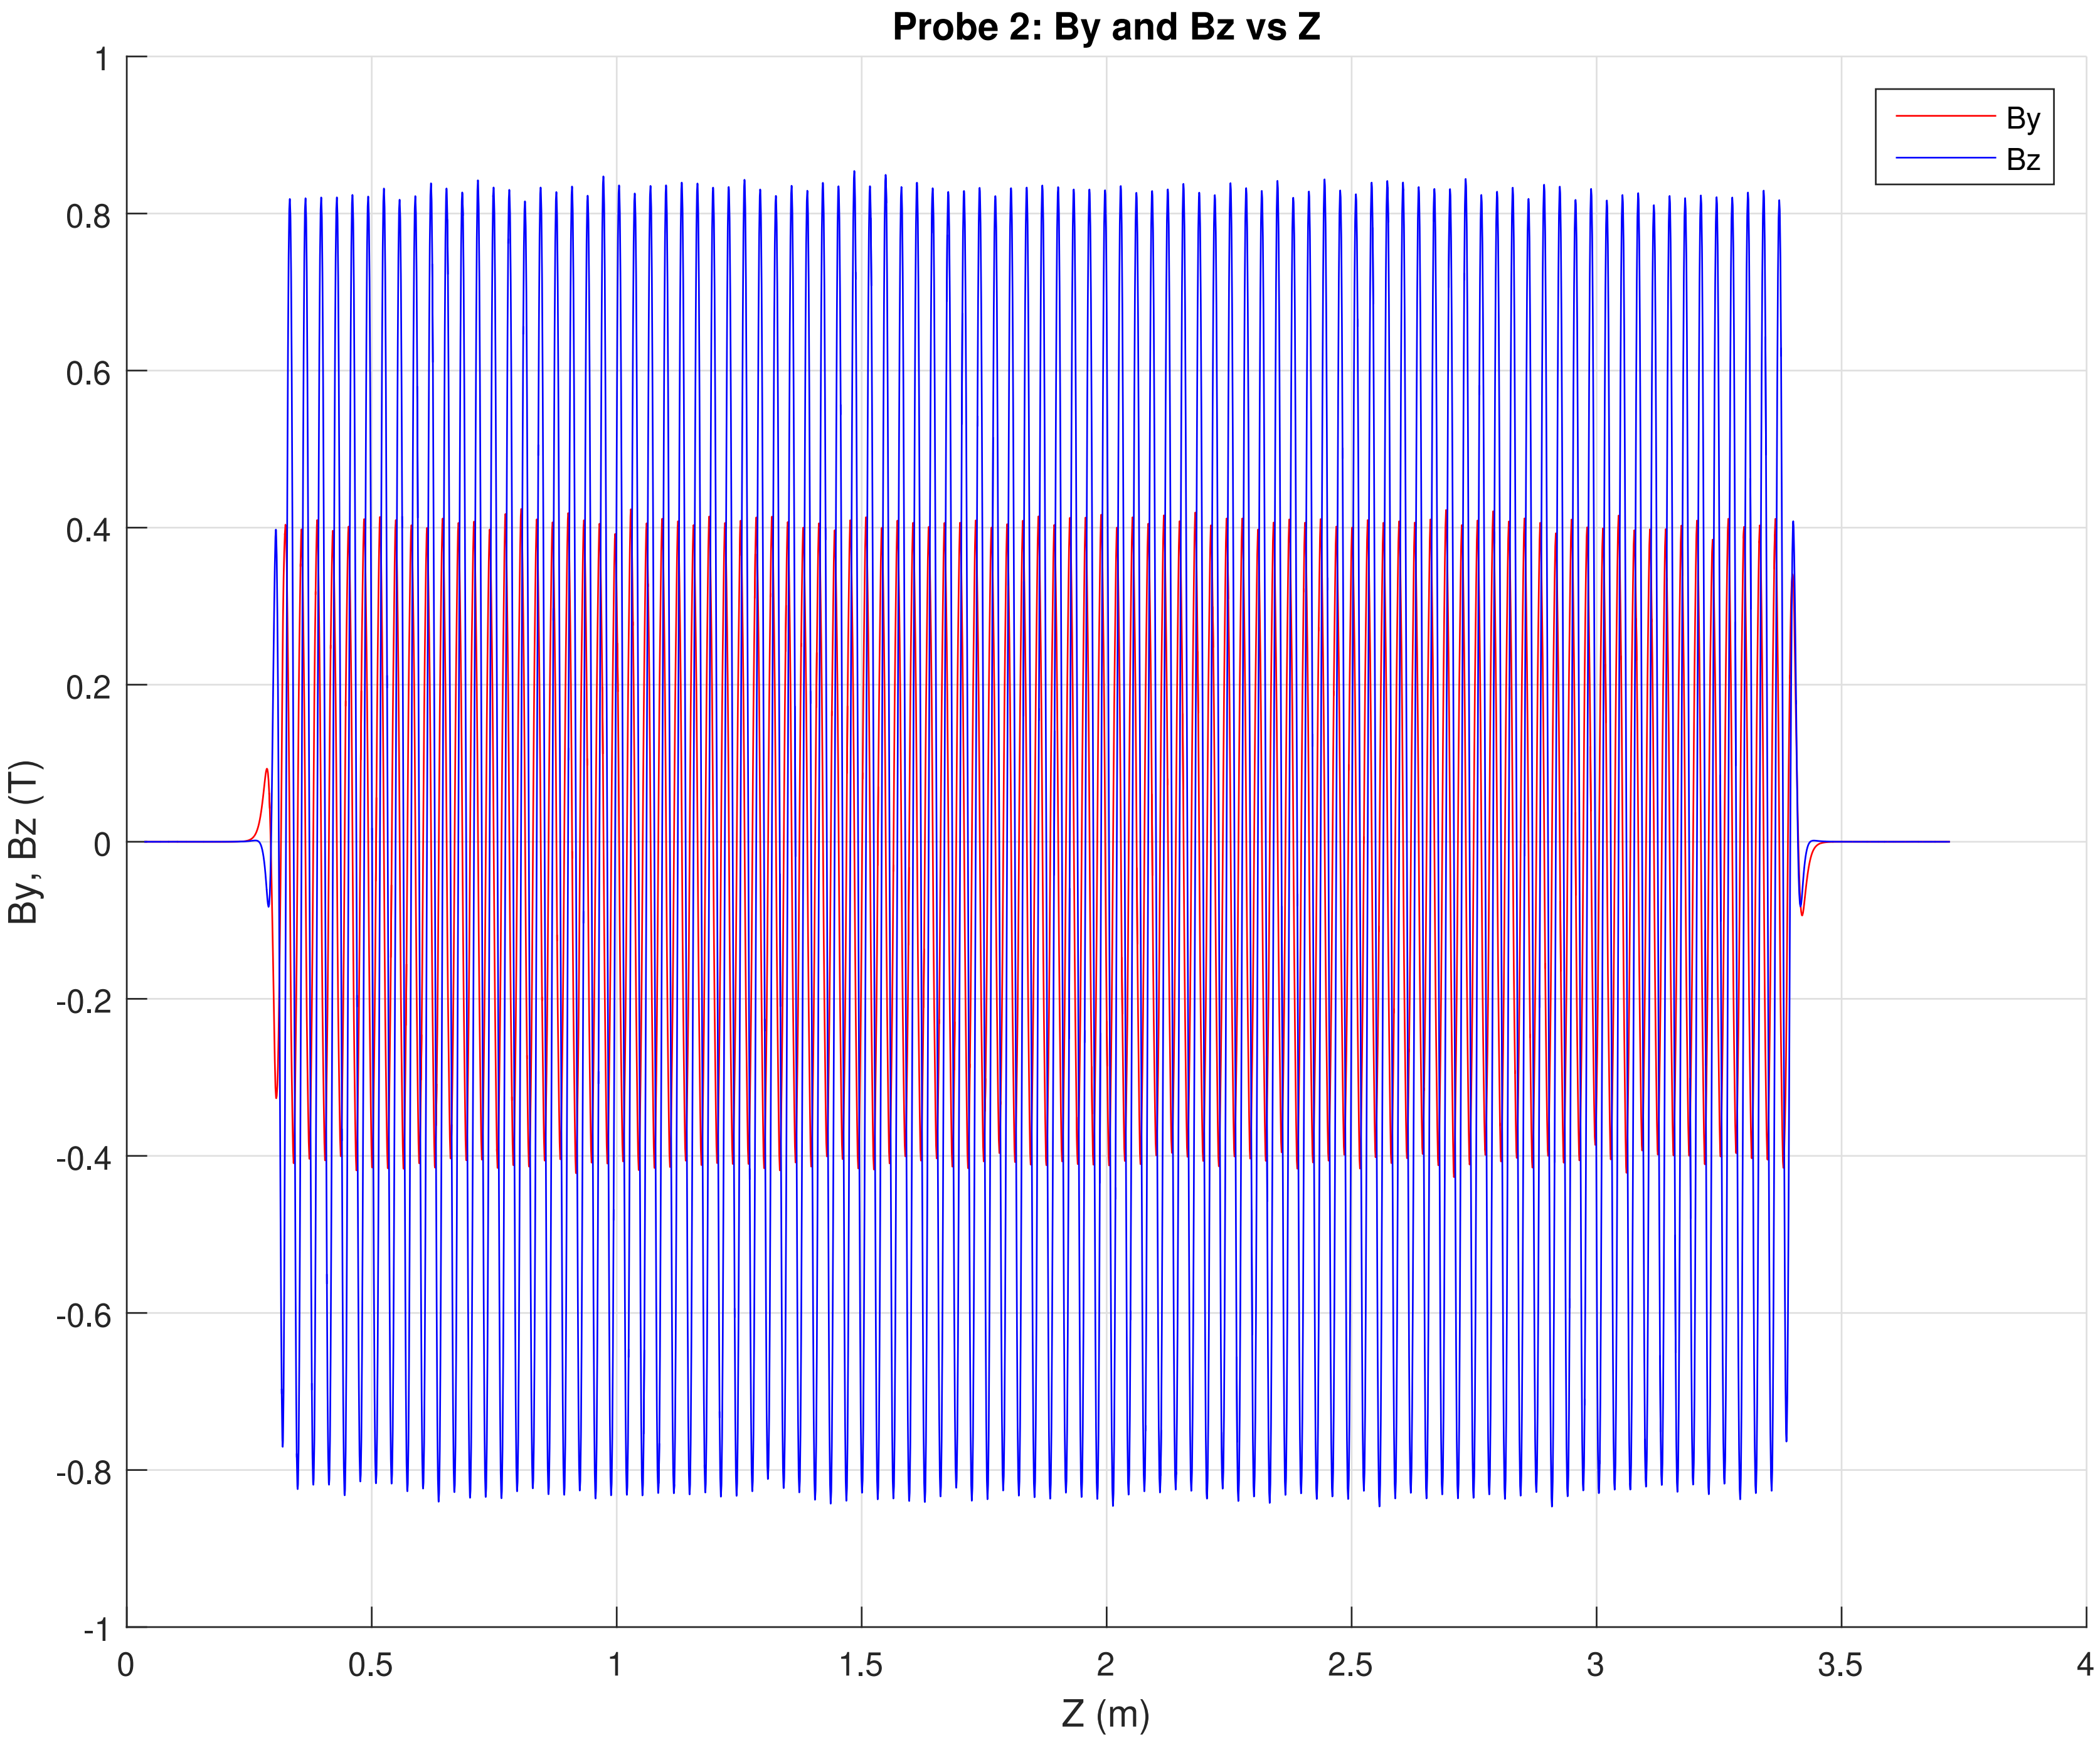
Probe 2: By and Bz vs Z
By
Bz
By, Bz (T)
1
0.8
0.6
0.4
0.2
0
-0.2
-0.4
-0.6
-0.8
-1
0
0.5
1
1.5
2
2.5
3
3.5
4
Z (m)

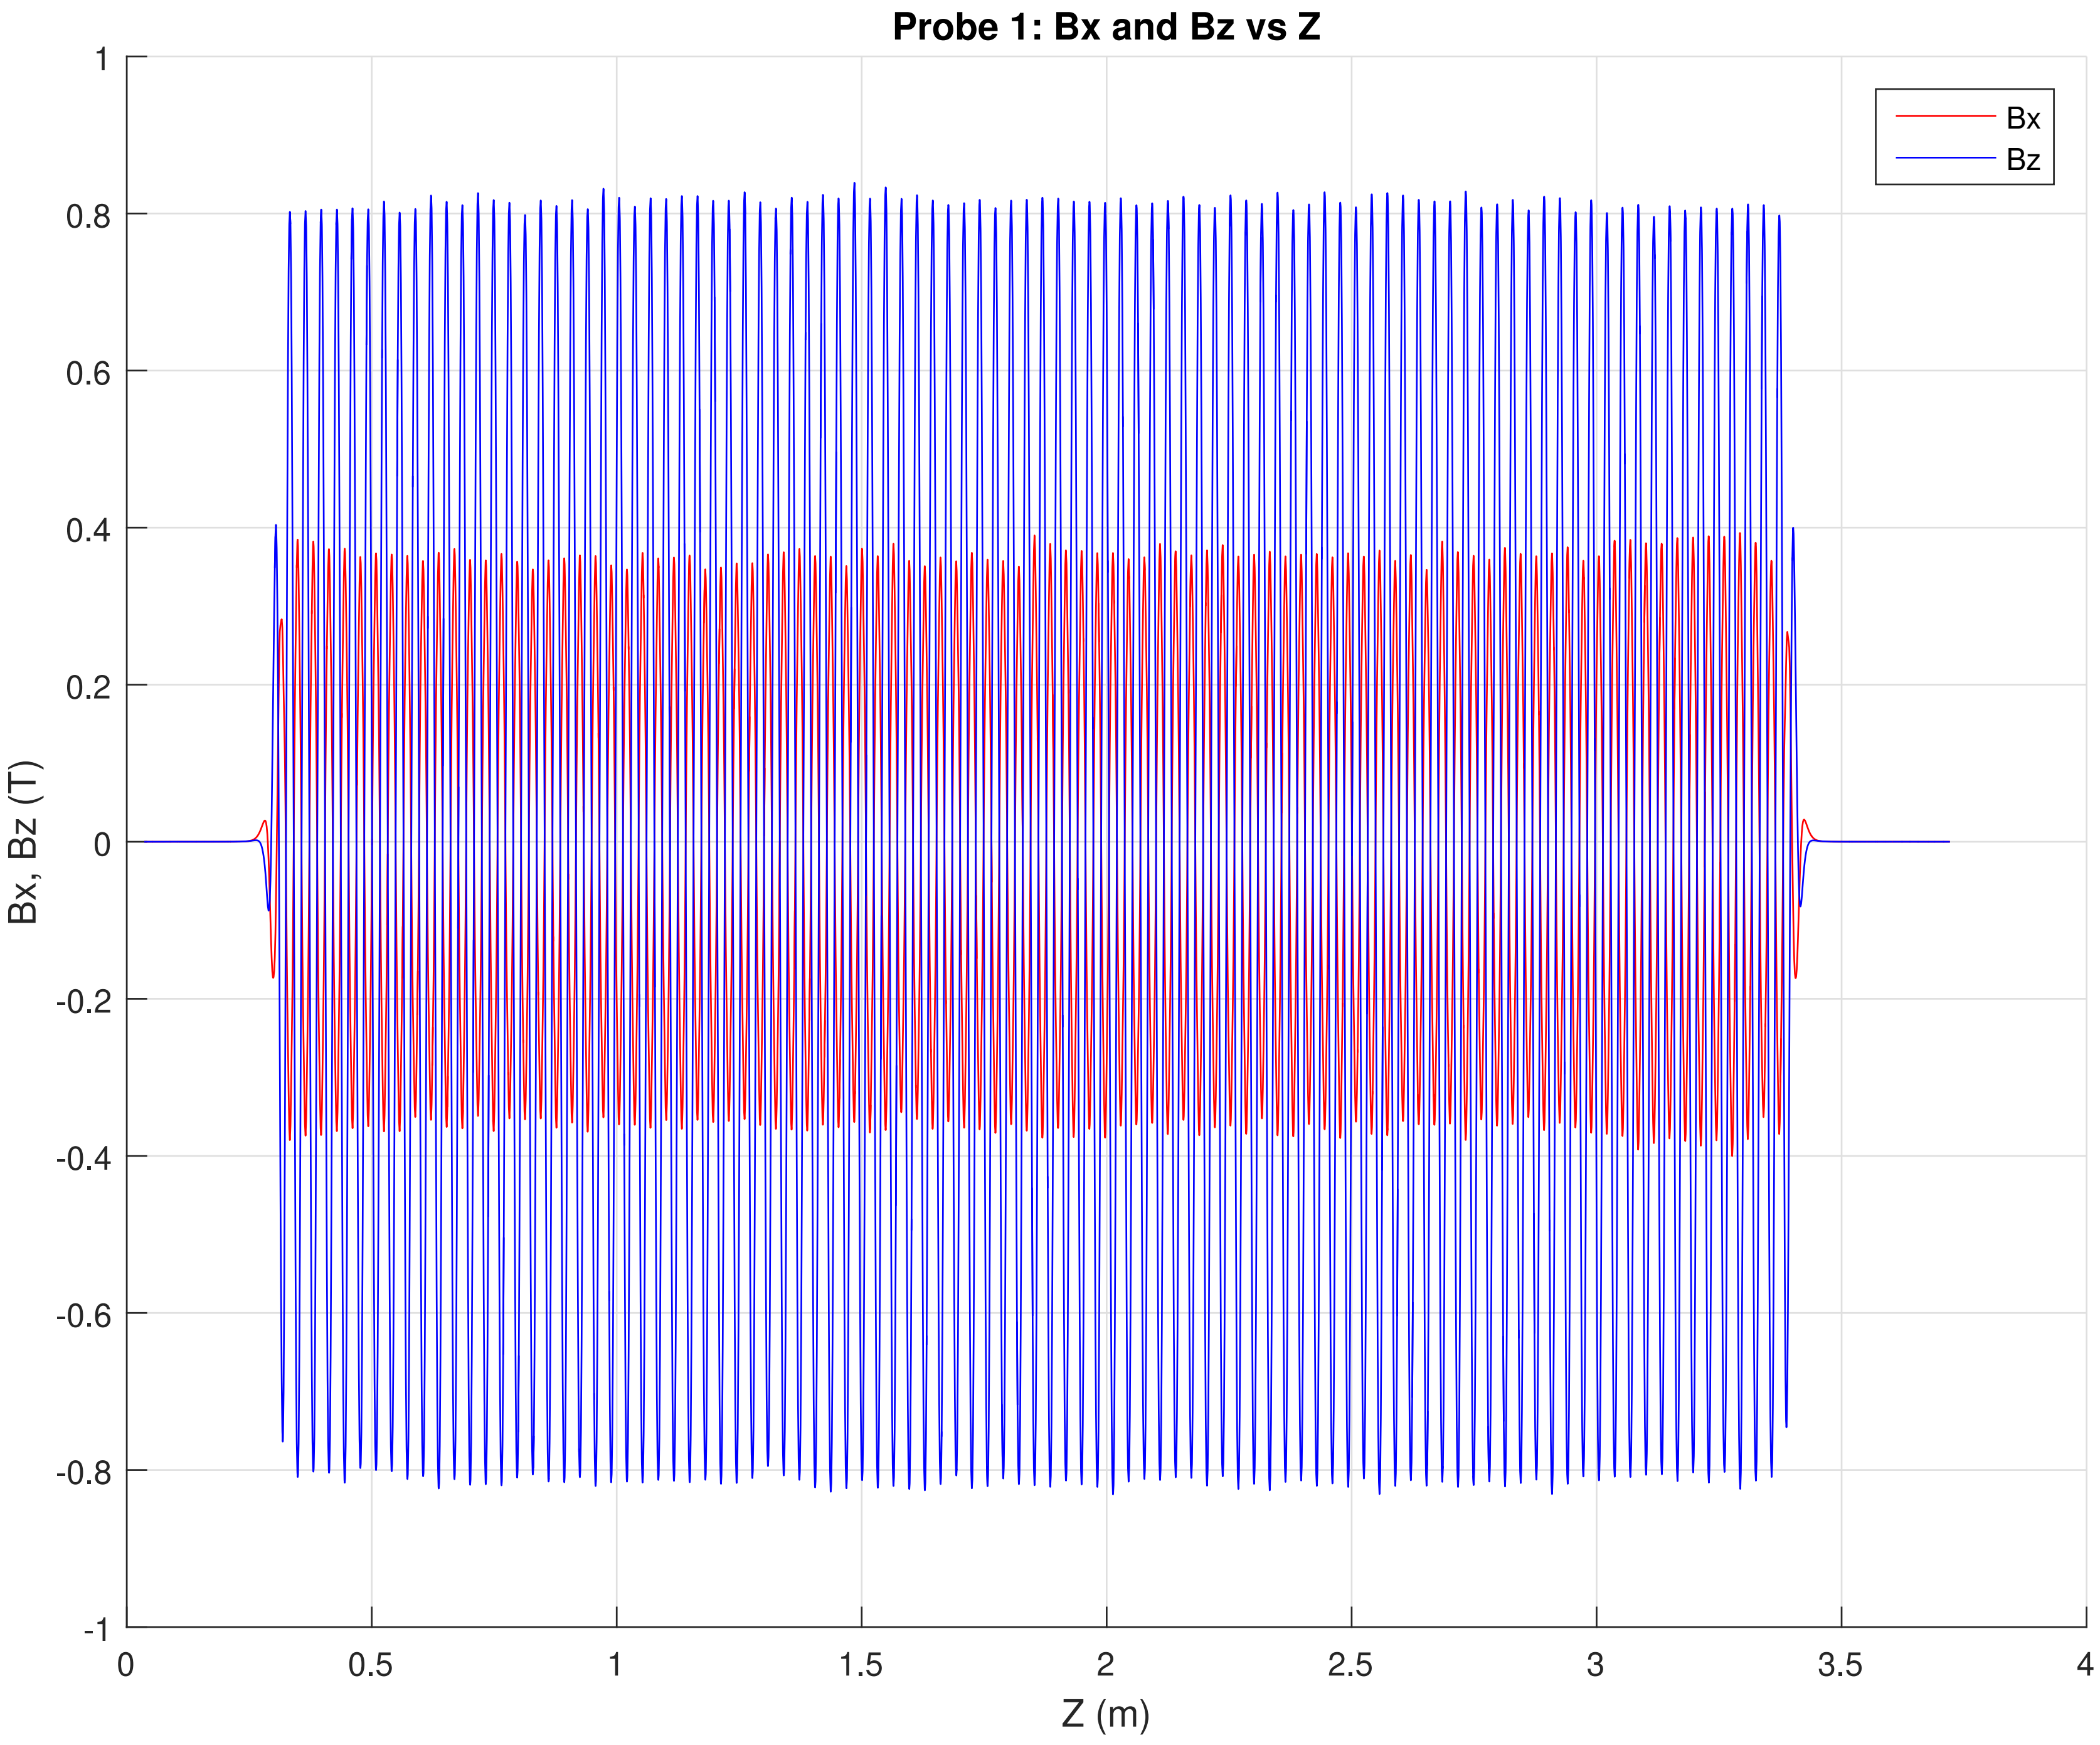
Probe 1: Bx and Bz vs Z
Bx
Bz
Bx, Bz (T)
1
0.8
0.6
0.4
0.2
0
-0.2
-0.4
-0.6
-0.8
-1
0
0.5
1
1.5
2
2.5
3
3.5
4
Z (m)

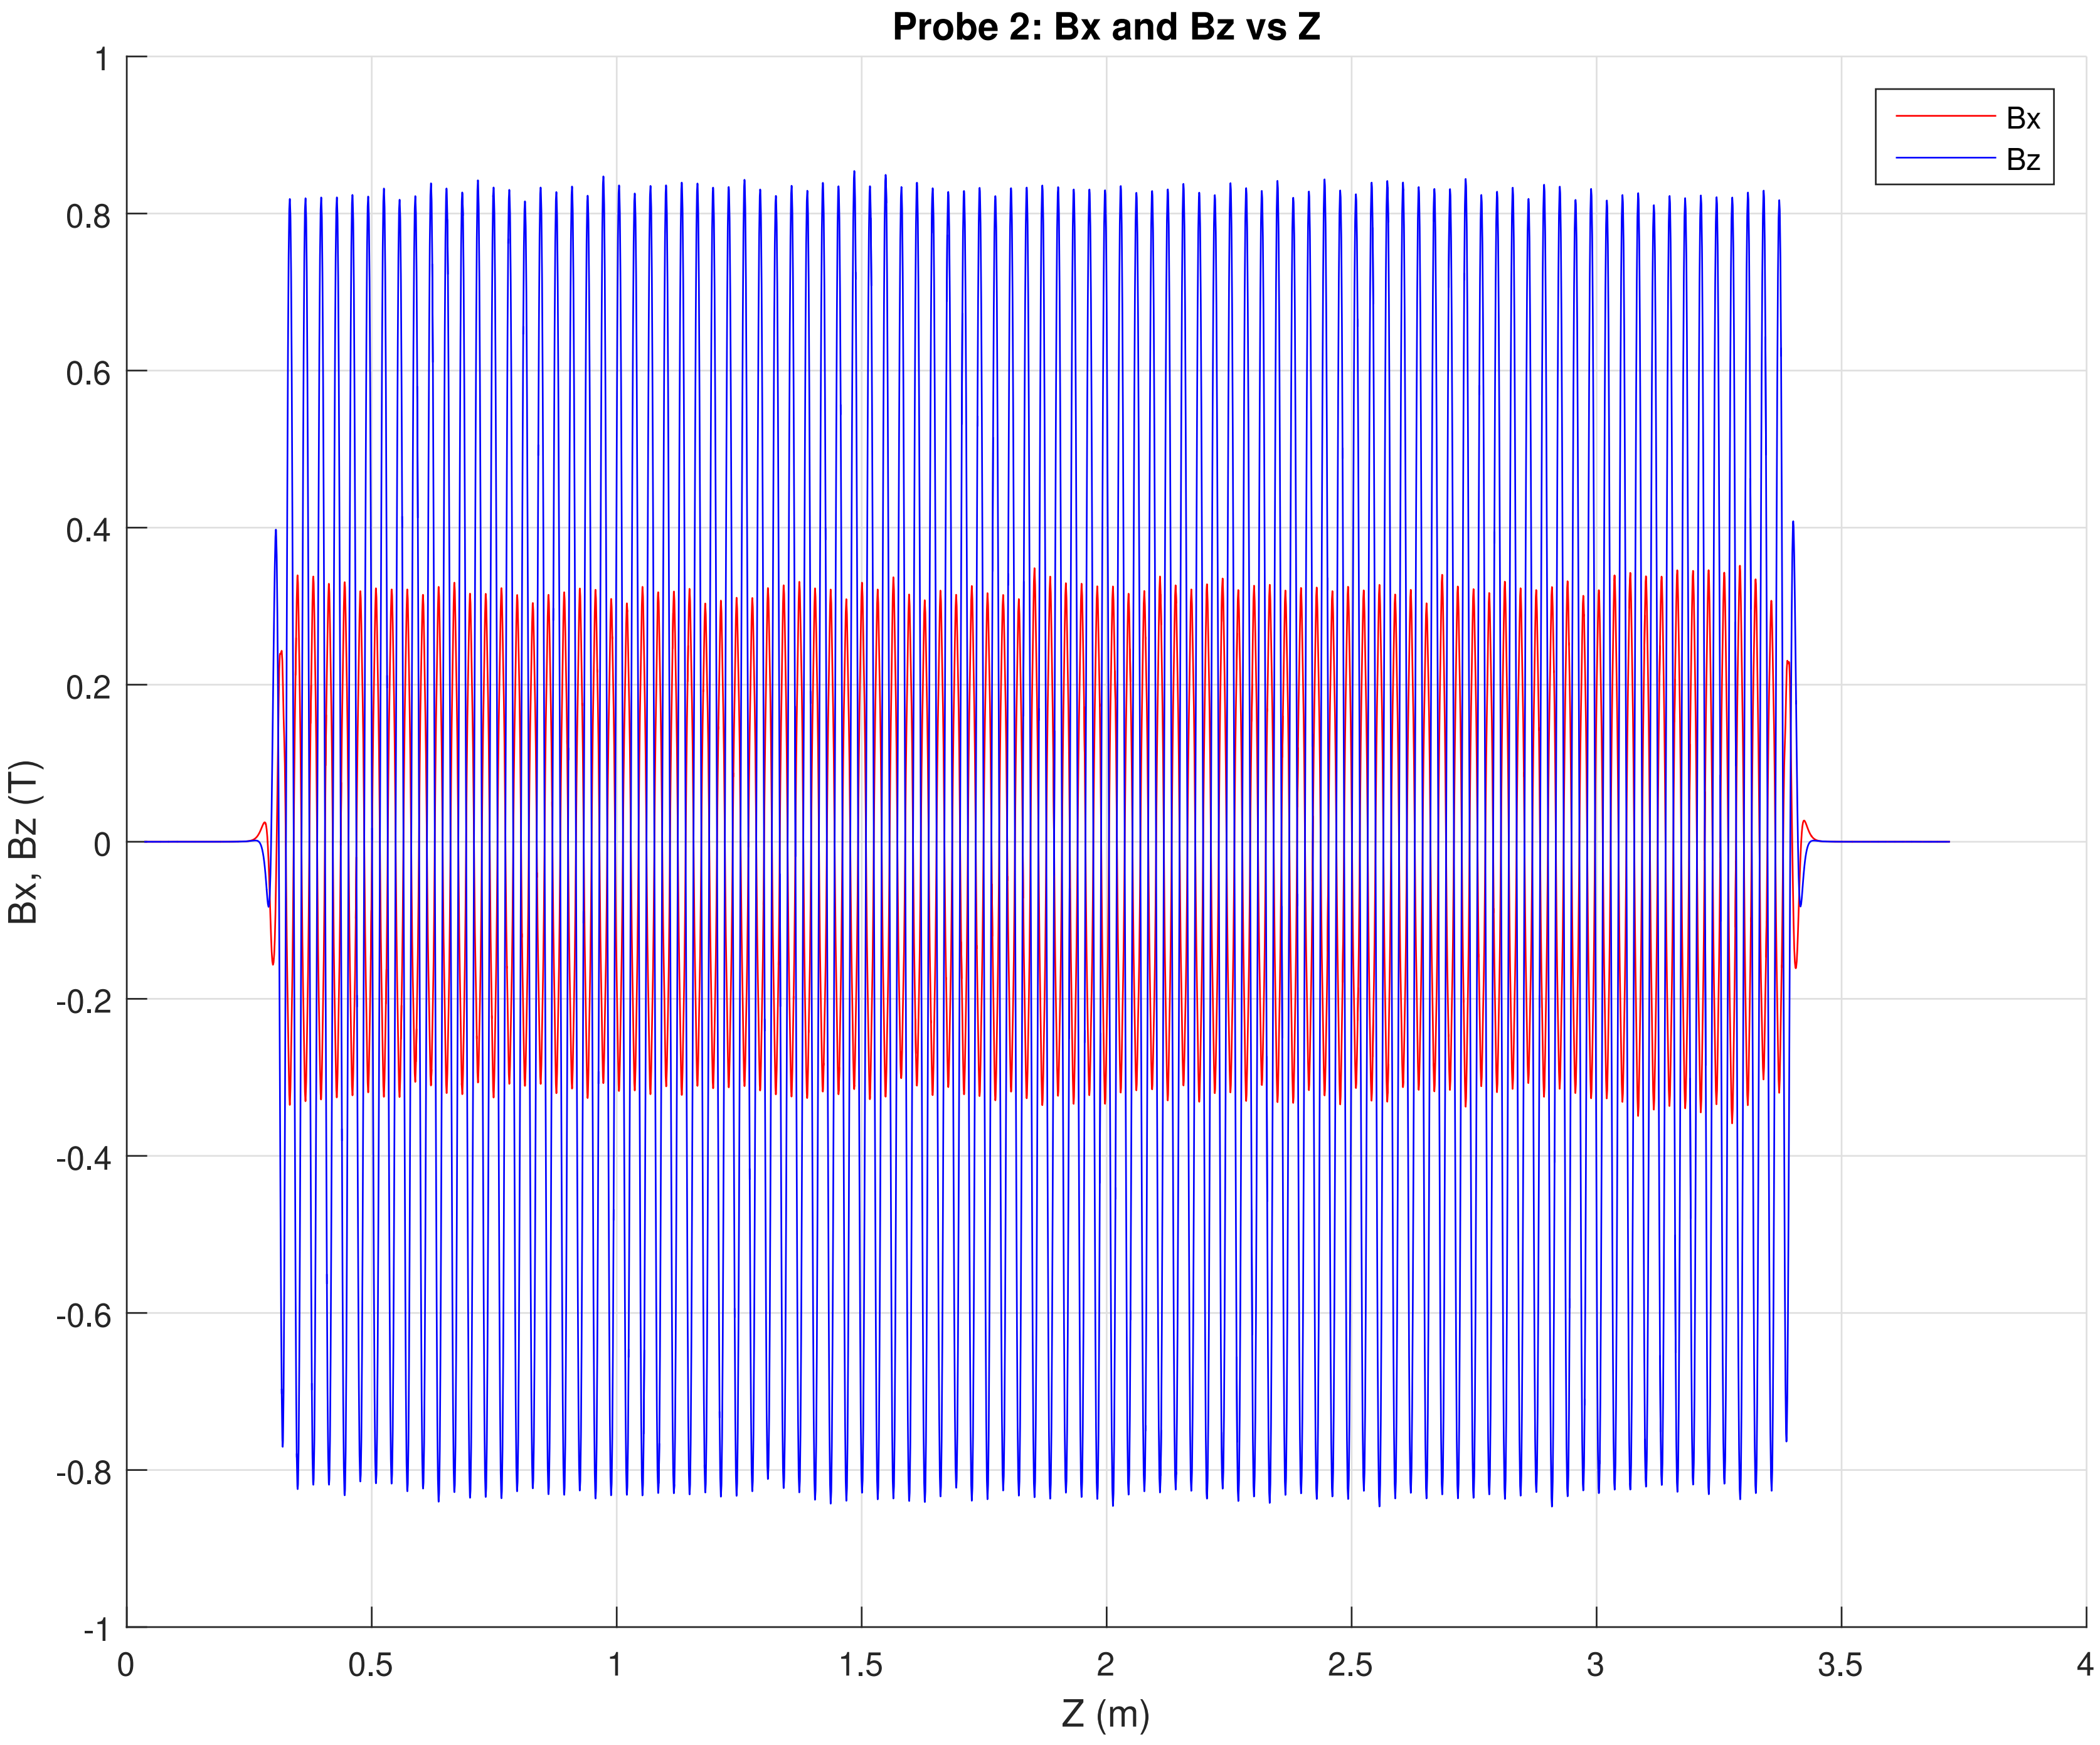
Probe 2: Bx and Bz vs Z
Bx
Bz
Bx, Bz (T)
Z (m)
1
0.8
0.6
0.4
0.2
0
-0.2
-0.4
-0.6
-0.8
-1
0
0.5
1
1.5
2
2.5
3
3.5
4

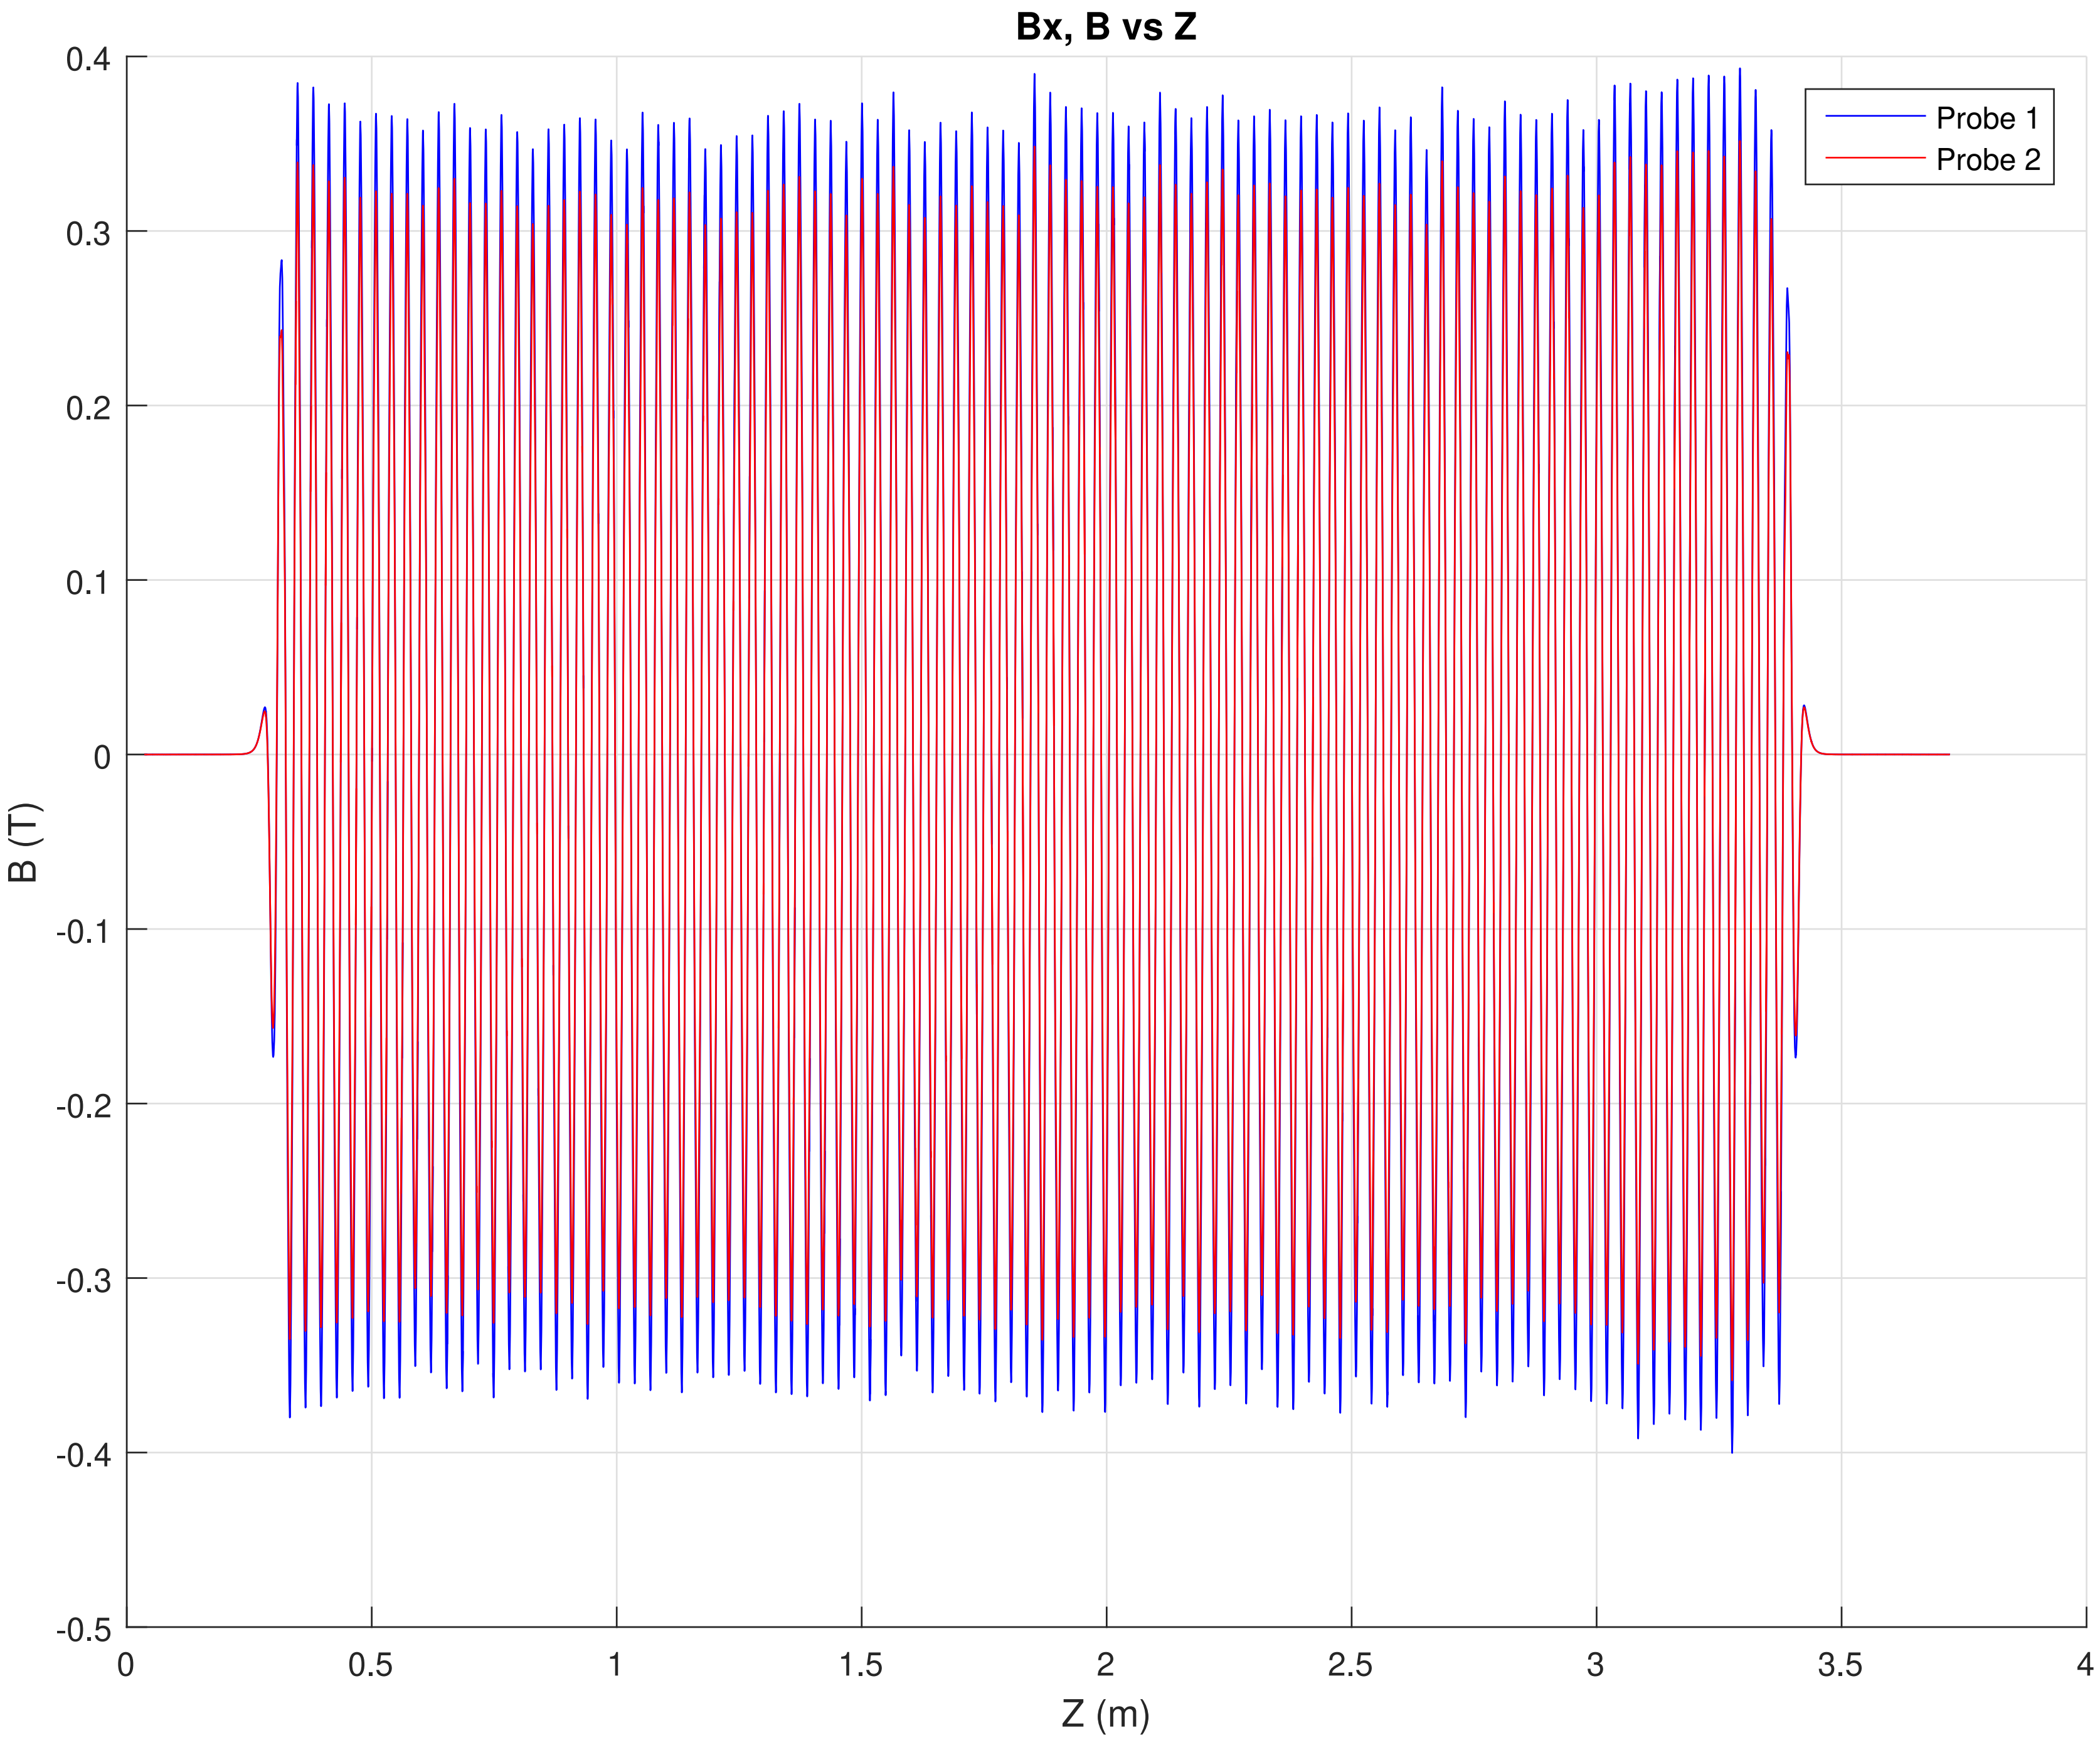
Bx, B vs Z
Probe 1
Probe 2
B (T)
Z (m)
0.4
0.3
0.2
0.1
0
-0.1
-0.2
-0.3
-0.4
-0.5
0
0.5
1
1.5
2
2.5
3
3.5
4

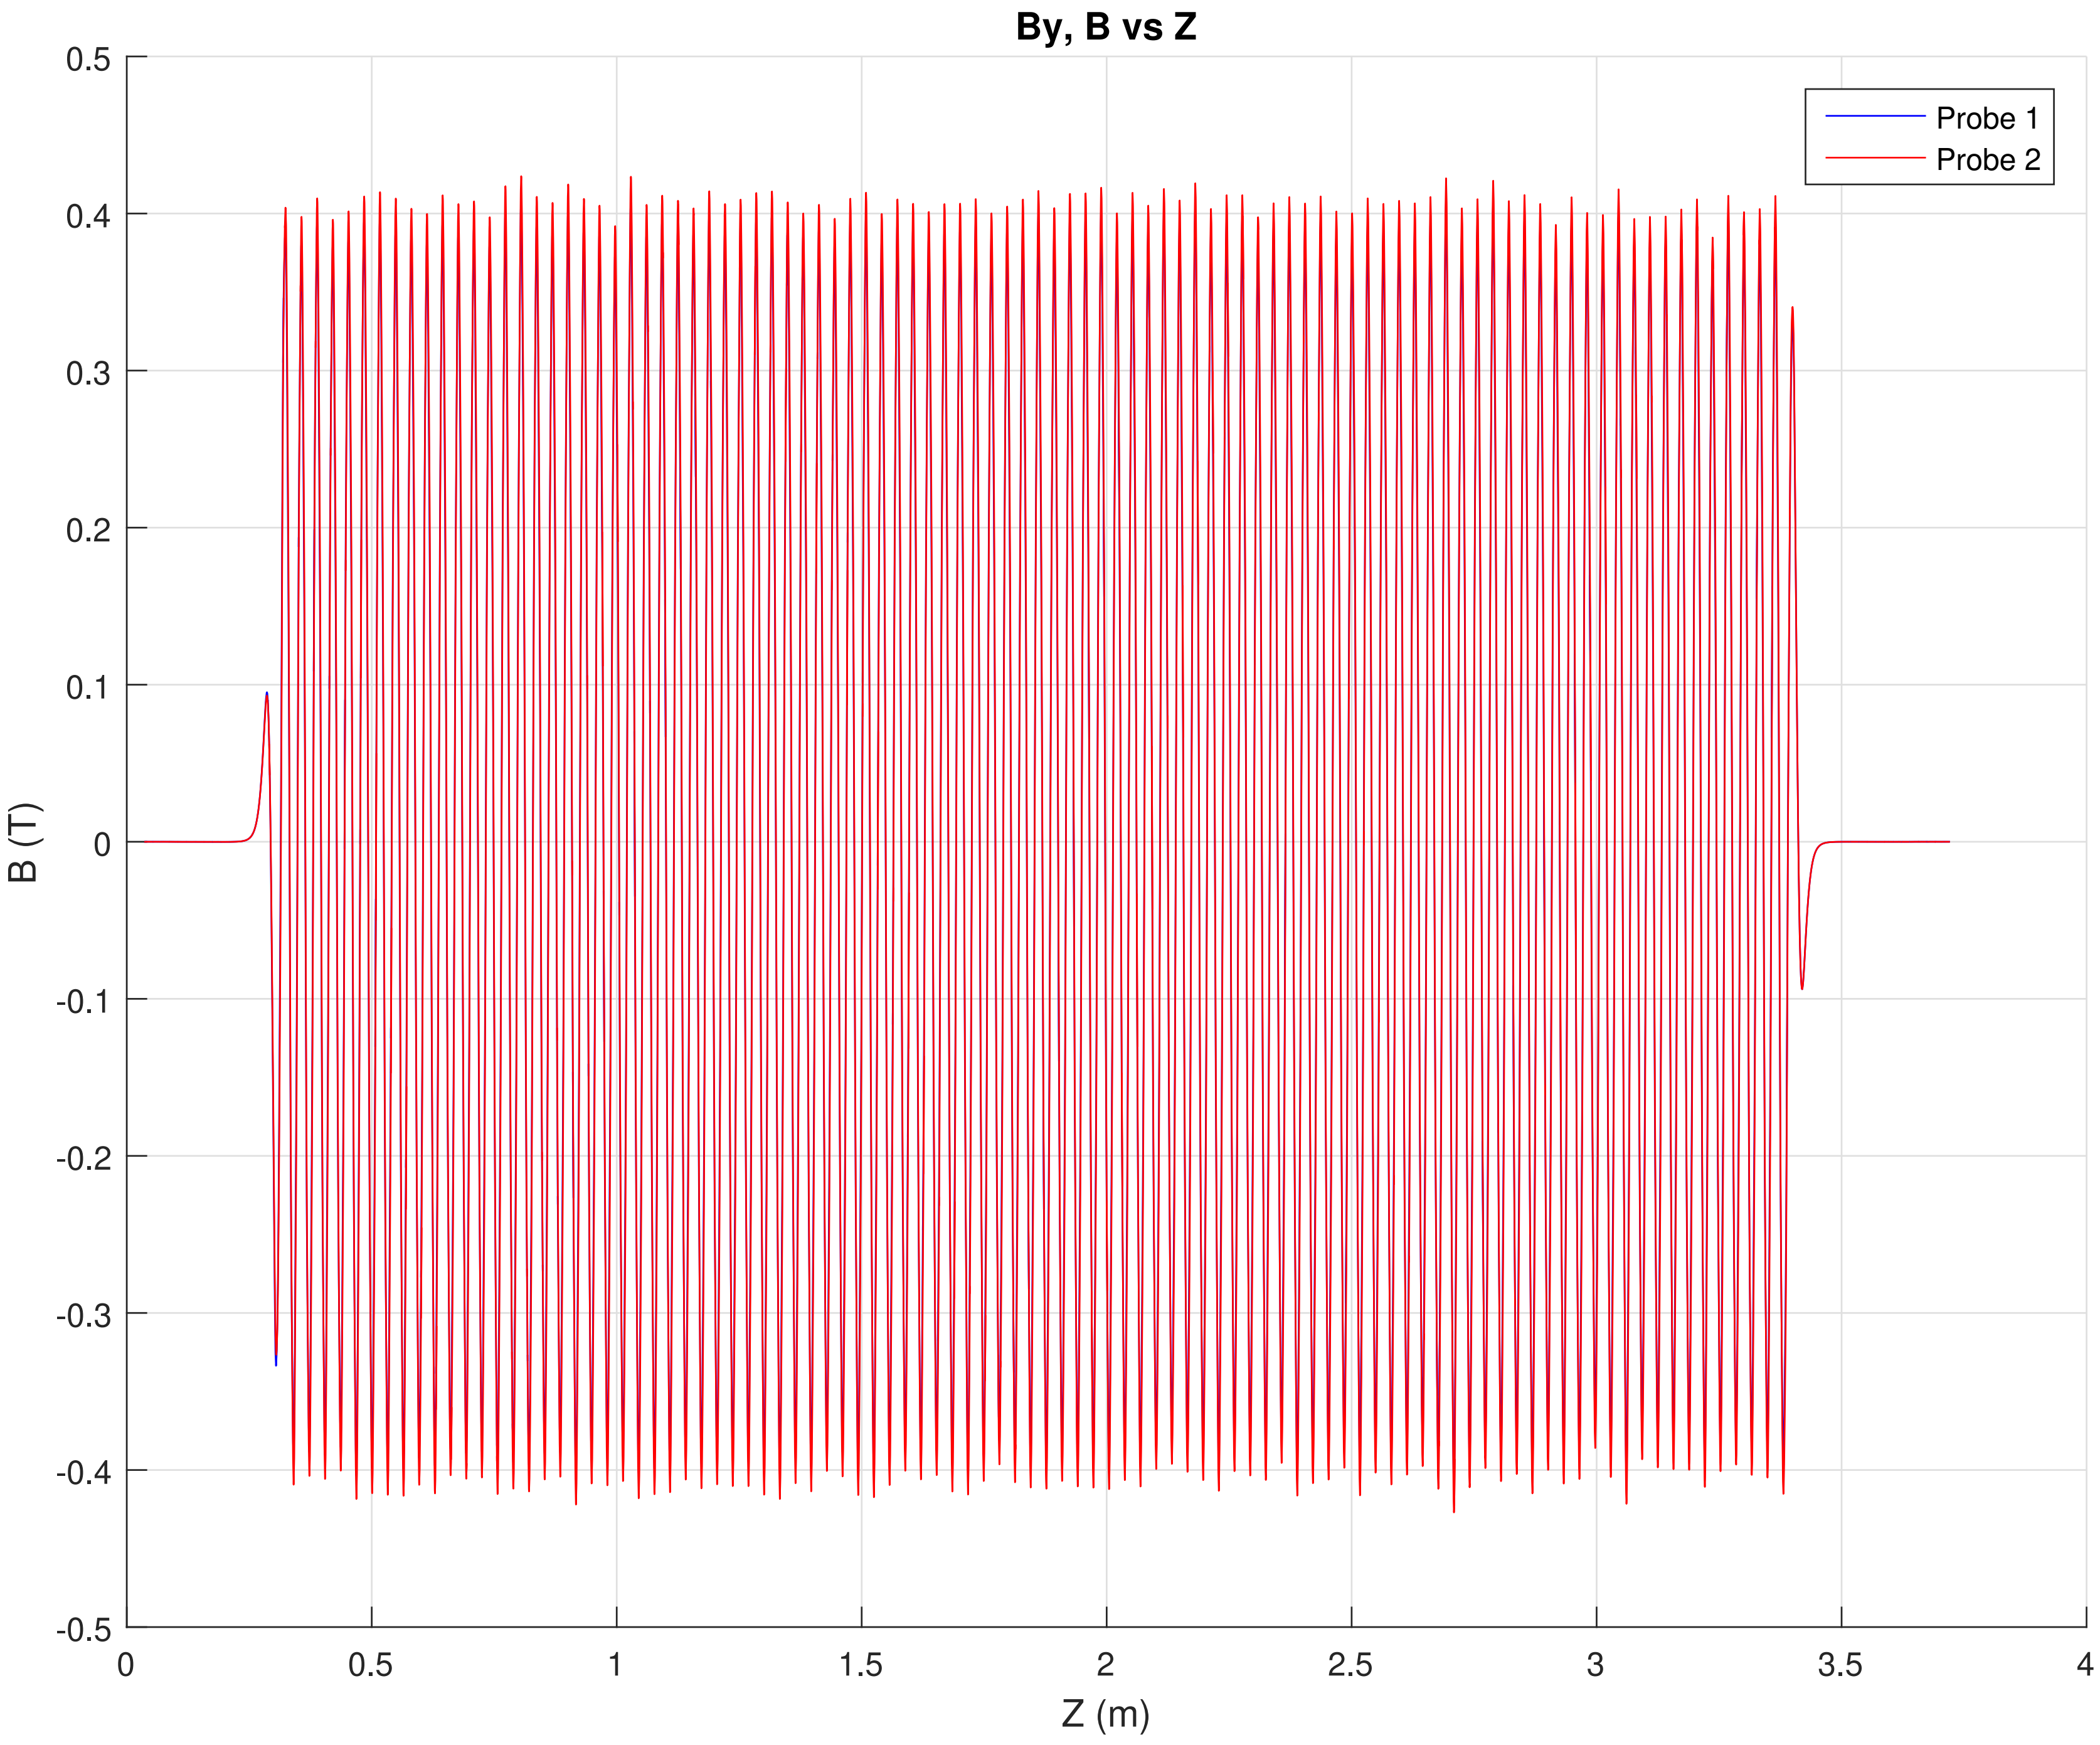
By, B vs Z
Probe 1
Probe 2
B (T)
Z (m)
0.5
0.4
0.3
0.2
0.1
0
-0.1
-0.2
-0.3
-0.4
-0.5
0
0.5
1
1.5
2
2.5
3
3.5
4

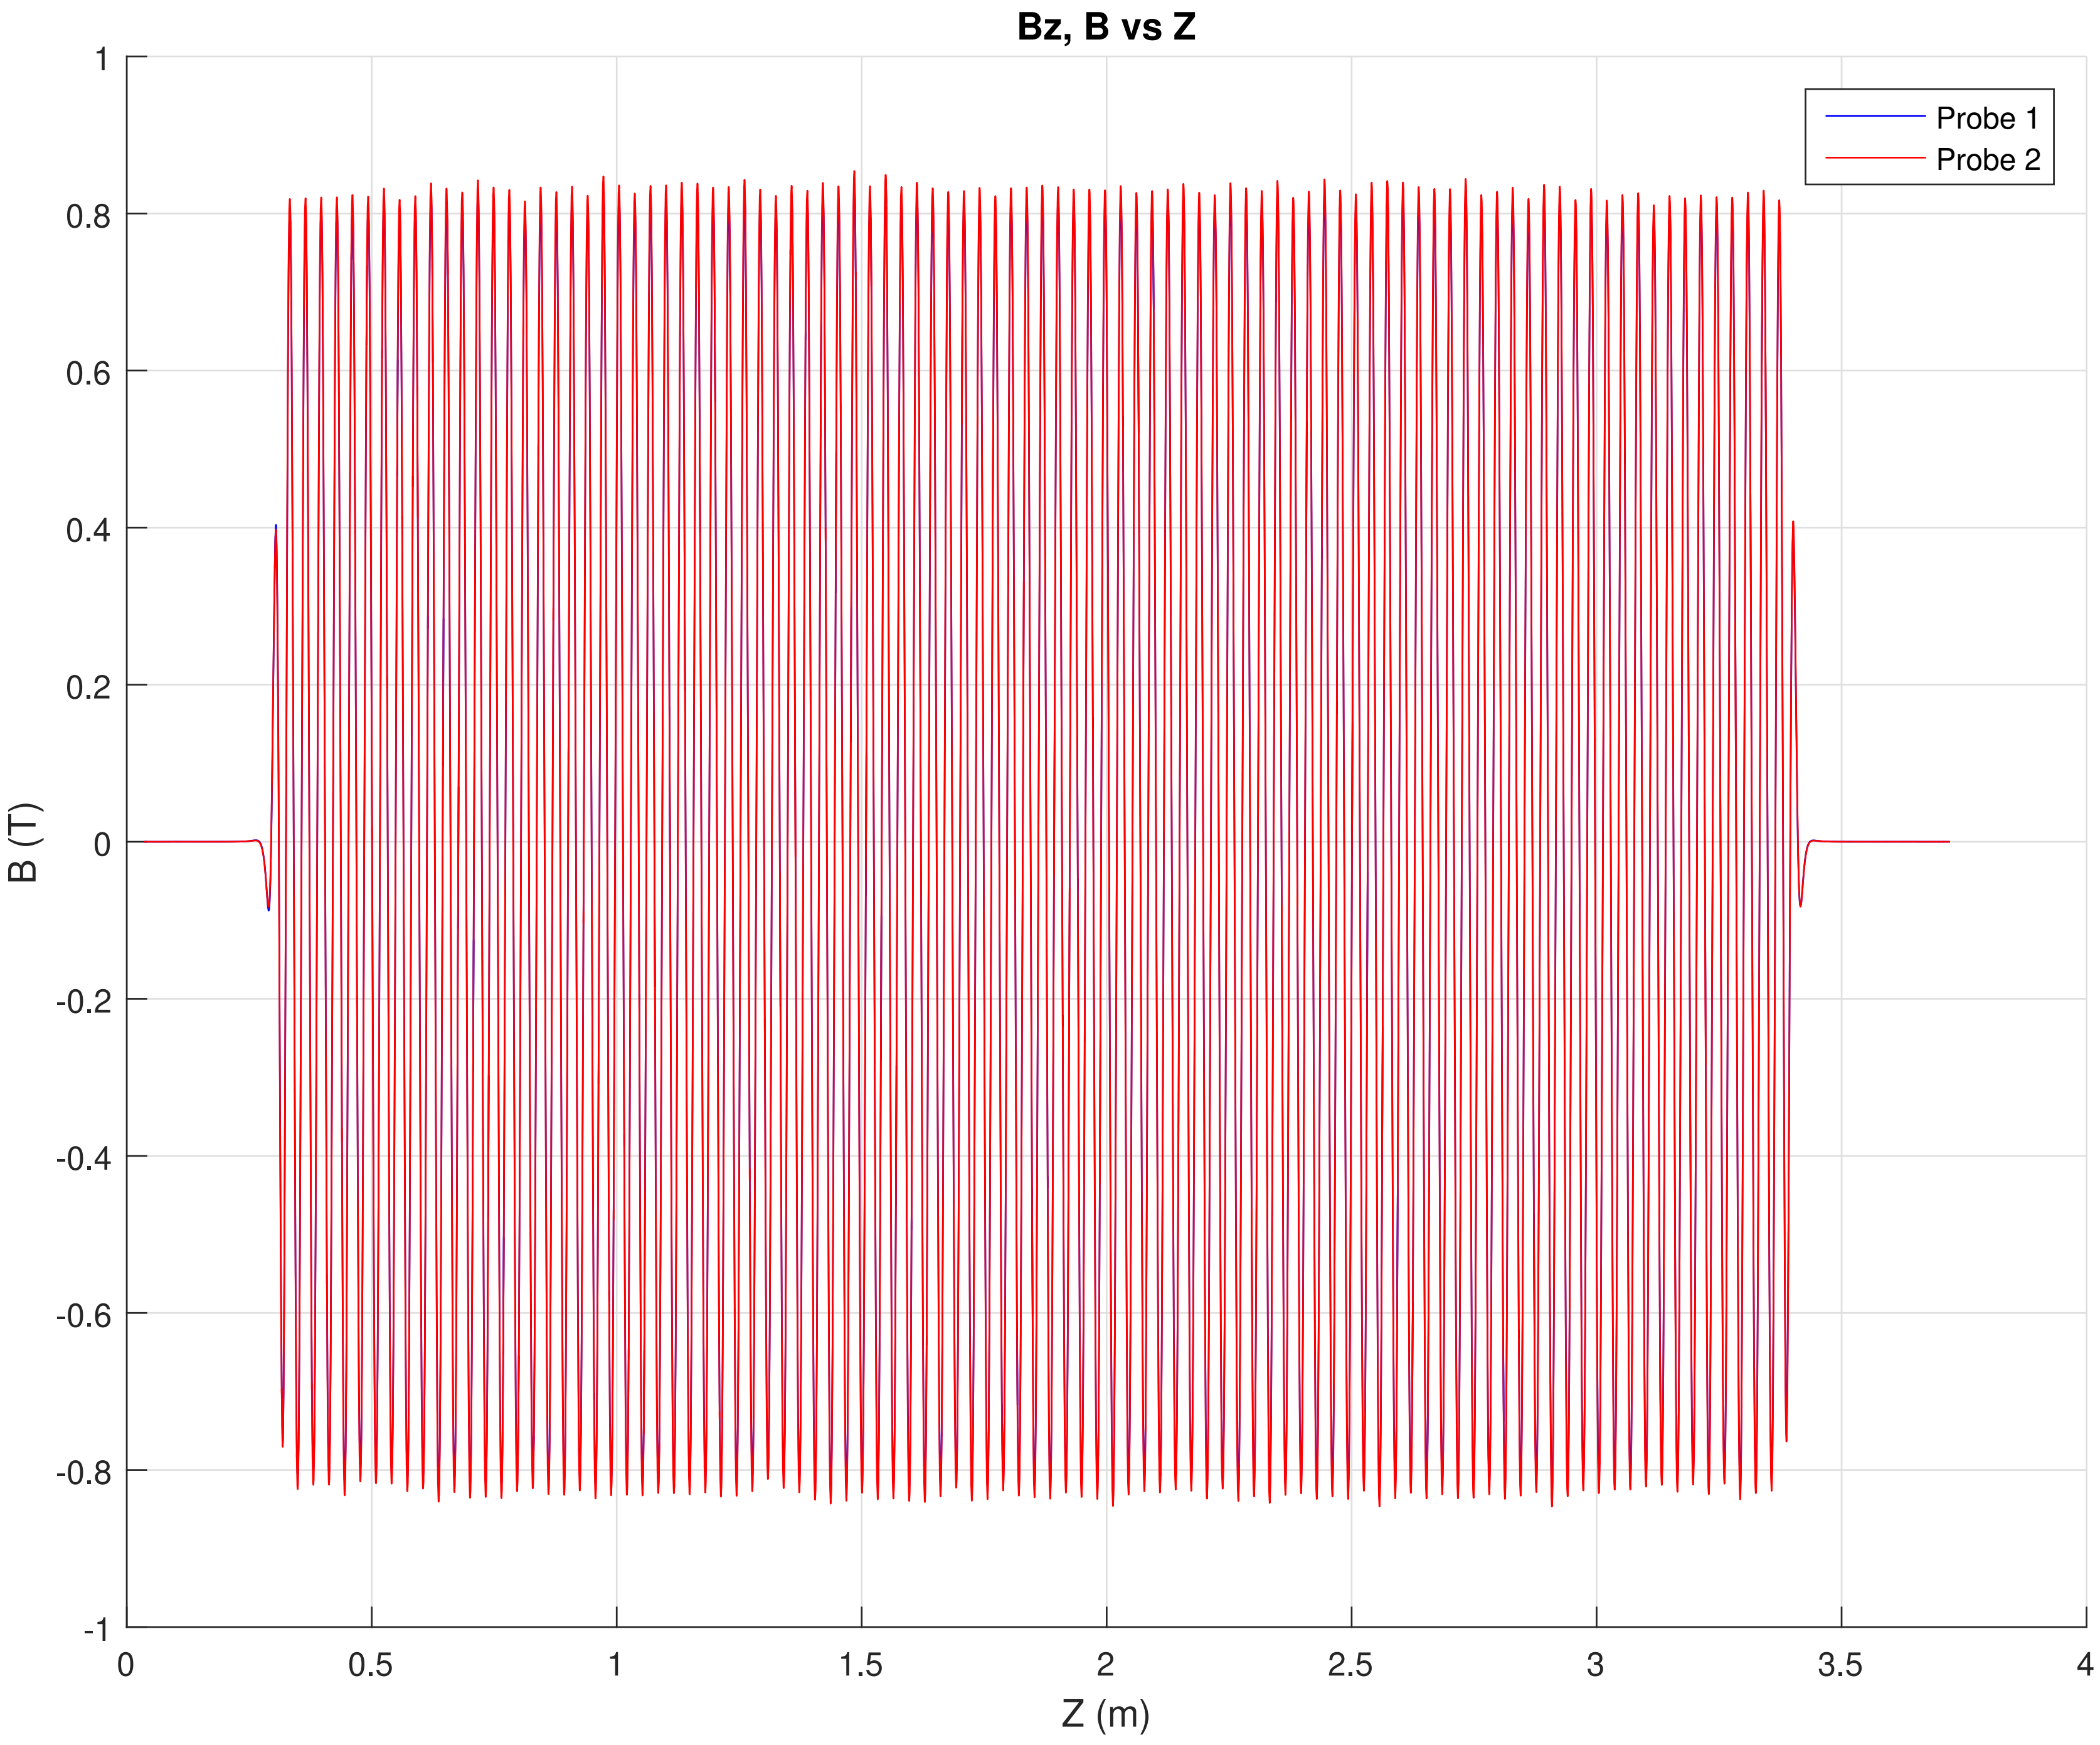
Bz, B vs Z
Probe 1
Probe 2
B (T)
Z (m)
1
0.8
0.6
0.4
0.2
0
-0.2
-0.4
-0.6
-0.8
-1
0
0.5
1
1.5
2
2.5
3
3.5
4

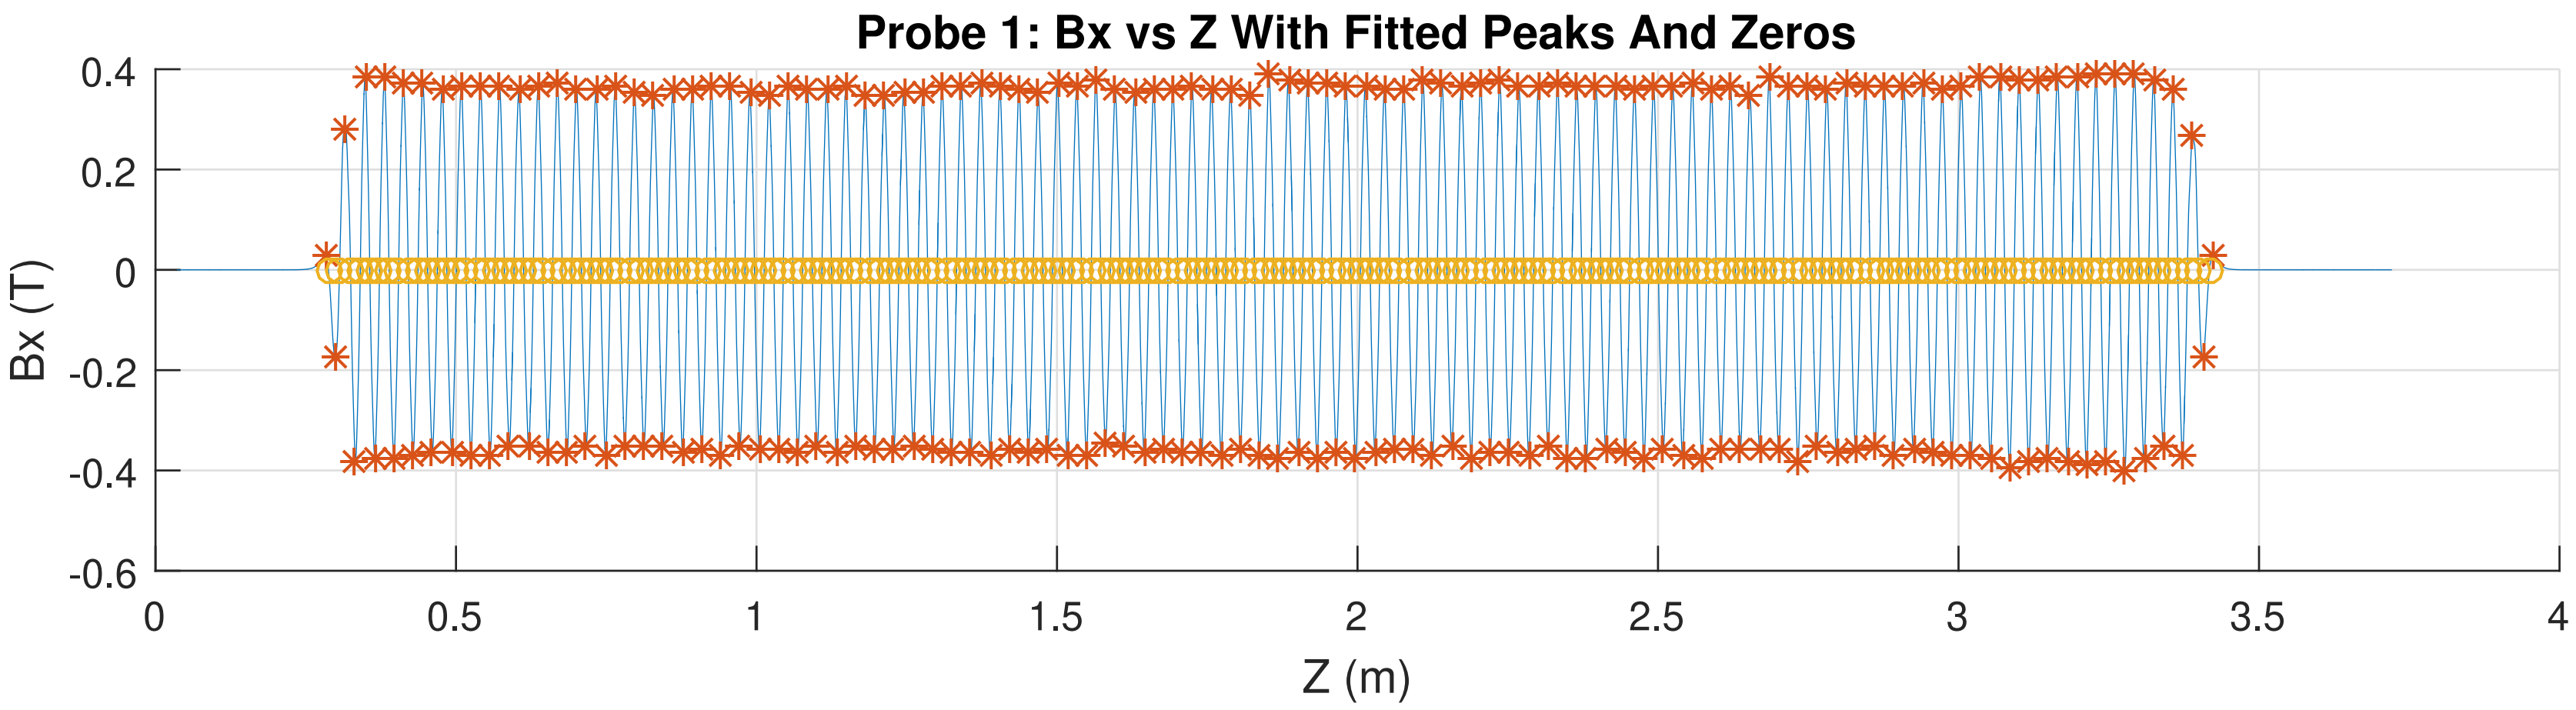

Probe 1: Bx vs Z With Fitted Peaks And Zeros

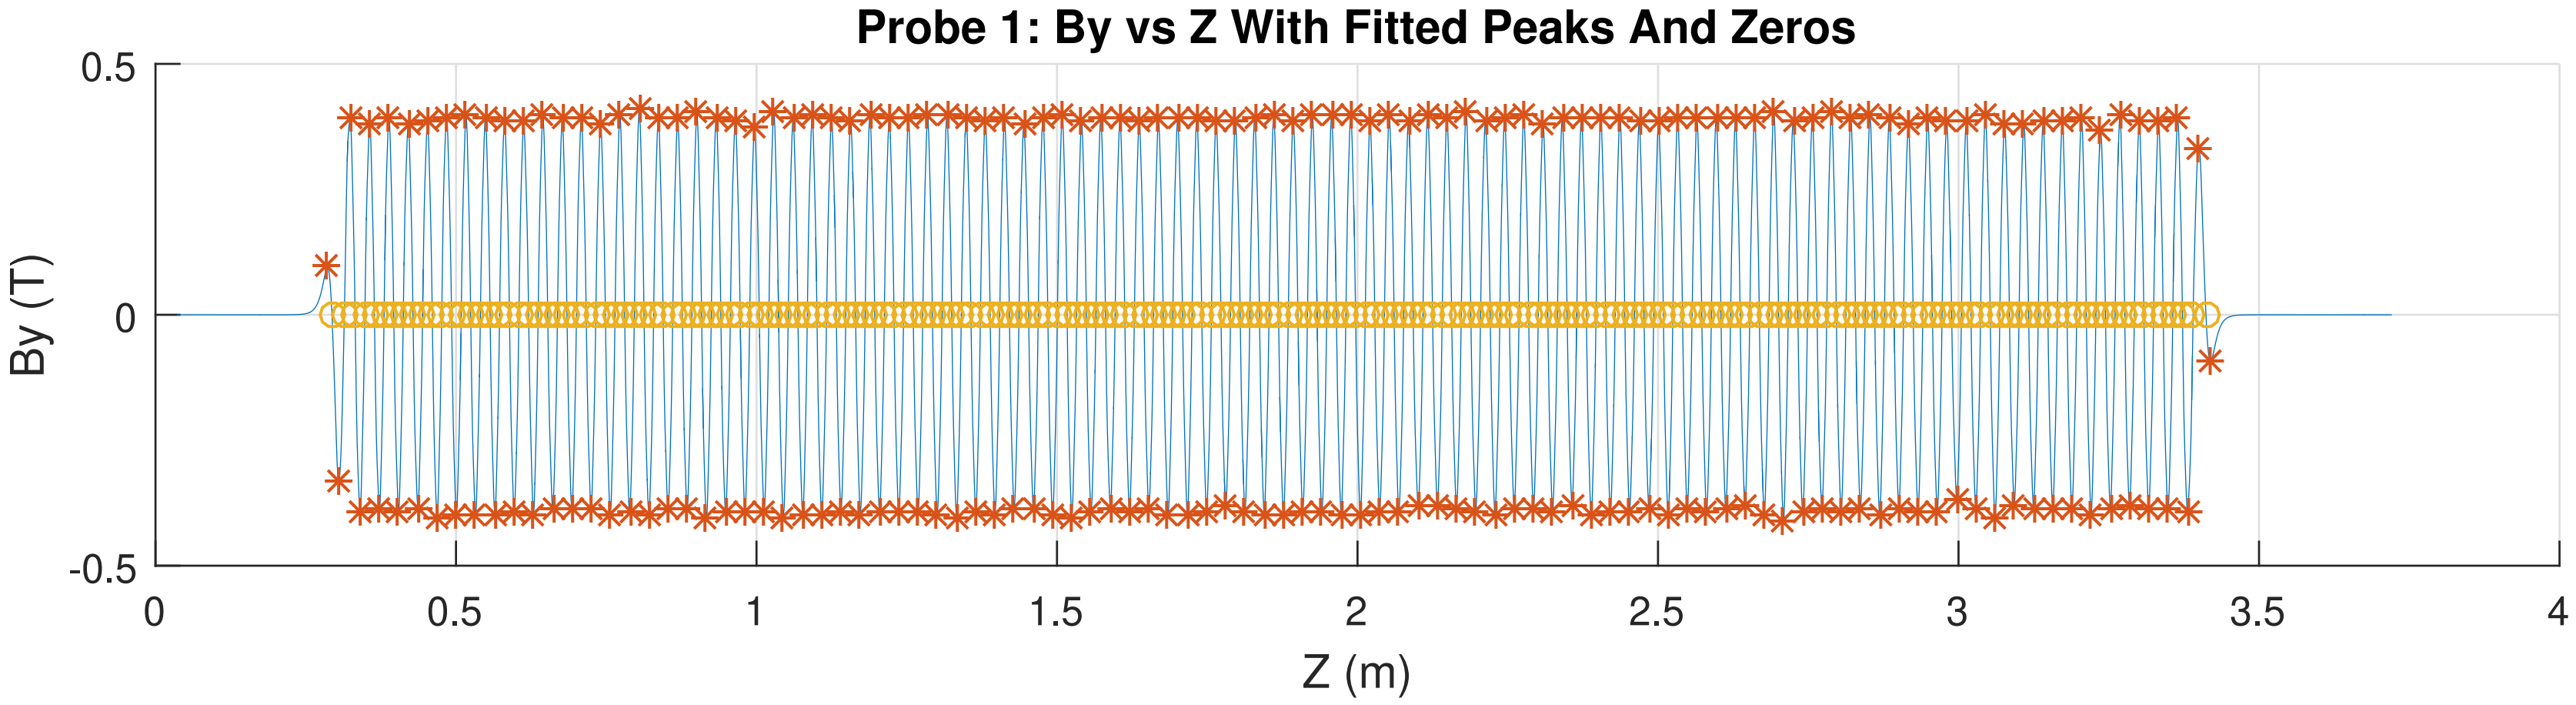

Probe 1: By vs Z With Fitted Peaks And Zeros

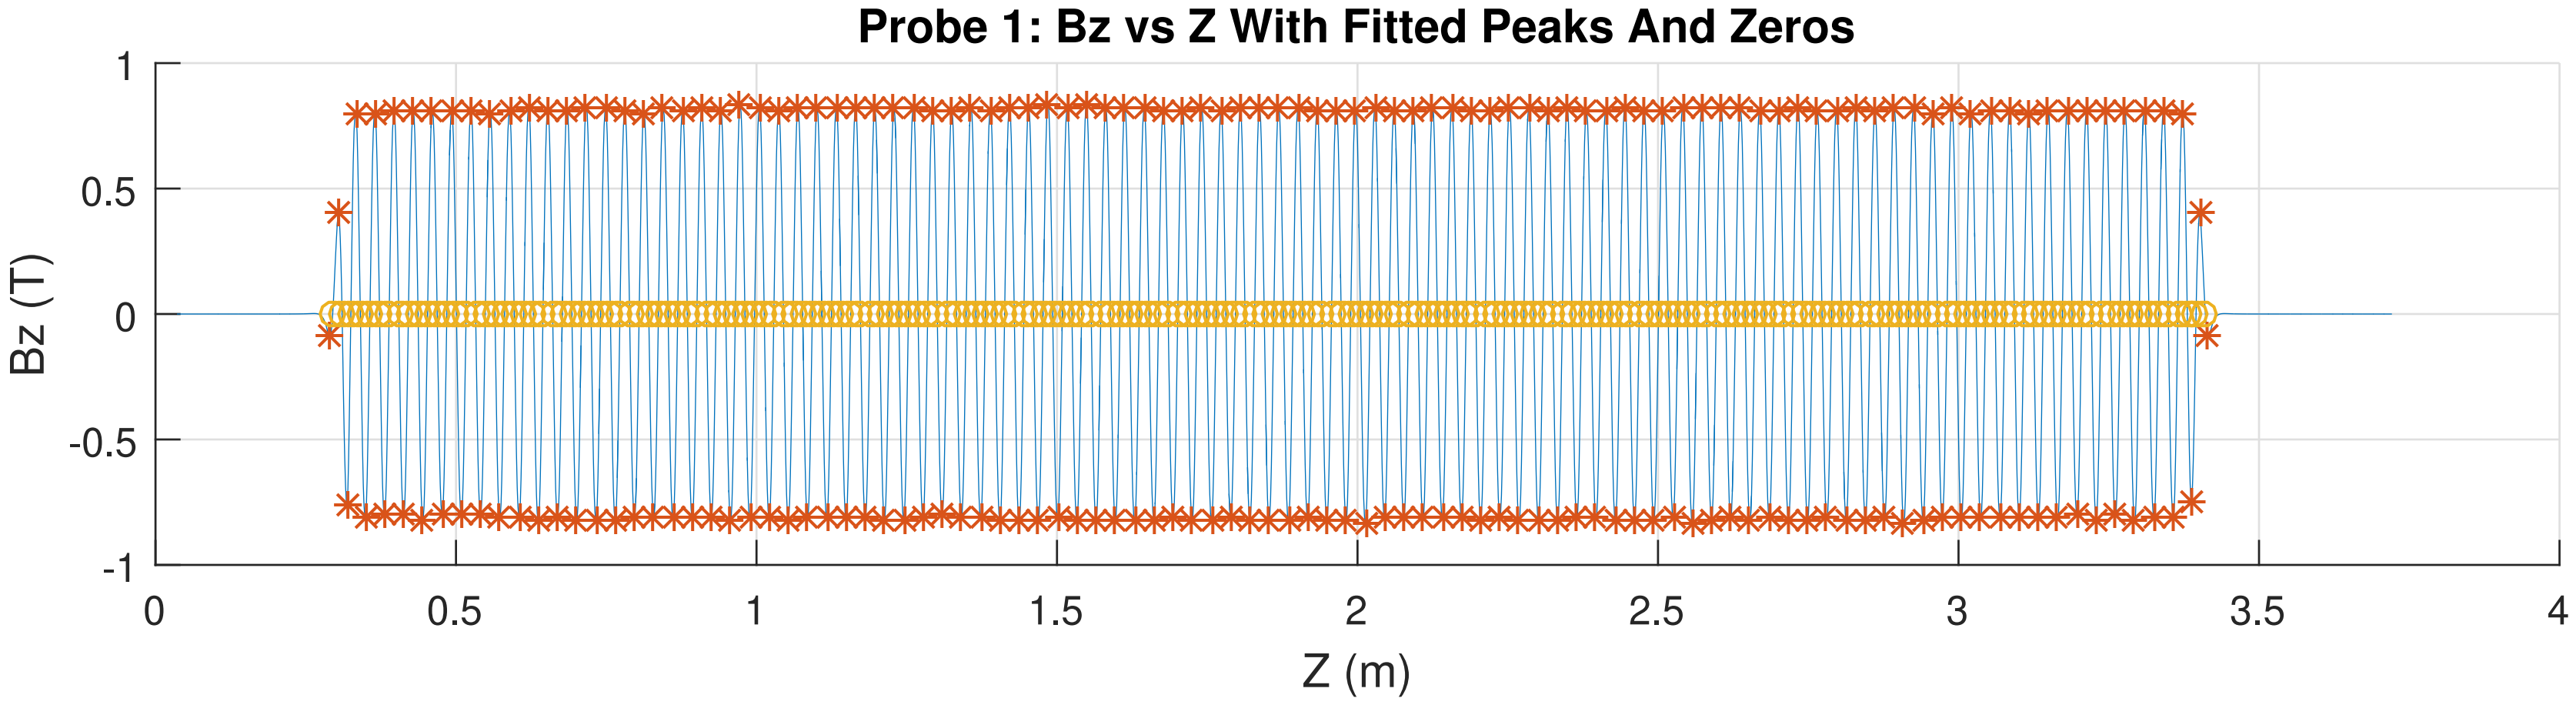

Probe 1: Bz vs Z With Fitted Peaks And Zeros

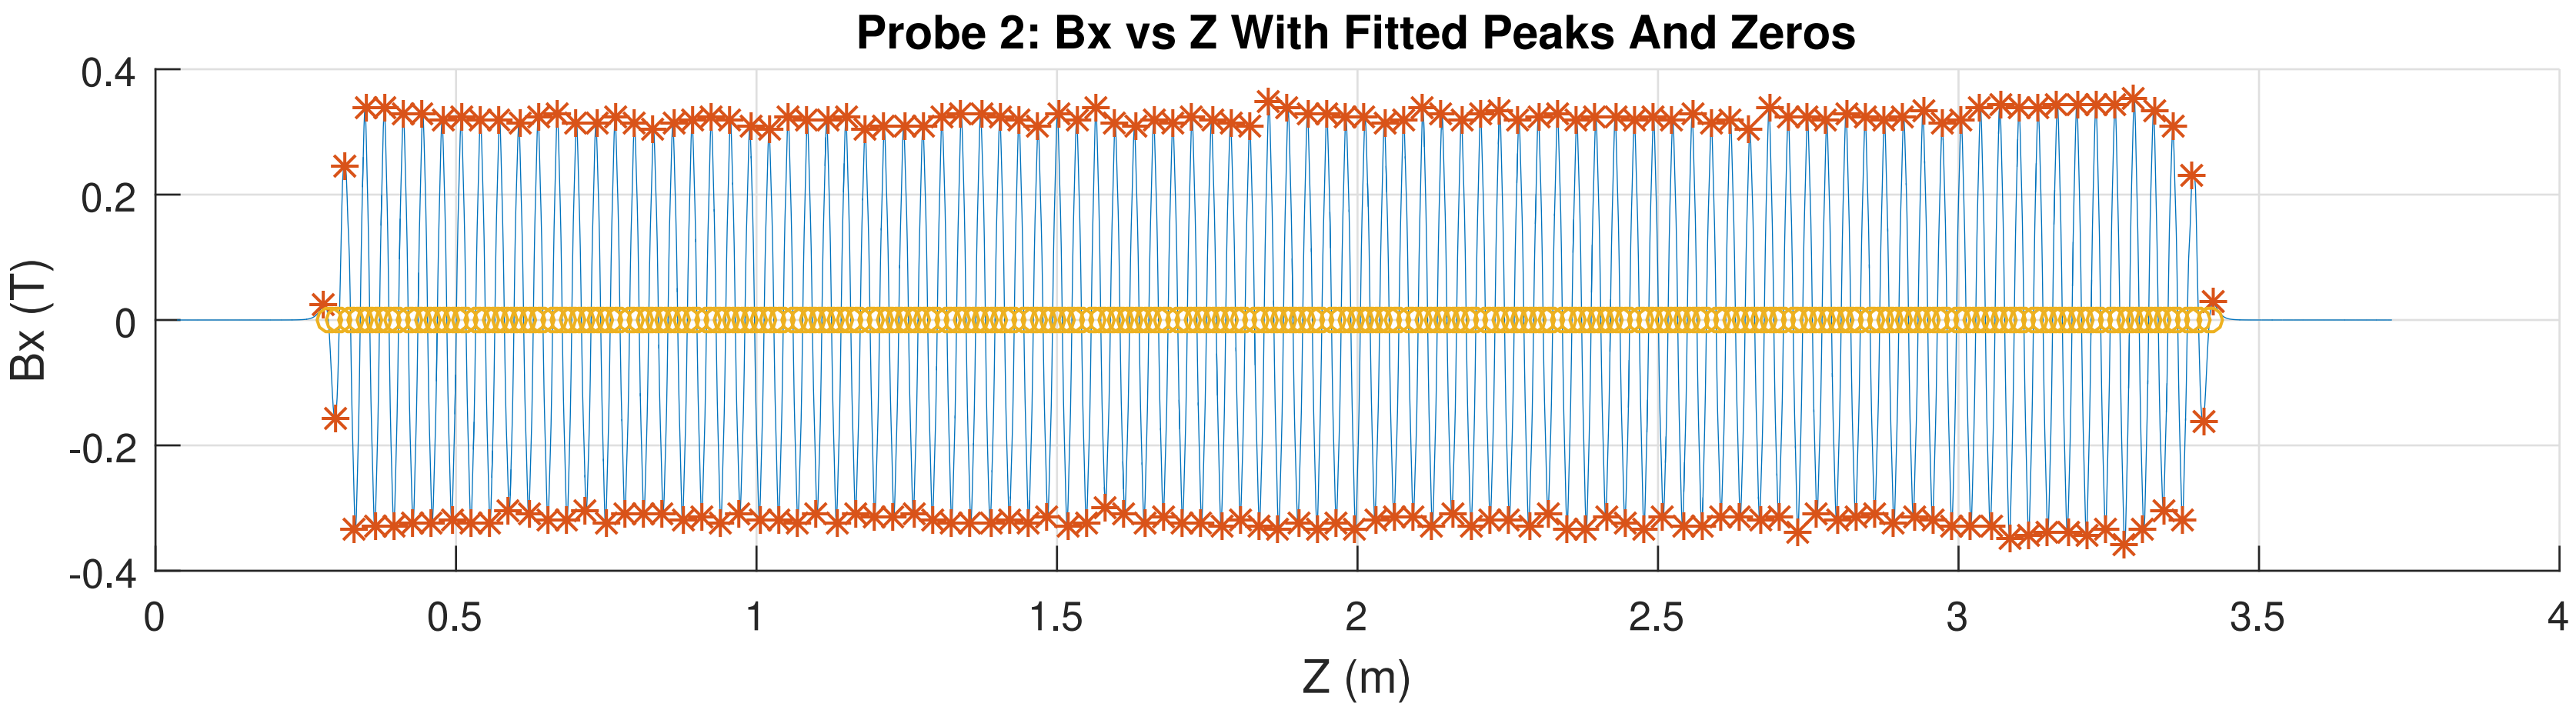

Probe 2: Bx vs Z With Fitted Peaks And Zeros

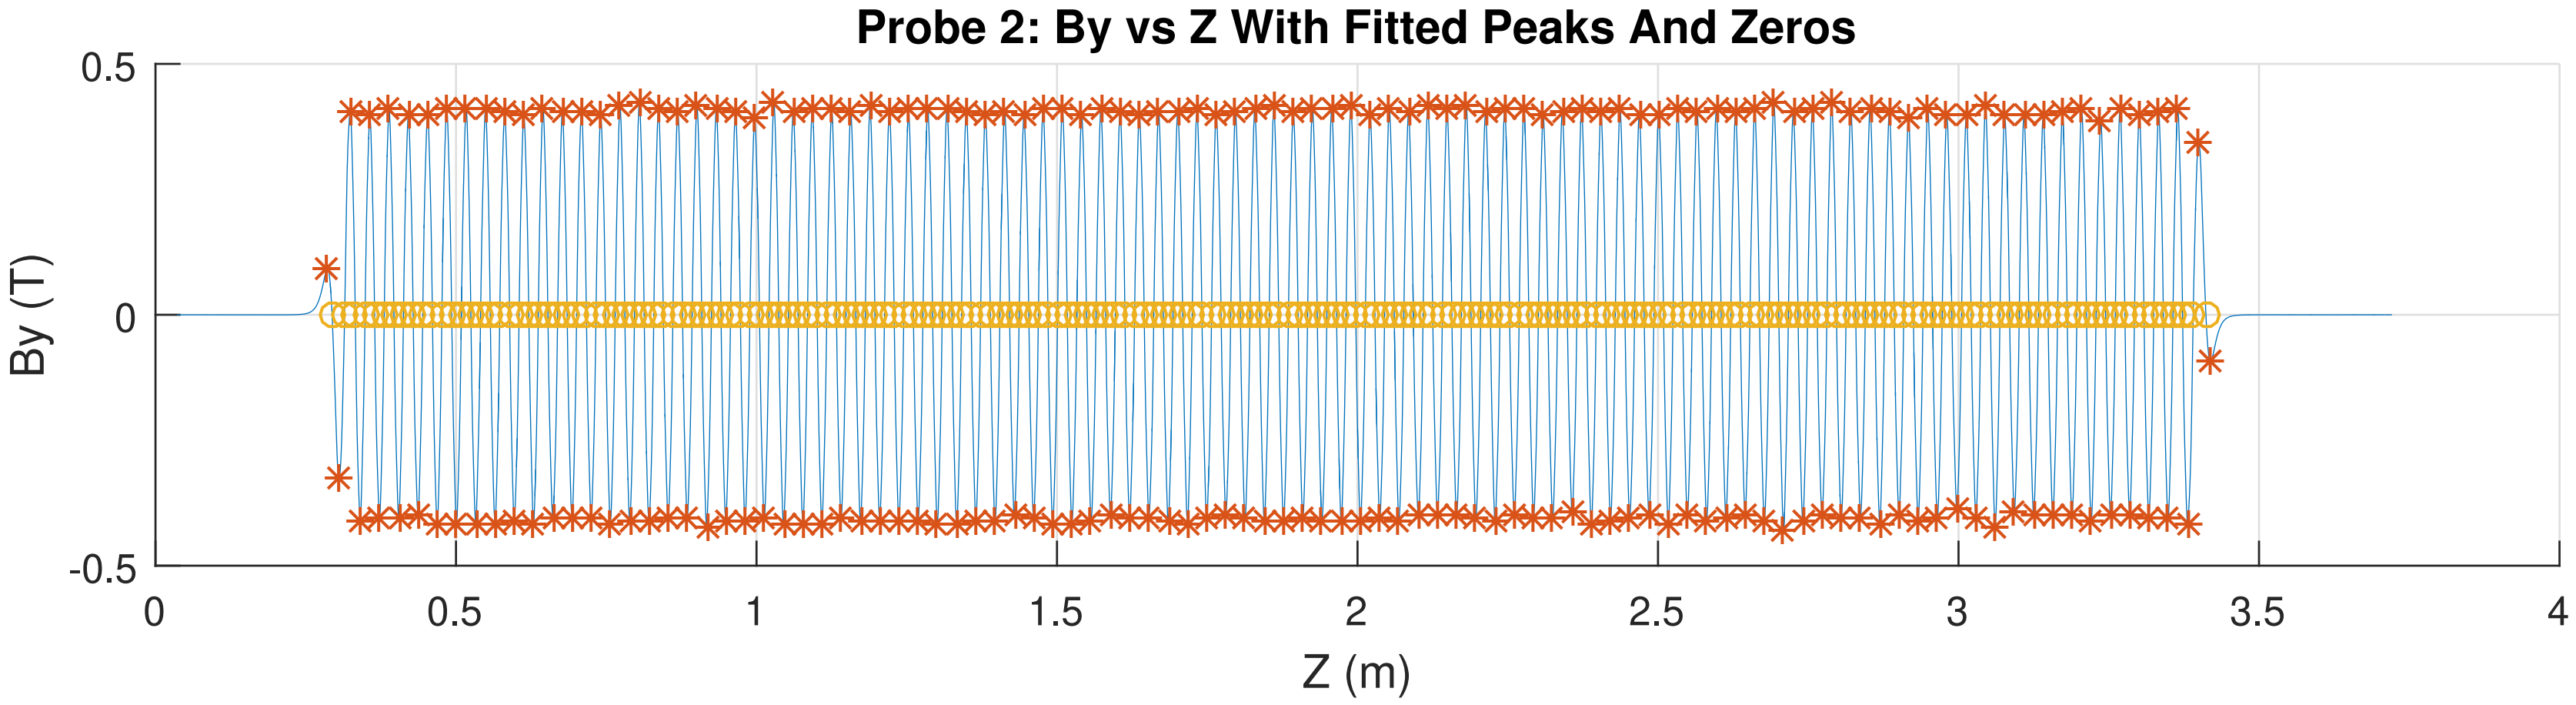

Probe 2: By vs Z With Fitted Peaks And Zeros

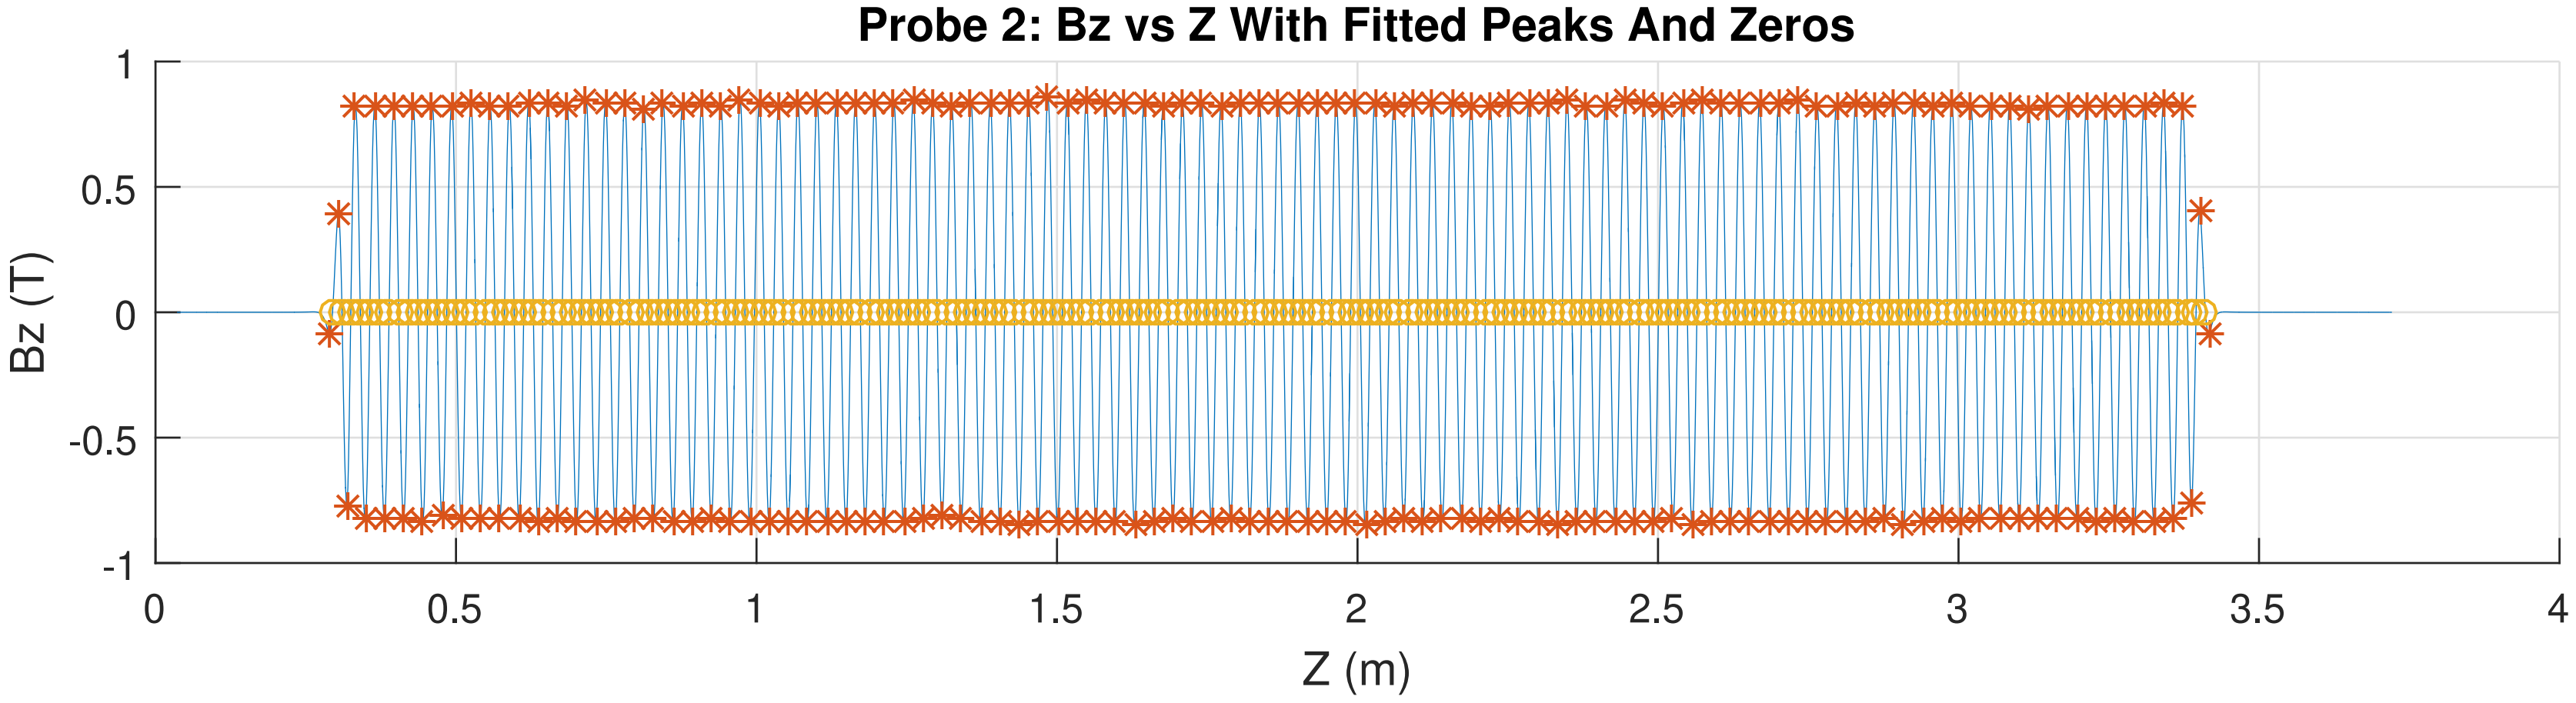

Probe 2: Bz vs Z With Fitted Peaks And Zeros

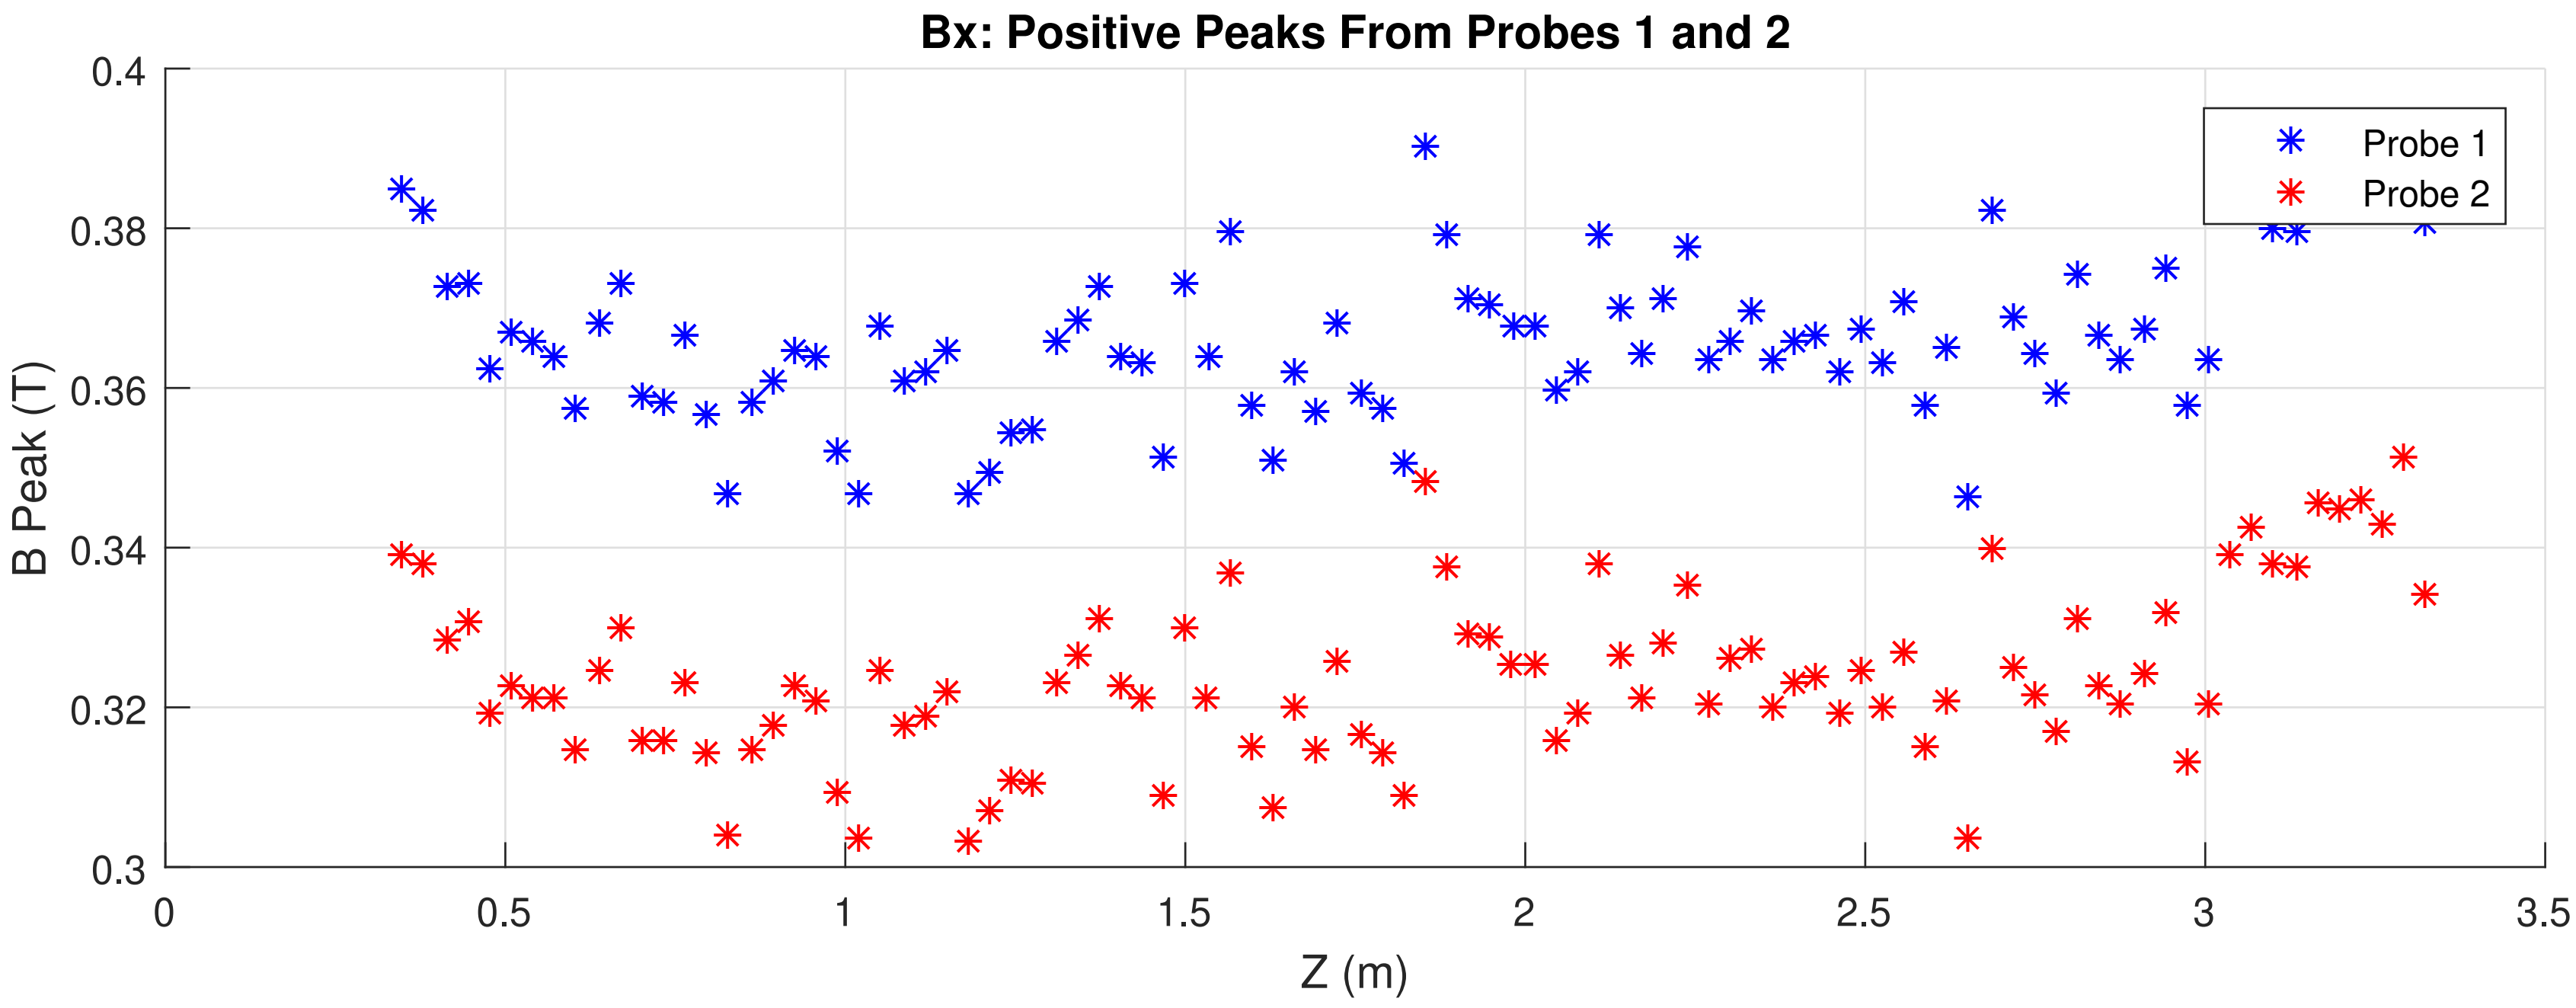
Bx: Positive Peaks From Probes 1 and 2
B Peak (T)
0.4
0.38
0.36
0.34
0.32
0.3
0
0.5
1
1.5
2
2.5
3
3.5
Z (m)
Probe 1
Probe 2

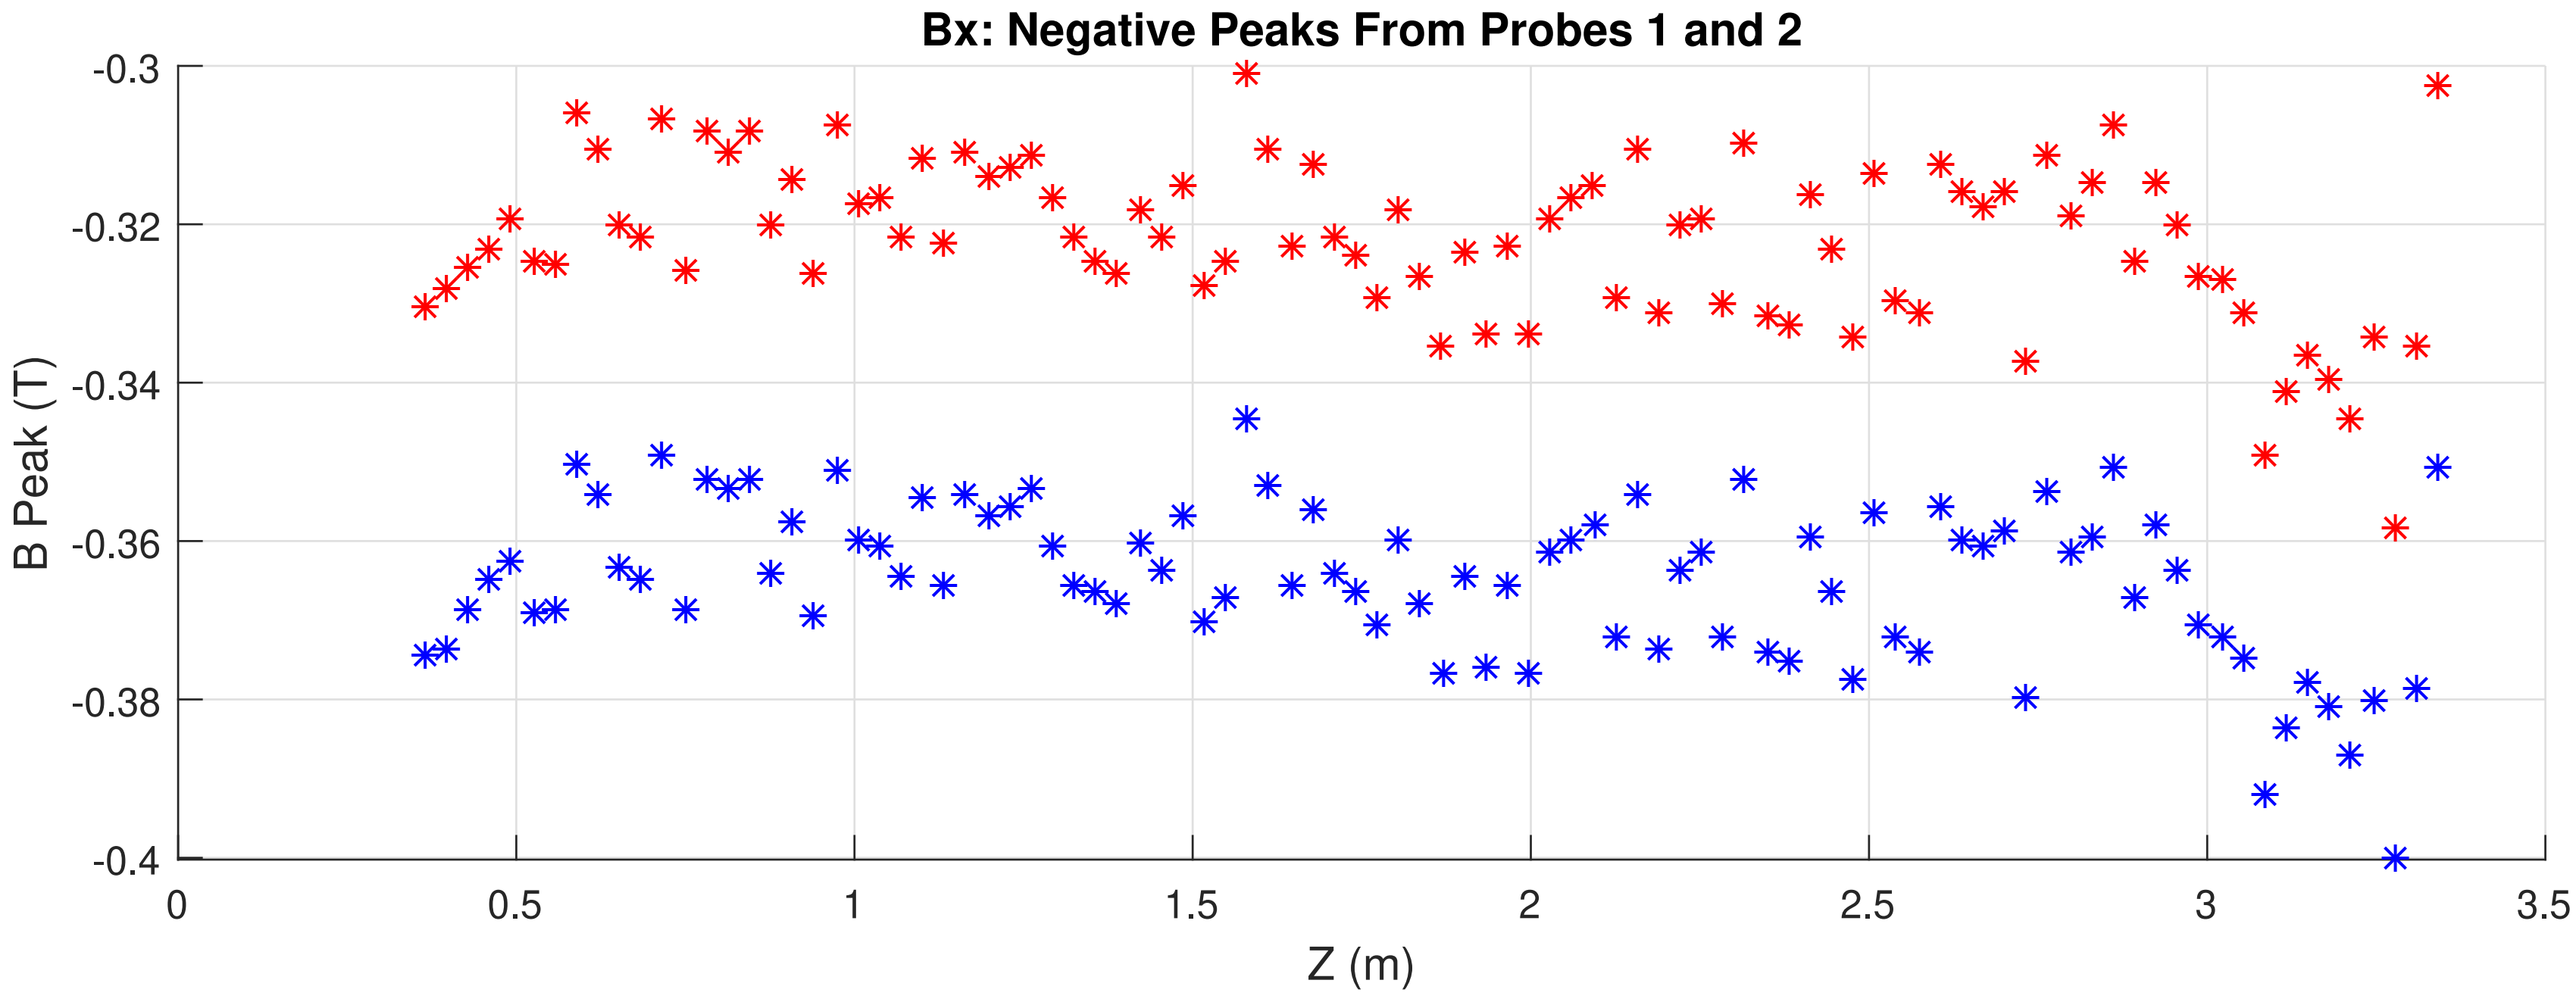
Bx: Negative Peaks From Probes 1 and 2
B Peak (T)
-0.3
-0.32
-0.34
-0.36
-0.38
-0.4
0
0.5
1
1.5
2
2.5
3
3.5
Z (m)

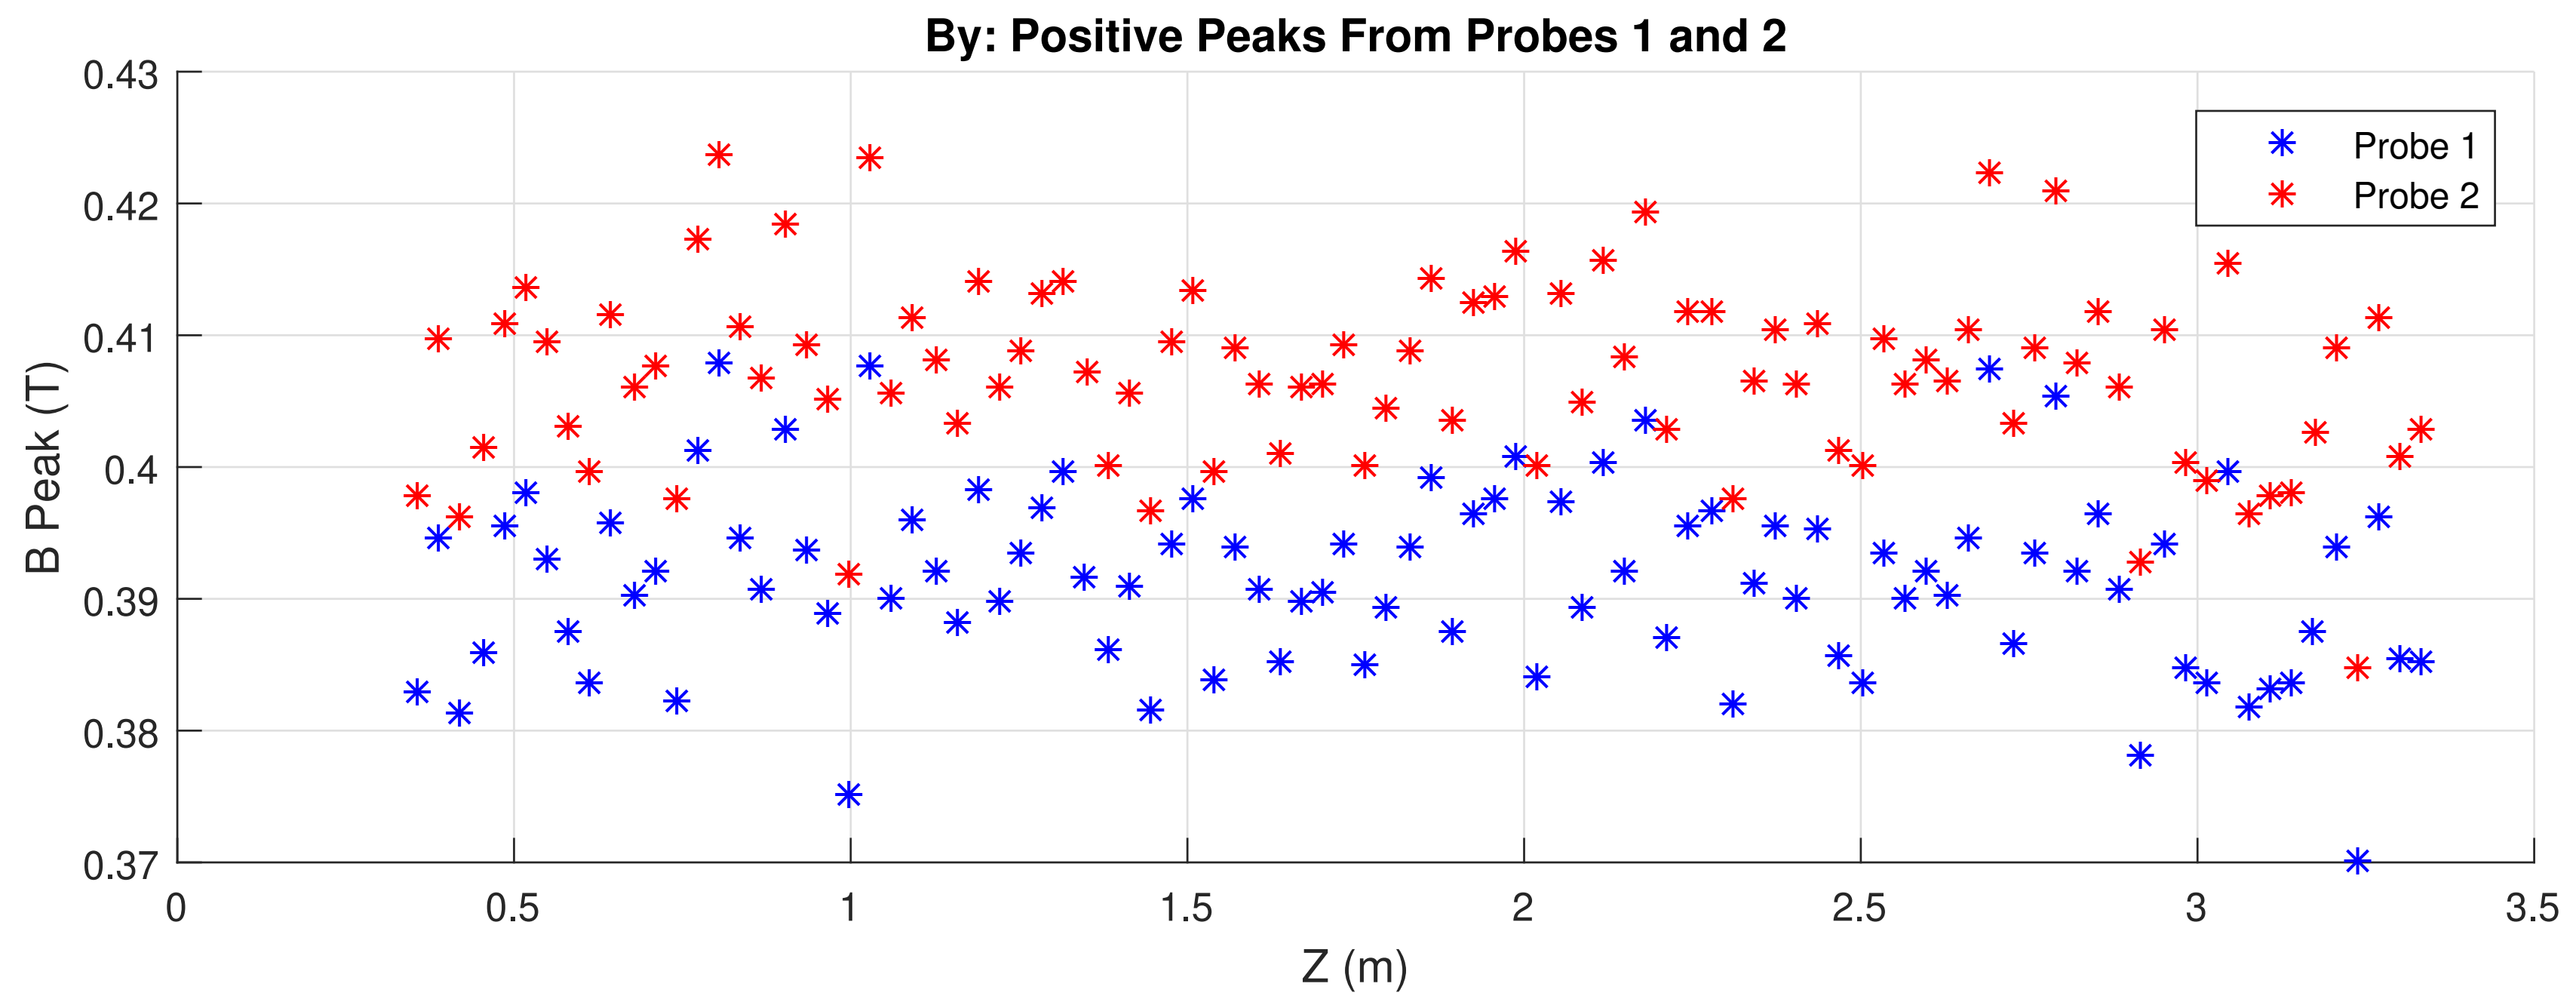
By: Positive Peaks From Probes 1 and 2
B Peak (T)
0.43
0.42
0.41
0.4
0.39
0.38
0.37
0
0.5
1
1.5
2
2.5
3
3.5
Z (m)
Probe 1
Probe 2

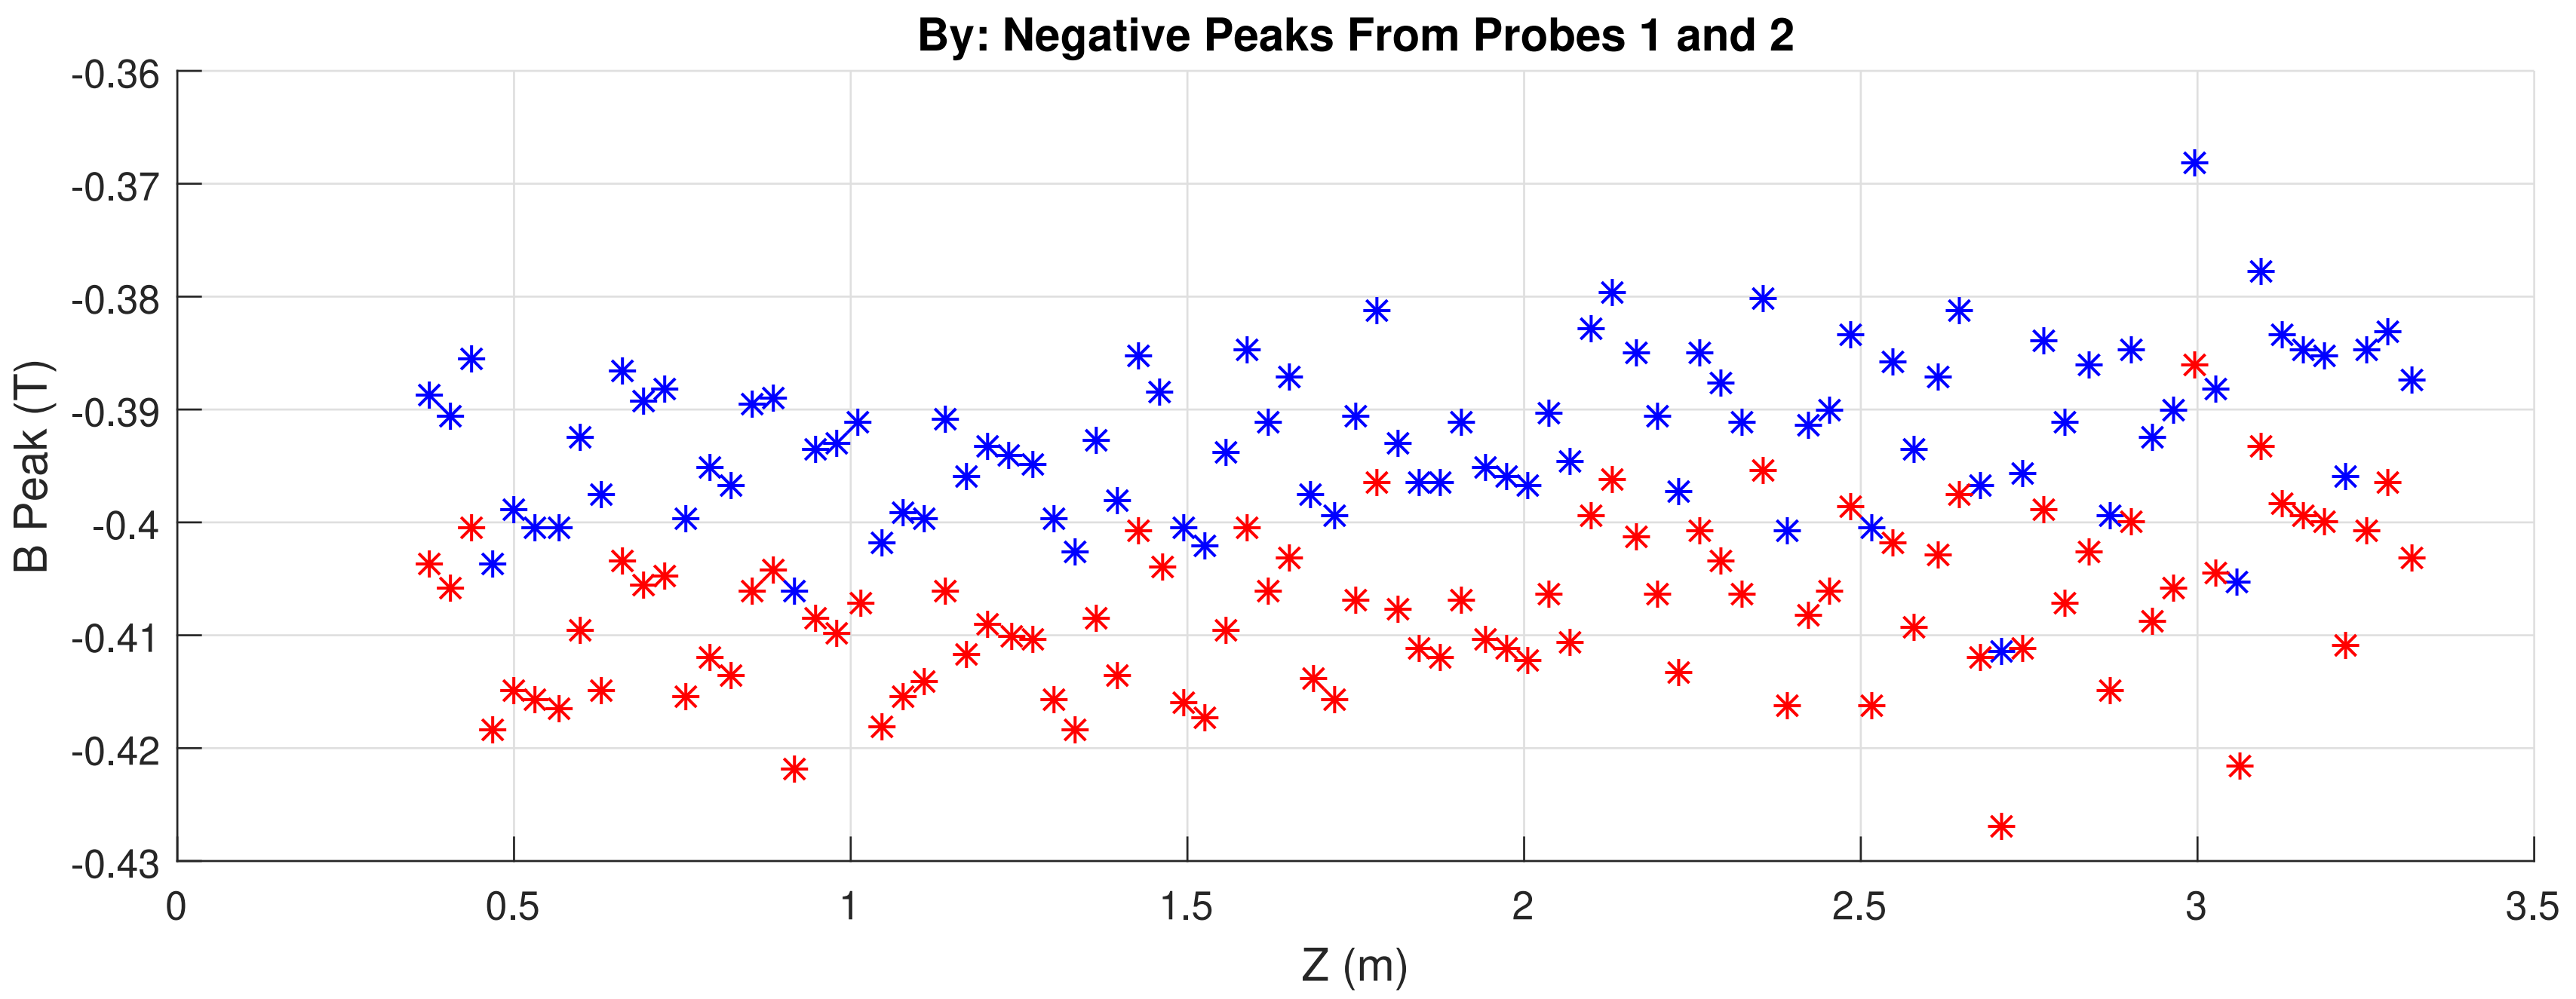
By: Negative Peaks From Probes 1 and 2
B Peak (T)
-0.36
-0.37
-0.38
-0.39
-0.4
-0.41
-0.42
-0.43
0
0.5
1
1.5
2
2.5
3
3.5
Z (m)

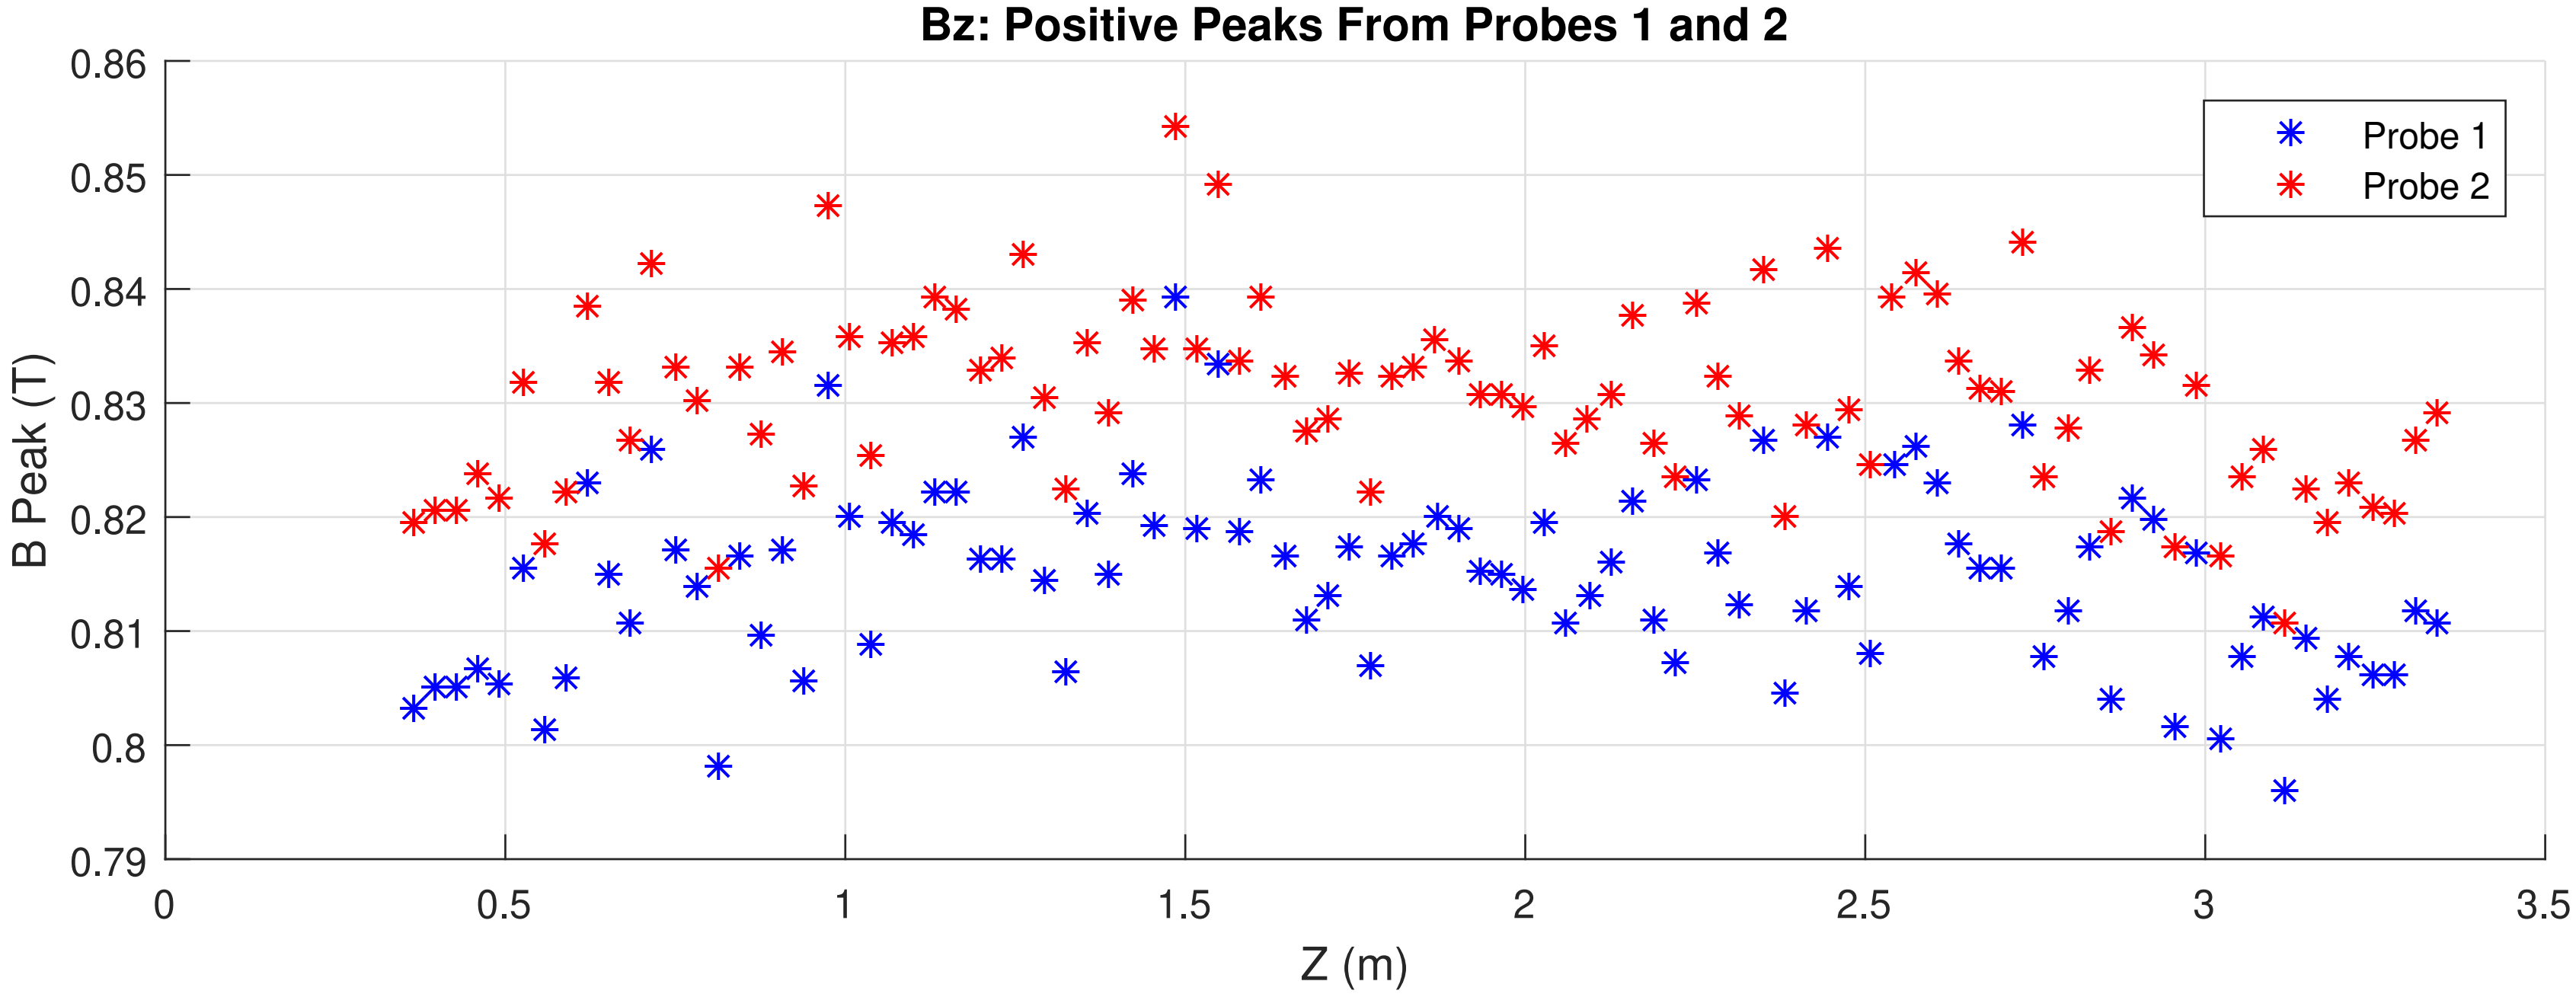
Bz: Positive Peaks From Probes 1 and 2
B Peak (T)
0.86
0.85
0.84
0.83
0.82
0.81
0.8
0.79
Z (m)
0
0.5
1
1.5
2
2.5
3
3.5
Probe 1
Probe 2

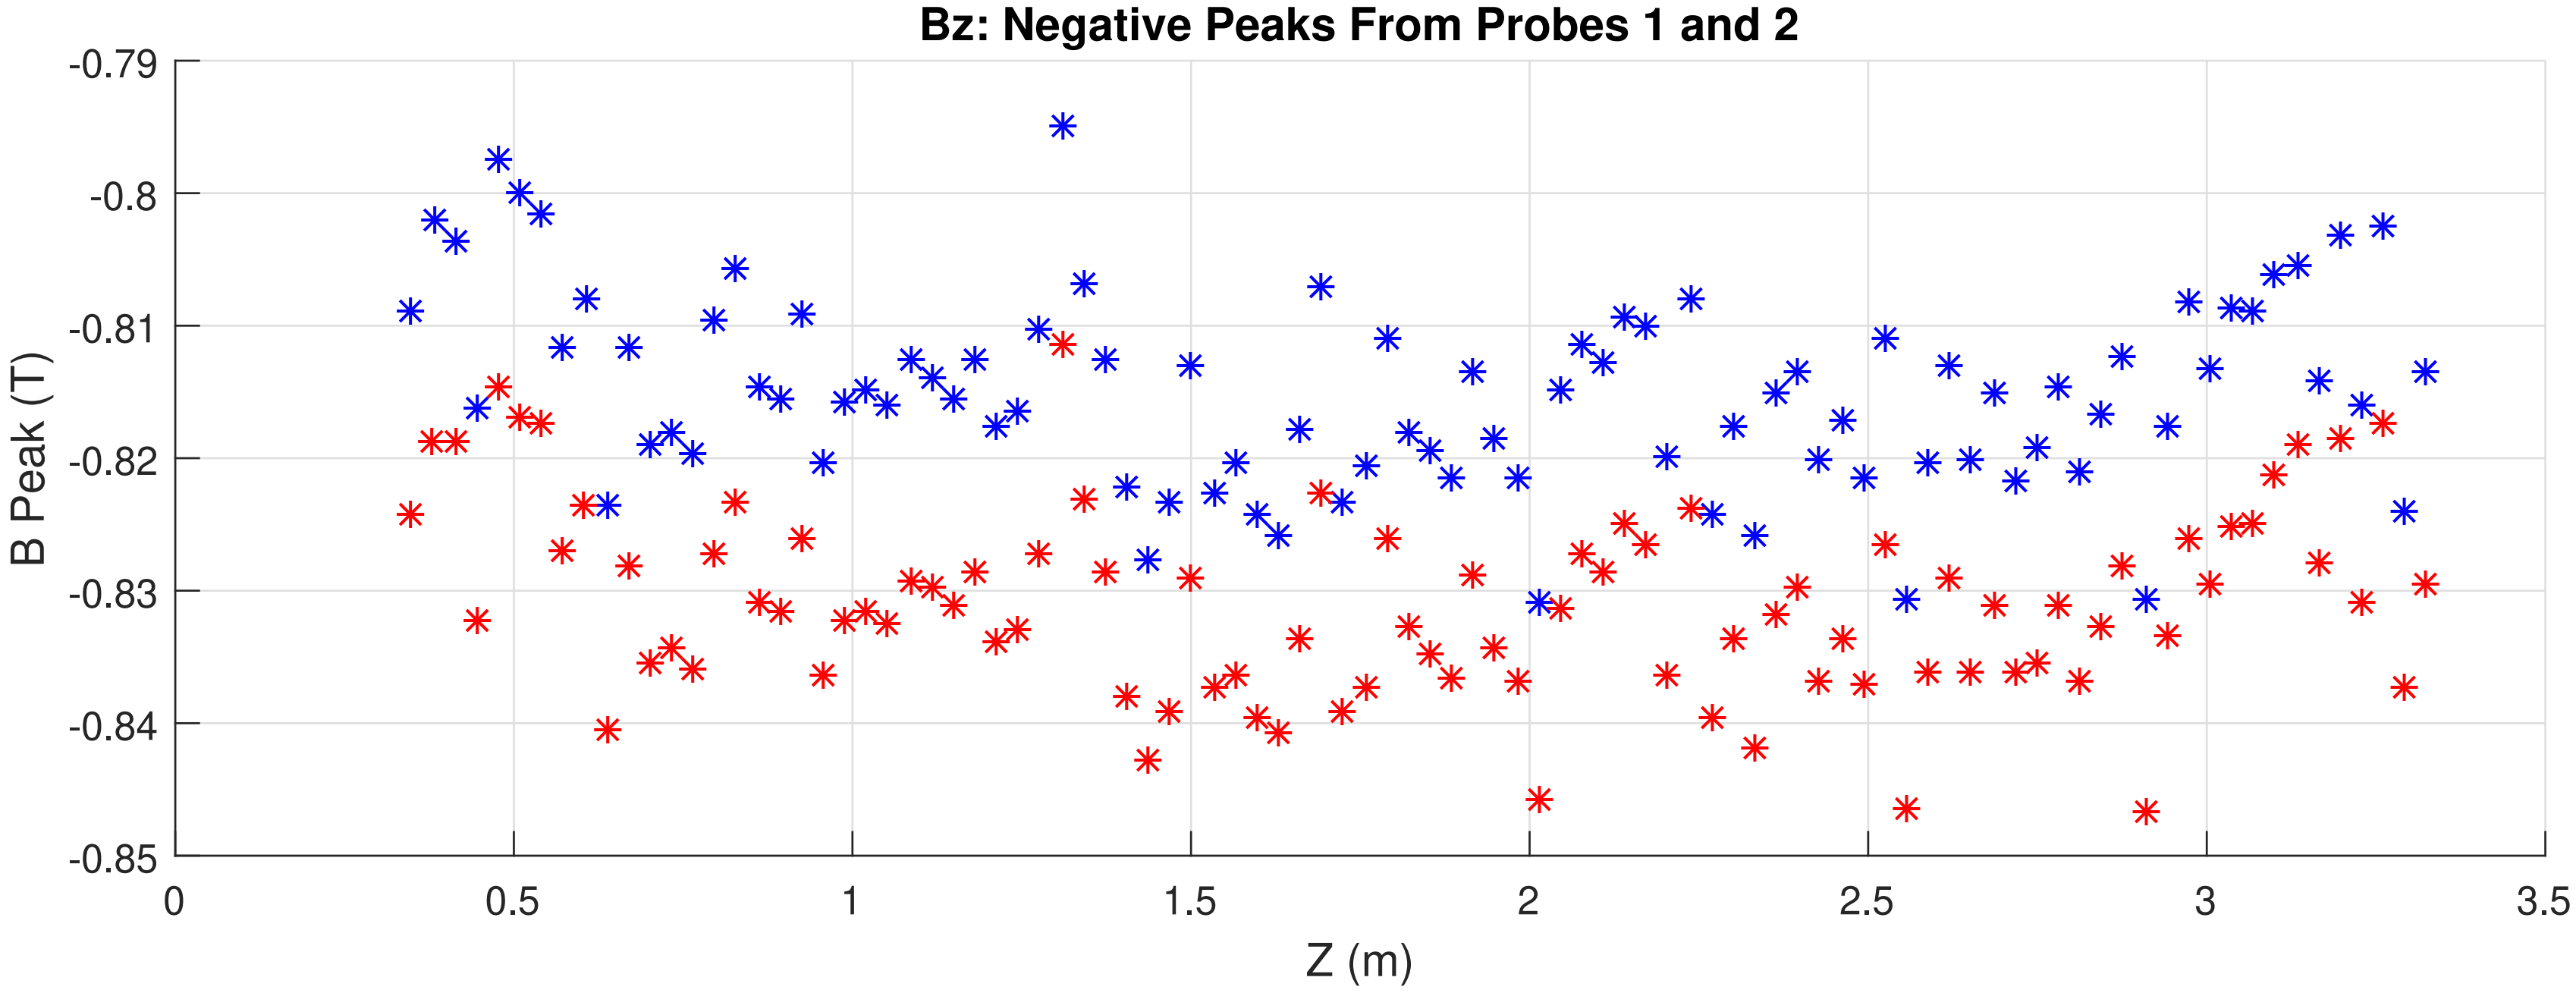
Bz: Negative Peaks From Probes 1 and 2
B Peak (T)
-0.79
-0.8
-0.81
-0.82
-0.83
-0.84
-0.85
Z (m)
0
0.5
1
1.5
2
2.5
3
3.5