SLAC Magnetic Measurements

Trajectory Analysis
−−−−−−−−−−−−−−−−−−

Parameters:
INPUT−FILE−DIR =S:\MagData\LCLS\Undulator\A1−ANL\DATASET0001\Rough Tuning\Z Scans\Run 037\
INPUT−FILE−NAME =x+00000−y+000−bscanz.dat
INPUT−FILE−TYPE =ZVXYBXYH
CORR−REQUIRED =0
GAMMA =26627.1
DEVICE CENTER POSITION ZM =2.1492 m
DEVICE ENTRANCE POSITION ZM =0.9685 m
DEVICE EXIT POSITION ZM =3.3299 m
NOM−LAMBDA−R =1.5e−010 m

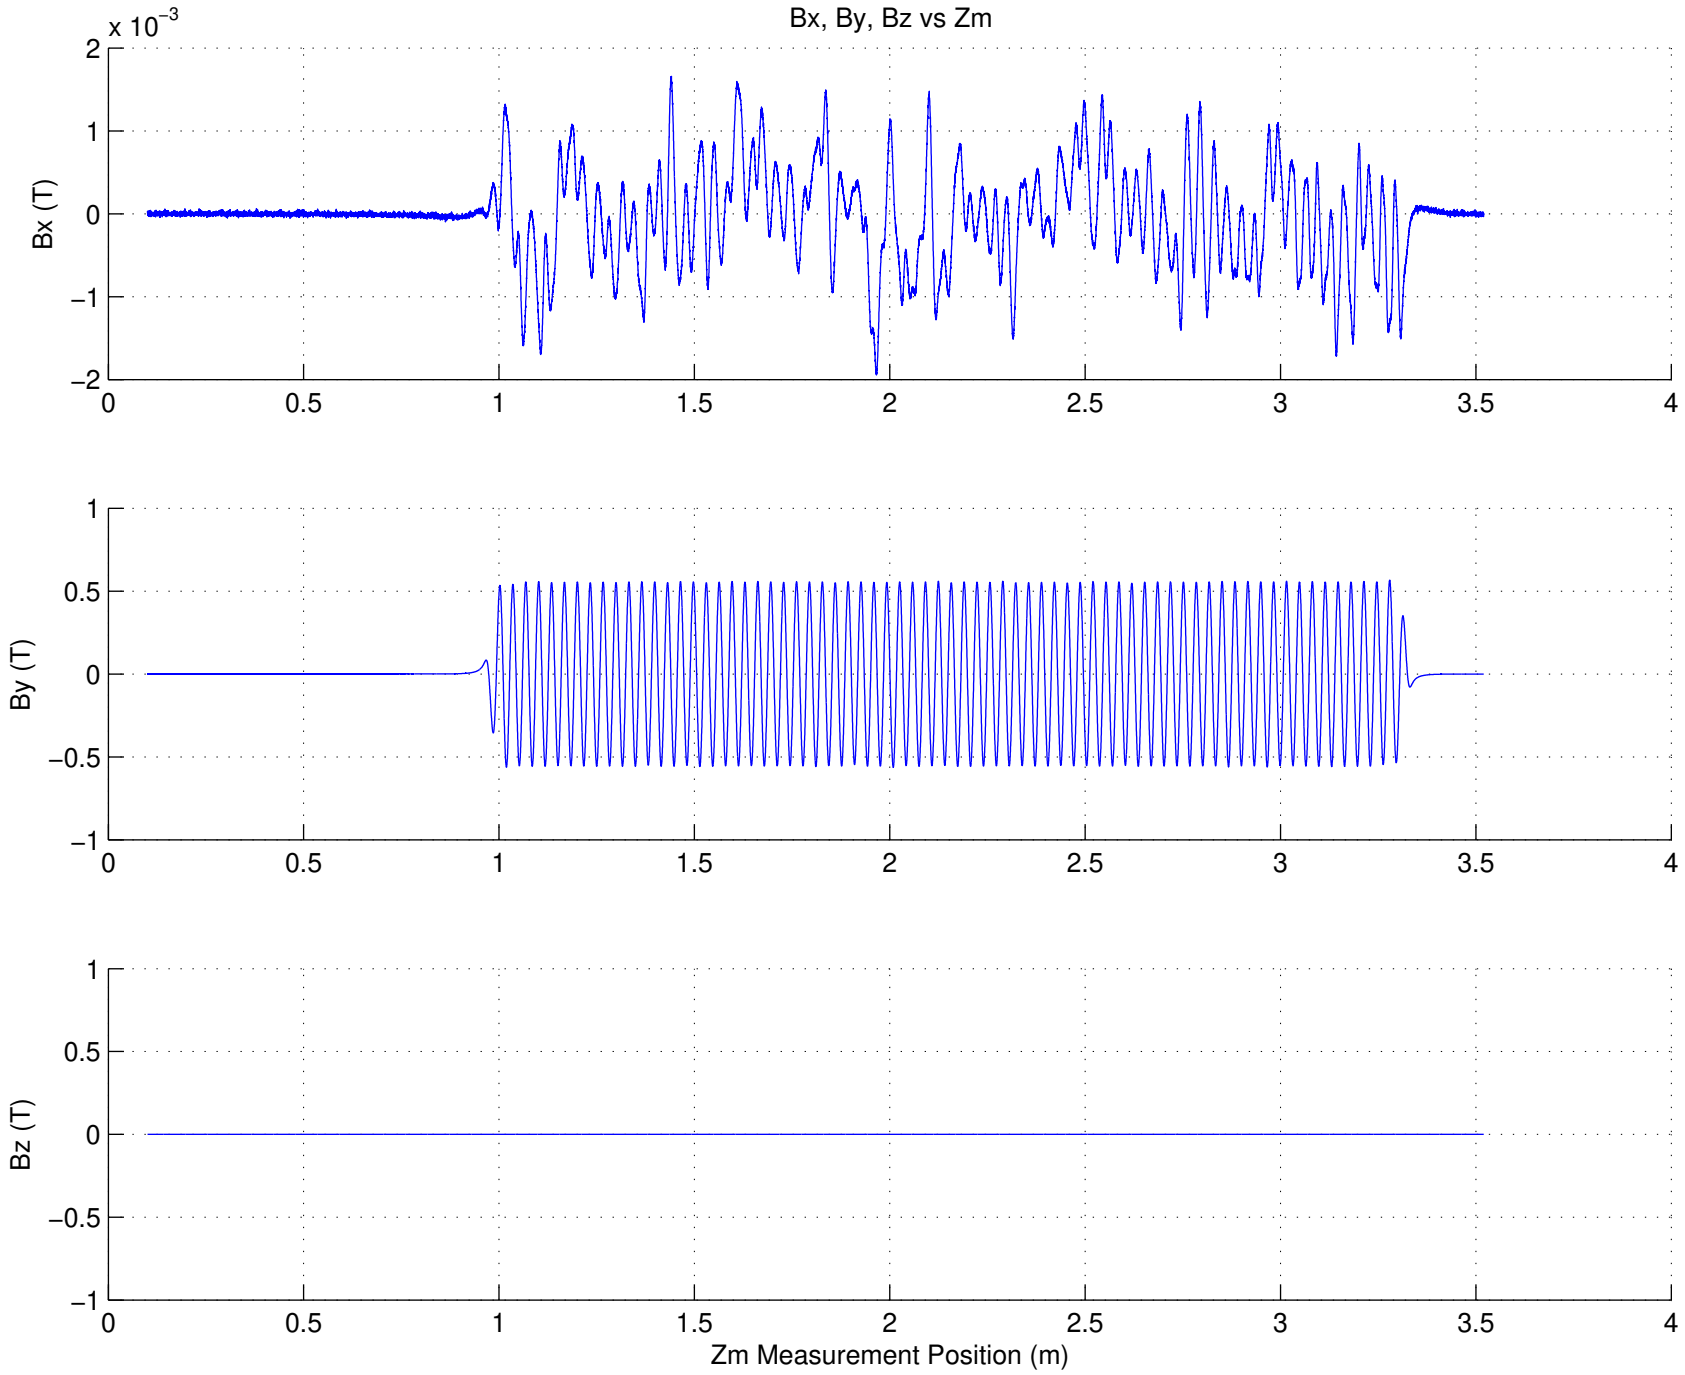
Bx, By, Bz vs Zm
x 10^-3
Bx (T)
By (T)
Bz (T)
Zm Measurement Position (m)
2
1
0
−1
−2
0.5
1.5
2.5
3
3.5
4

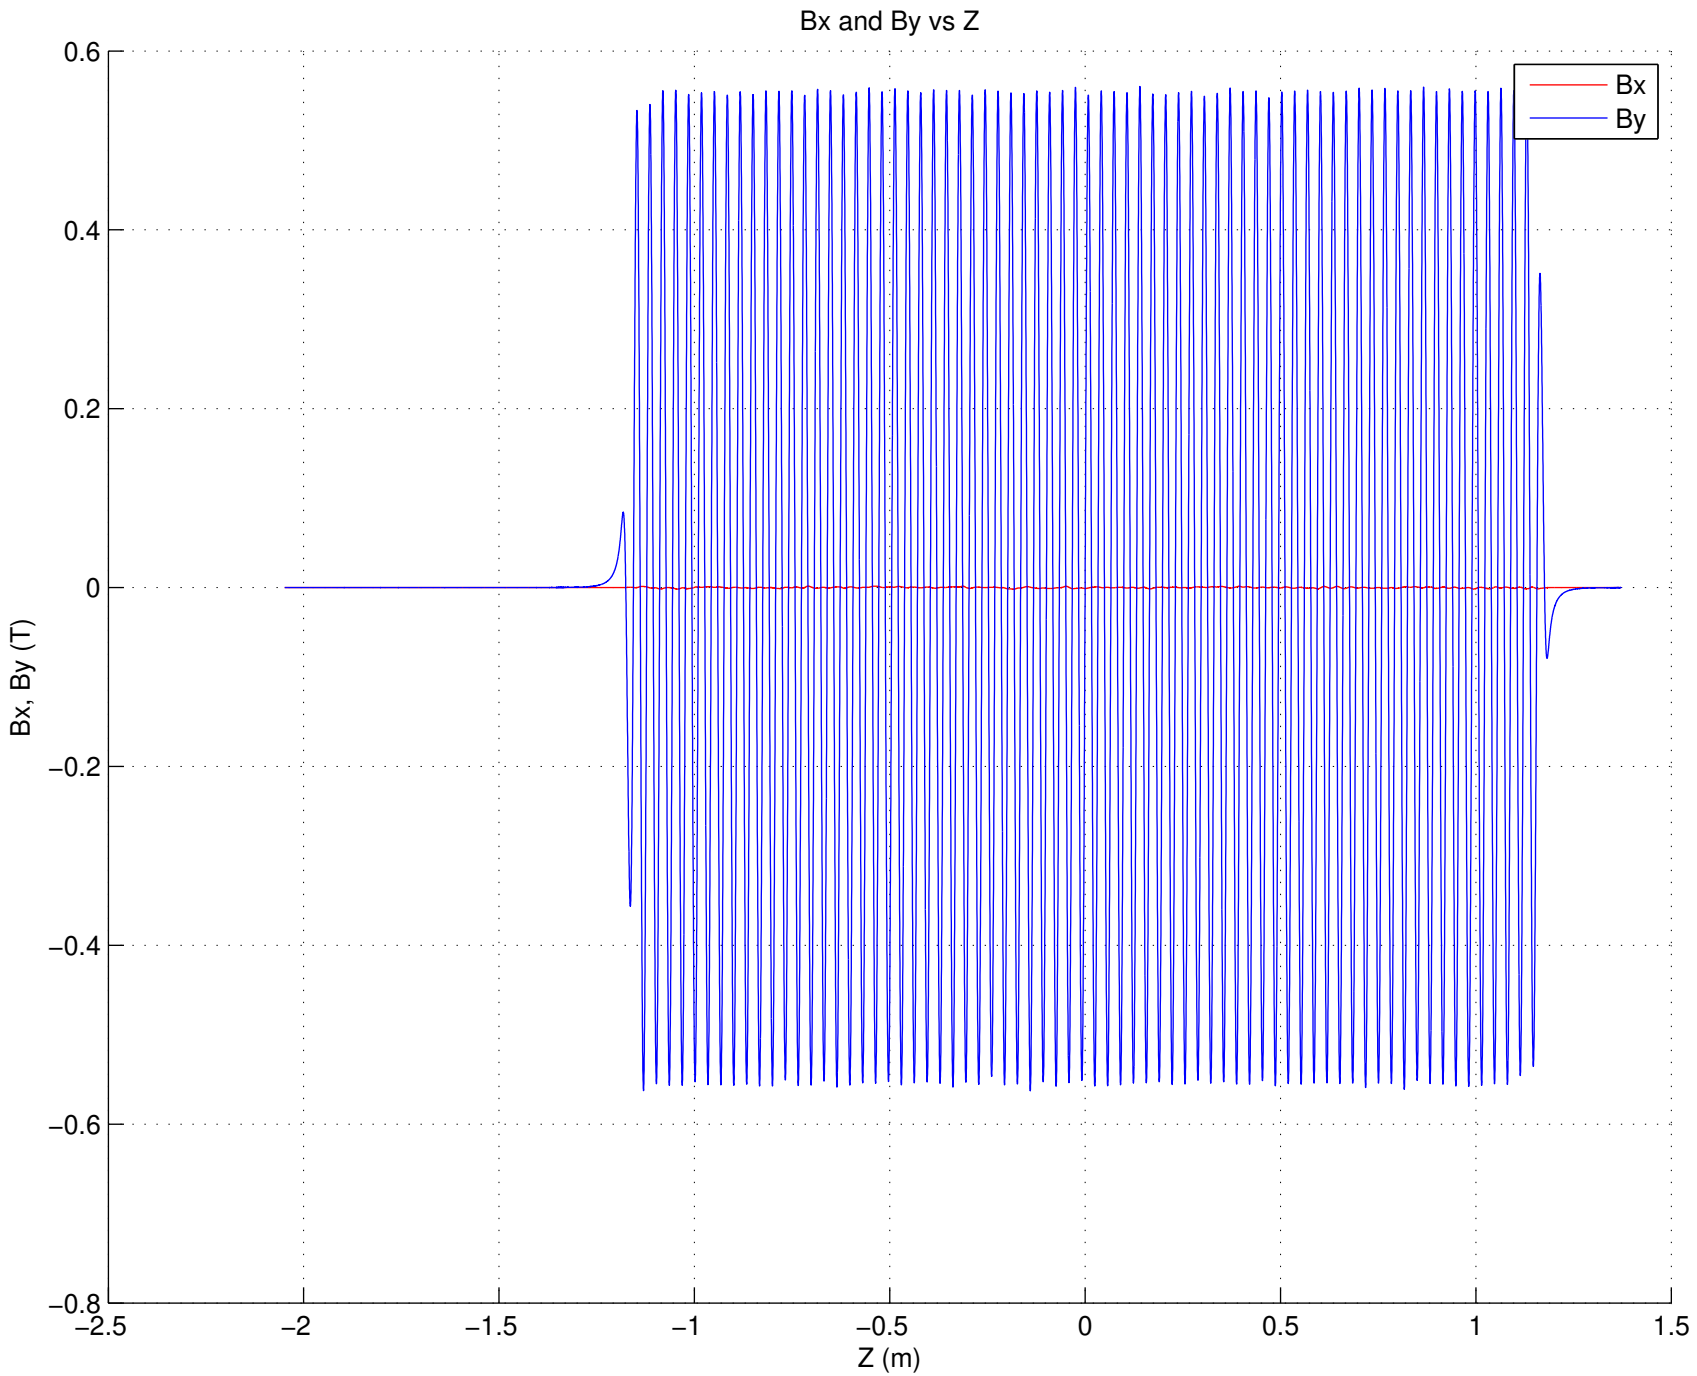
Bx and By vs Z
Bx
By
Bx, By (T)
Z (m)
0.6
0.4
0.2
0
−0.2
−0.4
−0.6
−0.8
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5

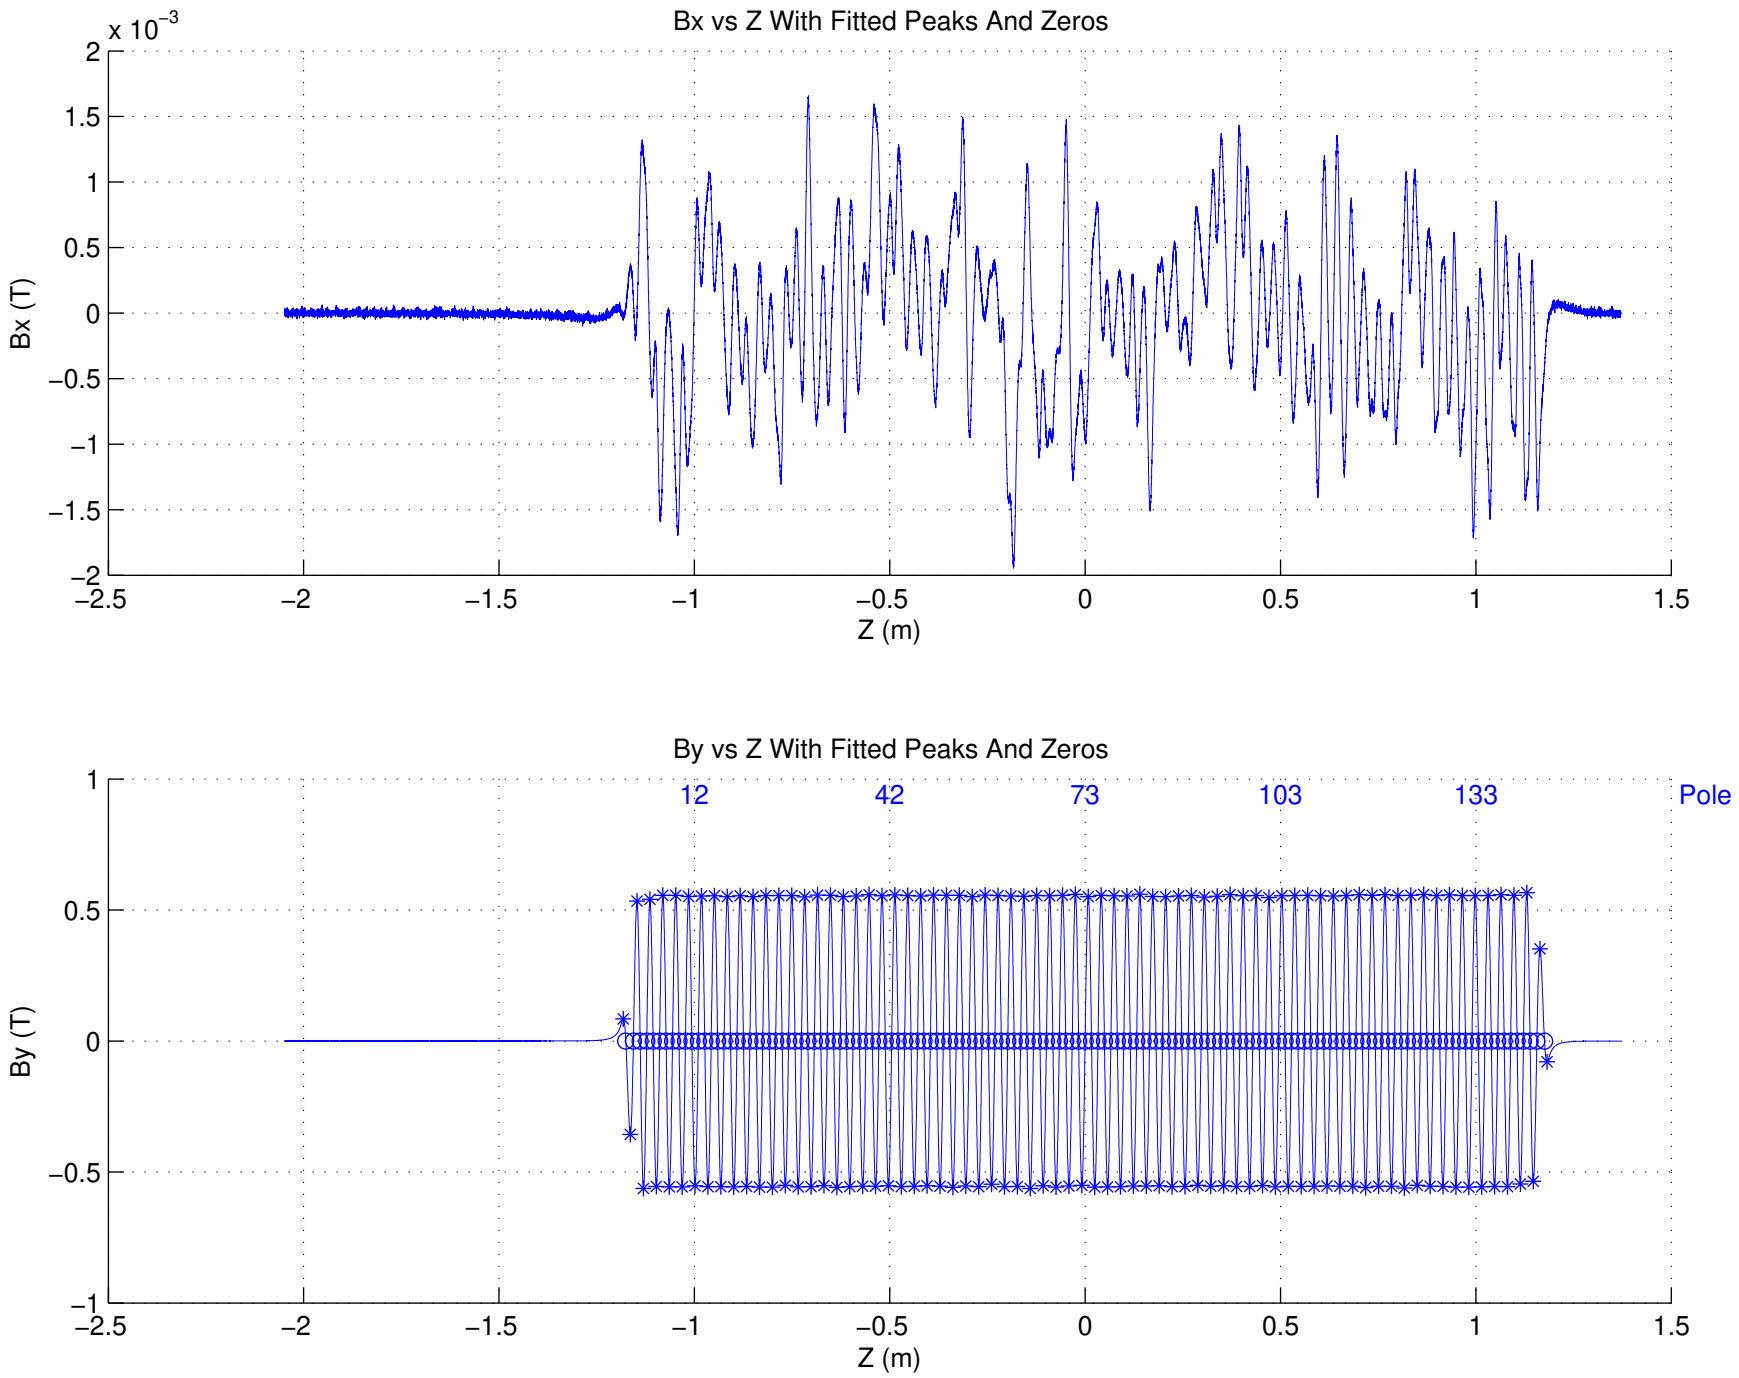
Bx vs Z With Fitted Peaks And Zeros
x 10^-3
Bx (T)
Z (m)
By vs Z With Fitted Peaks And Zeros
By (T)
Z (m)
12
42
73
103
133
Pole

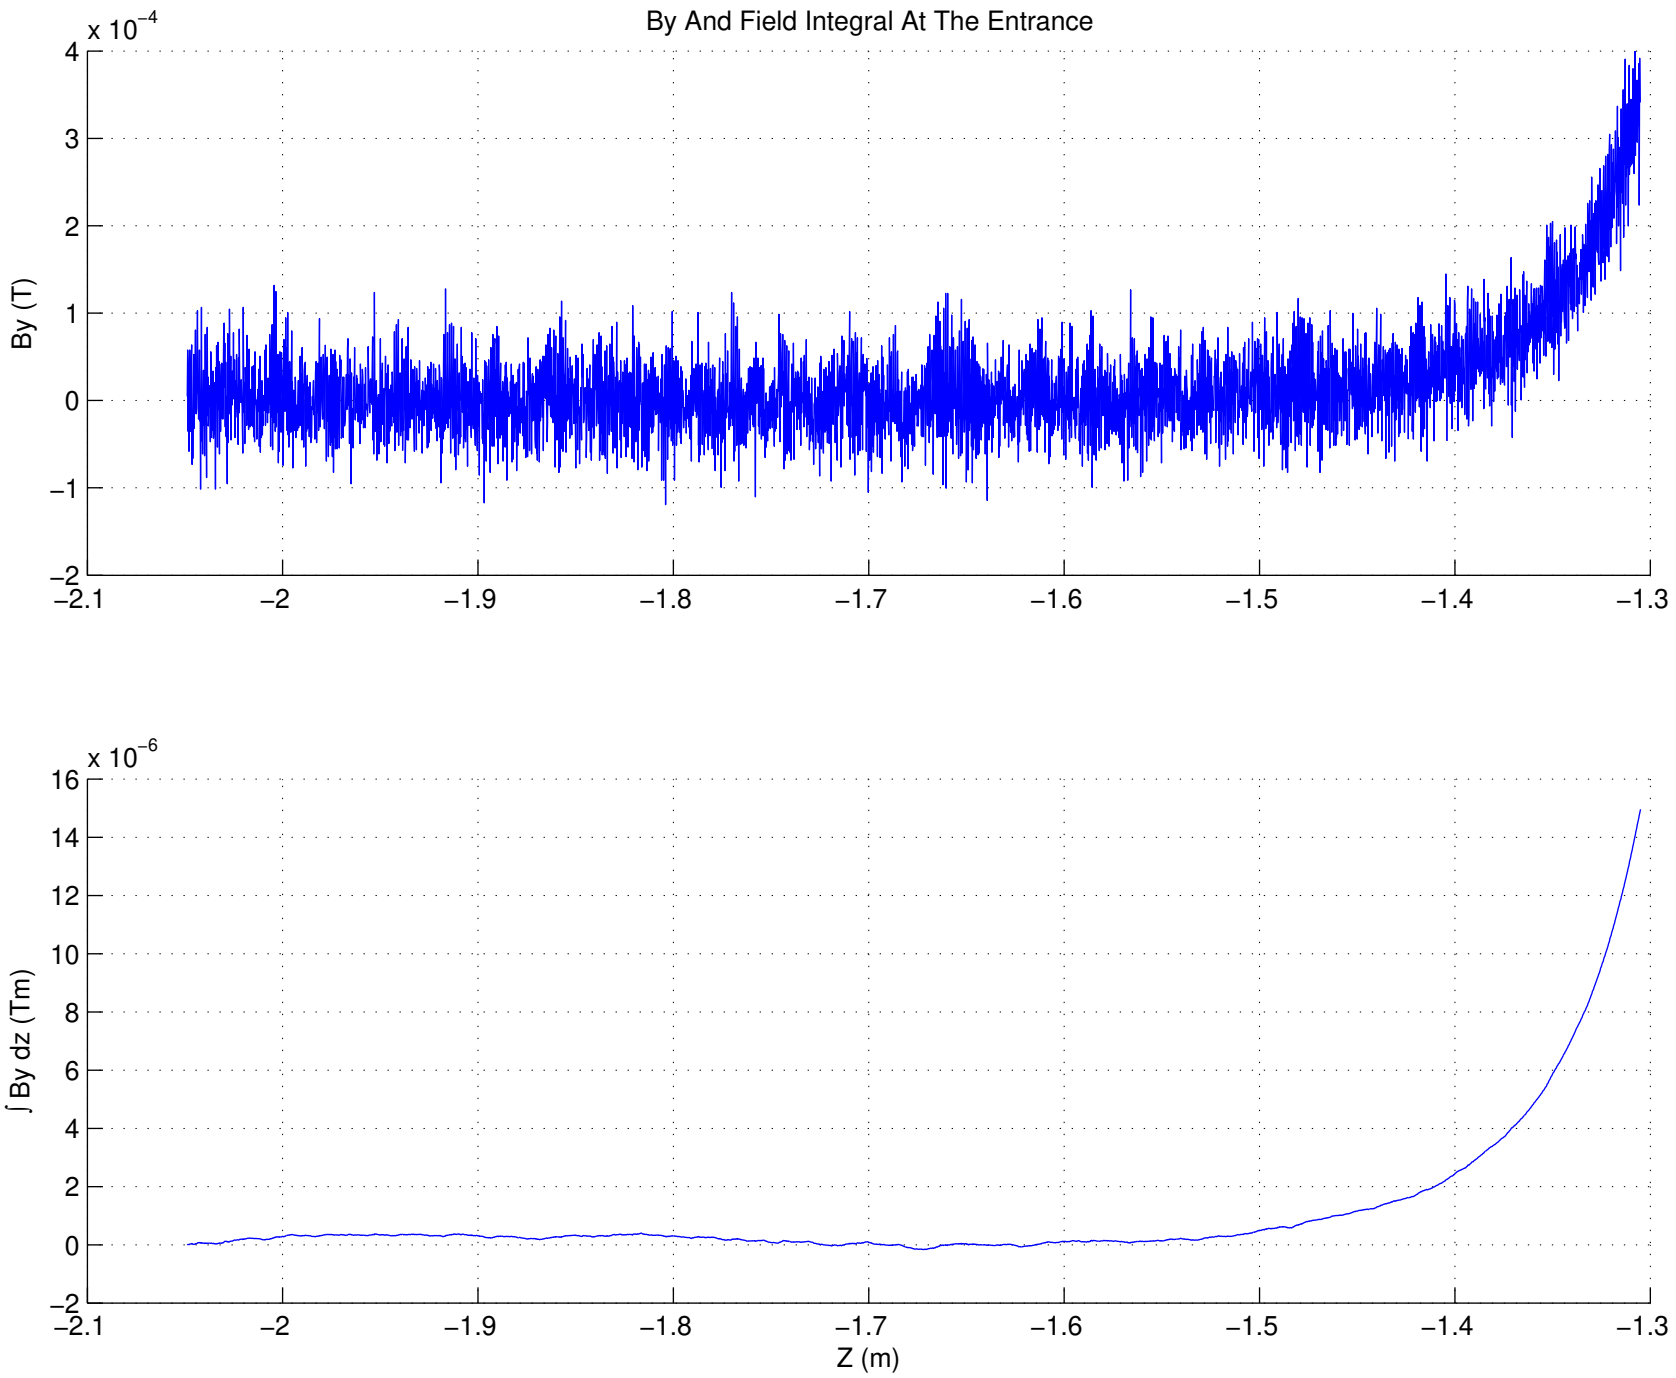
By And Field Integral At The Entrance
x 10^-4
By (T)
4
3
2
1
0
−1
−2
−2.1
−2
−1.9
−1.8
−1.7
−1.6
−1.5
−1.4
−1.3
x 10^-6
∫ By dz (Tm)
16
14
12
10
8
6
4
2
0
−2
Z (m)

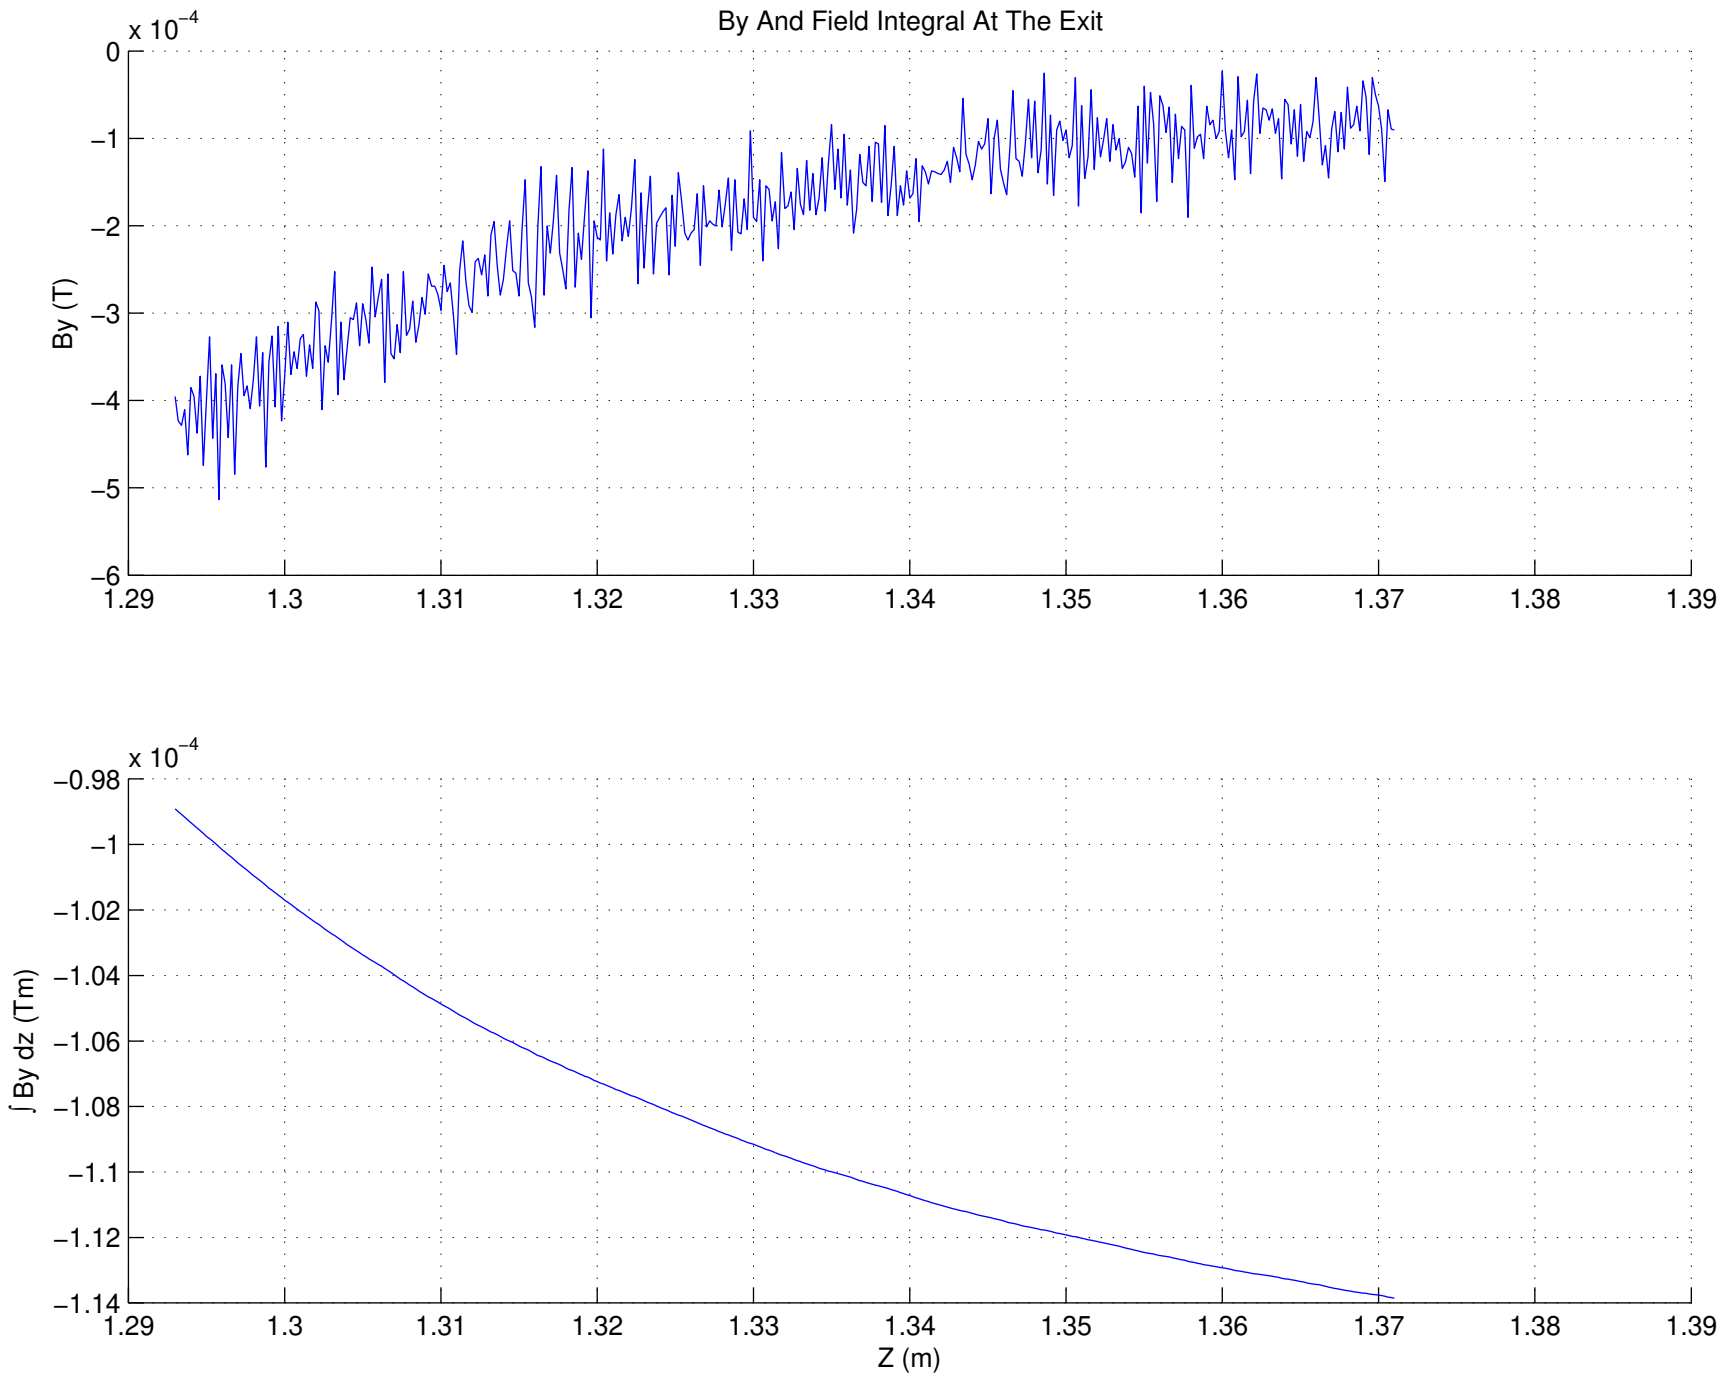
By And Field Integral At The Exit
x 10^-4
0
−1
−2
−3
−4
−5
−6
By (T)
1.29
1.3
1.31
1.32
1.33
1.34
1.35
1.36
1.37
1.38
1.39
x 10^-4
−0.98
−1
−1.02
−1.04
−1.06
−1.08
−1.1
−1.12
−1.14
∫ By dz (Tm)
Z (m)

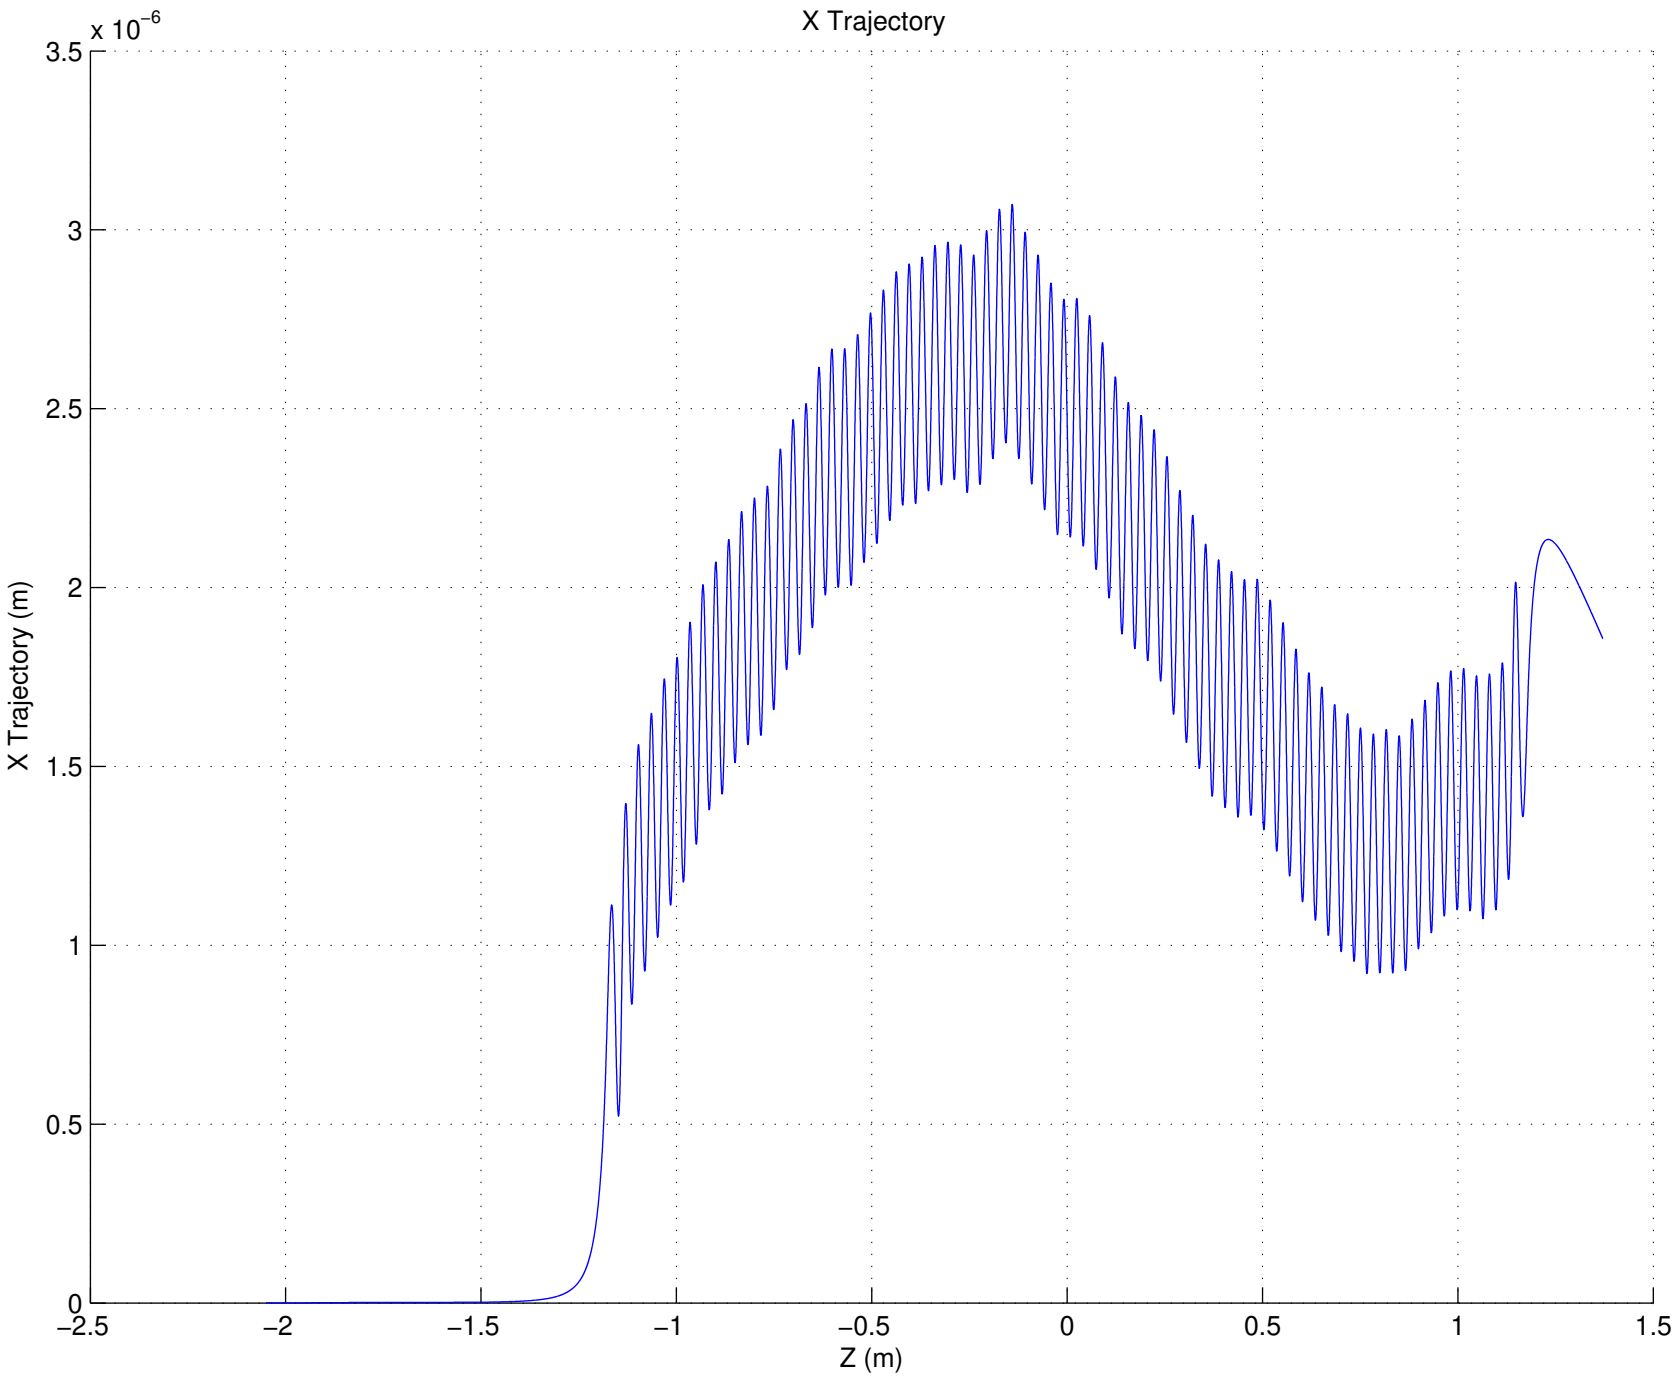
X Trajectory
x 10^-6
3.5
3
2.5
2
1.5
1
0.5
0
X Trajectory (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
Z (m)

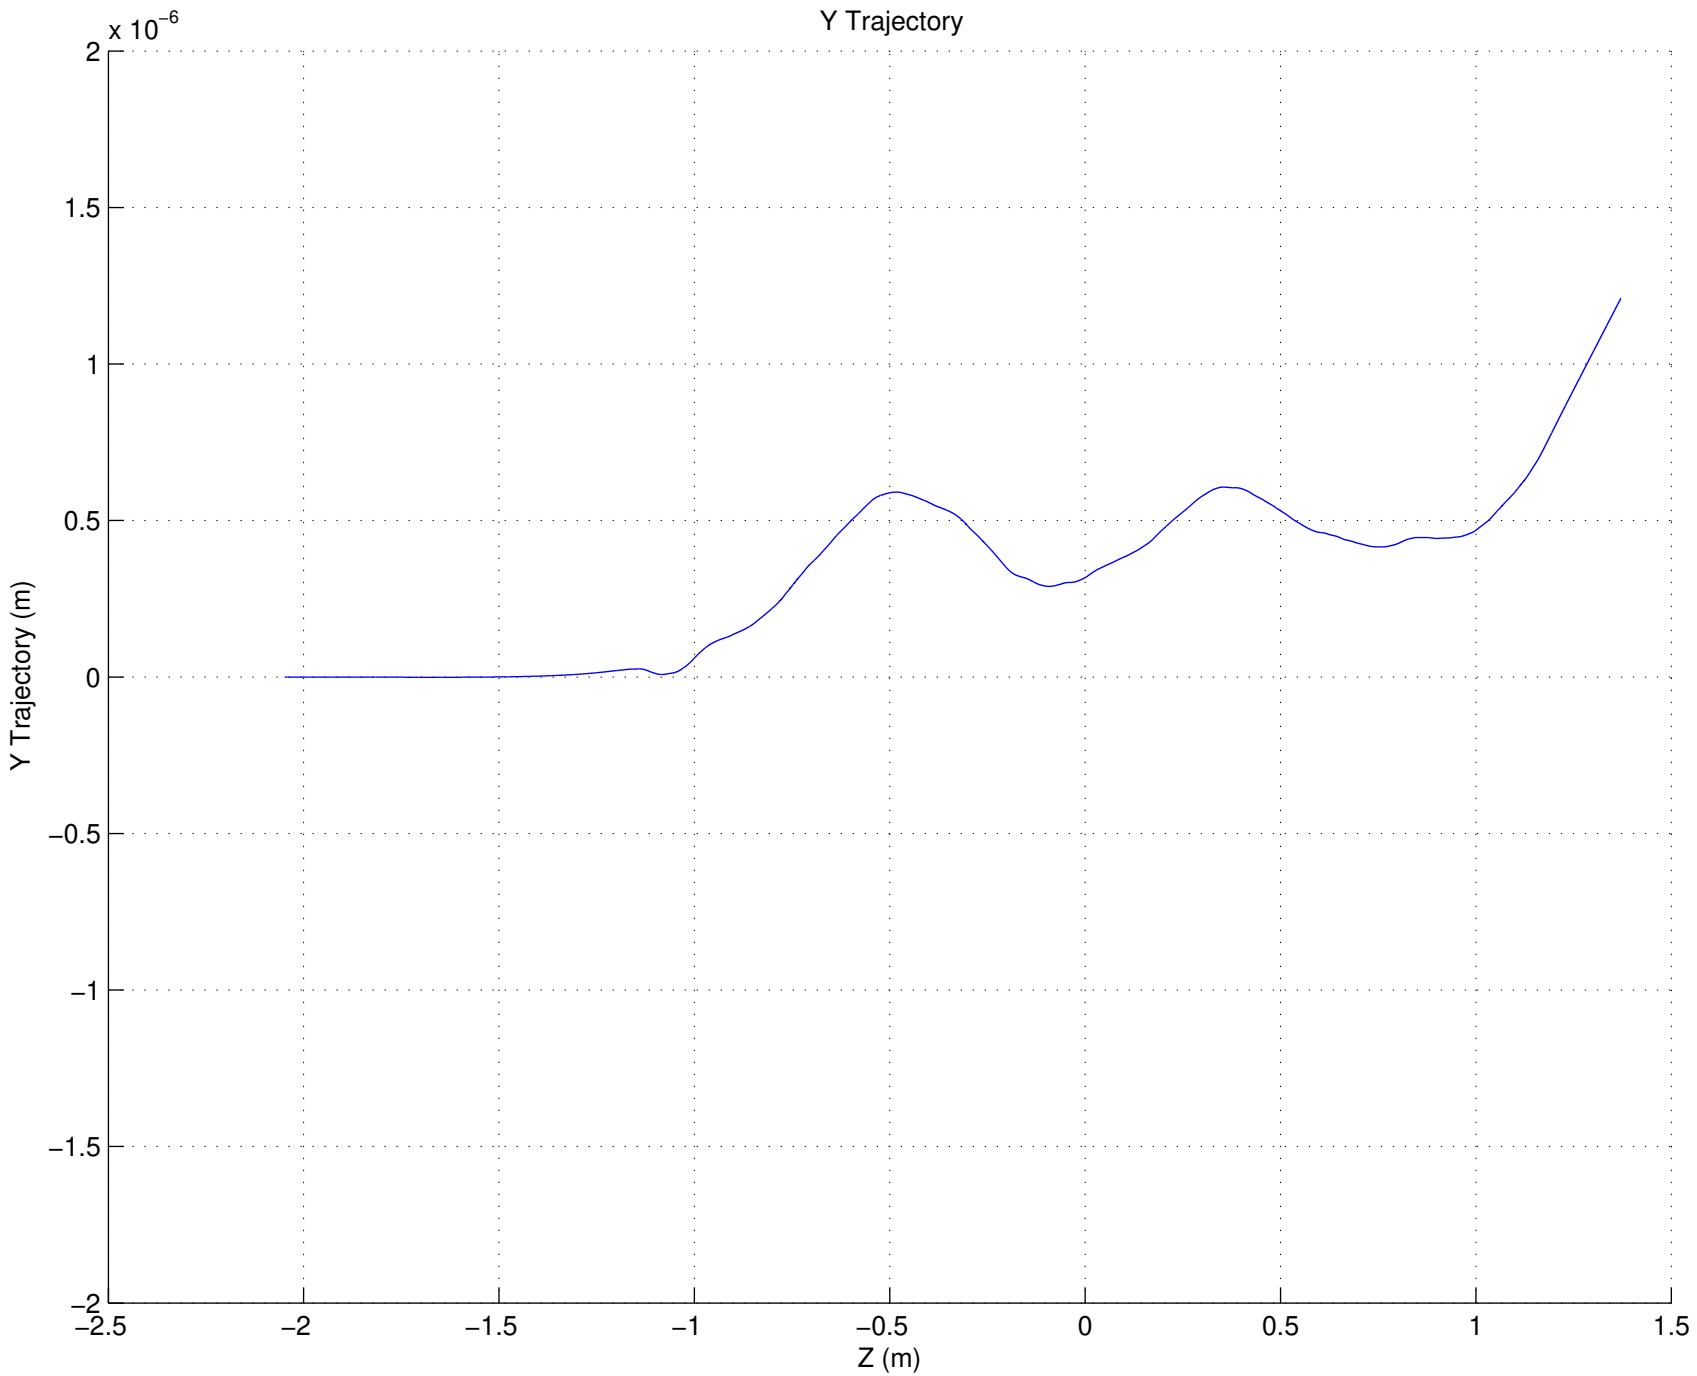
Y Trajectory
x 10^-6
2
1.5
1
0.5
0
−0.5
−1
−1.5
−2
Y Trajectory (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
Z (m)

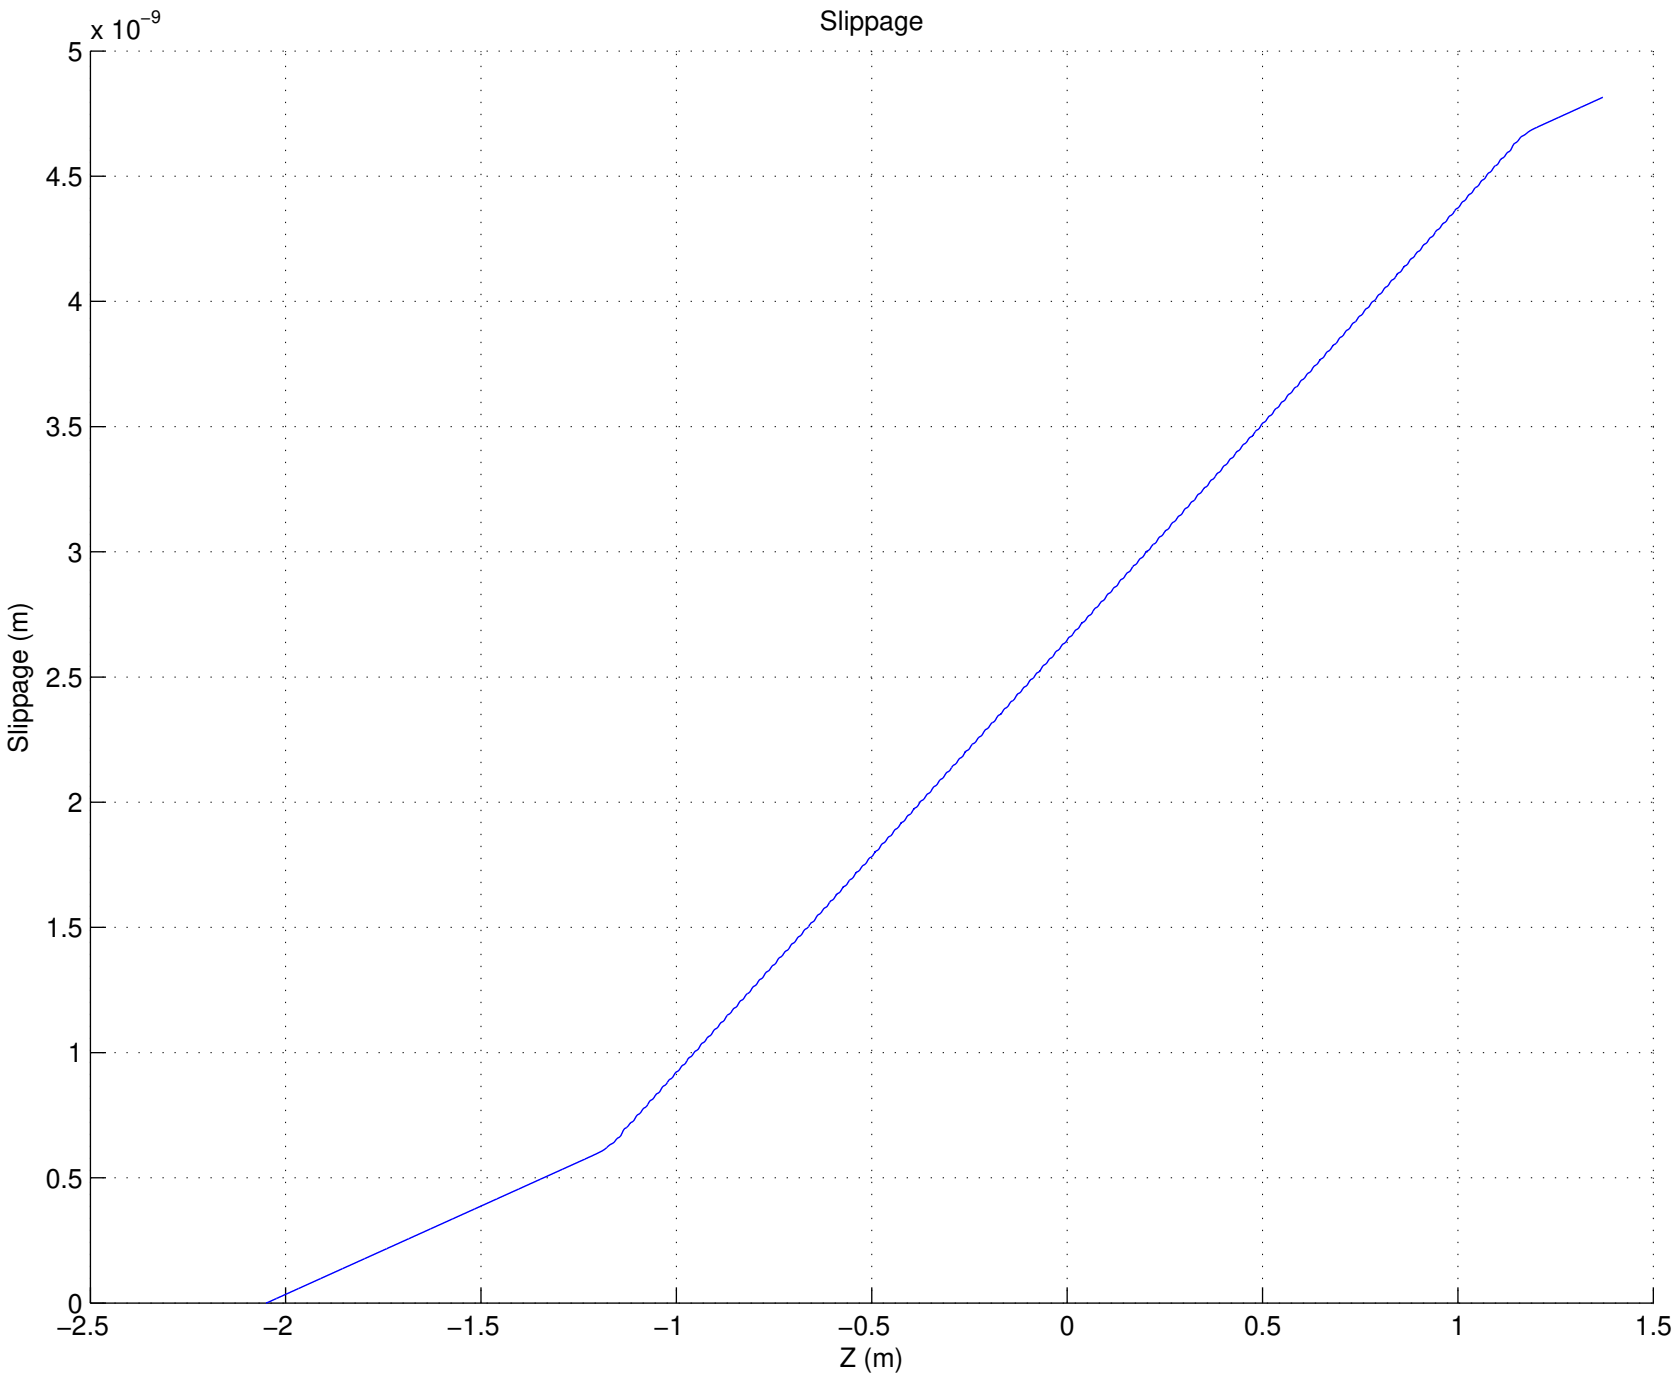
Slippage
x 10^-9
Slippage (m)
Z (m)
5
4.5
4
3.5
3
2.5
2
1.5
1
0.5
0
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5

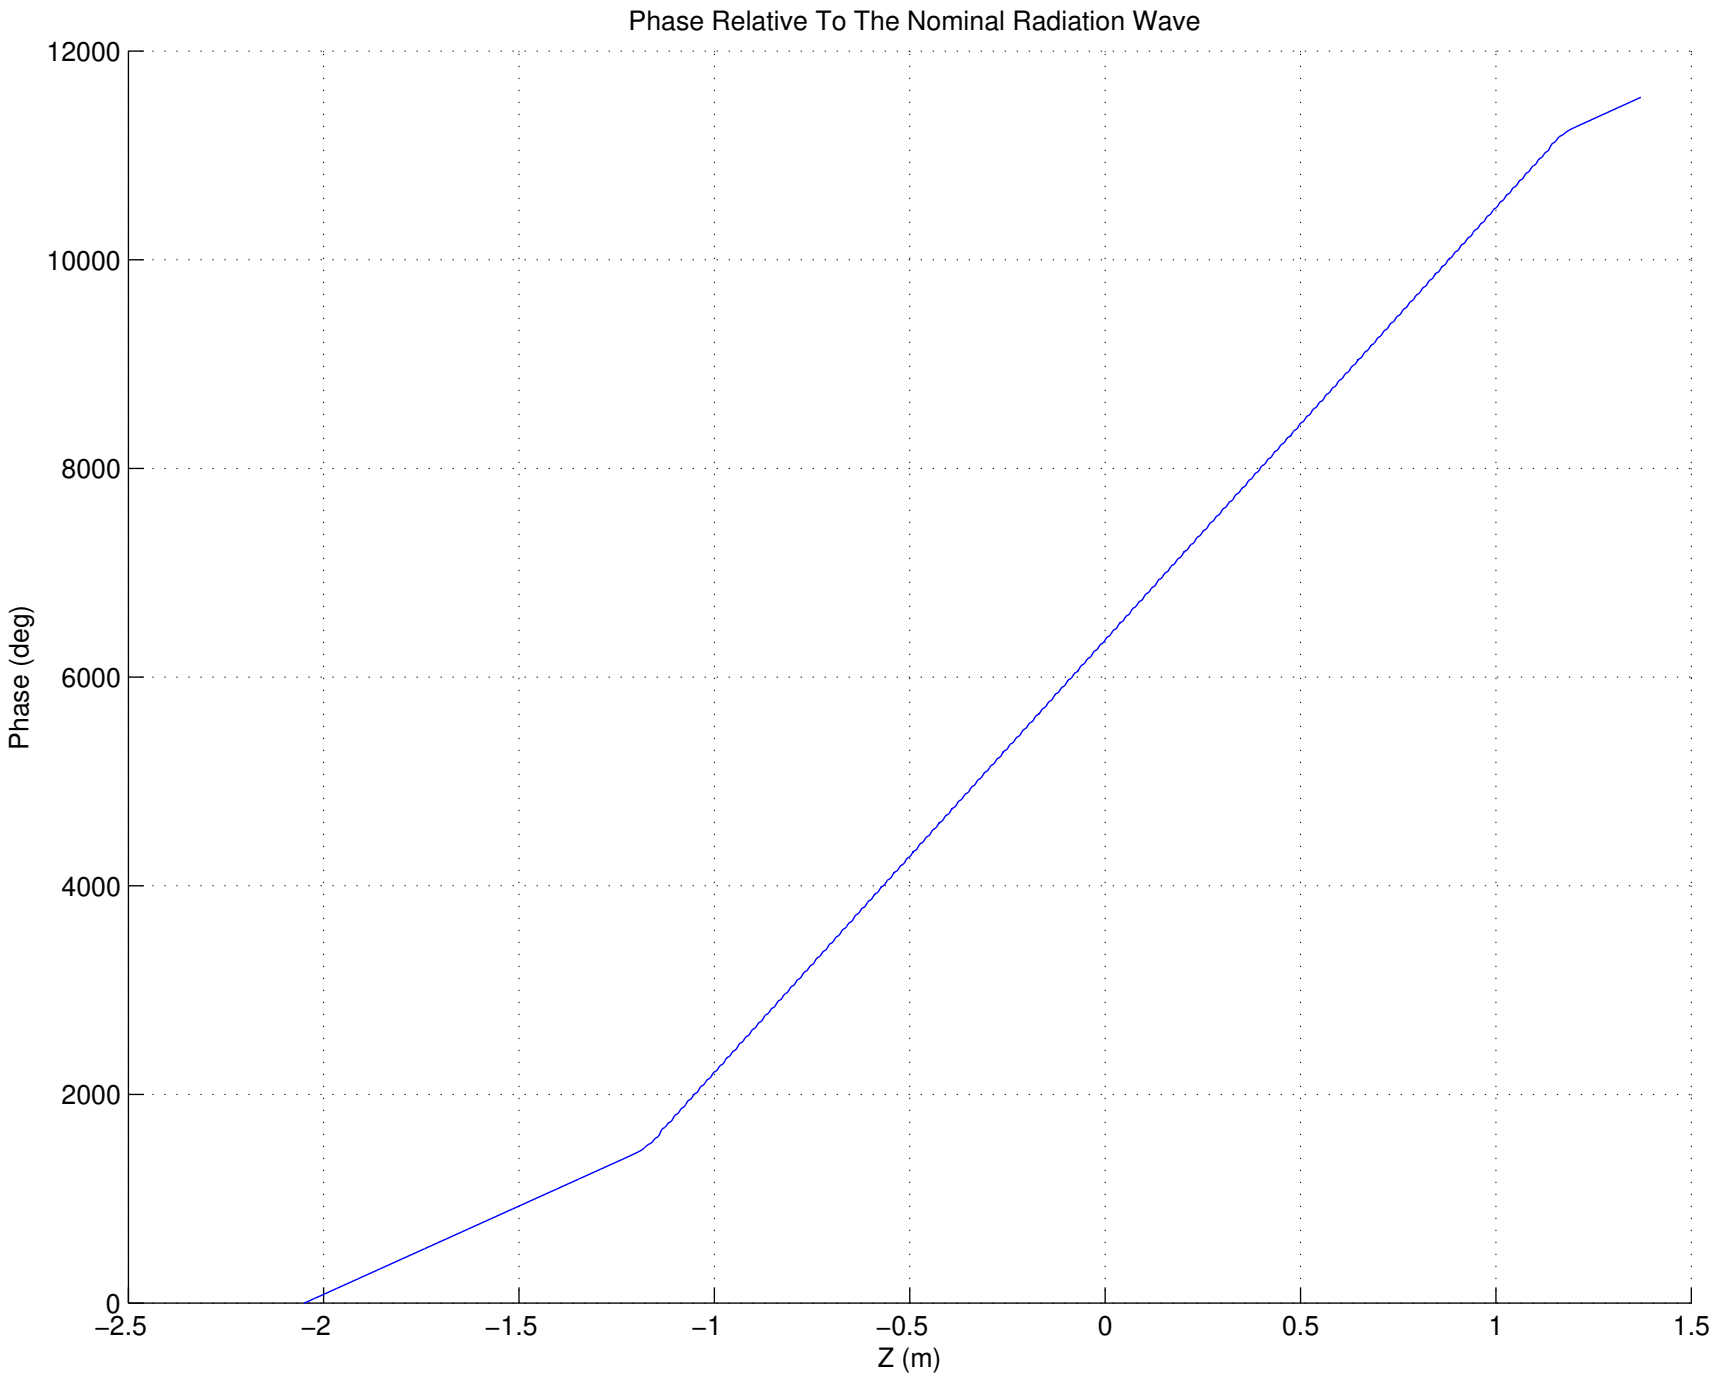
Phase Relative To The Nominal Radiation Wave
12000
10000
8000
6000
4000
2000
0
Phase (deg)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
Z (m)