SLAC Magnetic Measurements

EPU Analysis
−−−−−−−−−−−

Parameters:
INPUT−FILE−DIR =S:\MagData\LCLS\Undulator\A1−ANL\DATASET0001\Rough Tuning\Z Scans\Run 038\
INPUT−FILE−NAME =x+00000−y+000−bscanz.dat
INPUT−FILE−TYPE =ZVXYBXYH
CORR−REQUIRED =0
GAMMA =26627.1
NOM−LAMBDA−U =0.033
NOM−K−VALUE =1.047
NOM−LAMBDA−R =3.6028e−011
NUM−POLES =144
NUM−END−POLES =4
CELL−LENGTH =4

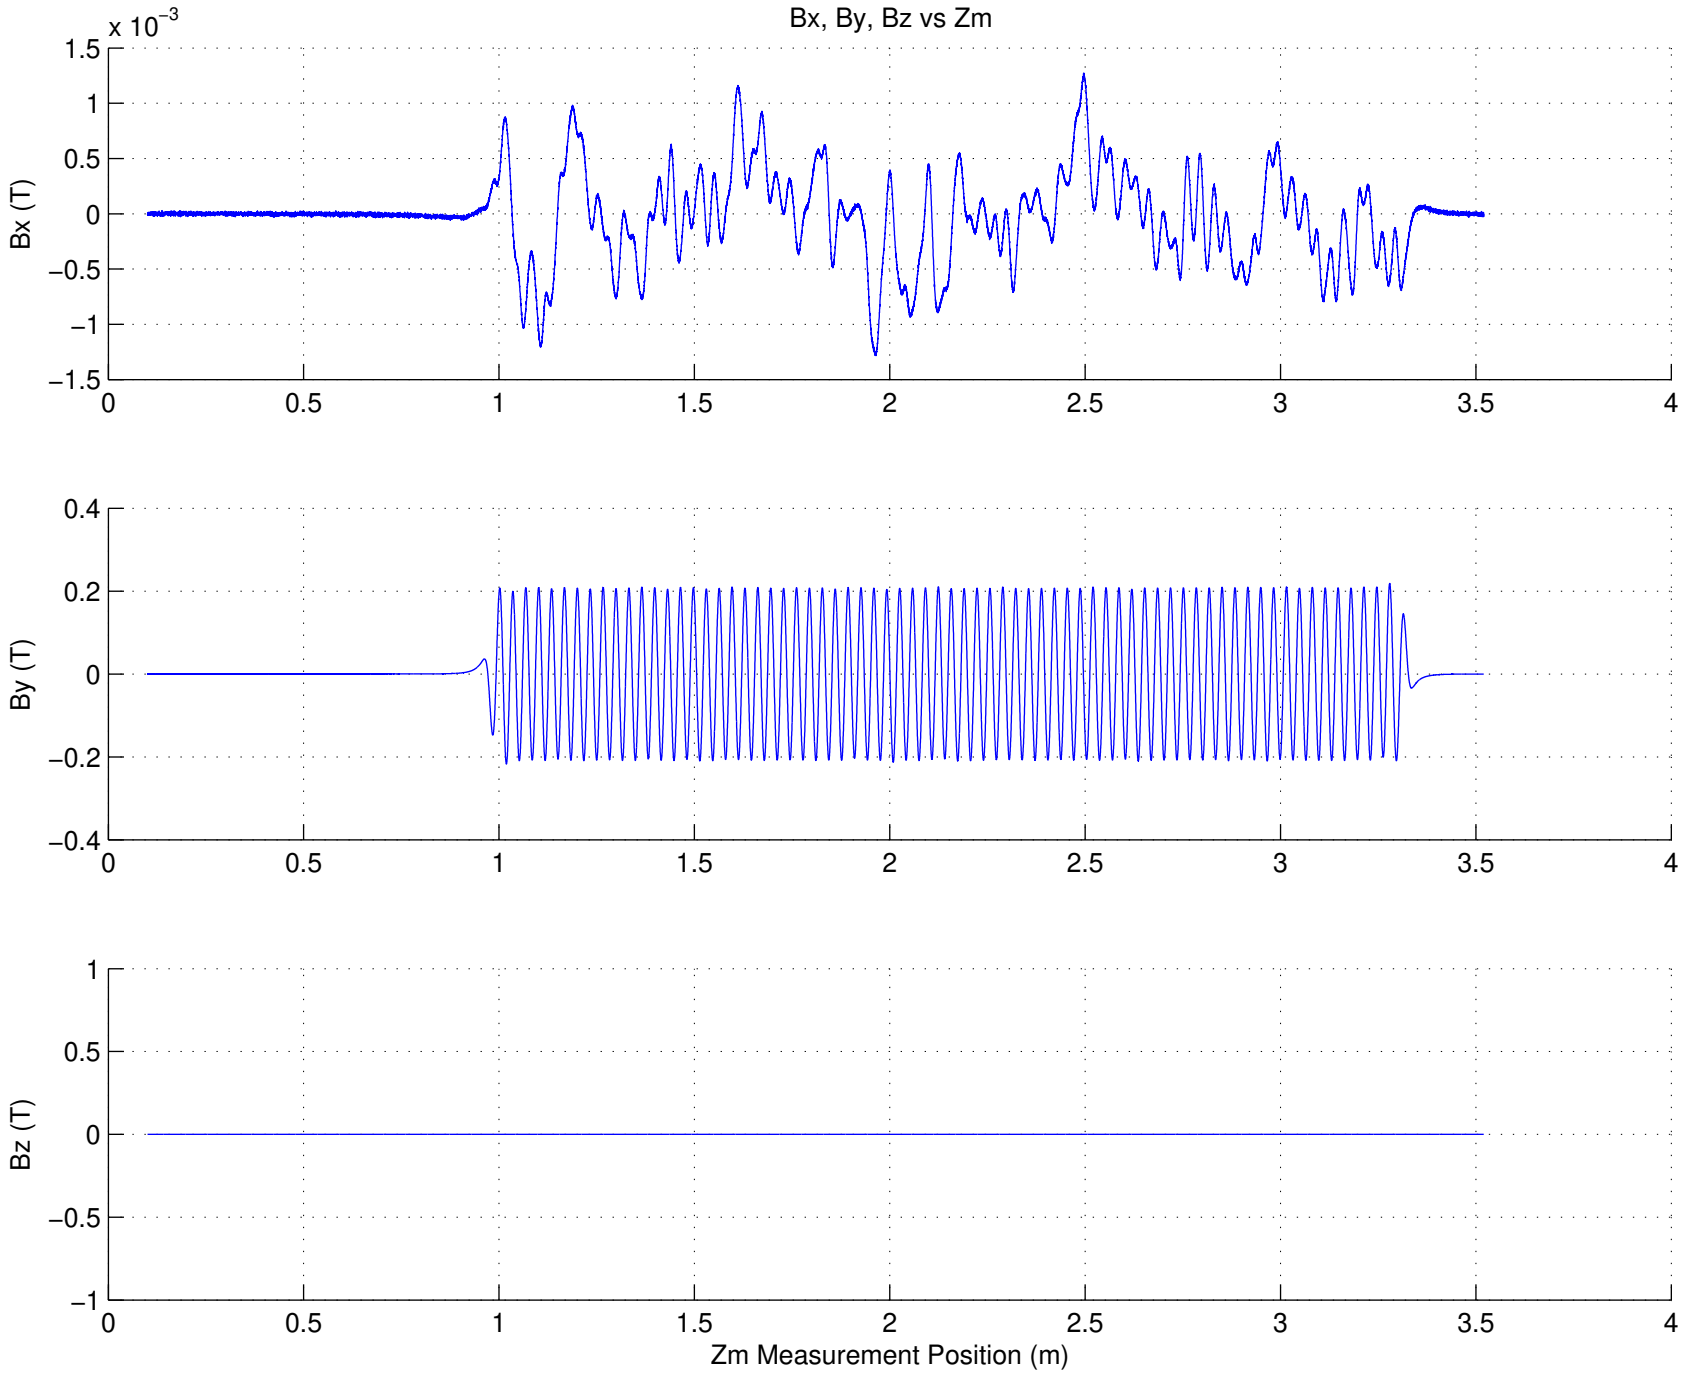
Bx, By, Bz vs Zm
x 10^-3
Bx (T)
By (T)
Bz (T)
Zm Measurement Position (m)

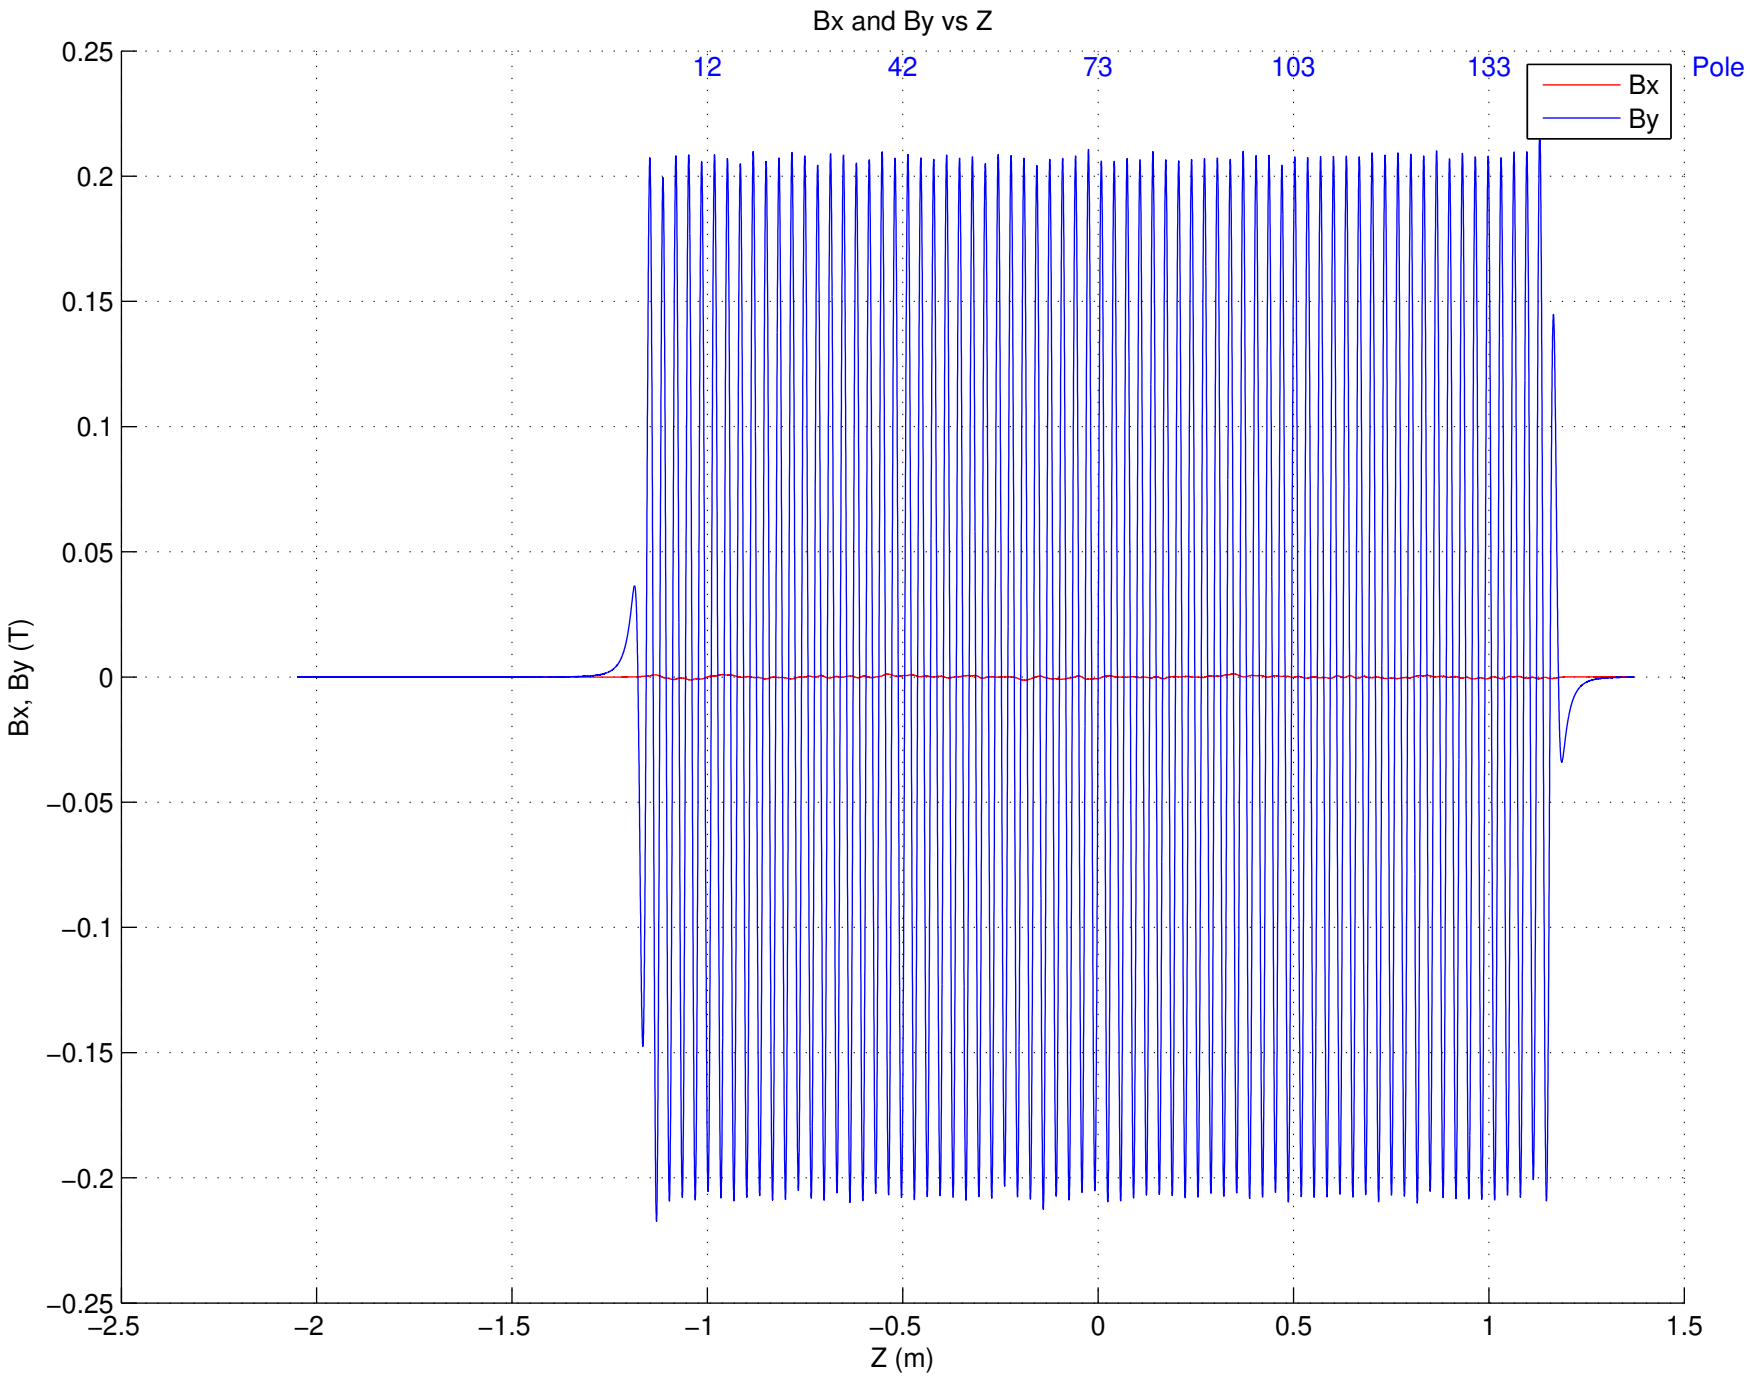
Bx and By vs Z
12
42
73
103
133
Pole
Bx
By
0.25
0.2
0.15
0.1
0.05
0
−0.05
−0.1
−0.15
−0.2
−0.25
Bx, By (T)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
Z (m)

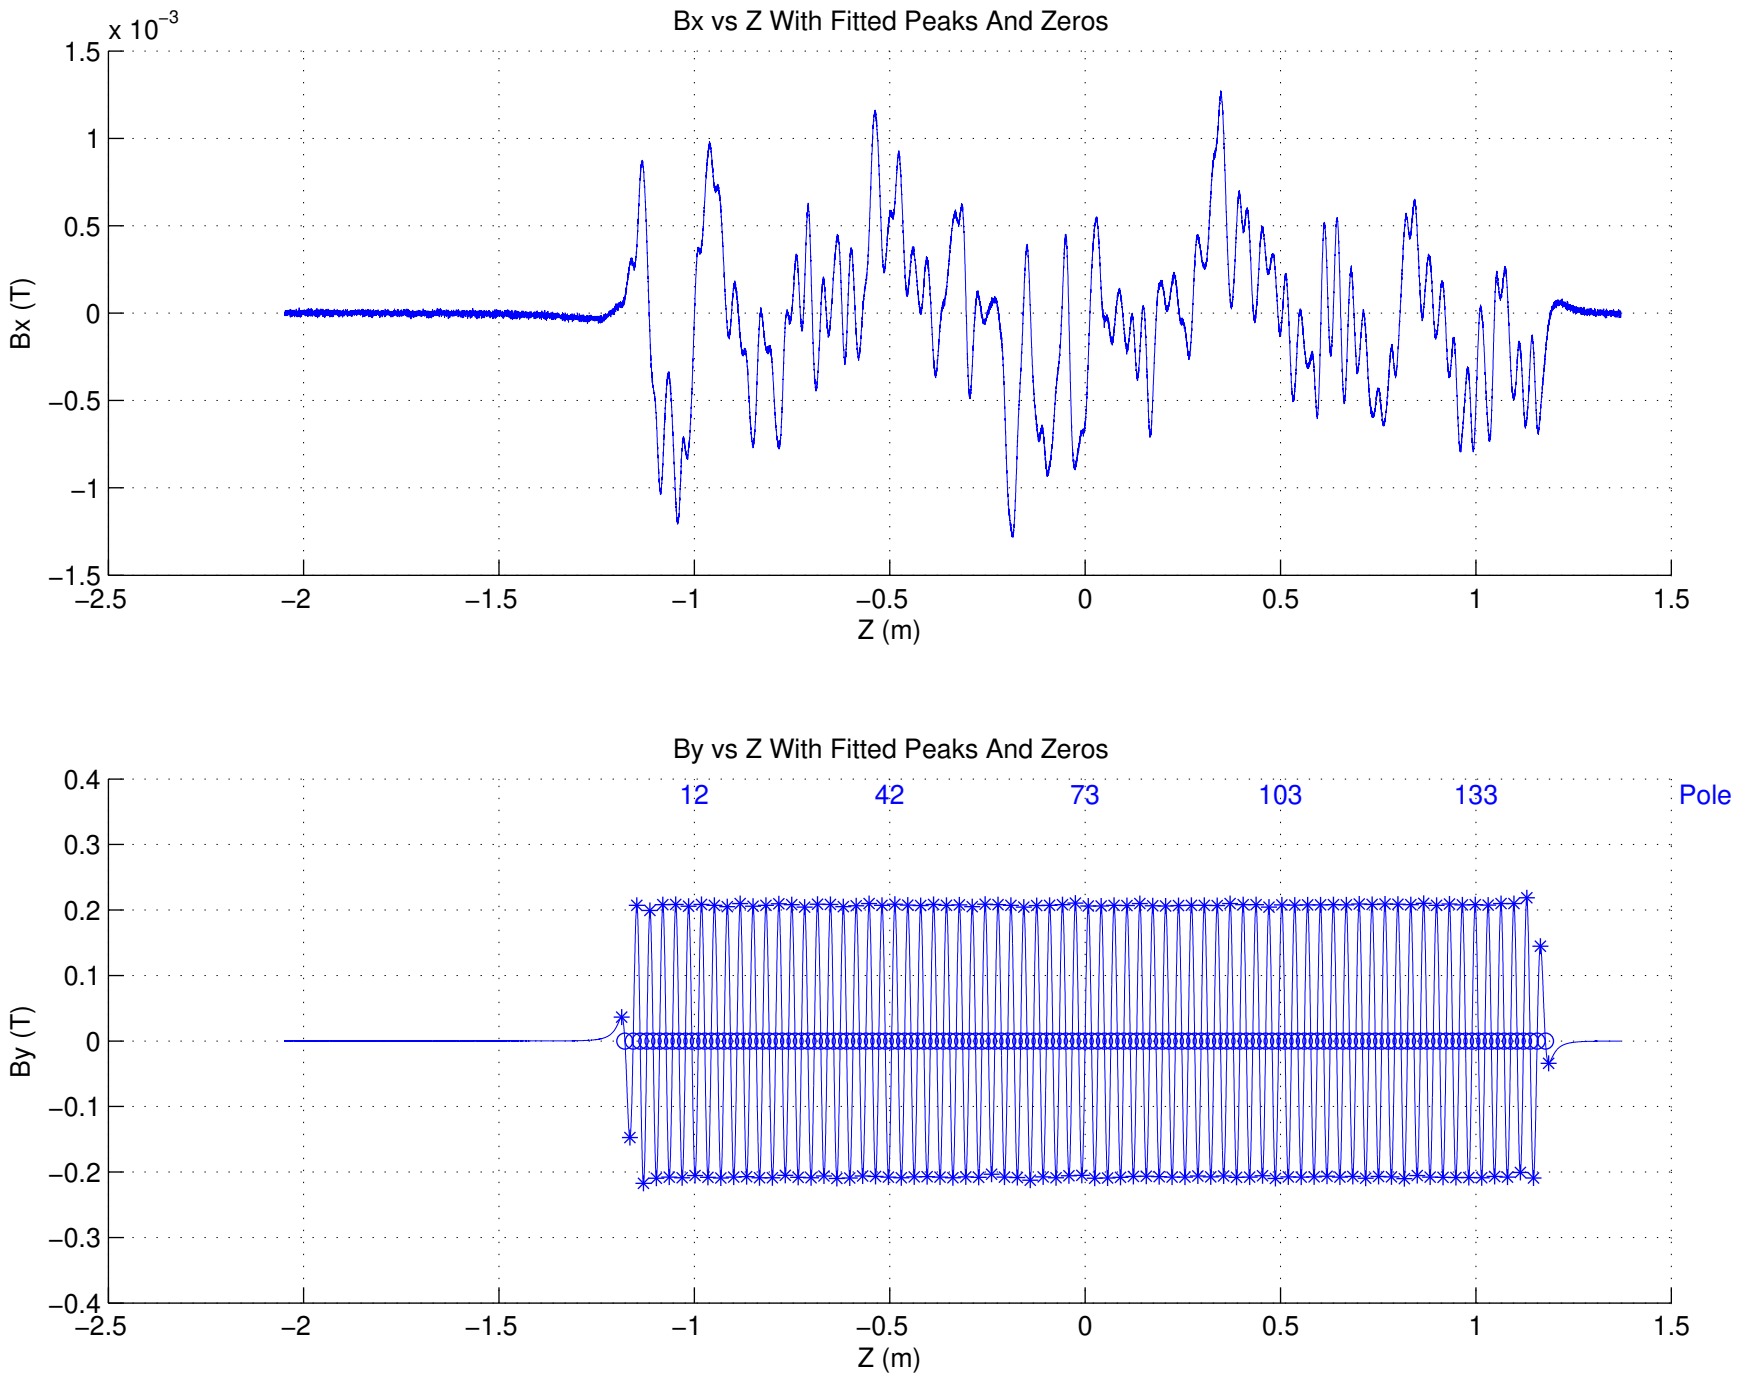
Bx vs Z With Fitted Peaks And Zeros
x 10^-3
Bx (T)
Z (m)
By vs Z With Fitted Peaks And Zeros
By (T)
Z (m)
12
42
73
103
133
Pole

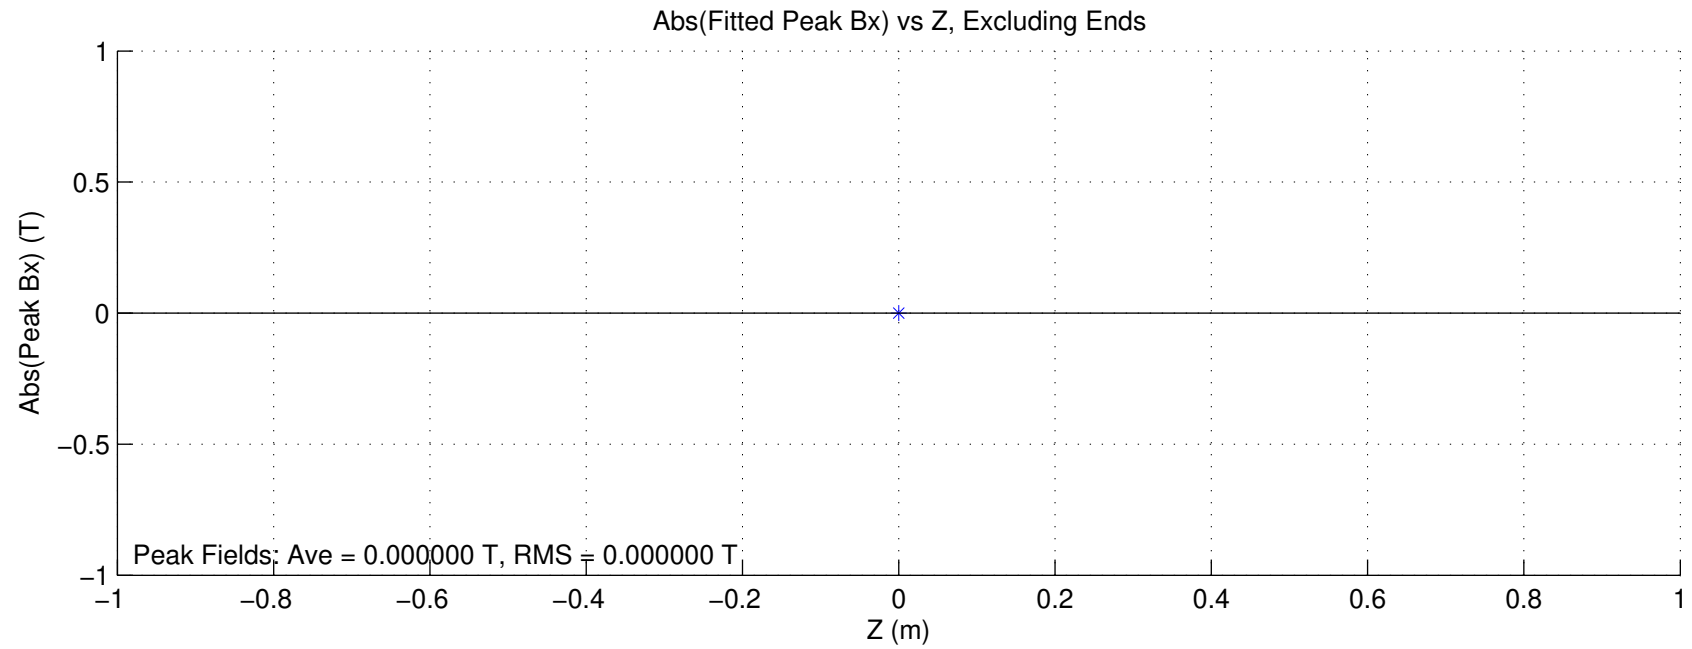
Abs(Fitted Peak Bx) vs Z, Excluding Ends
Abs(Peak Bx) (T)
Z (m)
Peak Fields: Ave = 0.000000 T, RMS = 0.000000 T
1
0.5
0
−0.5
−1
−1
−0.8
−0.6
−0.4
−0.2
0
0.2
0.4
0.6
0.8
1

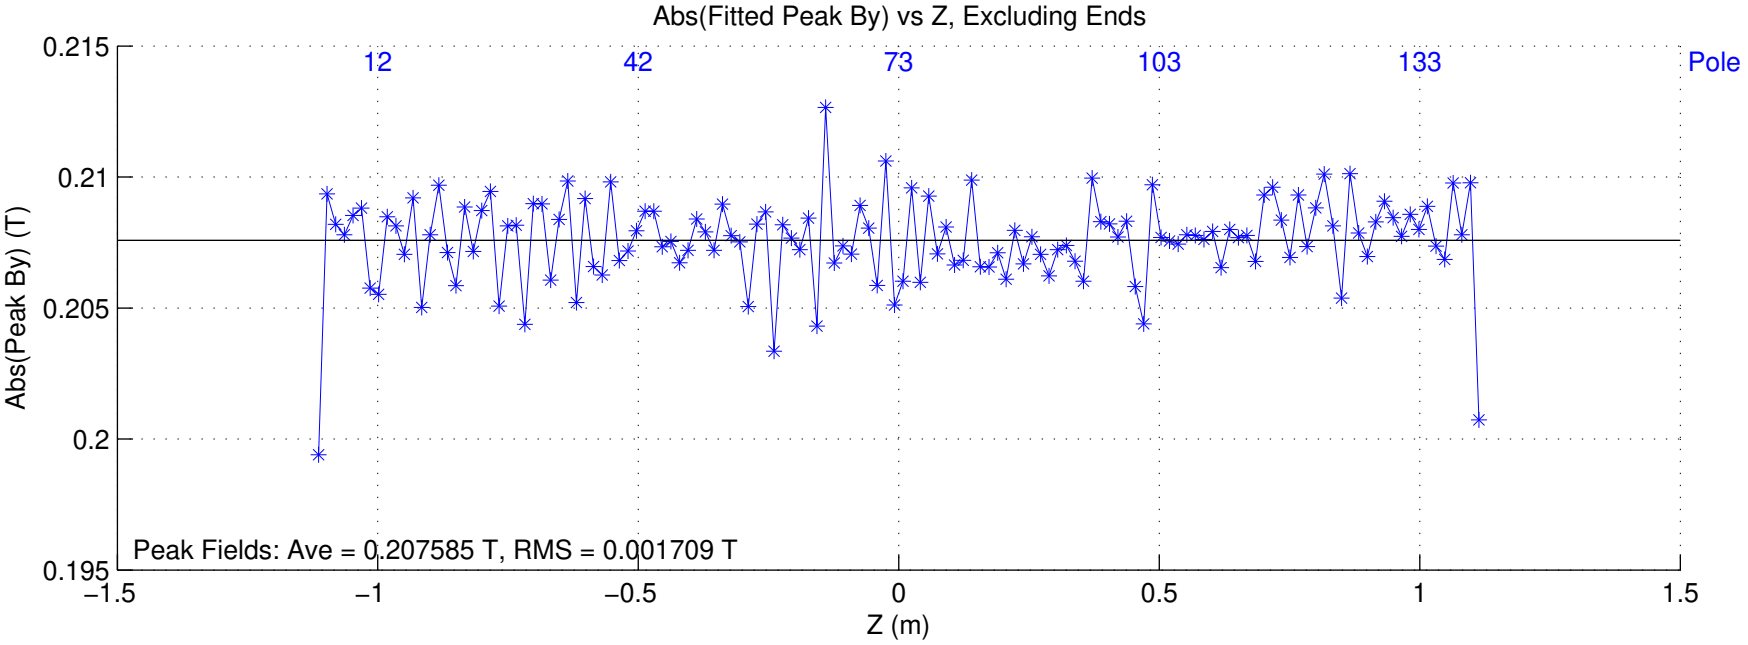
Abs(Fitted Peak By) vs Z, Excluding Ends
Abs(Peak By) (T)
Z (m)
Peak Fields: Ave = 0.207585 T, RMS = 0.001709 T
12
42
73
103
133
Pole
0.215
0.21
0.205
0.2
0.195
−1.5
−1
−0.5
0
0.5
1
1.5

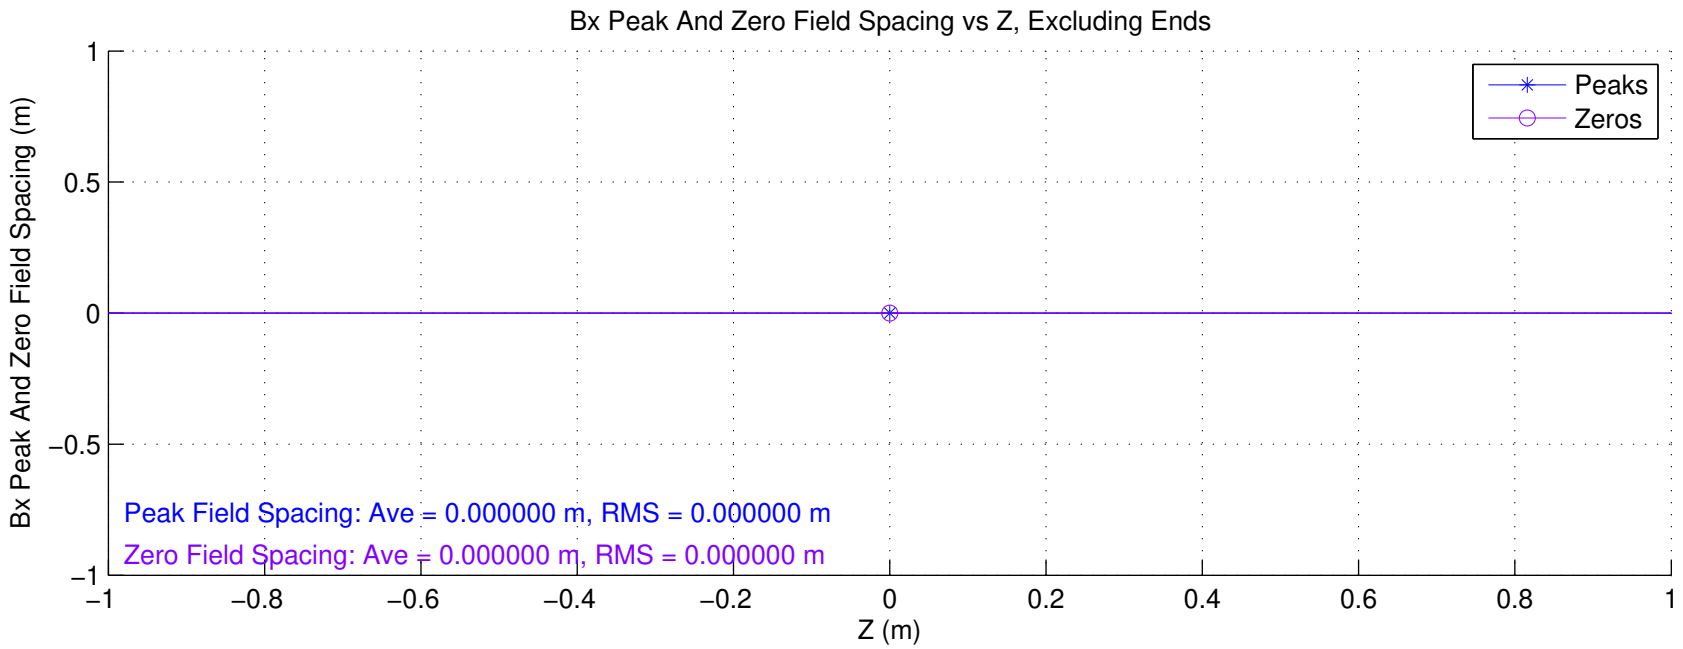
Bx Peak And Zero Field Spacing vs Z, Excluding Ends
Bx Peak And Zero Field Spacing (m)
Z (m)
Peaks
Zeros
Peak Field Spacing: Ave = 0.000000 m, RMS = 0.000000 m
Zero Field Spacing: Ave = 0.000000 m, RMS = 0.000000 m
1
0.5
0
−0.5
−1
−1
−0.8
−0.6
−0.4
−0.2
0
0.2
0.4
0.6
0.8
1

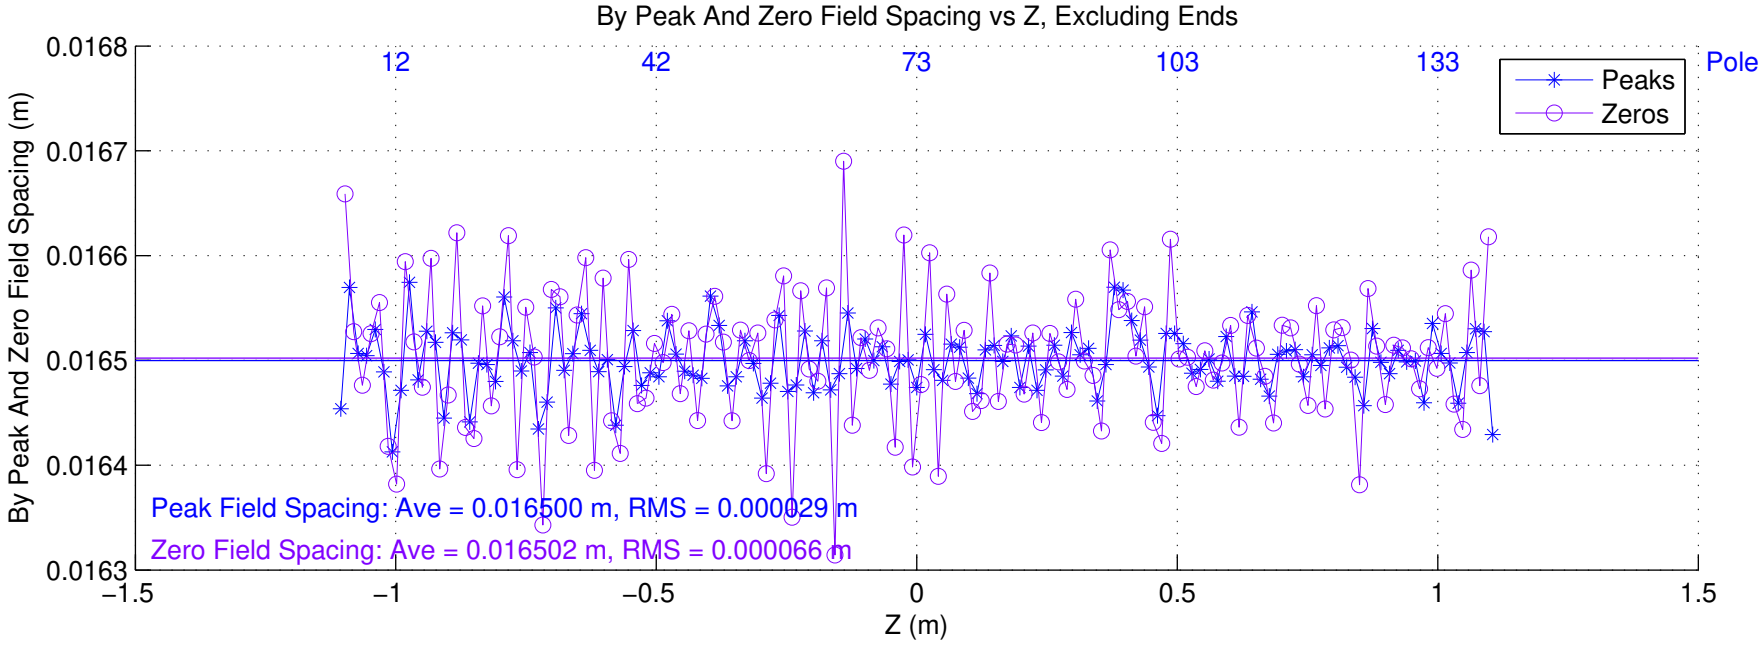
By Peak And Zero Field Spacing vs Z, Excluding Ends
By Peak And Zero Field Spacing (m)
Z (m)
12
42
73
103
133
Pole
Peaks
Zeros
Peak Field Spacing: Ave = 0.016500 m, RMS = 0.000029 m
Zero Field Spacing: Ave = 0.016502 m, RMS = 0.000066 m
0.0168
0.0167
0.0166
0.0165
0.0164
0.0163
−1.5
−1
−0.5
0
0.5
1
1.5

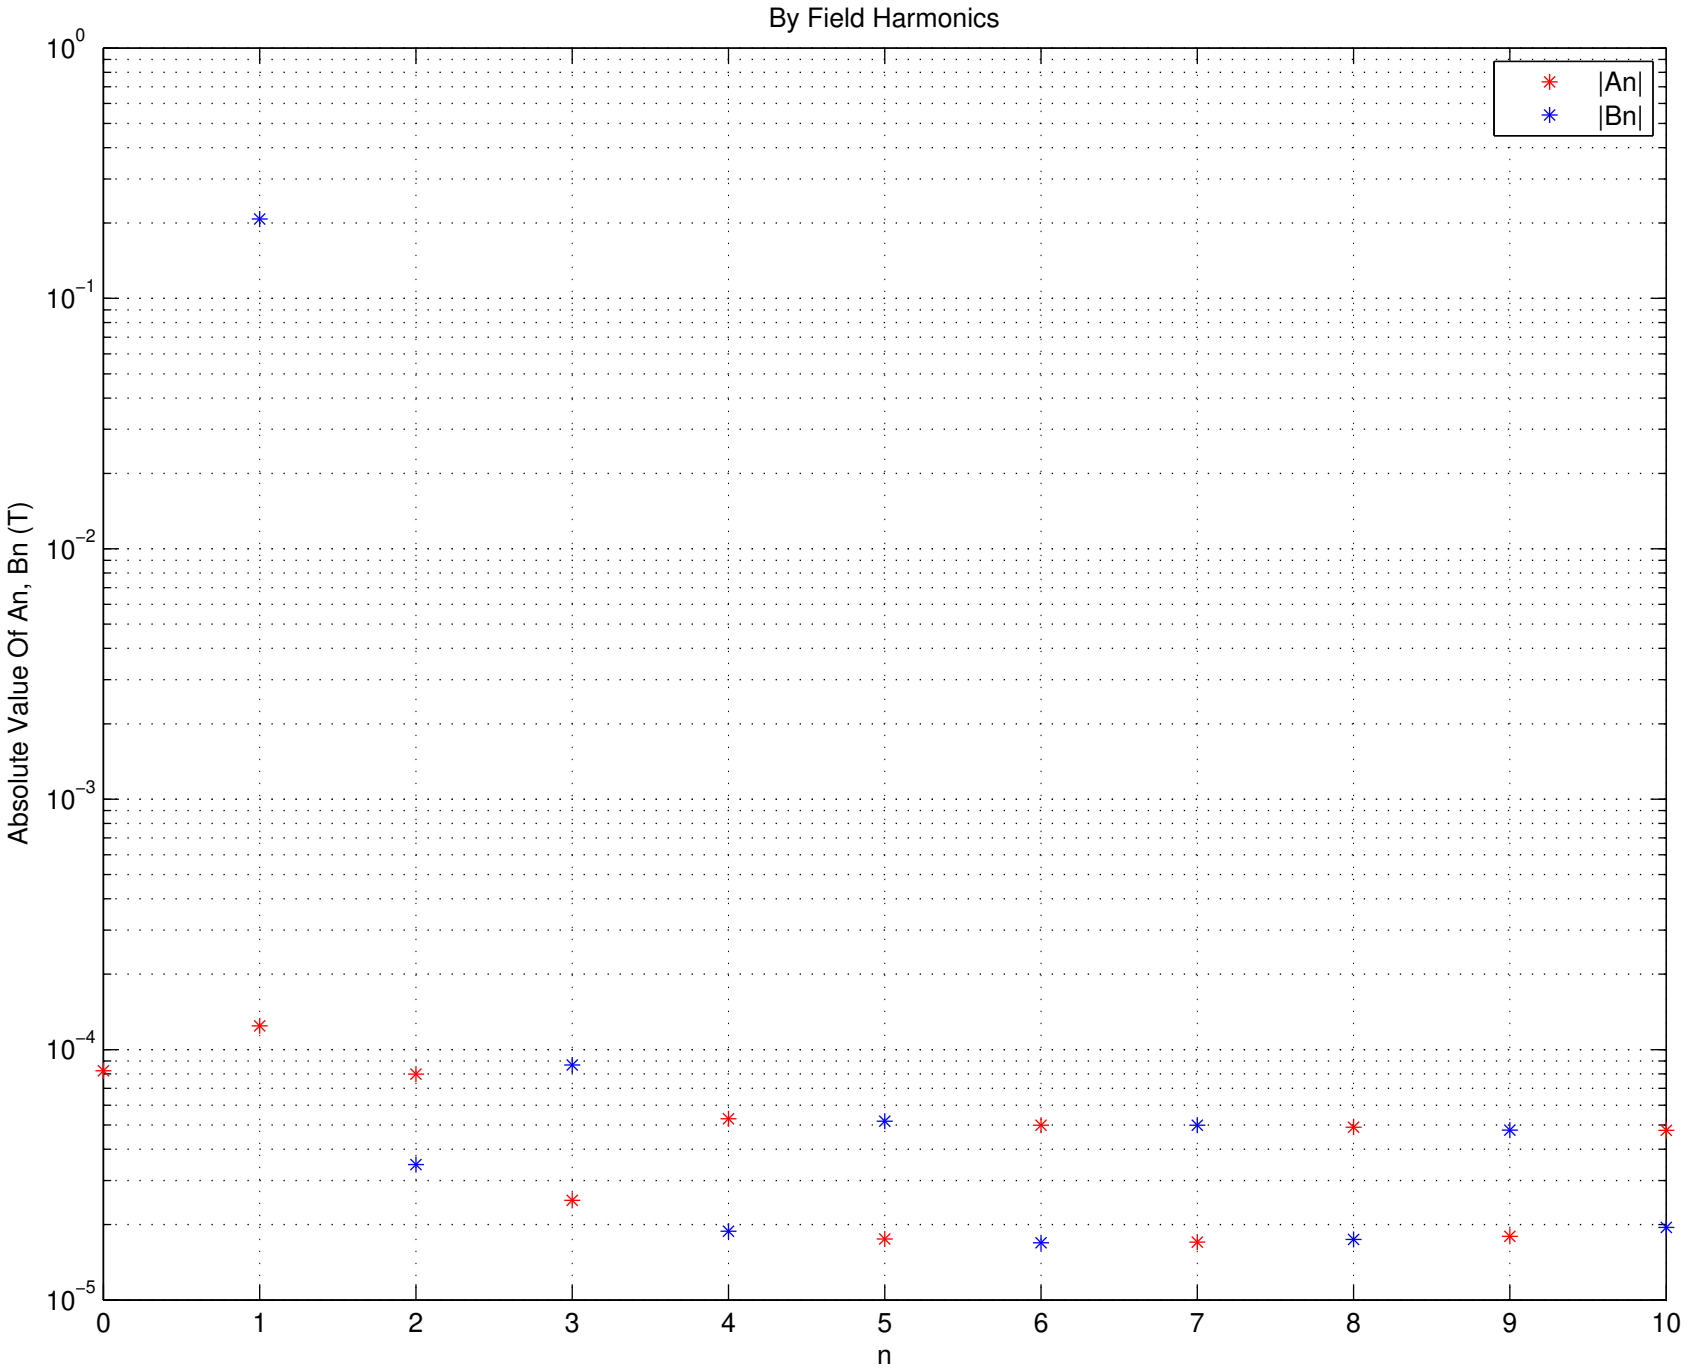
By Field Harmonics
|An|
|Bn|
Absolute Value Of An, Bn (T)
n
10^{0}
10^{-1}
10^{-2}
10^{-3}
10^{-4}
10^{-5}
0
1
2
3
4
5
6
7
8
9
10

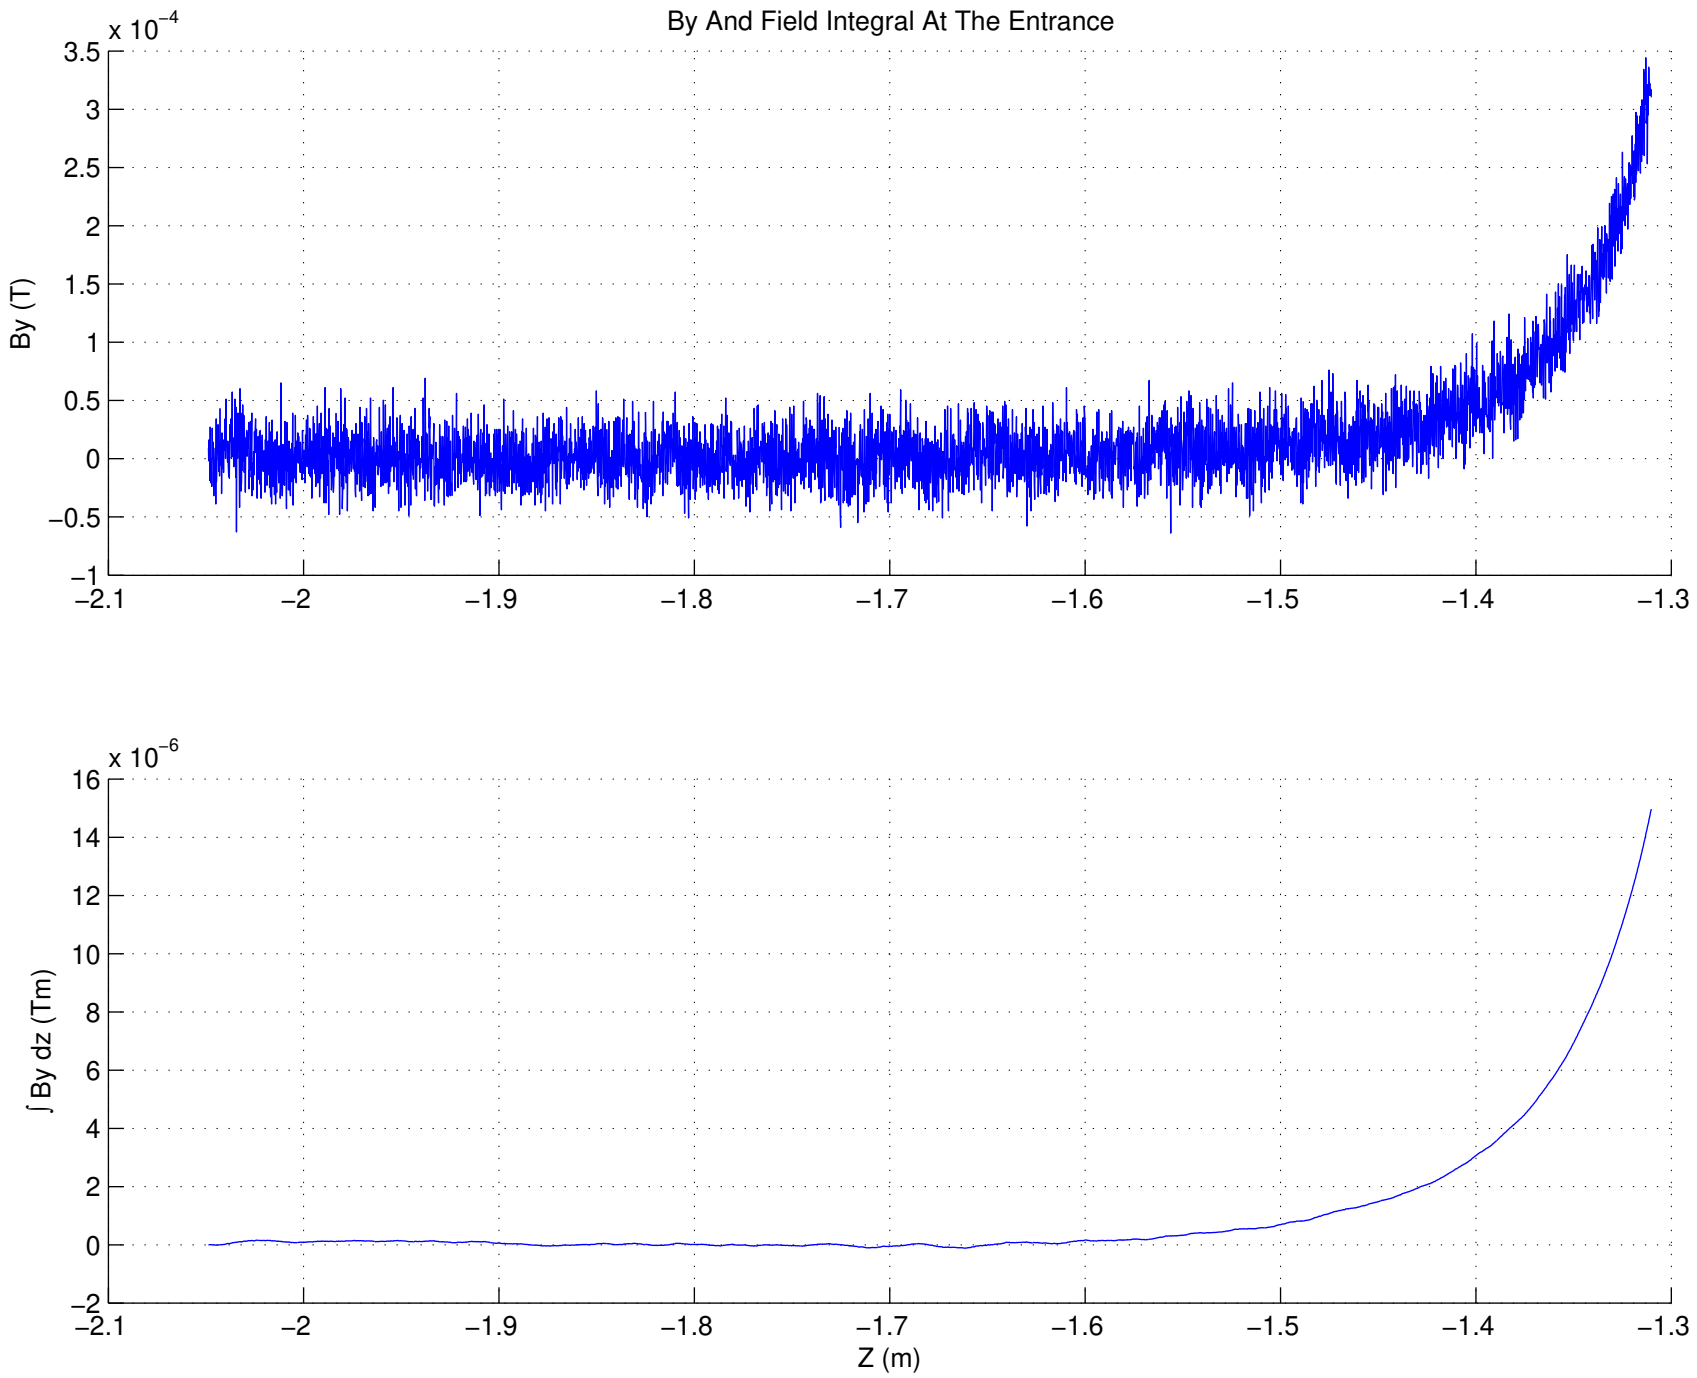
By And Field Integral At The Entrance
x 10^-4
By (T)
3.5
3
2.5
2
1.5
1
0.5
0
−0.5
−1
−2.1
−2
−1.9
−1.8
−1.7
−1.6
−1.5
−1.4
−1.3
x 10^-6
∫ By dz (Tm)
16
14
12
10
8
6
4
2
0
−2
Z (m)

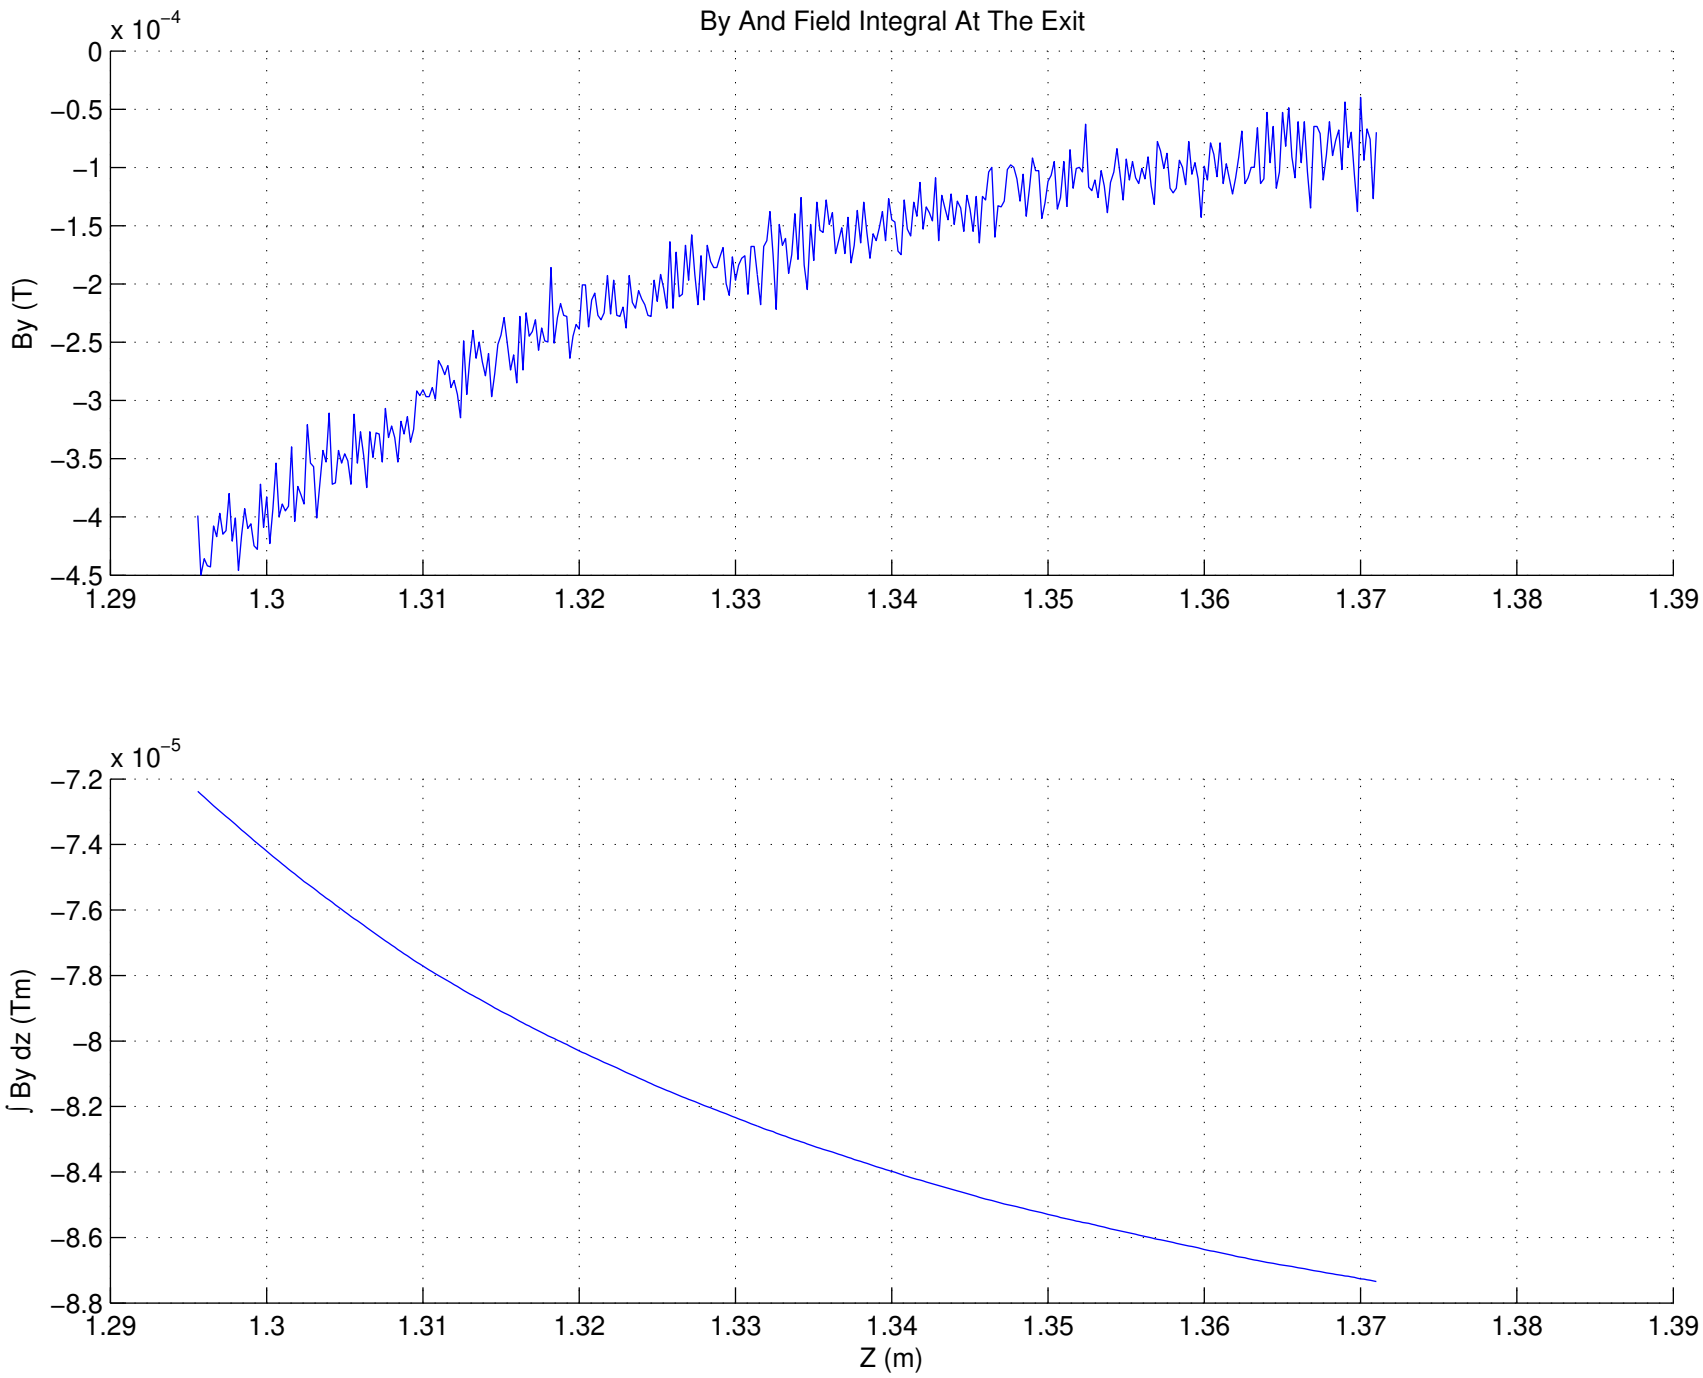
By And Field Integral At The Exit
x 10^-4
0
−0.5
−1
−1.5
−2
−2.5
−3
−3.5
−4
−4.5
By (T)
1.29
1.3
1.31
1.32
1.33
1.34
1.35
1.36
1.37
1.38
1.39
x 10^-5
−7.2
−7.4
−7.6
−7.8
−8
−8.2
−8.4
−8.6
−8.8
∫ By dz (Tm)
Z (m)

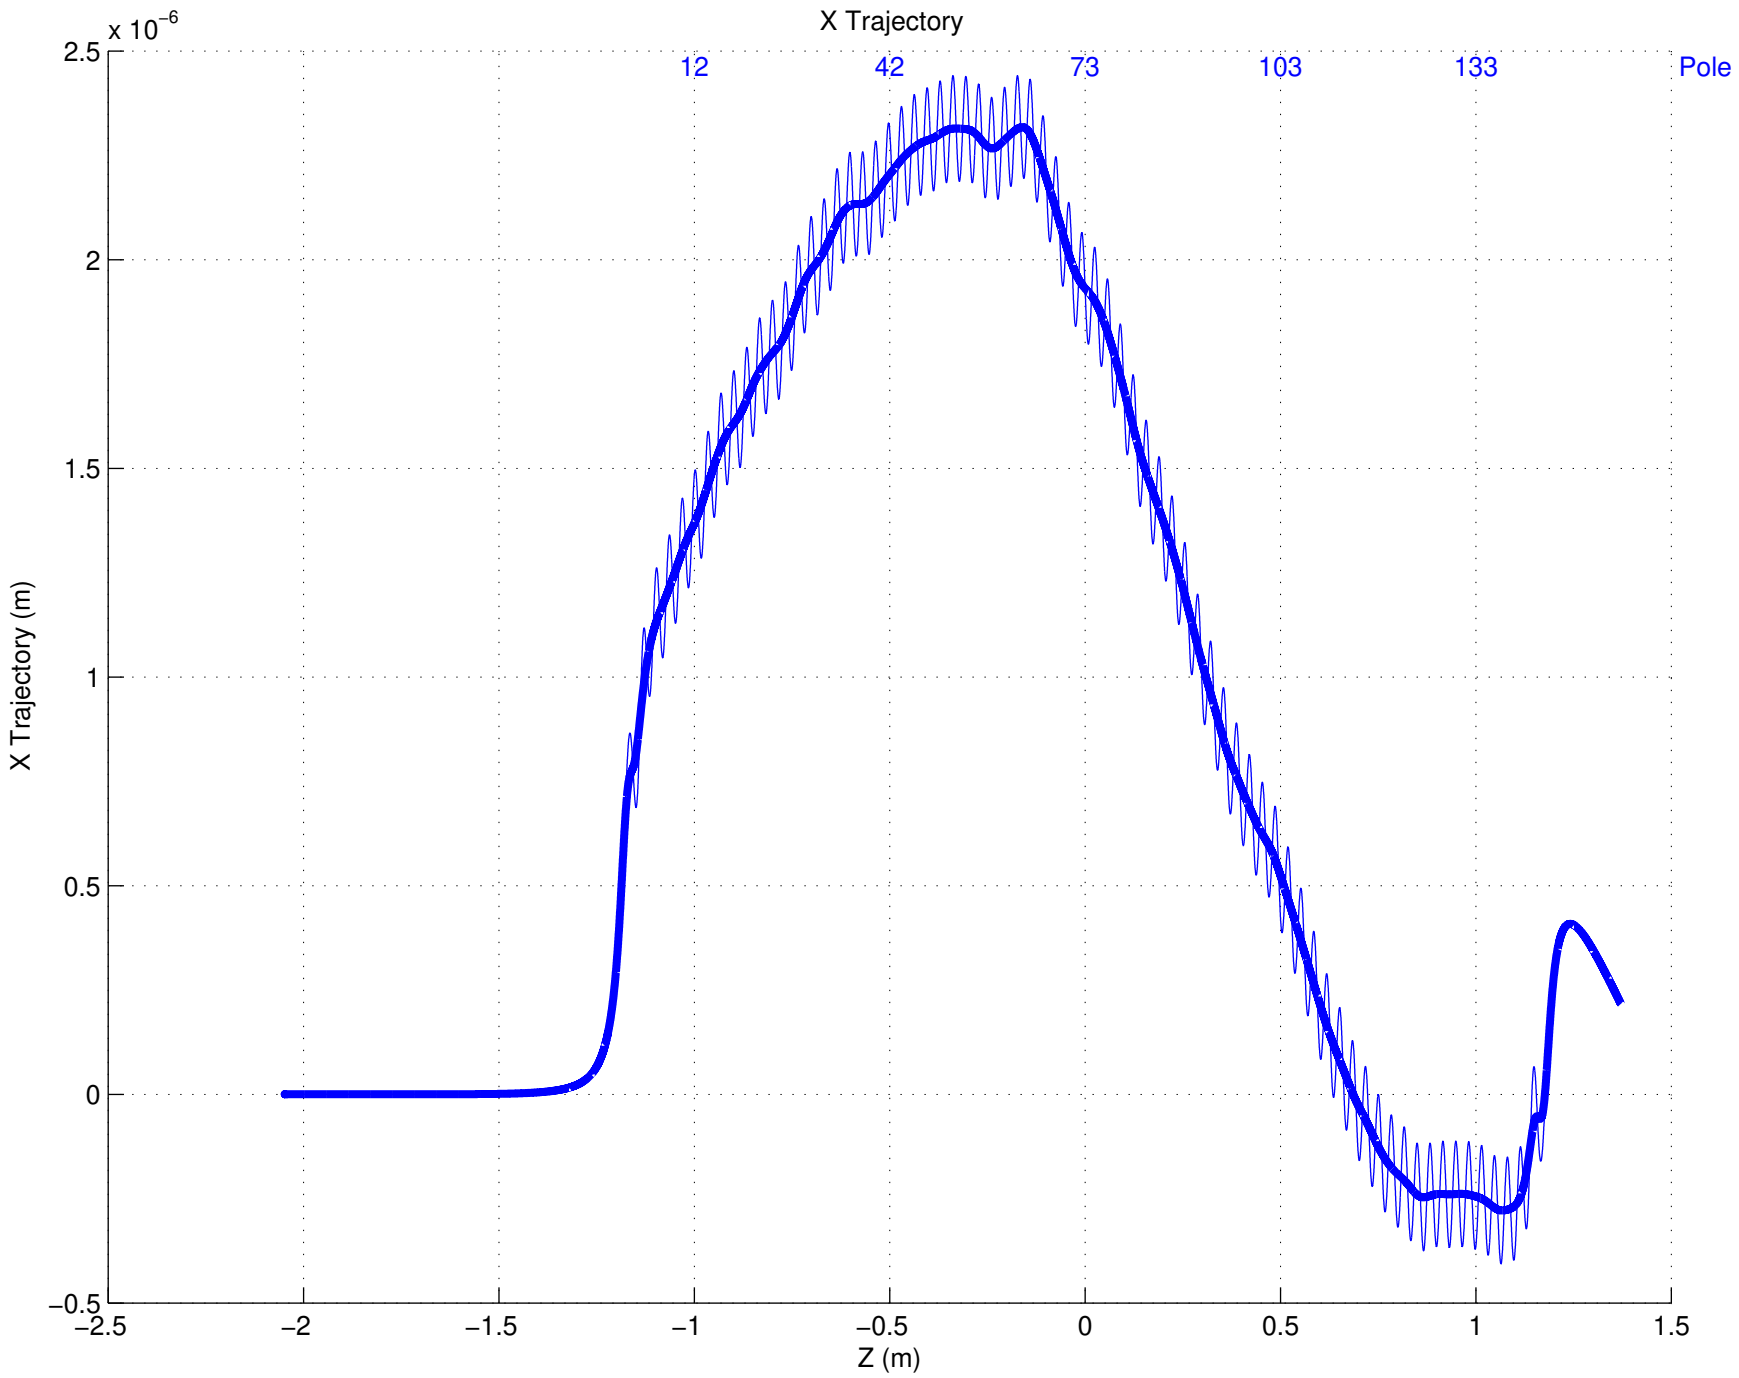
X Trajectory
x 10^-6
2.5
2
1.5
1
0.5
0
−0.5
X Trajectory (m)
12
42
73
103
133
Pole
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
Z (m)

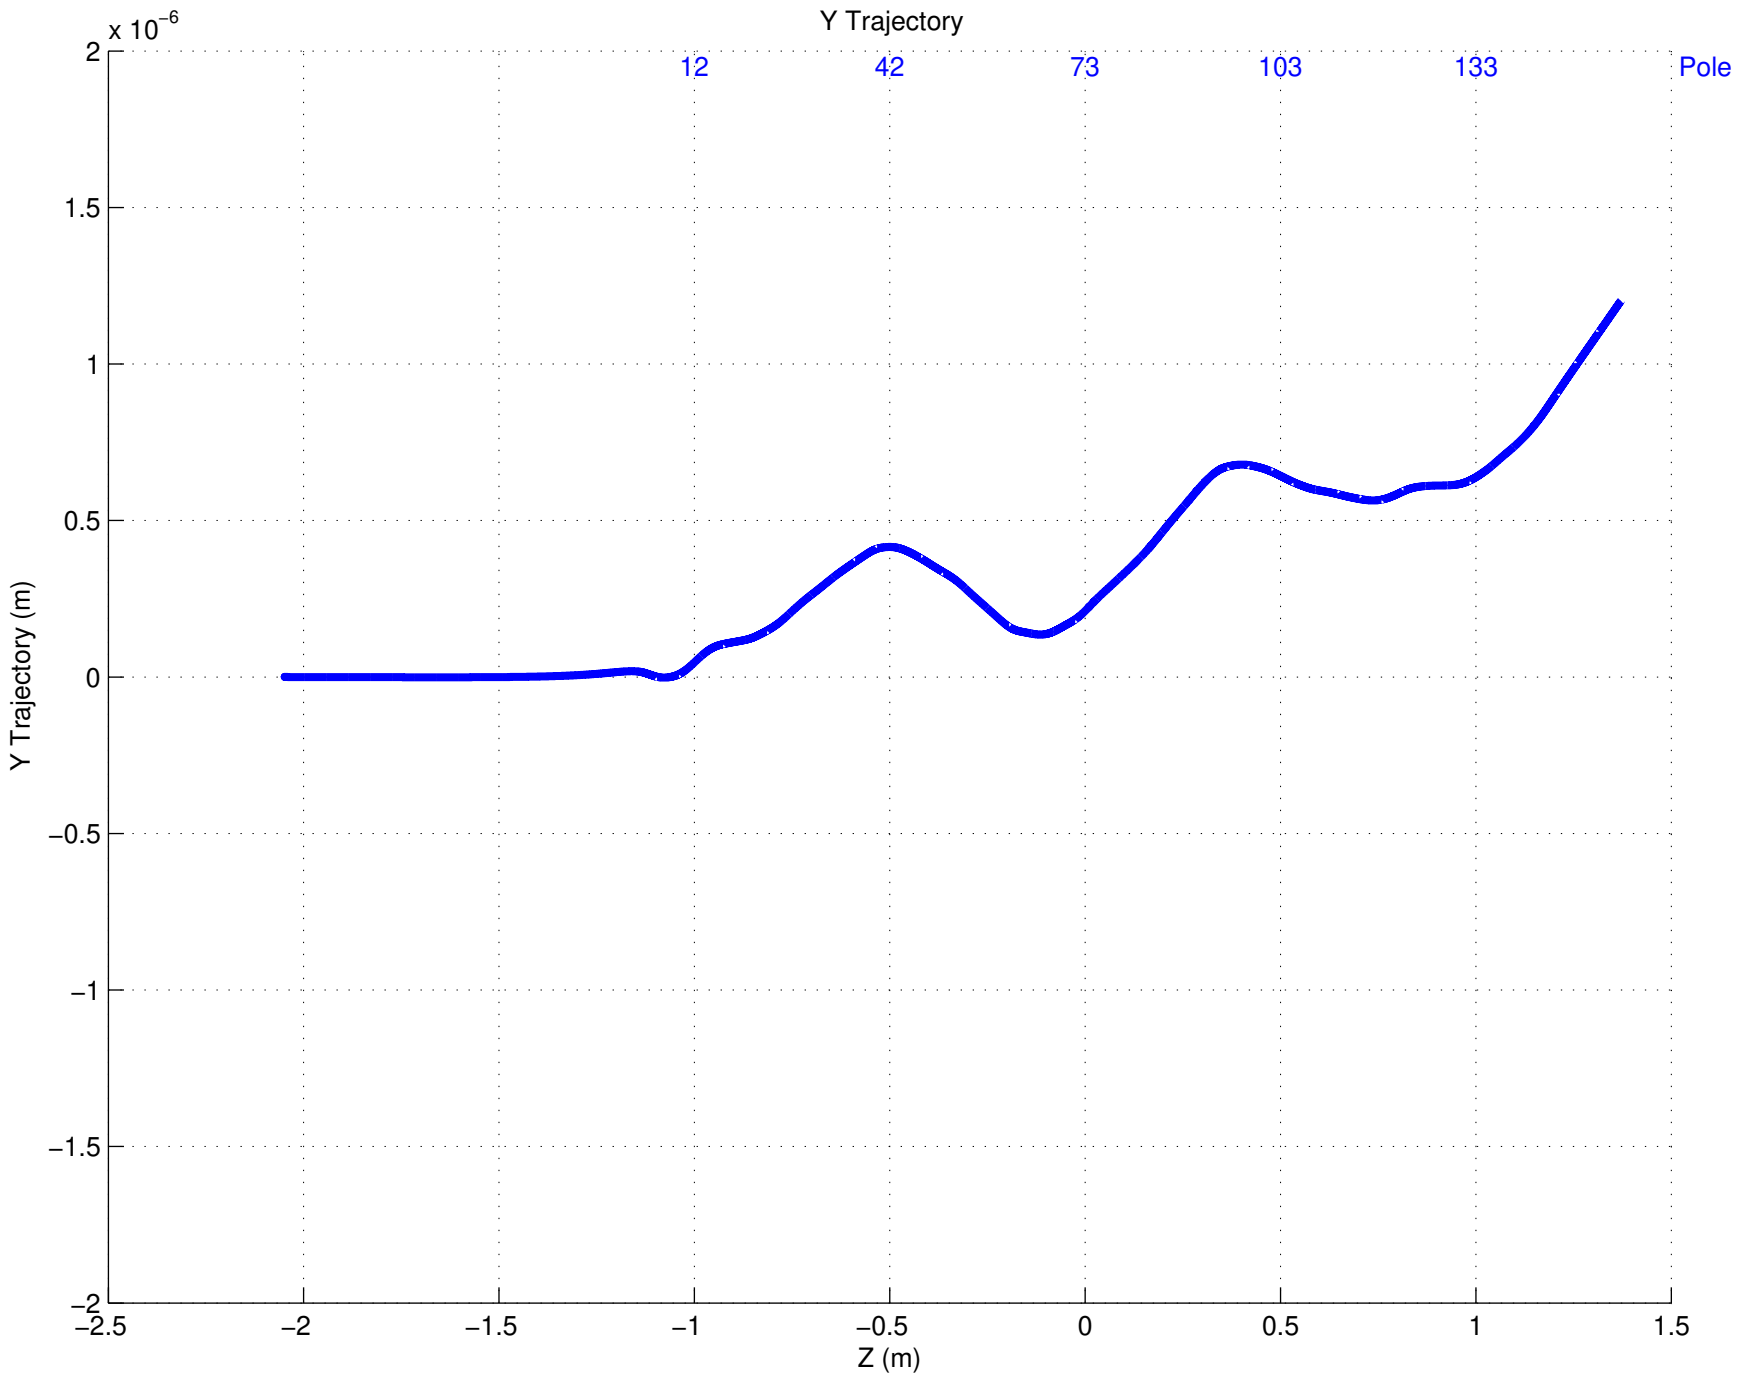
Y Trajectory
x 10^-6
12
42
73
103
133
Pole
2
1.5
1
0.5
0
−0.5
−1
−1.5
−2
Y Trajectory (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
Z (m)

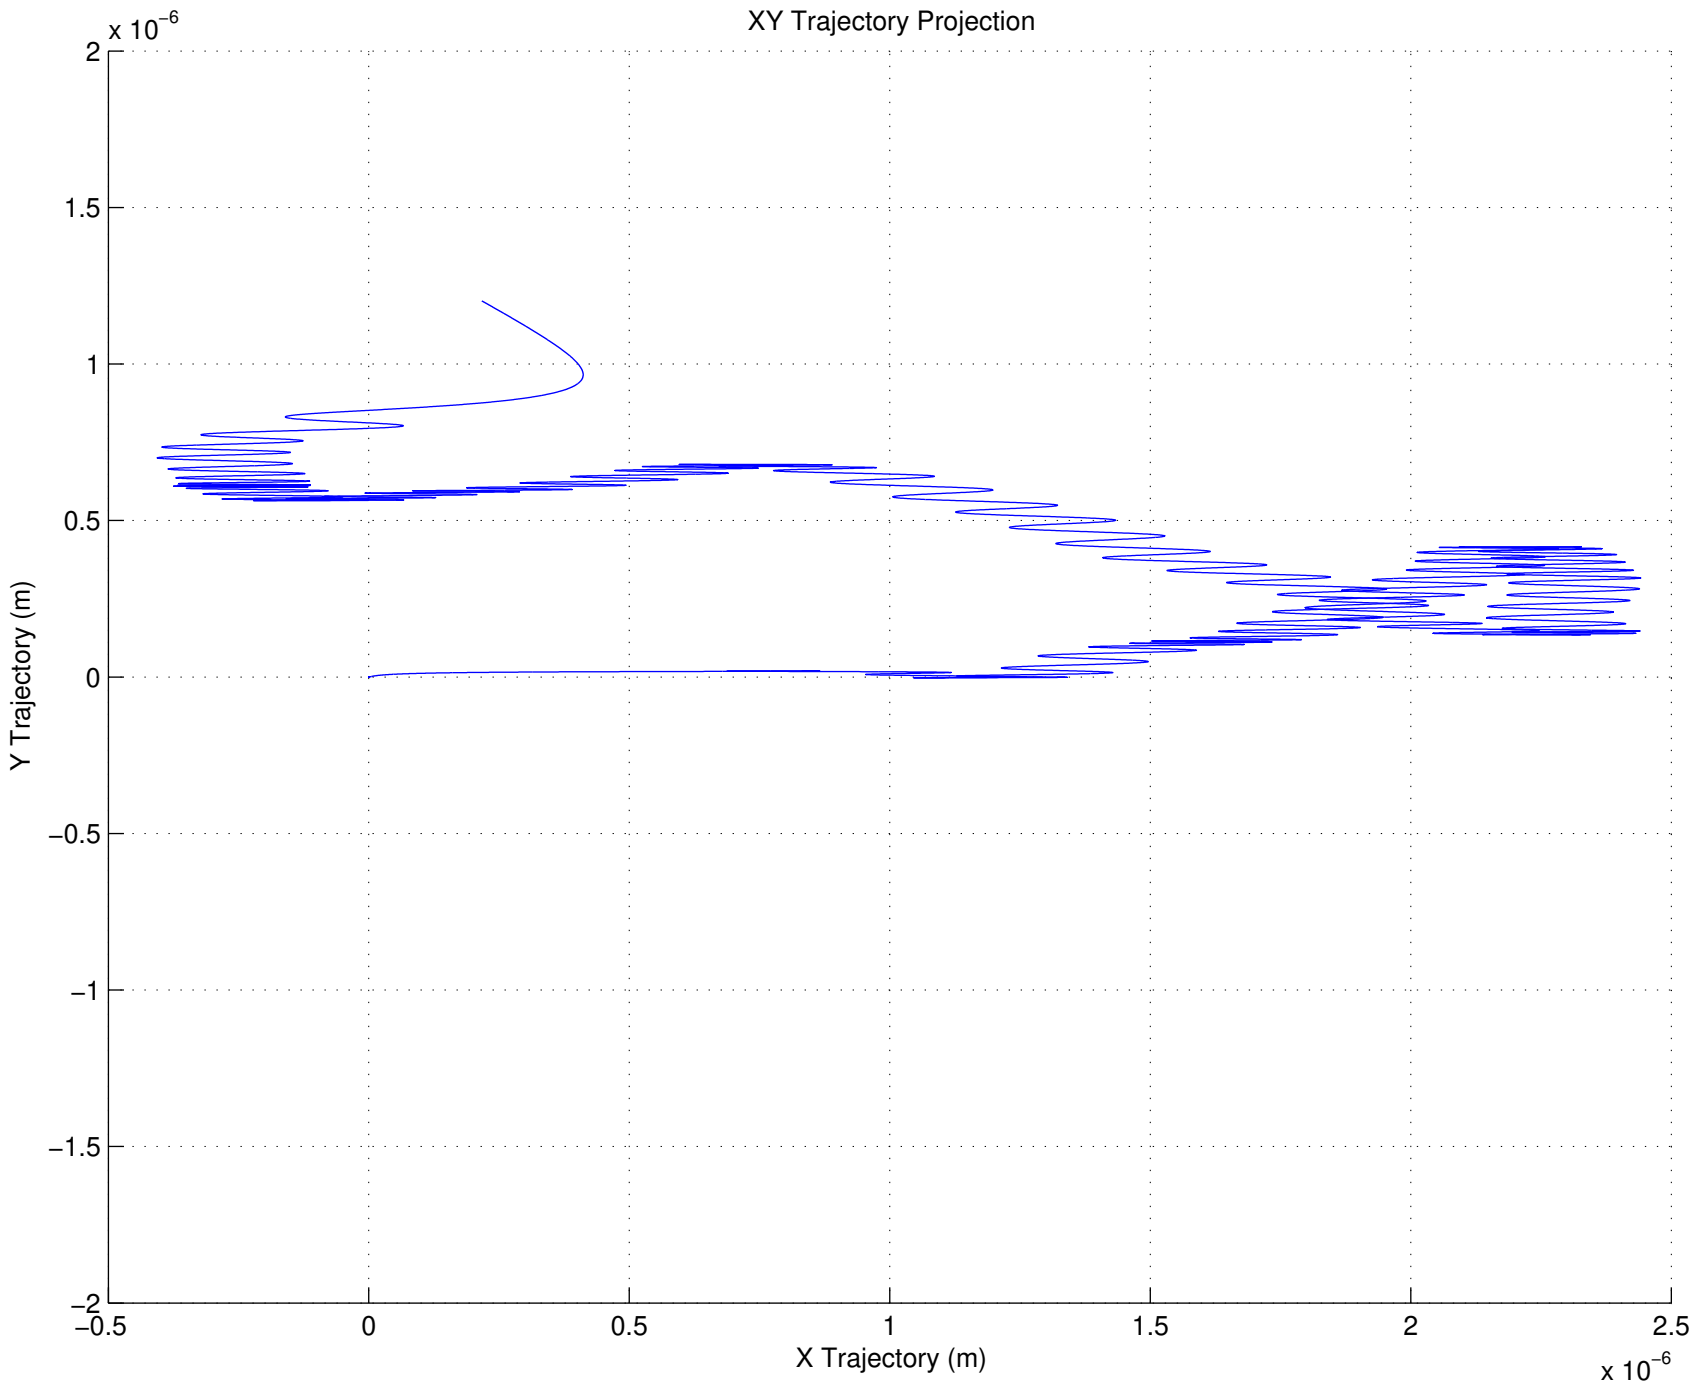
XY Trajectory Projection
x 10^-6
2
1.5
1
0.5
0
−0.5
−1
−1.5
−2
Y Trajectory (m)
−0.5
0
0.5
1
1.5
2
2.5
X Trajectory (m)
x 10^-6

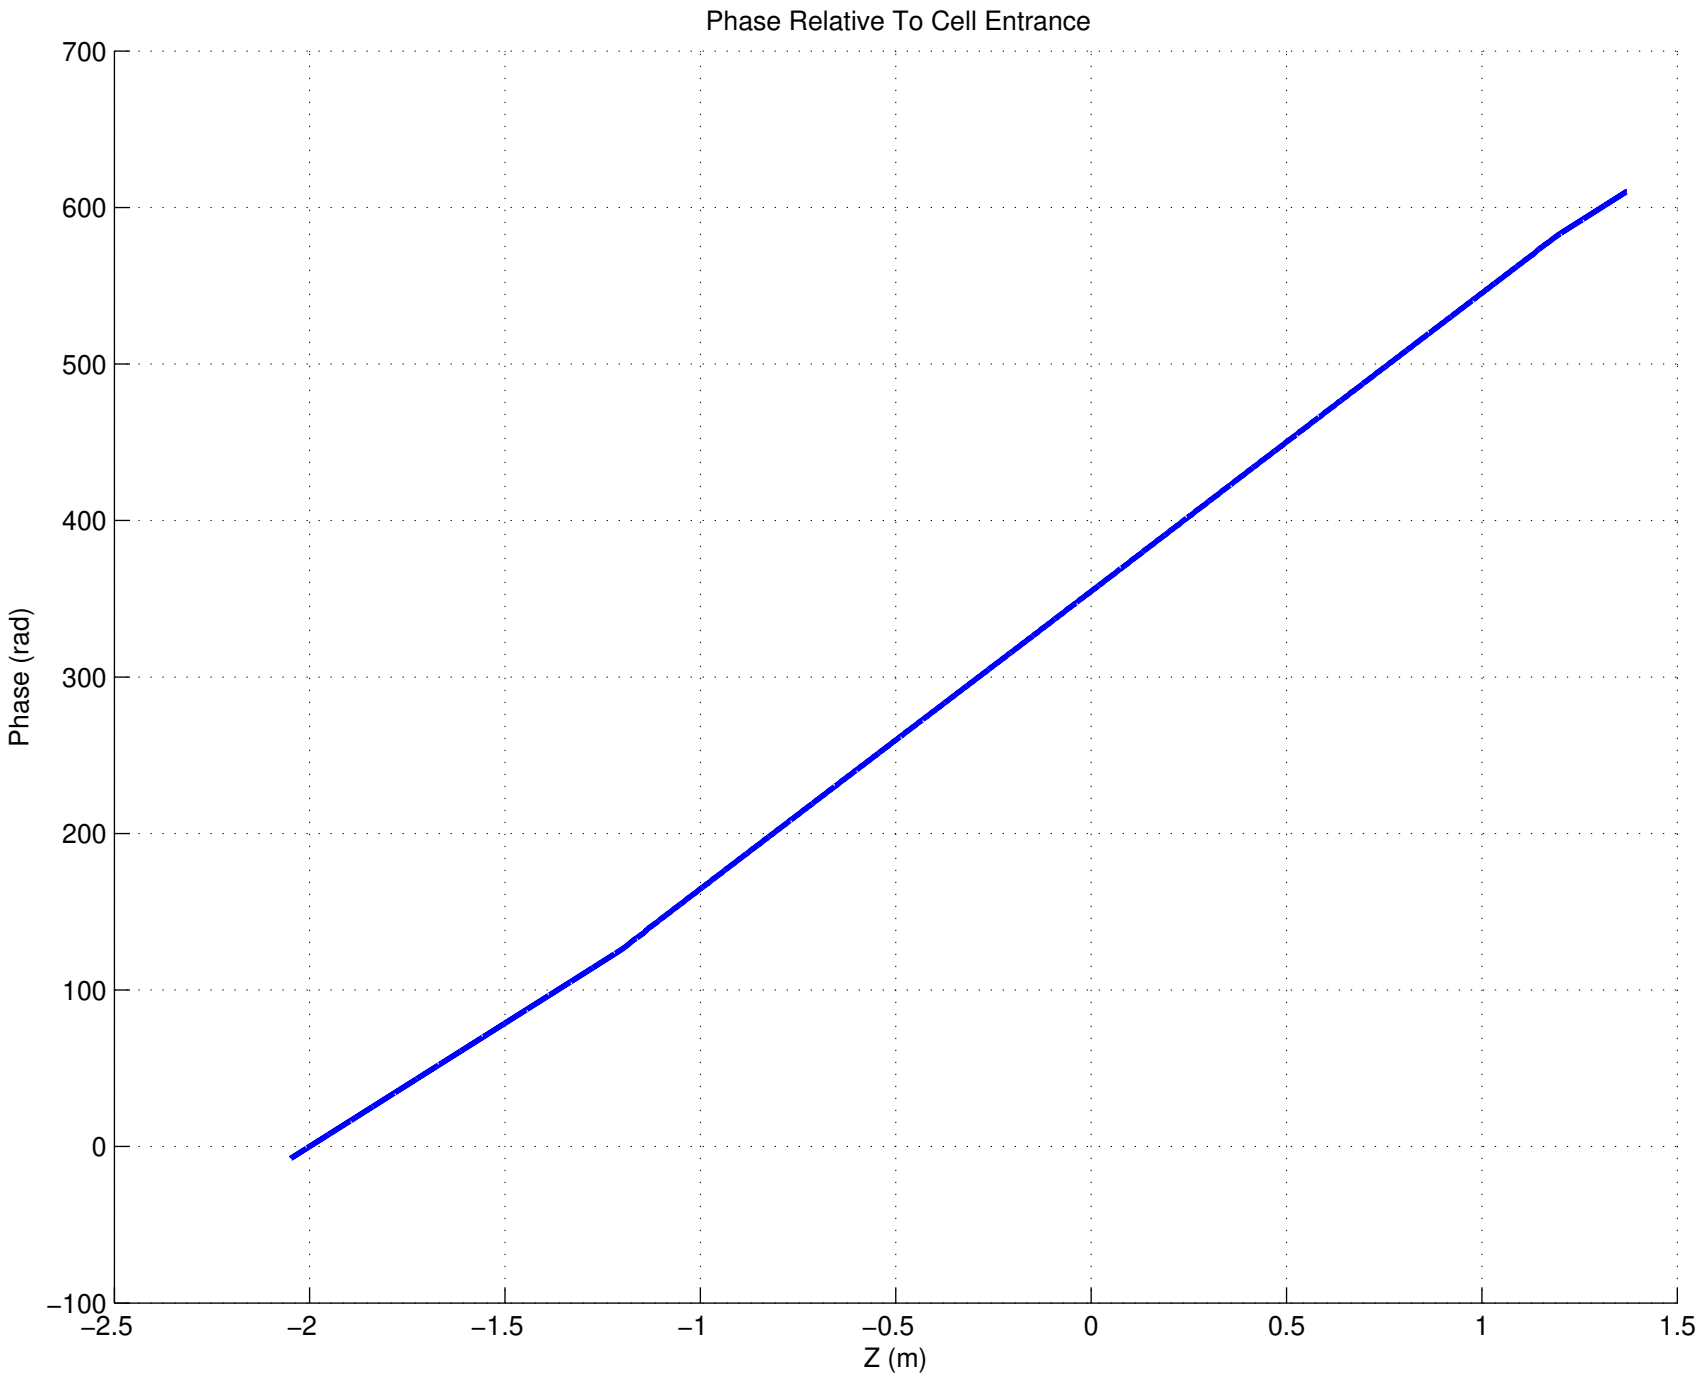
Phase Relative To Cell Entrance
Phase (rad)
Z (m)
700
600
500
400
300
200
100
0
−100
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5

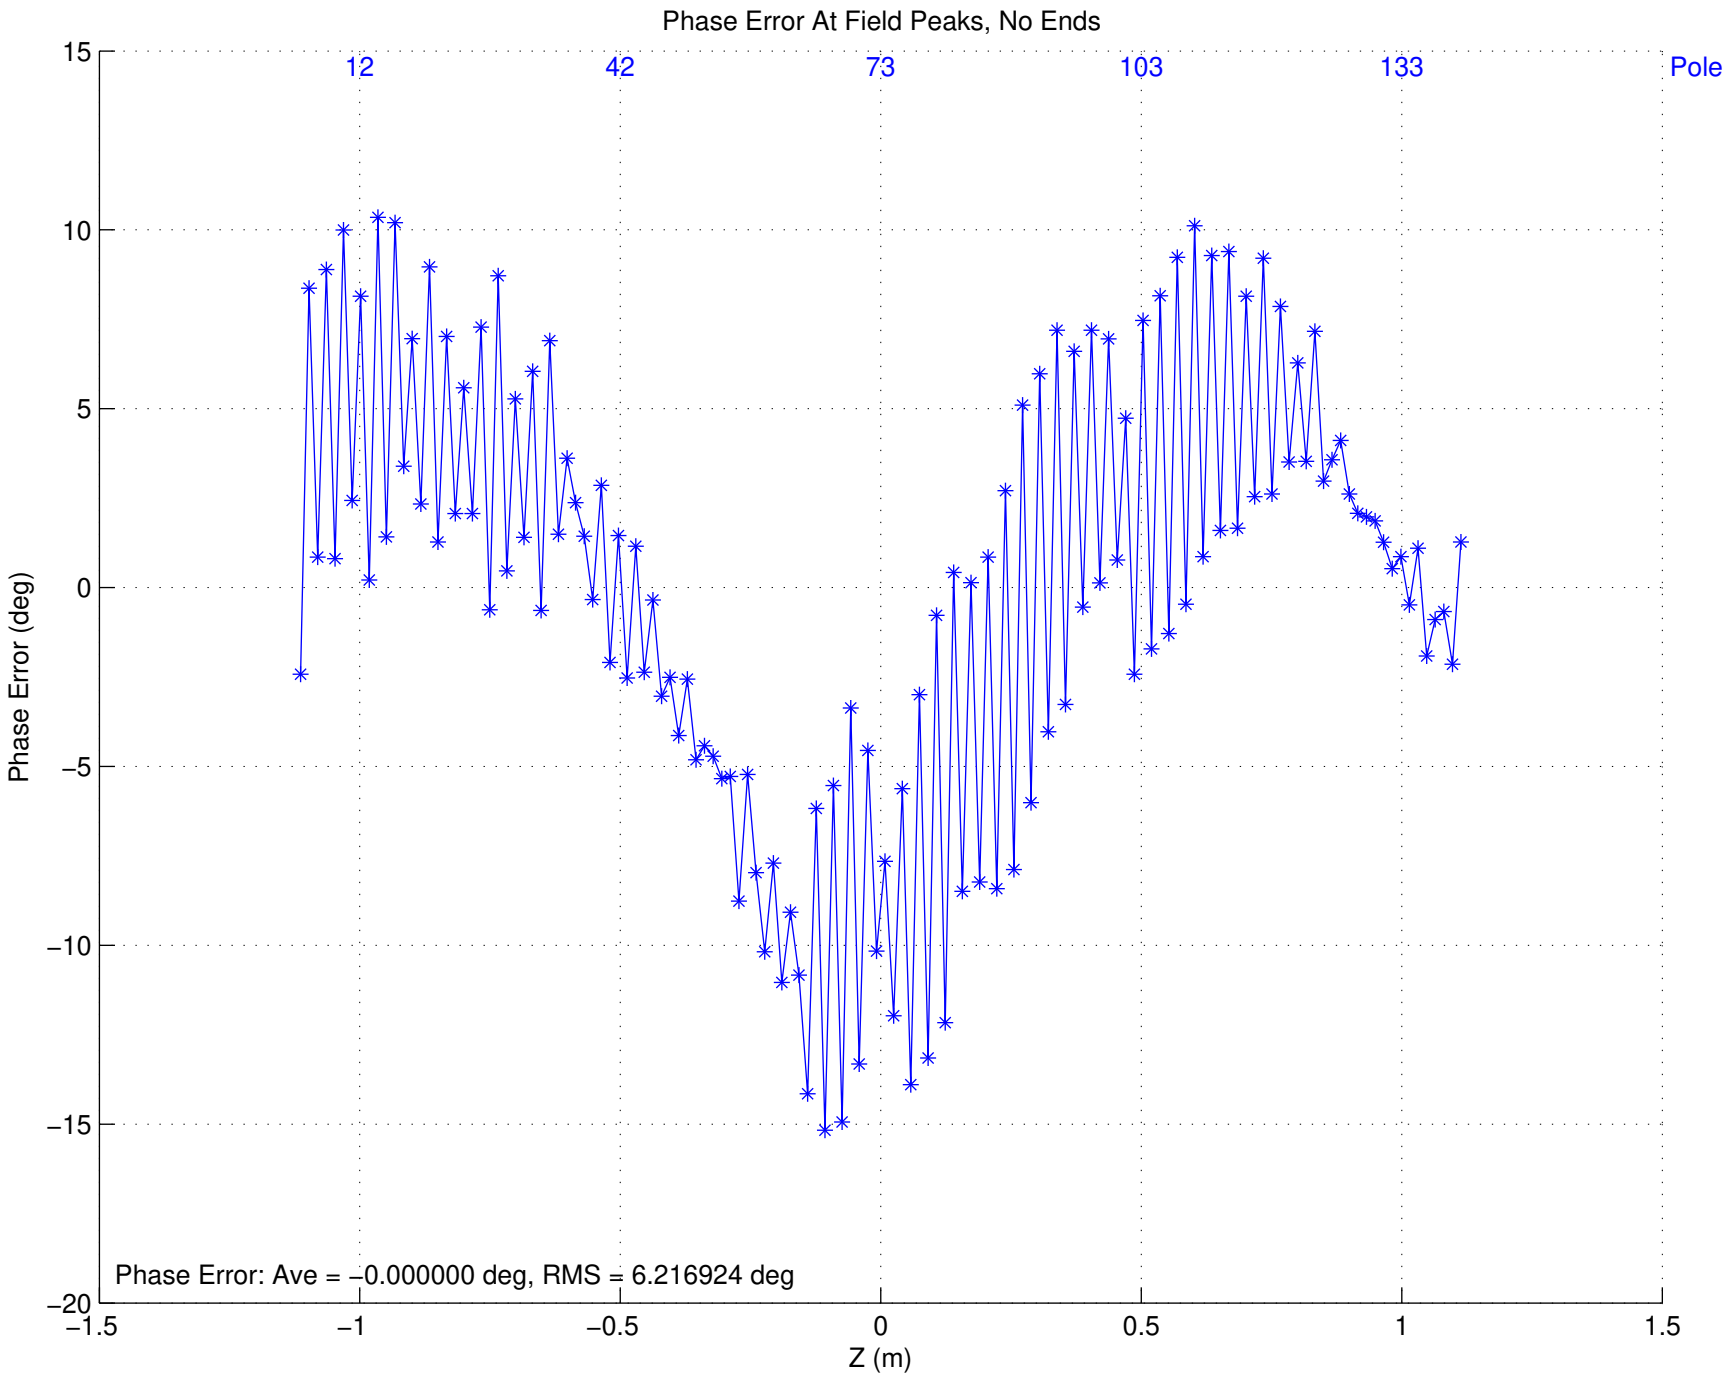
Phase Error At Field Peaks, No Ends
12
42
73
103
133
Pole
15
10
5
0
−5
−10
−15
−20
Phase Error (deg)
−1.5
−1
−0.5
0
0.5
1
1.5
Z (m)
Phase Error: Ave = −0.000000 deg, RMS = 6.216924 deg

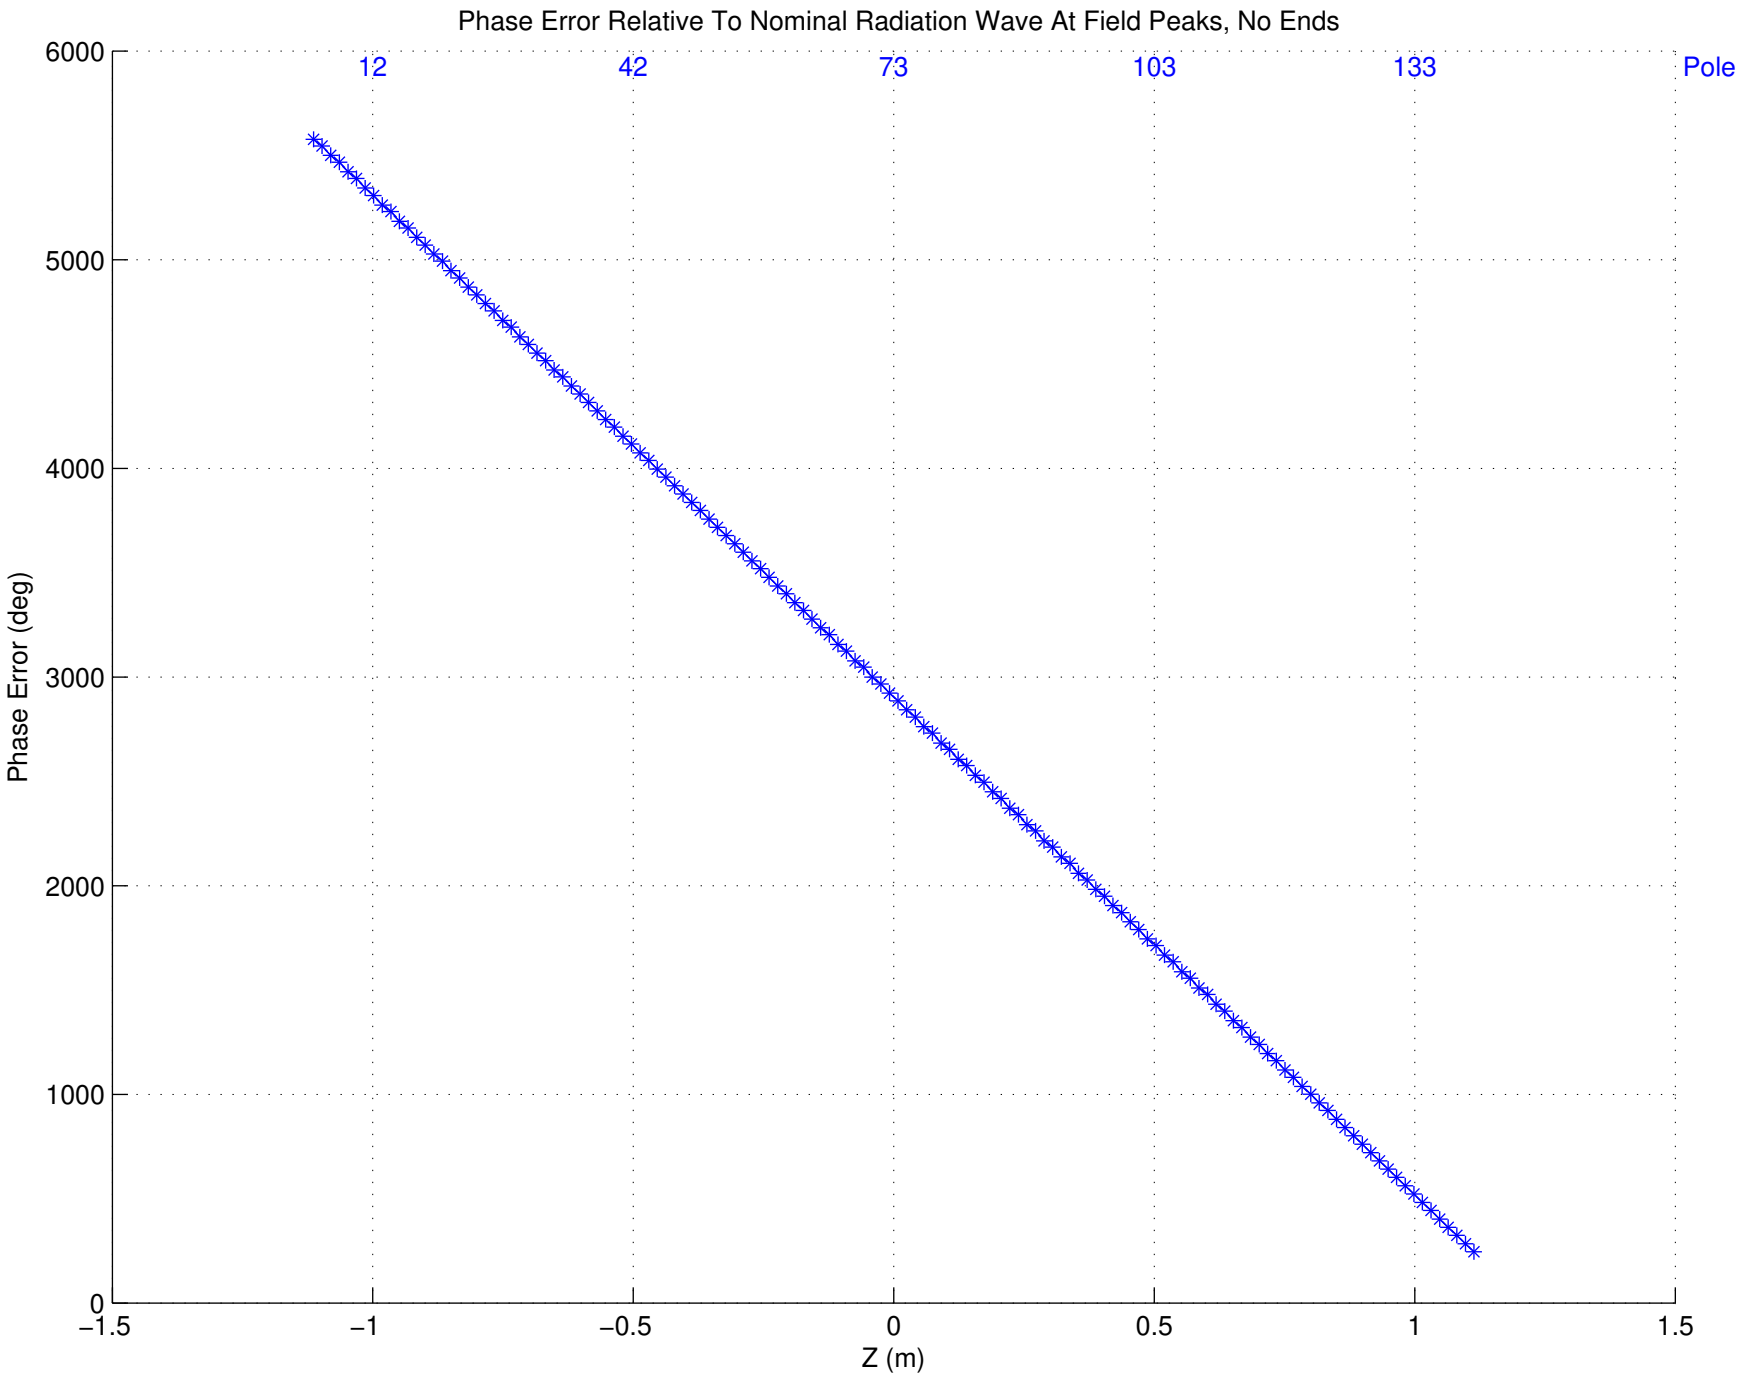
Phase Error Relative To Nominal Radiation Wave At Field Peaks, No Ends
12
42
73
103
133
Pole
6000
5000
4000
3000
2000
1000
0
Phase Error (deg)
−1.5
−1
−0.5
0
0.5
1
1.5
Z (m)

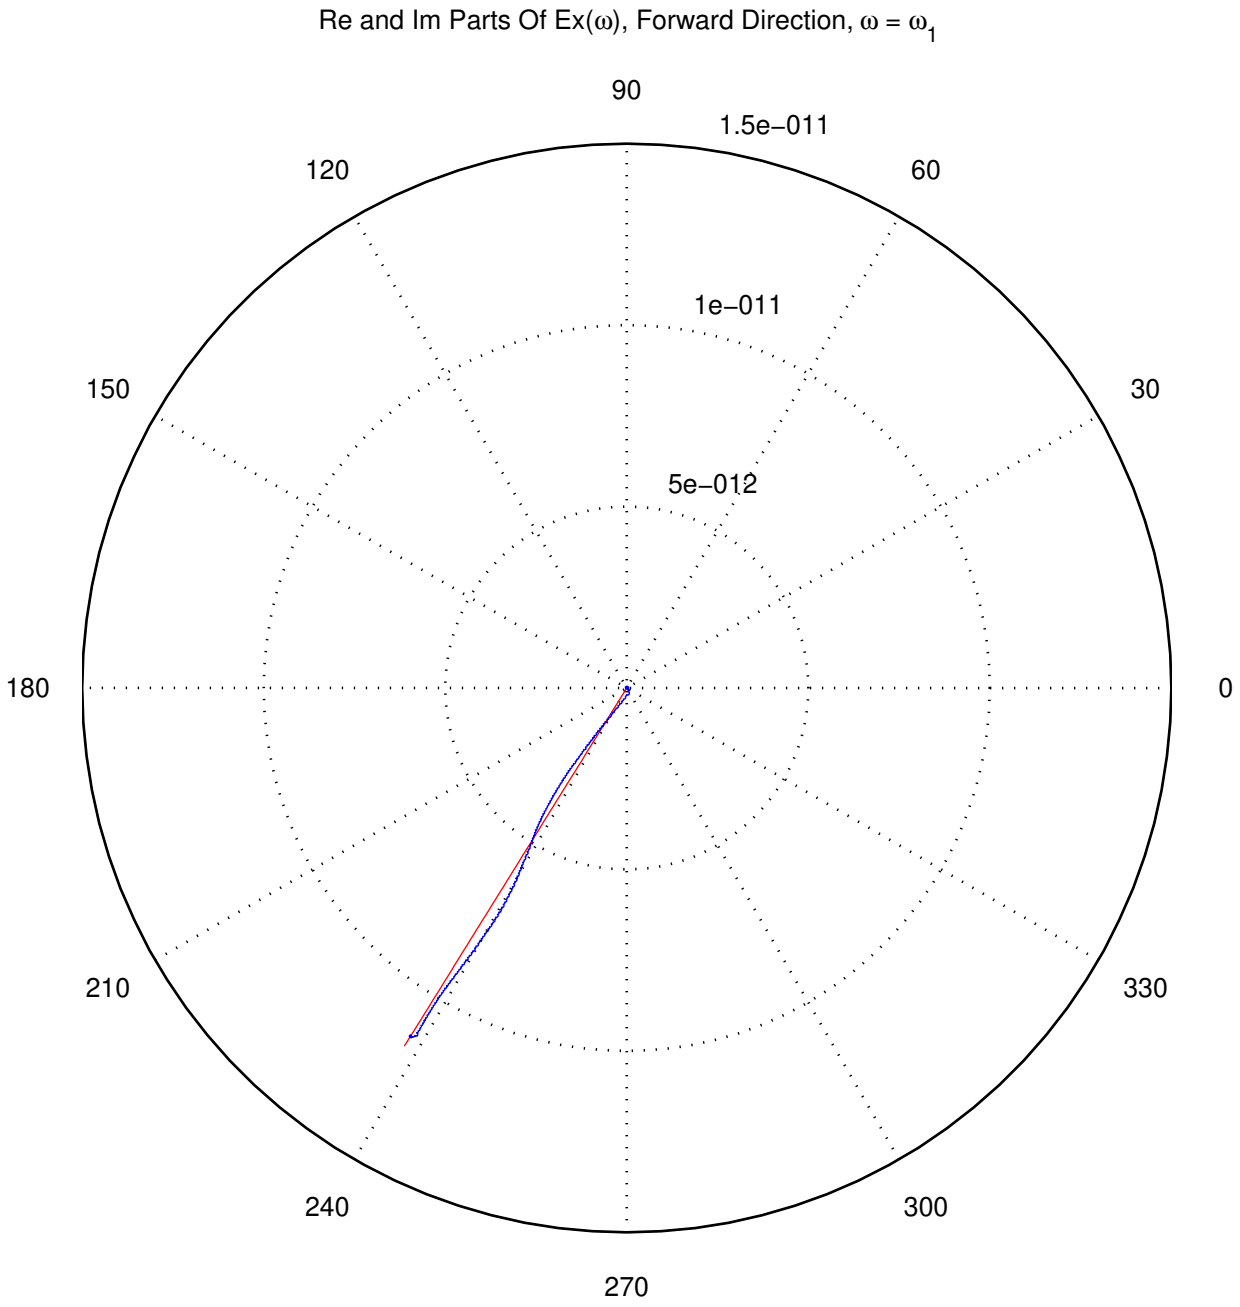
Re and Im Parts Of Ex(ω), Forward Direction, ω = ω1
90
1.5e−011
120
60
1e−011
150
30
5e−012
180
0
210
330
240
300
270

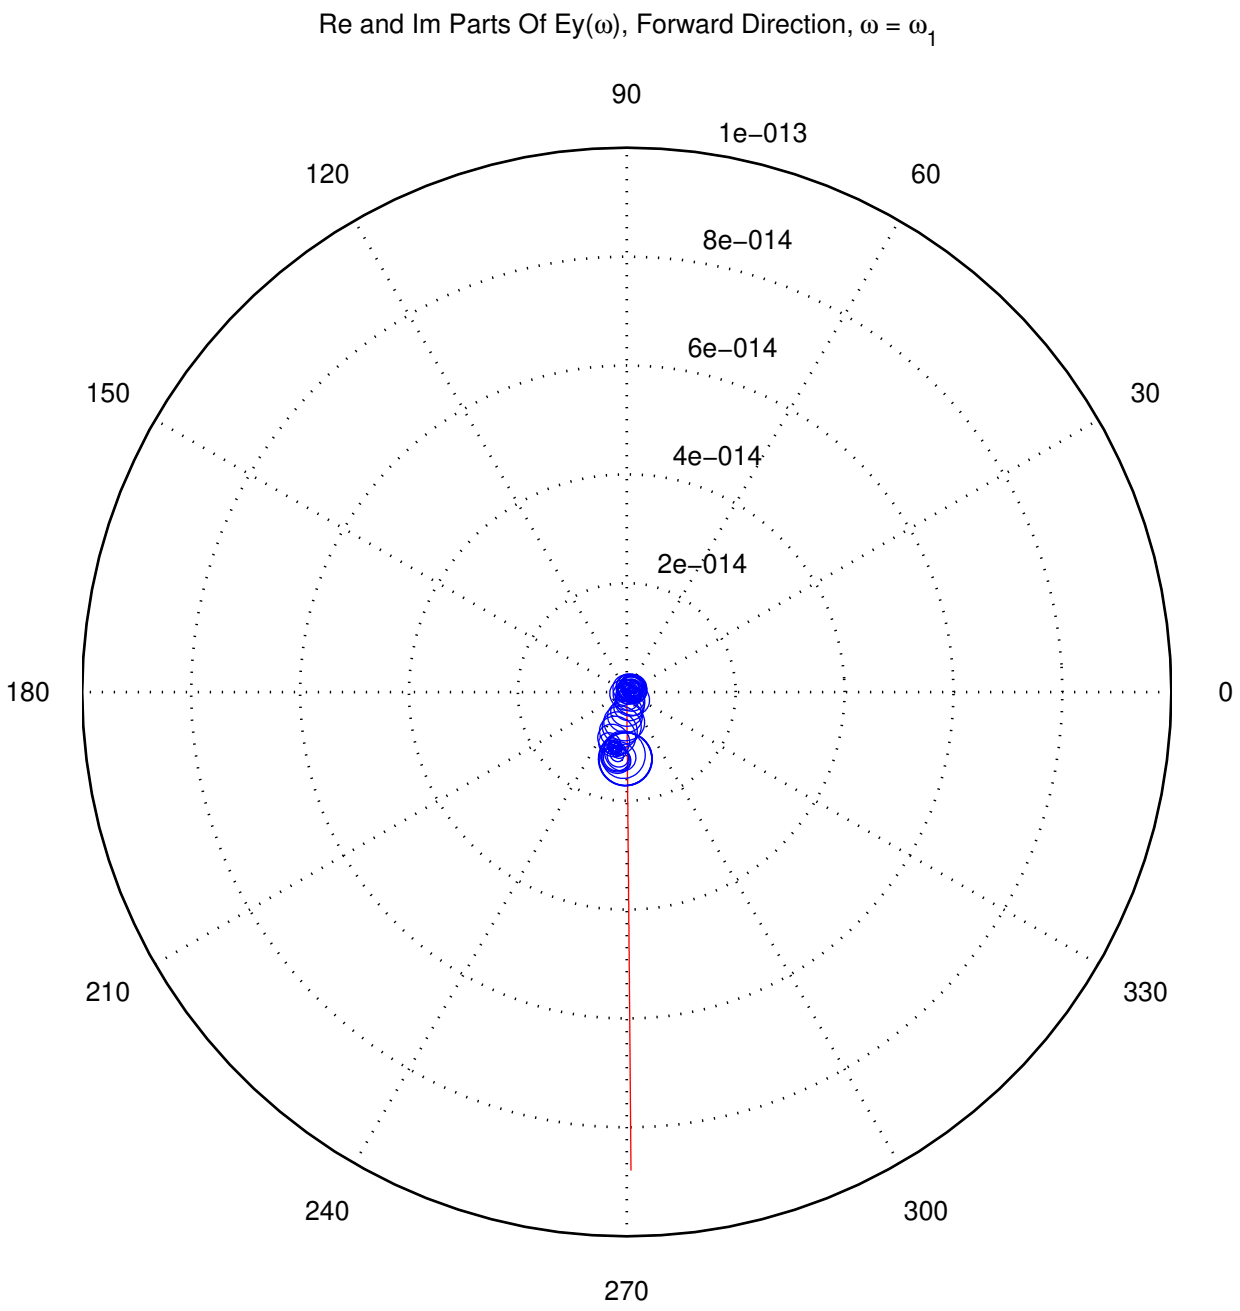
Re and Im Parts Of Ey(ω), Forward Direction, ω = ω1
90
1e−013
120
60
8e−014
6e−014
150
30
4e−014
2e−014
180
0
210
330
240
300
270

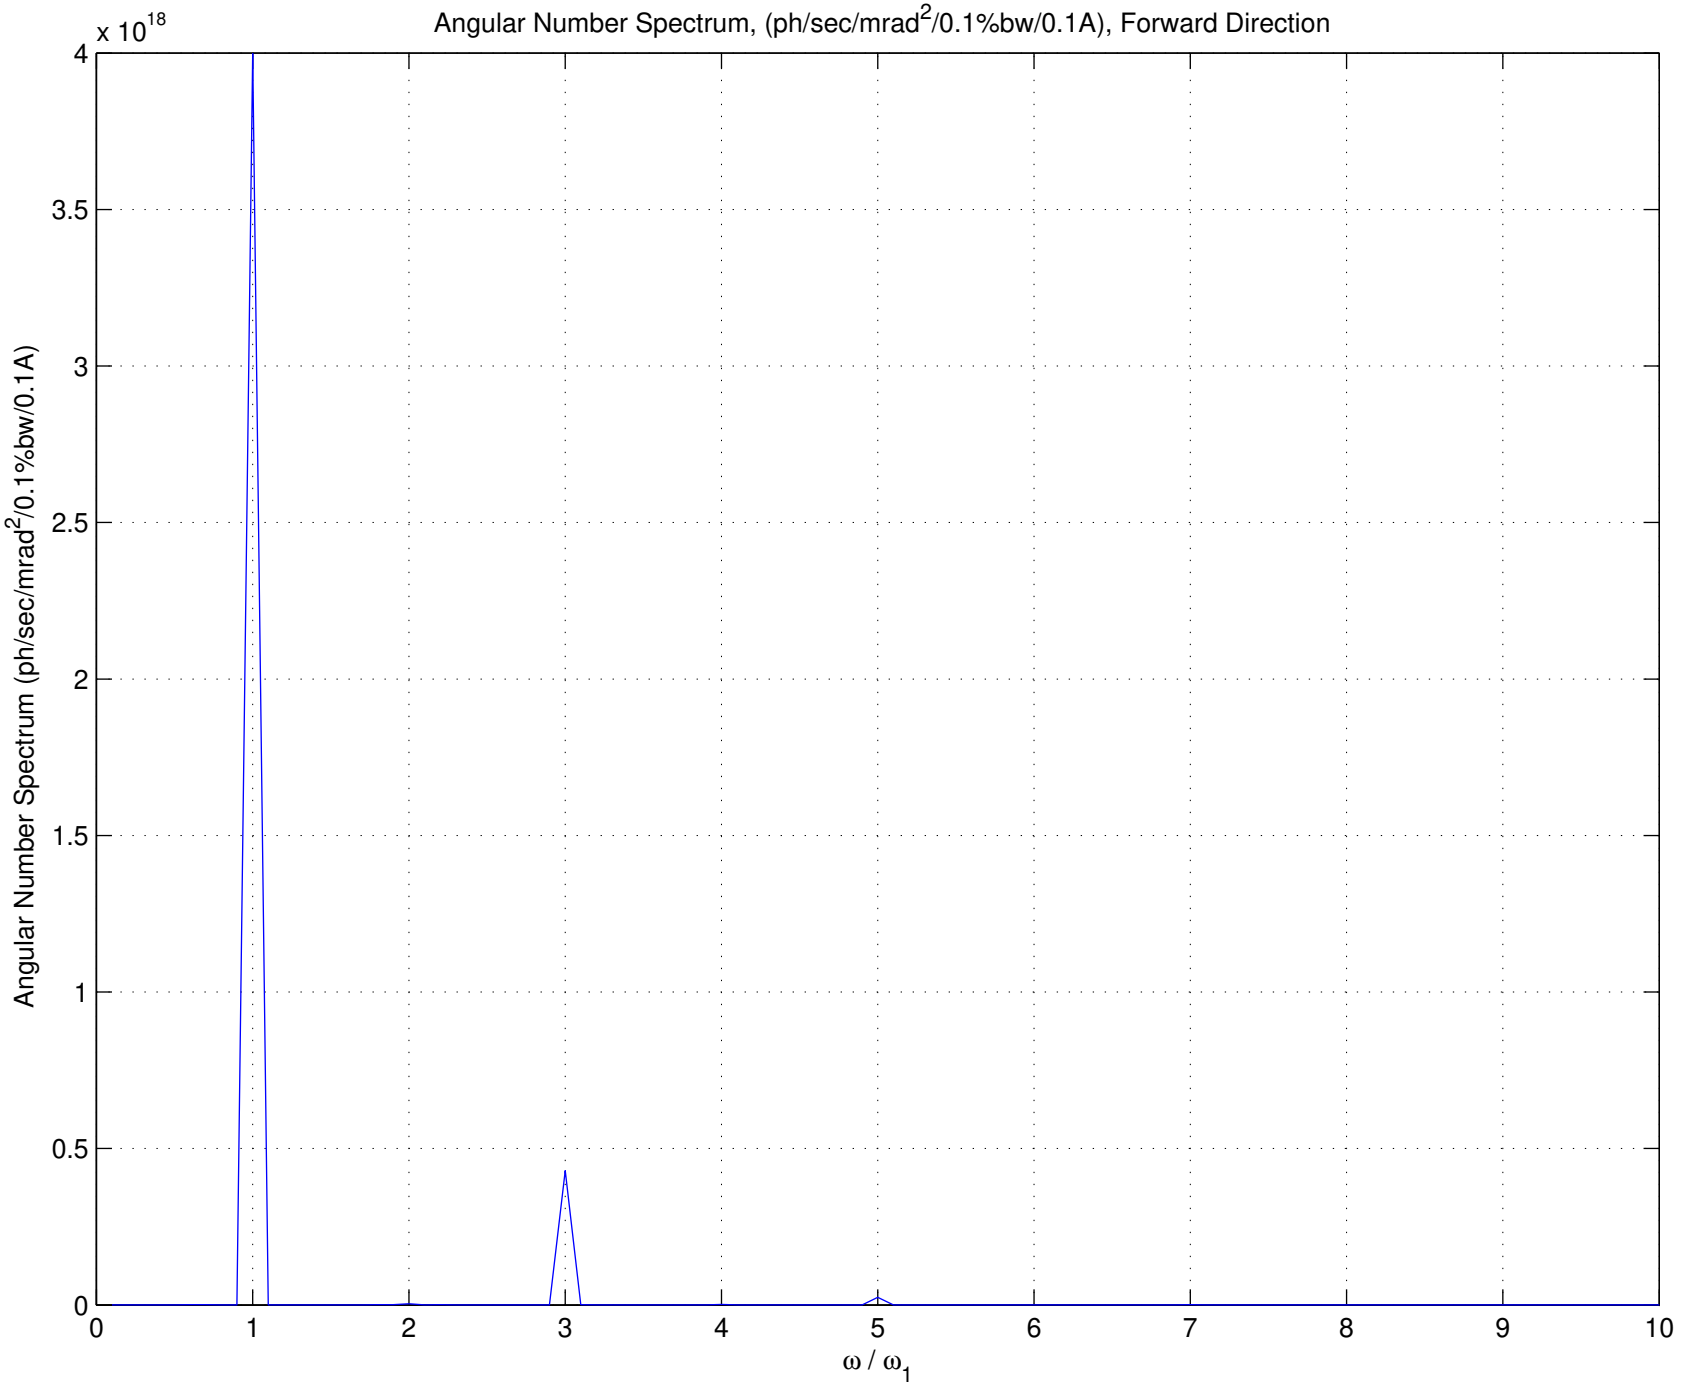
Angular Number Spectrum, (ph/sec/mrad2/0.1%bw/0.1A), Forward Direction
x 10^18
Angular Number Spectrum (ph/sec/mrad2/0.1%bw/0.1A)
ω / ω1
0
0.5
1
1.5
2
2.5
3
3.5
4
0
1
2
3
4
5
6
7
8
9
10

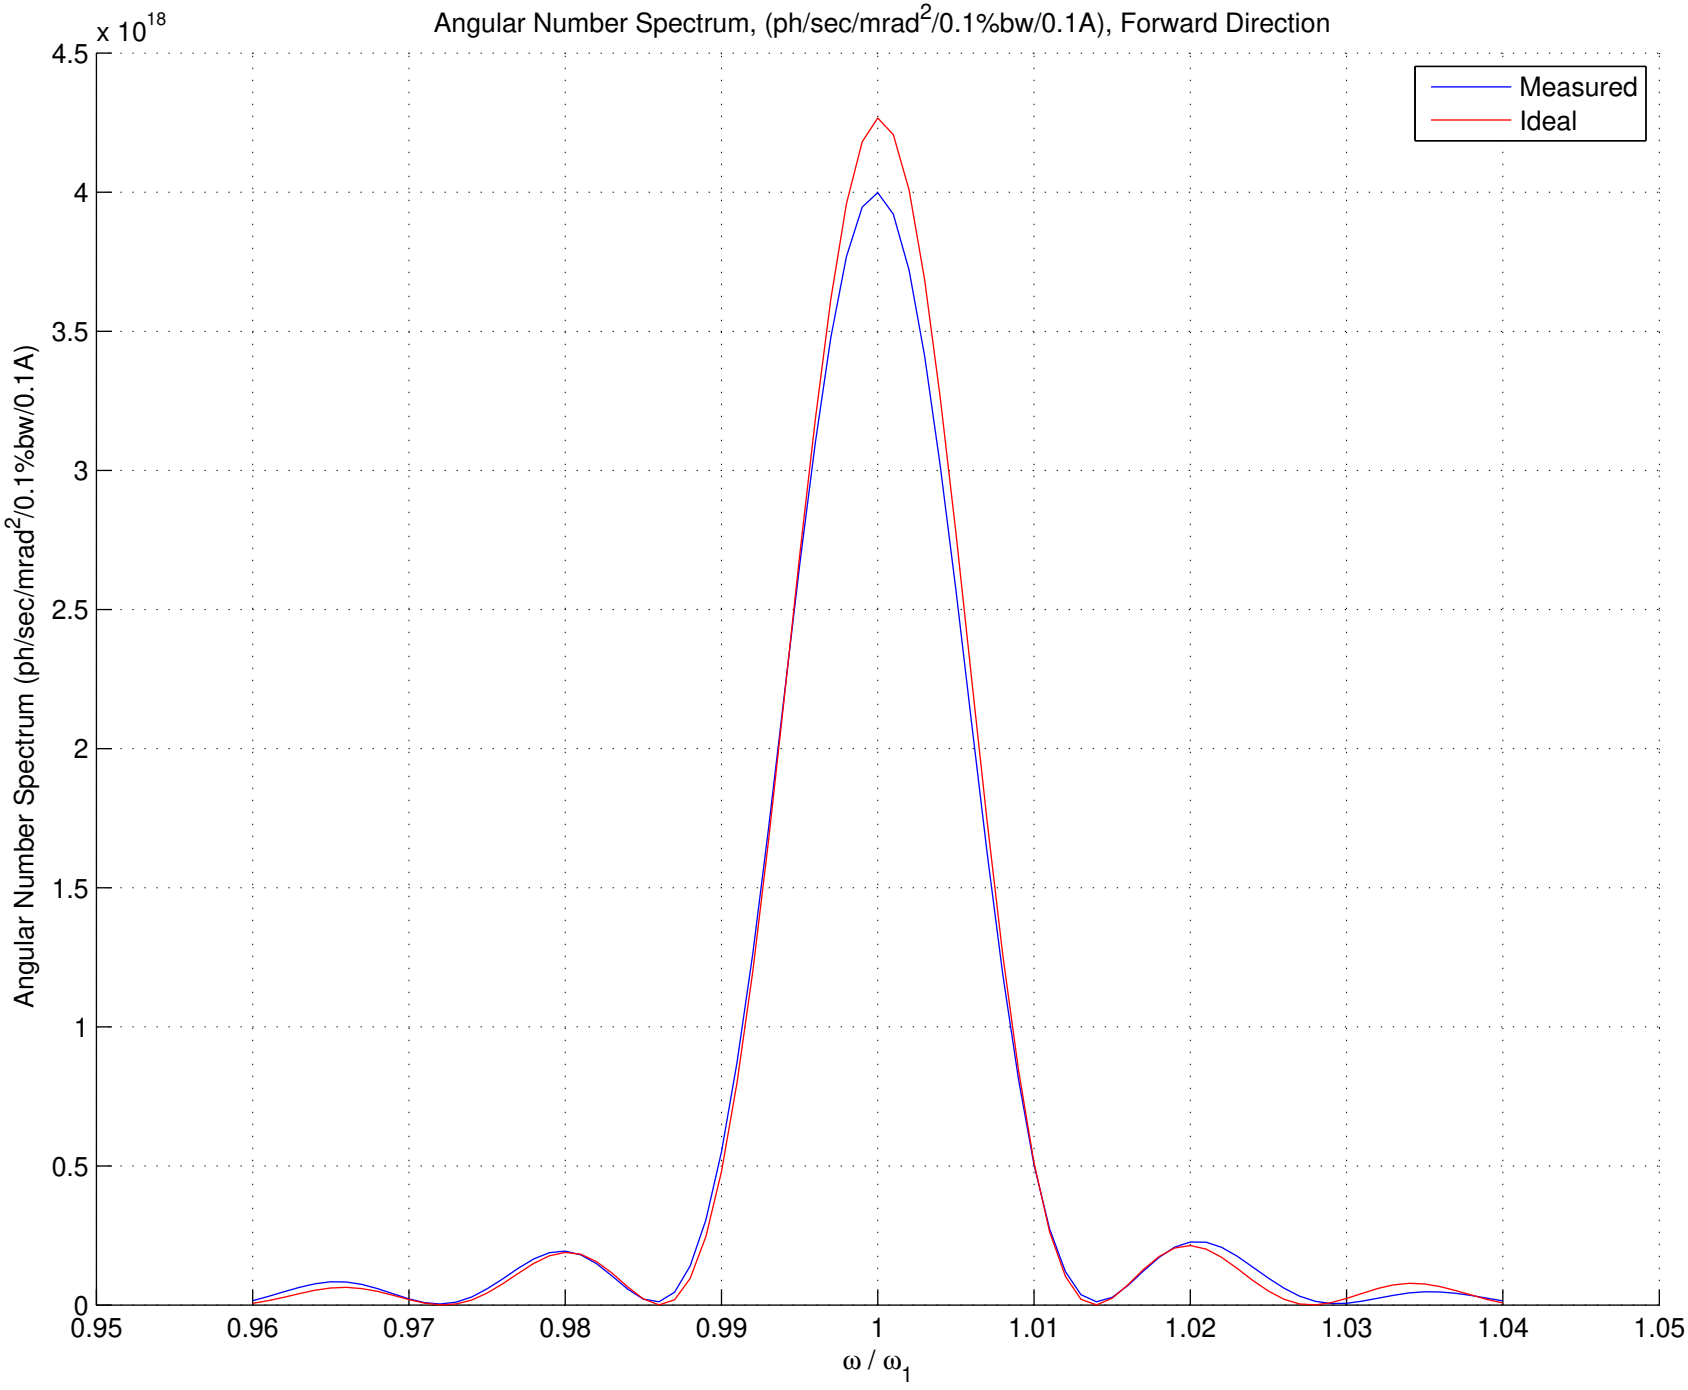
Angular Number Spectrum, (ph/sec/mrad^2/0.1%bw/0.1A), Forward Direction
x 10^{18}
Measured
Ideal
Angular Number Spectrum (ph/sec/mrad^2/0.1%bw/0.1A)
ω / ω_1
4.5
4
3.5
3
2.5
2
1.5
1
0.5
0
0.95
0.96
0.97
0.98
0.99
1
1.01
1.02
1.03
1.04
1.05

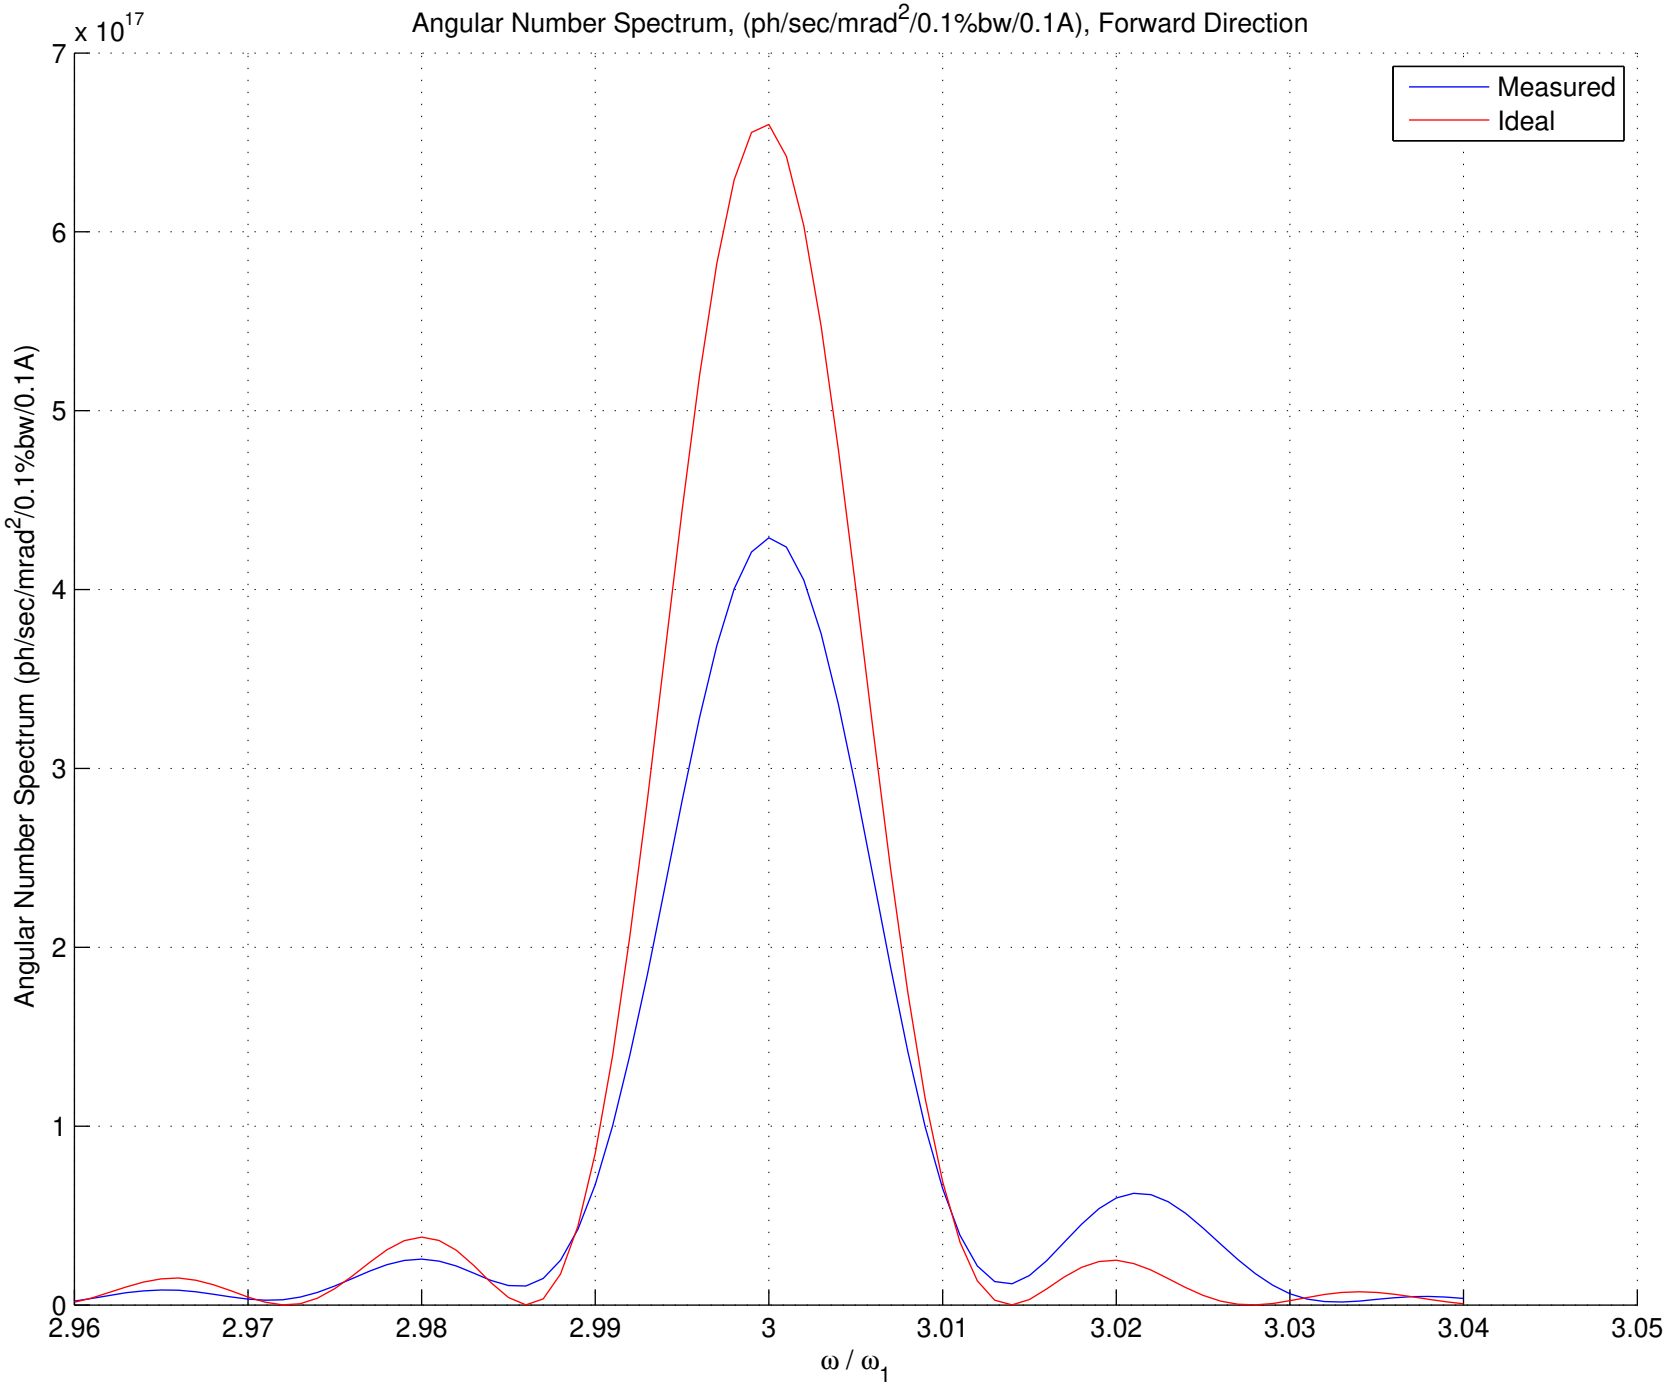
Angular Number Spectrum, (ph/sec/mrad2/0.1%bw/0.1A), Forward Direction
x 10^17
Angular Number Spectrum (ph/sec/mrad2/0.1%bw/0.1A)
ω / ω1
Measured
Ideal
0
1
2
3
4
5
6
7
2.96
2.97
2.98
2.99
3
3.01
3.02
3.03
3.04
3.05

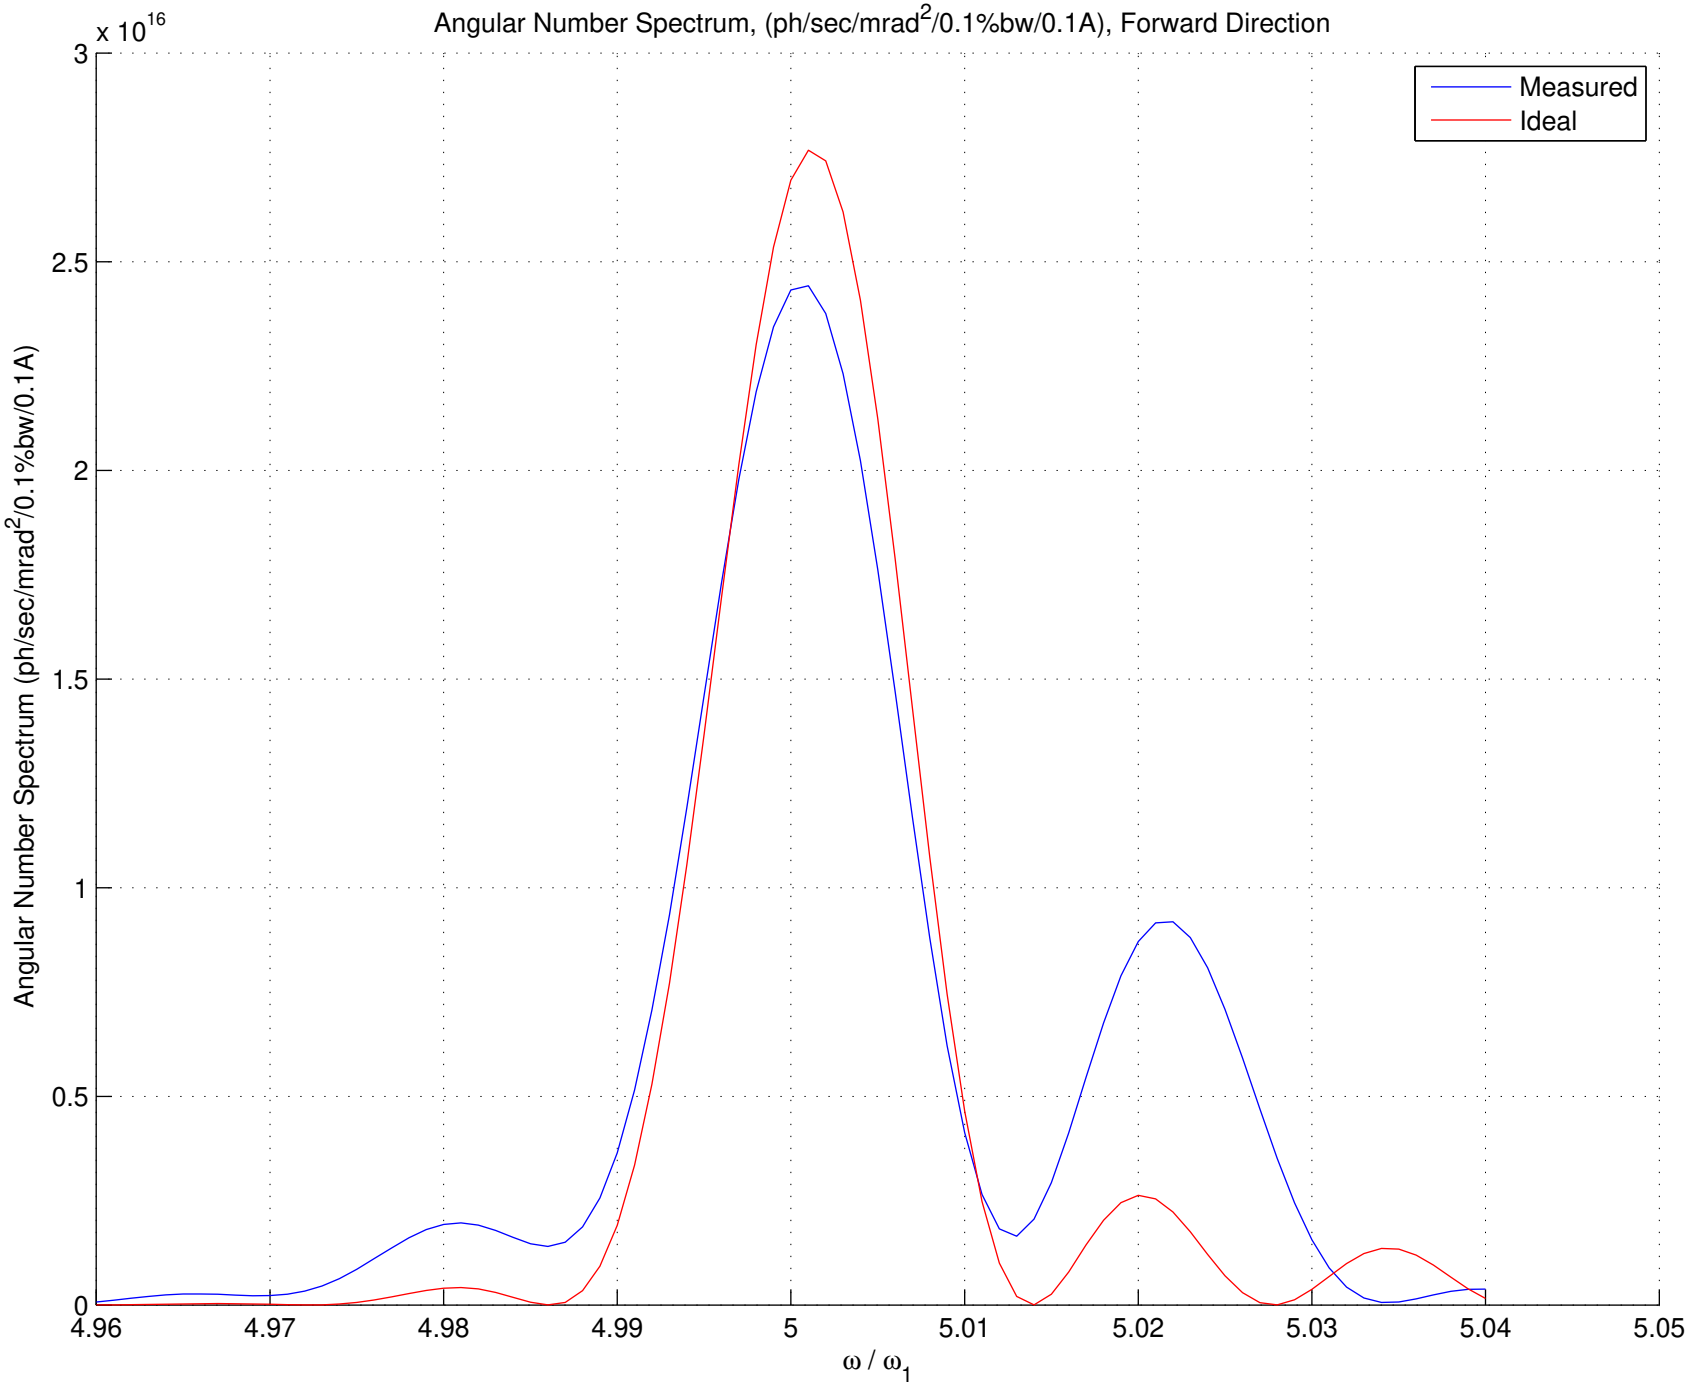
Angular Number Spectrum, (ph/sec/mrad^2/0.1%bw/0.1A), Forward Direction
x 10^{16}
Measured
Ideal
Angular Number Spectrum (ph/sec/mrad^2/0.1%bw/0.1A)
3
2.5
2
1.5
1
0.5
0
4.96
4.97
4.98
4.99
5
5.01
5.02
5.03
5.04
5.05
ω / $ω_1$