SLAC Magnetic Measurements

Planar Insertion Device Shim Analysis

Parameters:
INPUT−FILE−DIR =S:\Magdata\Lcls\Undulator\L143−112000−12\DATASET0001\Rough Tuning\Z Scans\Run 007\
INPUT−FILE−NAME =x+00000−y+000−bscanz.dat
INPUT−FILE−TYPE =ZVXYBXYH
CORR−REQUIRED =1
GAMMA =26637.77
NOM−LAMBDA−U =0.03
NOM−K−VALUE =3.4881
NOM−LAMBDA−R =1.4974e−010
NUM−POLES =226
NUM−END−POLES =4
CELL−LENGTH =3.656

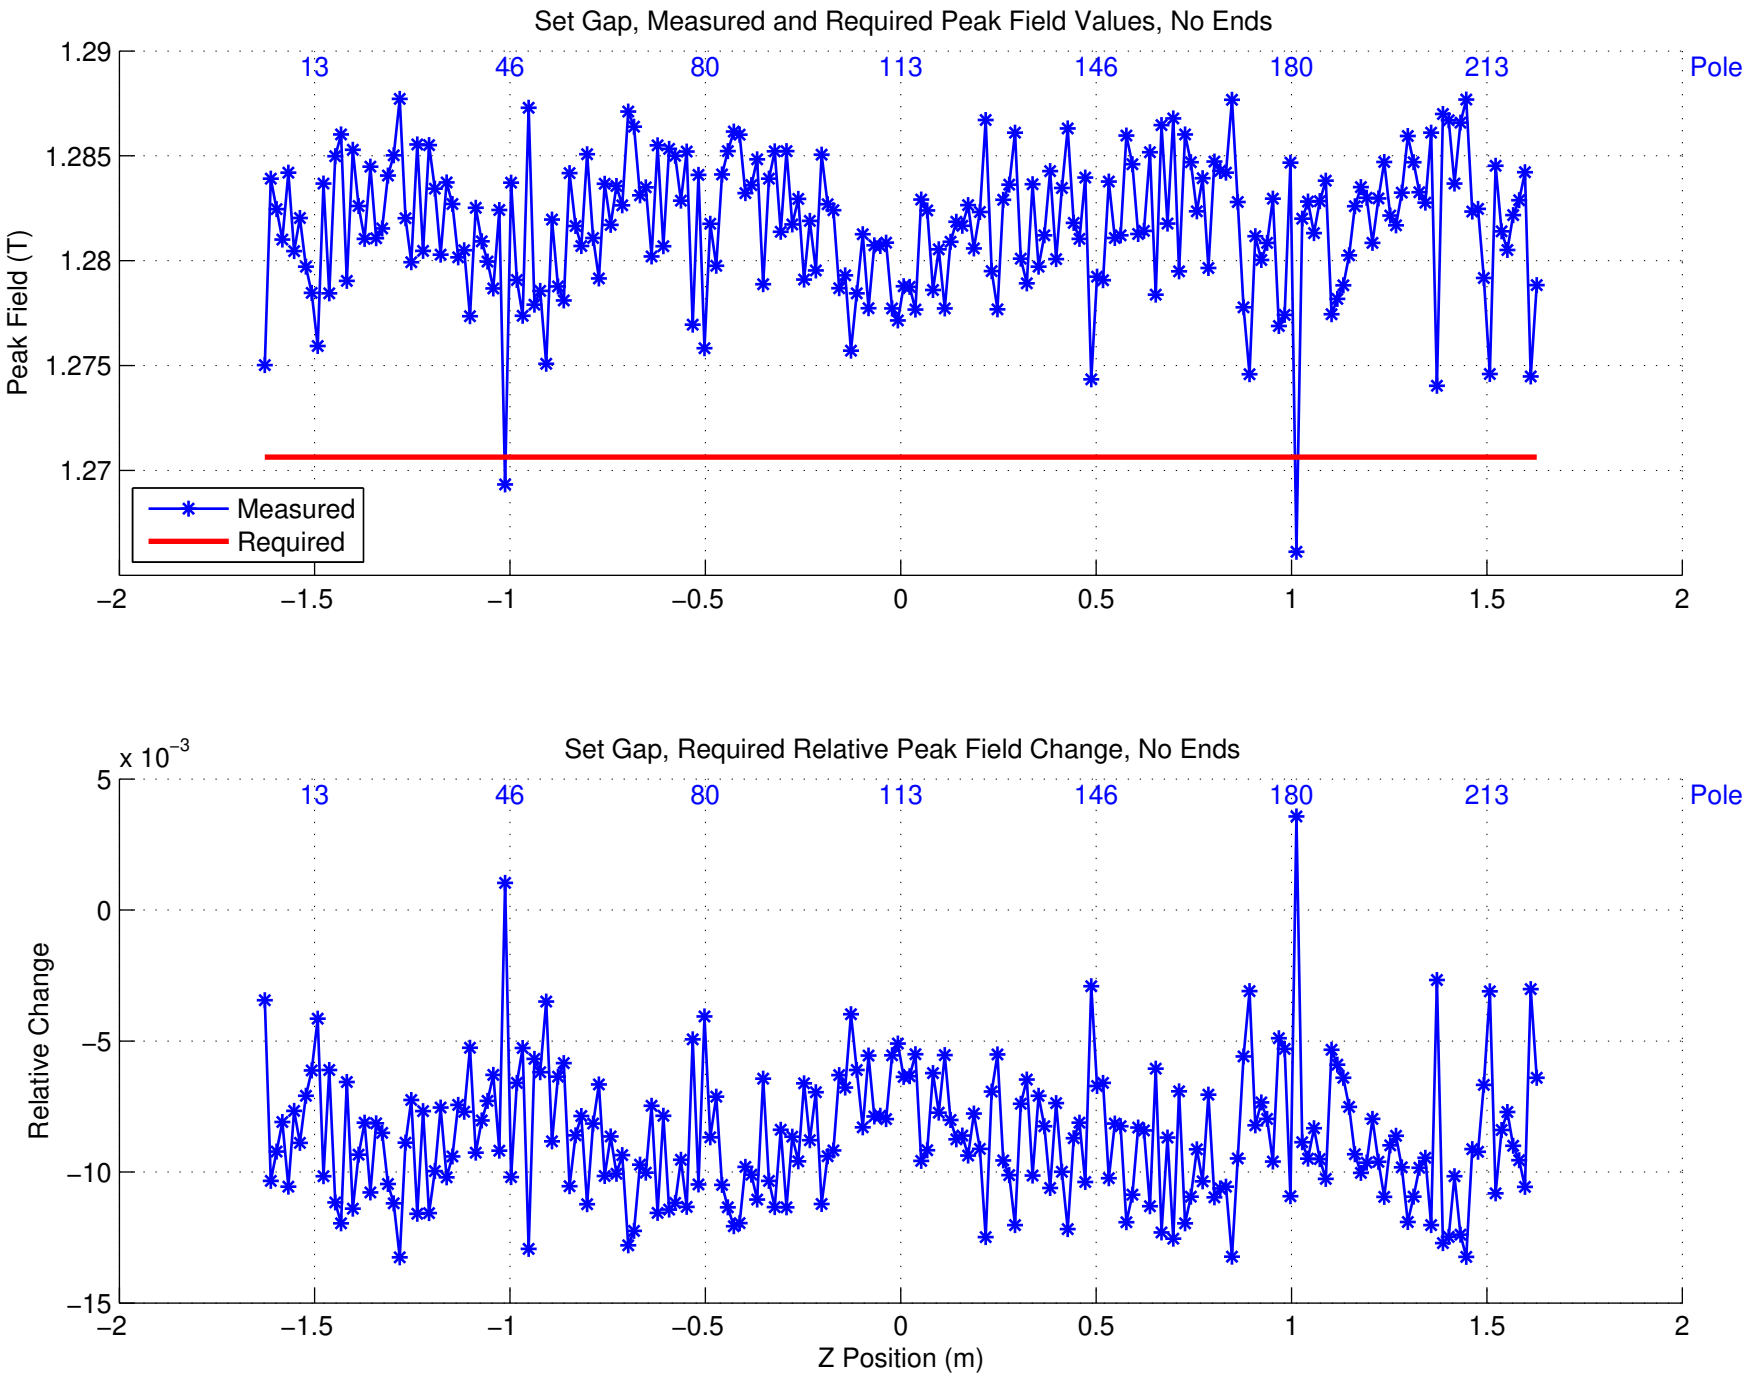
Set Gap, Measured and Required Peak Field Values, No Ends
Peak Field (T)
1.29
1.285
1.28
1.275
1.27
13
46
80
113
146
180
213
Pole
Measured
Required
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Set Gap, Required Relative Peak Field Change, No Ends
x 10^−3
Relative Change
5
0
−5
−10
−15
Z Position (m)

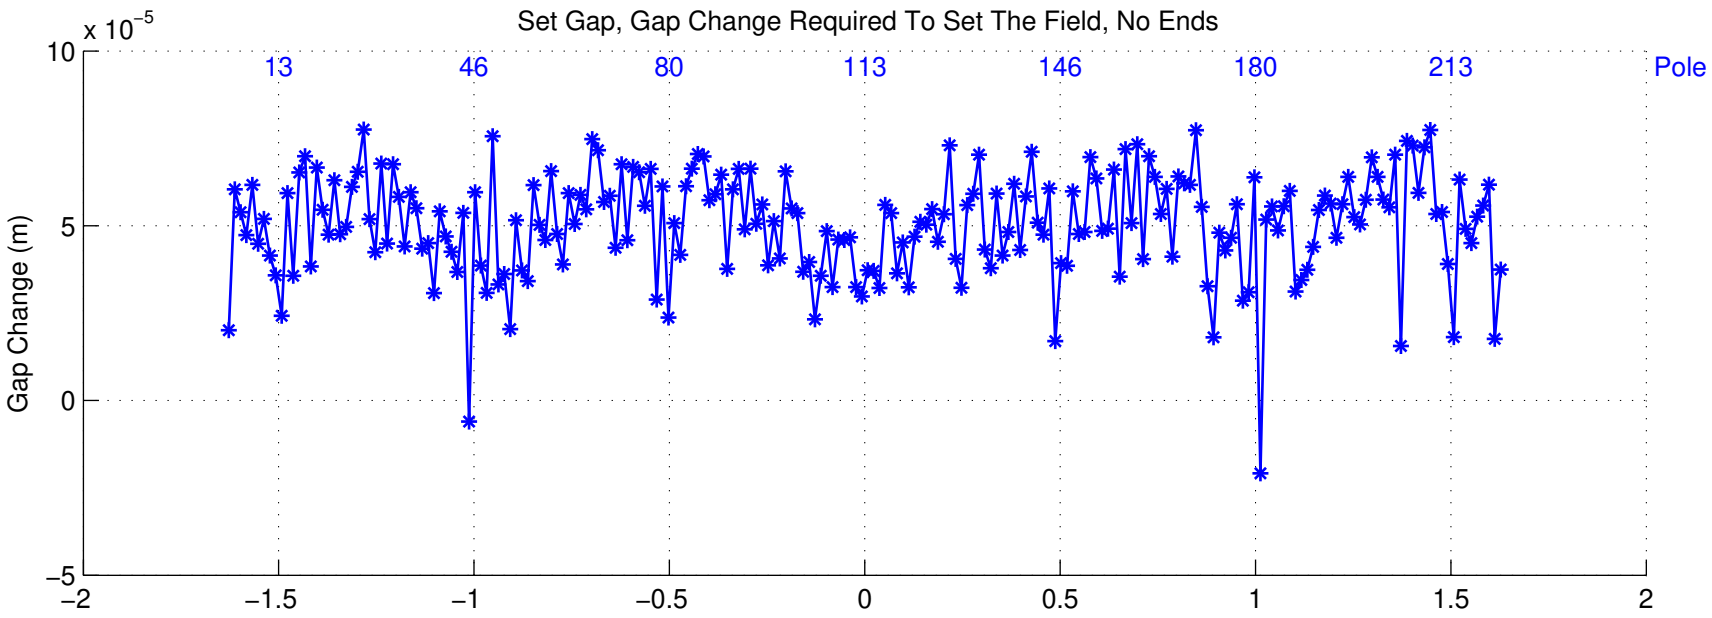
Set Gap, Gap Change Required To Set The Field, No Ends
x 10^-5
Gap Change (m)
13
46
80
113
146
180
213
Pole
10
5
0
−5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

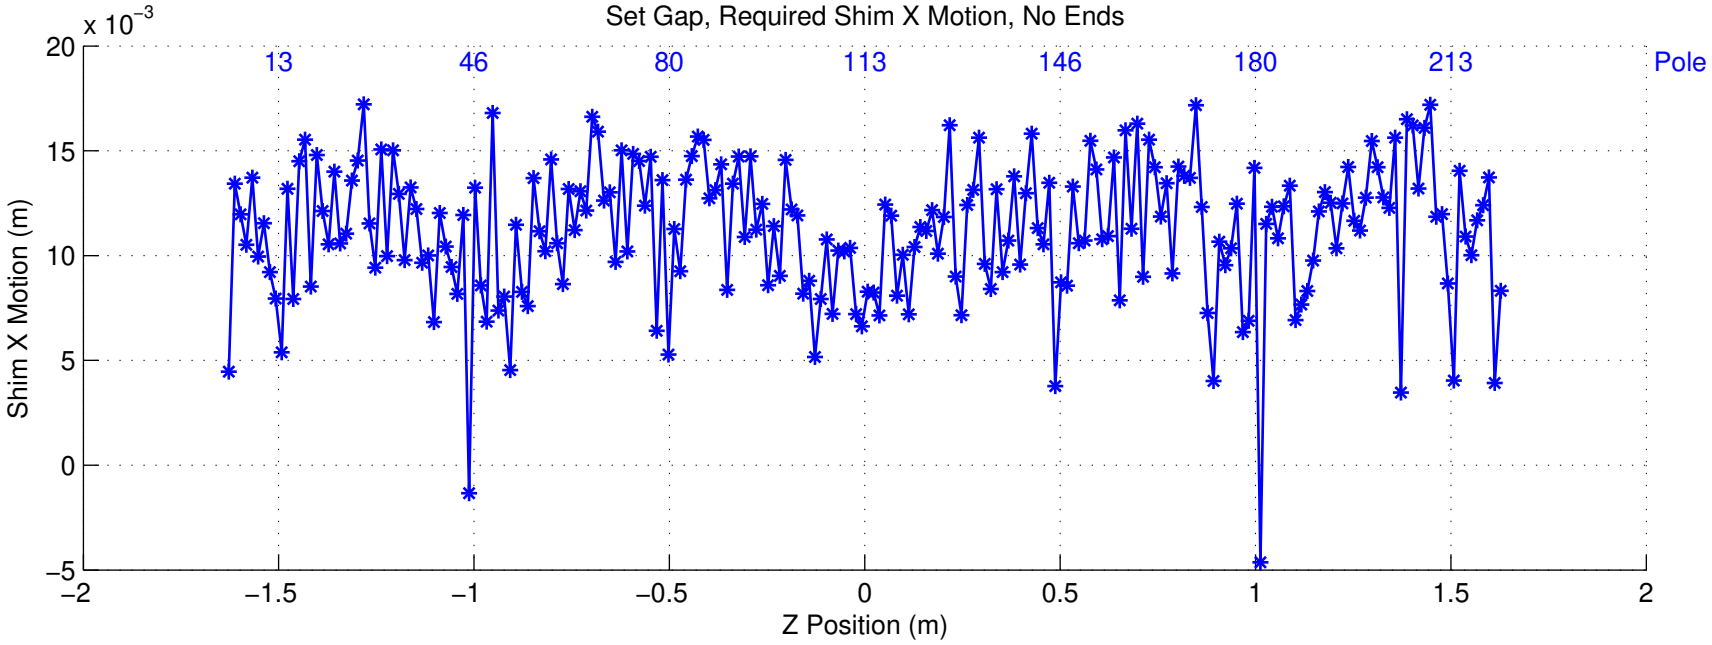
Set Gap, Required Shim X Motion, No Ends
x 10^-3
Shim X Motion (m)
13
46
80
113
146
180
213
Pole
20
15
10
5
0
−5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

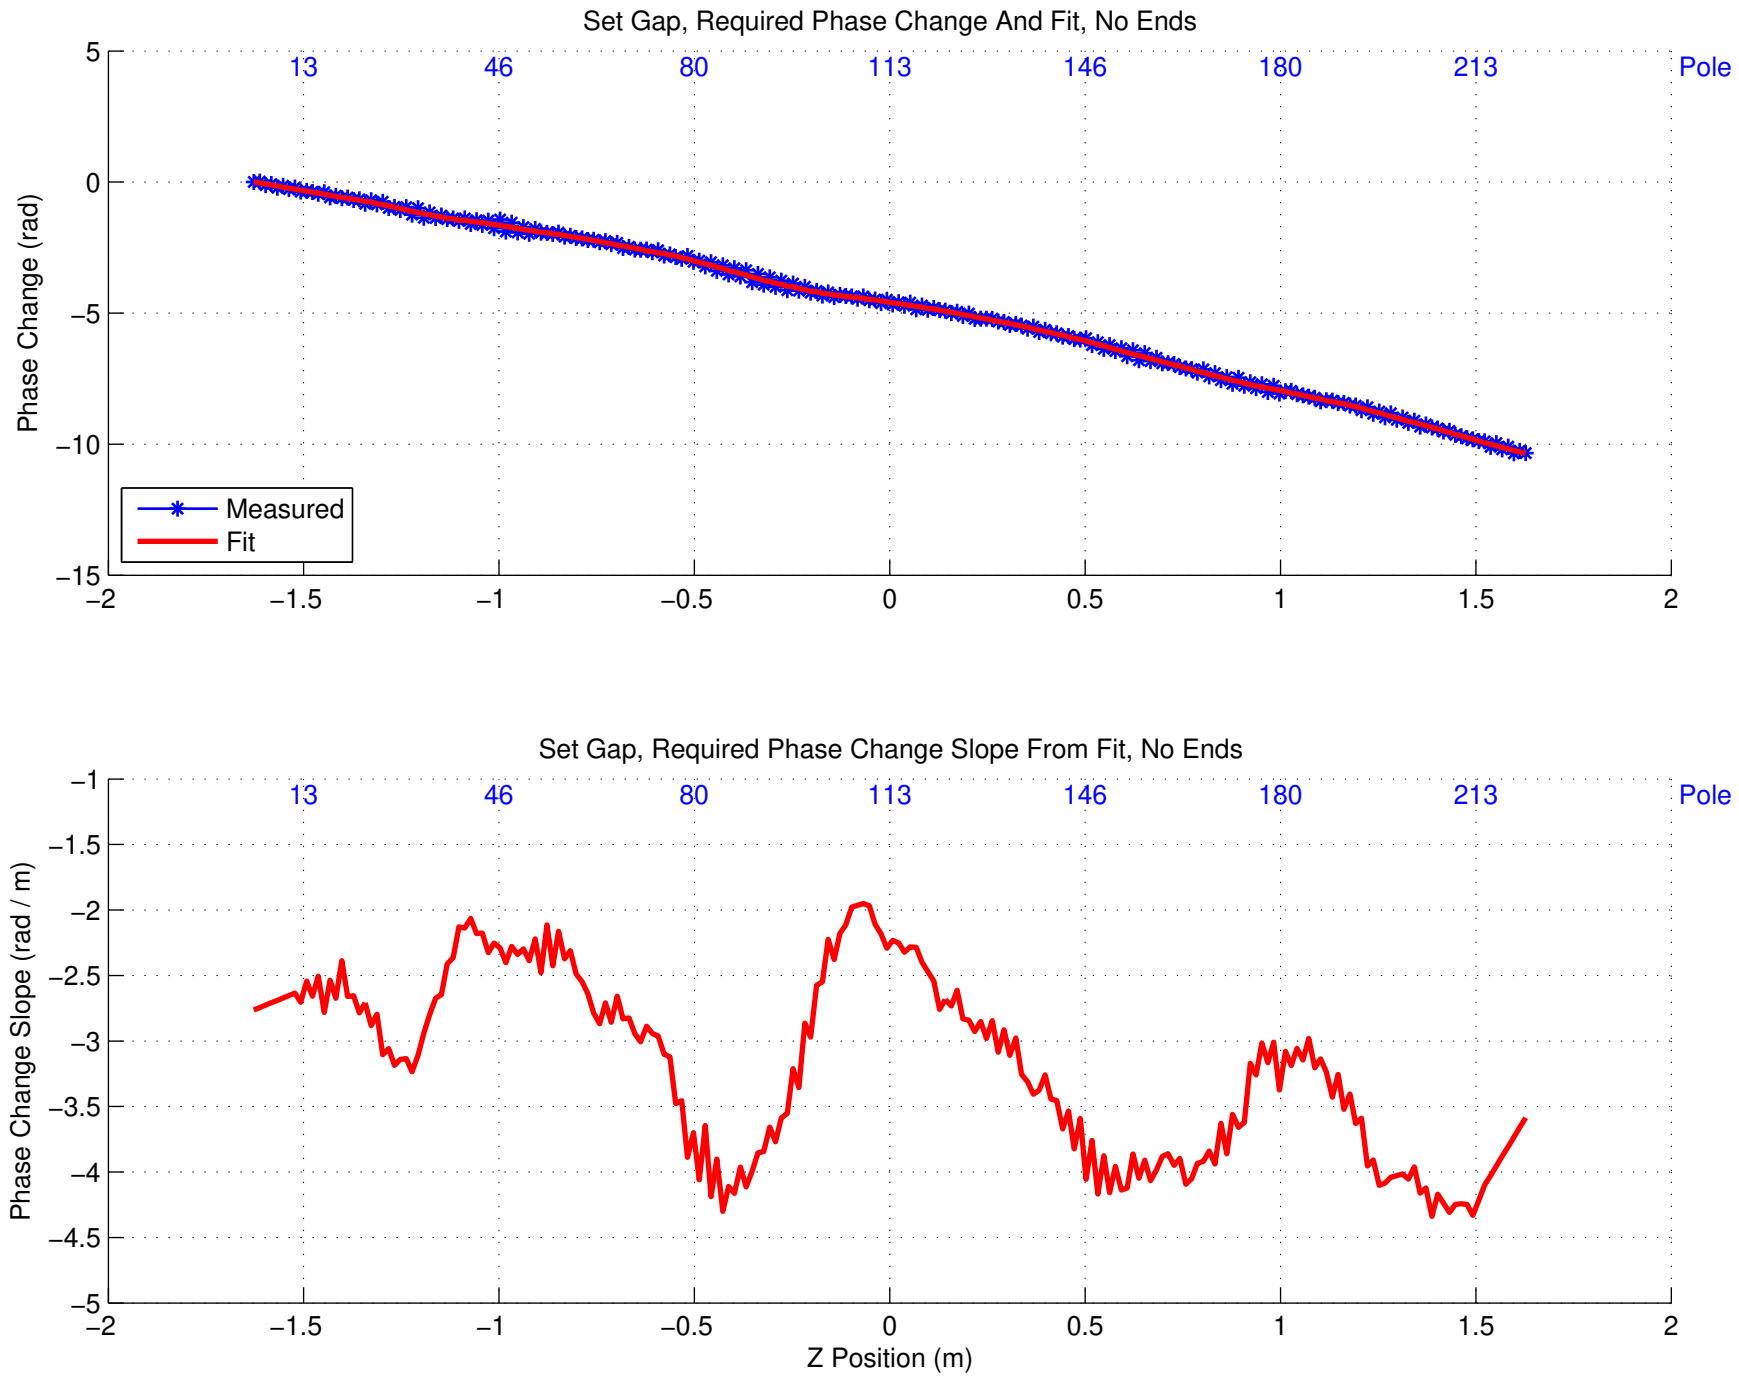
Set Gap, Required Phase Change And Fit, No Ends
13
46
80
113
146
180
213
Pole
Phase Change (rad)
5
0
−5
−10
−15
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Measured
Fit
Set Gap, Required Phase Change Slope From Fit, No Ends
Phase Change Slope (rad / m)
−1
−1.5
−2
−2.5
−3
−3.5
−4
−4.5
−5
Z Position (m)

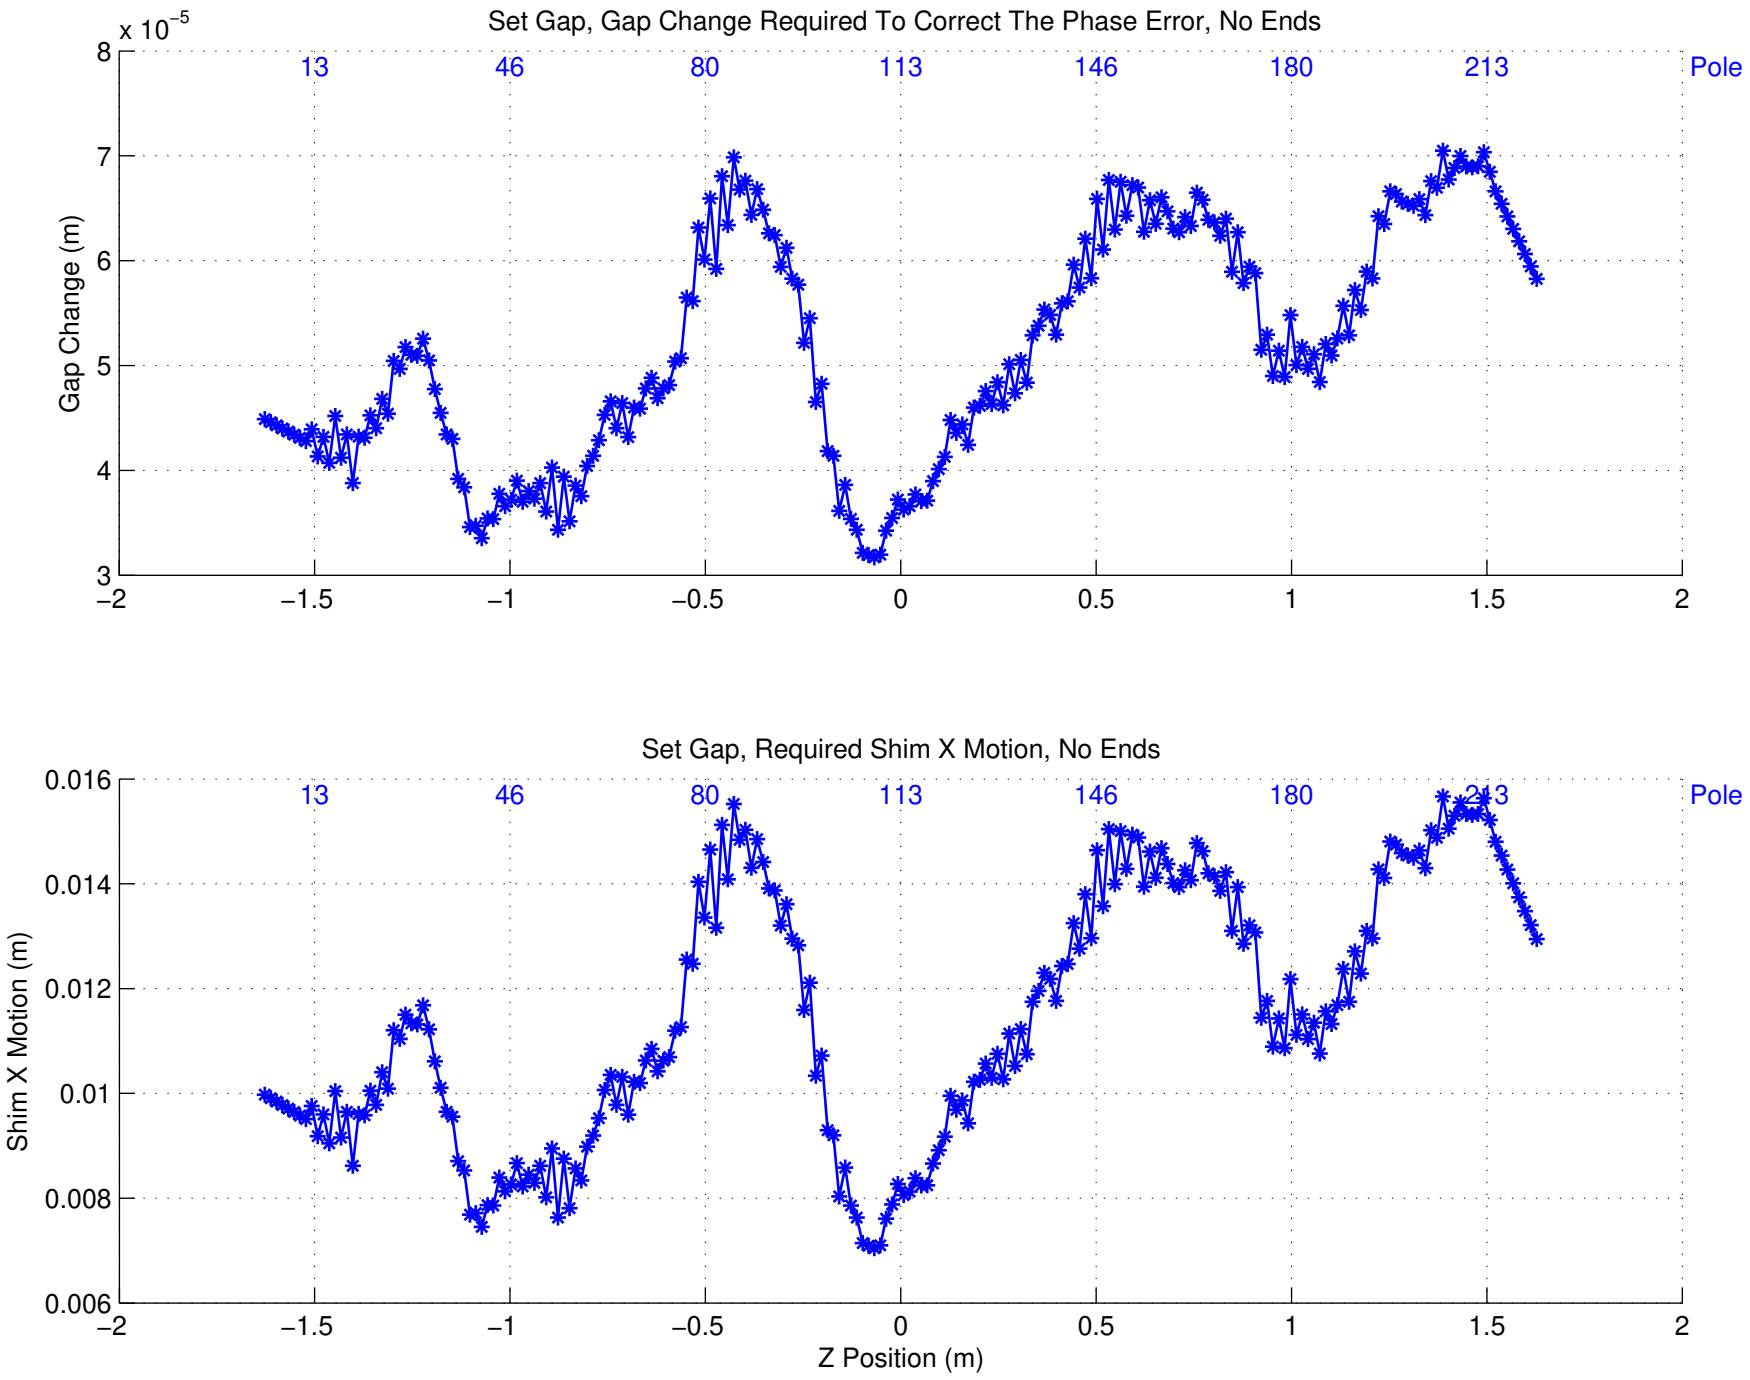
Set Gap, Gap Change Required To Correct The Phase Error, No Ends
x 10^-5
Gap Change (m)
8
7
6
5
4
3
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Set Gap, Required Shim X Motion, No Ends
Shim X Motion (m)
0.016
0.014
0.012
0.01
0.008
0.006
Z Position (m)

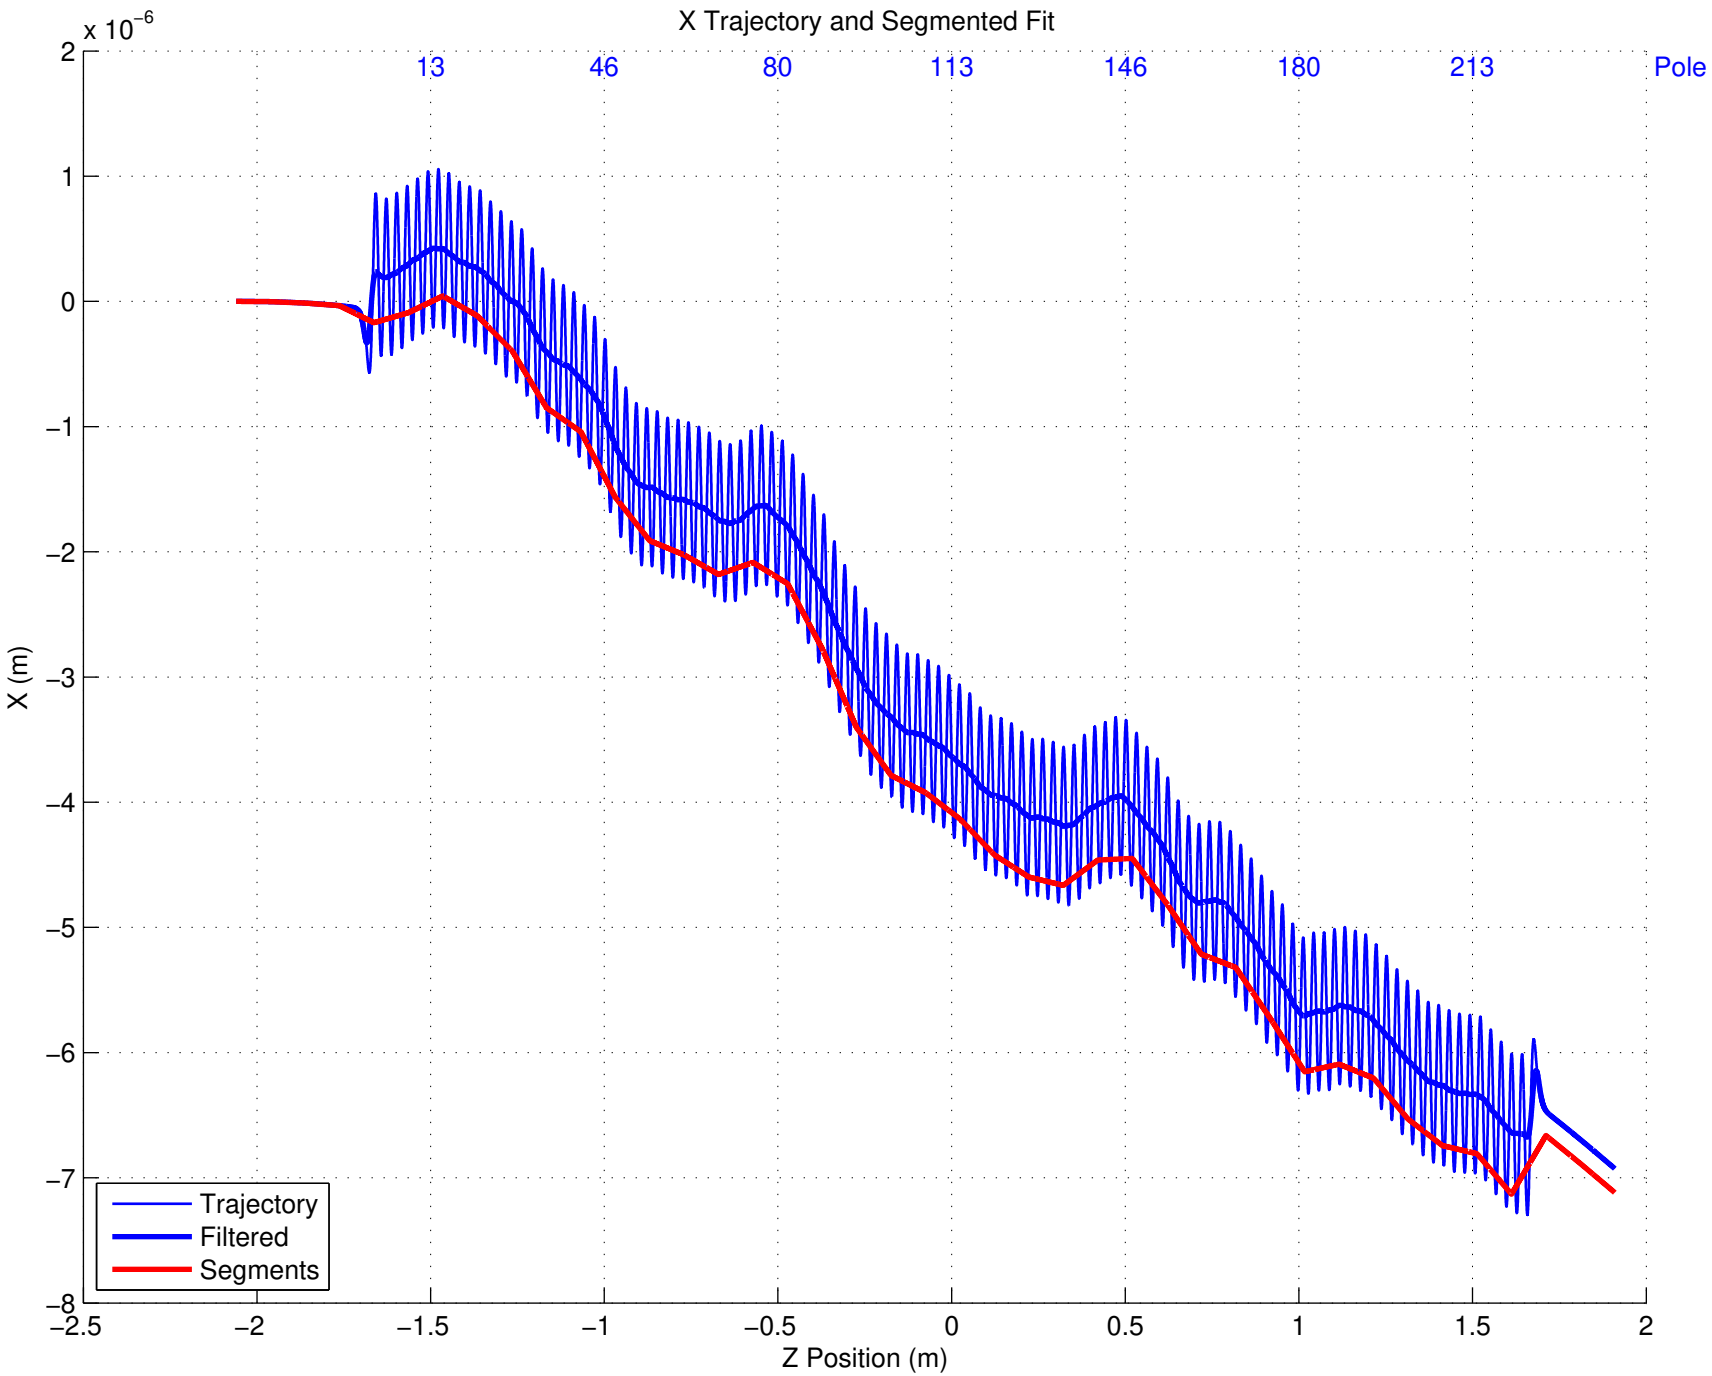
X Trajectory and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
2
1
0
−1
−2
−3
−4
−5
−6
−7
−8
X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

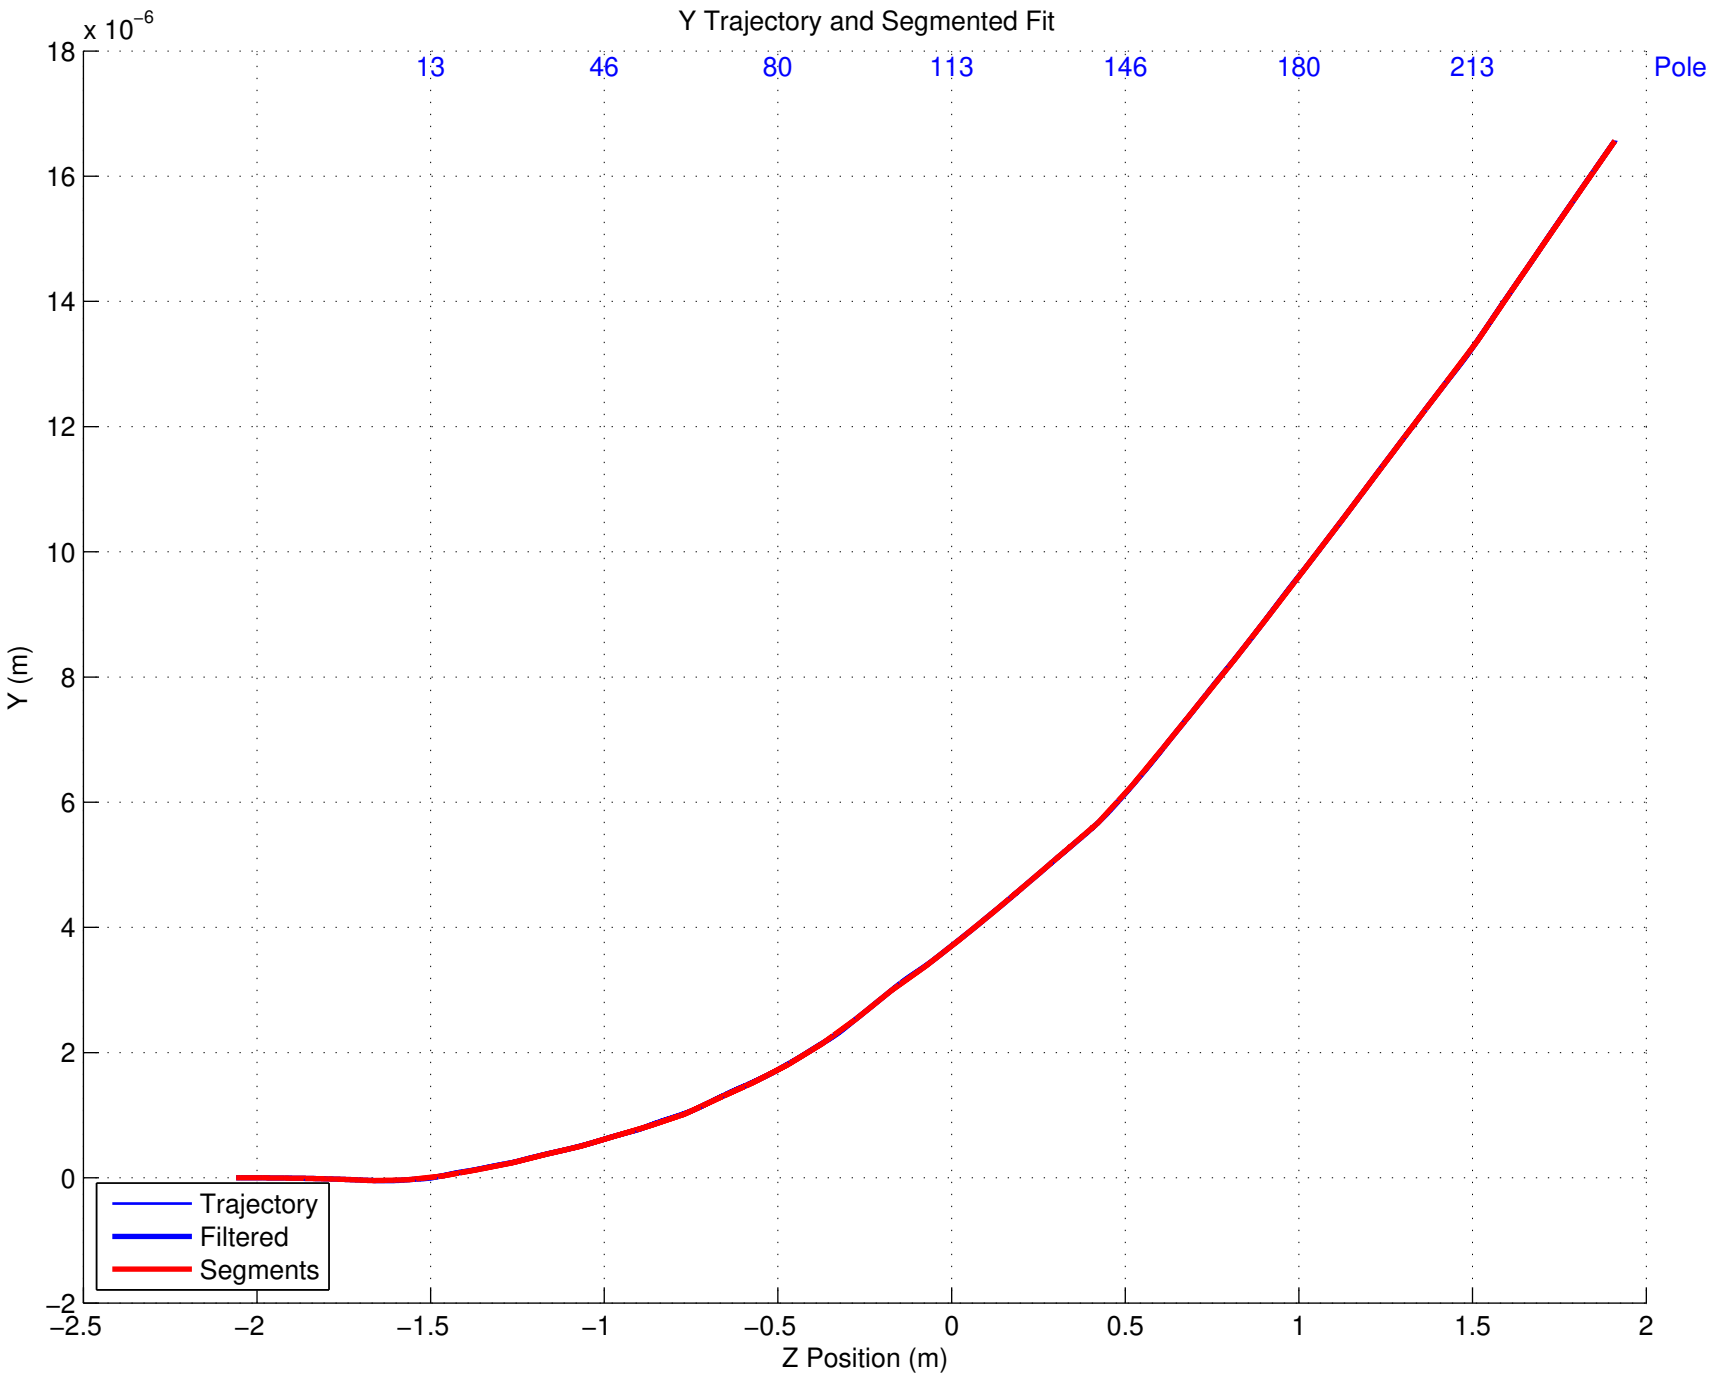
Y Trajectory and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
18
16
14
12
10
8
6
4
2
0
−2
Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

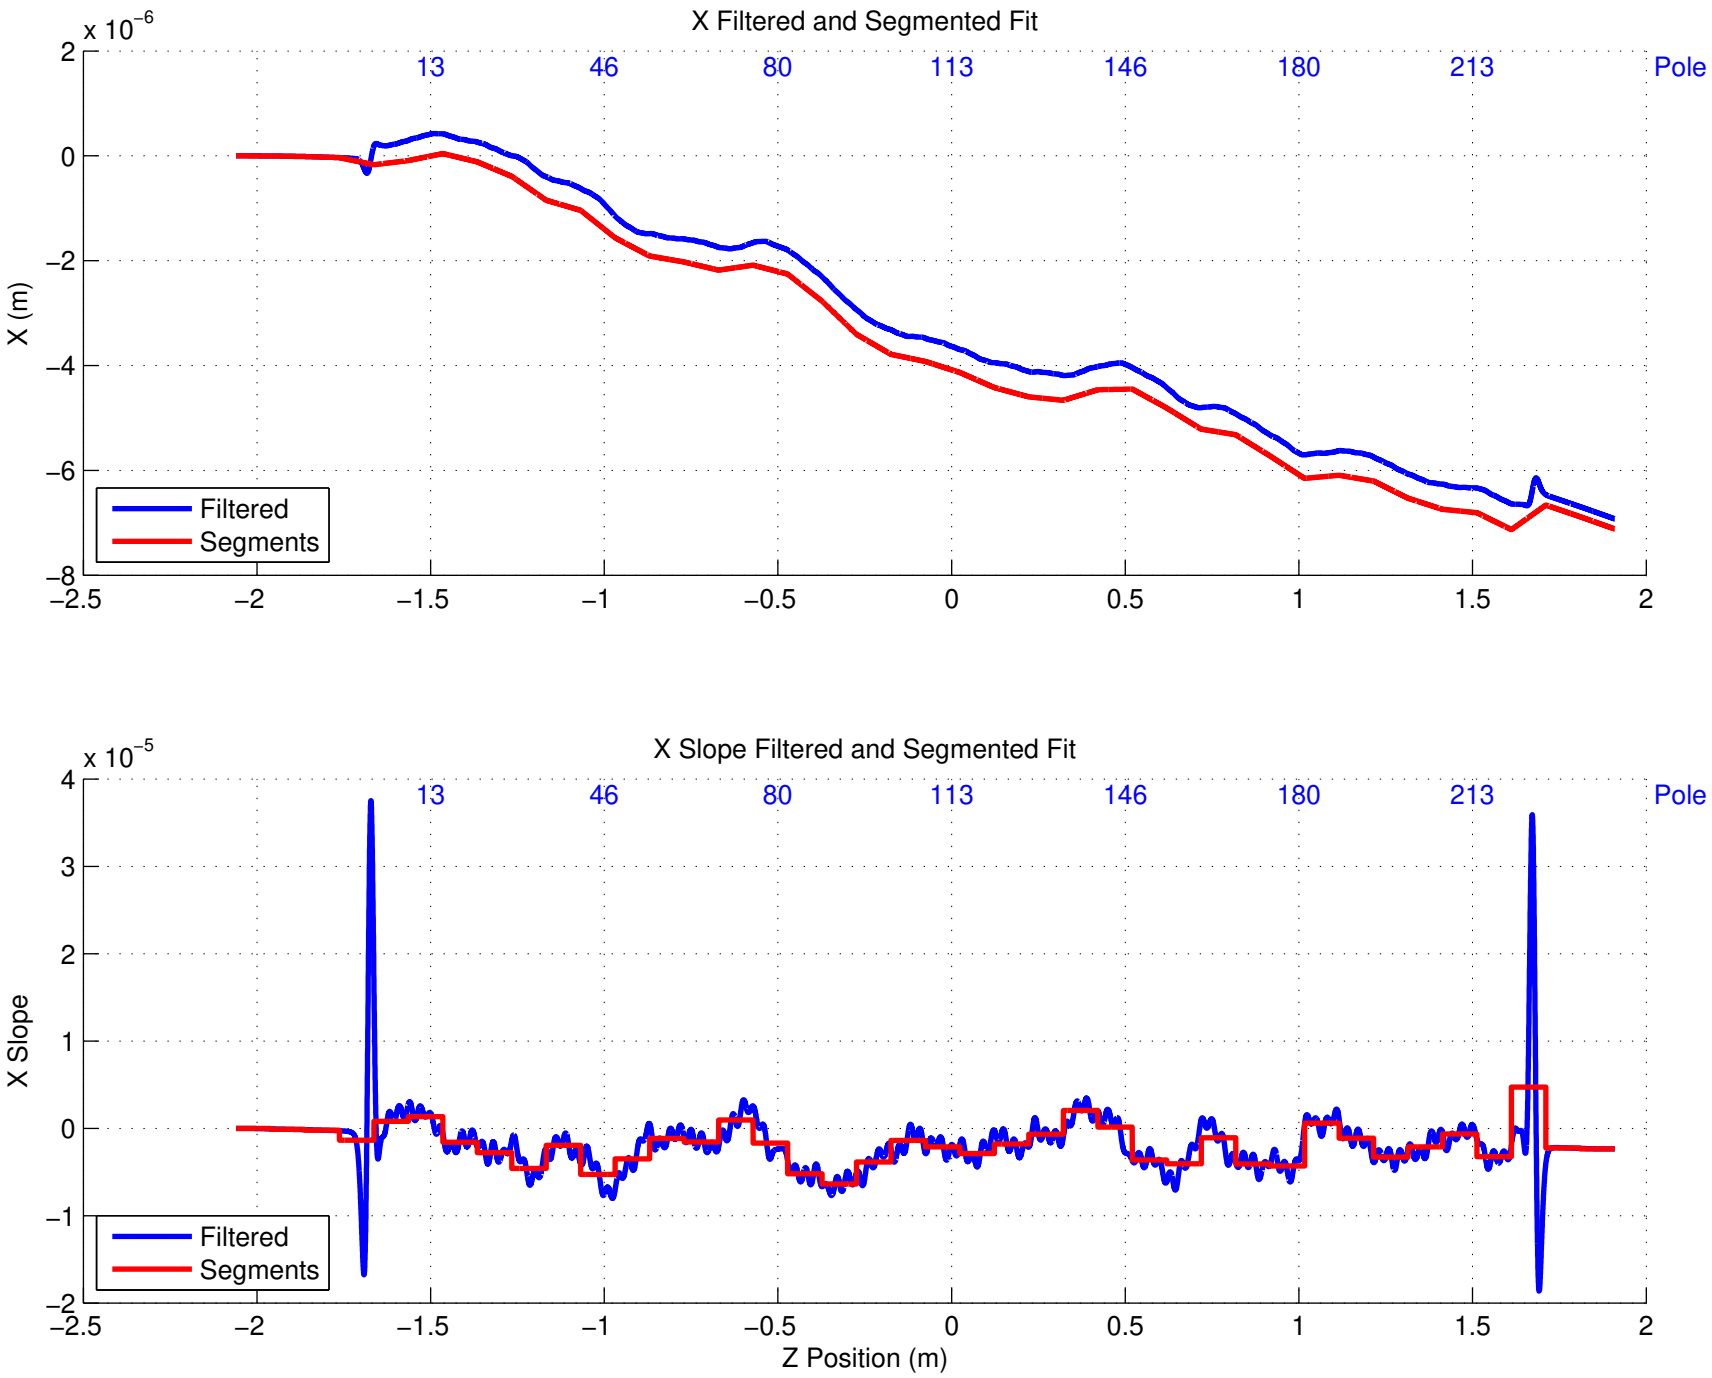
X Filtered and Segmented Fit
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
X Slope Filtered and Segmented Fit
x 10^-5
X Slope
Z Position (m)

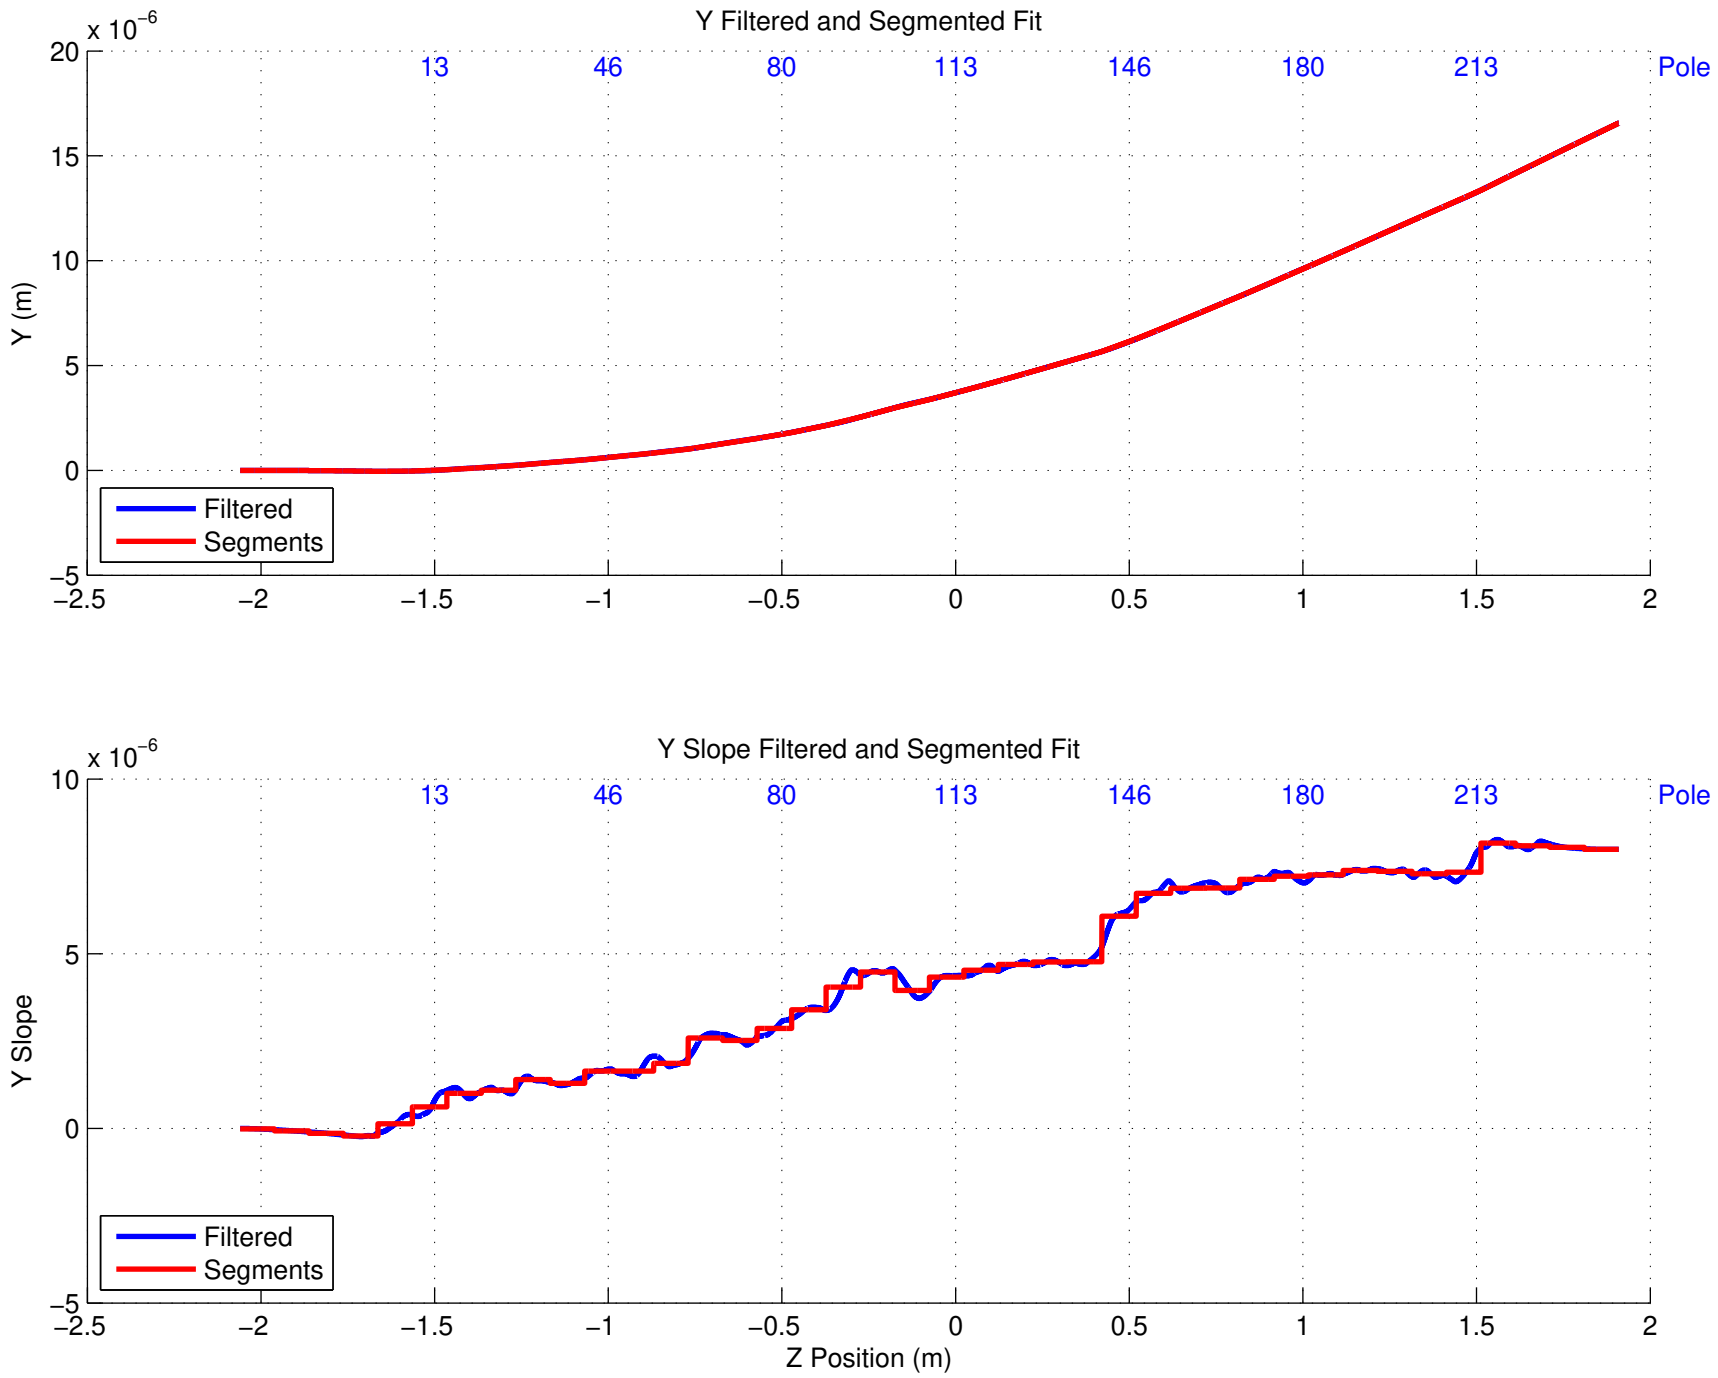
Y Filtered and Segmented Fit
x 10^-6
20
15
10
5
0
−5
Y (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Y Slope Filtered and Segmented Fit
x 10^-6
10
5
0
−5
Y Slope
13
46
80
113
146
180
213
Pole
Filtered
Segments
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

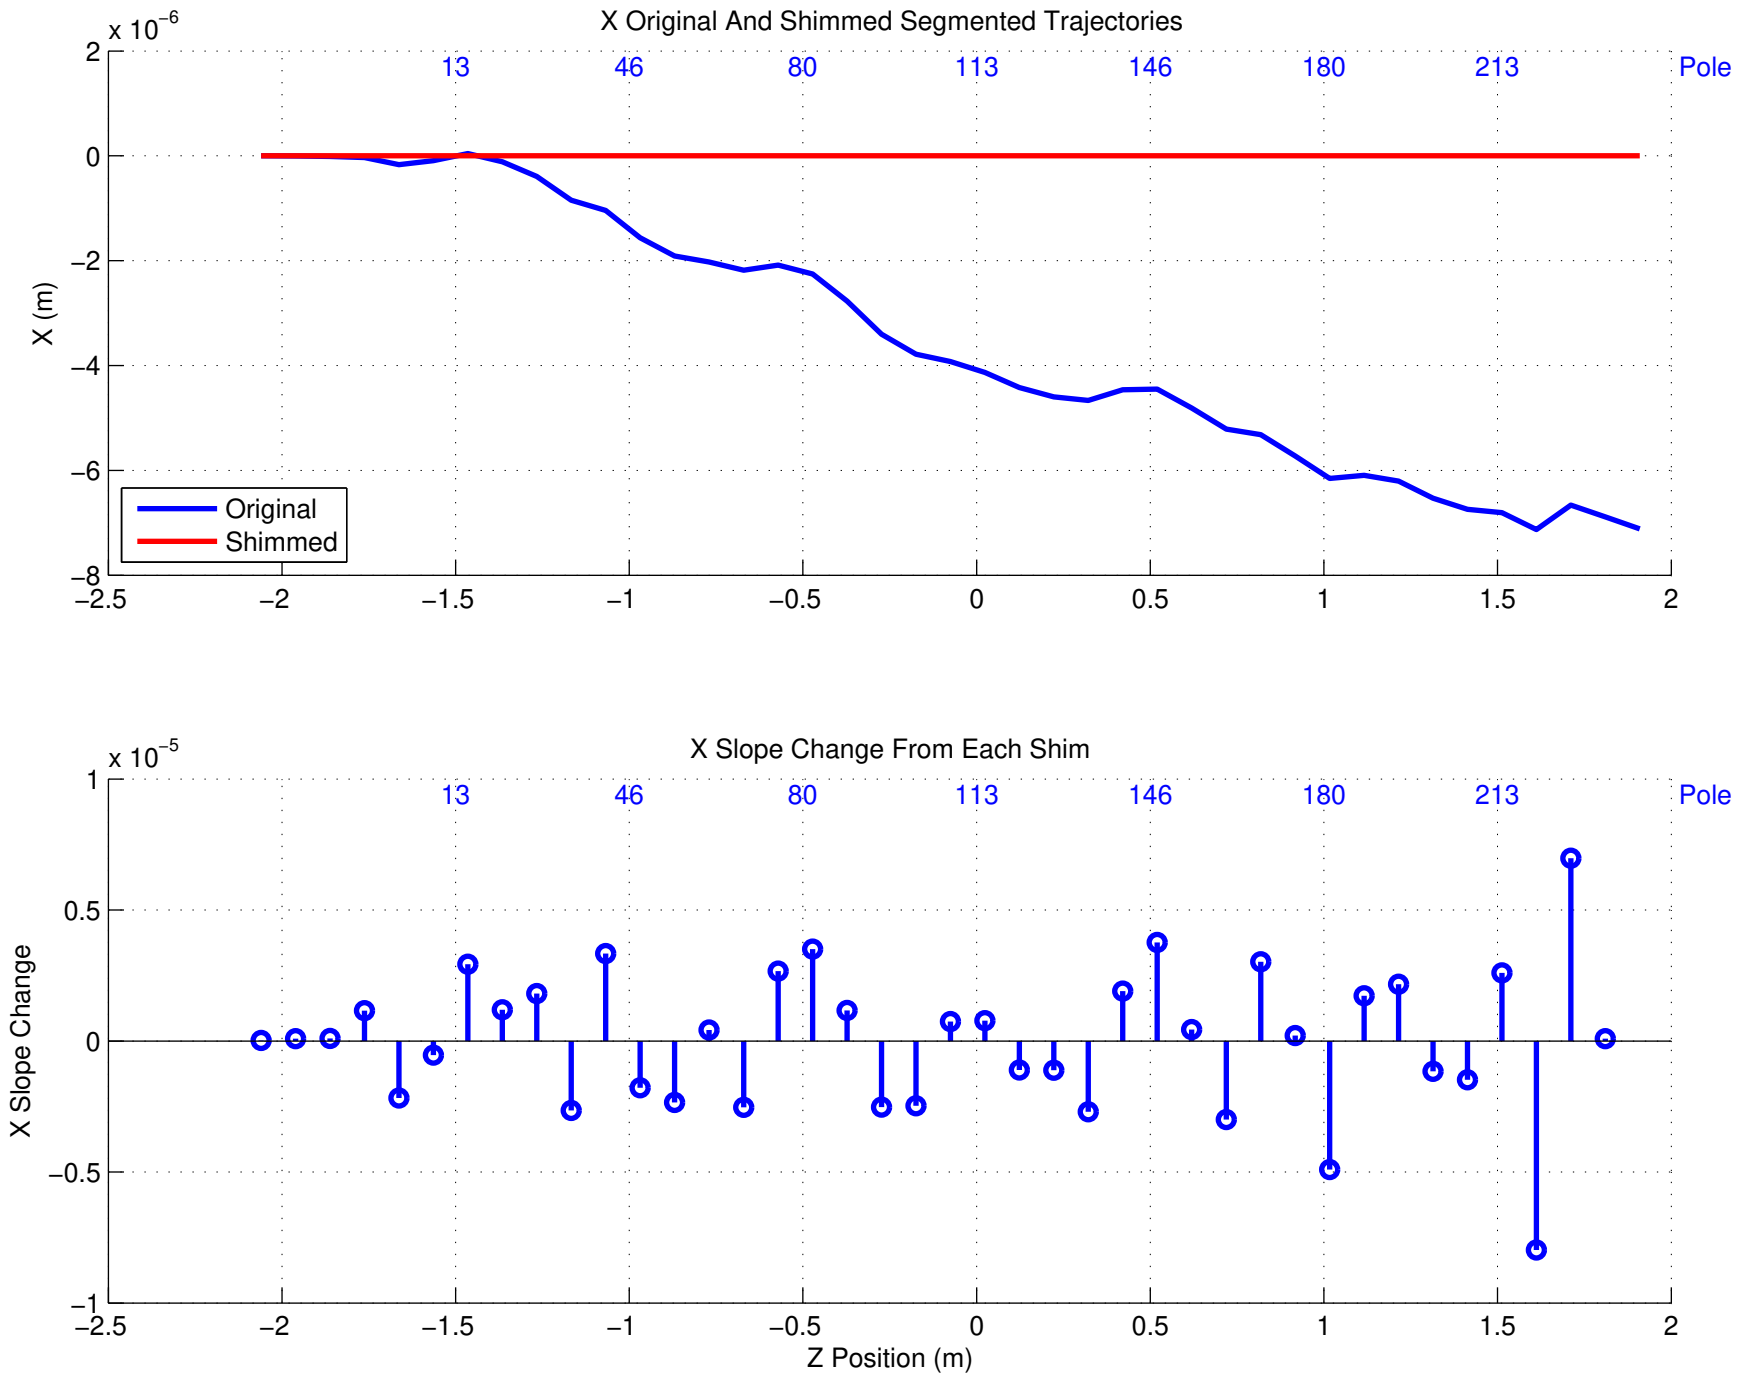
X Original And Shimmed Segmented Trajectories
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
Original
Shimmed
X Slope Change From Each Shim
x 10^-5
X Slope Change
Z Position (m)

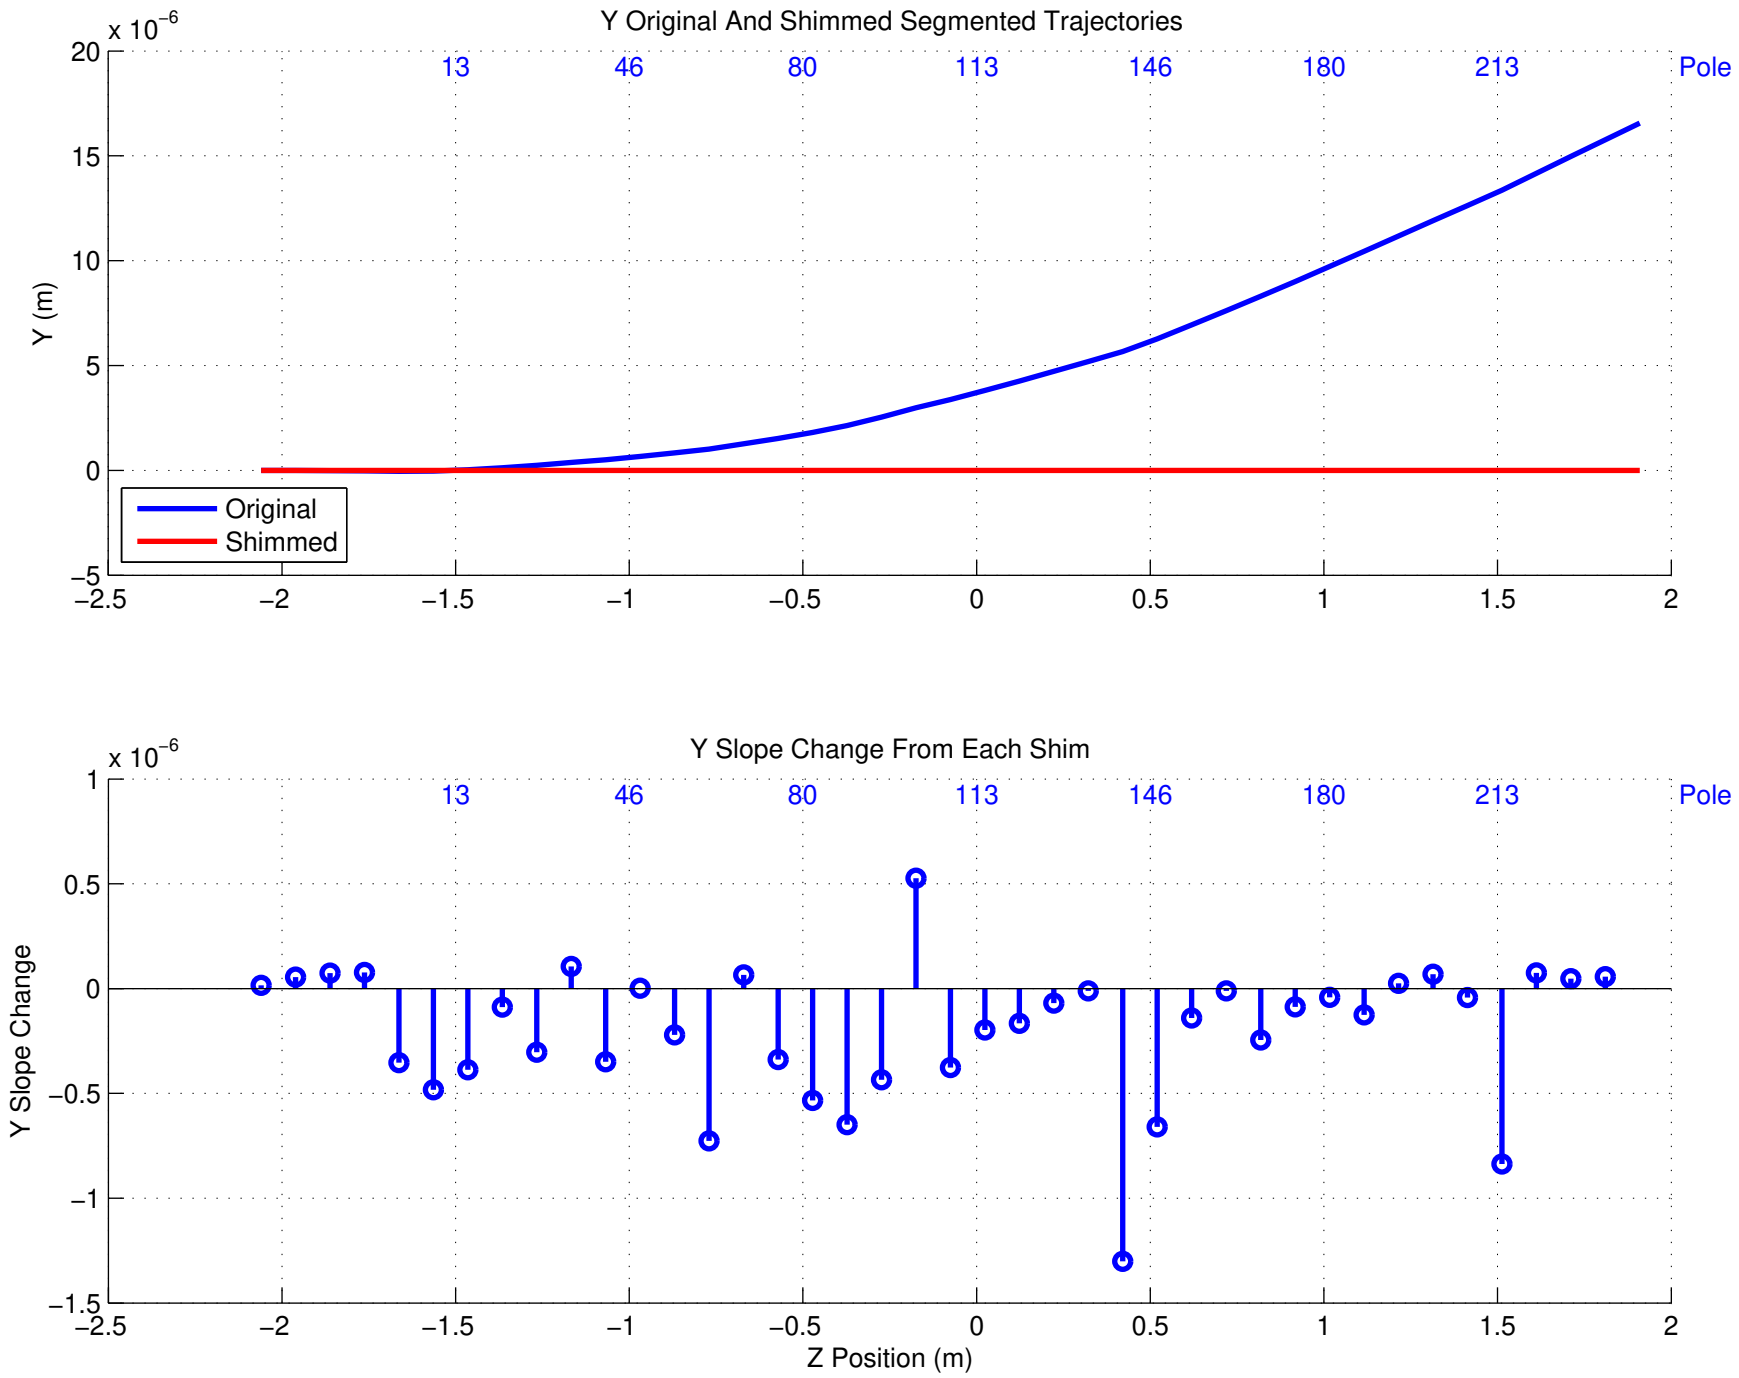
Y Original And Shimmed Segmented Trajectories
x 10^-6
13
46
80
113
146
180
213
Pole
Y (m)
Original
Shimmed
Y Slope Change From Each Shim
Y Slope Change
Z Position (m)

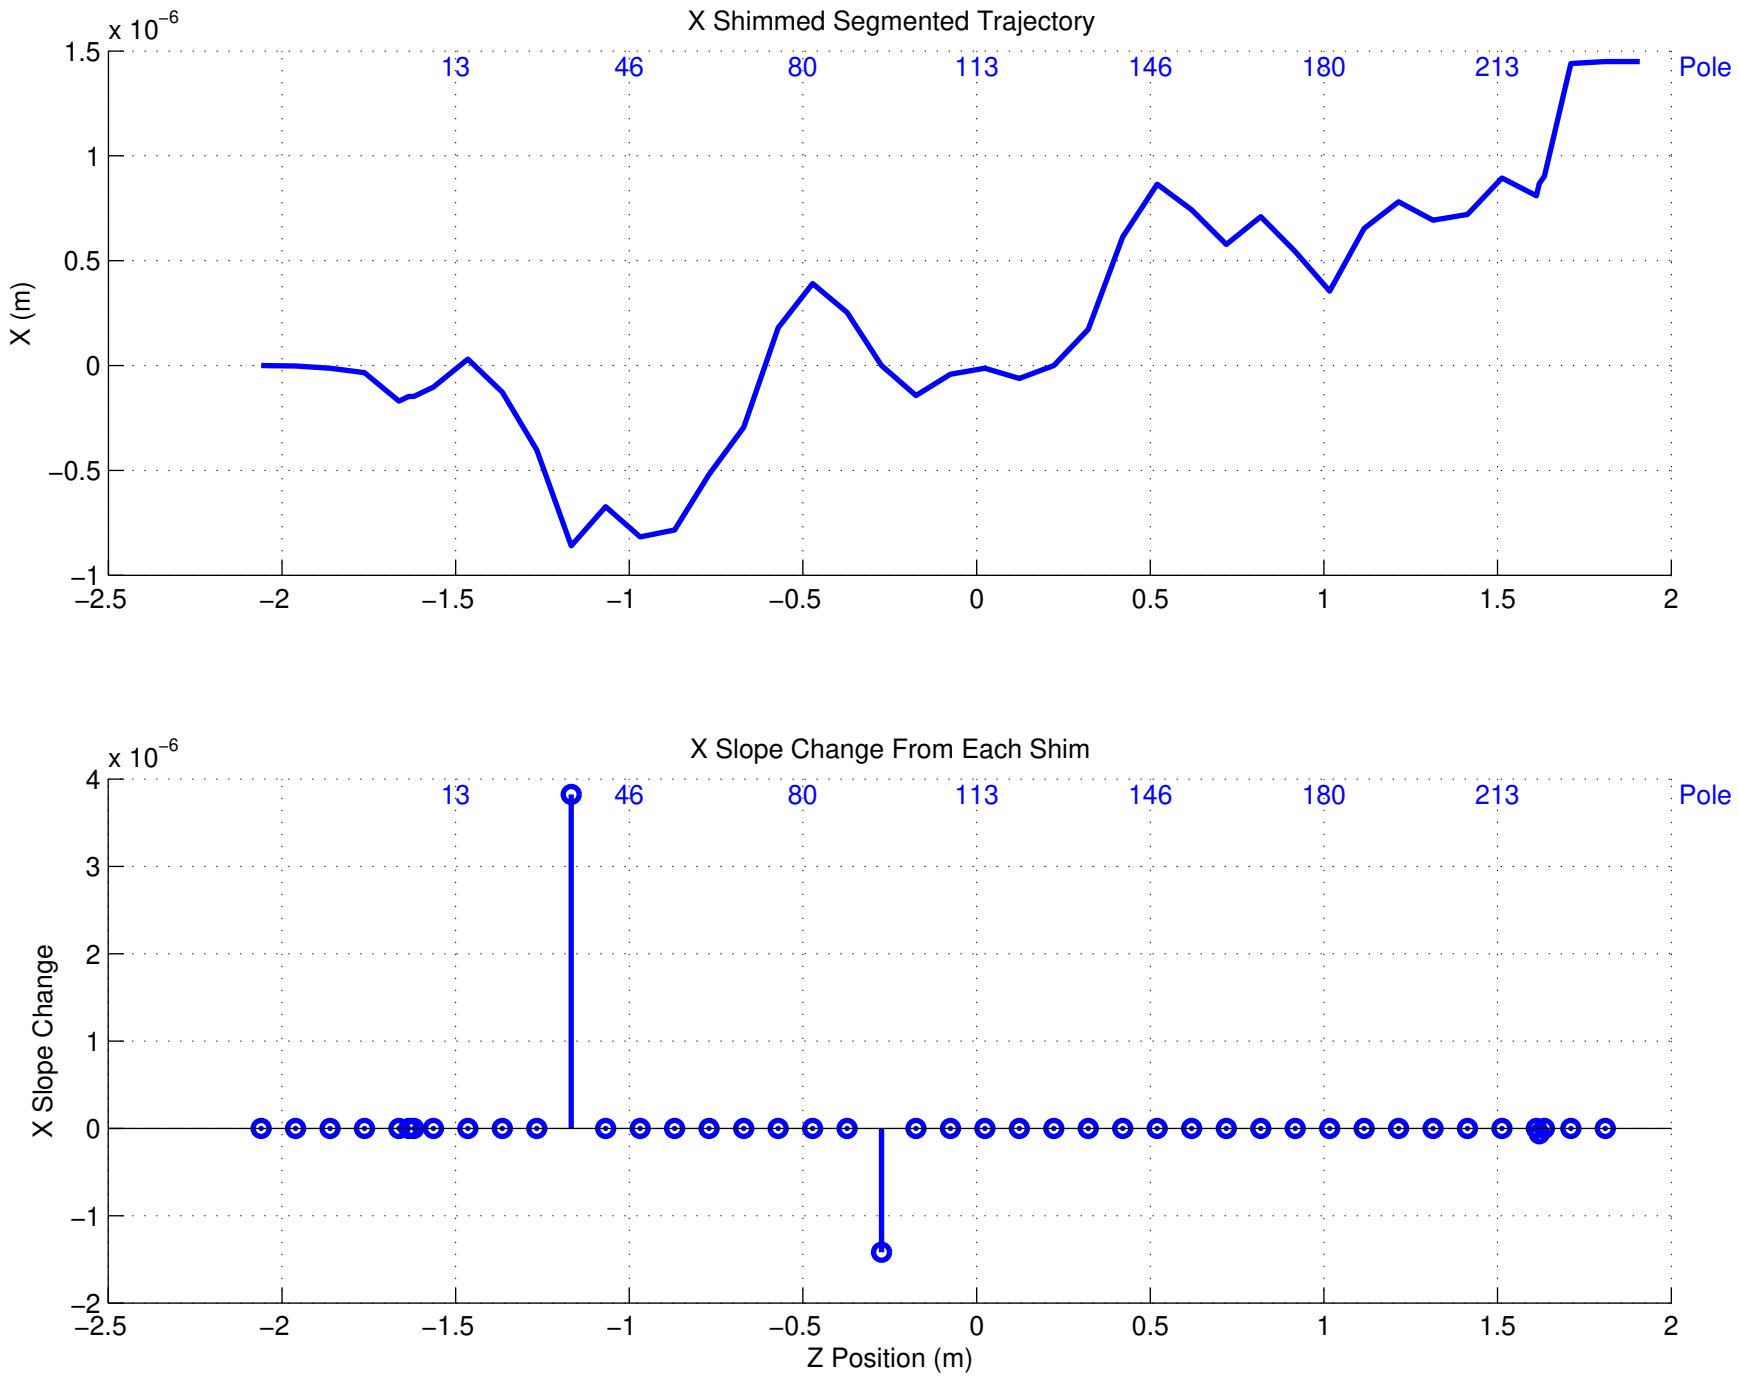
X Shimmed Segmented Trajectory
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
1.5
1
0.5
0
−0.5
−1
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
X Slope Change From Each Shim
x 10^-6
X Slope Change
4
3
2
1
0
−1
−2
Z Position (m)

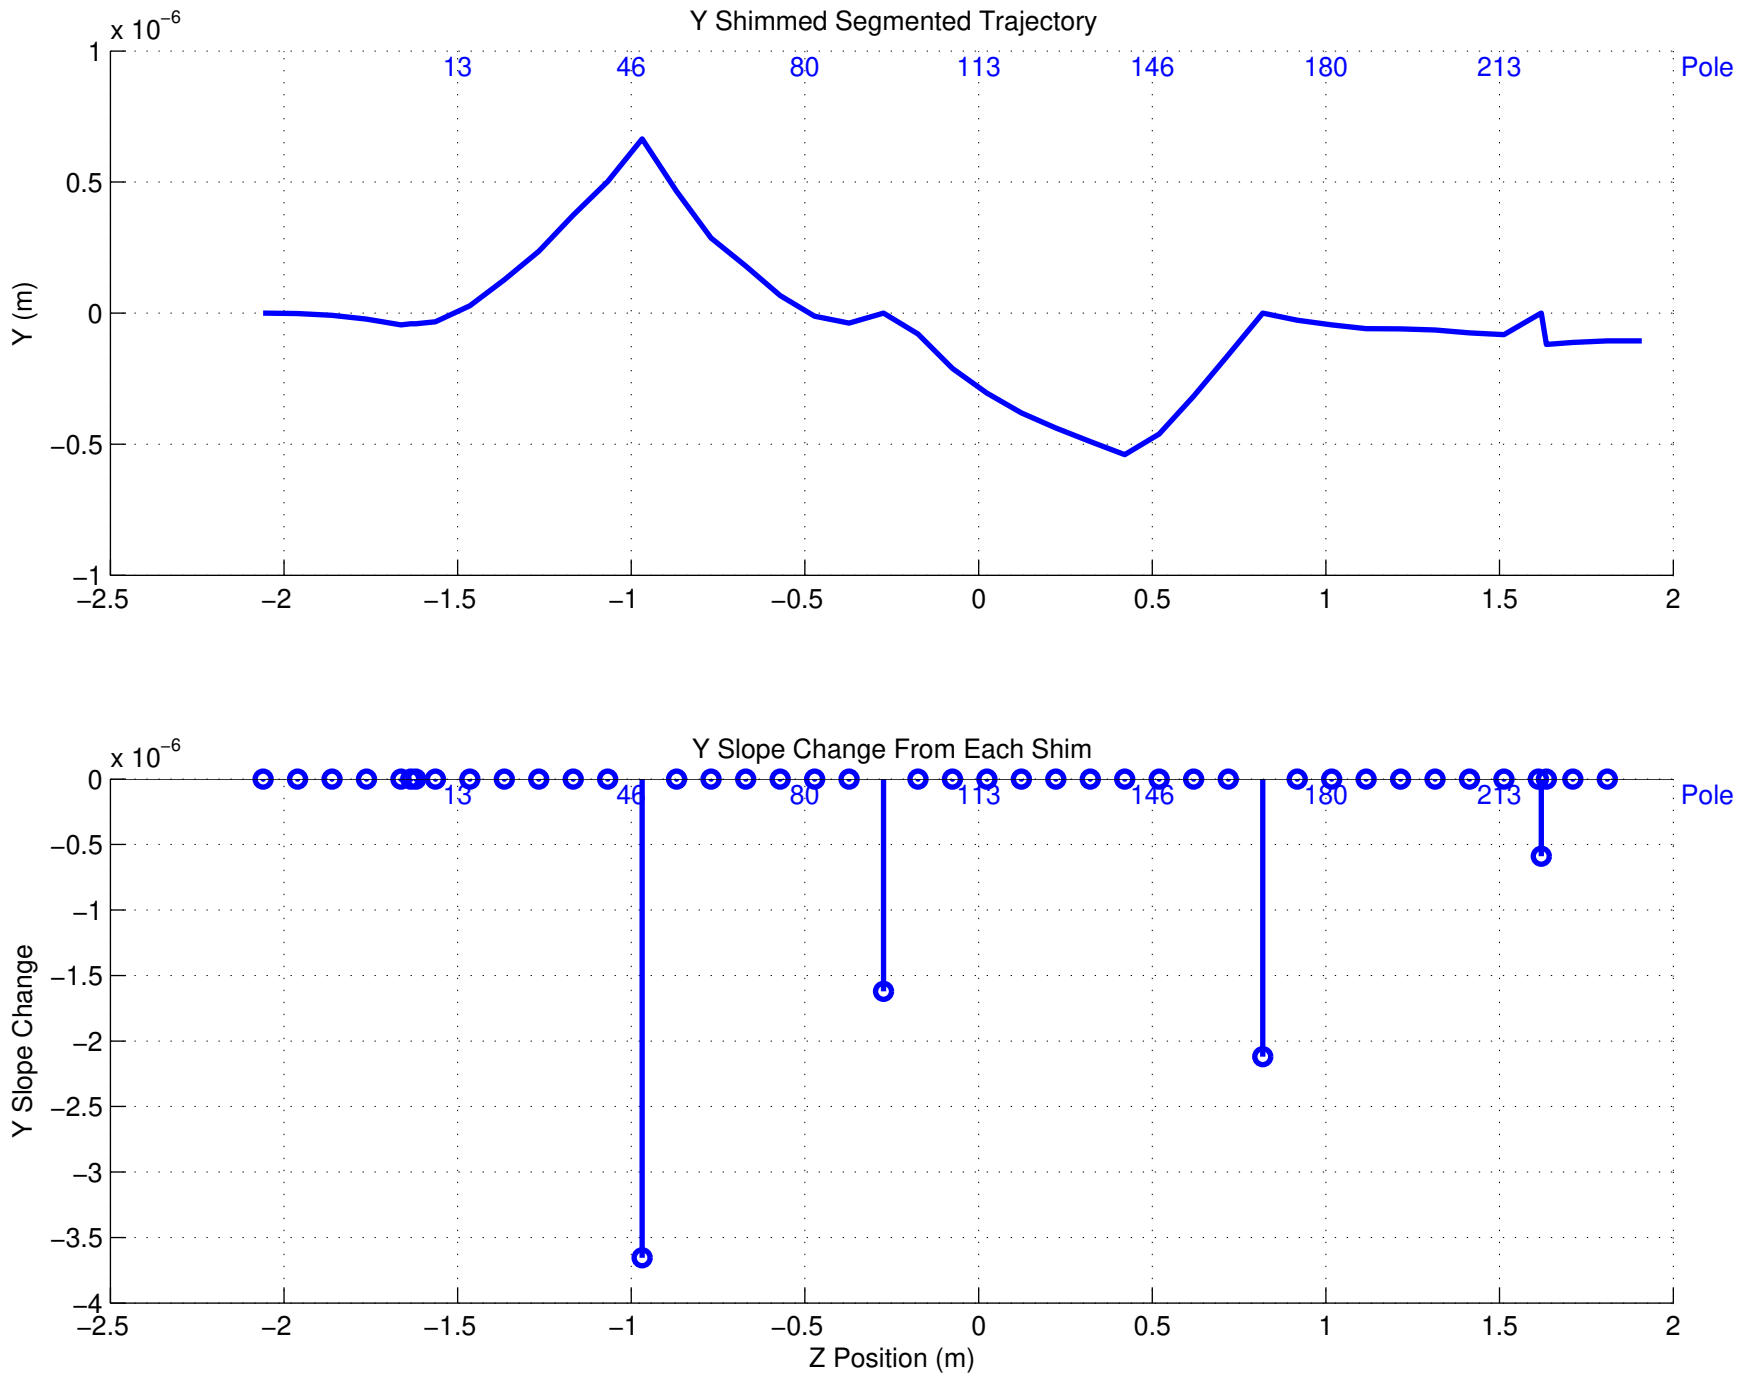
Y Shimmed Segmented Trajectory
x 10^-6
Y (m)
13
46
80
113
146
180
213
Pole
Y Slope Change From Each Shim
x 10^-6
Y Slope Change
Z Position (m)

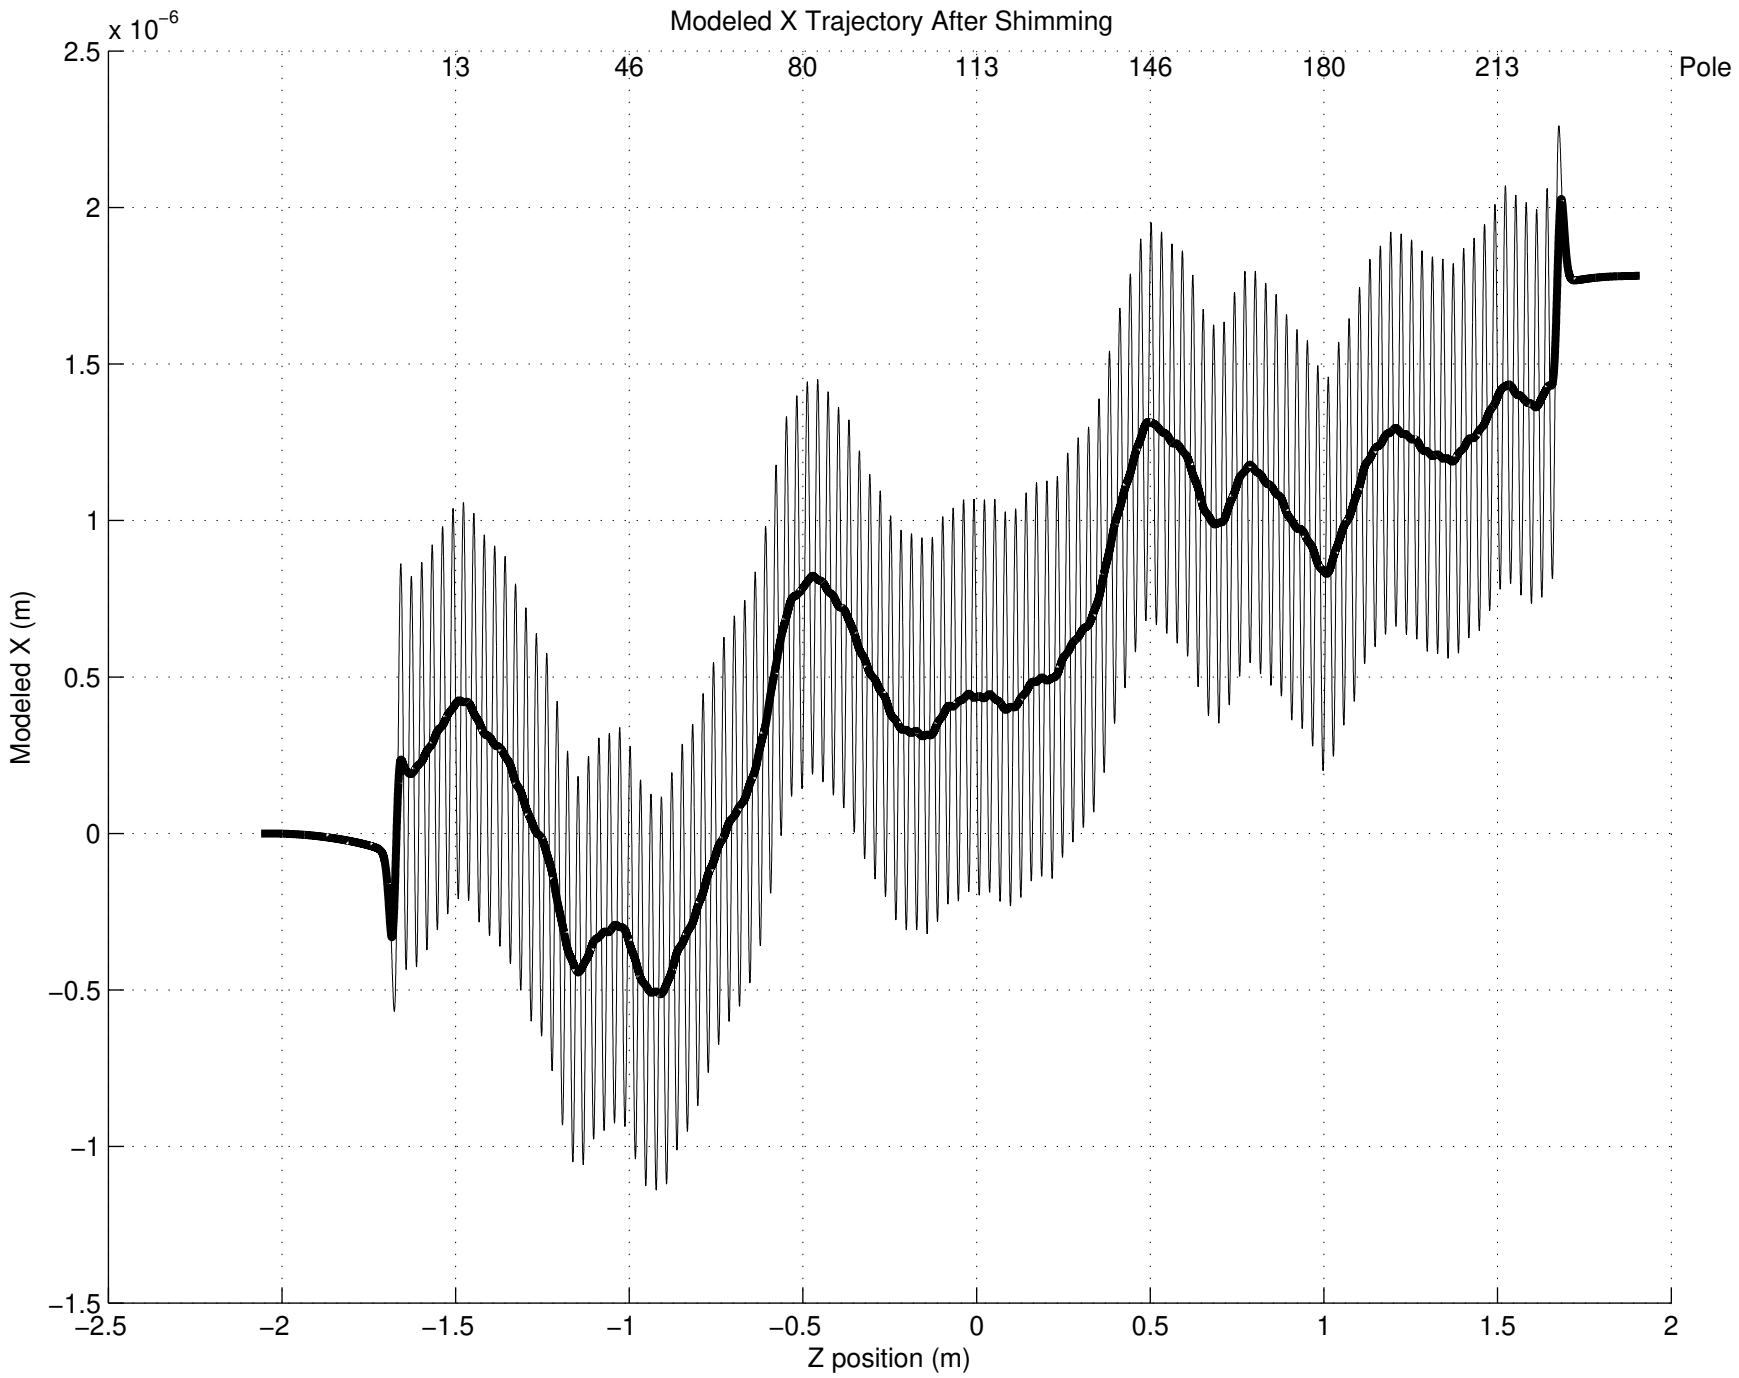
Modeled X Trajectory After Shimming
x 10^-6
2.5
2
1.5
1
0.5
0
−0.5
−1
−1.5
13
46
80
113
146
180
213
Pole
Modeled X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

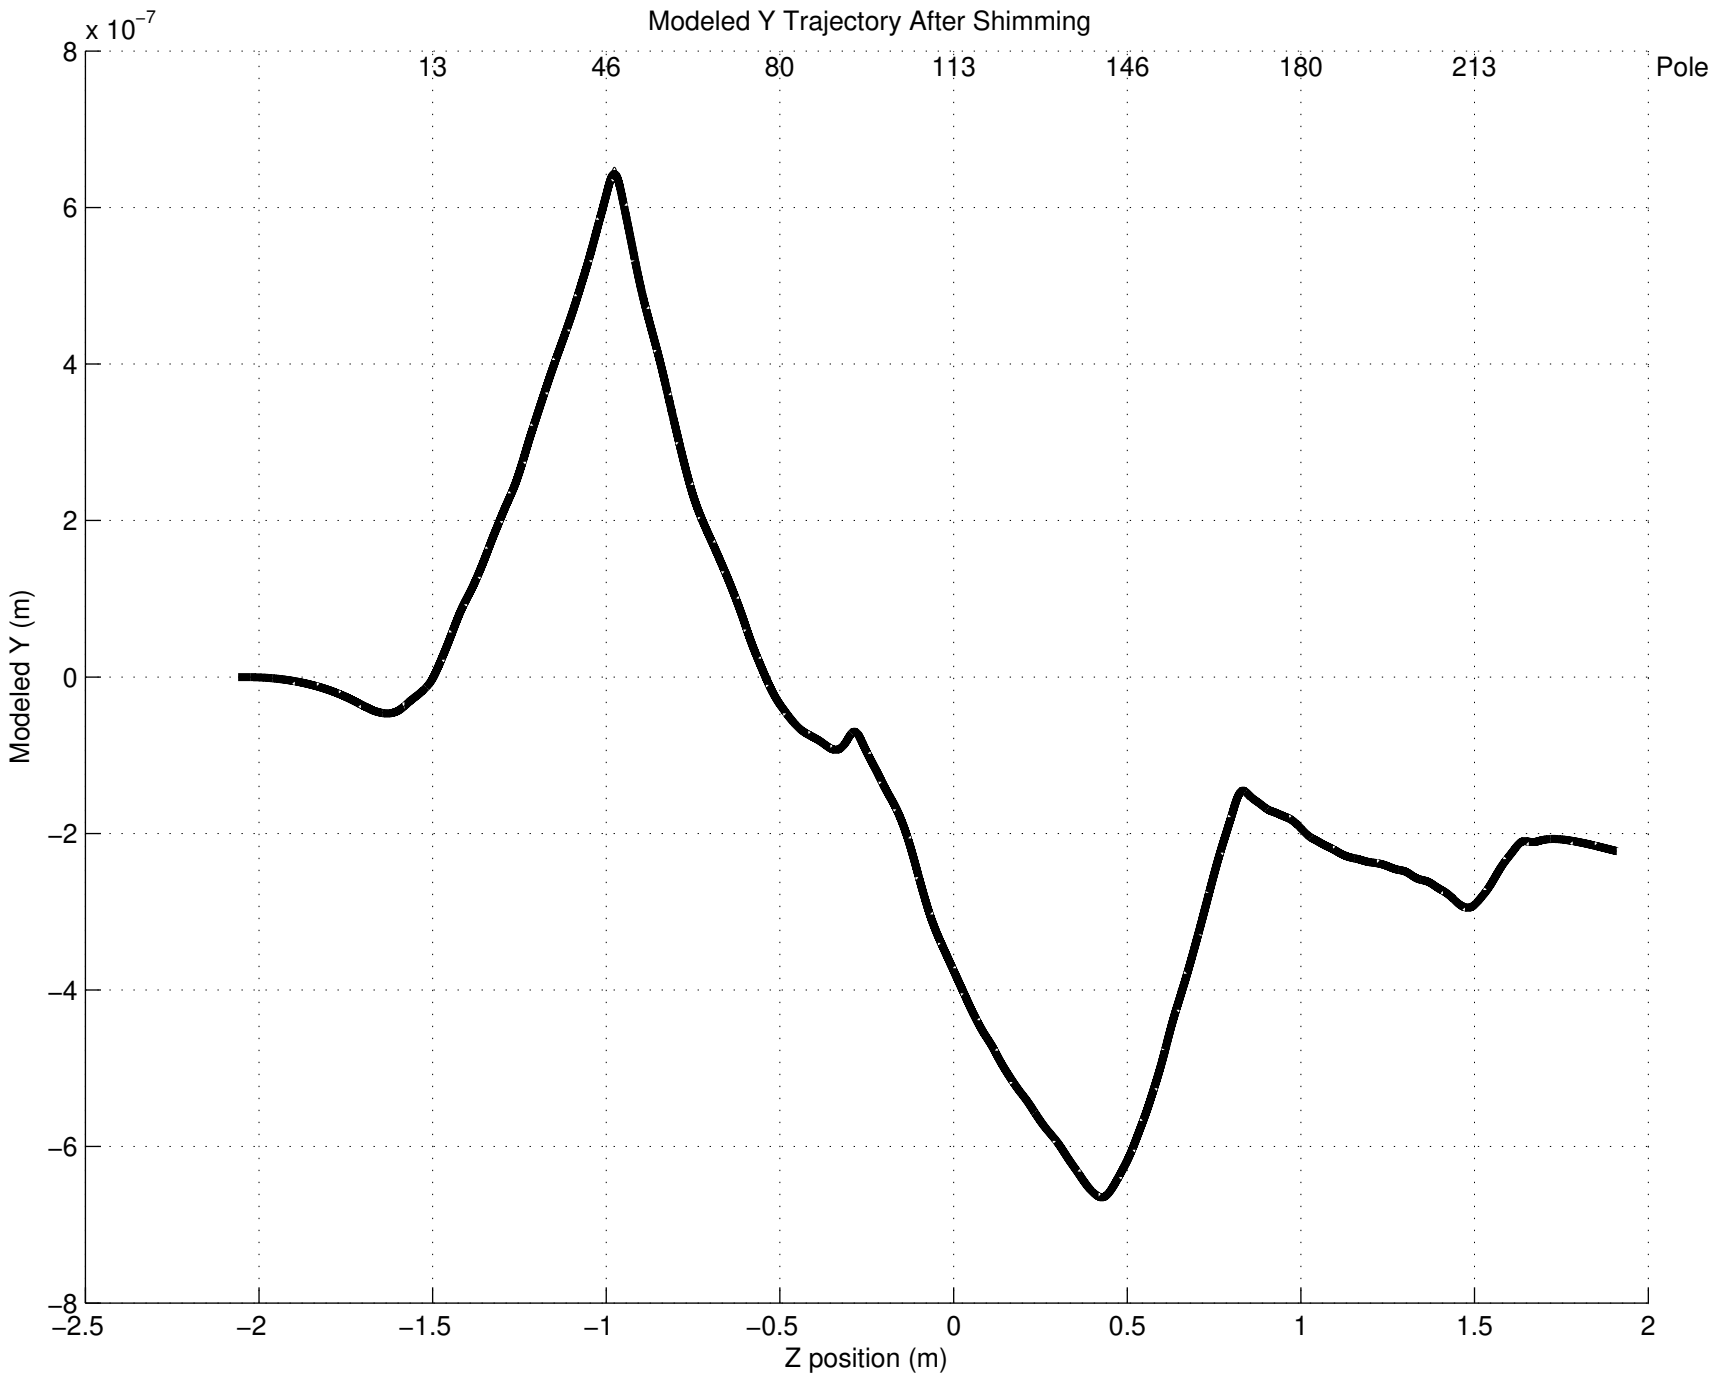
Modeled Y Trajectory After Shimming
x 10^-7
8
6
4
2
0
−2
−4
−6
−8
13
46
80
113
146
180
213
Pole
Modeled Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

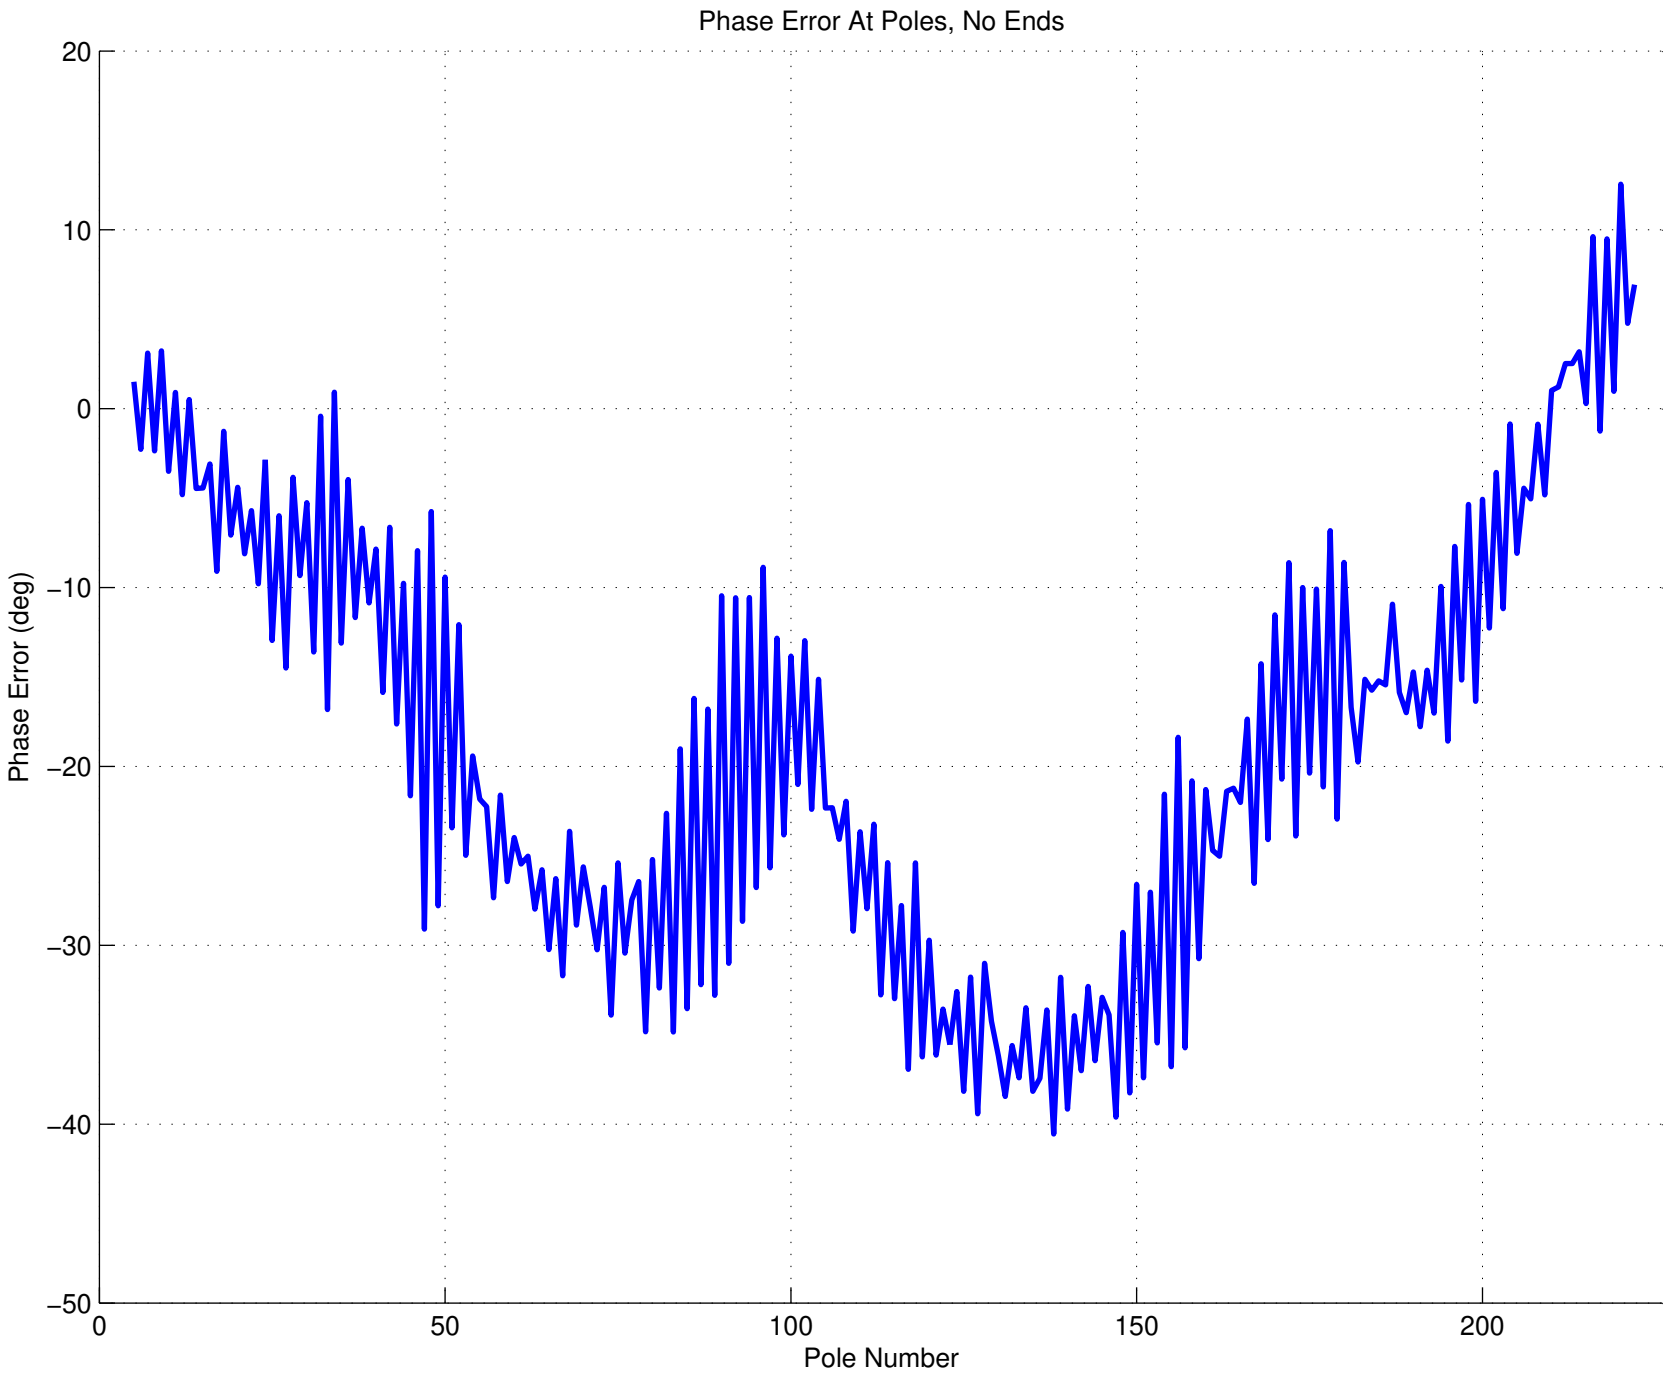
Phase Error At Poles, No Ends
Phase Error (deg)
Pole Number
20
10
0
−10
−20
−30
−40
−50
0
50
100
150
200

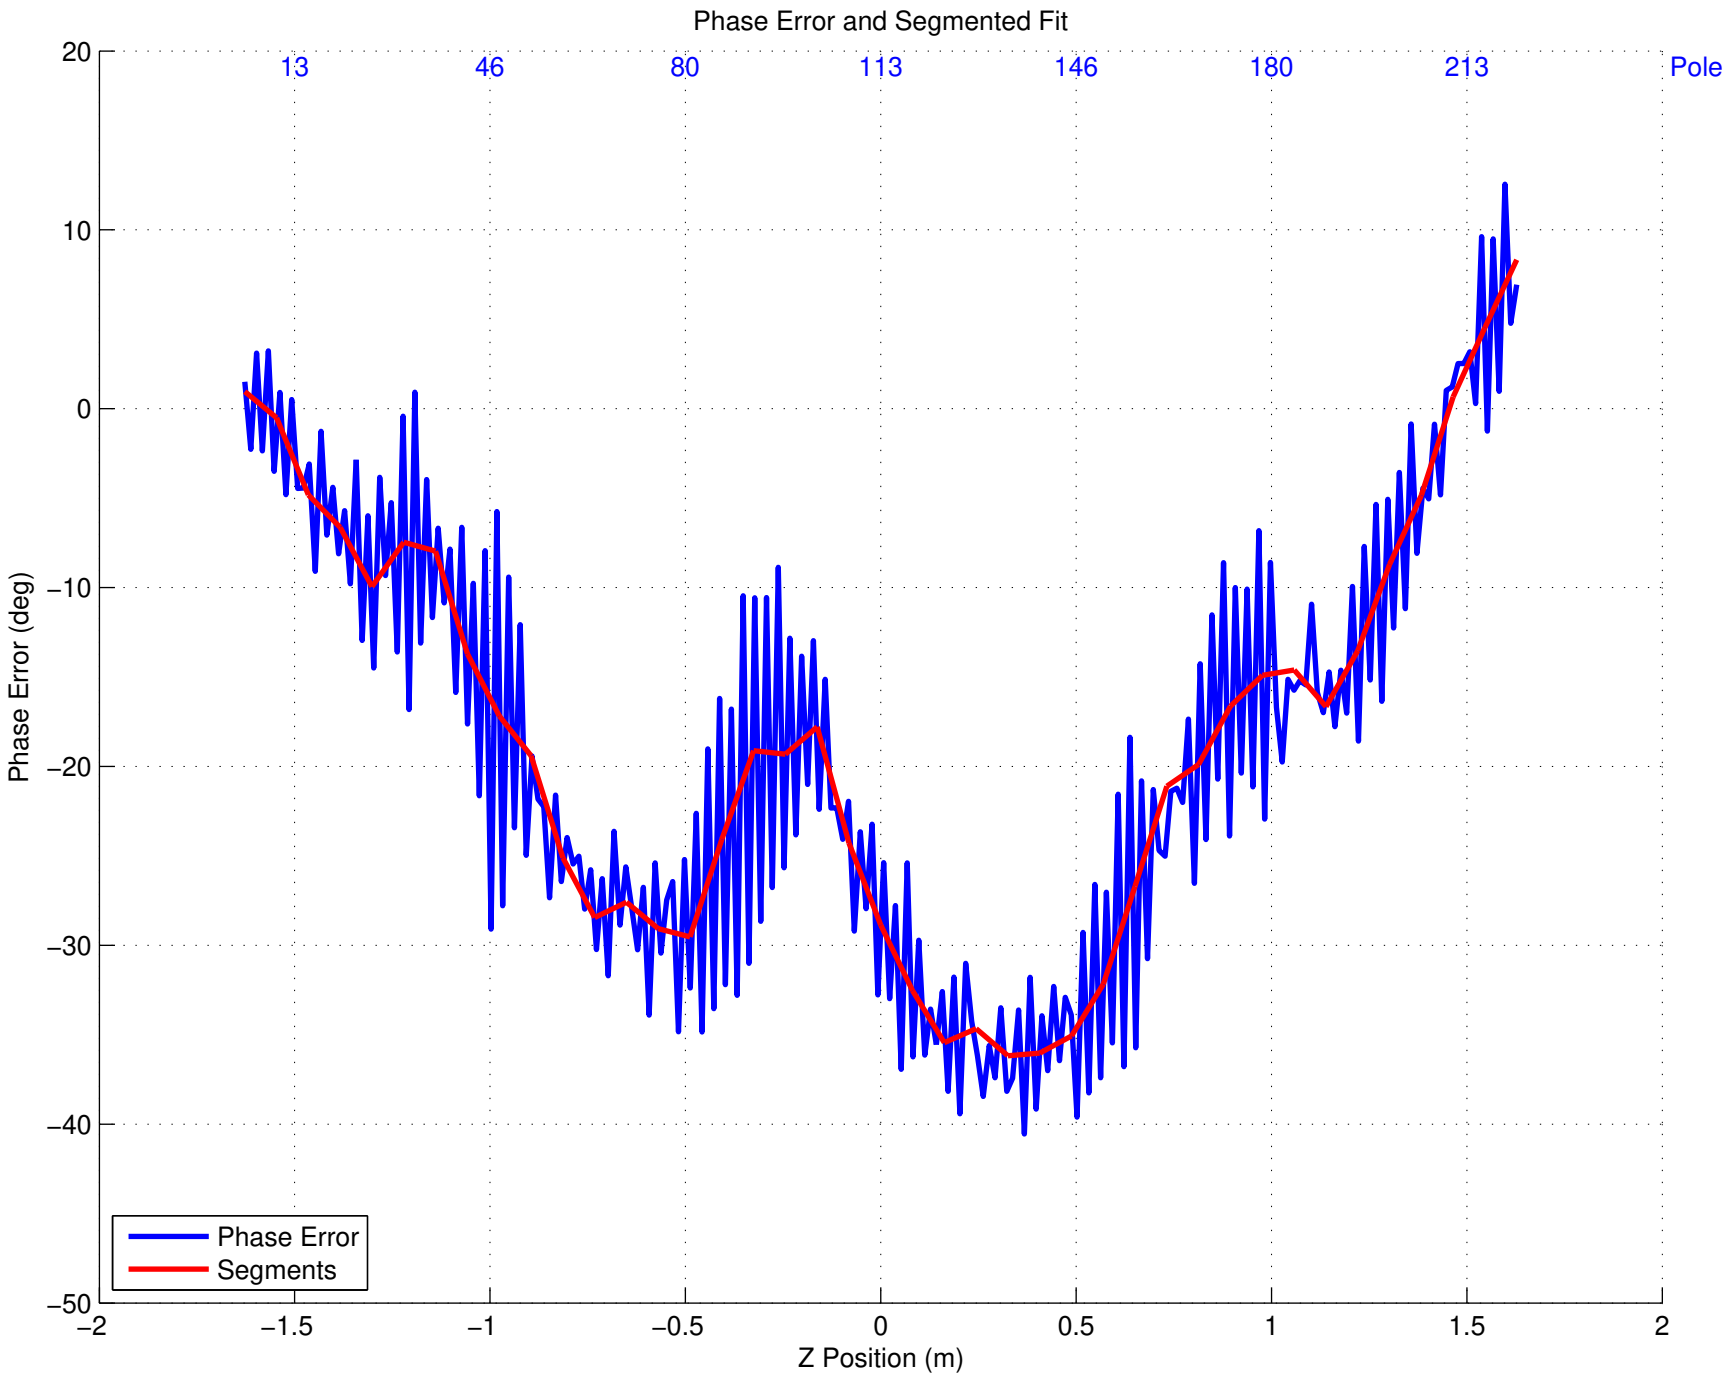
Phase Error and Segmented Fit
13
46
80
113
146
180
213
Pole
20
10
0
−10
−20
−30
−40
−50
Phase Error (deg)
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Phase Error
Segments

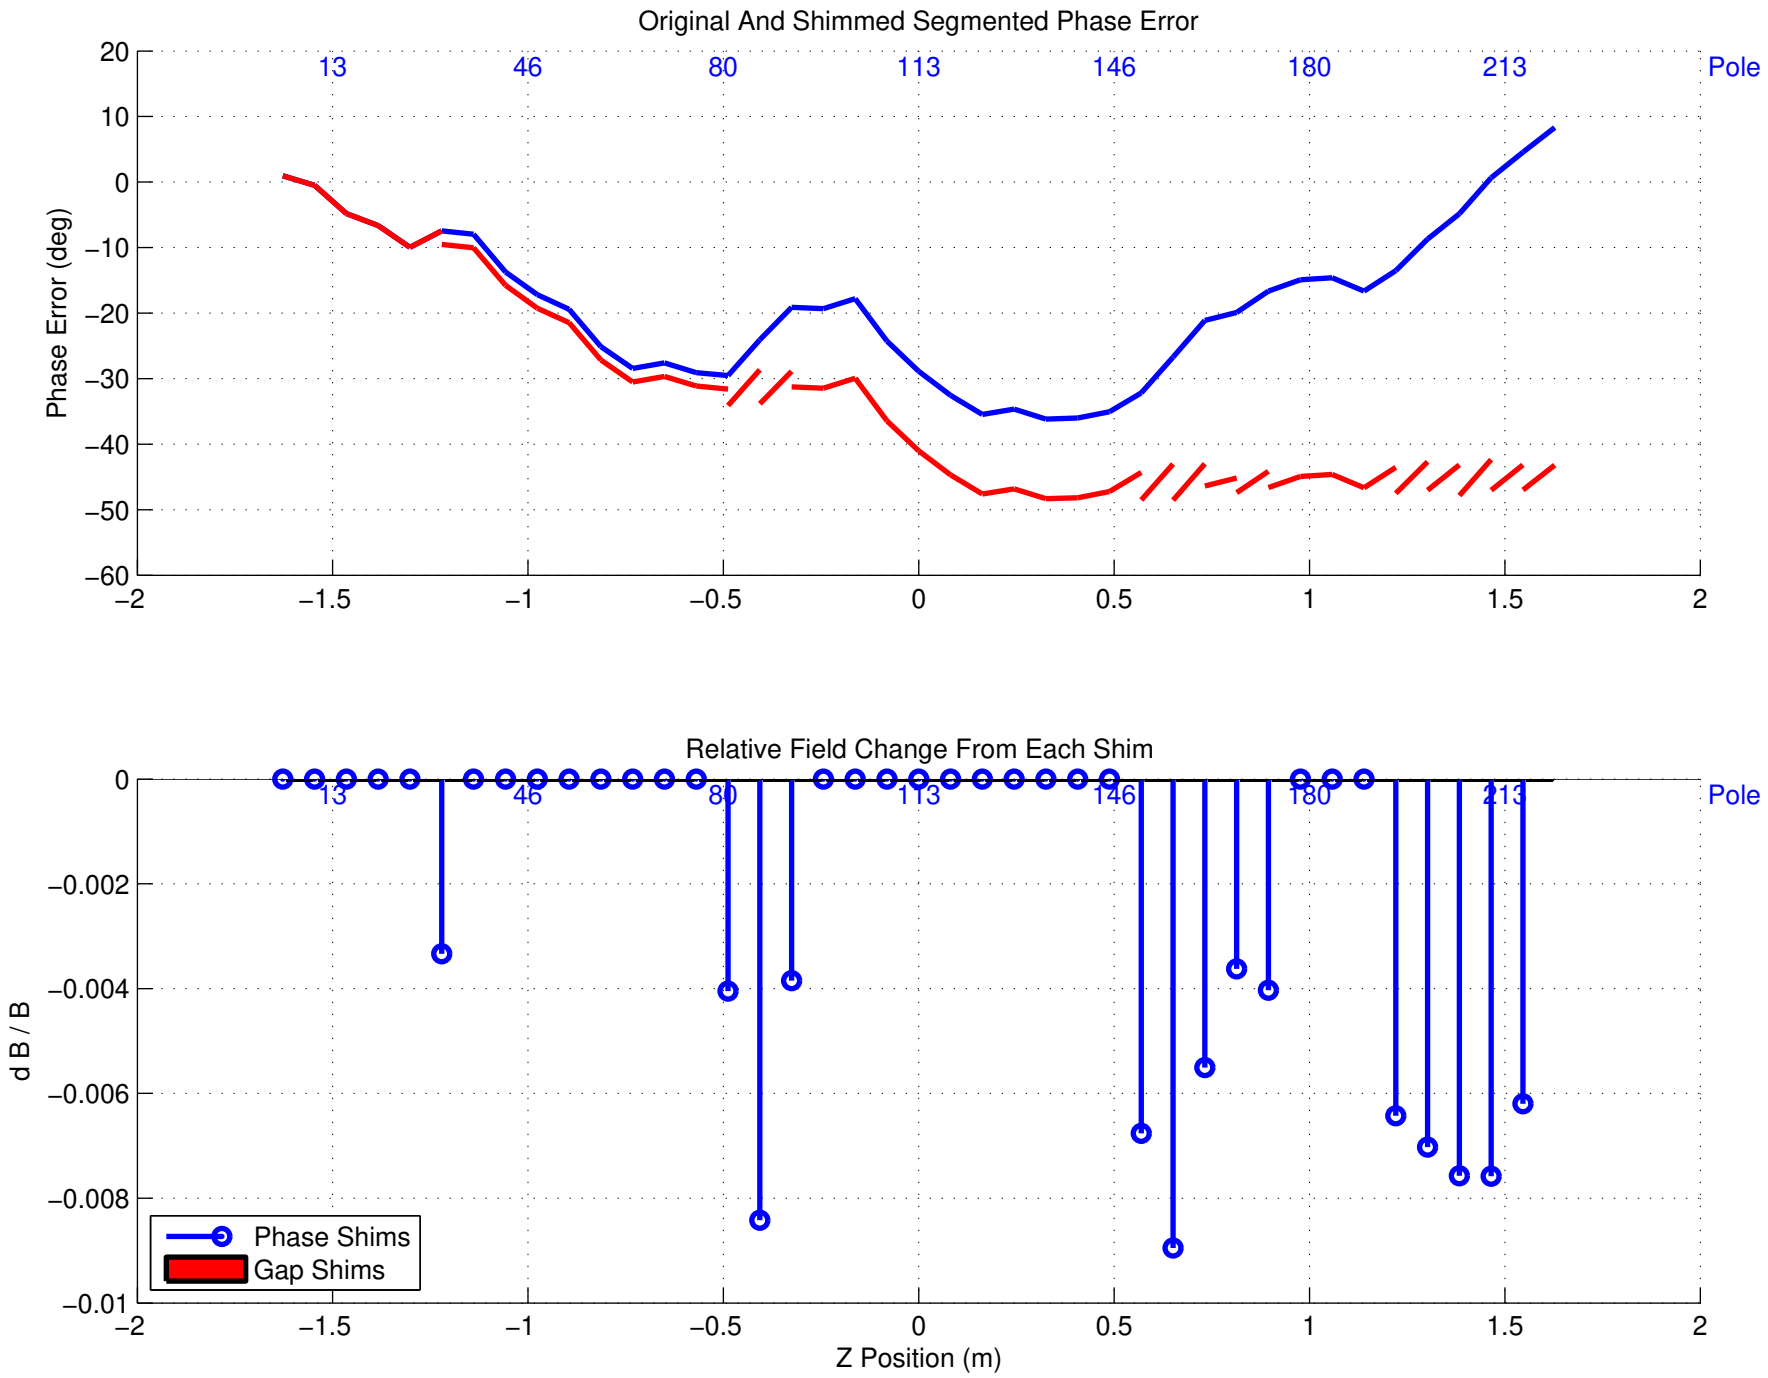
Original And Shimmed Segmented Phase Error
Phase Error (deg)
Pole
13
46
80
113
146
180
213
20
10
0
−10
−20
−30
−40
−50
−60
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
d B / B
Z Position (m)
Phase Shims
Gap Shims
0
−0.002
−0.004
−0.006
−0.008
−0.01

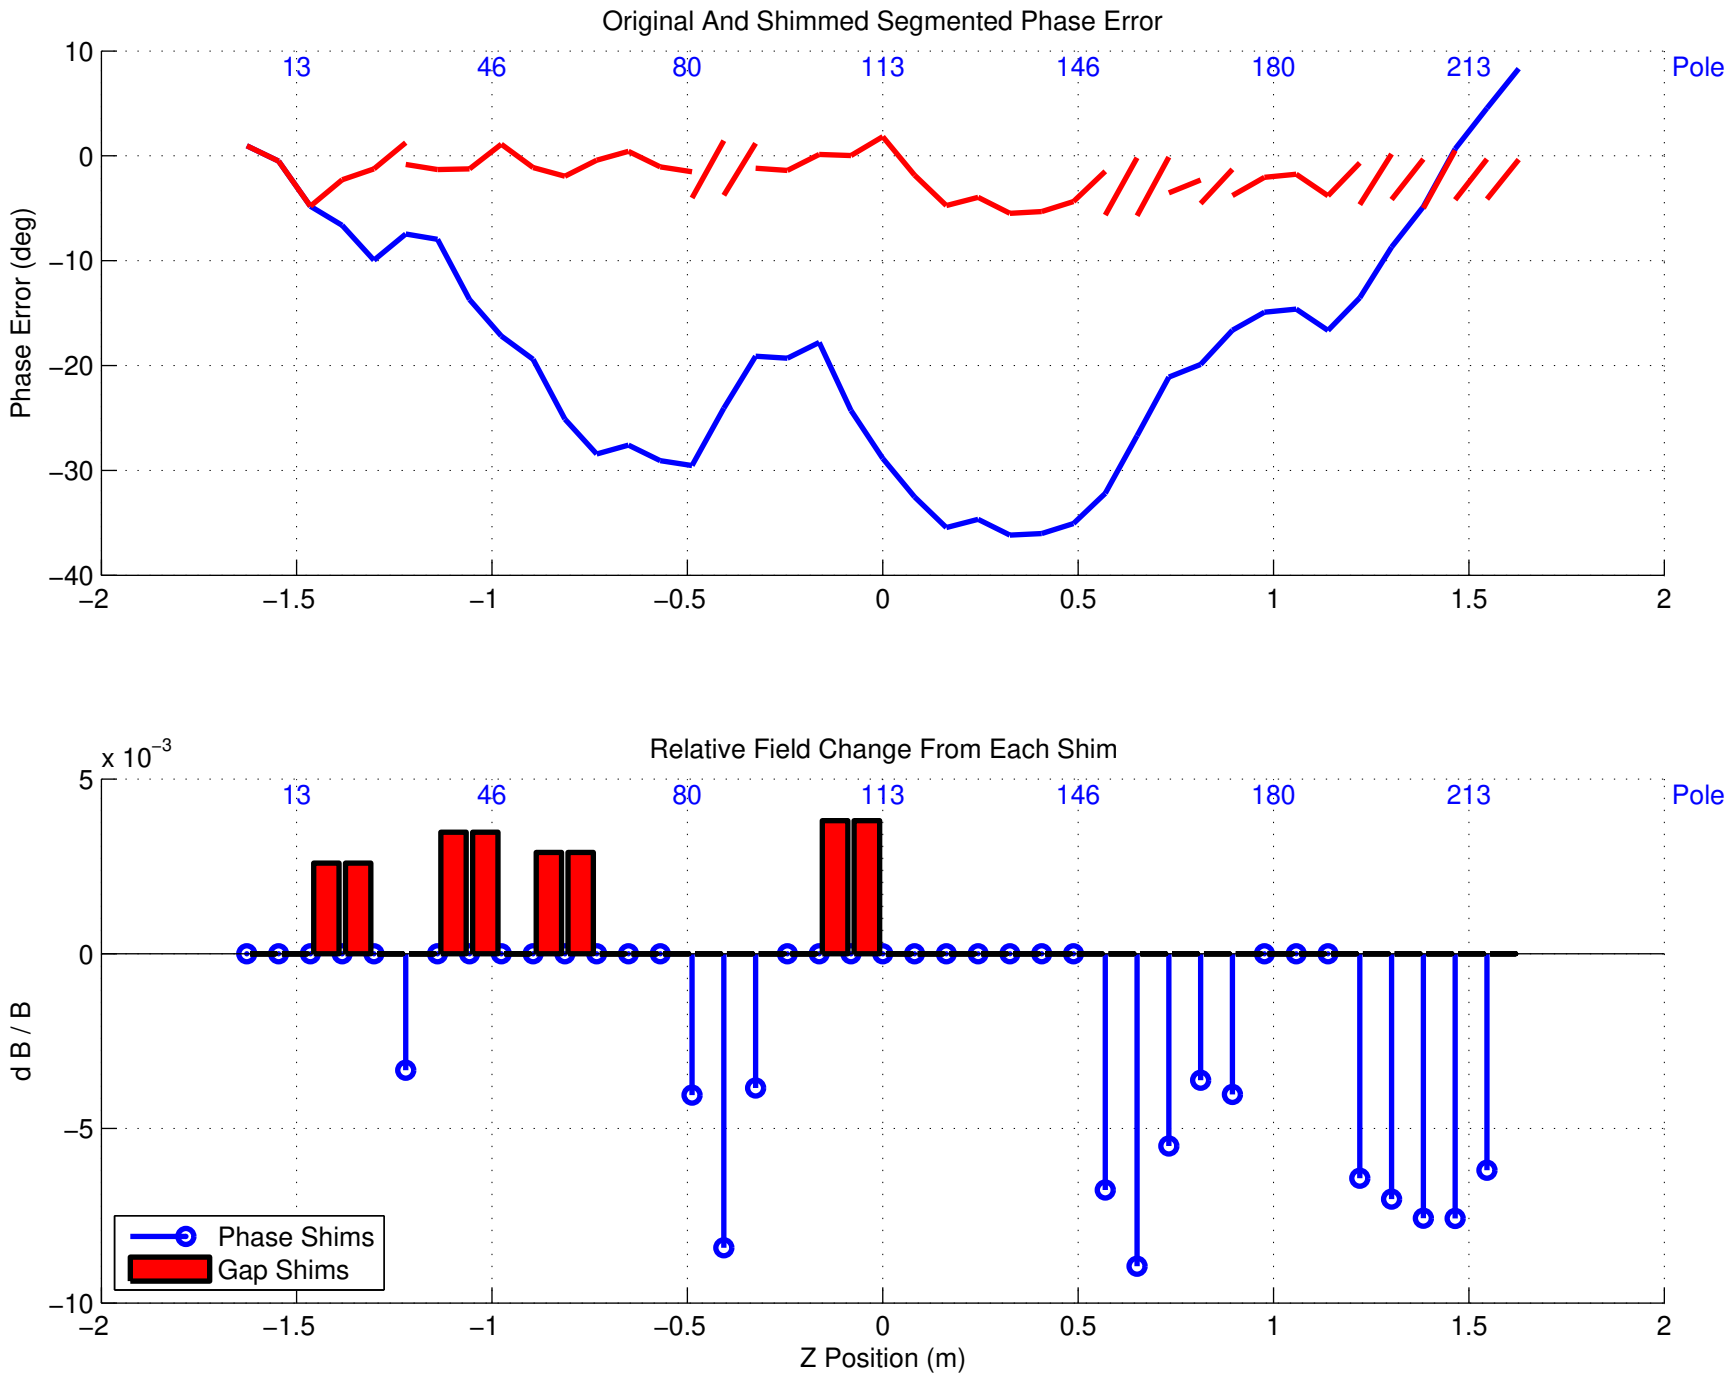
Original And Shimmed Segmented Phase Error
Phase Error (deg)
10
0
−10
−20
−30
−40
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
5
0
−5
−10
d B / B
Phase Shims
Gap Shims
Z Position (m)

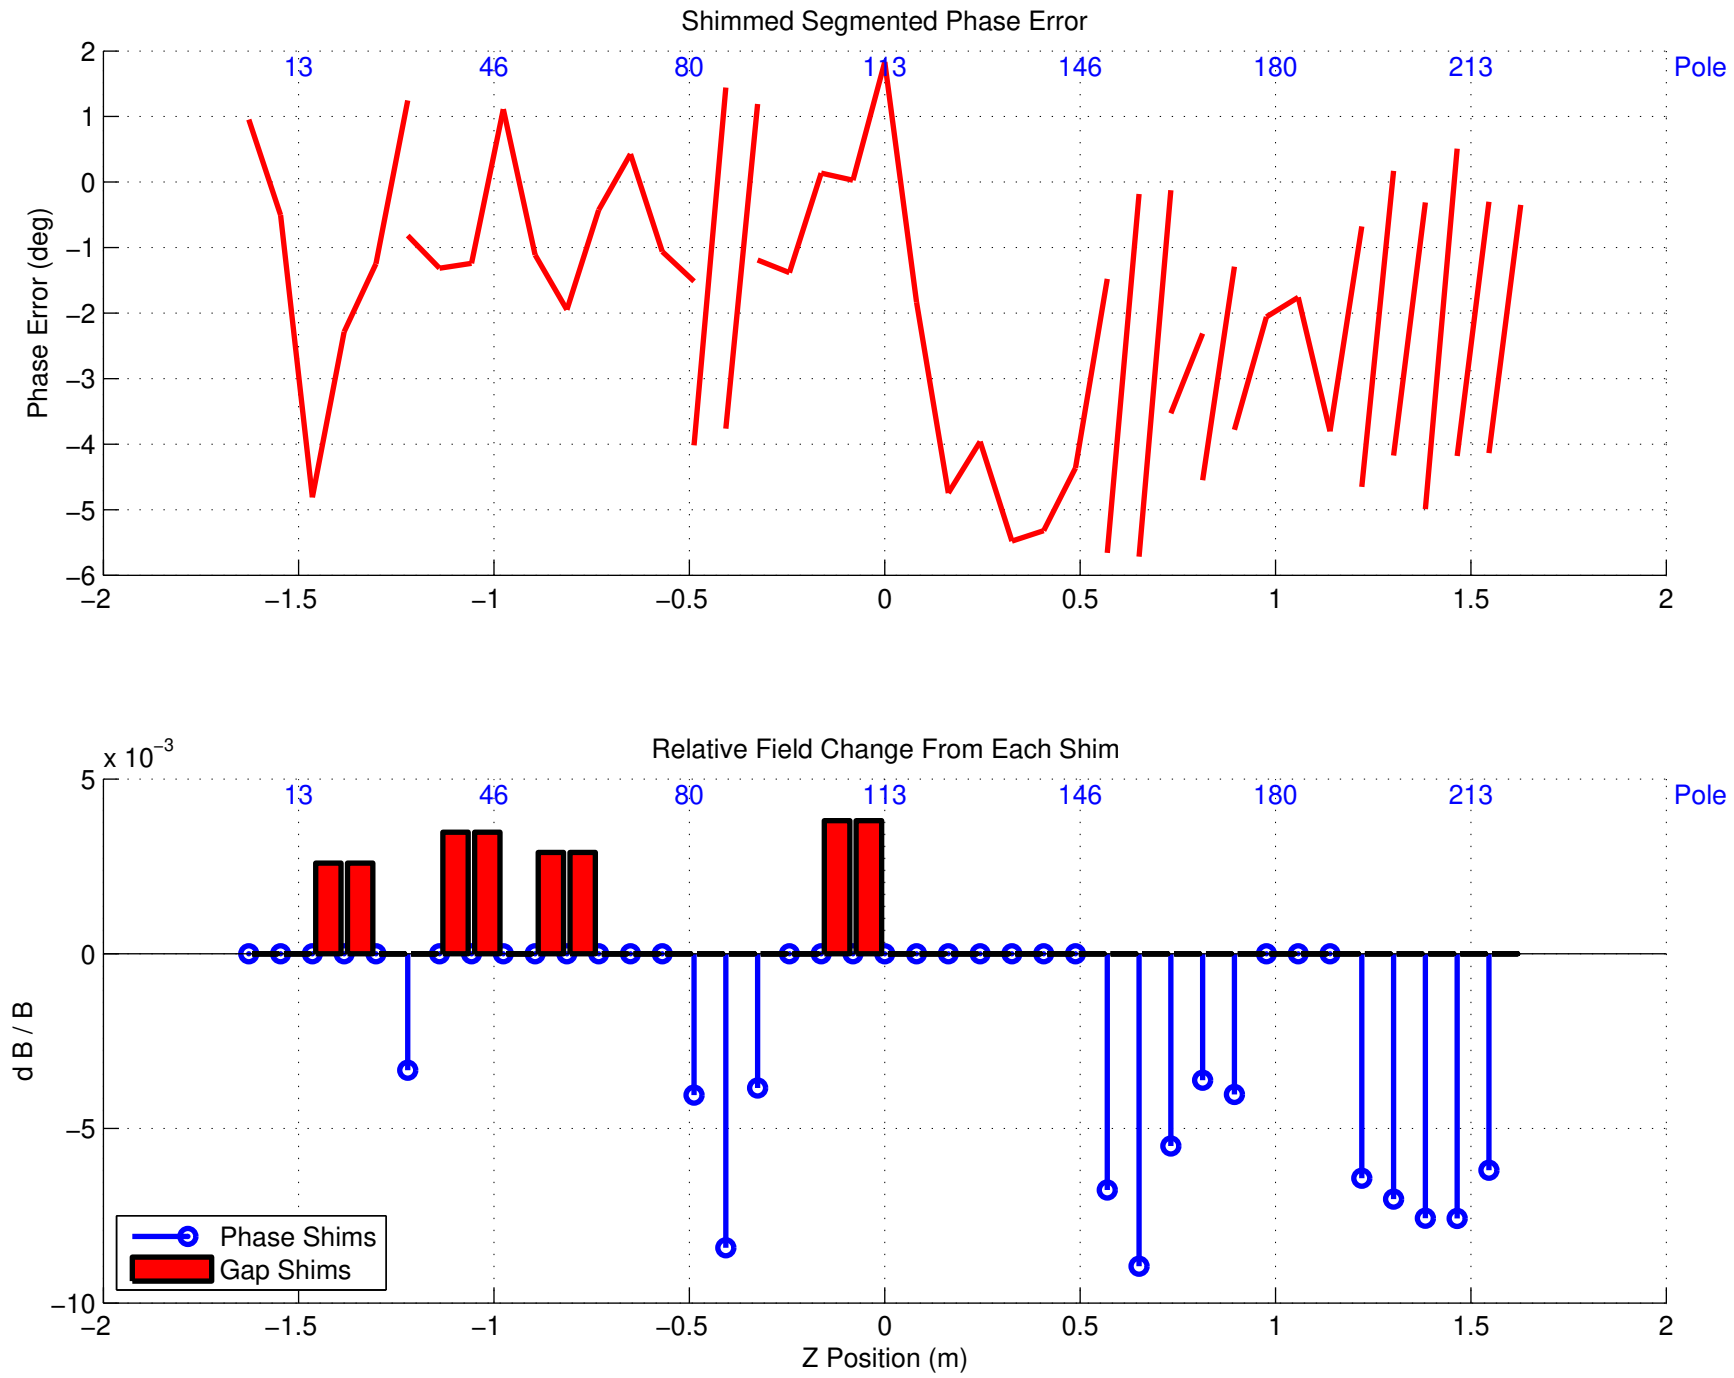
Shimmed Segmented Phase Error
Phase Error (deg)
13
46
80
113
146
180
213
Pole
2
1
0
−1
−2
−3
−4
−5
−6
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
5
0
−5
−10
Phase Shims
Gap Shims
Z Position (m)

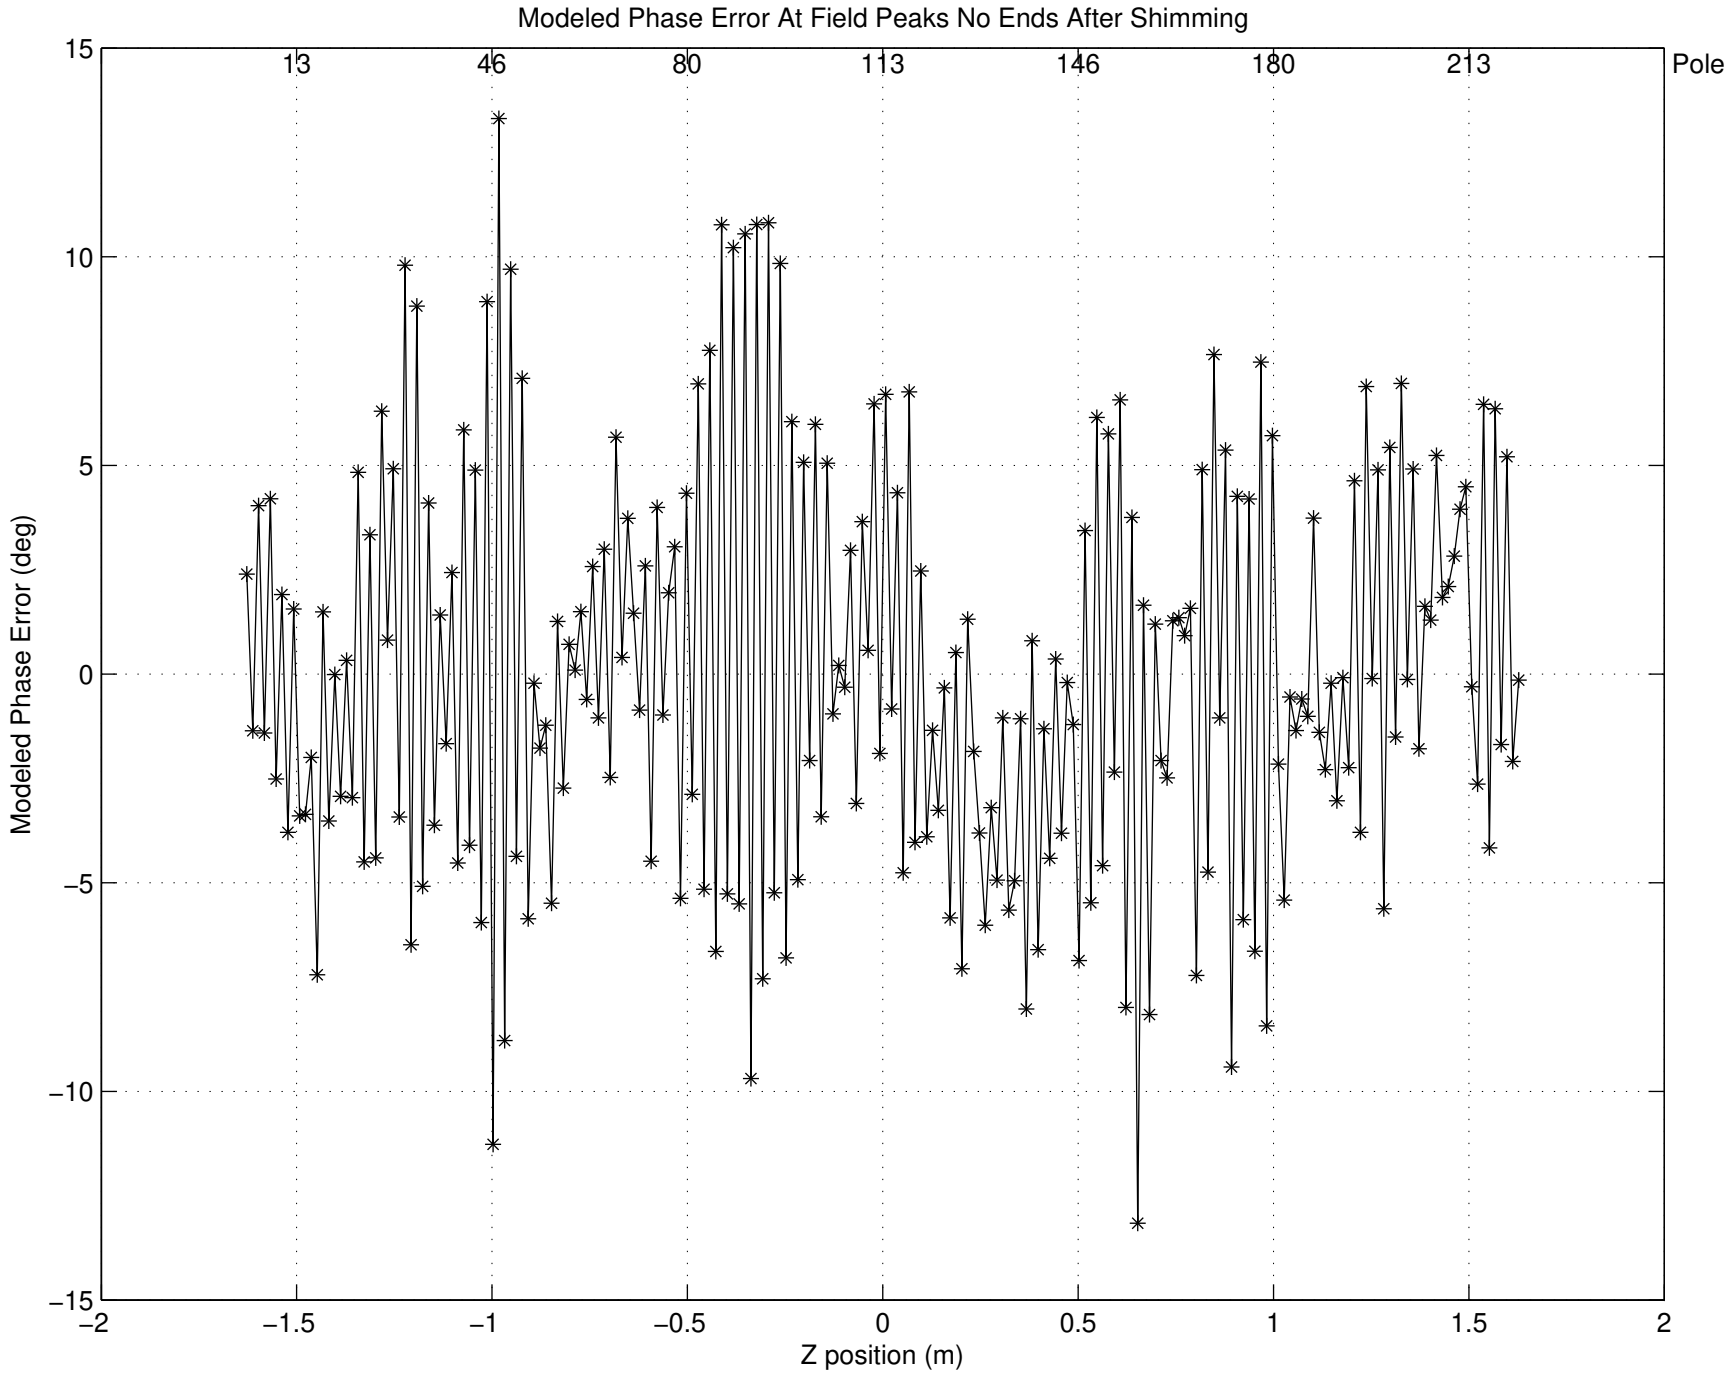

Phase Error: Ave = −0.000000 deg, RMS = 4.905472 deg