SLAC Magnetic Measurements

Planar Insertion Device Shim Analysis

Parameters:
INPUT−FILE−DIR =S:\Magdata\Lcls\Undulator\L143−112000−15\DATASET0001\Rough Tuning\Z Scans\Run 001\
INPUT−FILE−NAME =x+00000−y+000−bscanz.dat
INPUT−FILE−TYPE =ZVXYBXYH
CORR−REQUIRED =1
GAMMA =26654.56
NOM−LAMBDA−U =0.03
NOM−K−VALUE =3.4917
NOM−LAMBDA−R =1.4982e−010
NUM−POLES =226
NUM−END−POLES =4
CELL−LENGTH =3.656

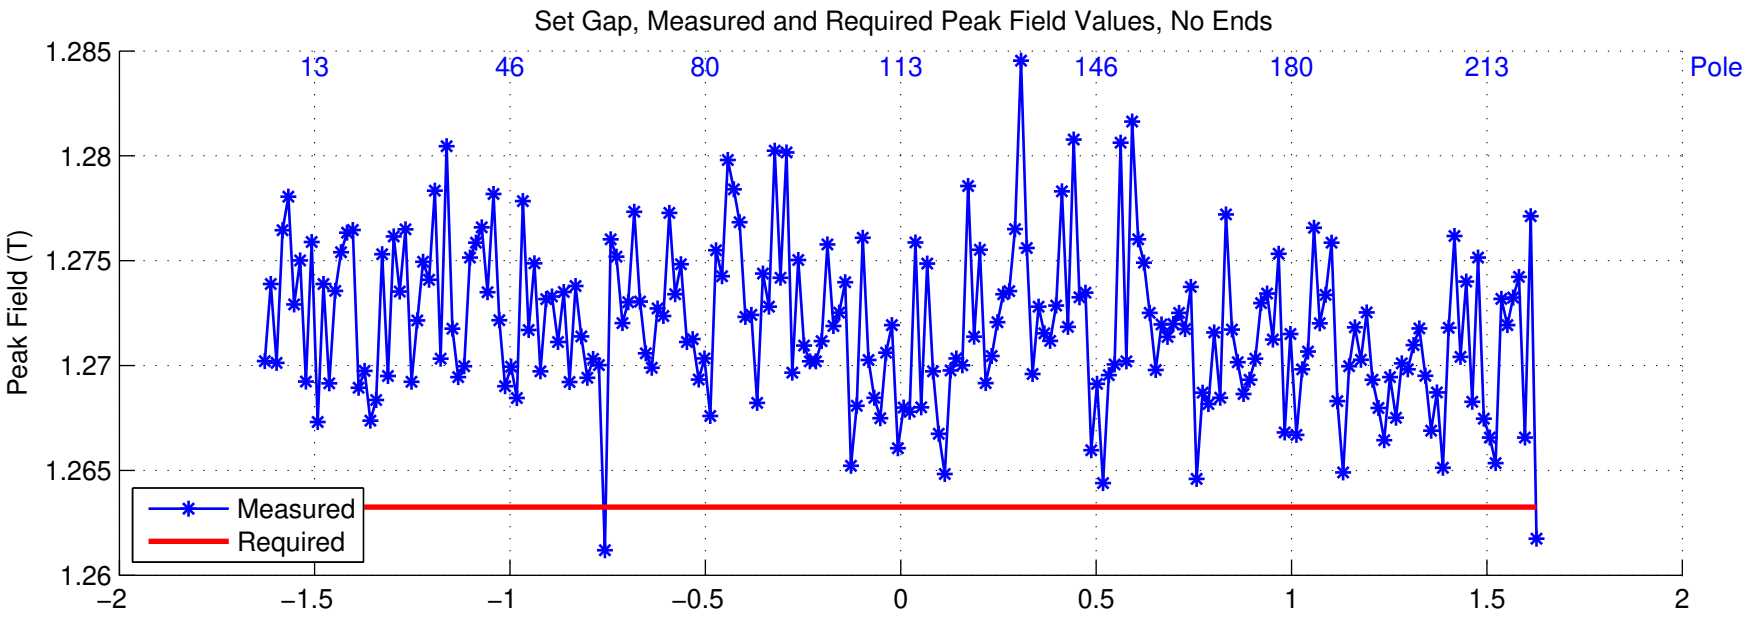
Set Gap, Measured and Required Peak Field Values, No Ends
13
46
80
113
146
180
213
Pole
1.285
1.28
1.275
1.27
1.265
1.26
Peak Field (T)
Measured
Required
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

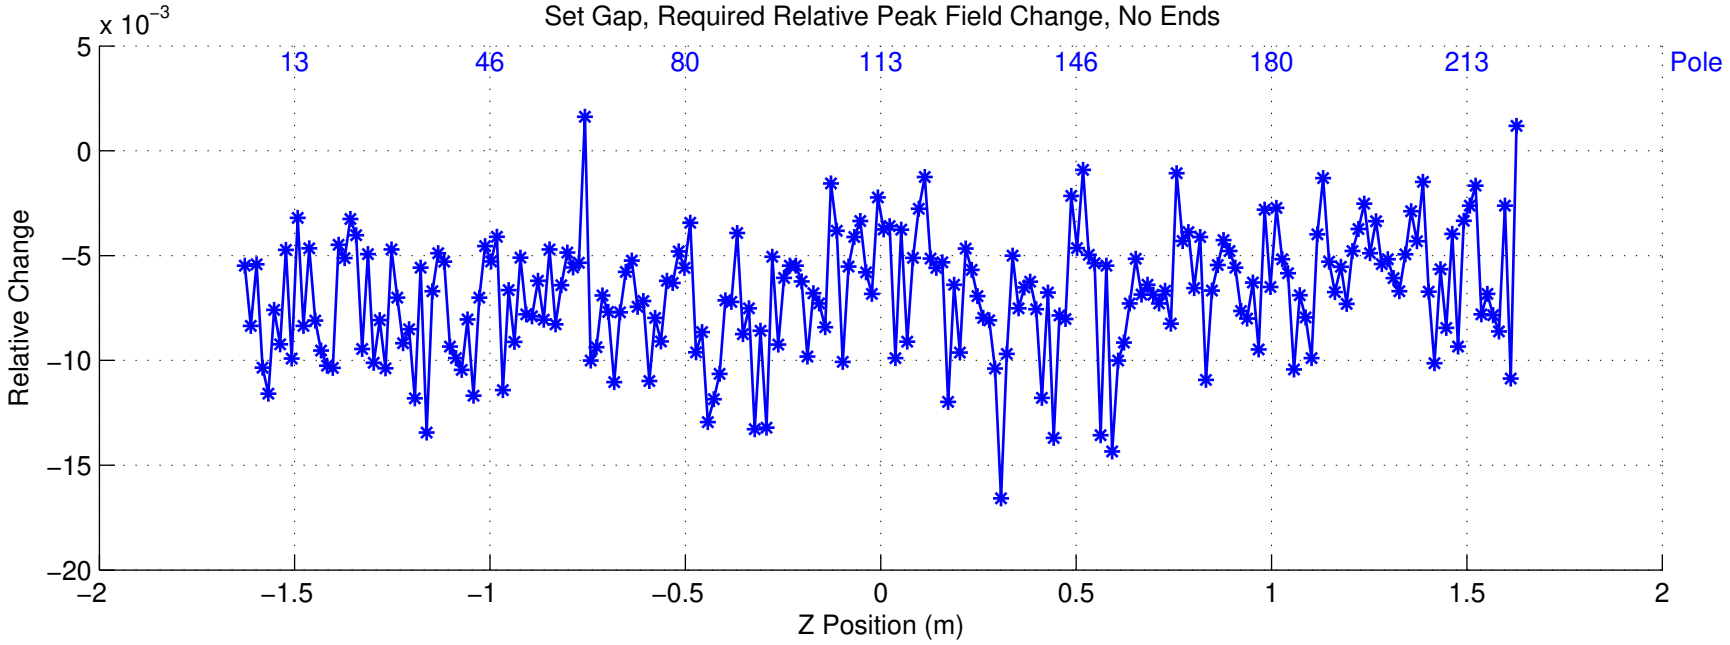
Set Gap, Required Relative Peak Field Change, No Ends
x 10^−3
13
46
80
113
146
180
213
Pole
5
0
−5
−10
−15
−20
Relative Change
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

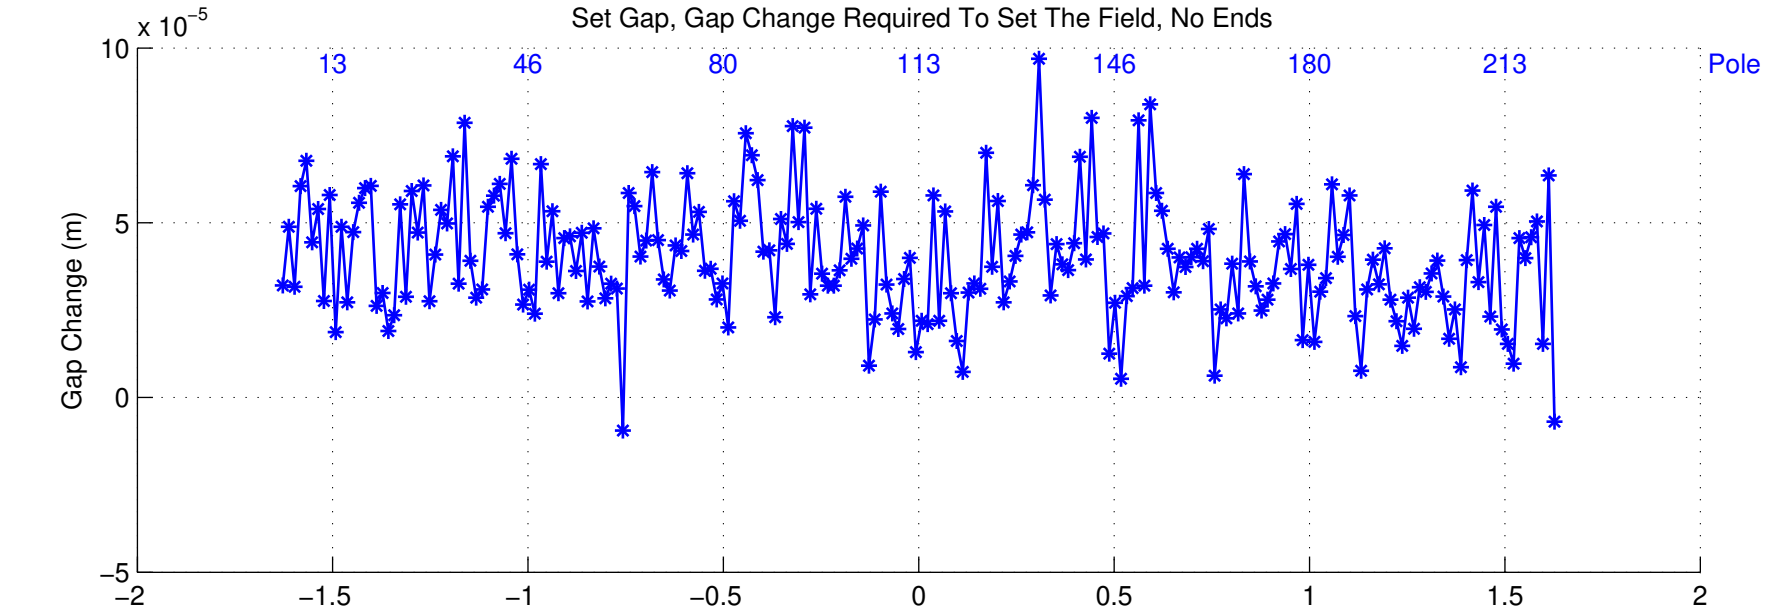
Set Gap, Gap Change Required To Set The Field, No Ends
x 10^-5
Gap Change (m)
10
5
0
−5
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

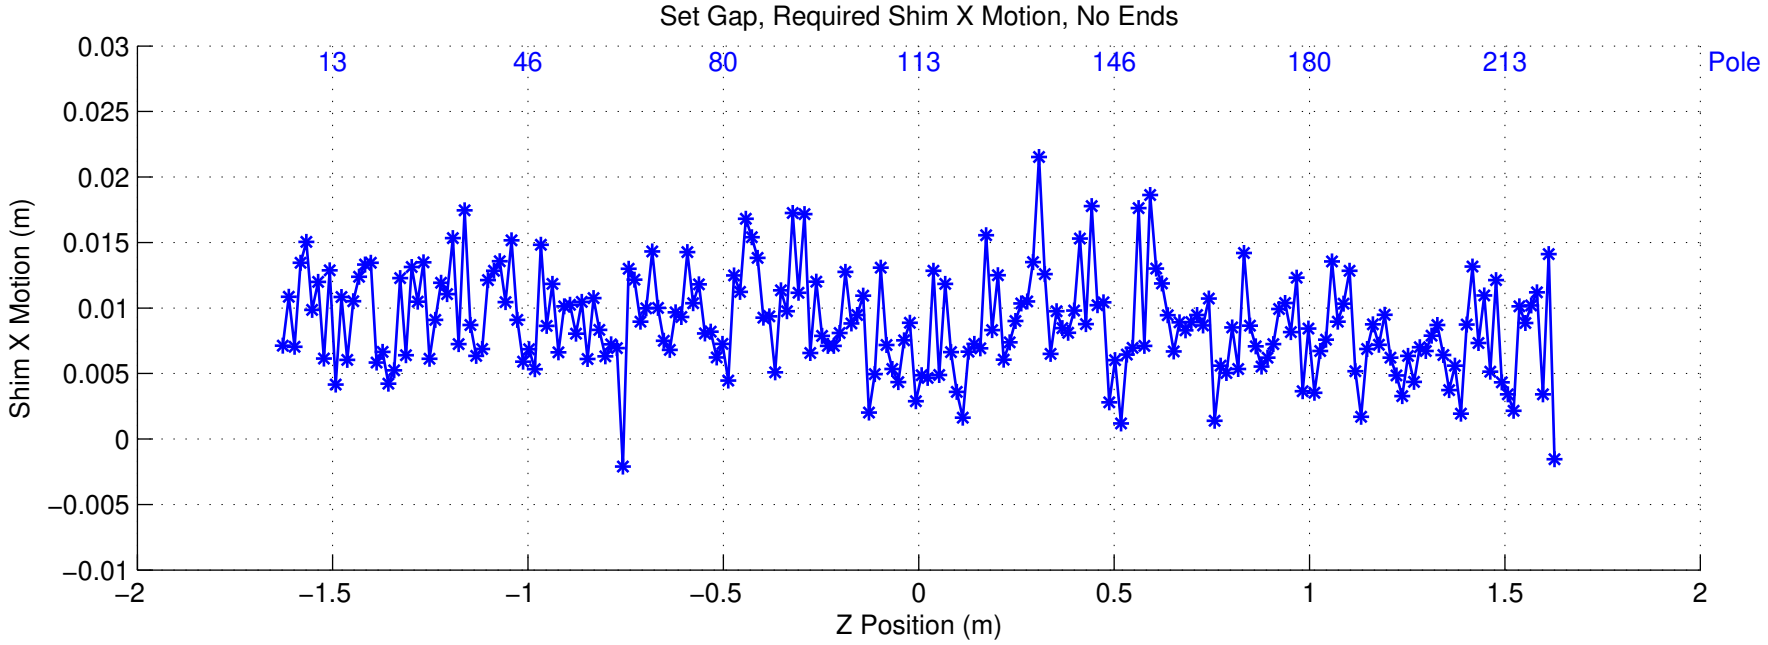
Set Gap, Required Shim X Motion, No Ends
Shim X Motion (m)
0.03
0.025
0.02
0.015
0.01
0.005
0
−0.005
−0.01
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

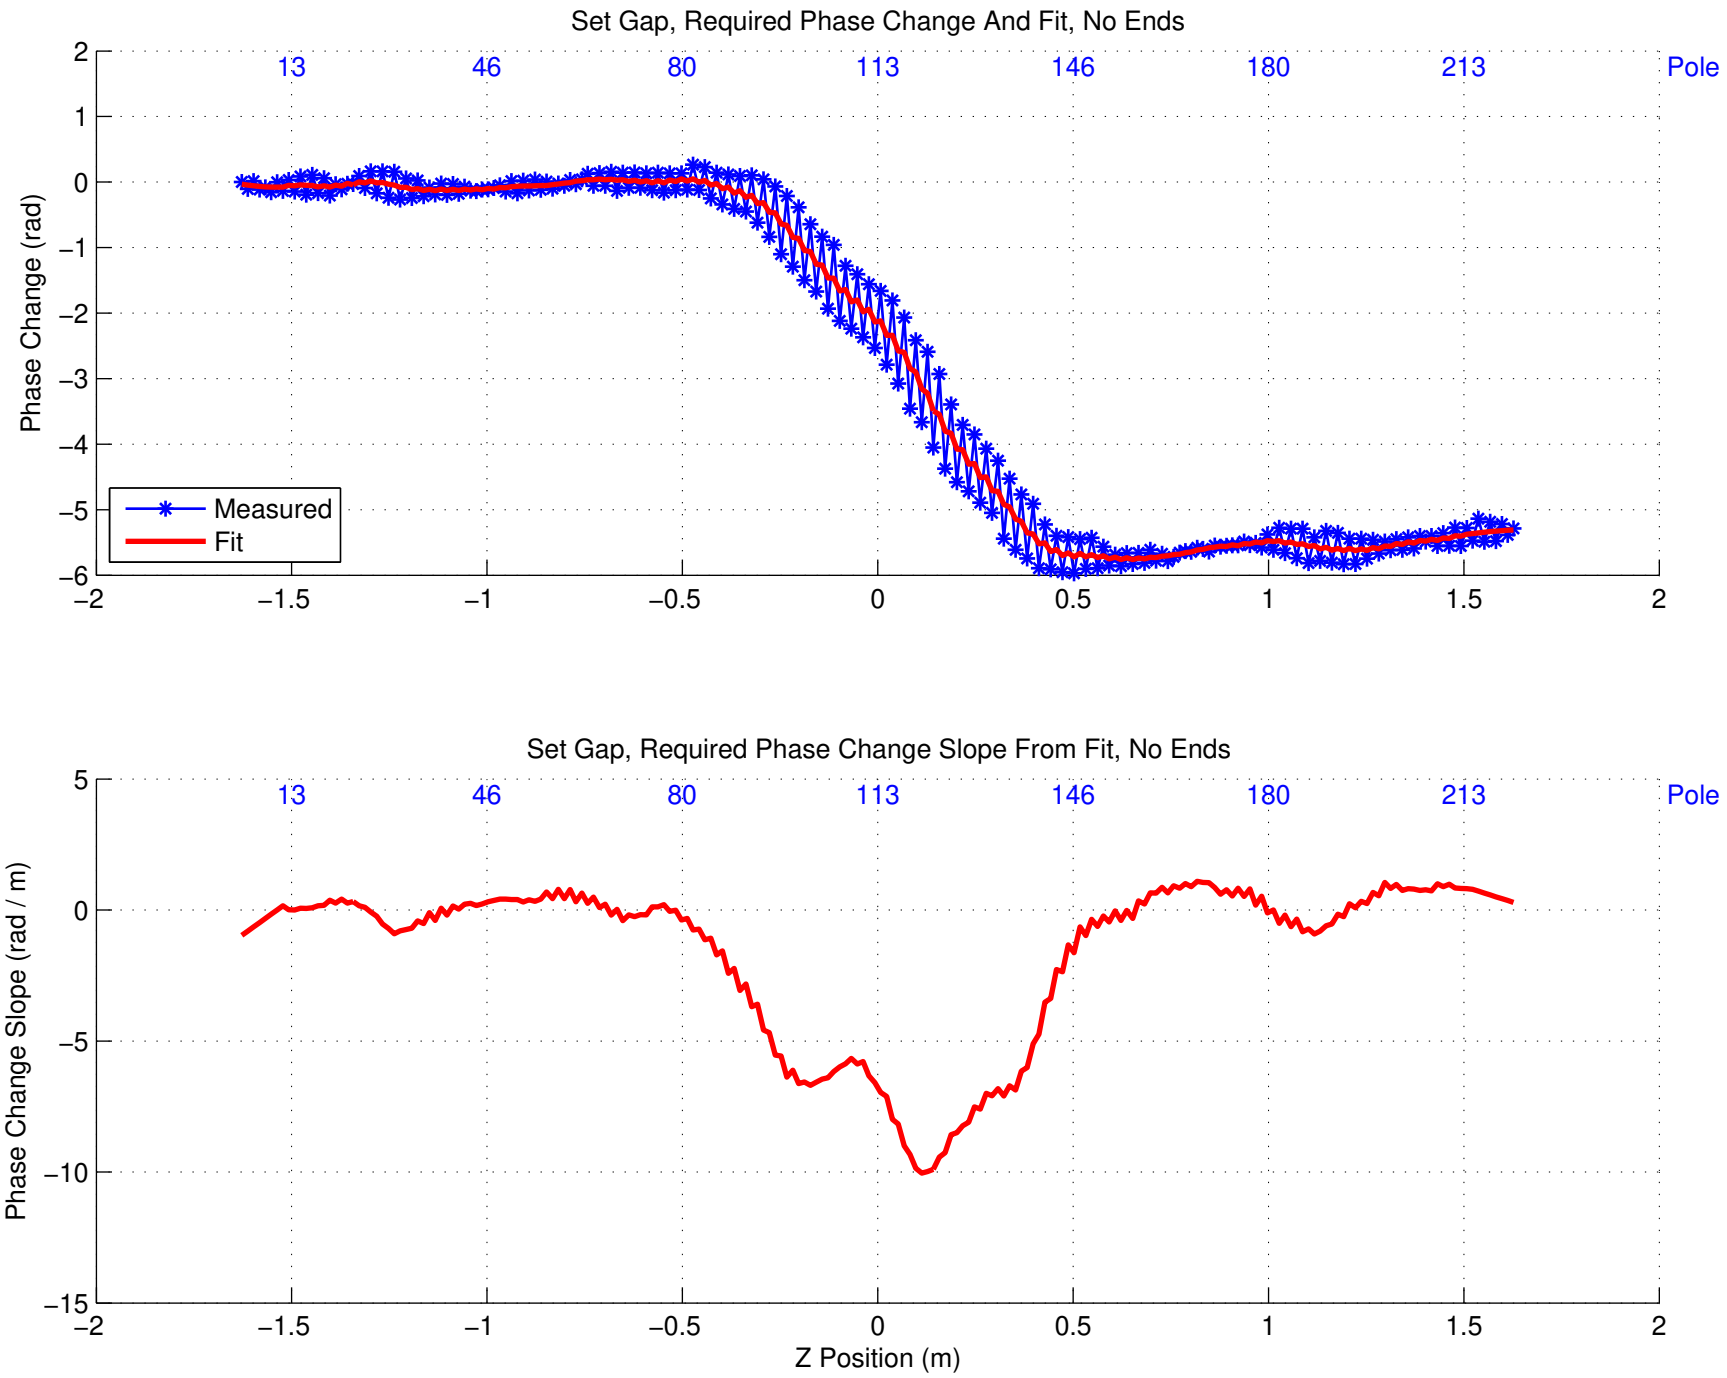
Set Gap, Required Phase Change And Fit, No Ends
13
46
80
113
146
180
213
Pole
Phase Change (rad)
Measured
Fit
Set Gap, Required Phase Change Slope From Fit, No Ends
Phase Change Slope (rad / m)
Z Position (m)

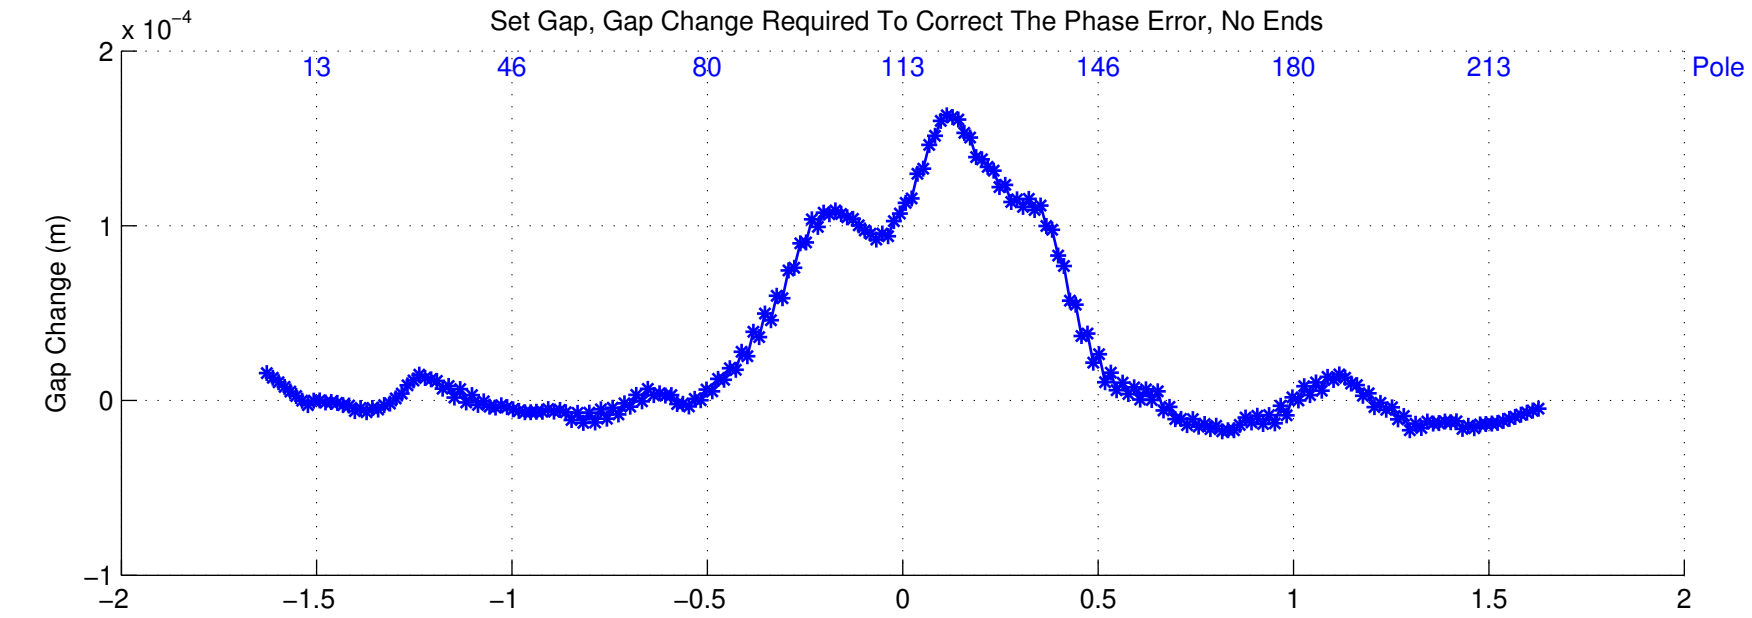
Set Gap, Gap Change Required To Correct The Phase Error, No Ends
x 10^-4
Gap Change (m)
2
1
0
−1
−2
−1.5
−0.5
0.5
1.5
13
46
80
113
146
180
213
Pole

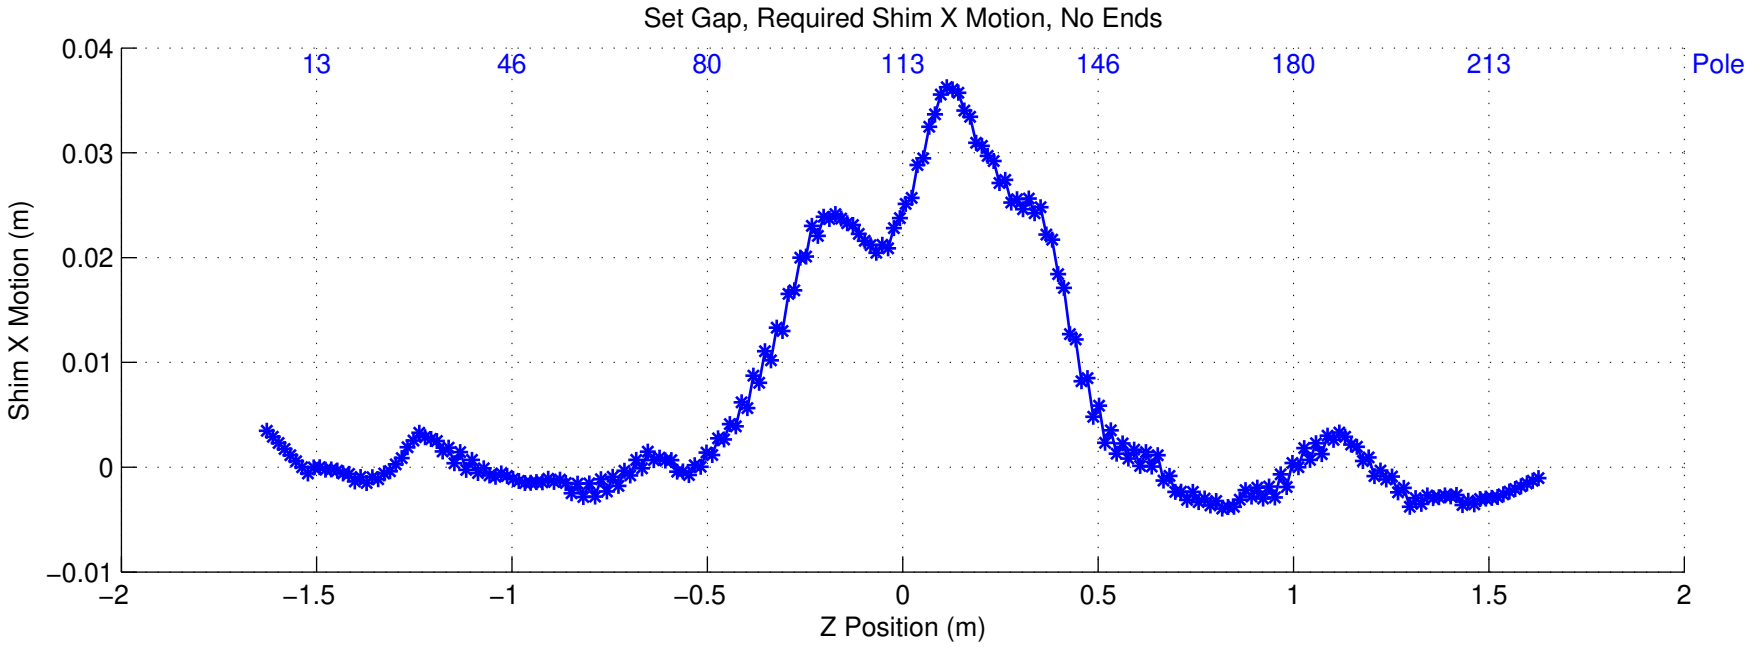
Set Gap, Required Shim X Motion, No Ends
Shim X Motion (m)
0.04
0.03
0.02
0.01
0
−0.01
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
13
46
80
113
146
180
213
Pole

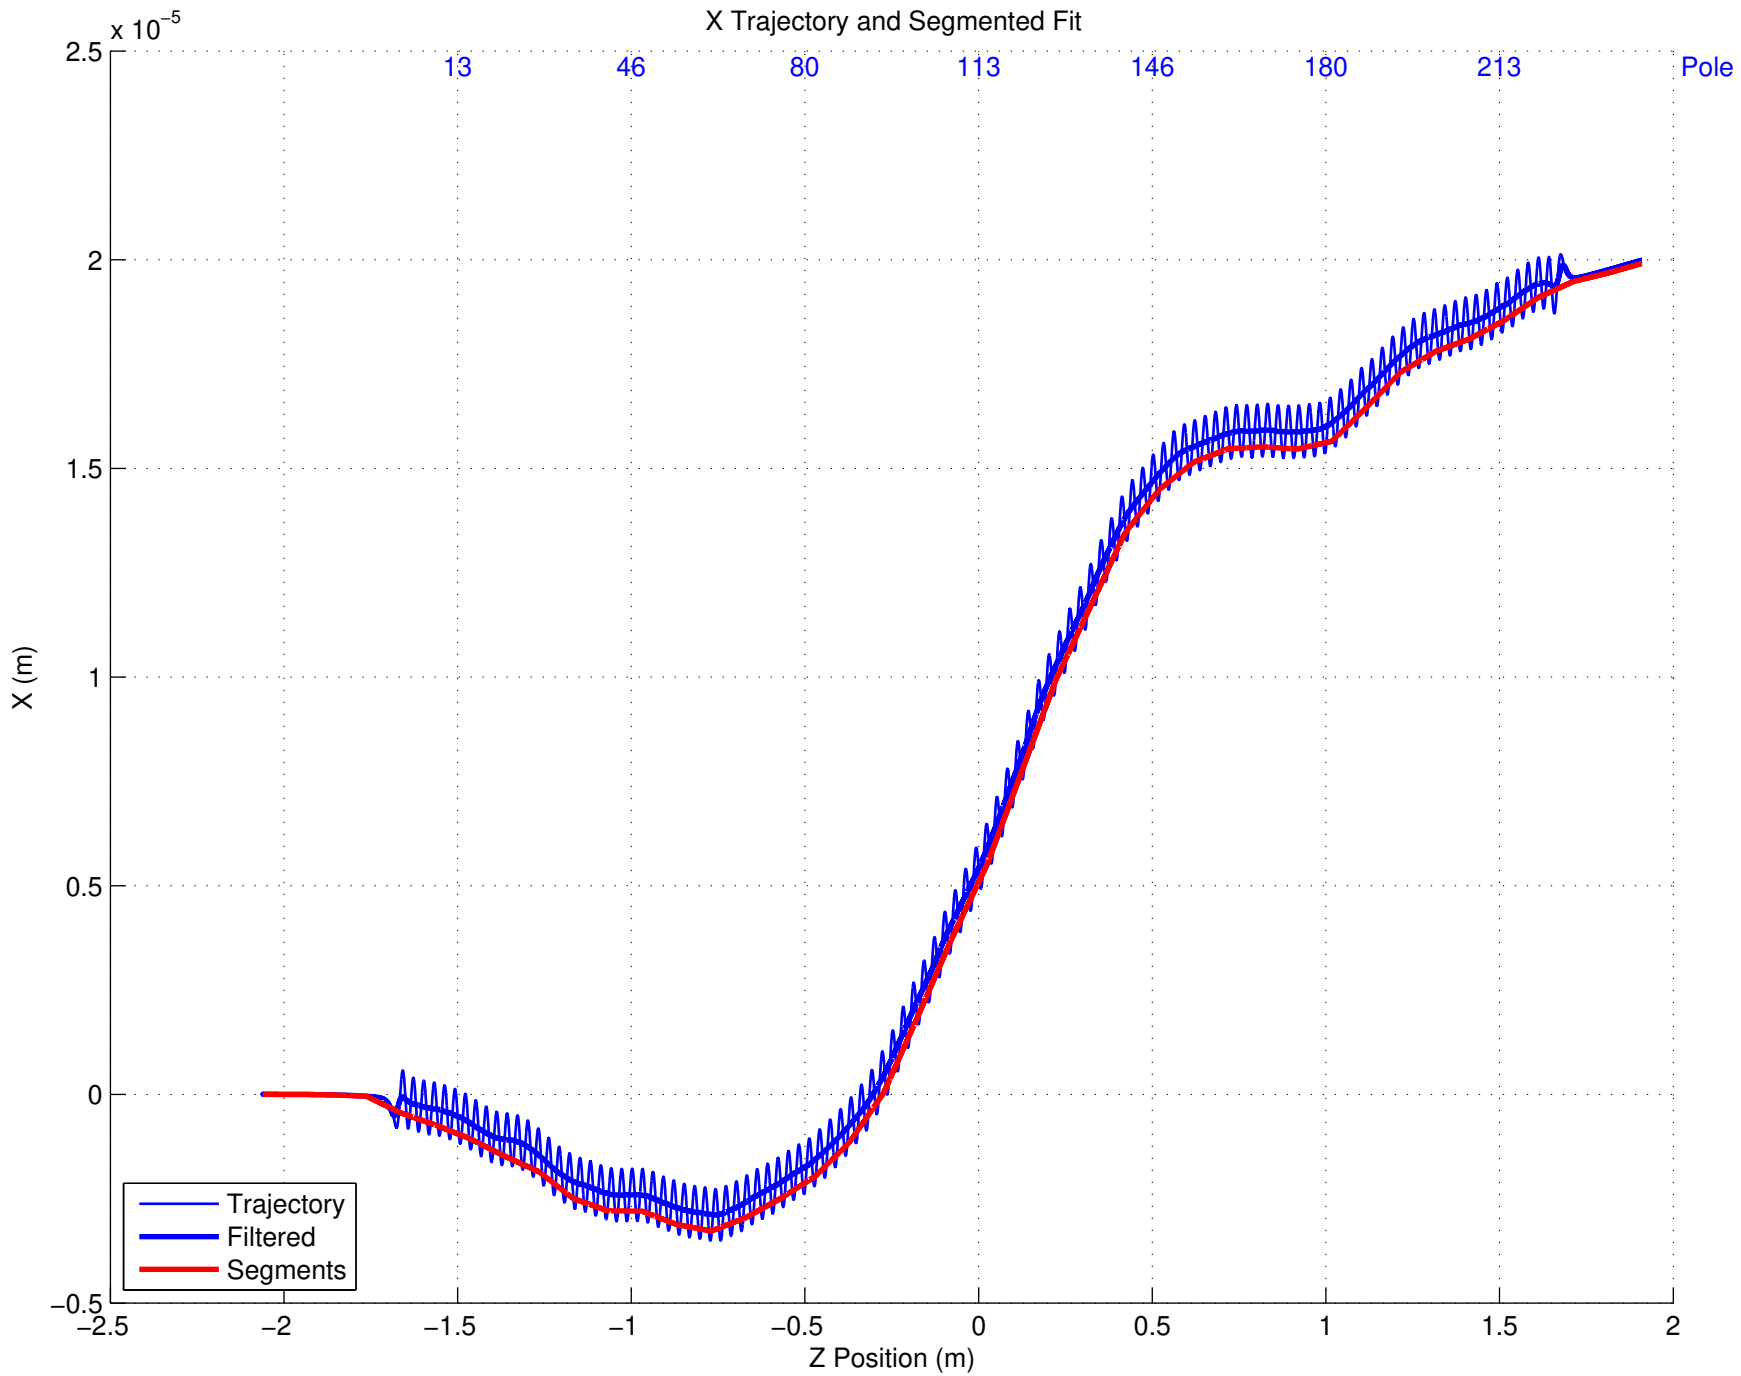
X Trajectory and Segmented Fit
x 10^-5
13
46
80
113
146
180
213
Pole
2.5
2
1.5
1
0.5
0
−0.5
X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

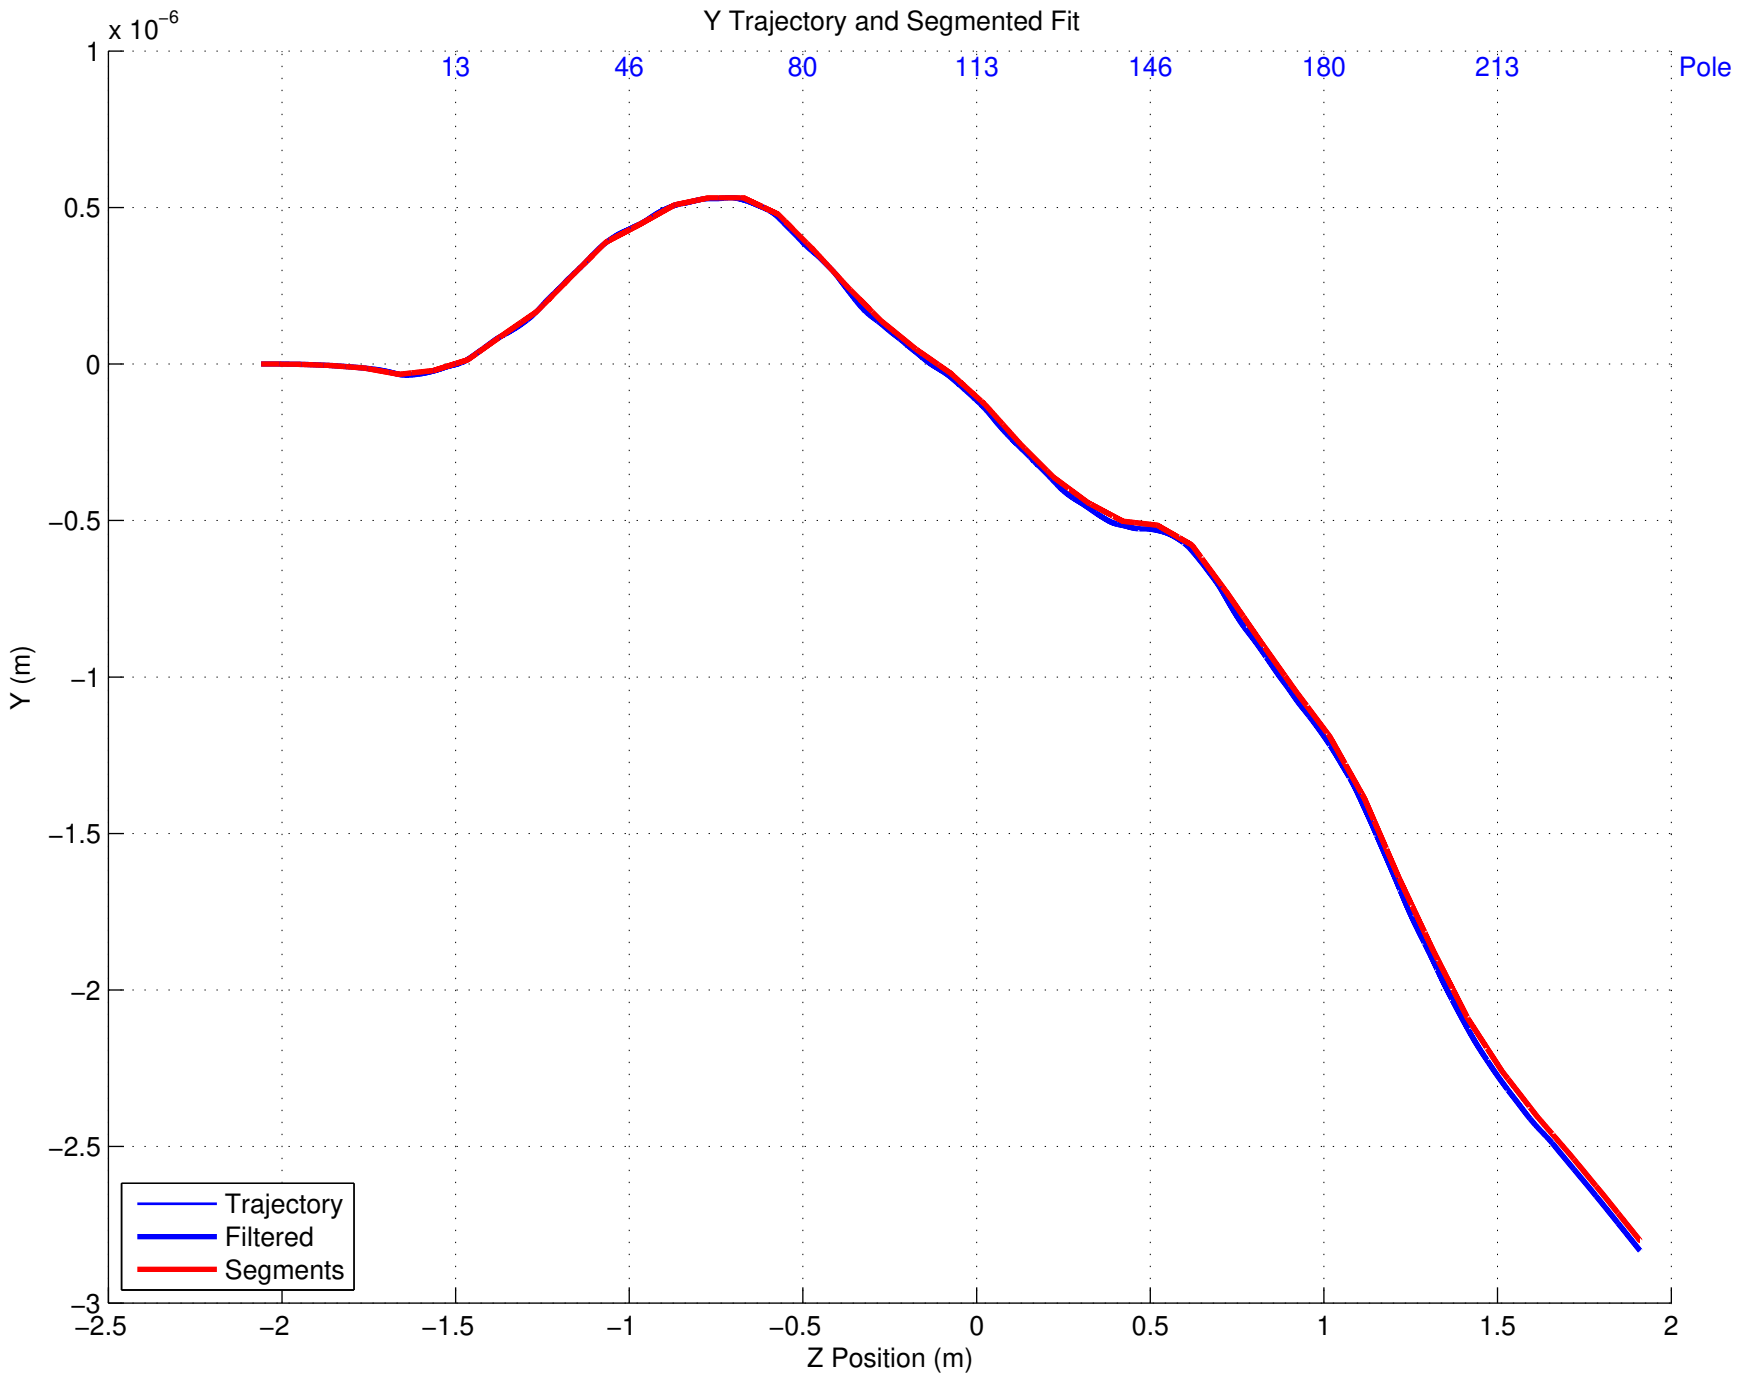
Y Trajectory and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
1
0.5
0
−0.5
−1
−1.5
−2
−2.5
−3
Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

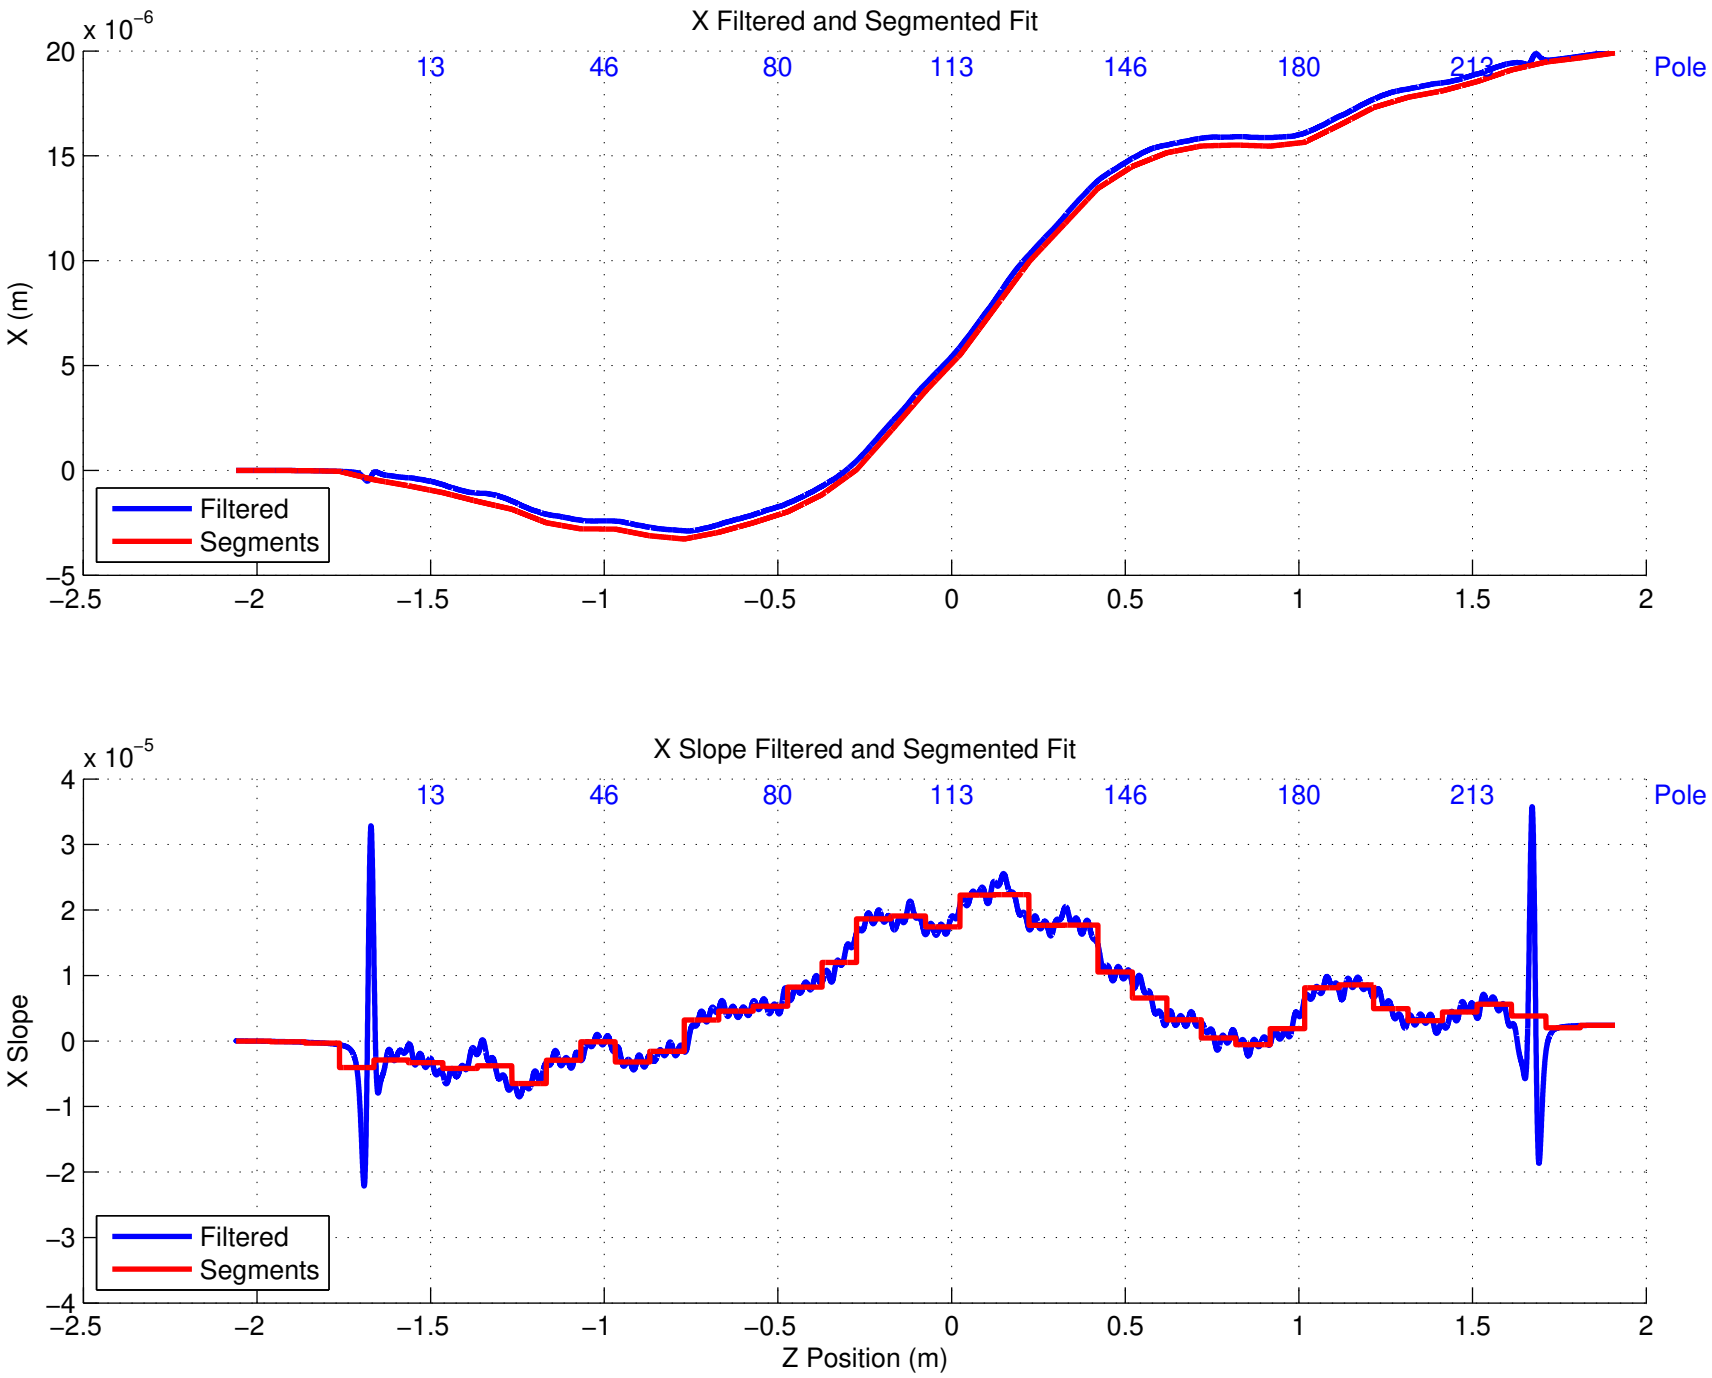
X Filtered and Segmented Fit
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
X Slope Filtered and Segmented Fit
x 10^-5
X Slope
Z Position (m)

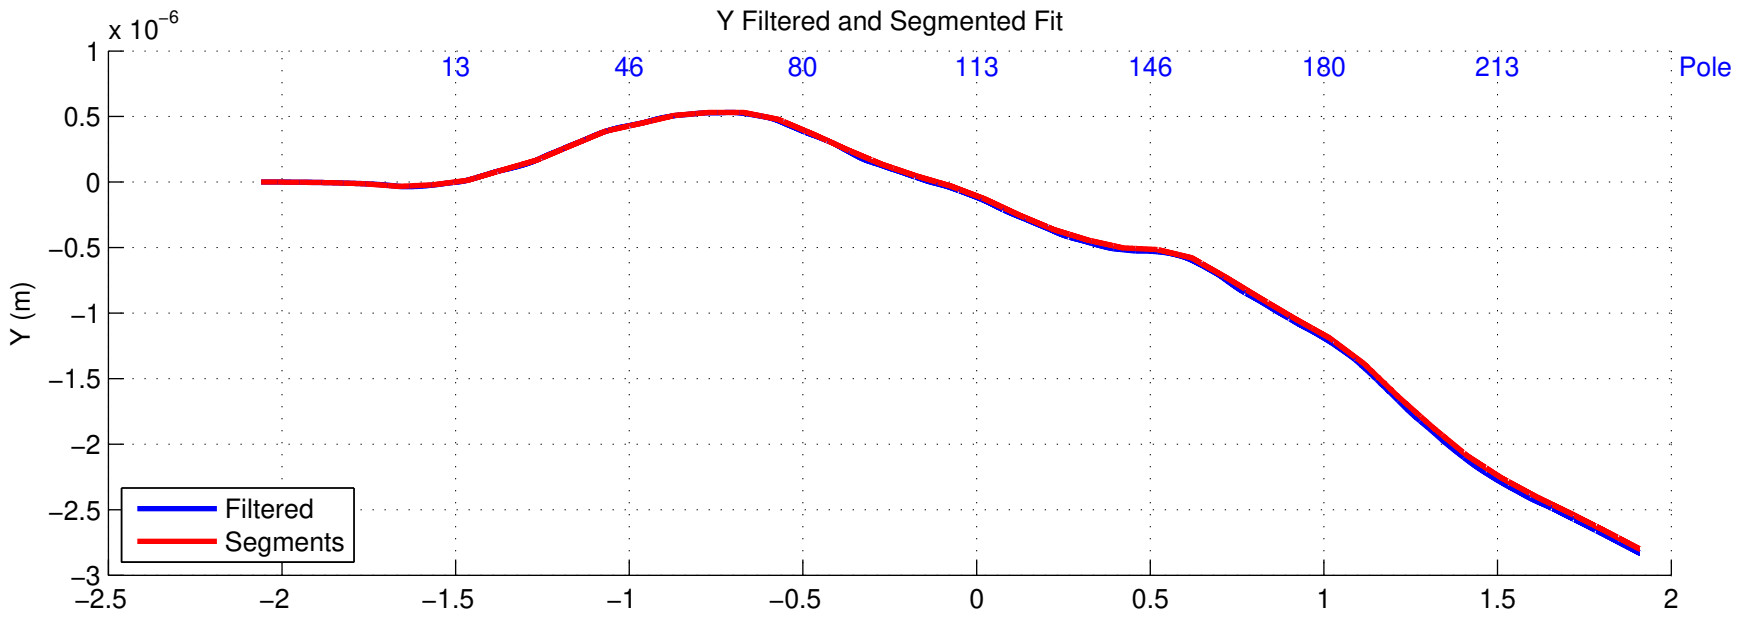
Y Filtered and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
Y (m)
Filtered
Segments

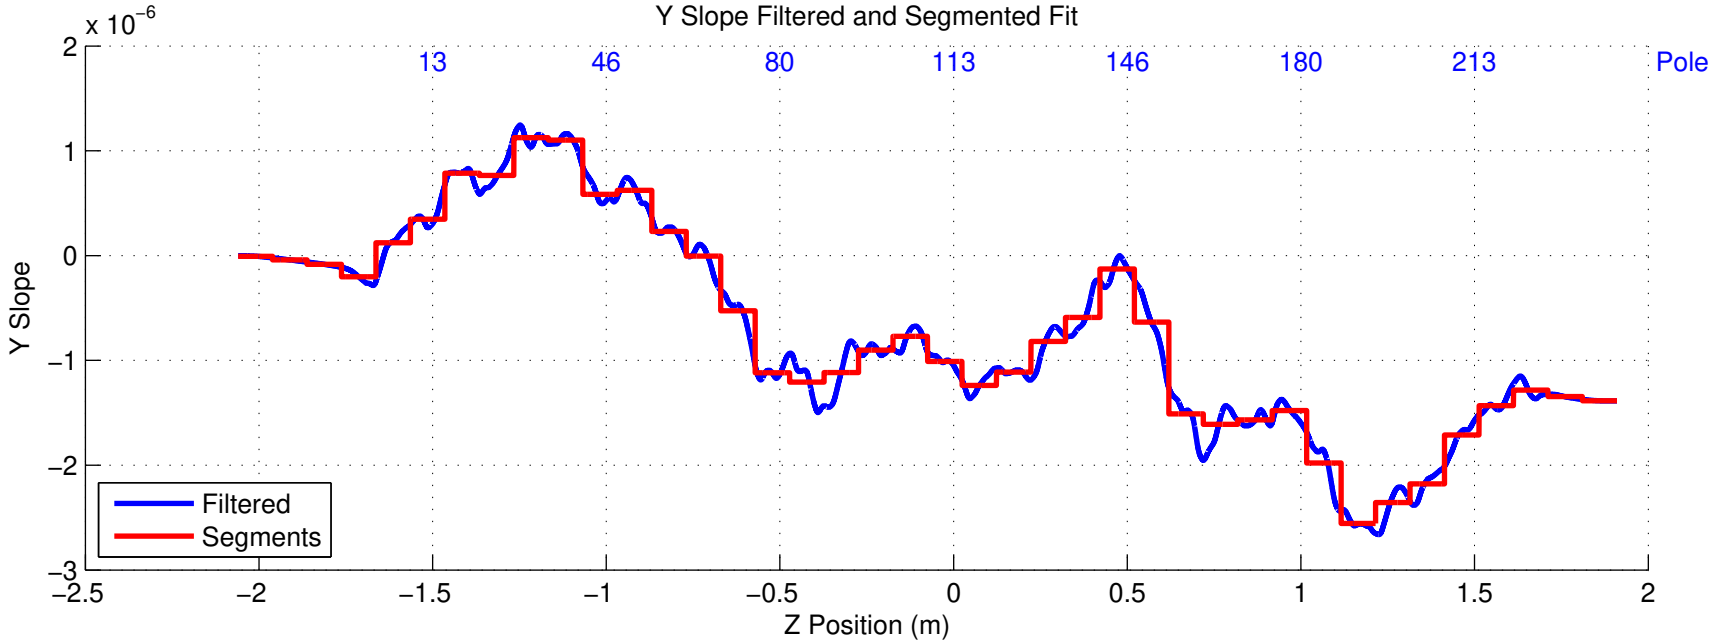
Y Slope Filtered and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
Y Slope
Filtered
Segments
Z Position (m)

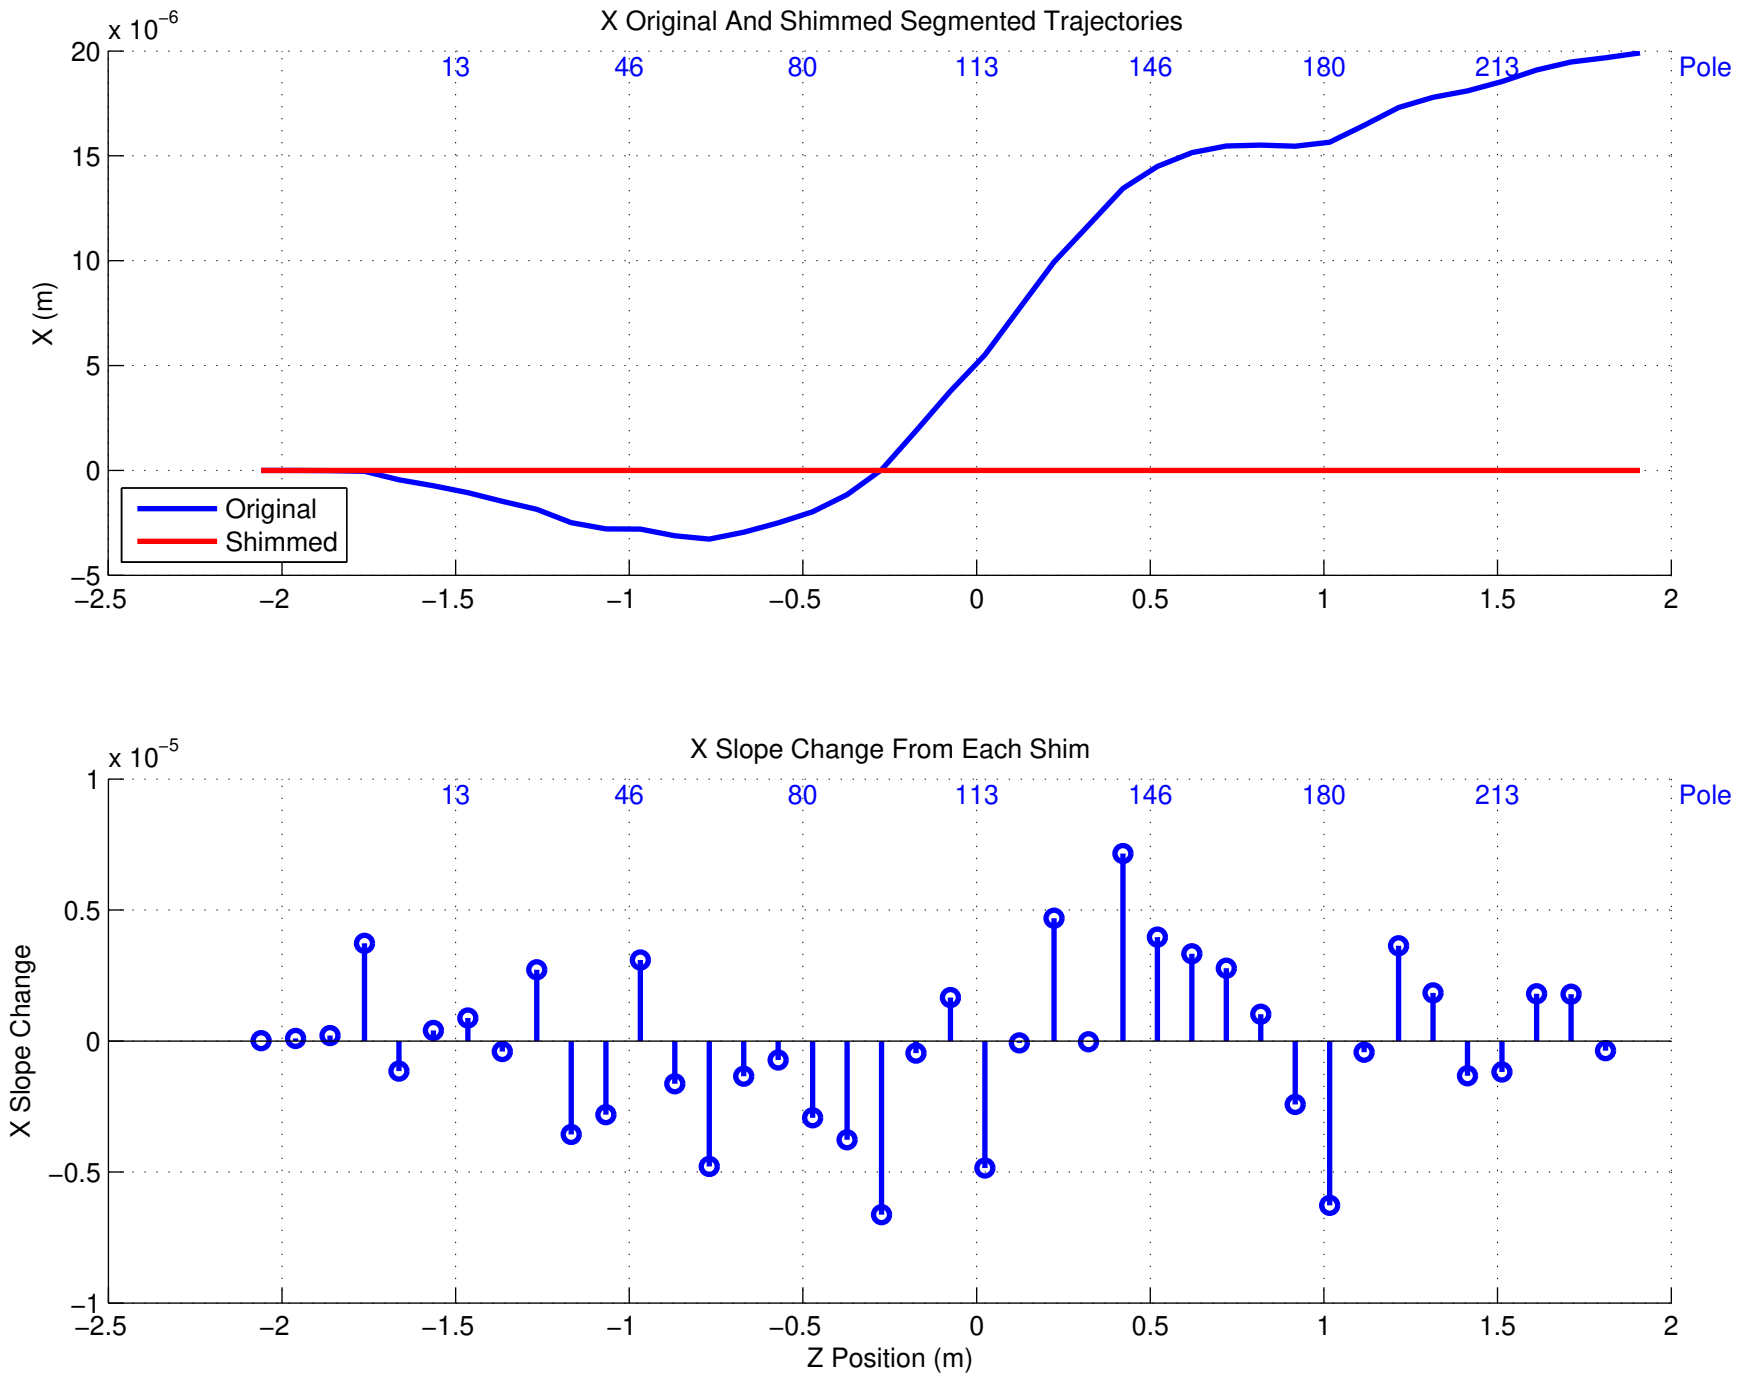
X Original And Shimmed Segmented Trajectories
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
Original
Shimmed
X Slope Change From Each Shim
x 10^-5
X Slope Change
Z Position (m)

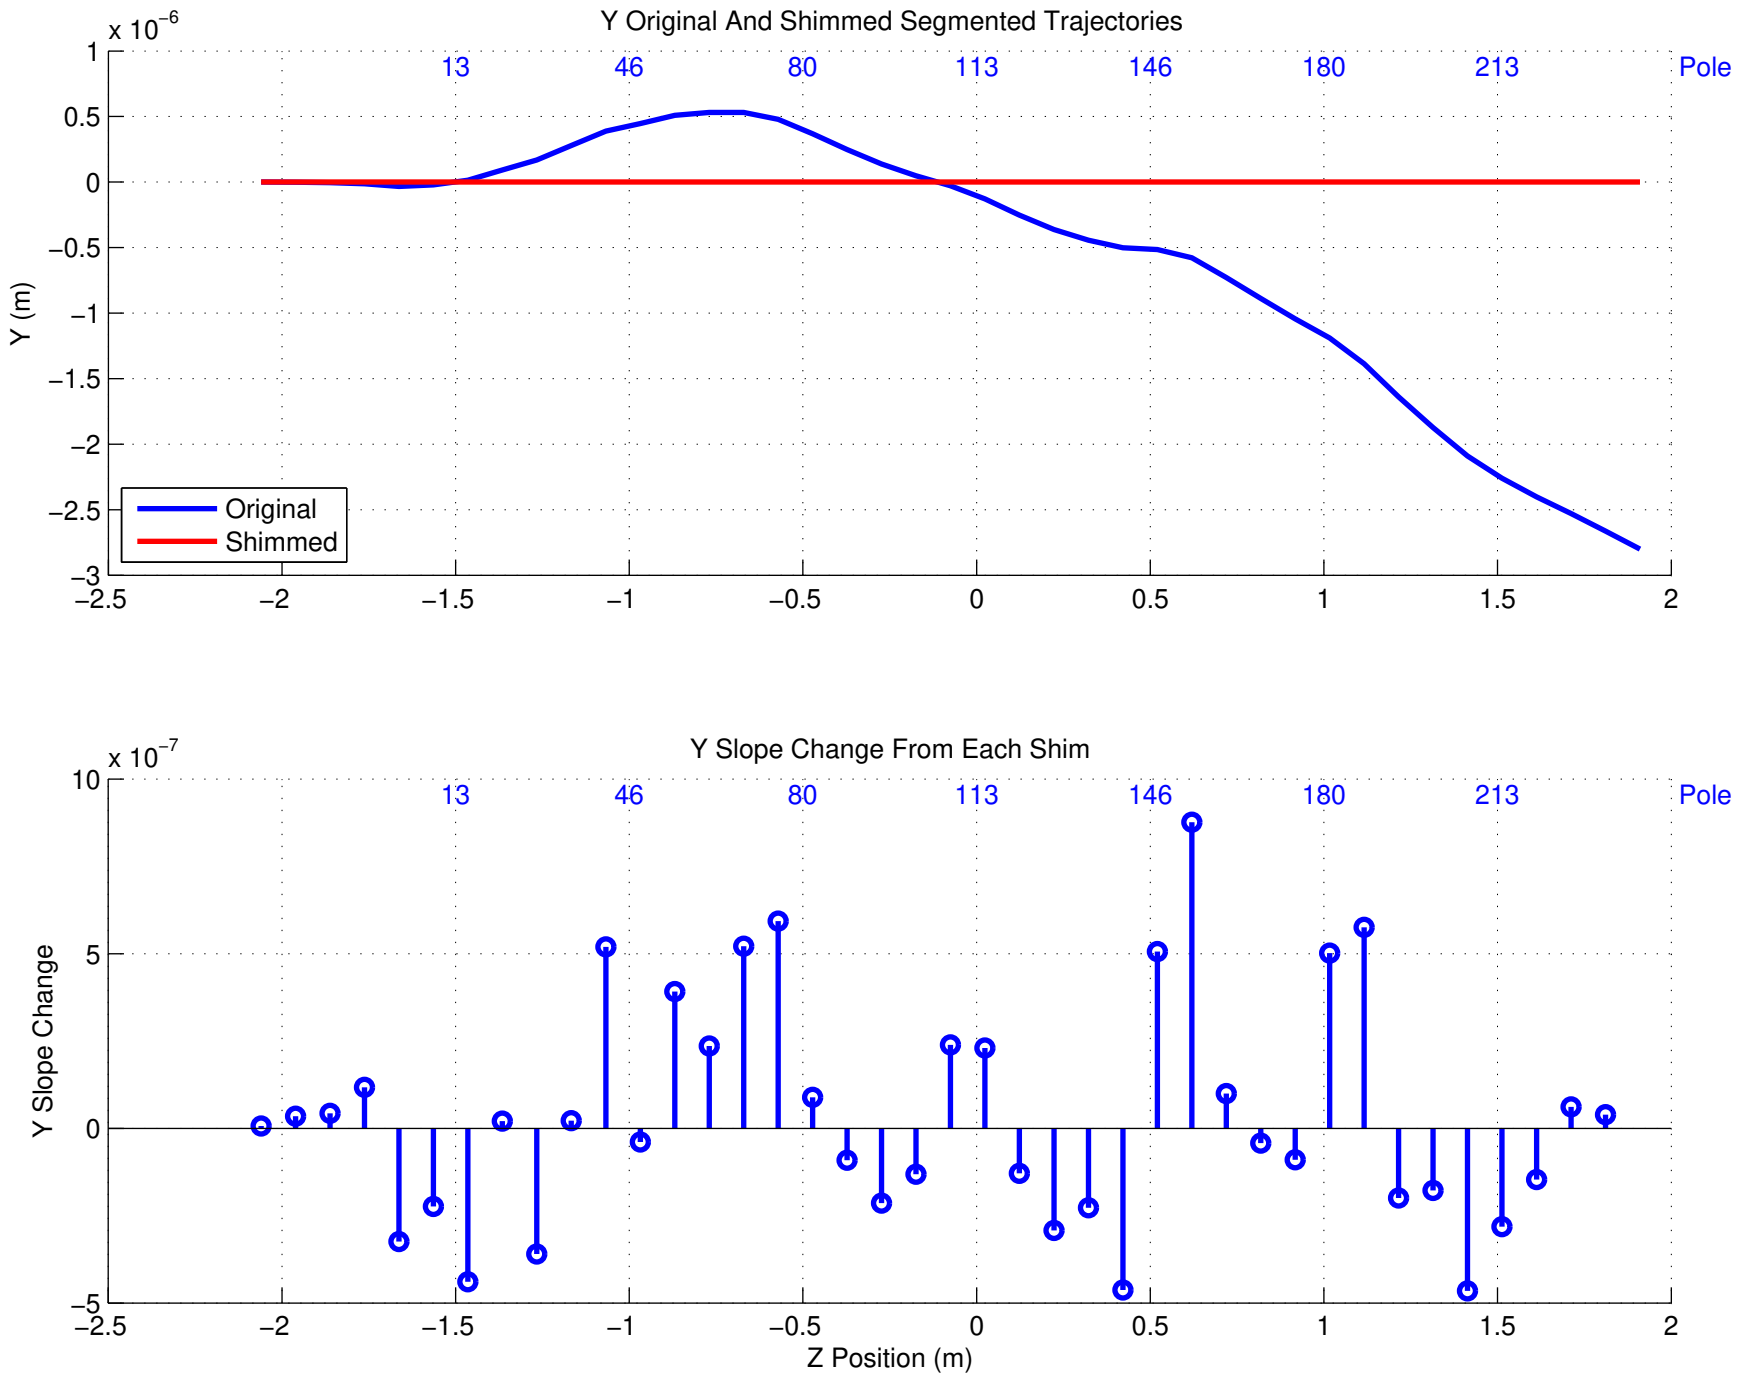
Y Original And Shimmed Segmented Trajectories
x 10^-6
13
46
80
113
146
180
213
Pole
Y (m)
Original
Shimmed
Y Slope Change From Each Shim
x 10^-7
Y Slope Change
Z Position (m)

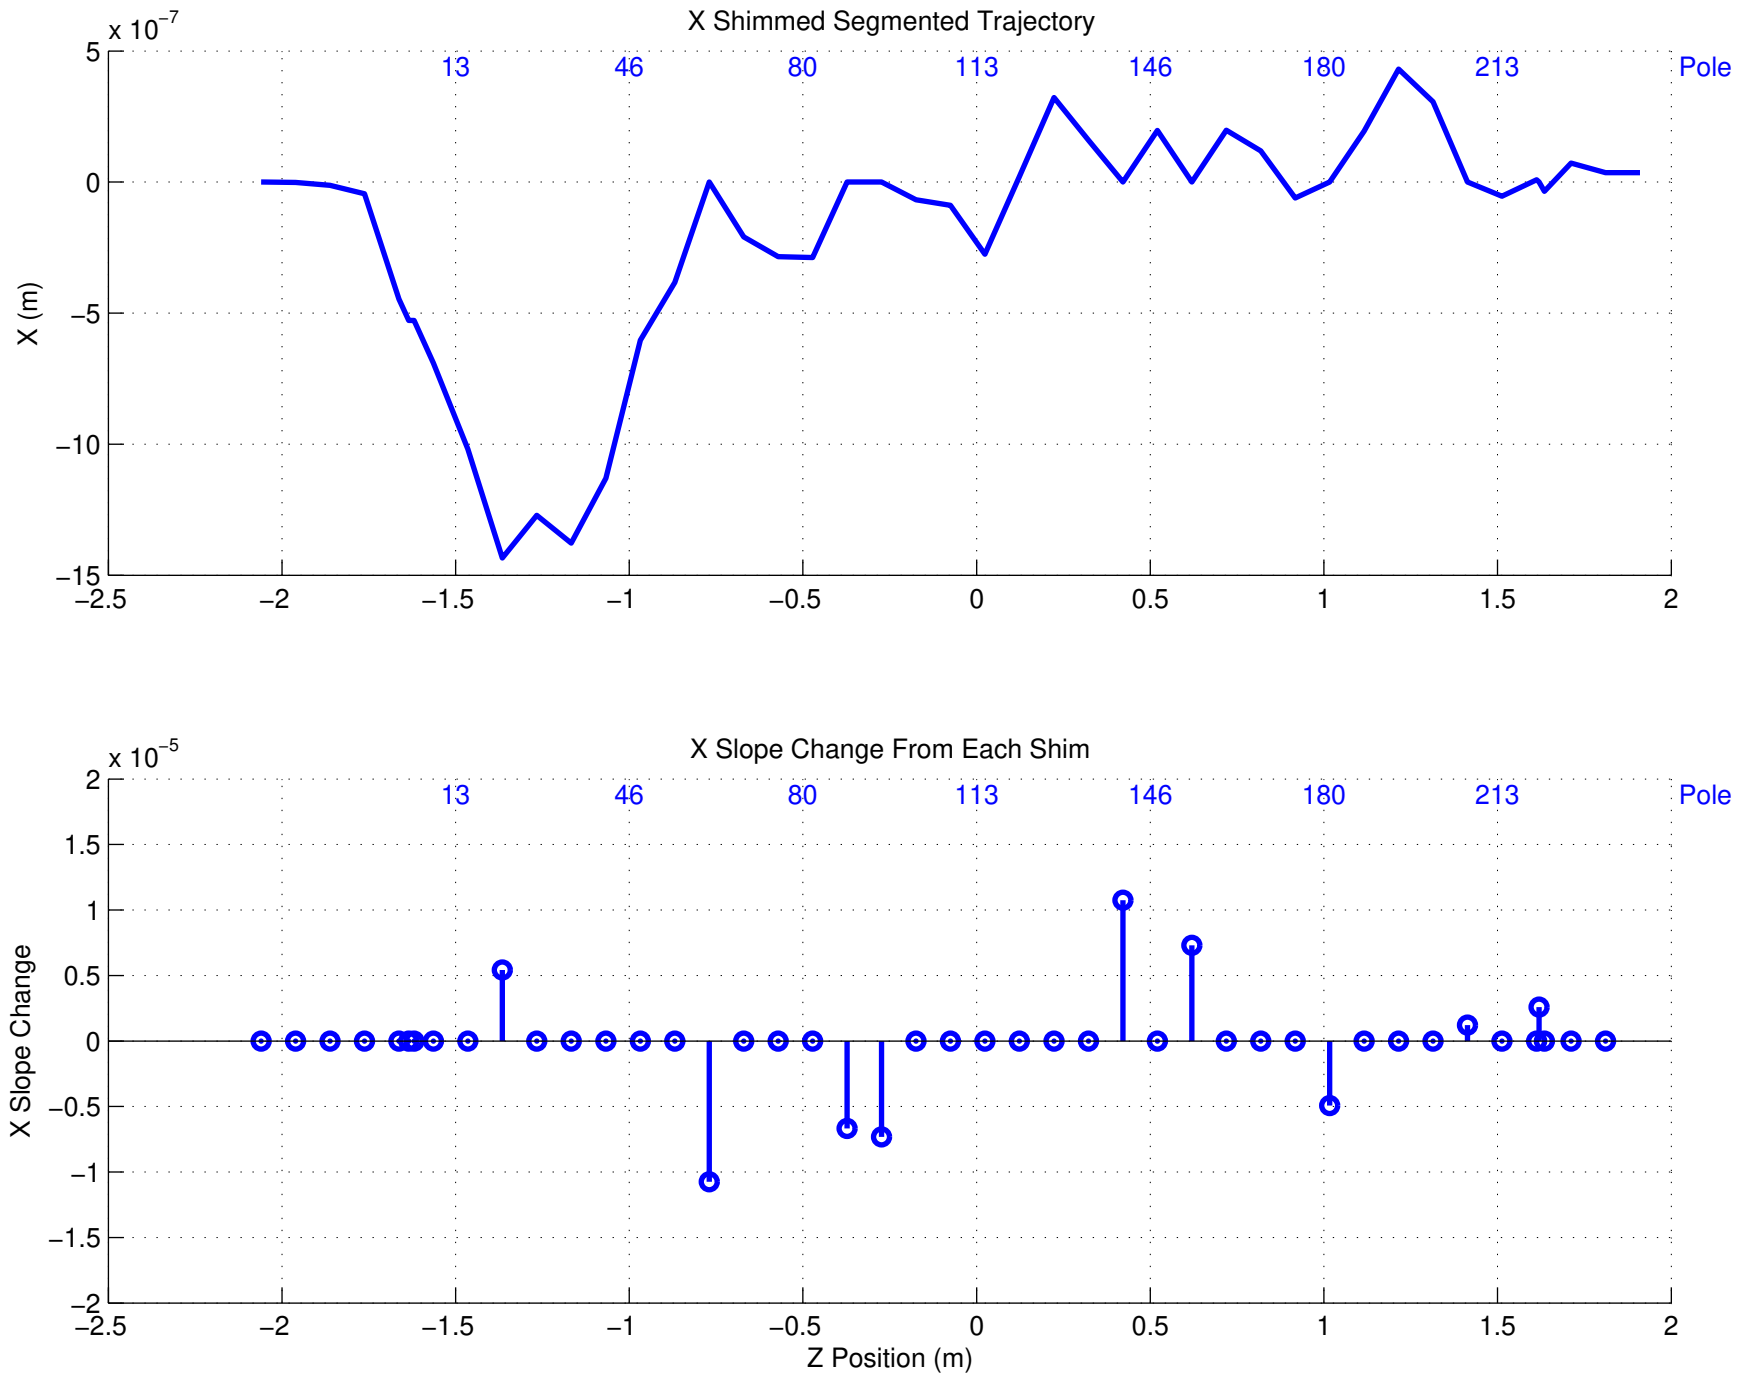
X Shimmed Segmented Trajectory
x 10^-7
X (m)
13
46
80
113
146
180
213
Pole
X Slope Change From Each Shim
x 10^-5
X Slope Change
Z Position (m)

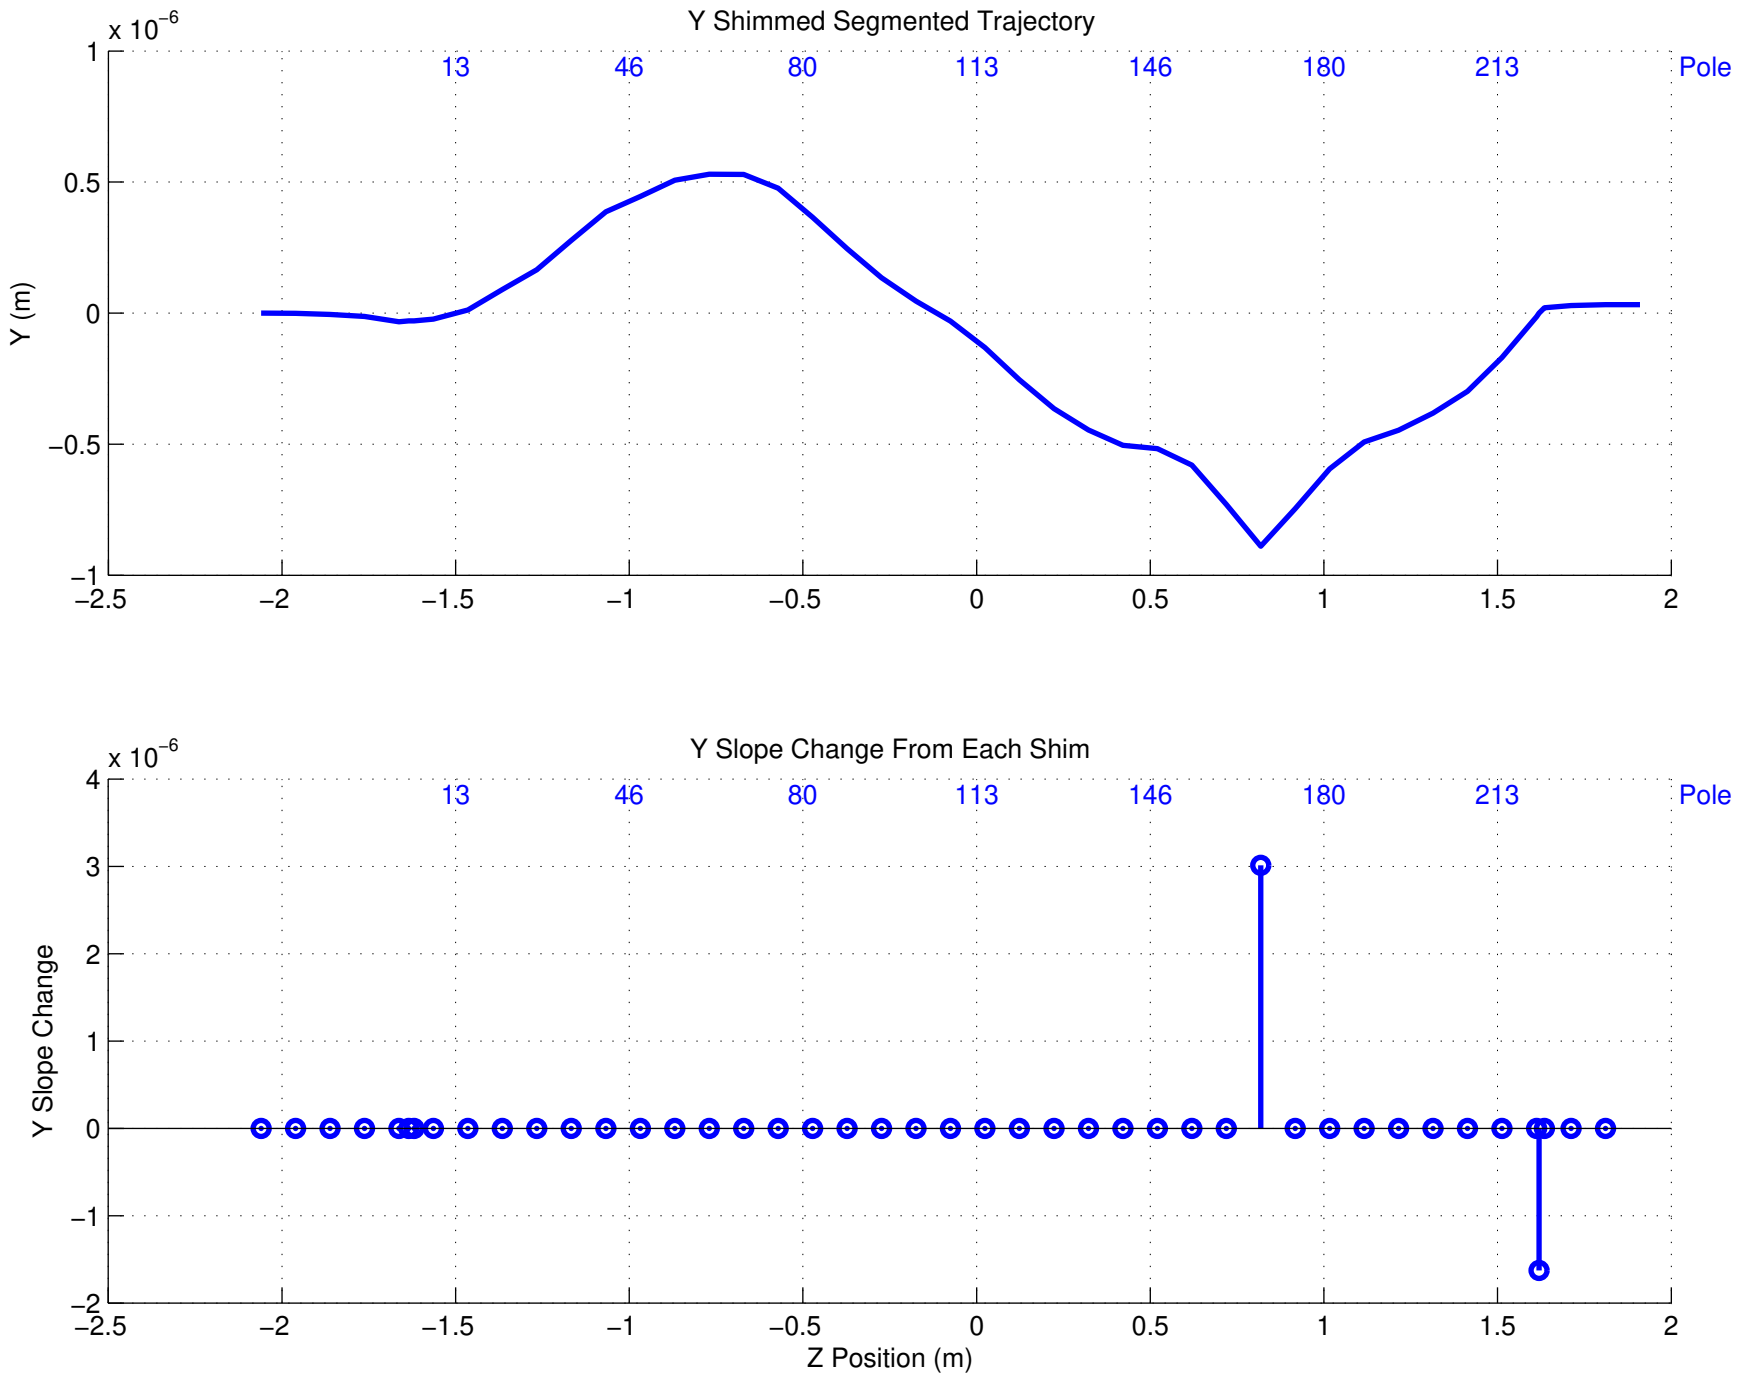
Y Shimmed Segmented Trajectory
x 10^-6
13
46
80
113
146
180
213
Pole
Y (m)
1
0.5
0
−0.5
−1
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Y Slope Change From Each Shim
x 10^-6
Y Slope Change
4
3
2
1
0
−1
−2
Z Position (m)

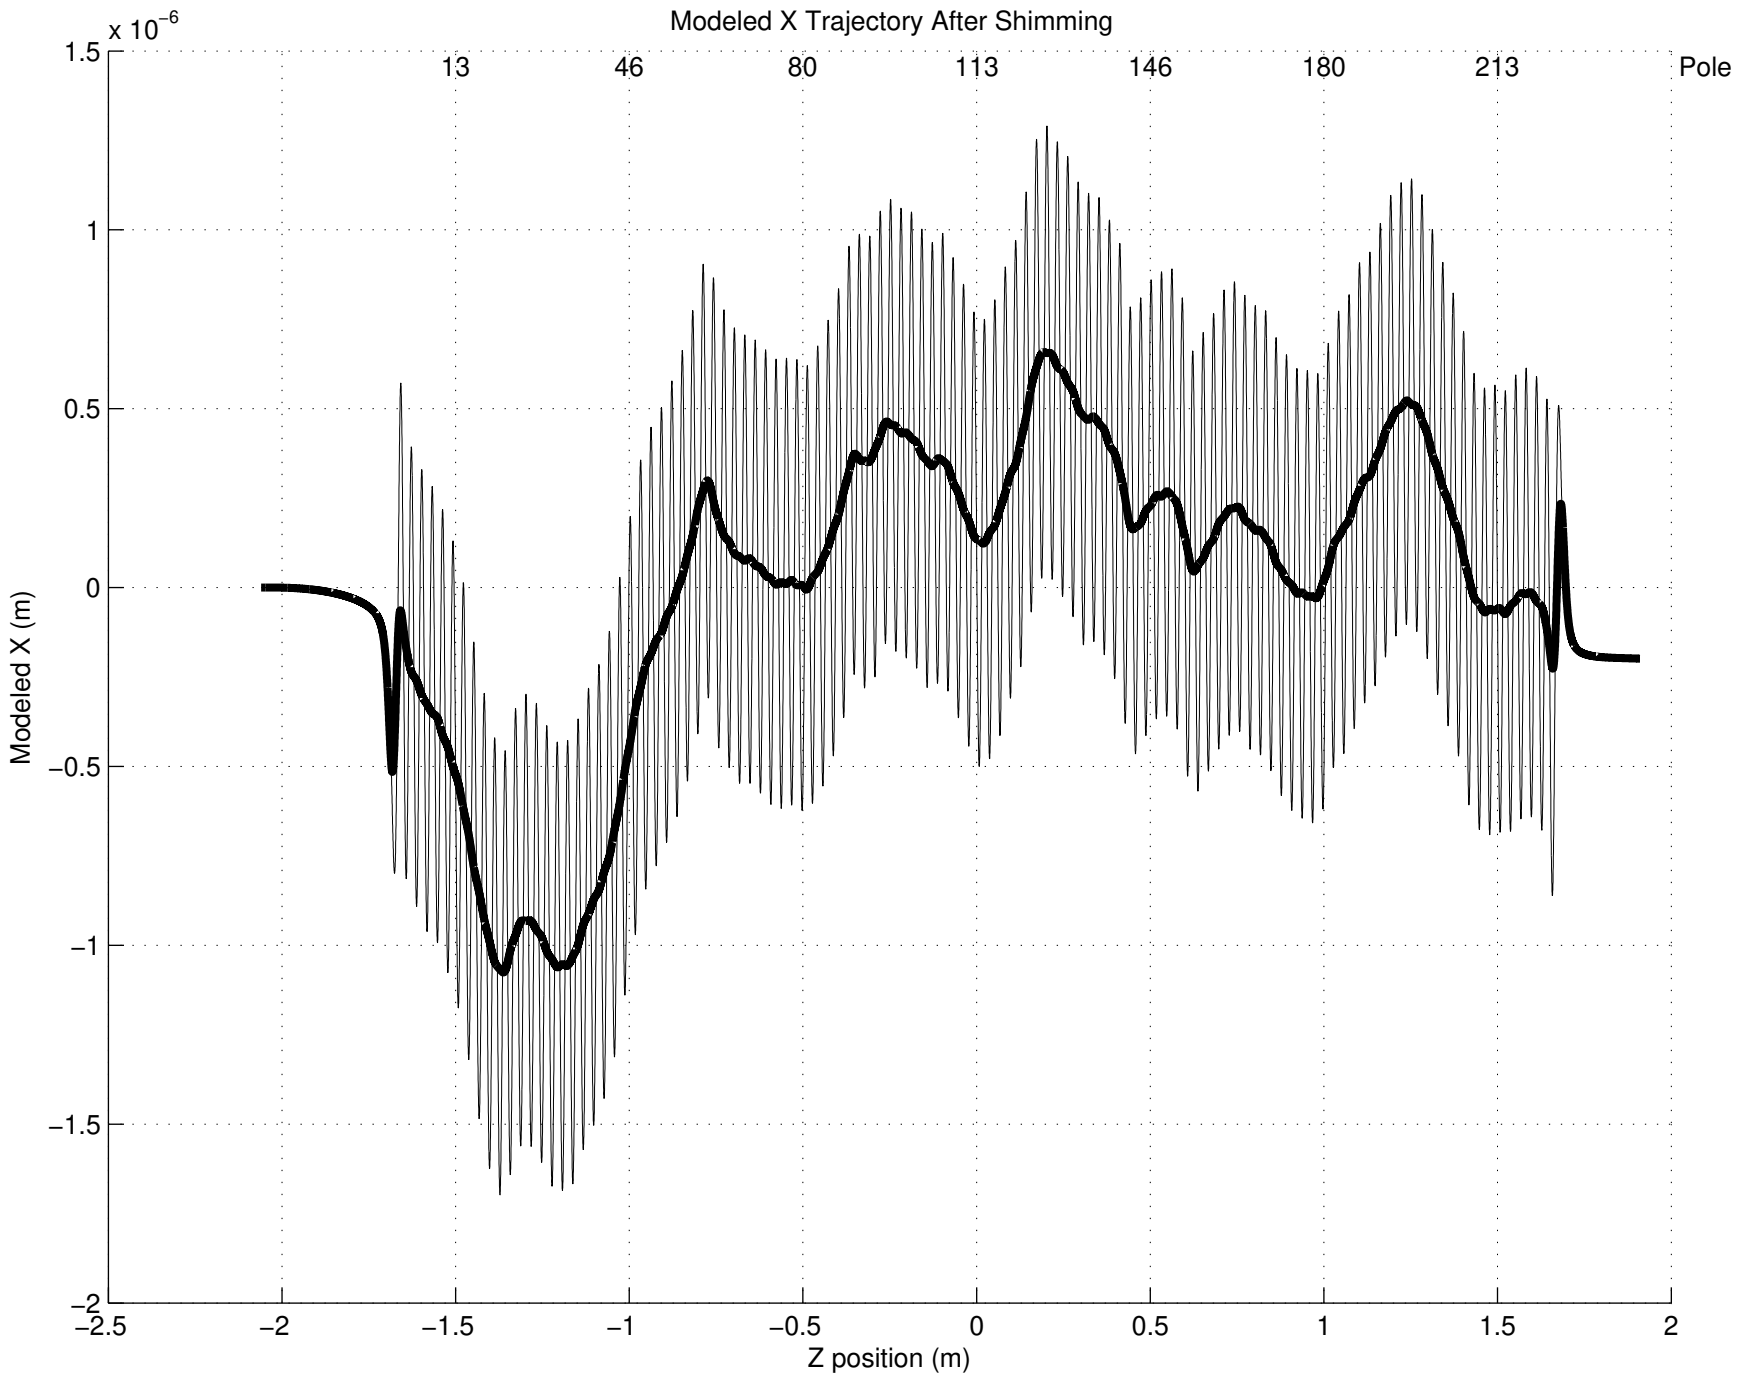
Modeled X Trajectory After Shimming
x 10^-6
1.5
1
0.5
0
−0.5
−1
−1.5
−2
13
46
80
113
146
180
213
Pole
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Modeled X (m)
Z position (m)

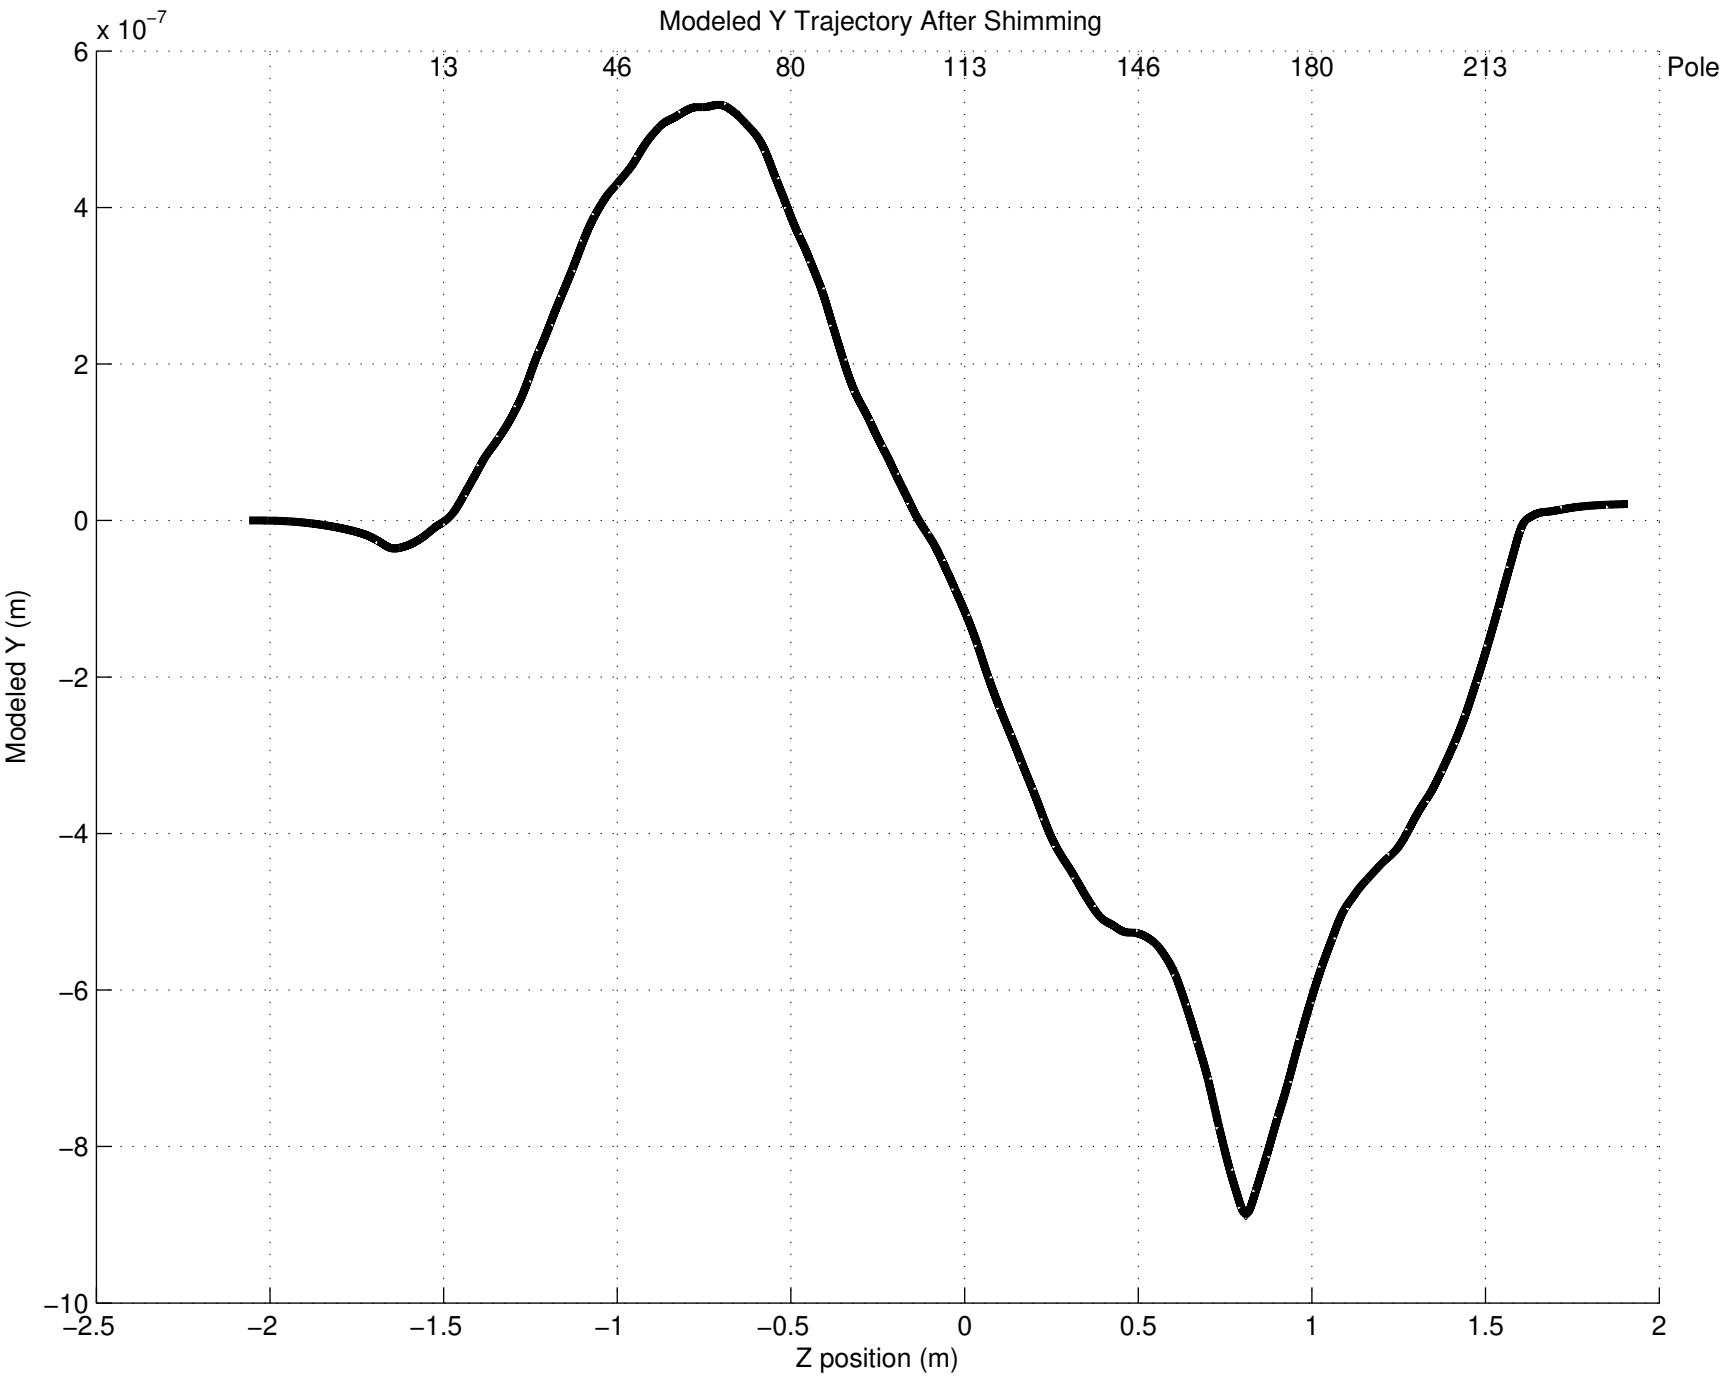
Modeled Y Trajectory After Shimming
x 10^-7
13
46
80
113
146
180
213
Pole
6
4
2
0
−2
−4
−6
−8
−10
Modeled Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

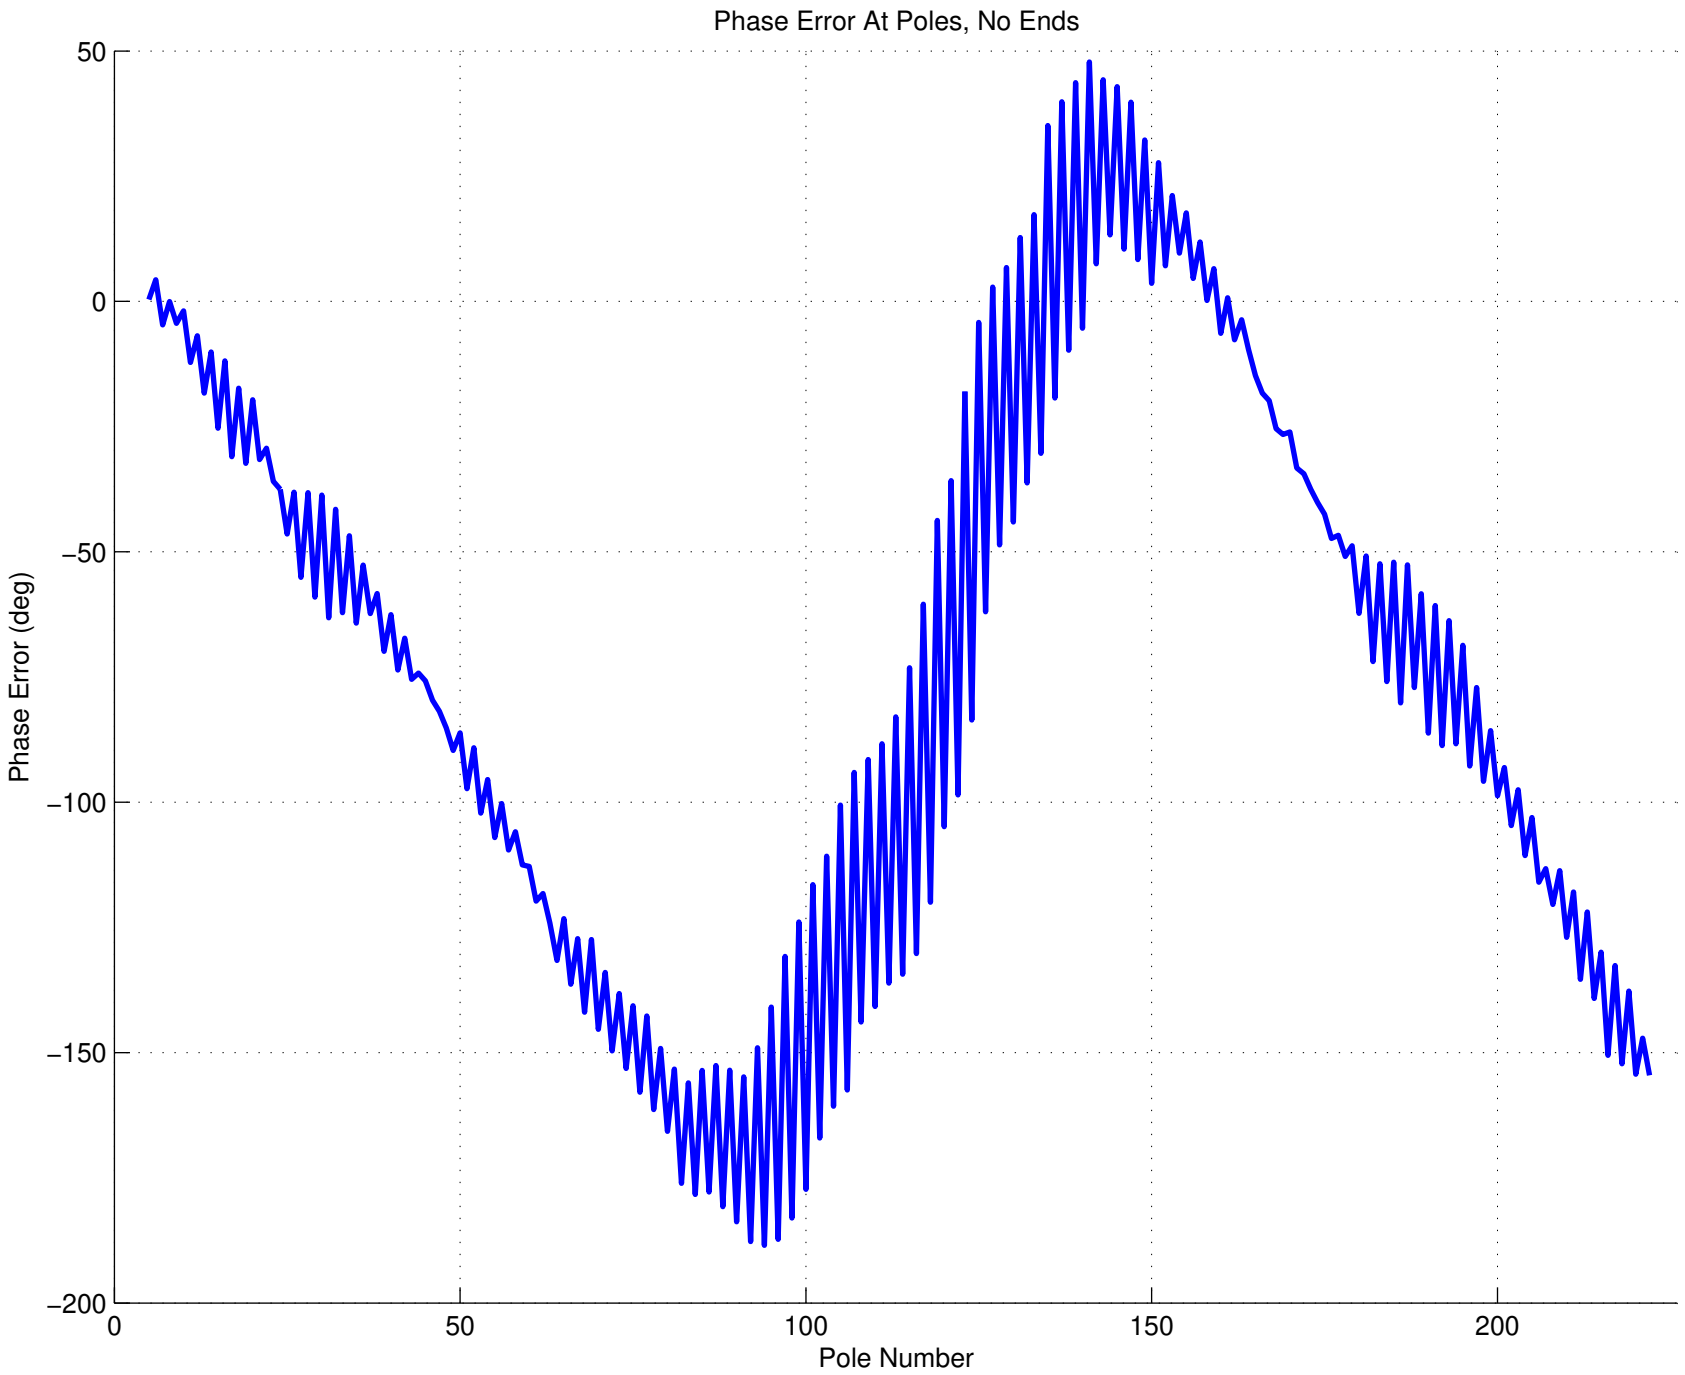
Phase Error At Poles, No Ends
Phase Error (deg)
50
0
−50
−100
−150
−200
0
50
100
150
200
Pole Number

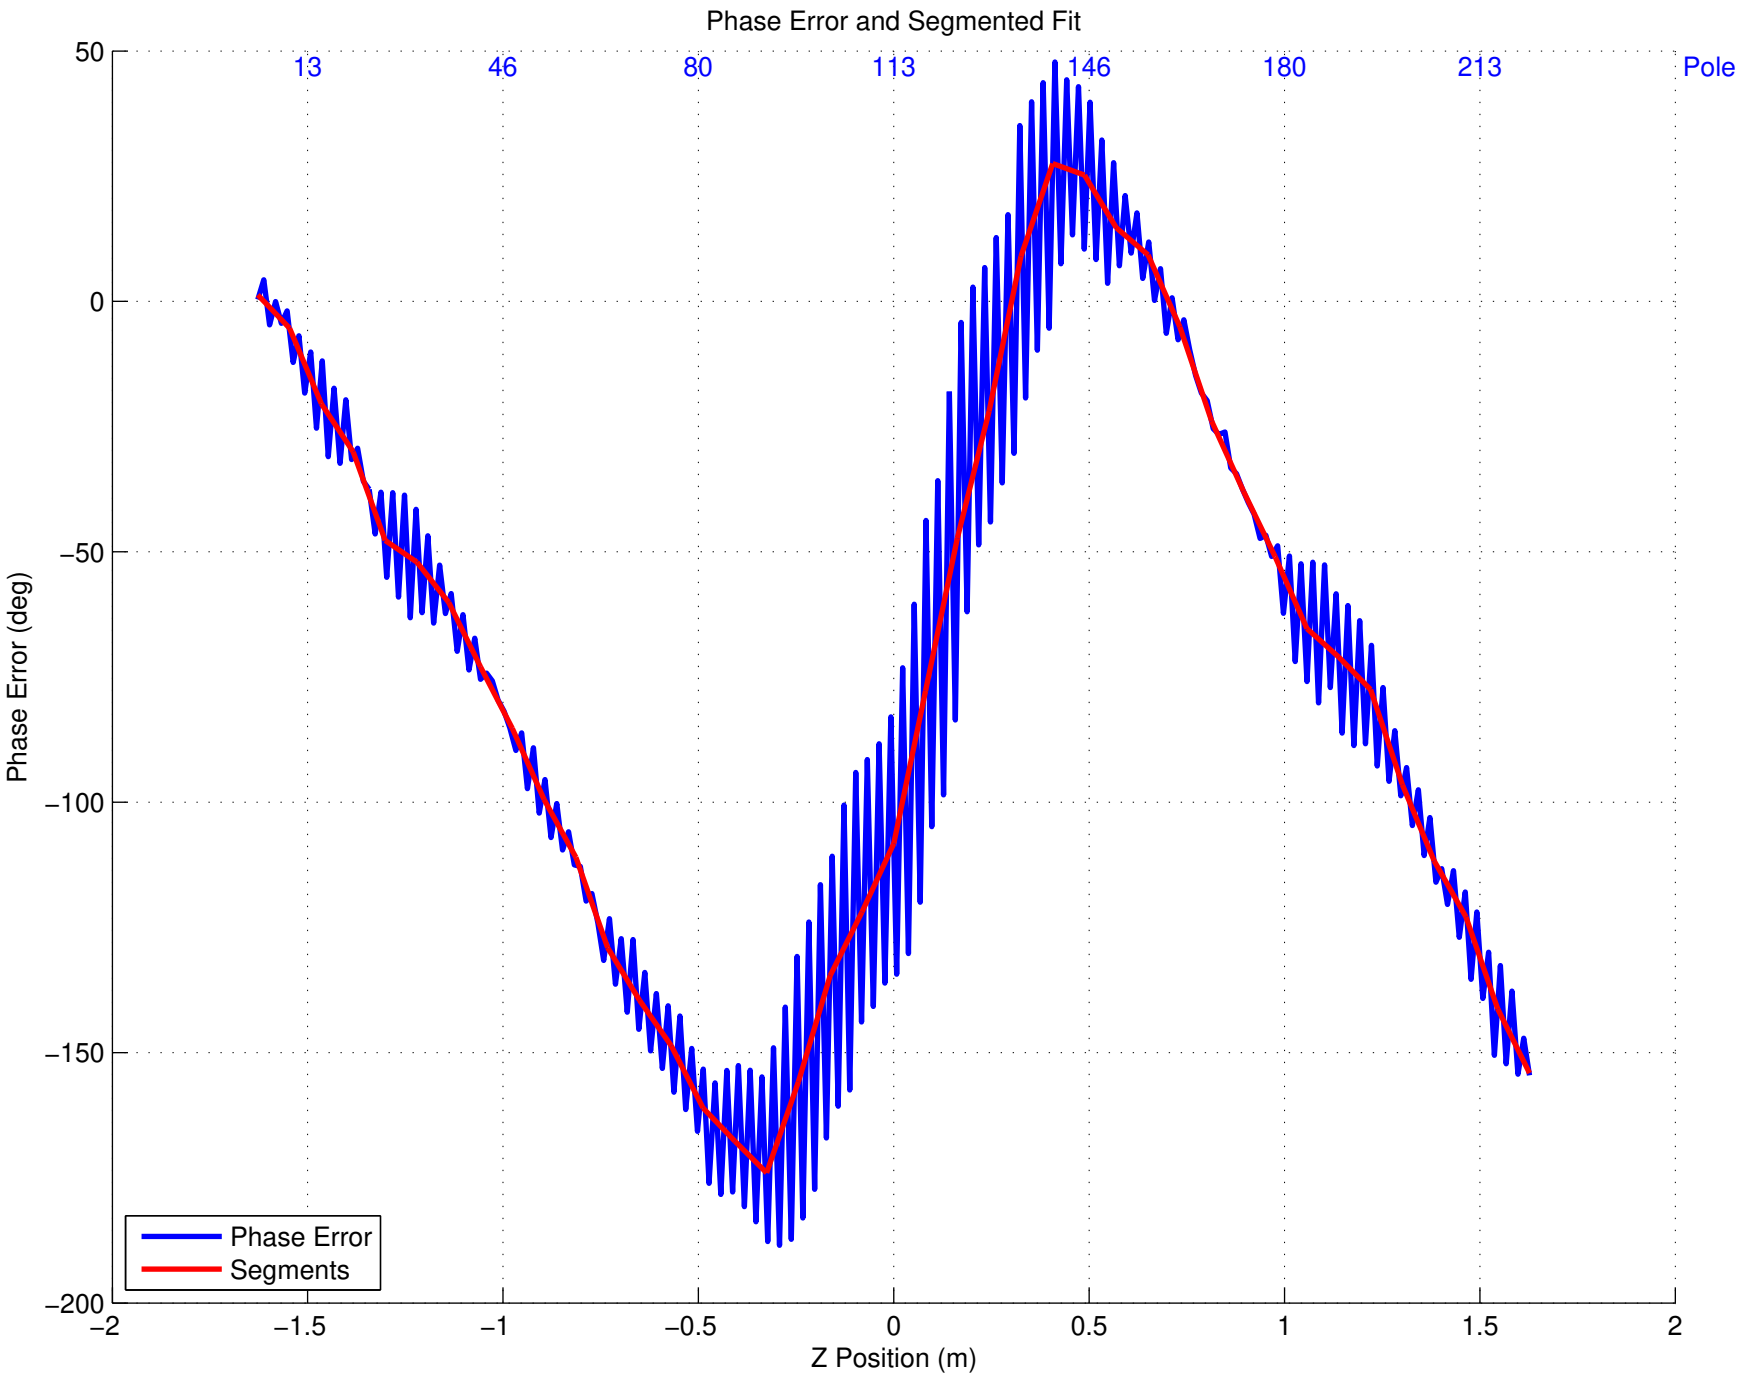
Phase Error and Segmented Fit
13
46
80
113
146
180
213
Pole
50
0
−50
−100
−150
−200
Phase Error (deg)
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Phase Error
Segments

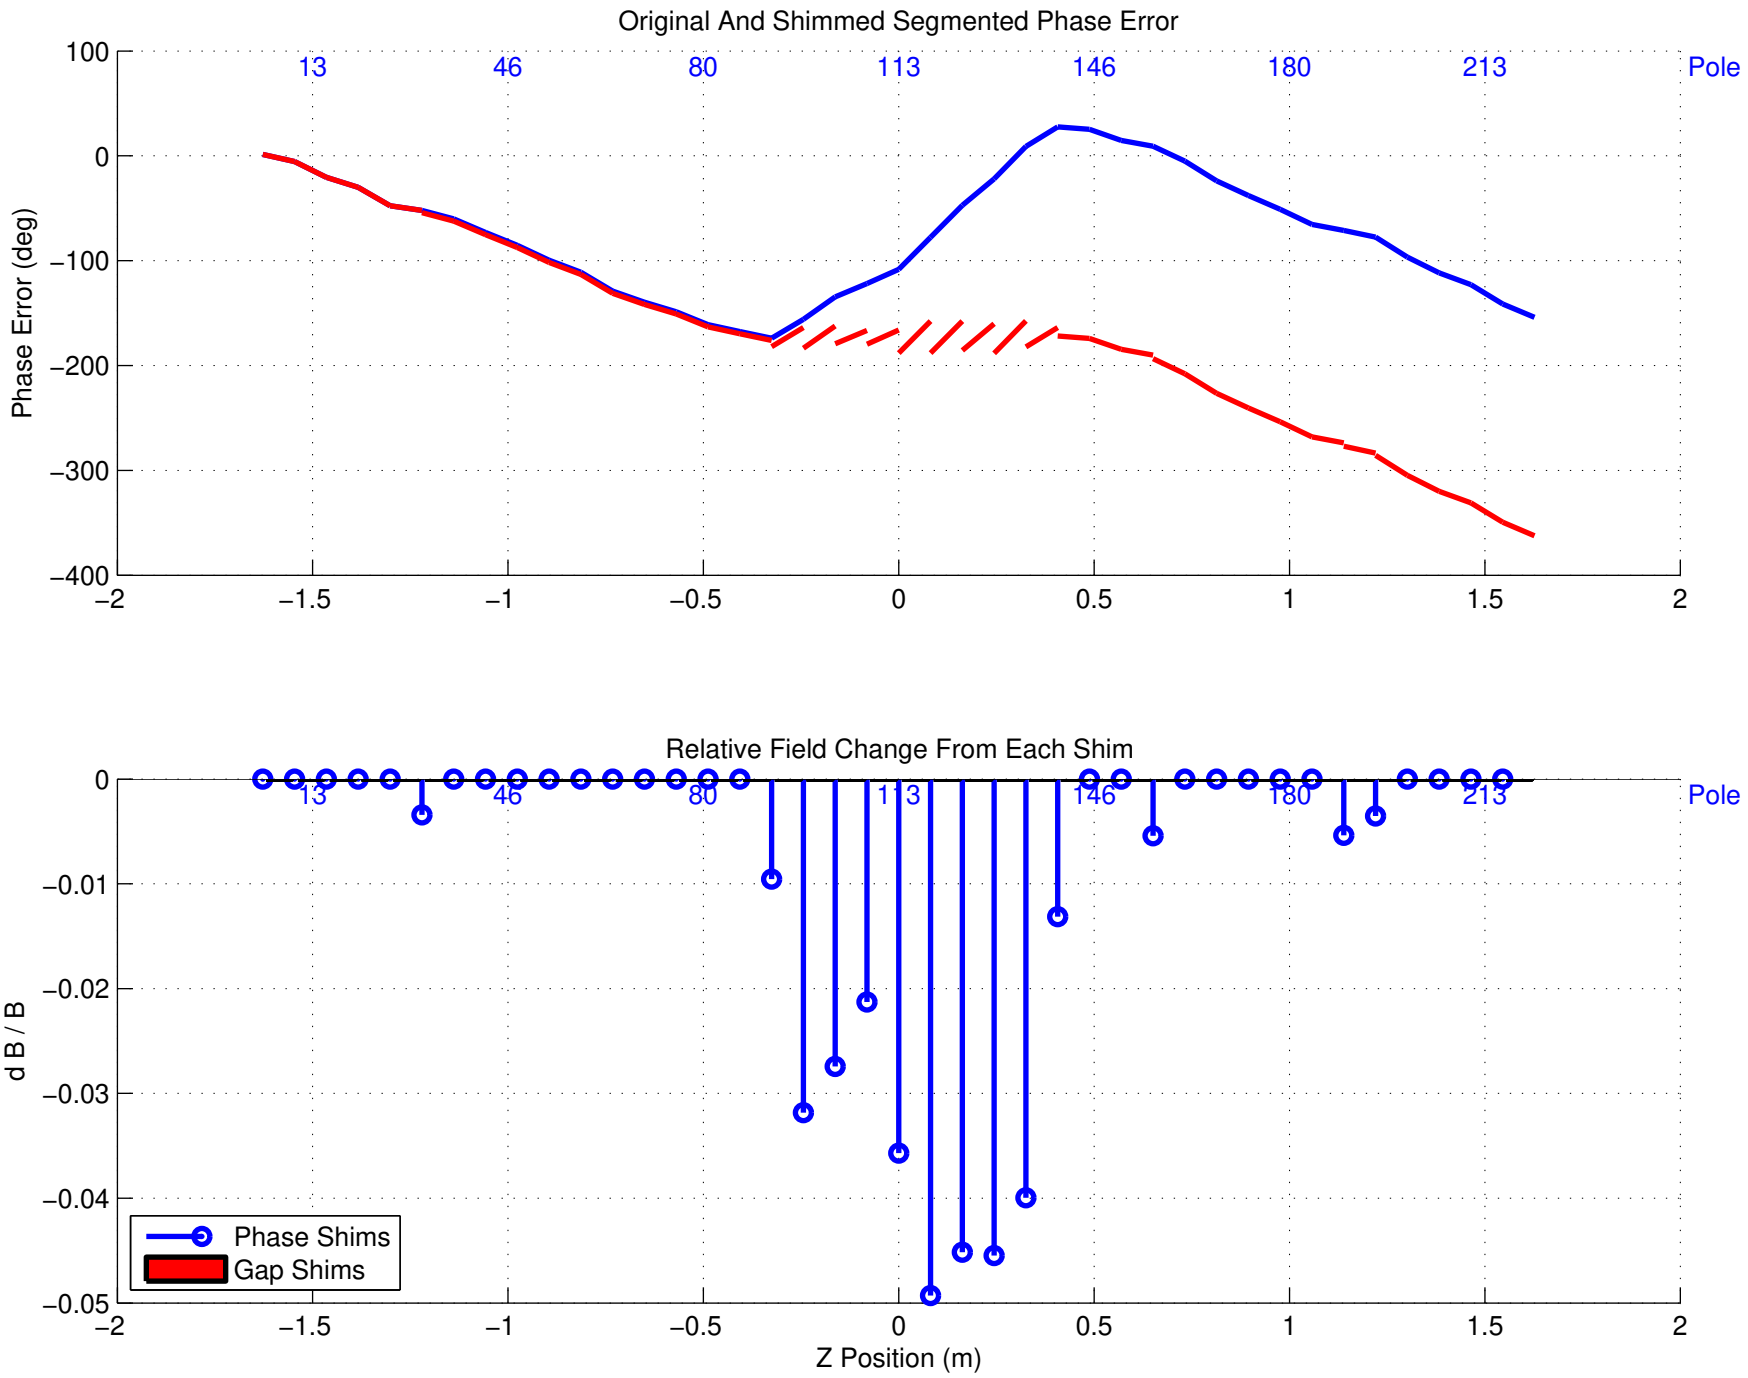
Original And Shimmed Segmented Phase Error
Phase Error (deg)
100
0
−100
−200
−300
−400
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
d B / B
0
−0.01
−0.02
−0.03
−0.04
−0.05
Phase Shims
Gap Shims
Z Position (m)

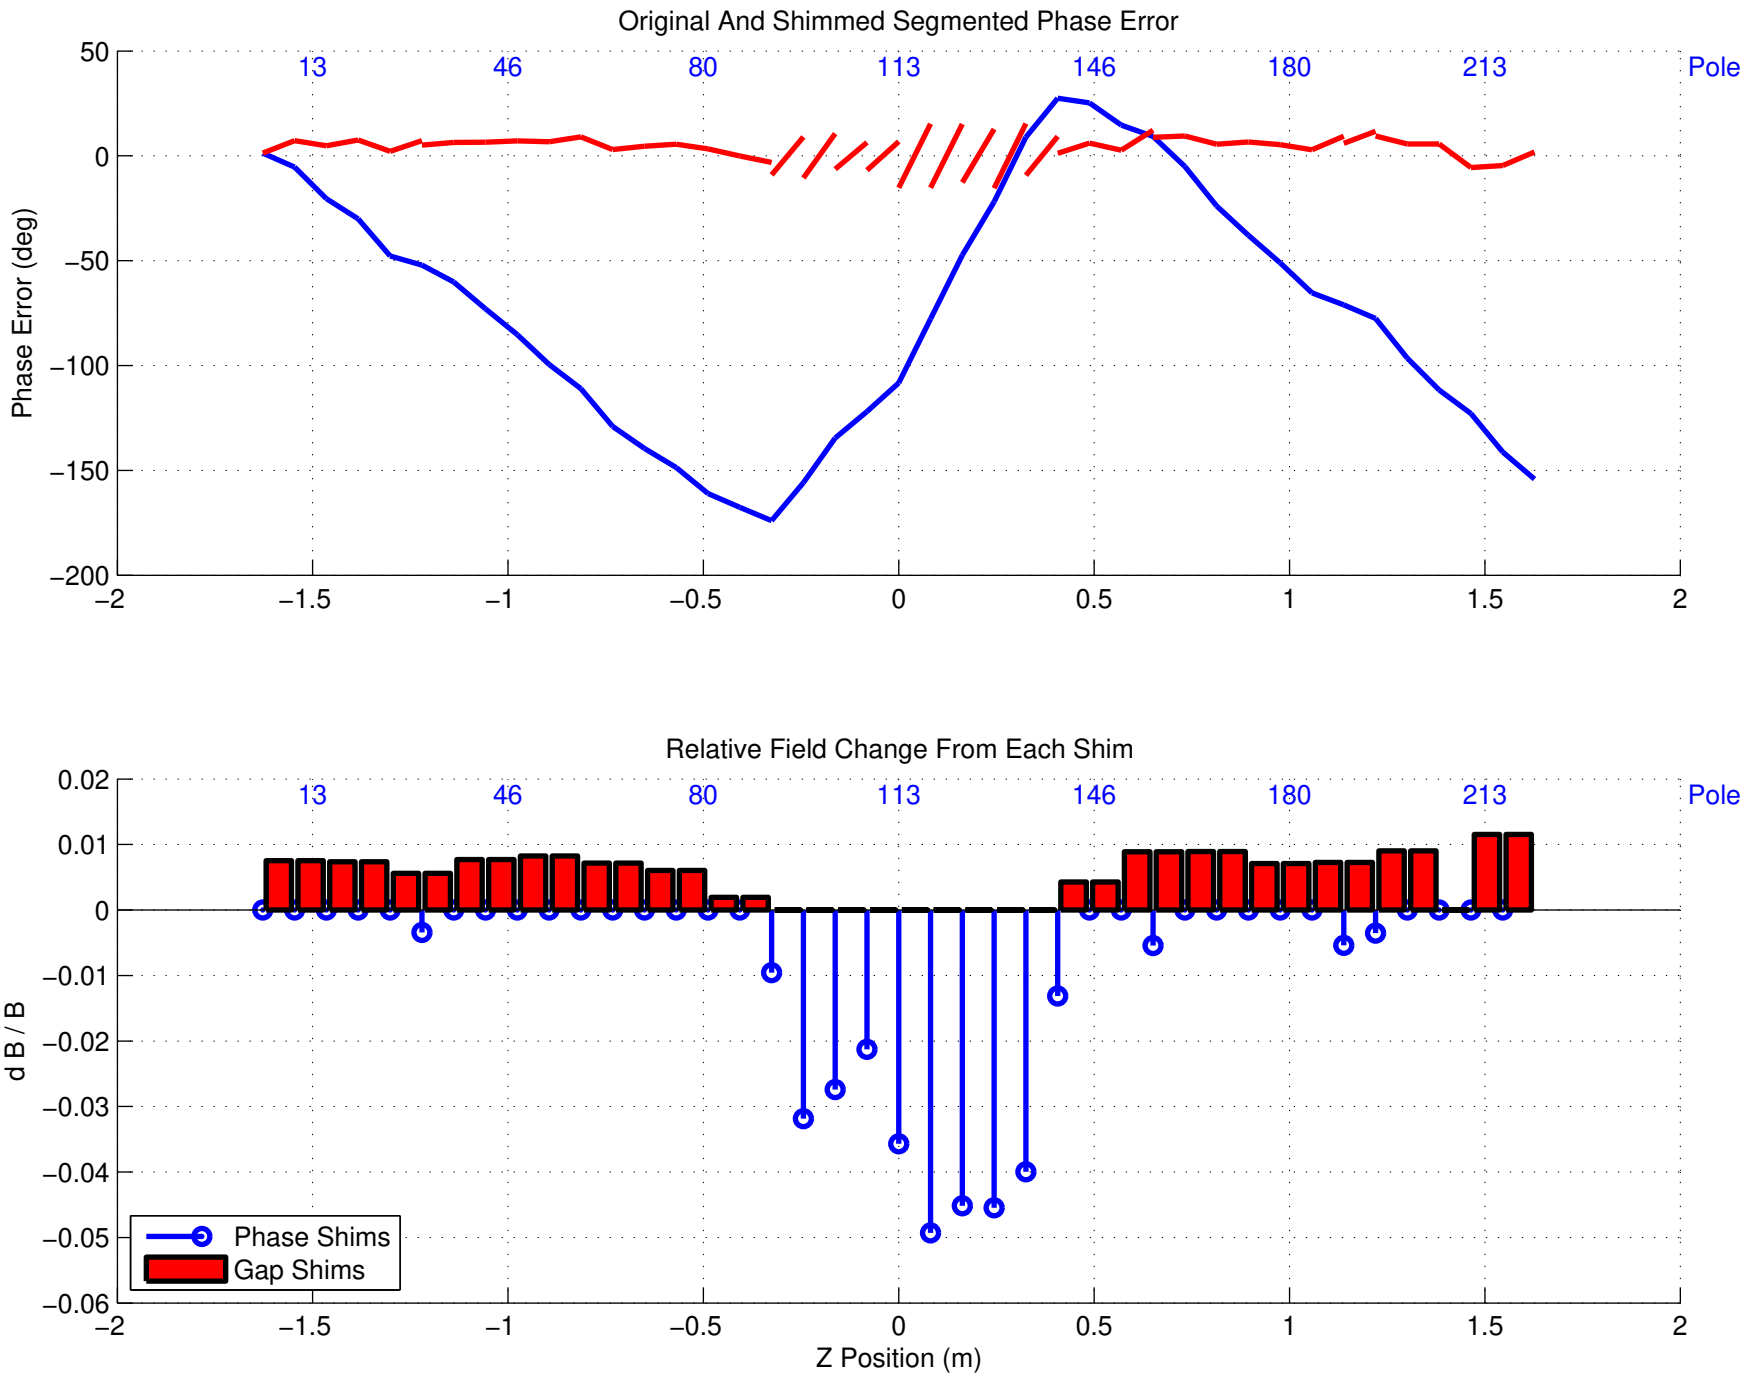
Original And Shimmed Segmented Phase Error
Phase Error (deg)
50
0
−50
−100
−150
−200
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
d B / B
0.02
0.01
0
−0.01
−0.02
−0.03
−0.04
−0.05
−0.06
Phase Shims
Gap Shims
Z Position (m)

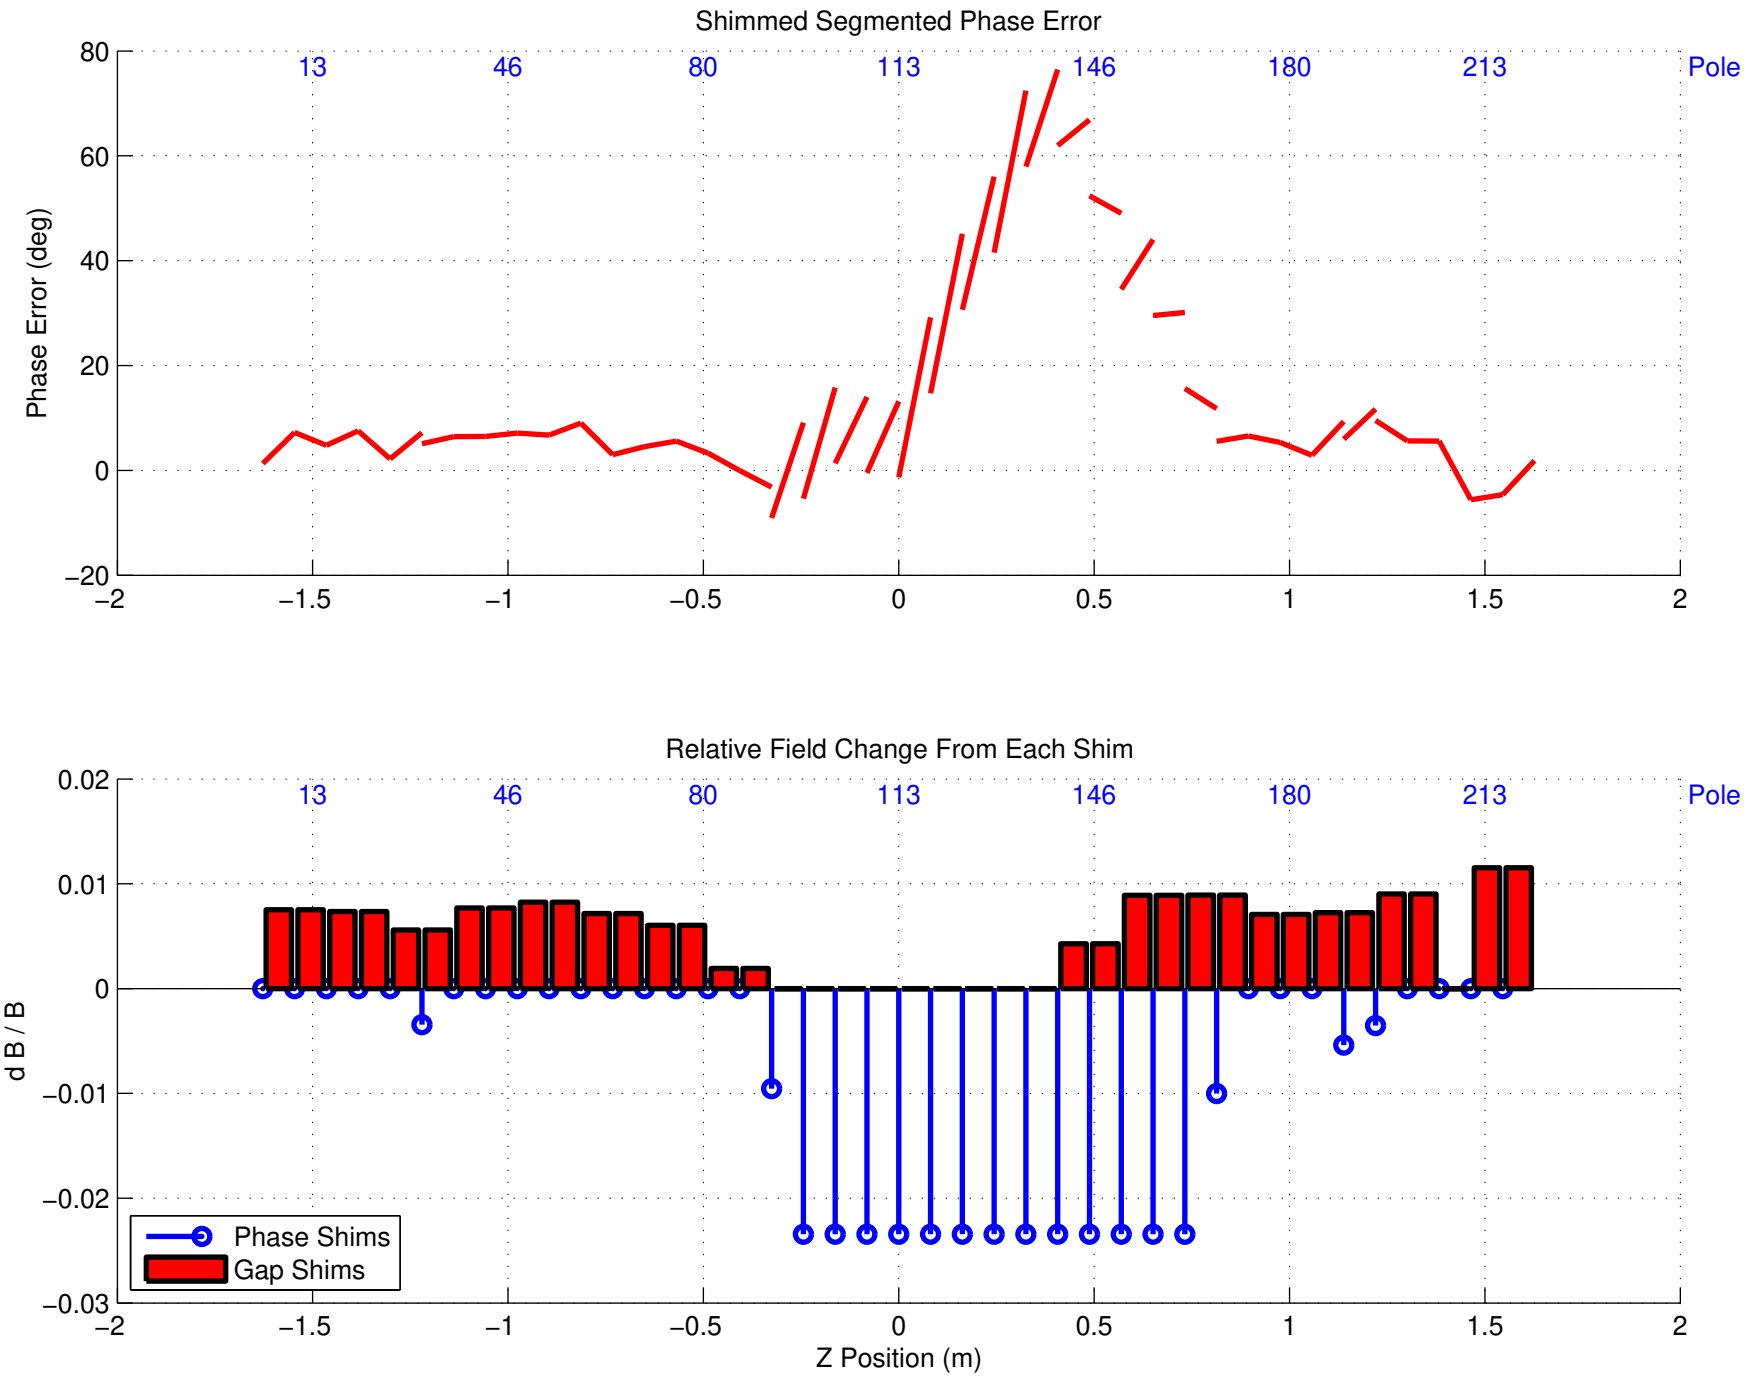
Shimmed Segmented Phase Error
Phase Error (deg)
80
60
40
20
0
−20
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
d B / B
0.02
0.01
0
−0.01
−0.02
−0.03
Phase Shims
Gap Shims
Z Position (m)

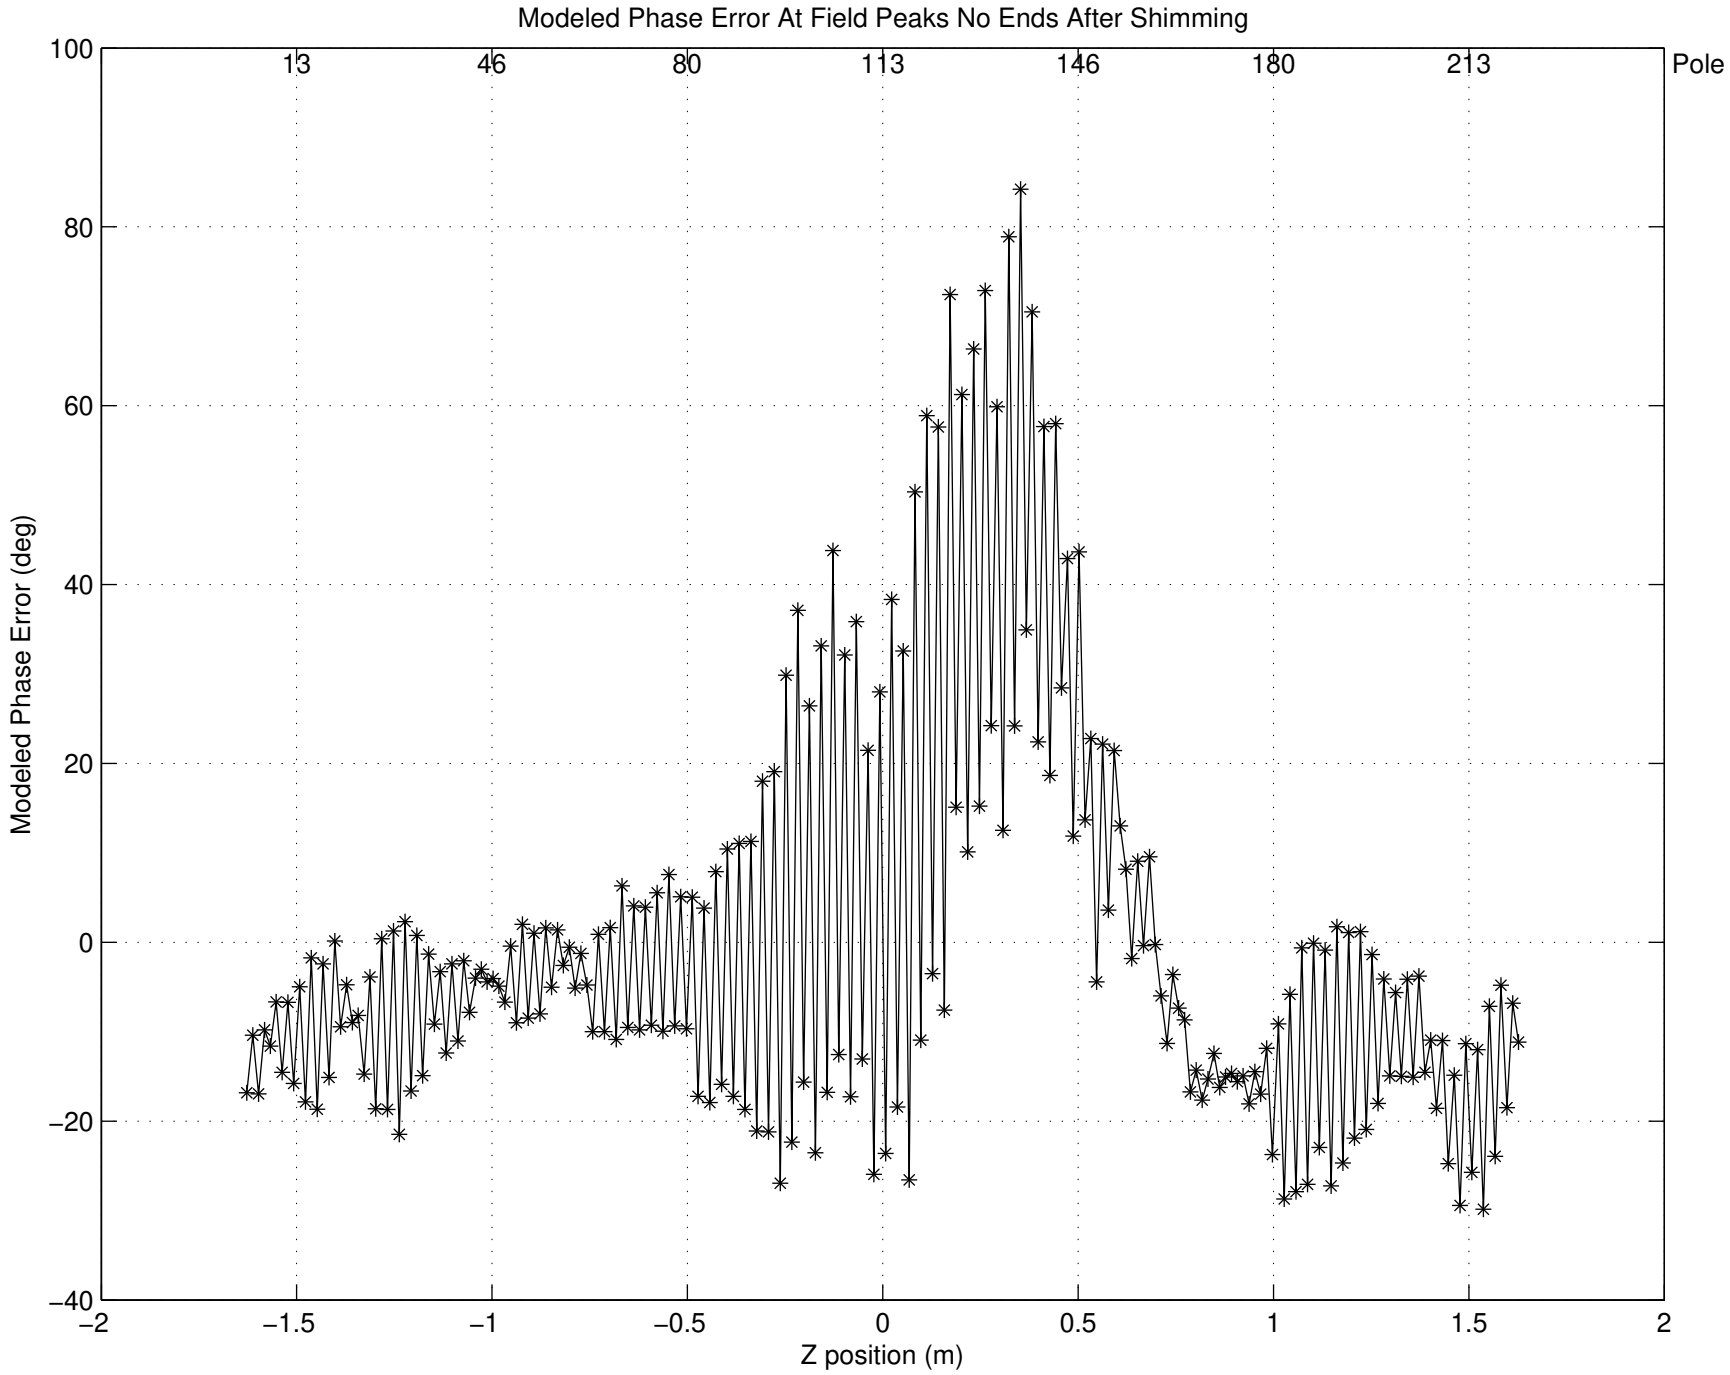

Phase Error: Ave = −0.000000 deg, RMS = 22.604622 deg