SLAC Magnetic Measurements

Planar Insertion Device Shim Analysis

Parameters:
INPUT−FILE−DIR =S:\Magdata\Lcls\Undulator\L143−112000−15\DATASET0001\Rough Tuning\Z Scans\Run 002\
INPUT−FILE−NAME =x+00000−y+000−bscanz.dat
INPUT−FILE−TYPE =ZVXYBXYH
CORR−REQUIRED =1
GAMMA =26654.56
NOM−LAMBDA−U =0.03
NOM−K−VALUE =3.4917
NOM−LAMBDA−R =1.4982e−010
NUM−POLES =226
NUM−END−POLES =4
CELL−LENGTH =3.656

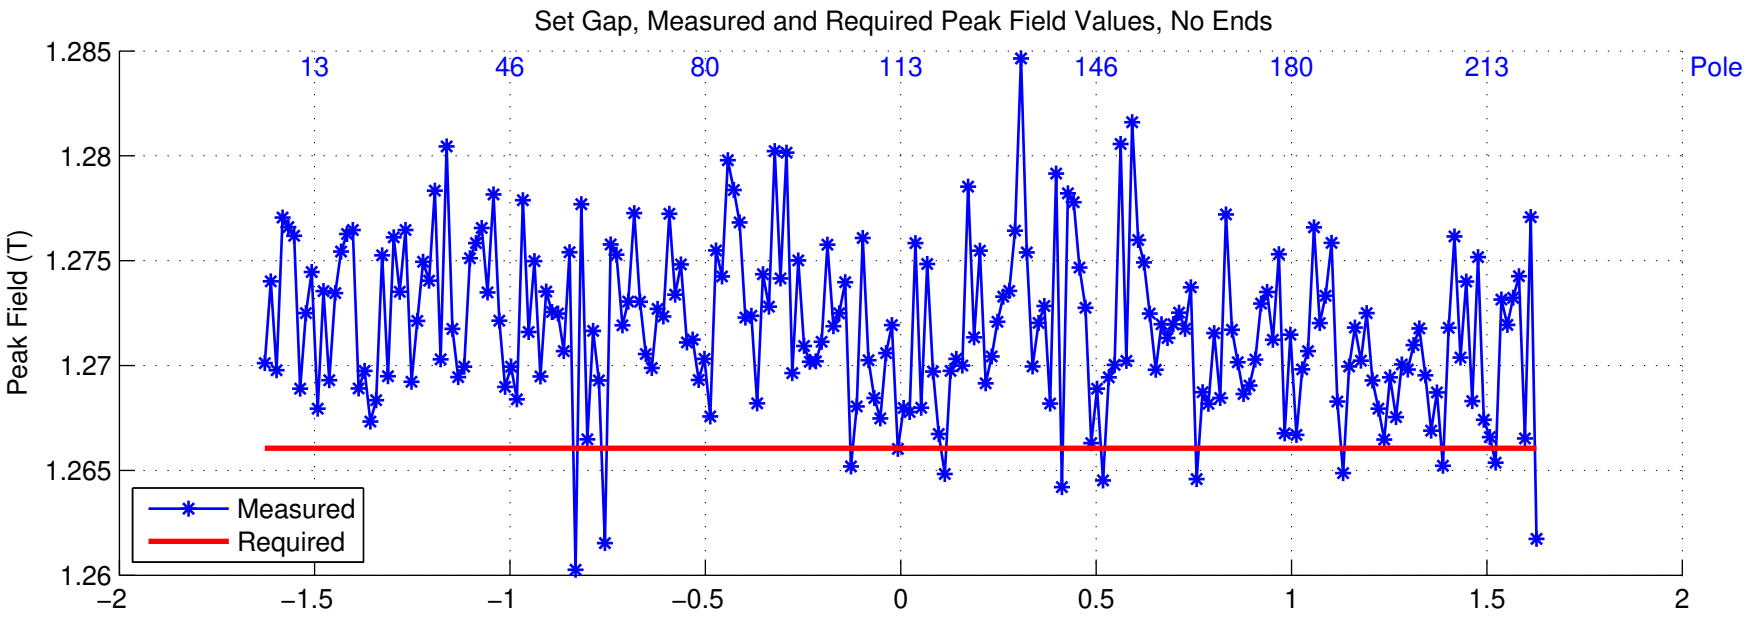
Set Gap, Measured and Required Peak Field Values, No Ends
Peak Field (T)
1.285
1.28
1.275
1.27
1.265
1.26
13
46
80
113
146
180
213
Pole
Measured
Required
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

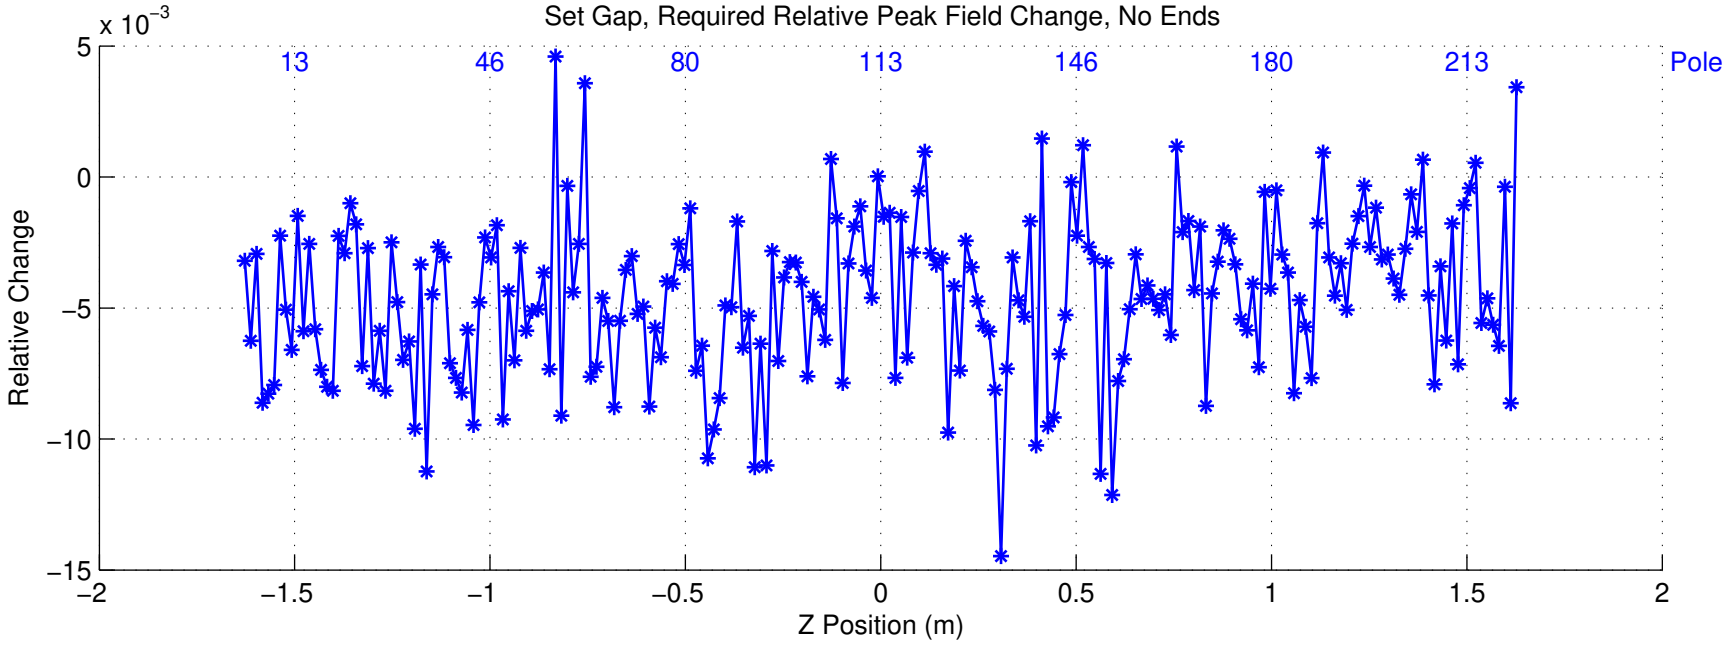
Set Gap, Required Relative Peak Field Change, No Ends
x 10^-3
Relative Change
5
0
−5
−10
−15
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

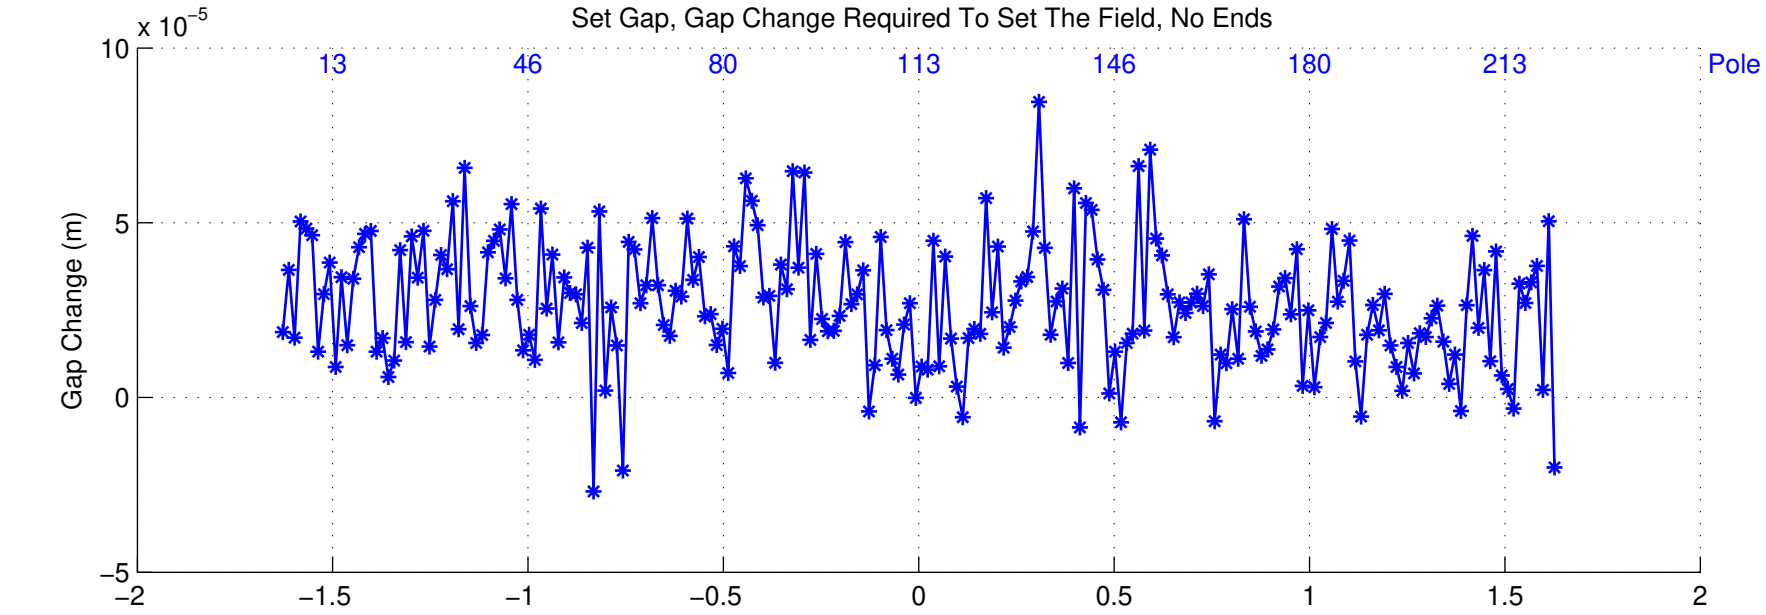
Set Gap, Gap Change Required To Set The Field, No Ends
x 10^-5
Gap Change (m)
10
5
0
−5
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

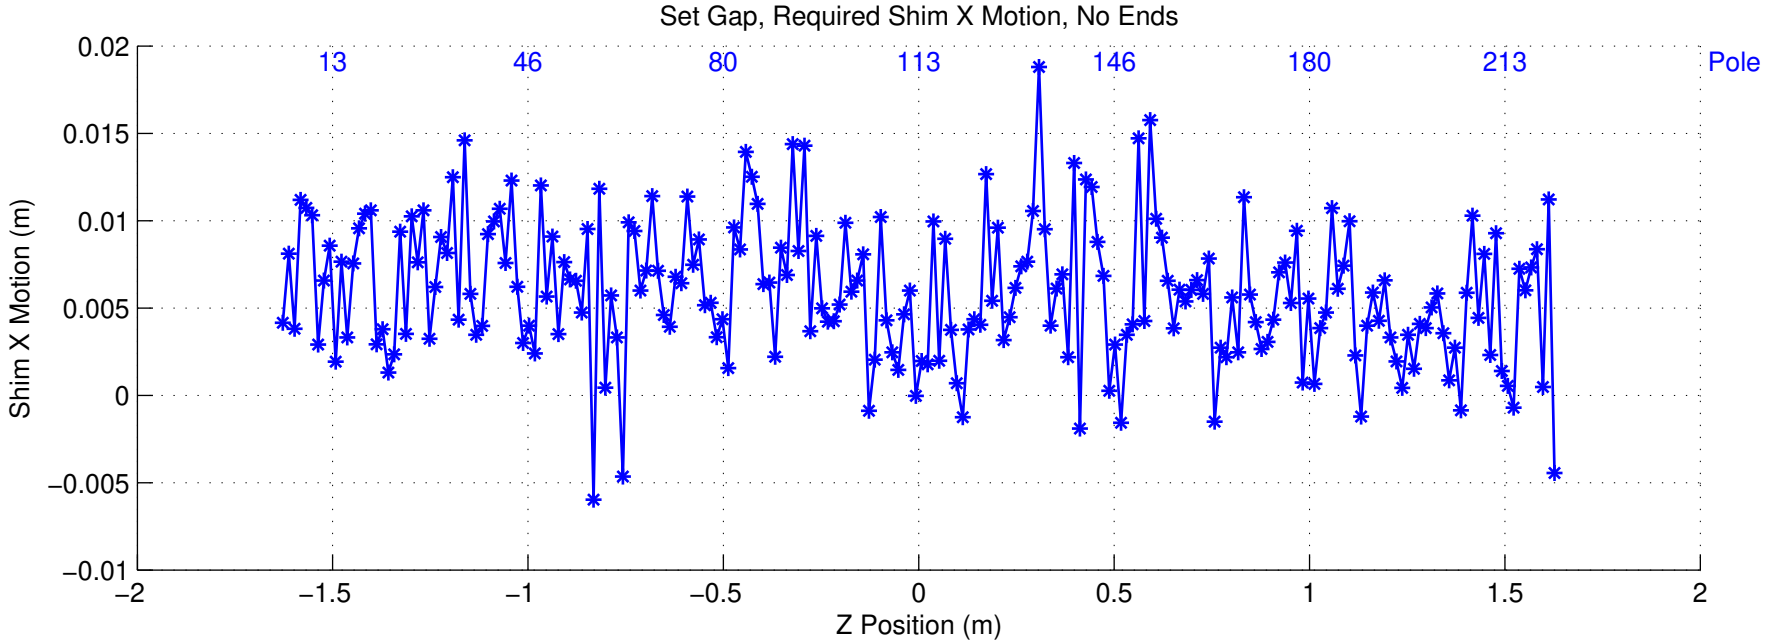
Set Gap, Required Shim X Motion, No Ends
Shim X Motion (m)
0.02
0.015
0.01
0.005
0
−0.005
−0.01
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

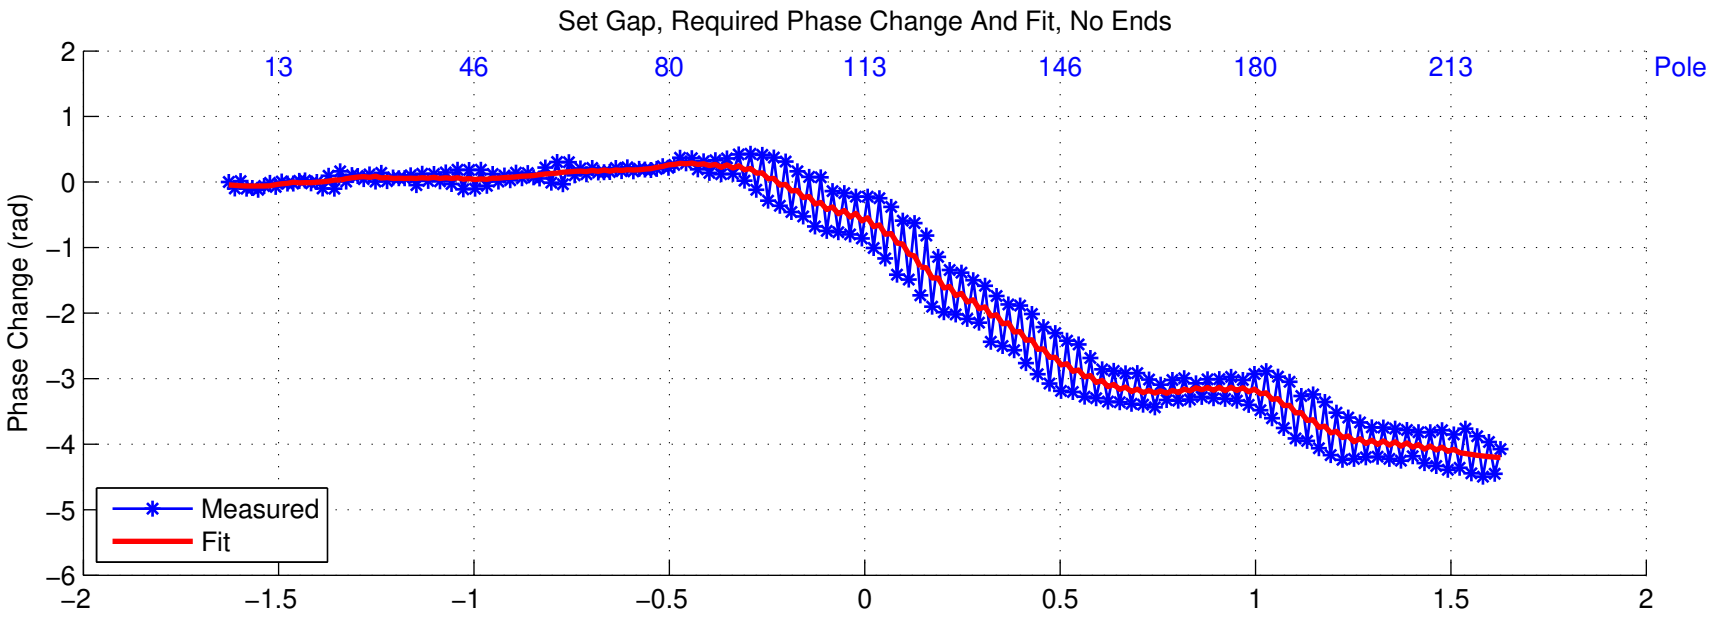
Set Gap, Required Phase Change And Fit, No Ends
13
46
80
113
146
180
213
Pole
Phase Change (rad)
Measured
Fit
2
1
0
−1
−2
−3
−4
−5
−6
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

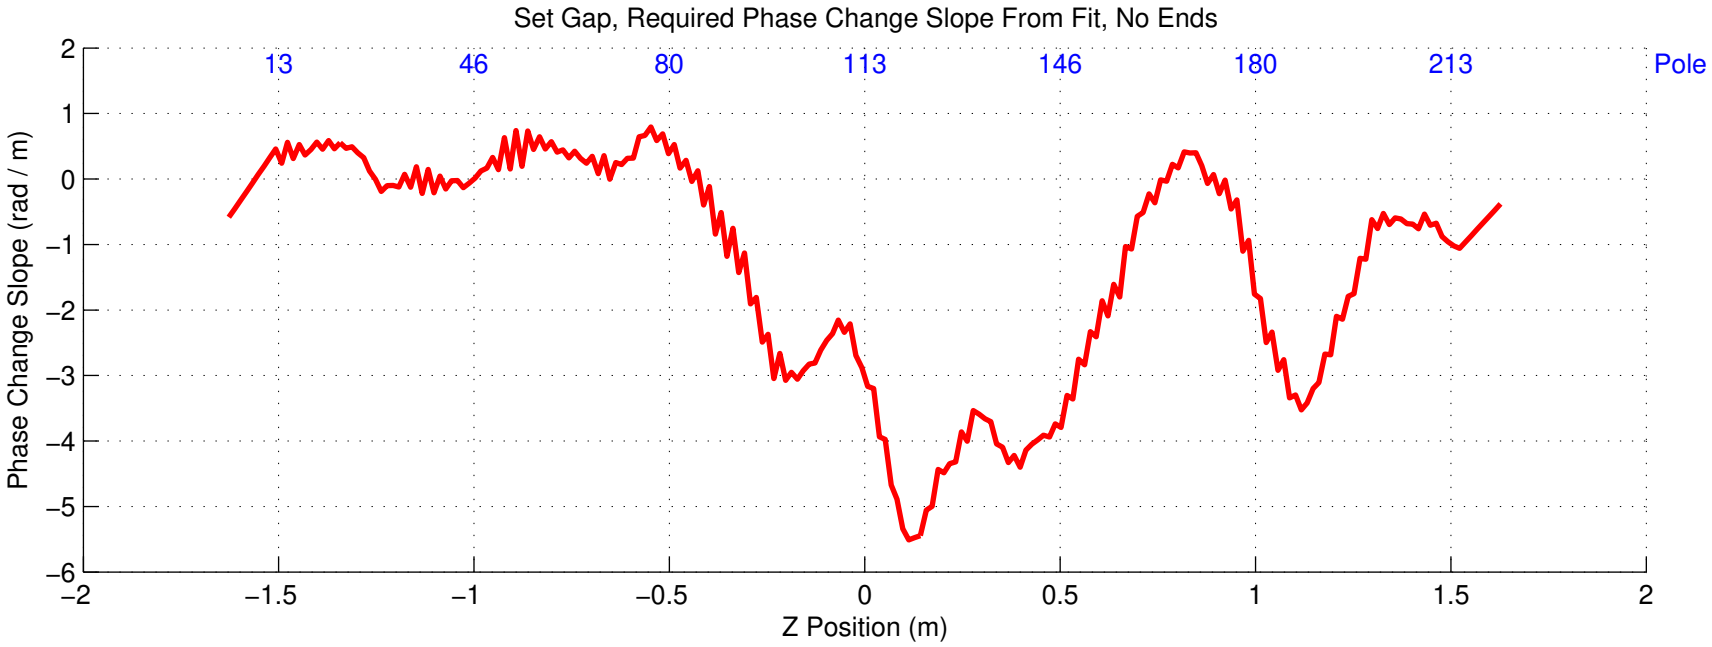
Set Gap, Required Phase Change Slope From Fit, No Ends
13
46
80
113
146
180
213
Pole
Phase Change Slope (rad / m)
Z Position (m)
2
1
0
−1
−2
−3
−4
−5
−6
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

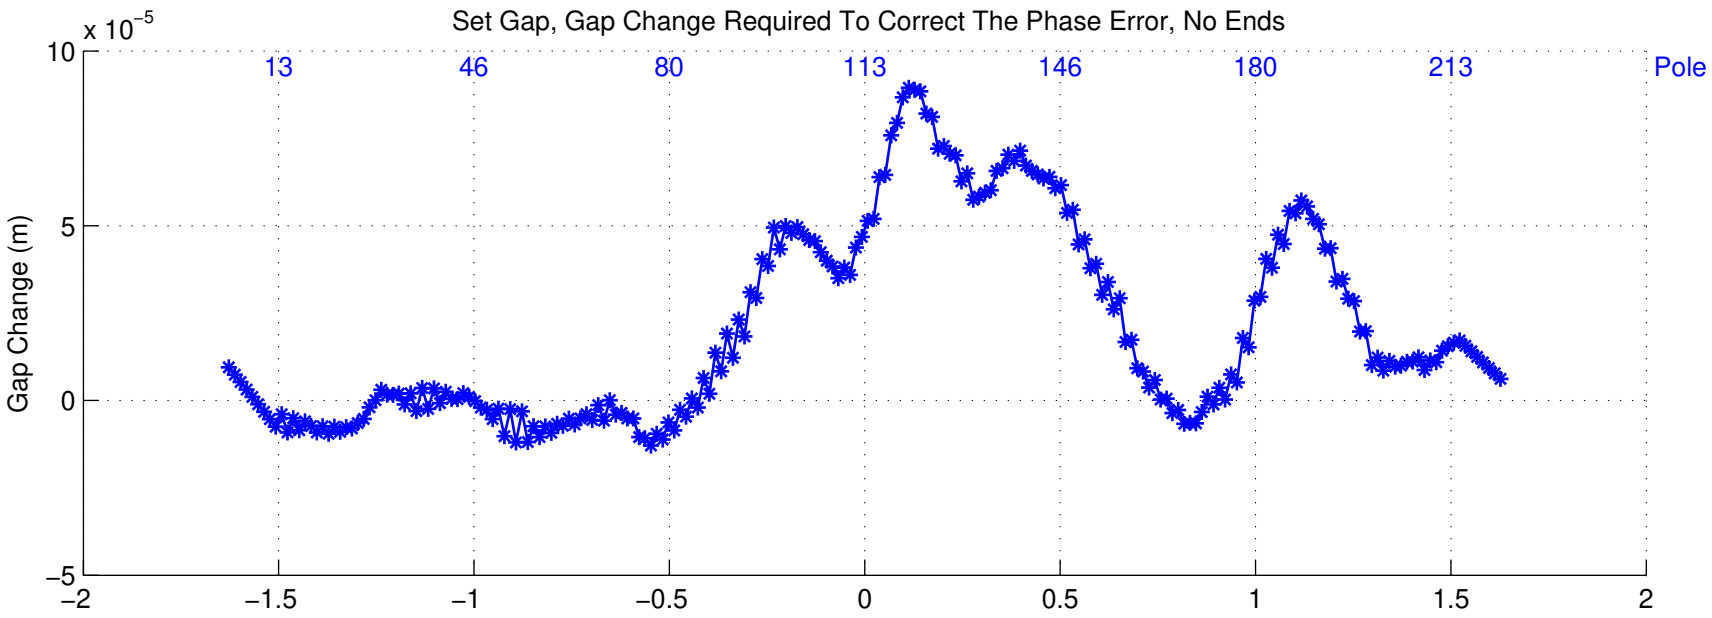
Set Gap, Gap Change Required To Correct The Phase Error, No Ends
x 10^-5
Gap Change (m)
13
46
80
113
146
180
213
Pole
10
5
0
−5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

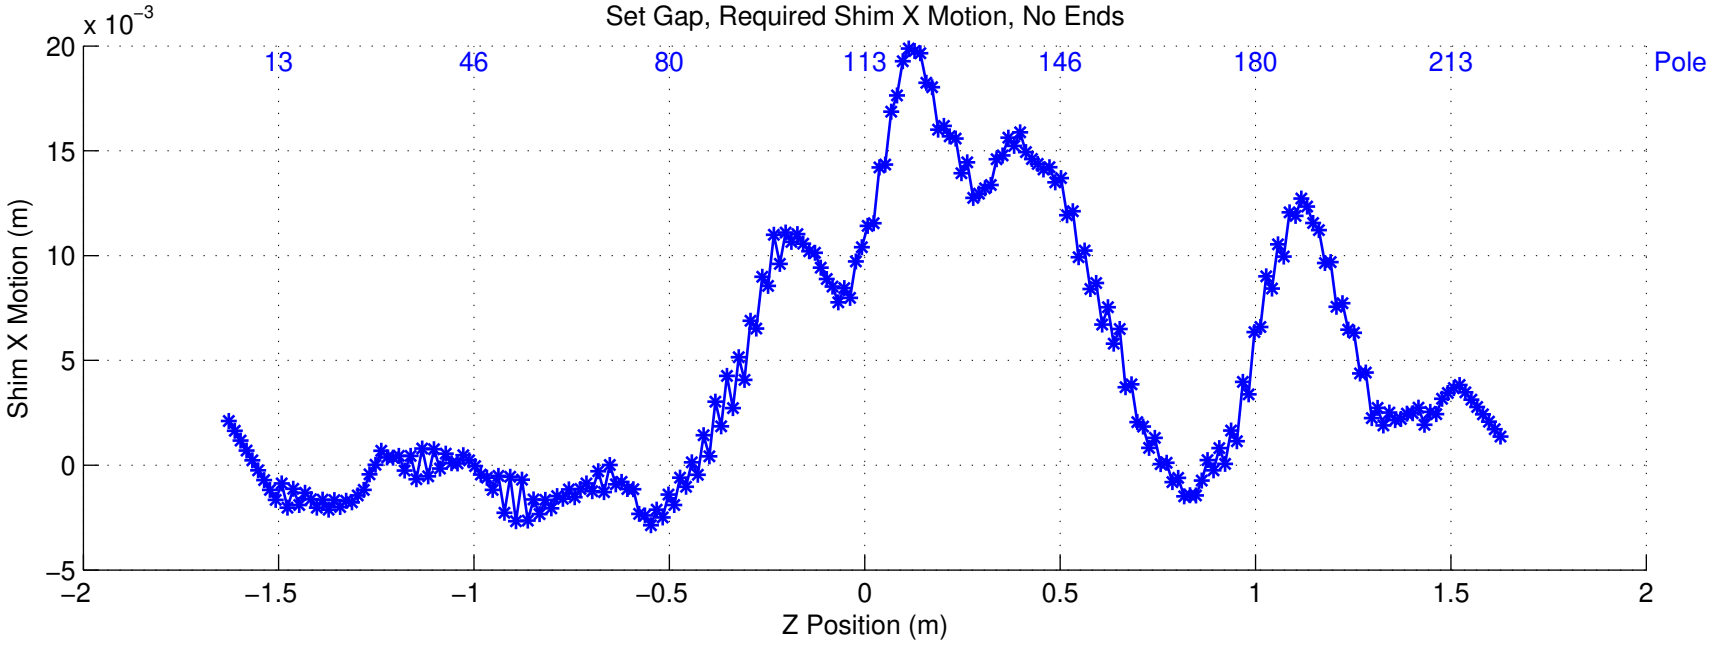
Set Gap, Required Shim X Motion, No Ends
x 10^-3
Shim X Motion (m)
13
46
80
113
146
180
213
Pole
20
15
10
5
0
−5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

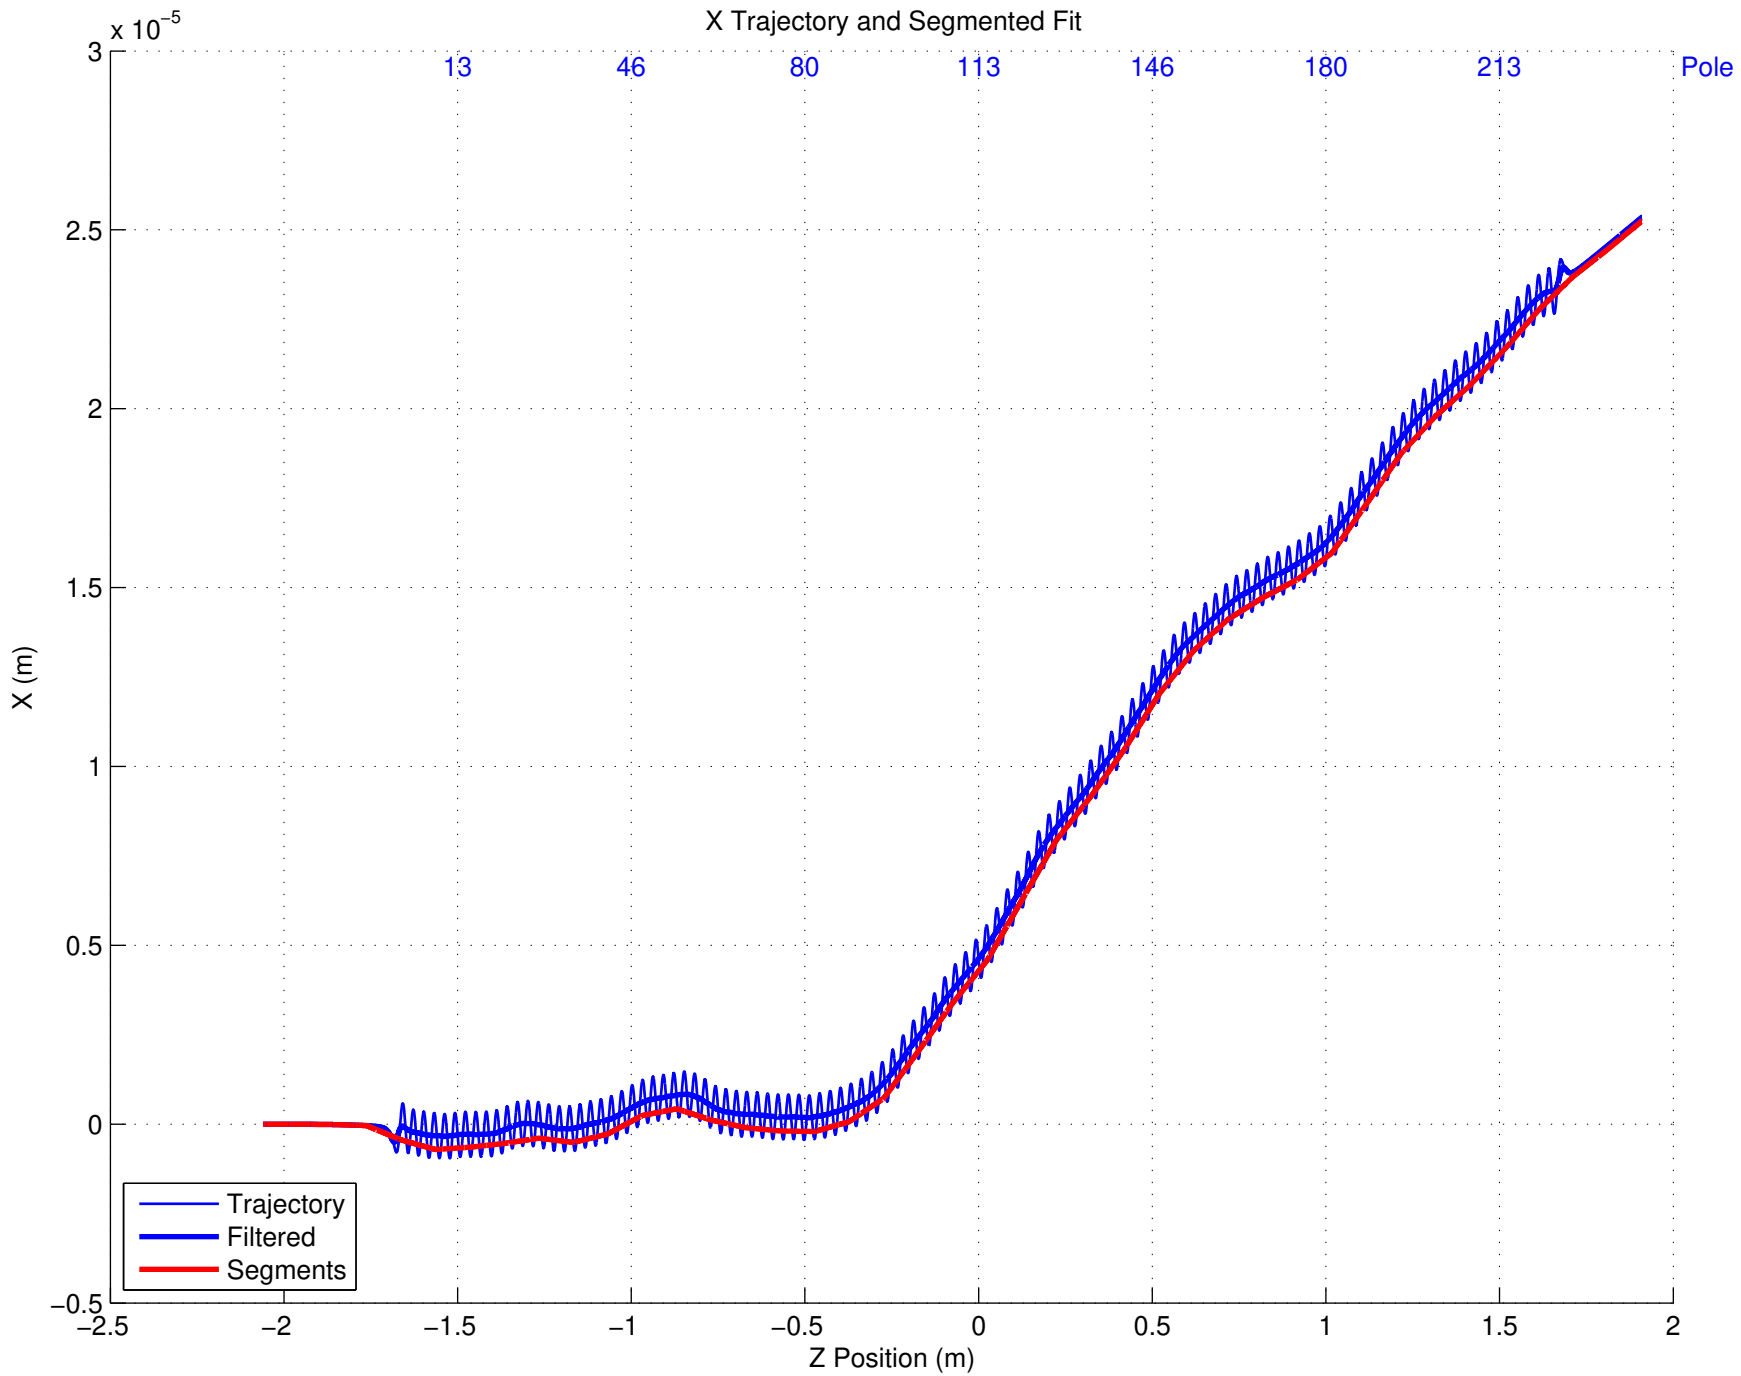
X Trajectory and Segmented Fit
x 10^-5
13
46
80
113
146
180
213
Pole
3
2.5
2
1.5
1
0.5
0
−0.5
X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

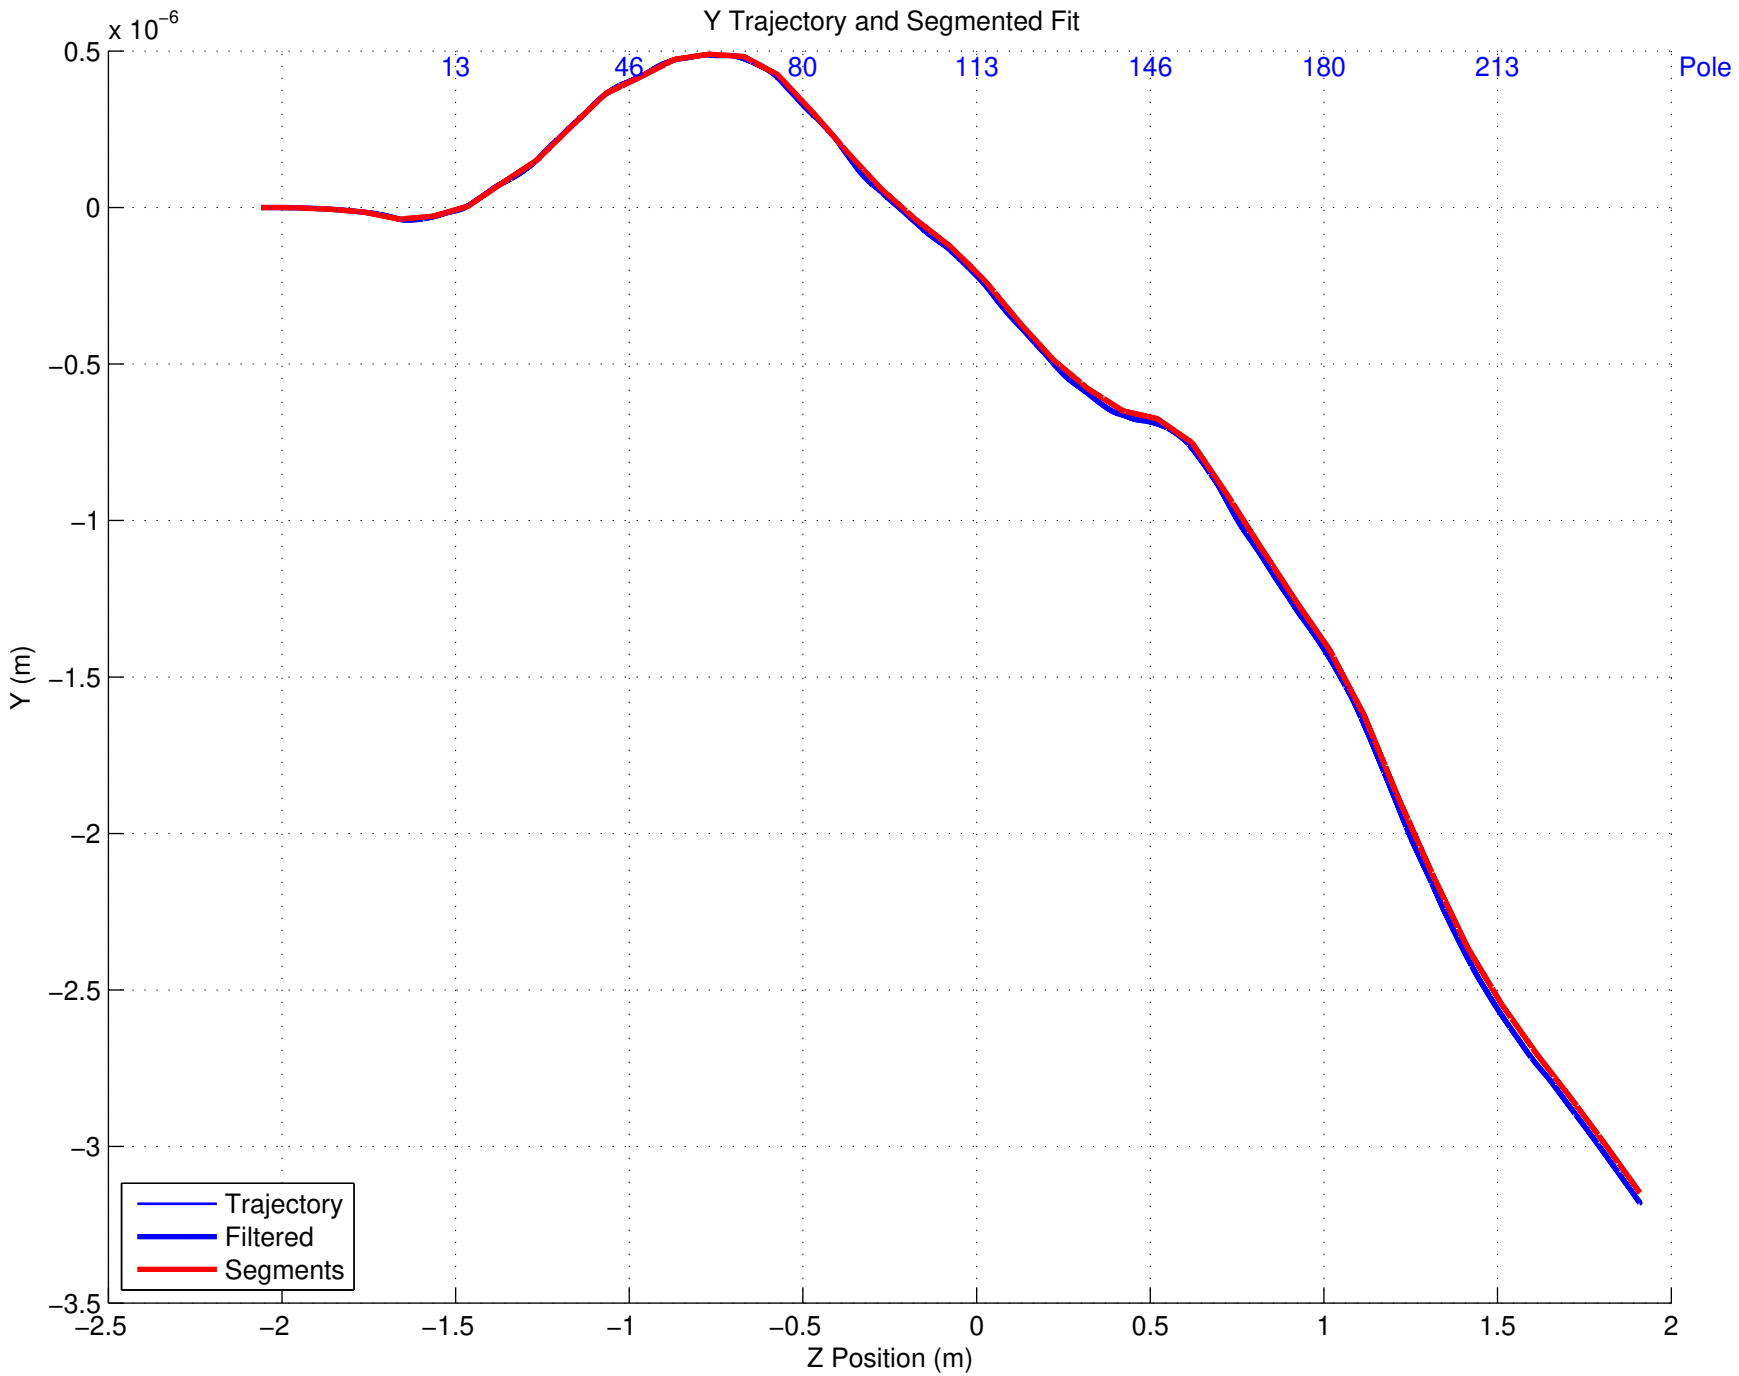
Y Trajectory and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
0.5
0
−0.5
−1
−1.5
−2
−2.5
−3
−3.5
Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

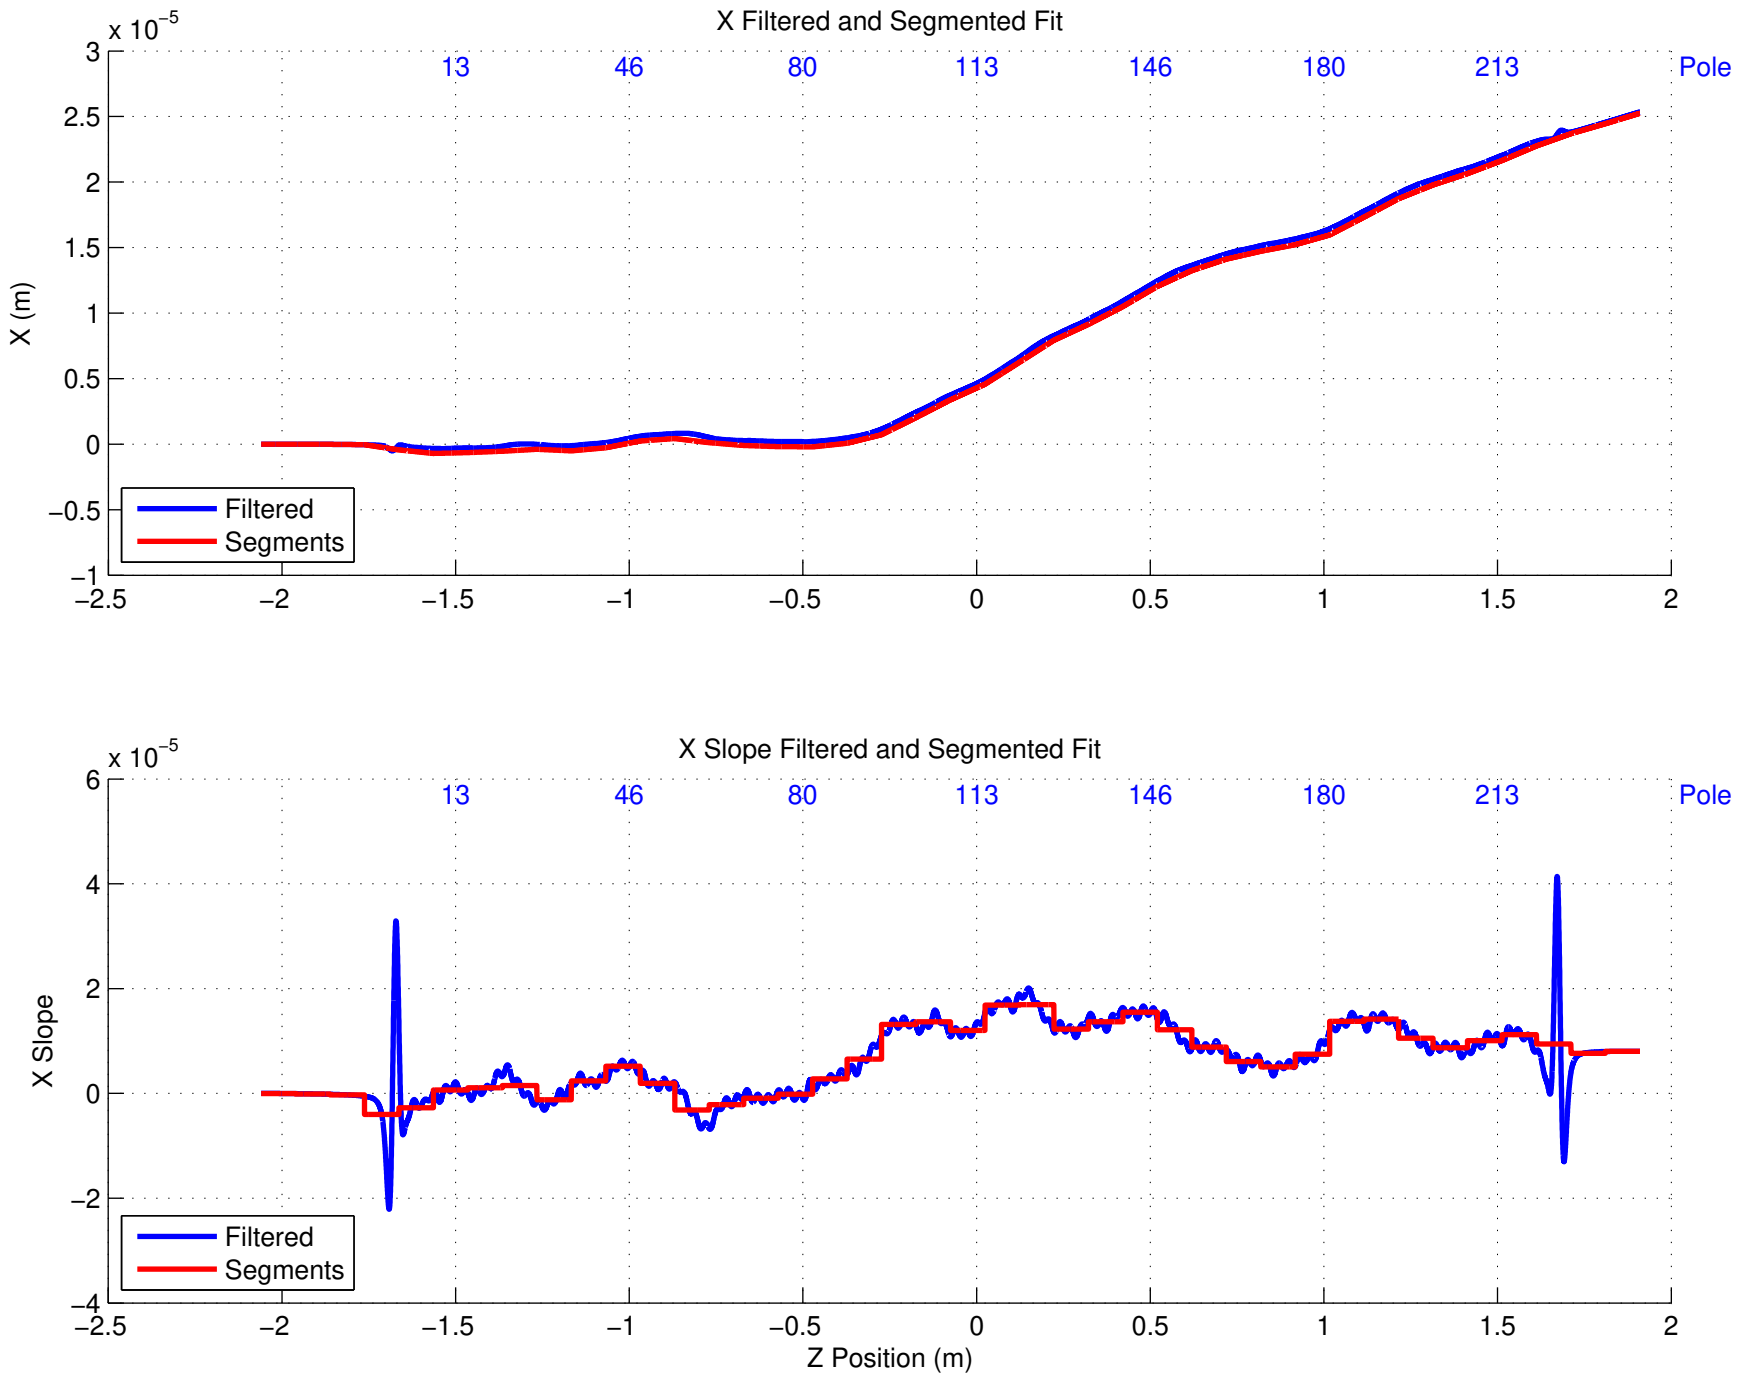
X Filtered and Segmented Fit
x 10^-5
13
46
80
113
146
180
213
Pole
X (m)
Filtered
Segments
X Slope Filtered and Segmented Fit
x 10^-5
X Slope
Z Position (m)
Filtered
Segments

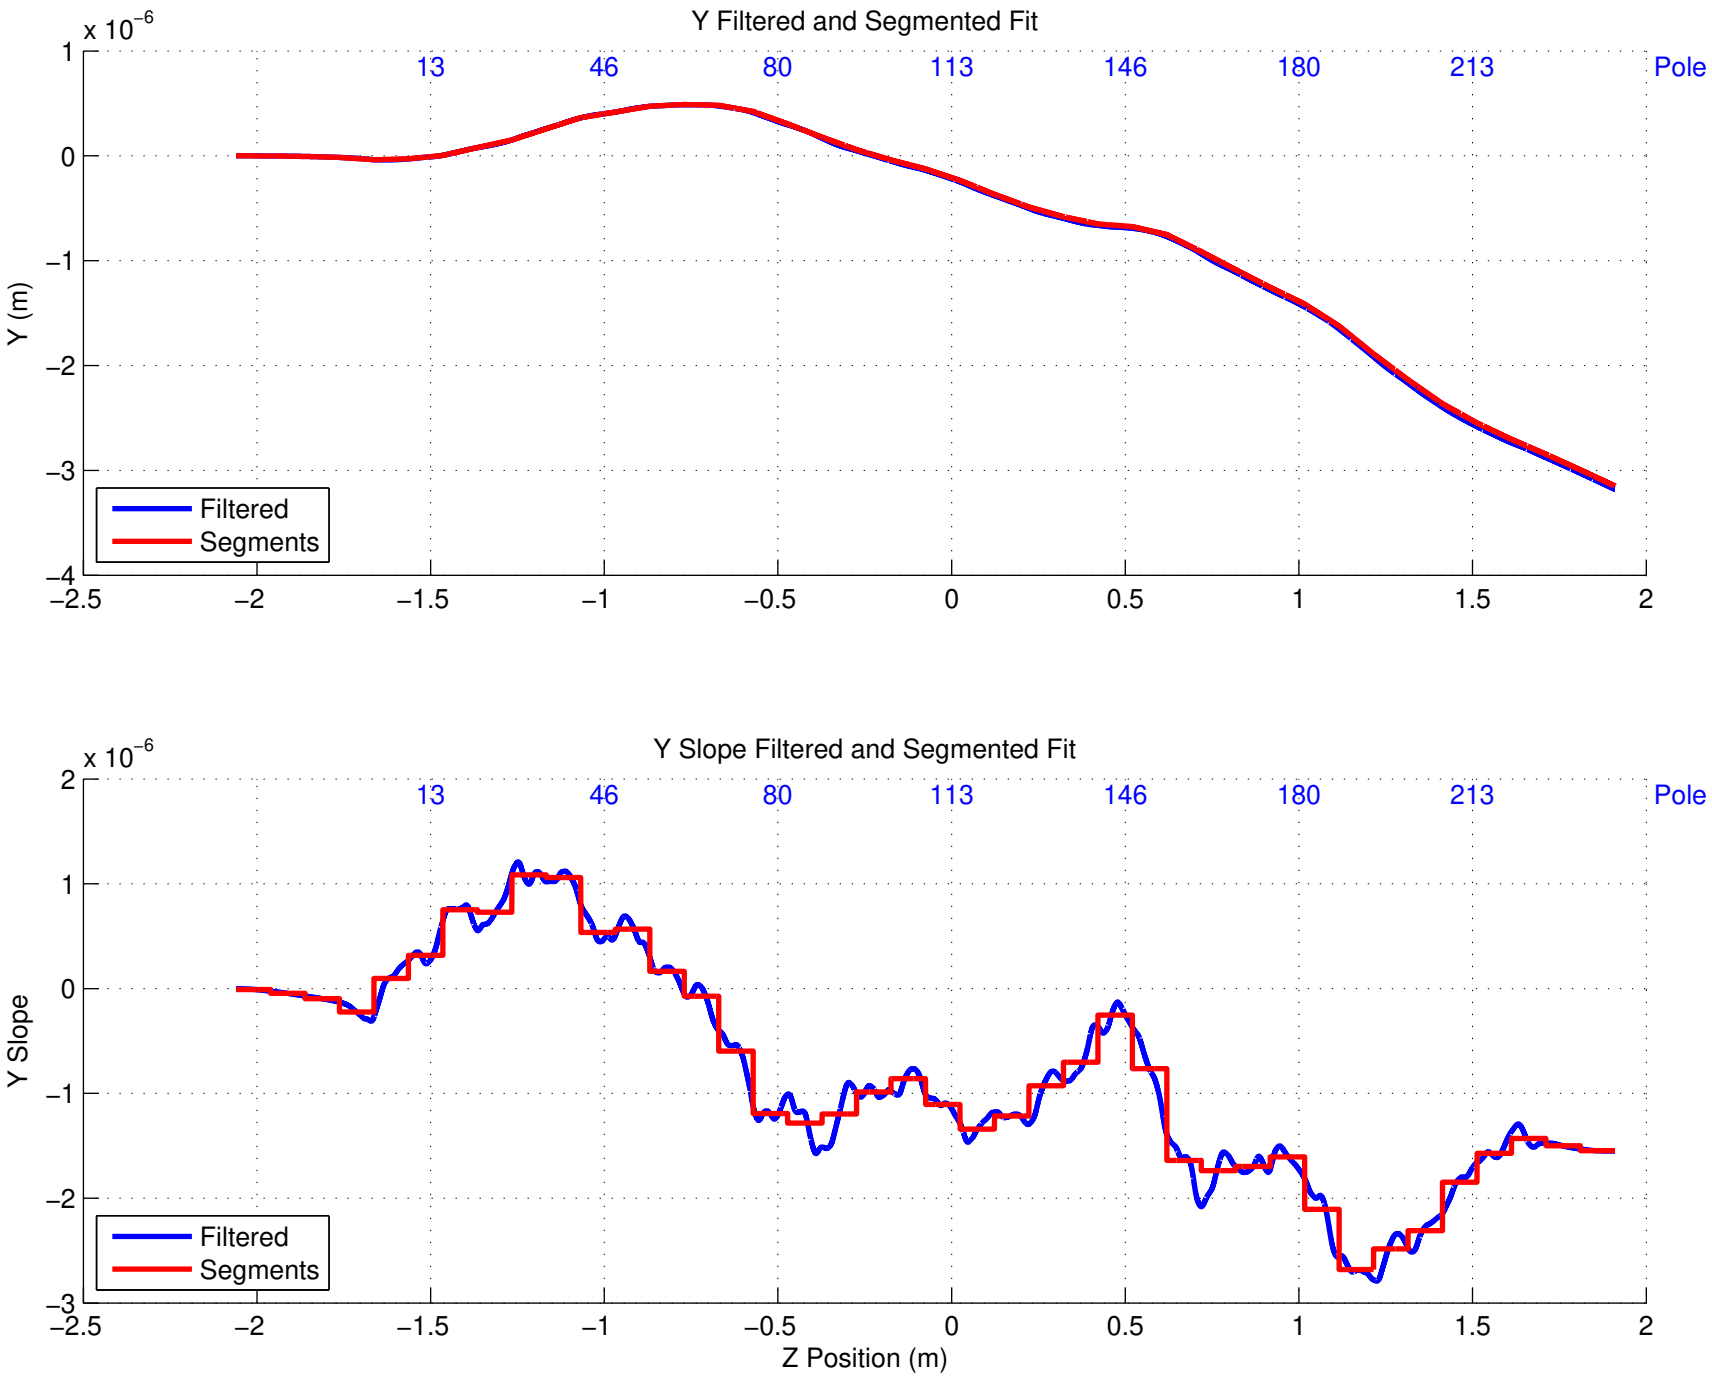
Y Filtered and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
Y (m)
Filtered
Segments
Y Slope Filtered and Segmented Fit
x 10^-6
Y Slope
Z Position (m)

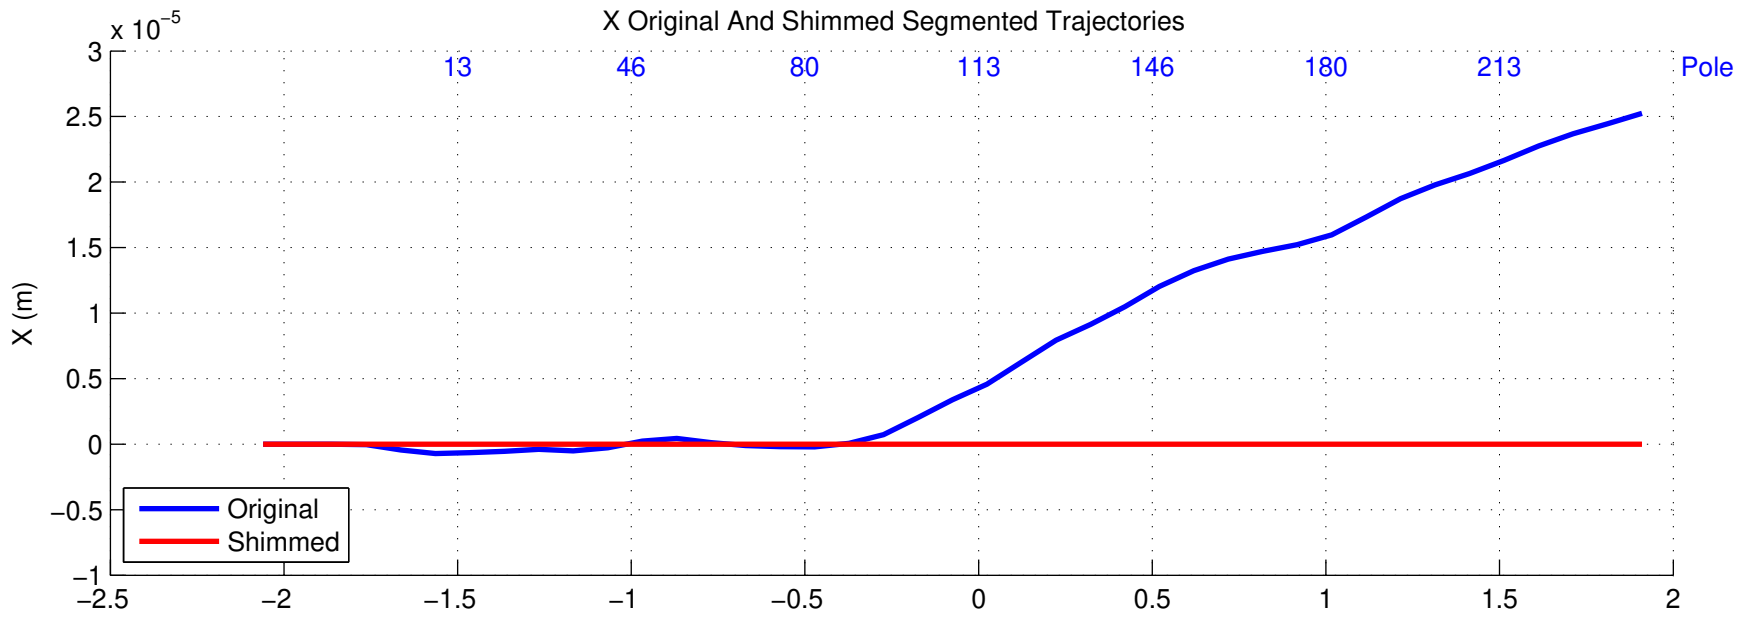
X Original And Shimmed Segmented Trajectories
x 10^-5
13
46
80
113
146
180
213
Pole
X (m)
Original
Shimmed

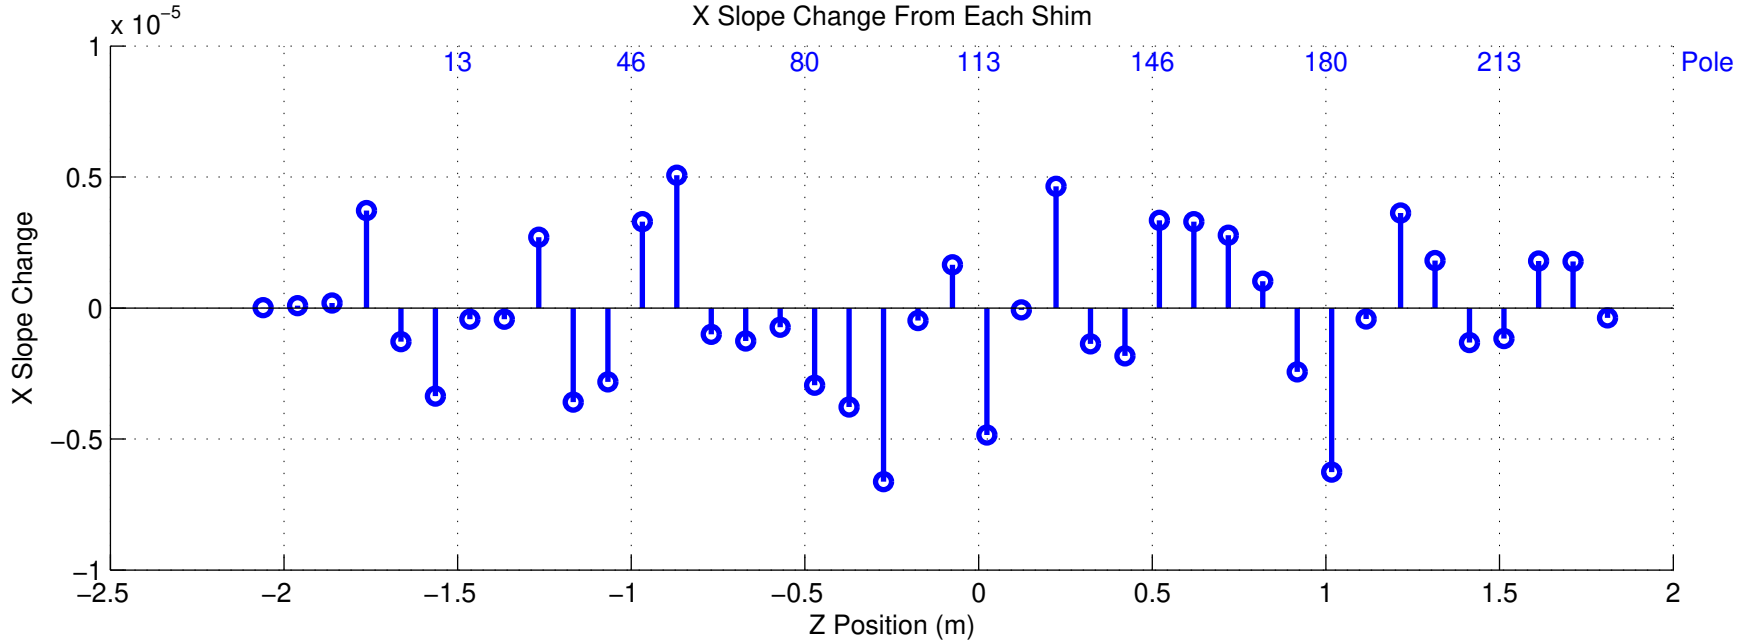
X Slope Change From Each Shim
x 10^-5
13
46
80
113
146
180
213
Pole
X Slope Change
Z Position (m)

Y Original And Shimmed Segmented Trajectories
x 10^-6
13
46
80
113
146
180
213
Pole
Y (m)
Original
Shimmed

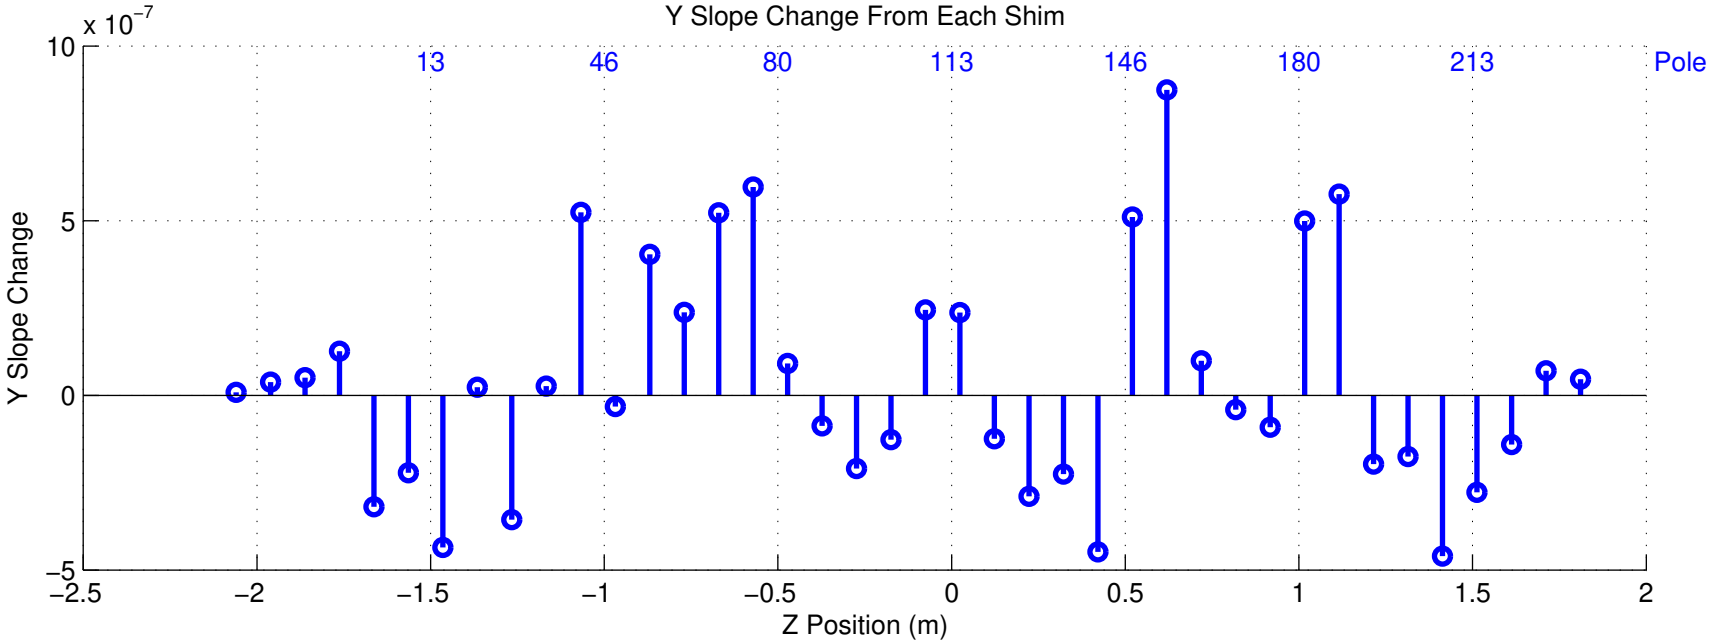
Y Slope Change From Each Shim
x 10^-7
13
46
80
113
146
180
213
Pole
Y Slope Change
Z Position (m)

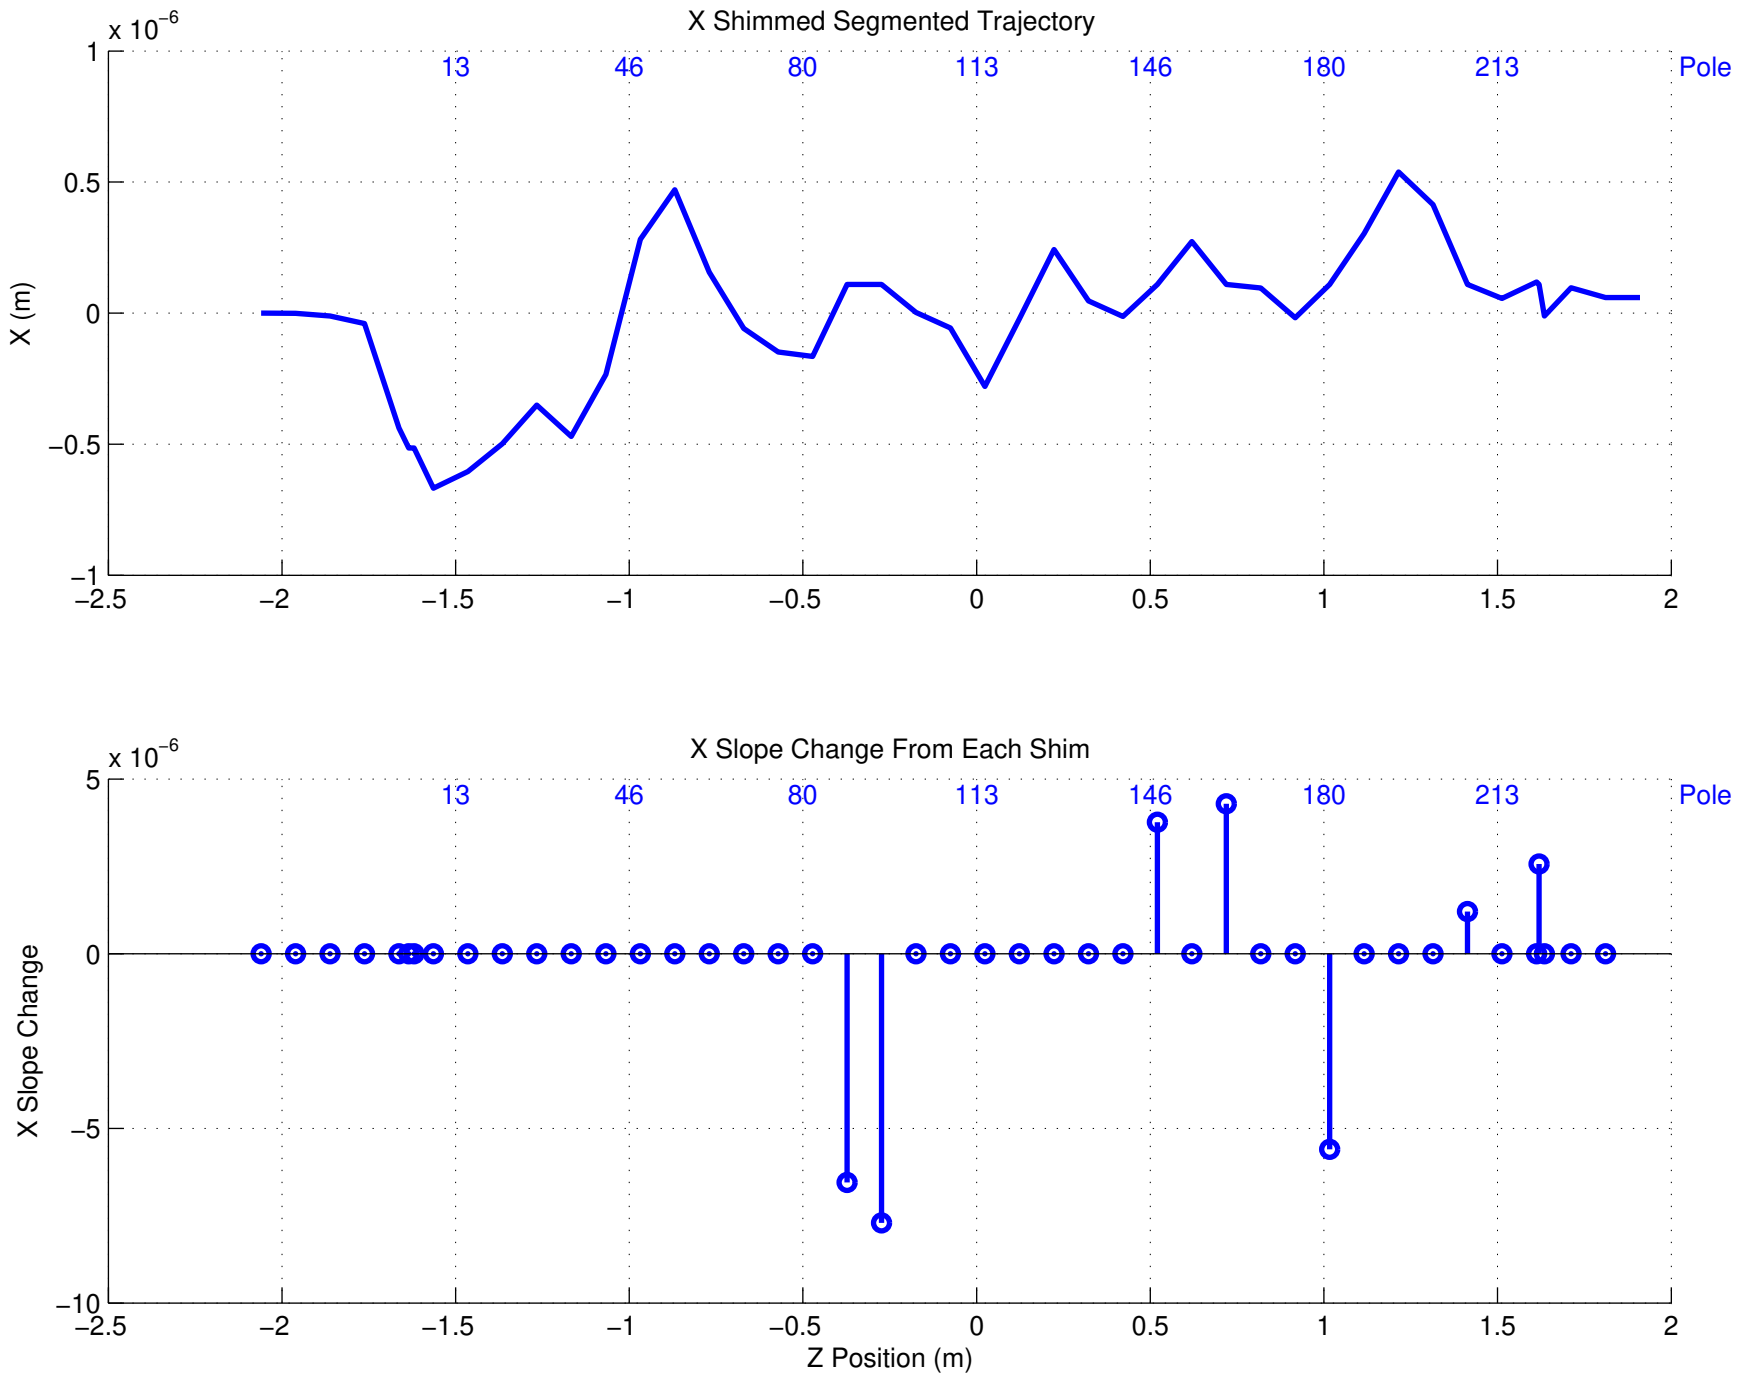
X Shimmed Segmented Trajectory
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
1
0.5
0
−0.5
−1
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
X Slope Change From Each Shim
x 10^-6
X Slope Change
5
0
−5
−10
Z Position (m)

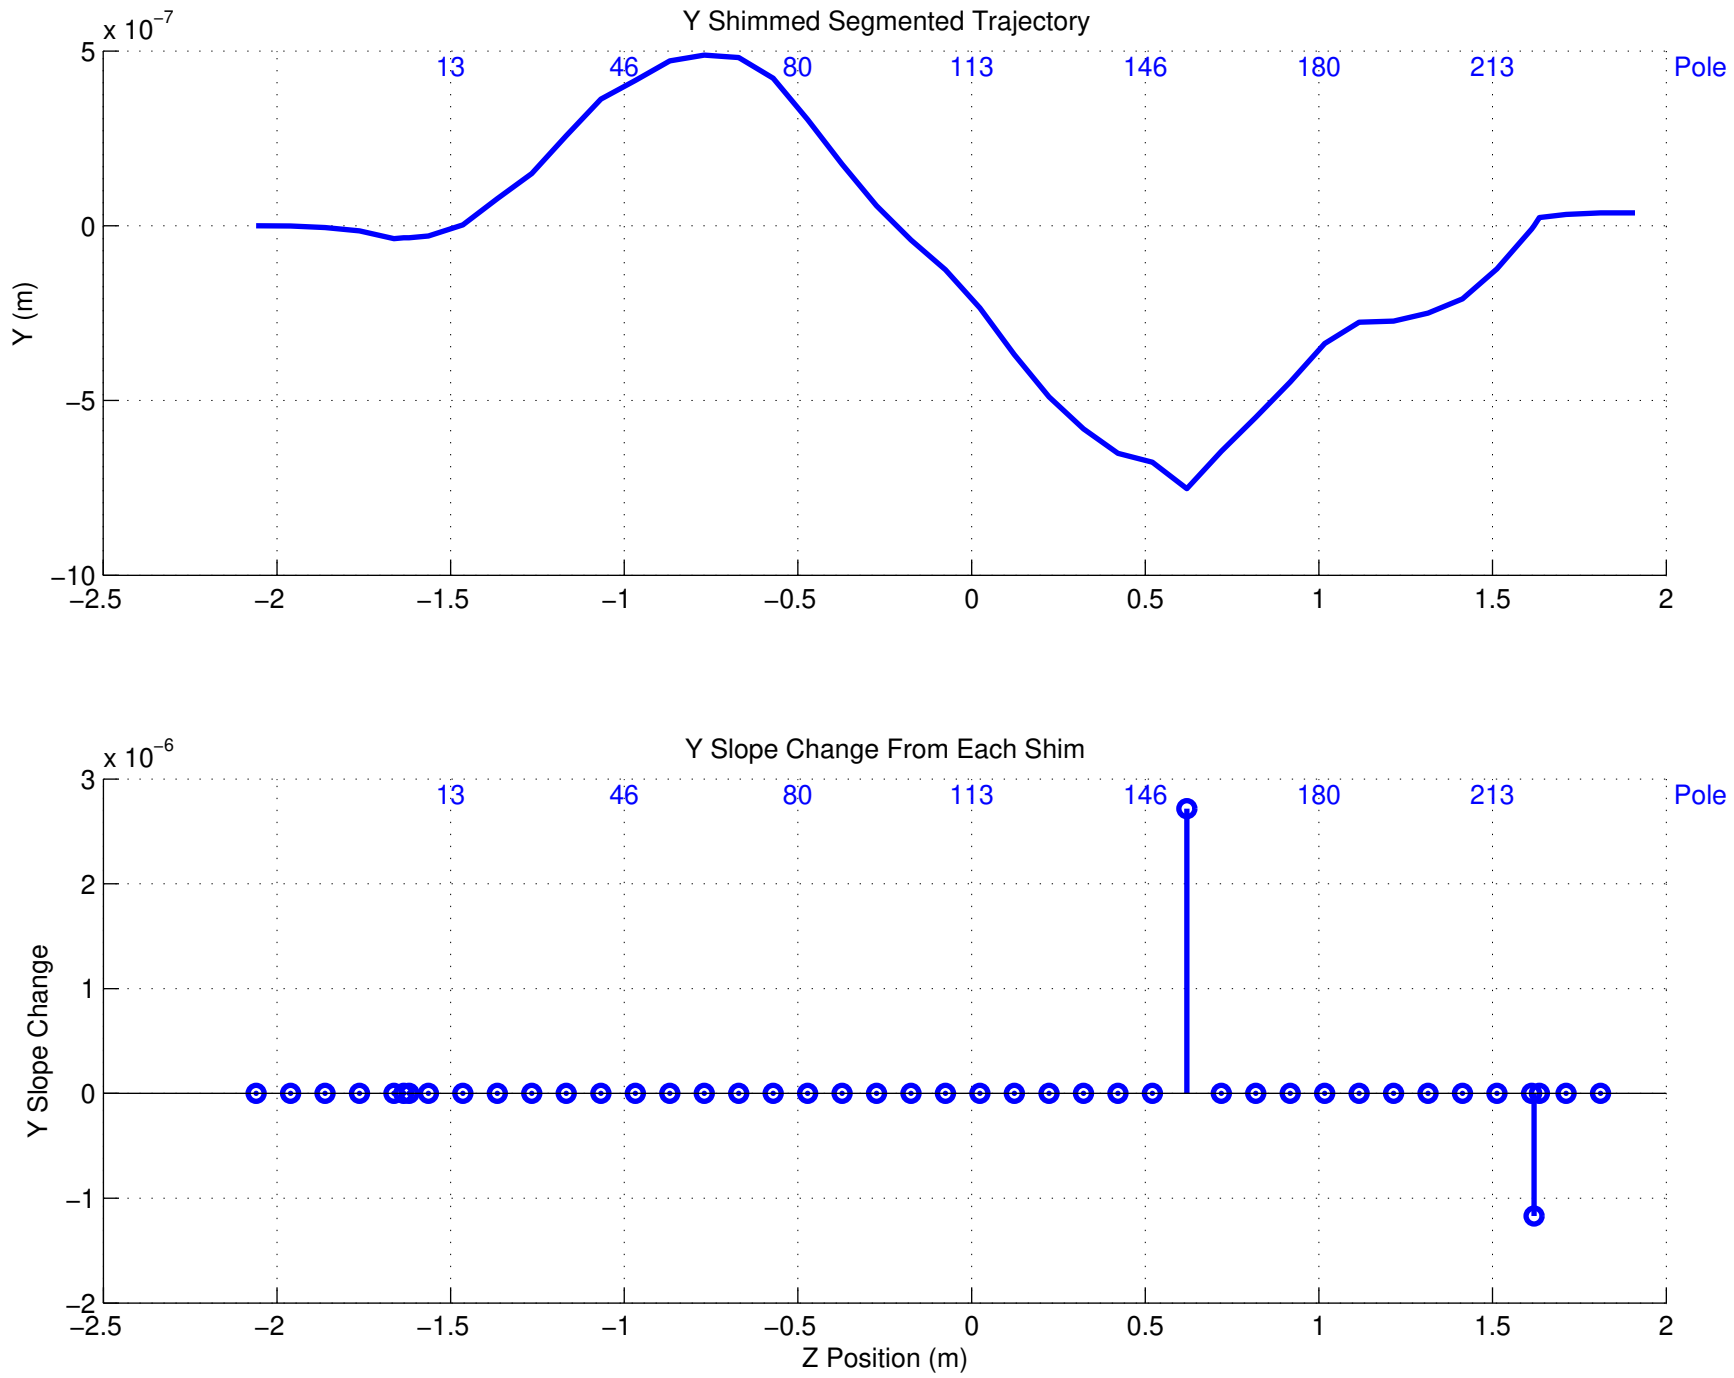
Y Shimmed Segmented Trajectory
x 10^-7
5
0
−5
−10
Y (m)
13
46
80
113
146
180
213
Pole
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Y Slope Change From Each Shim
x 10^-6
3
2
1
0
−1
−2
Y Slope Change
Z Position (m)

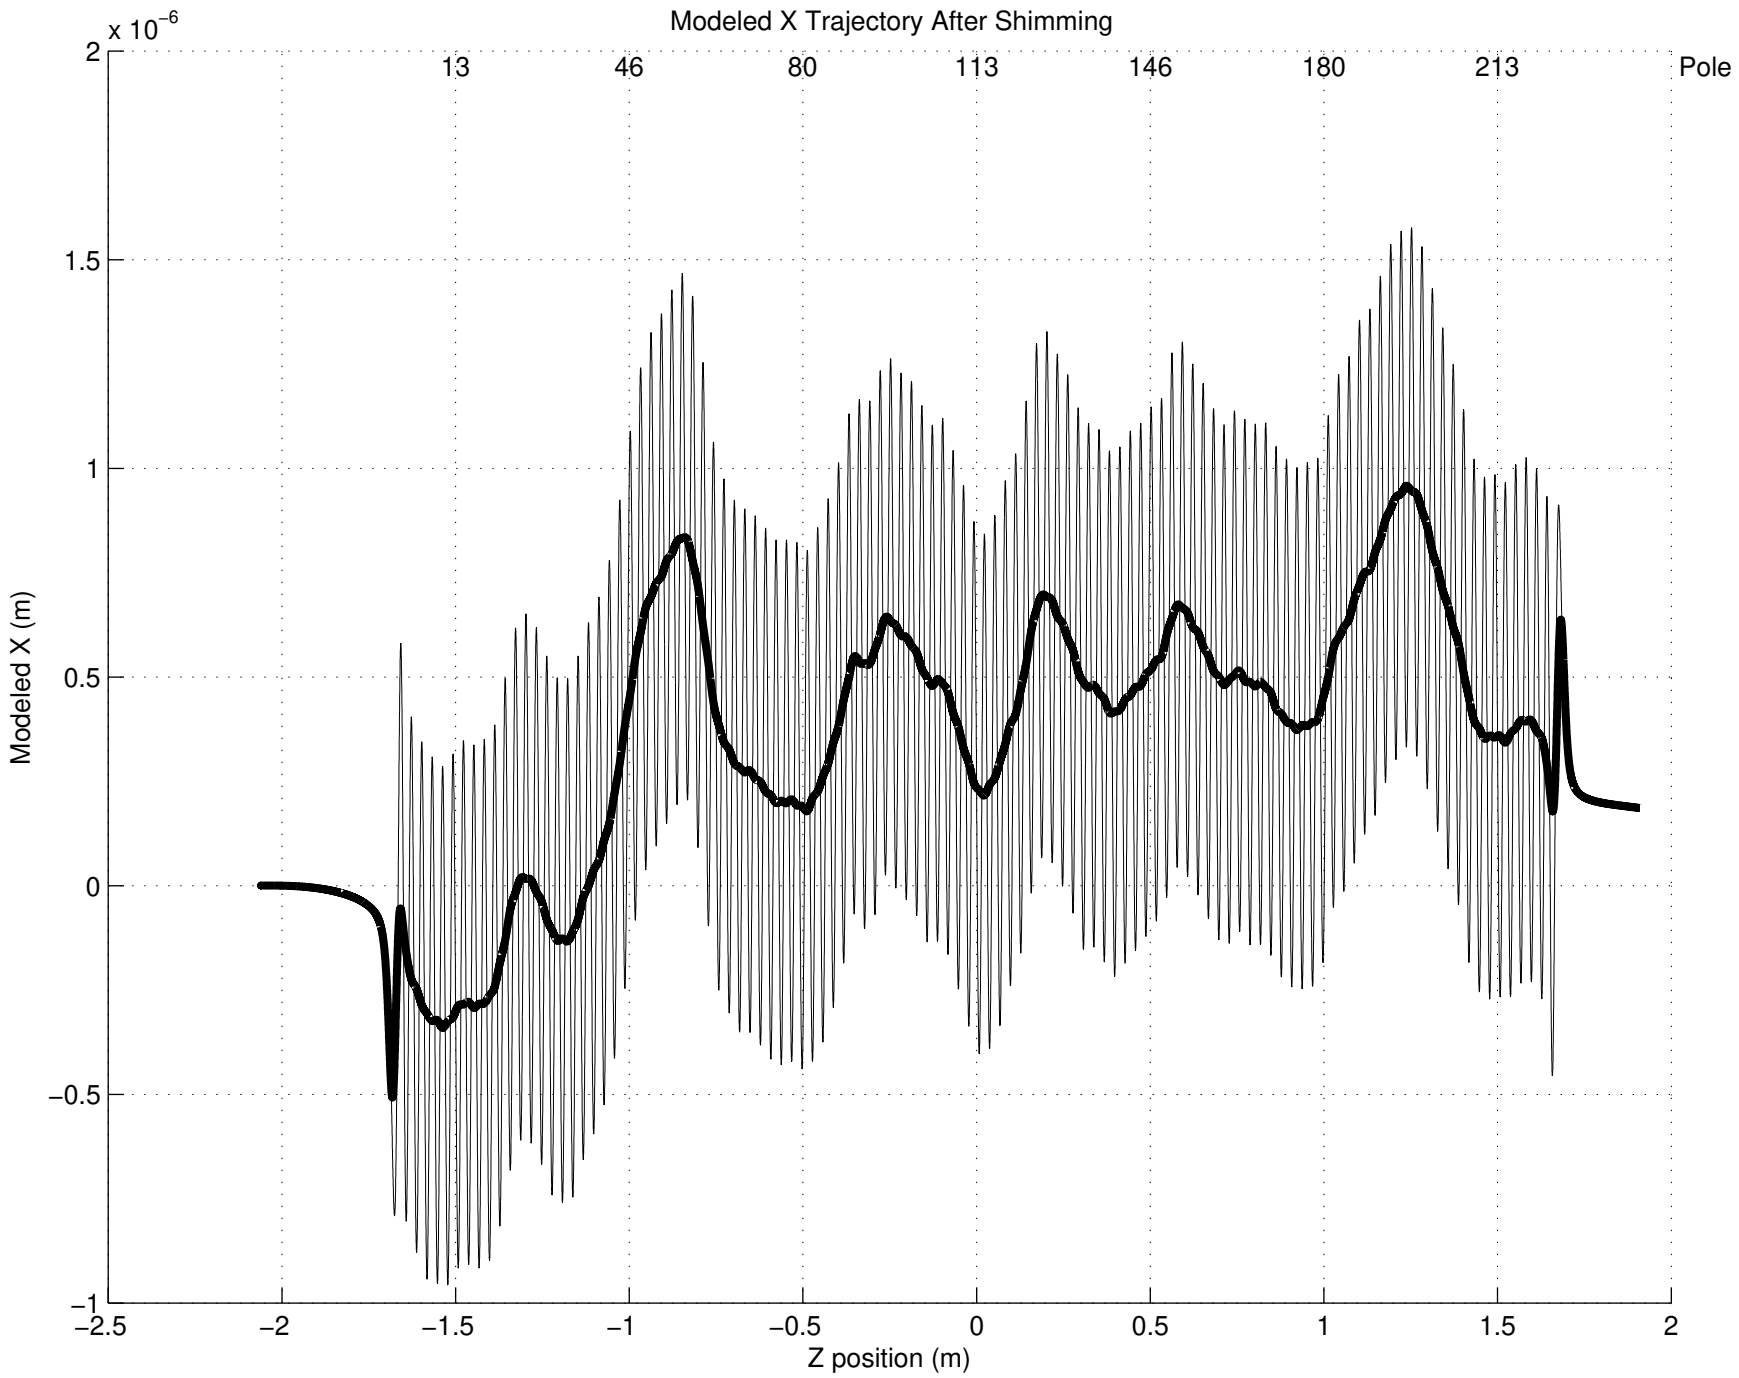
Modeled X Trajectory After Shimming
x 10^-6
2
1.5
1
0.5
0
−0.5
−1
13
46
80
113
146
180
213
Pole
Modeled X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

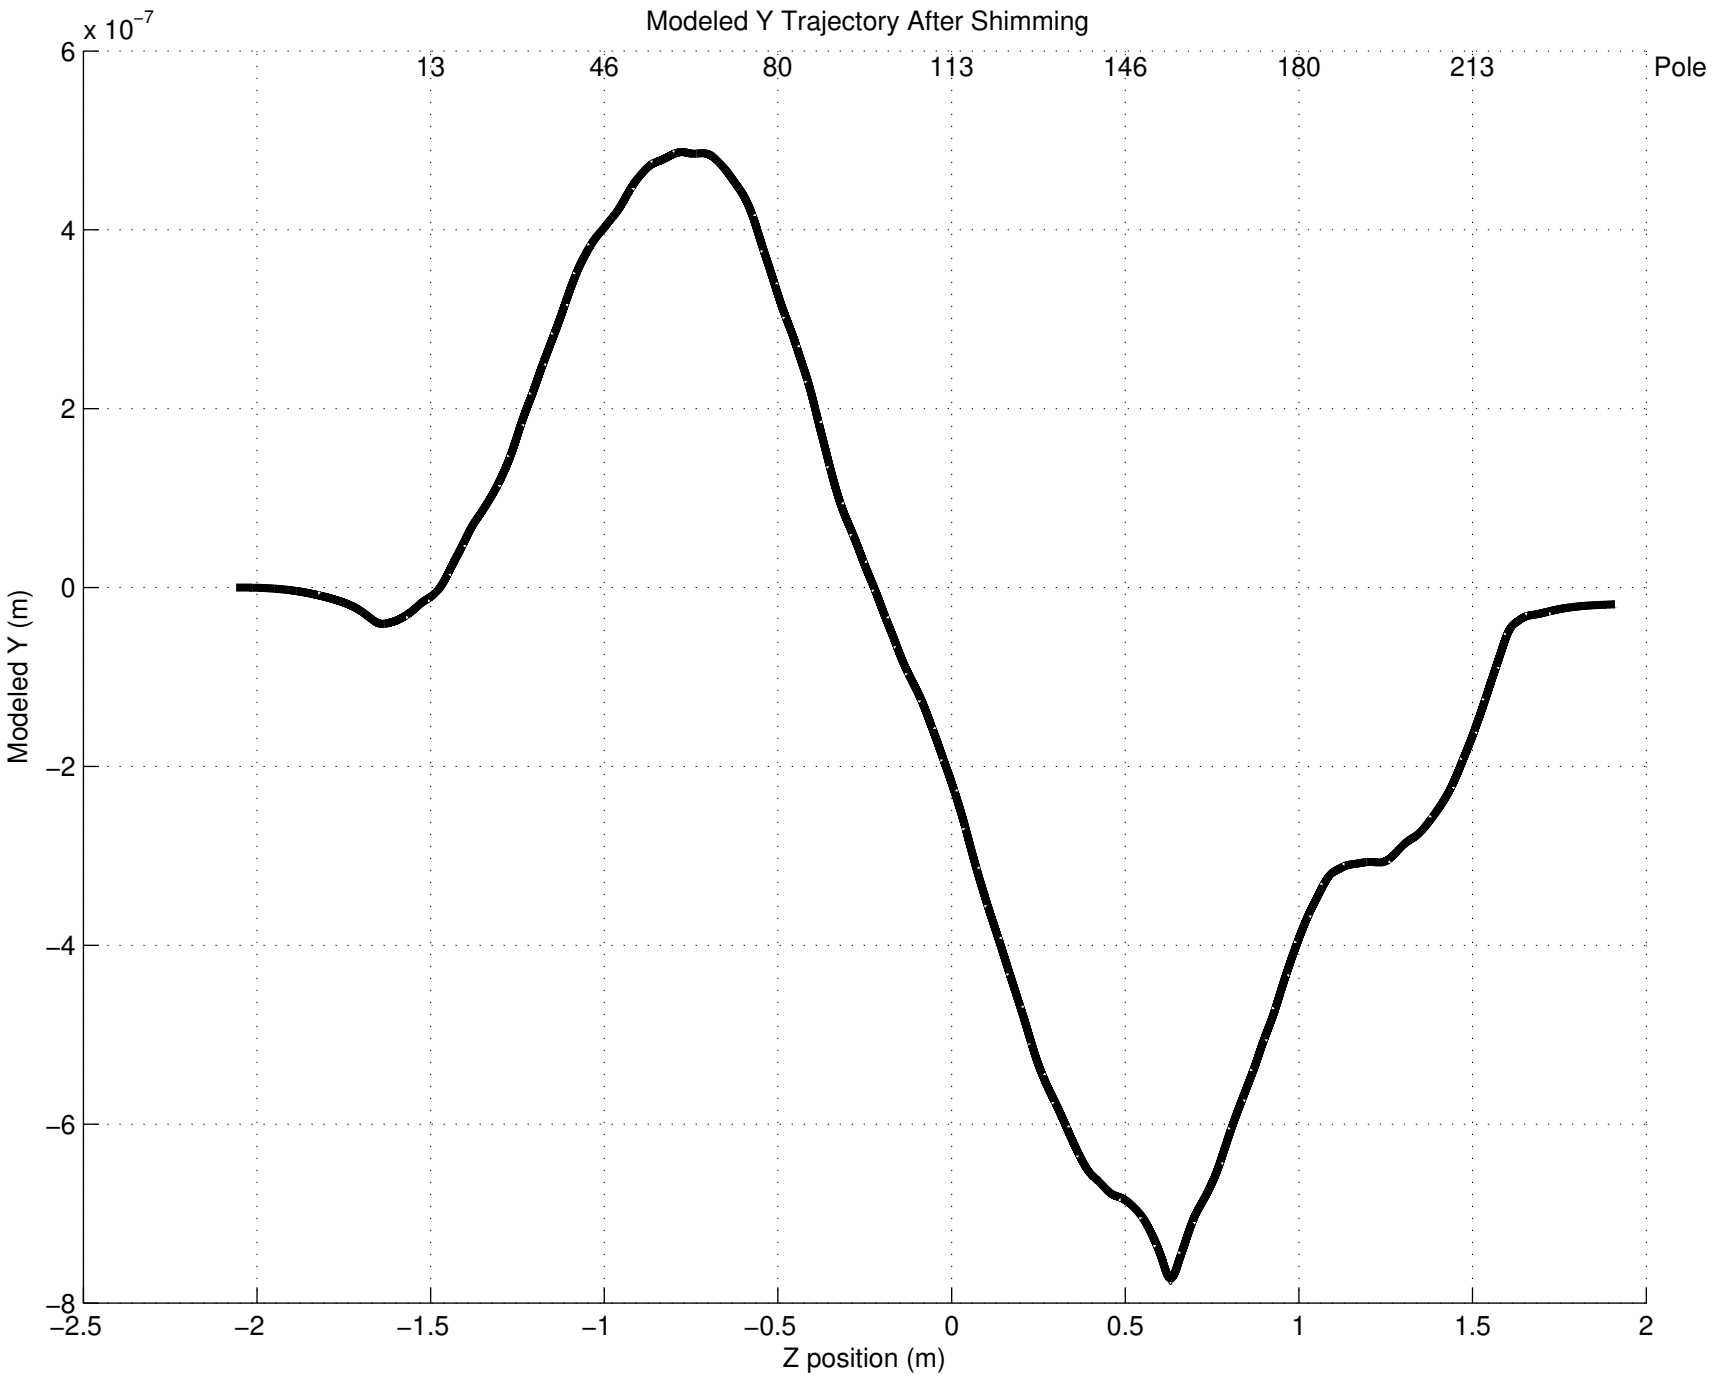
Modeled Y Trajectory After Shimming
x 10^-7
6
4
2
0
−2
−4
−6
−8
13
46
80
113
146
180
213
Pole
Modeled Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

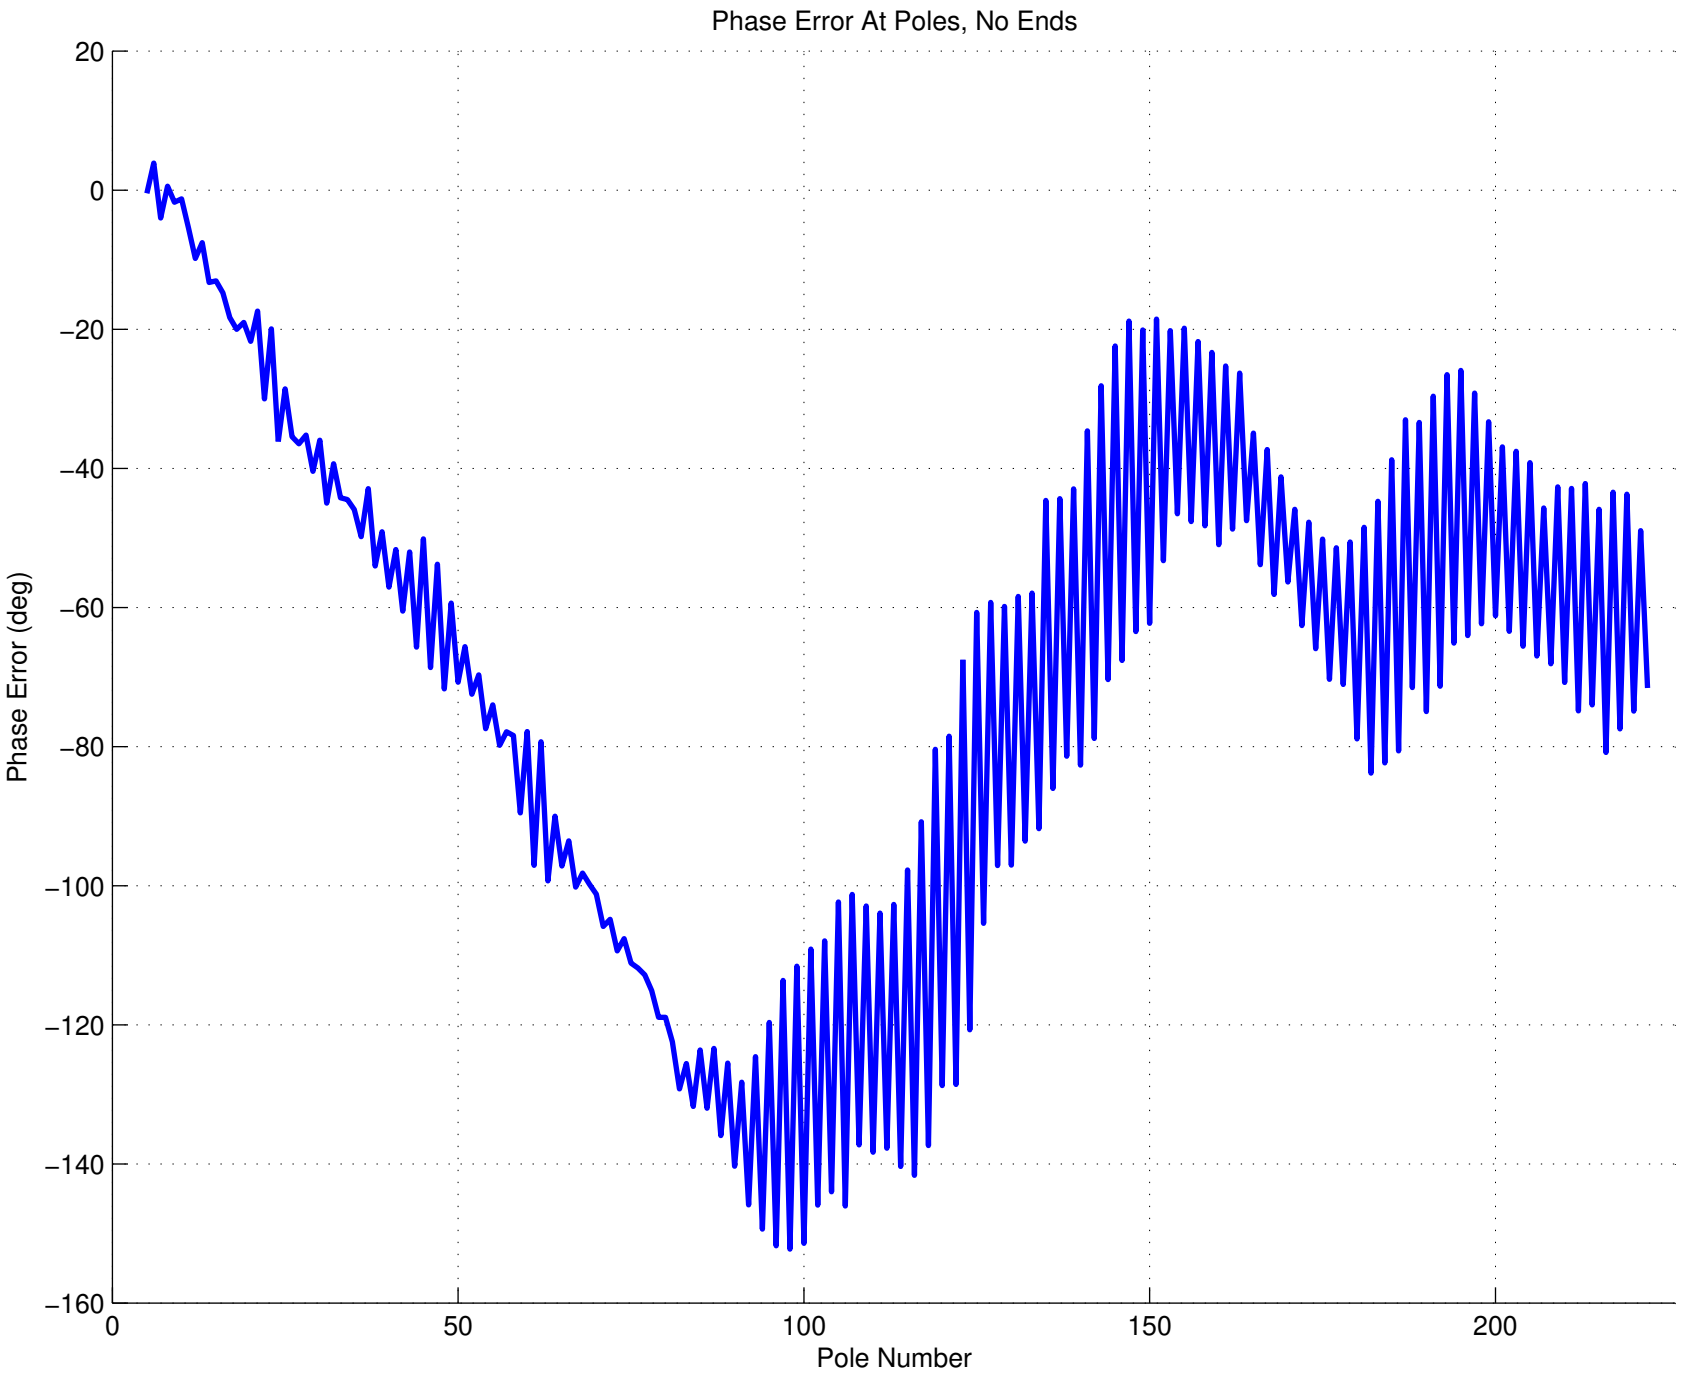
Phase Error At Poles, No Ends
Phase Error (deg)
Pole Number
20
0
−20
−40
−60
−80
−100
−120
−140
−160
0
50
100
150
200

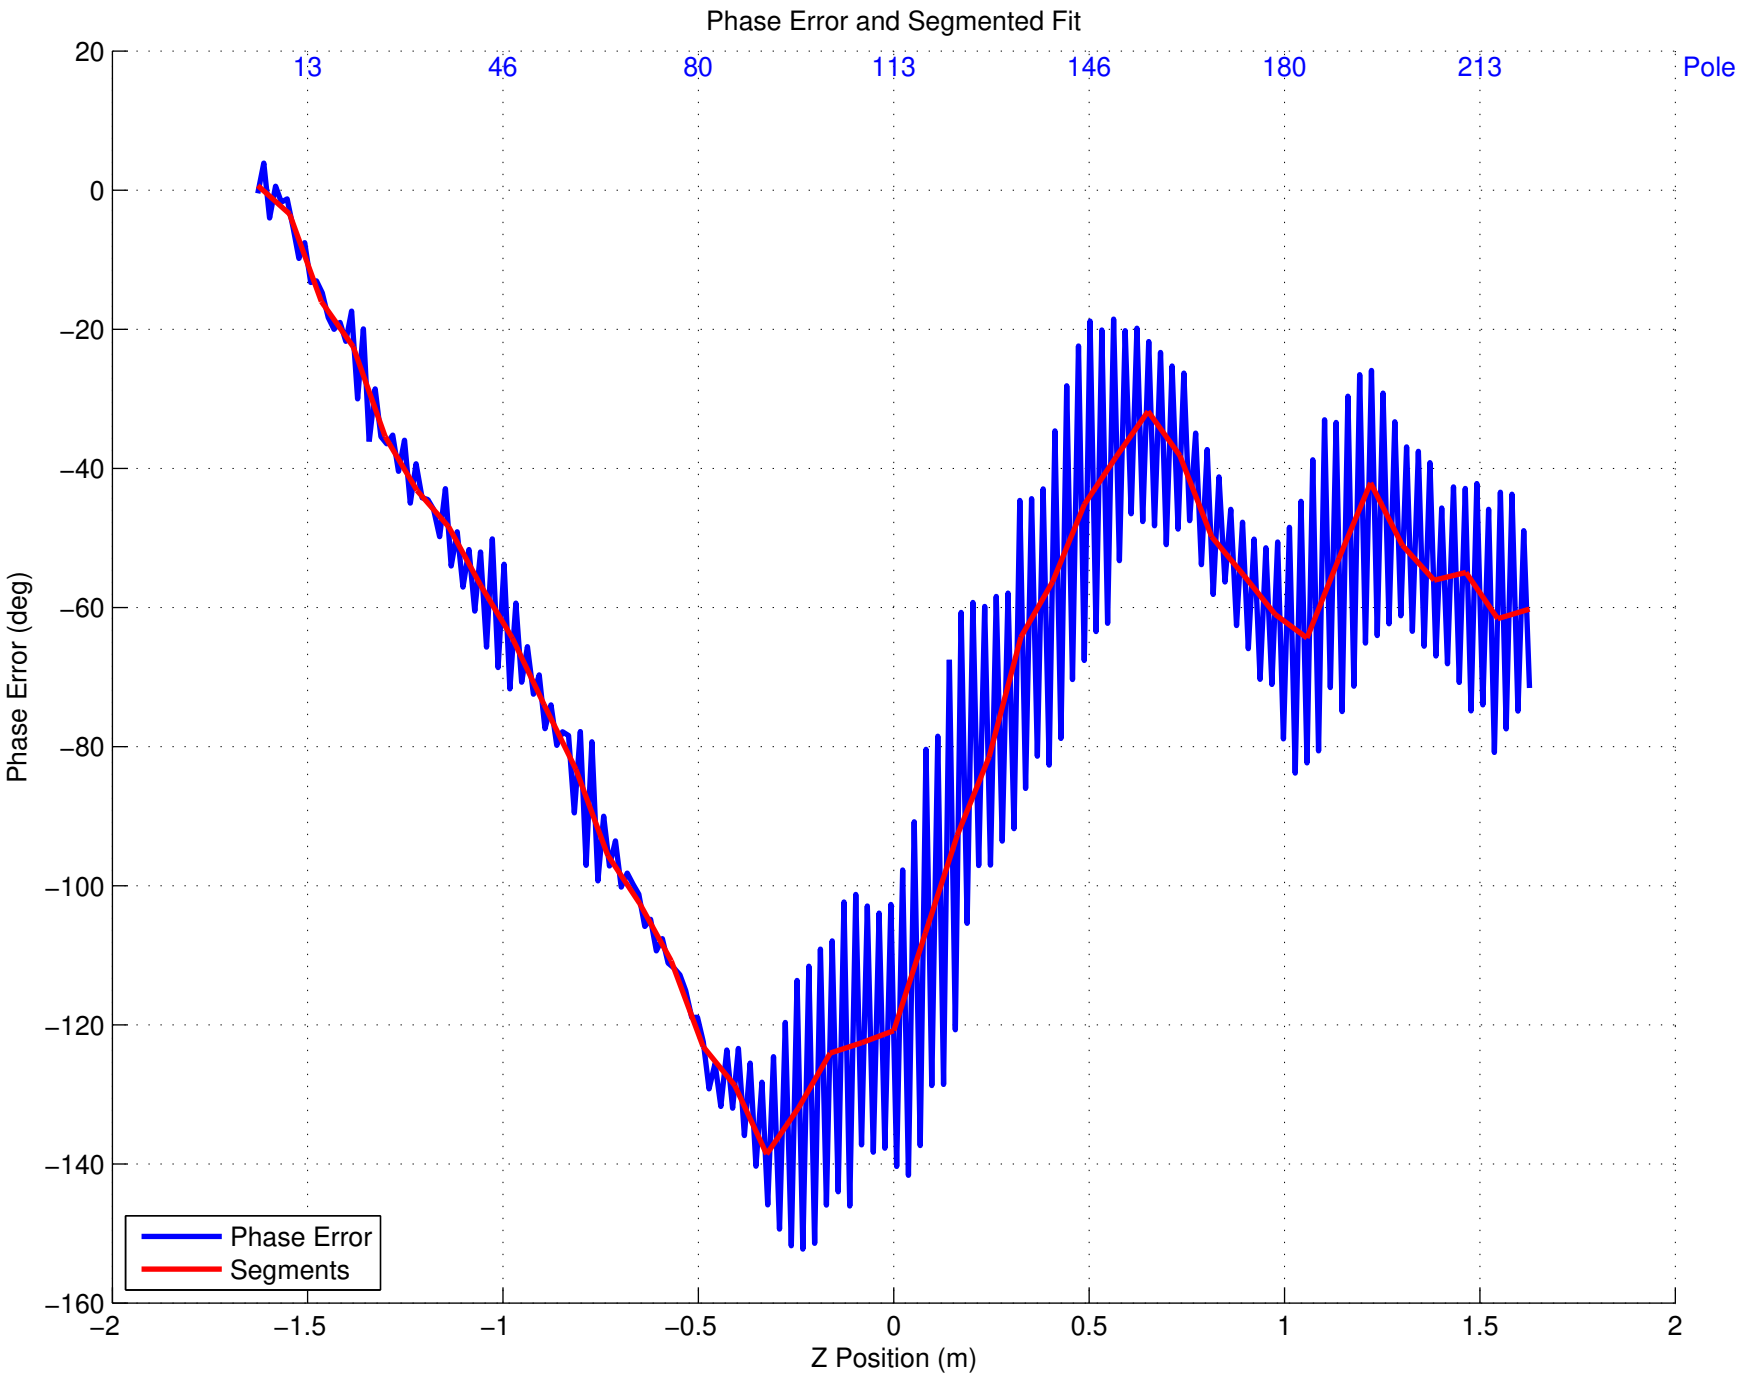
Phase Error and Segmented Fit
13
46
80
113
146
180
213
Pole
20
0
−20
−40
−60
−80
−100
−120
−140
−160
Phase Error (deg)
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Phase Error
Segments

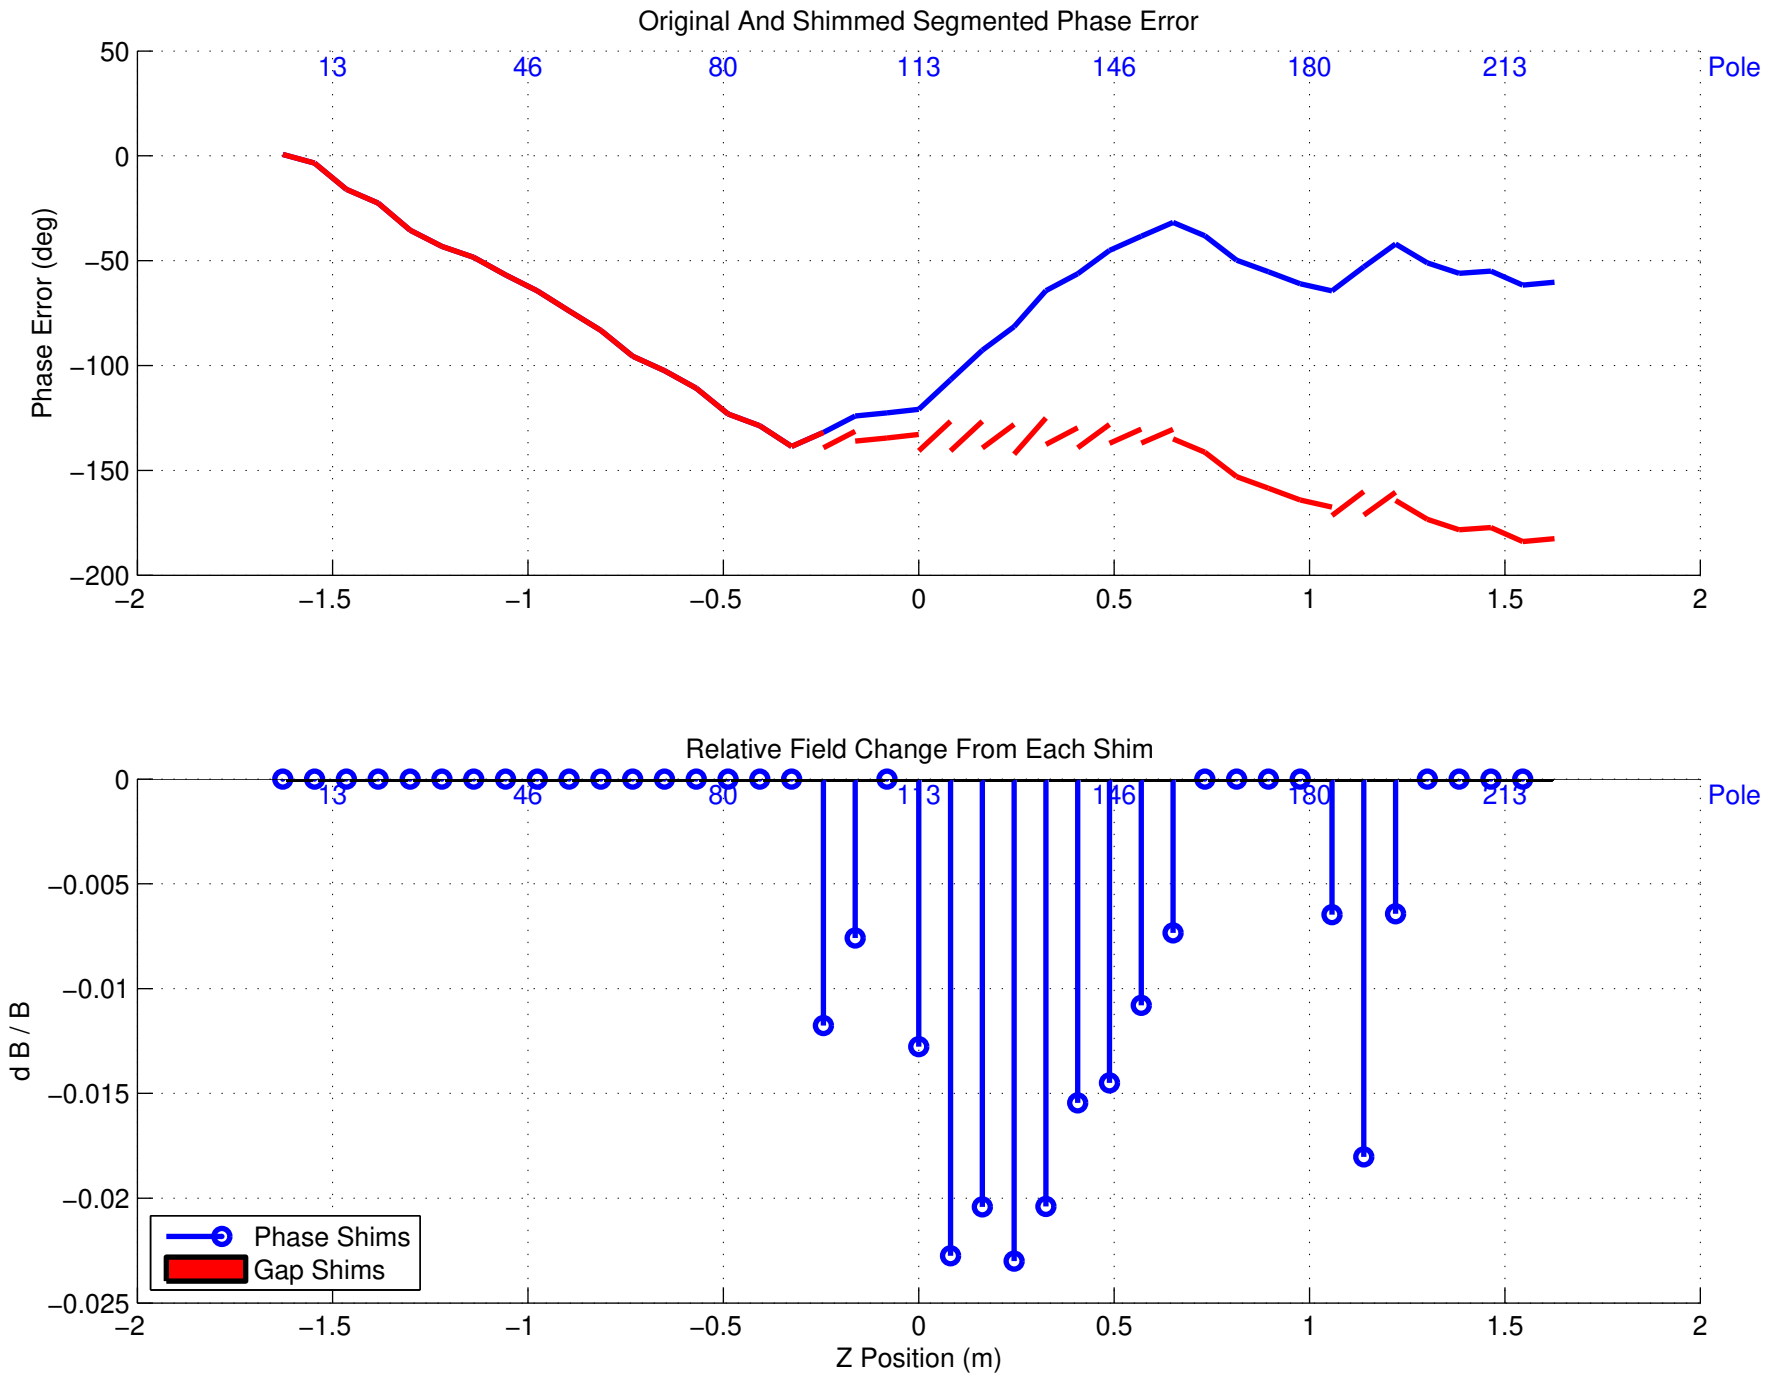
Original And Shimmed Segmented Phase Error
Phase Error (deg)
50
0
−50
−100
−150
−200
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
d B / B
0
−0.005
−0.01
−0.015
−0.02
−0.025
Phase Shims
Gap Shims
Z Position (m)

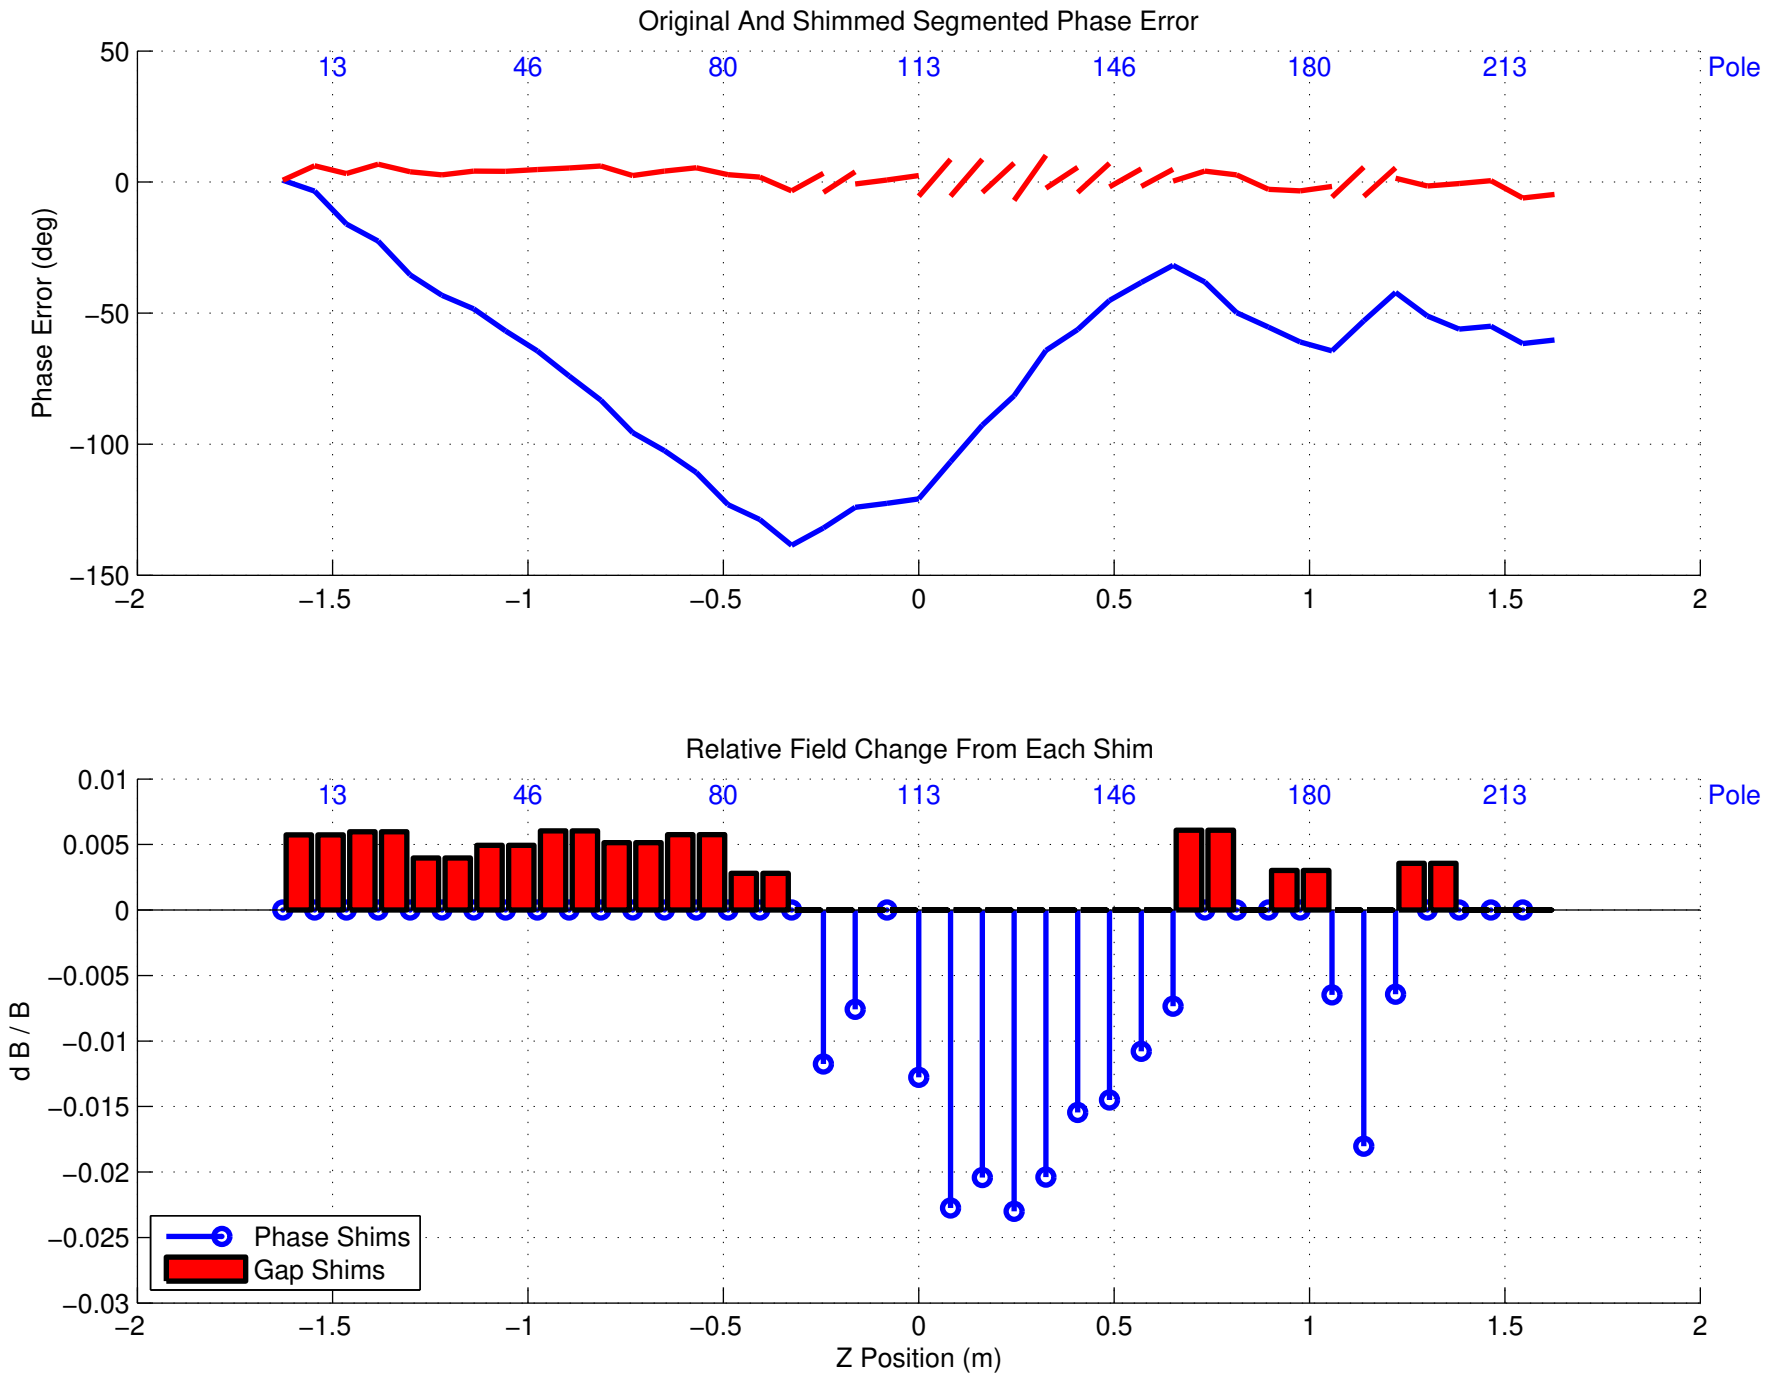
Original And Shimmed Segmented Phase Error
Phase Error (deg)
50
0
−50
−100
−150
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
d B / B
0.01
0.005
0
−0.005
−0.01
−0.015
−0.02
−0.025
−0.03
Phase Shims
Gap Shims
Z Position (m)

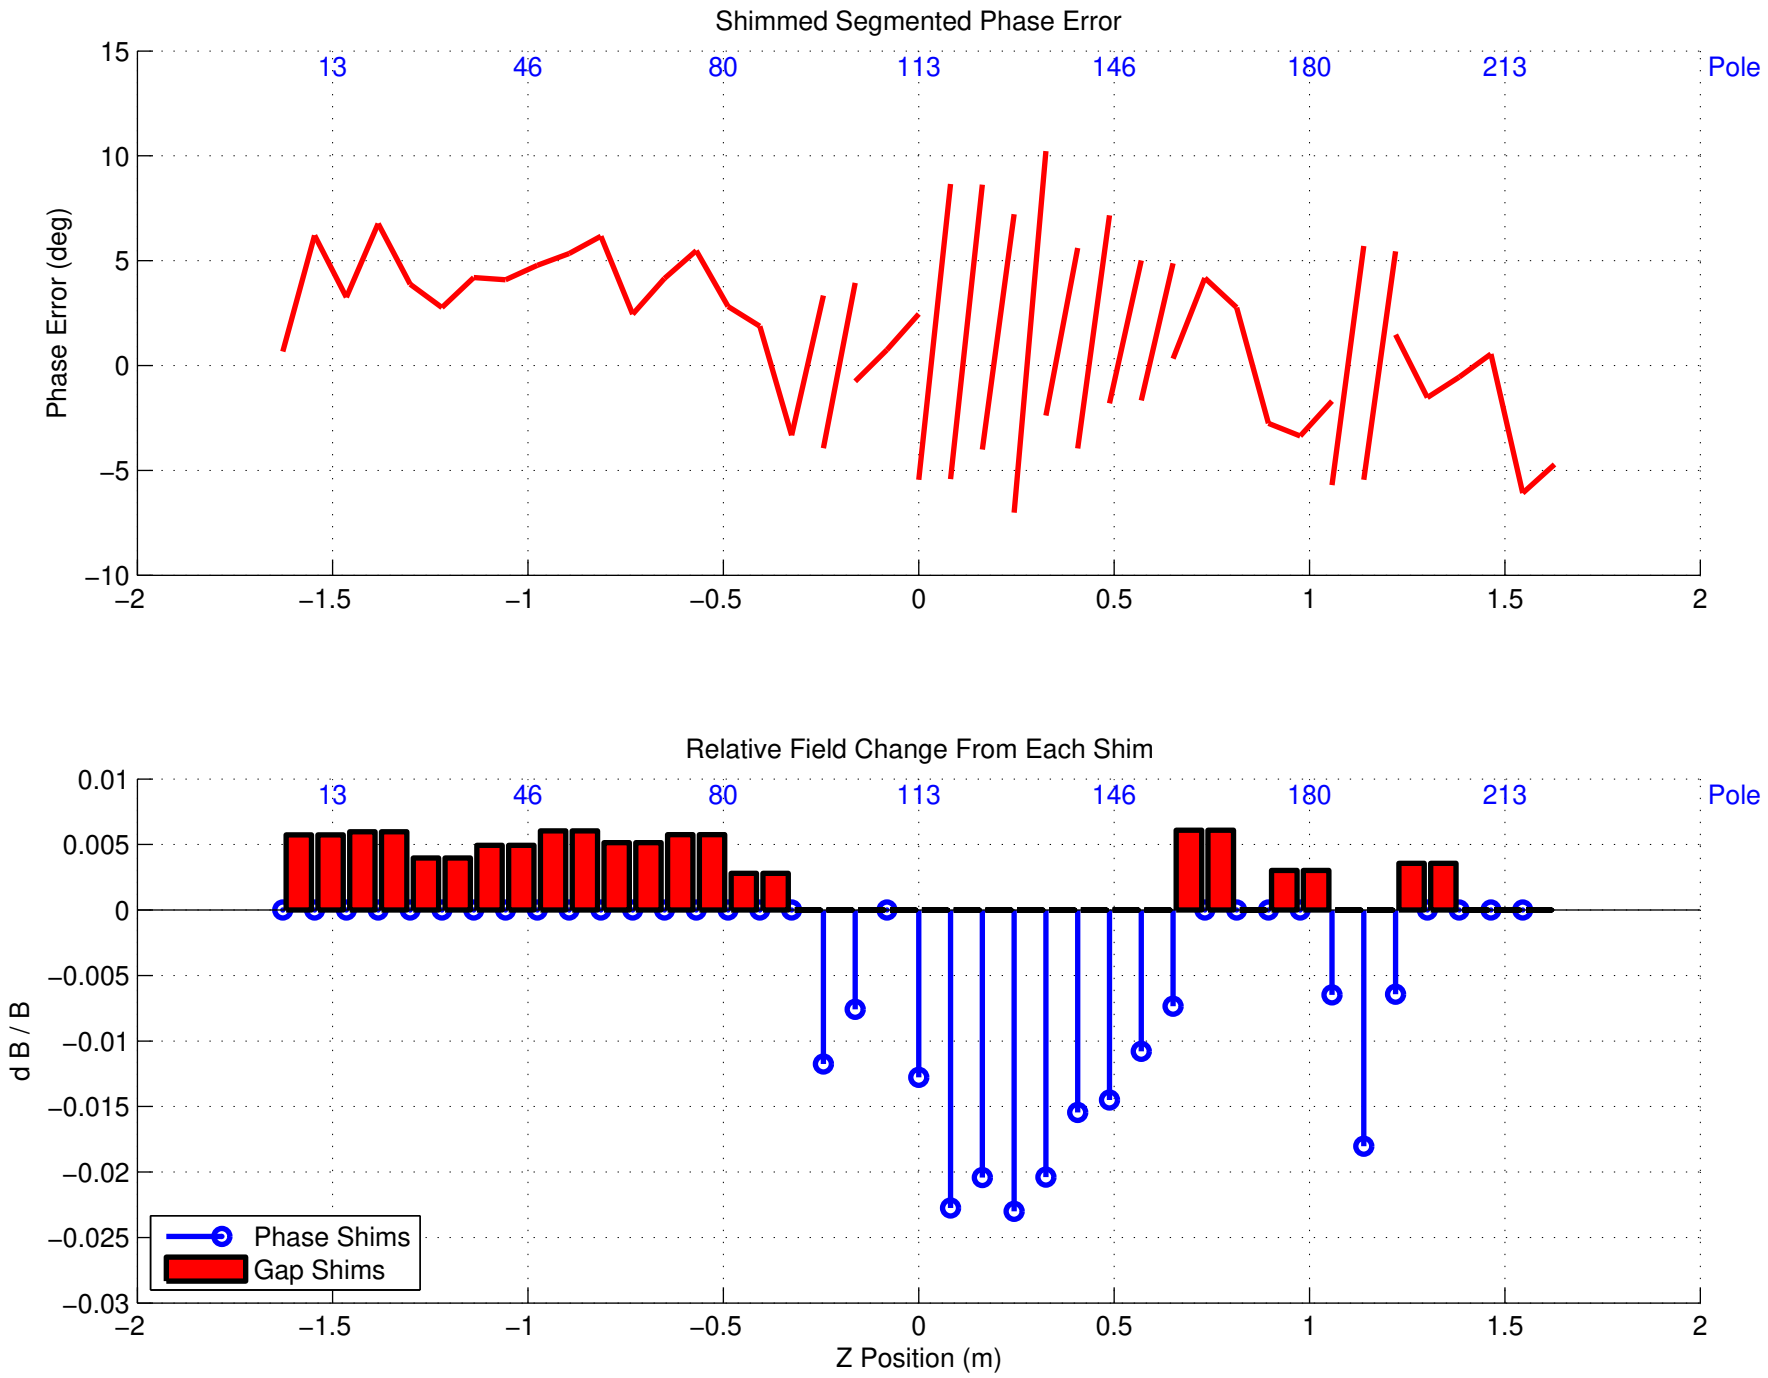
Shimmed Segmented Phase Error
Phase Error (deg)
15
10
5
0
−5
−10
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
d B / B
0.01
0.005
0
−0.005
−0.01
−0.015
−0.02
−0.025
−0.03
Phase Shims
Gap Shims
Z Position (m)

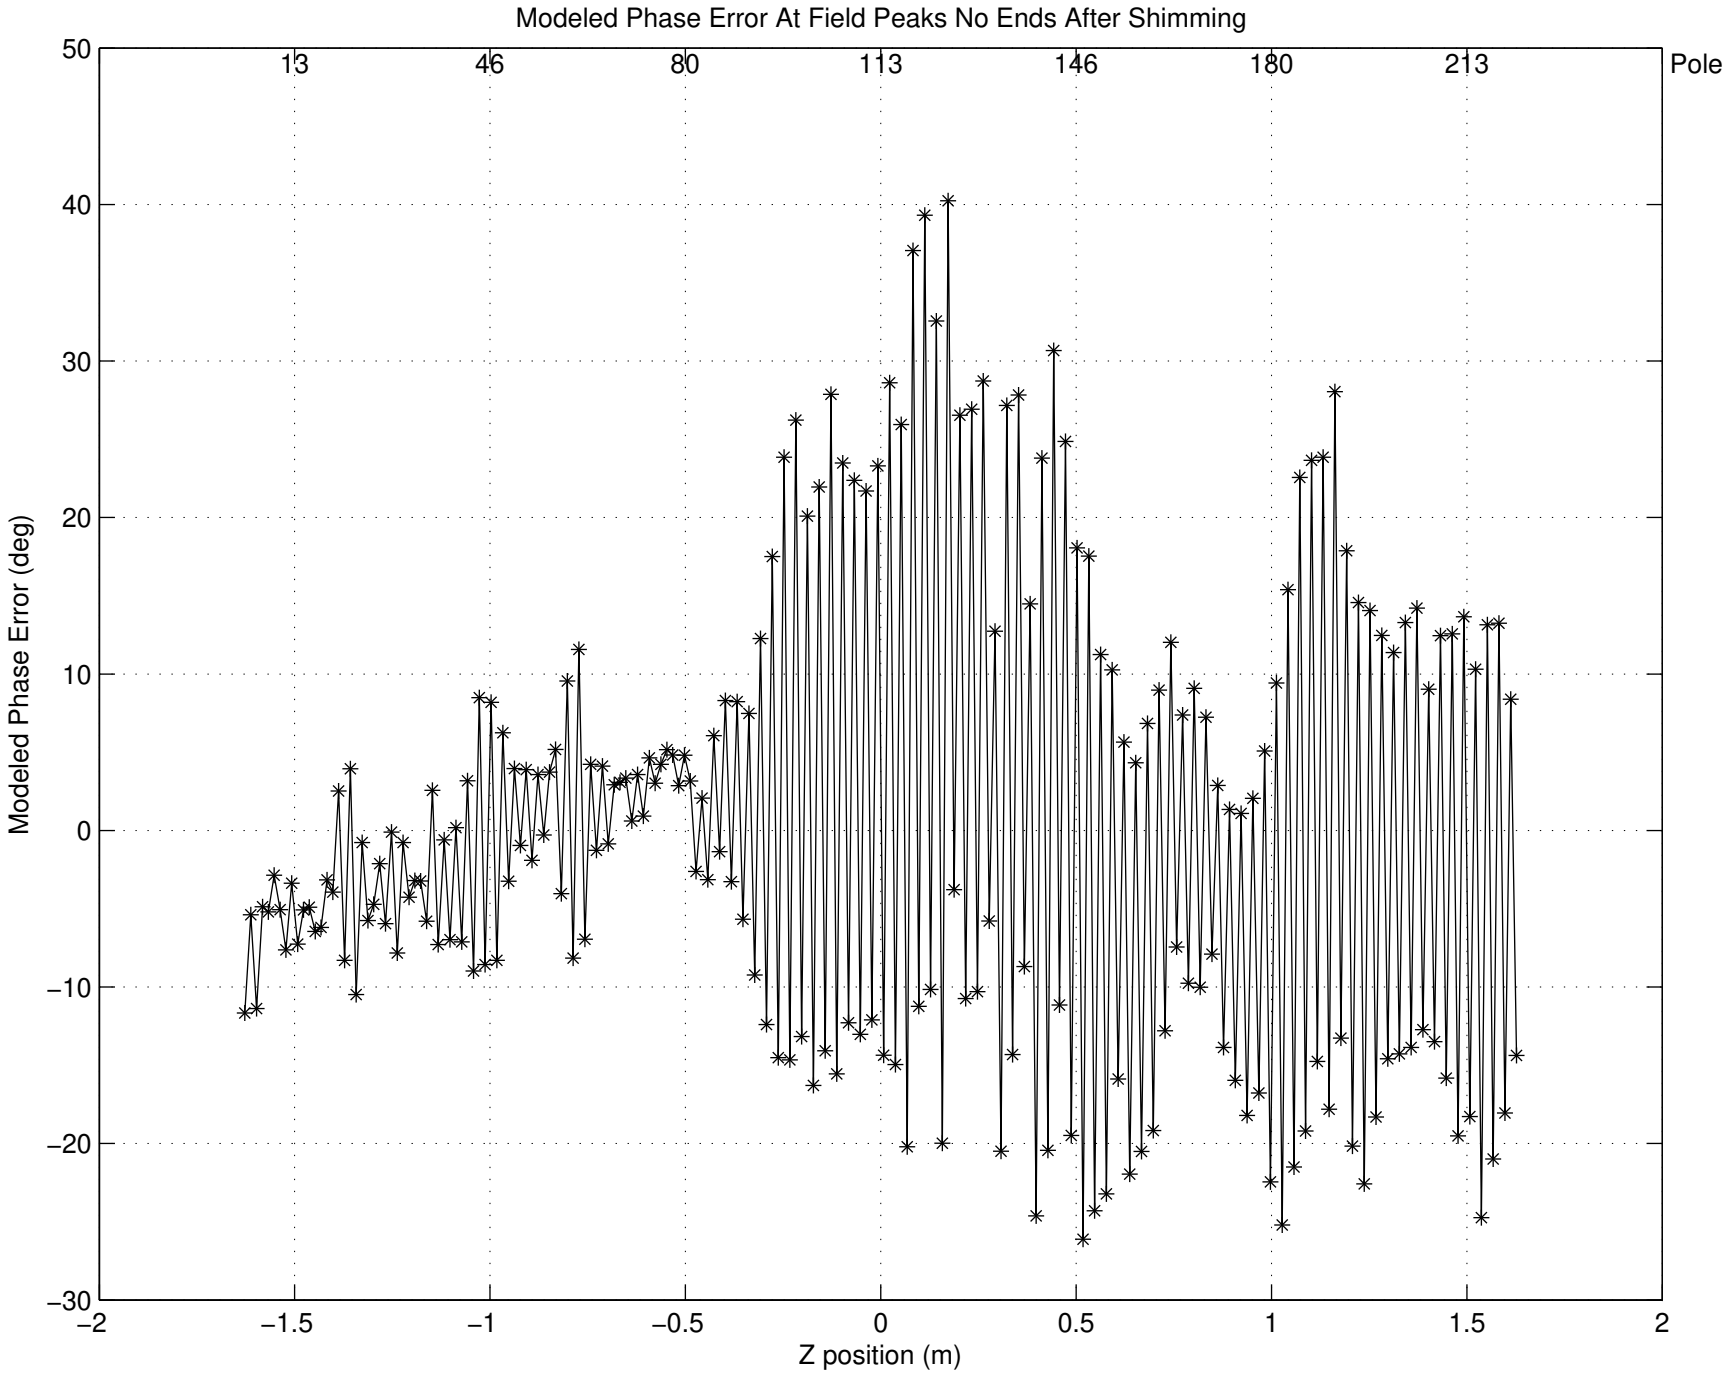

Phase Error: Ave = −0.000000 deg, RMS = 14.617713 deg