SLAC Magnetic Measurements

Planar Insertion Device Shim Analysis

Parameters:
INPUT−FILE−DIR =S:\MagData\LCLS\Undulator\L143−112000−17\DATASET0001\Rough Tuning\Z Scans\Run 011\
INPUT−FILE−NAME =bscanz−dat.001
INPUT−FILE−TYPE =SLAC−VXVYBXBYVSZ
CORR−REQUIRED =0
CORR−FILE =c:\Insertion Device Analysis\Earth Field Correction\earth−field−corr.dat
CORR−FILE−TYPE =CORR−BXBYVSZ
GAMMA =26692.7
NOM−LAMBDA−U =0.03
NOM−K−VALUE =3.5
NOM−LAMBDA−R =1.5e−010
NUM−POLES =226
NUM−END−POLES =4
CELL−LENGTH =3.656

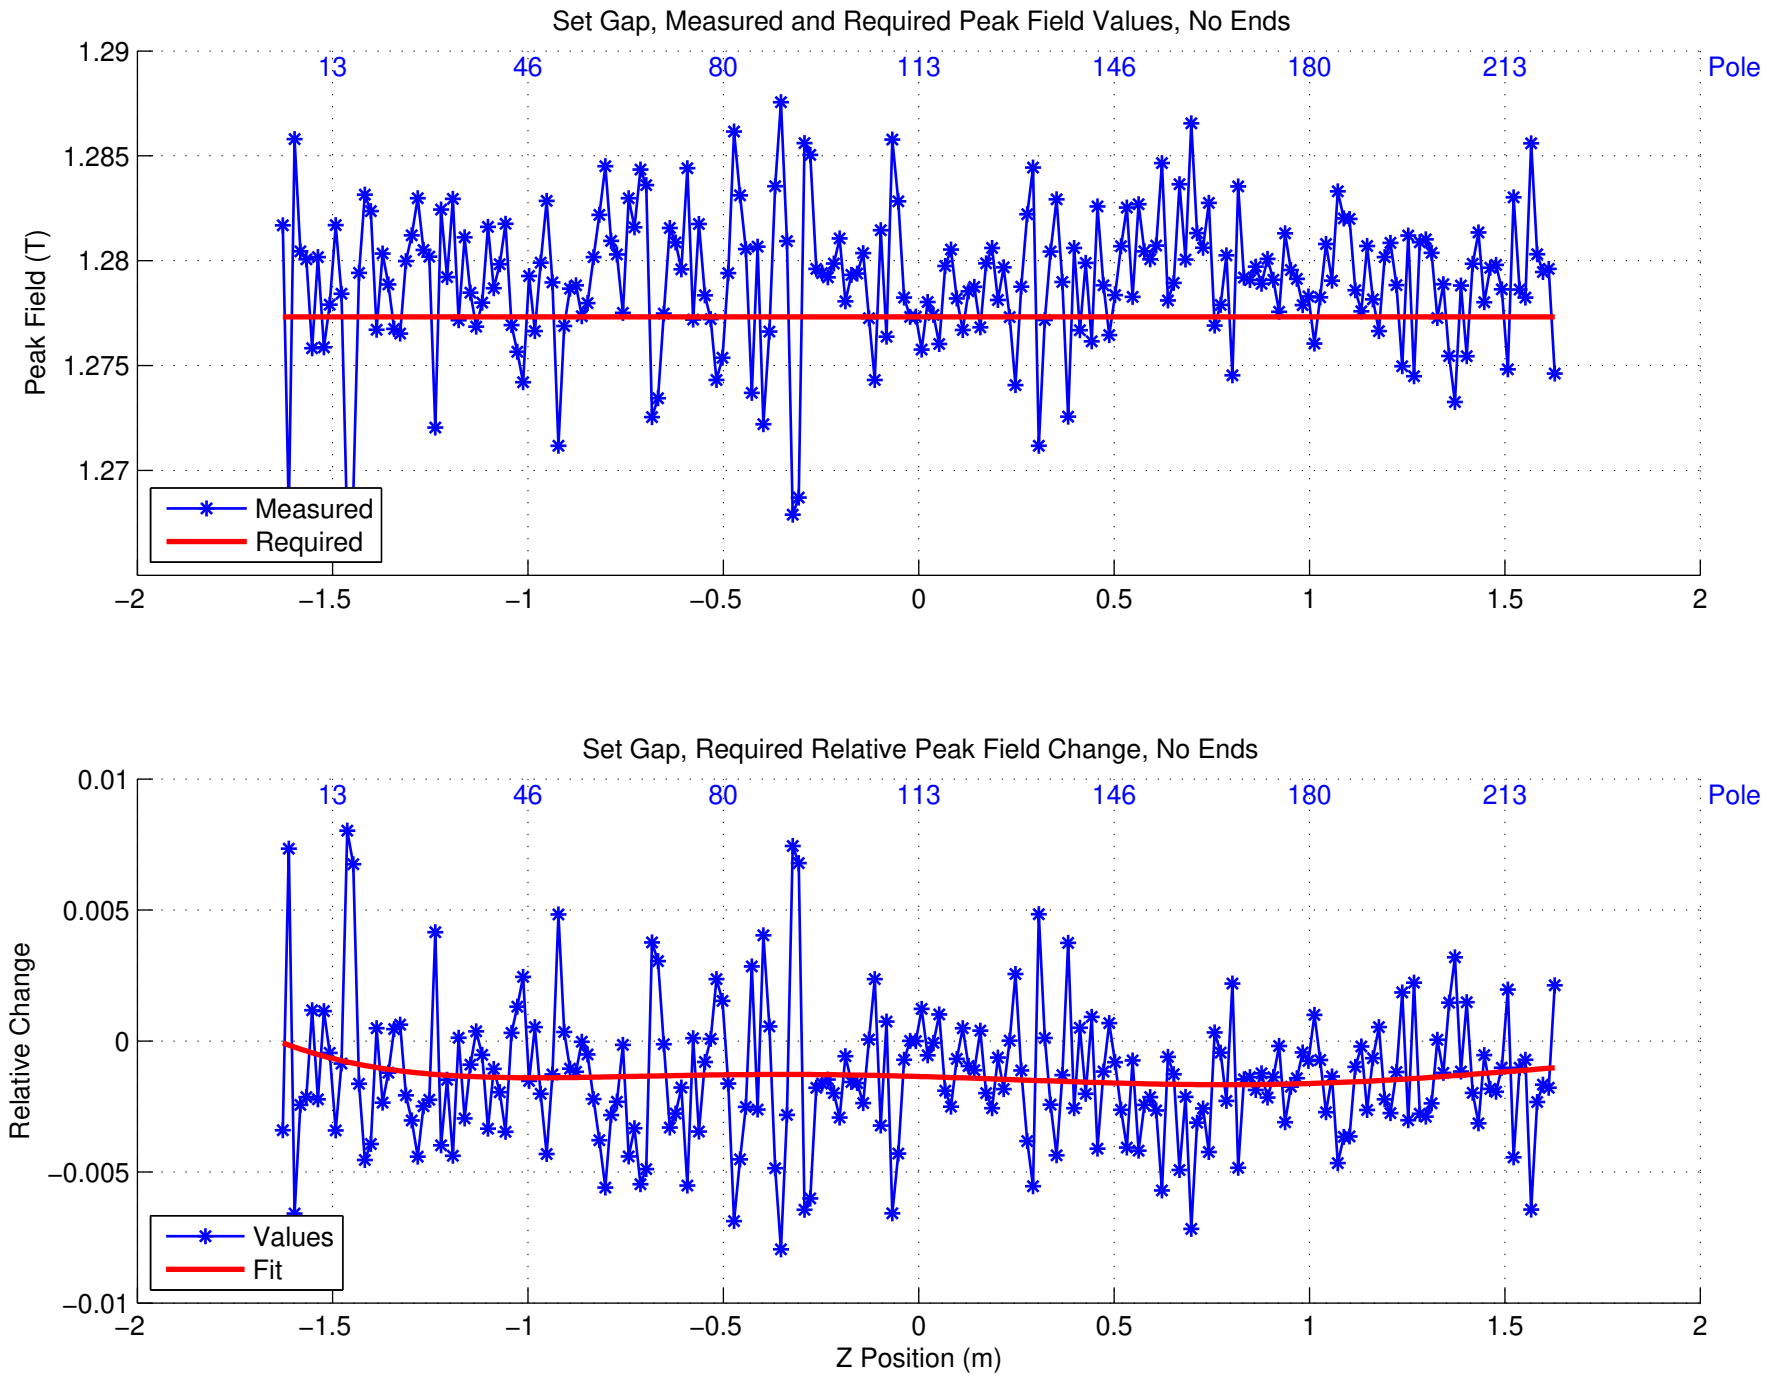
Set Gap, Measured and Required Peak Field Values, No Ends
Peak Field (T)
1.29
1.285
1.28
1.275
1.27
13
46
80
113
146
180
213
Pole
Measured
Required
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Set Gap, Required Relative Peak Field Change, No Ends
Relative Change
0.01
0.005
0
−0.005
−0.01
Values
Fit
Z Position (m)

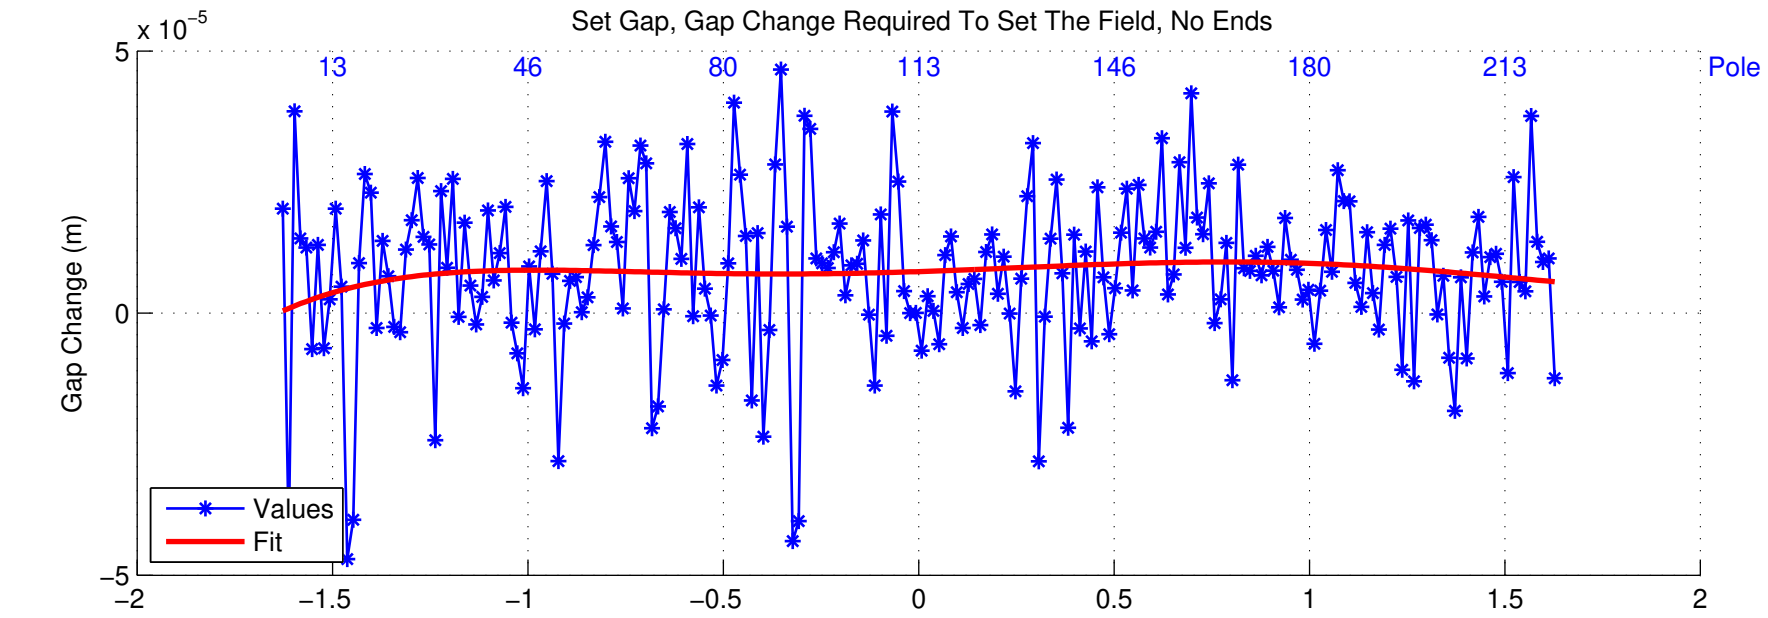
Set Gap, Gap Change Required To Set The Field, No Ends
x 10^-5
Gap Change (m)
5
0
−5
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Values
Fit

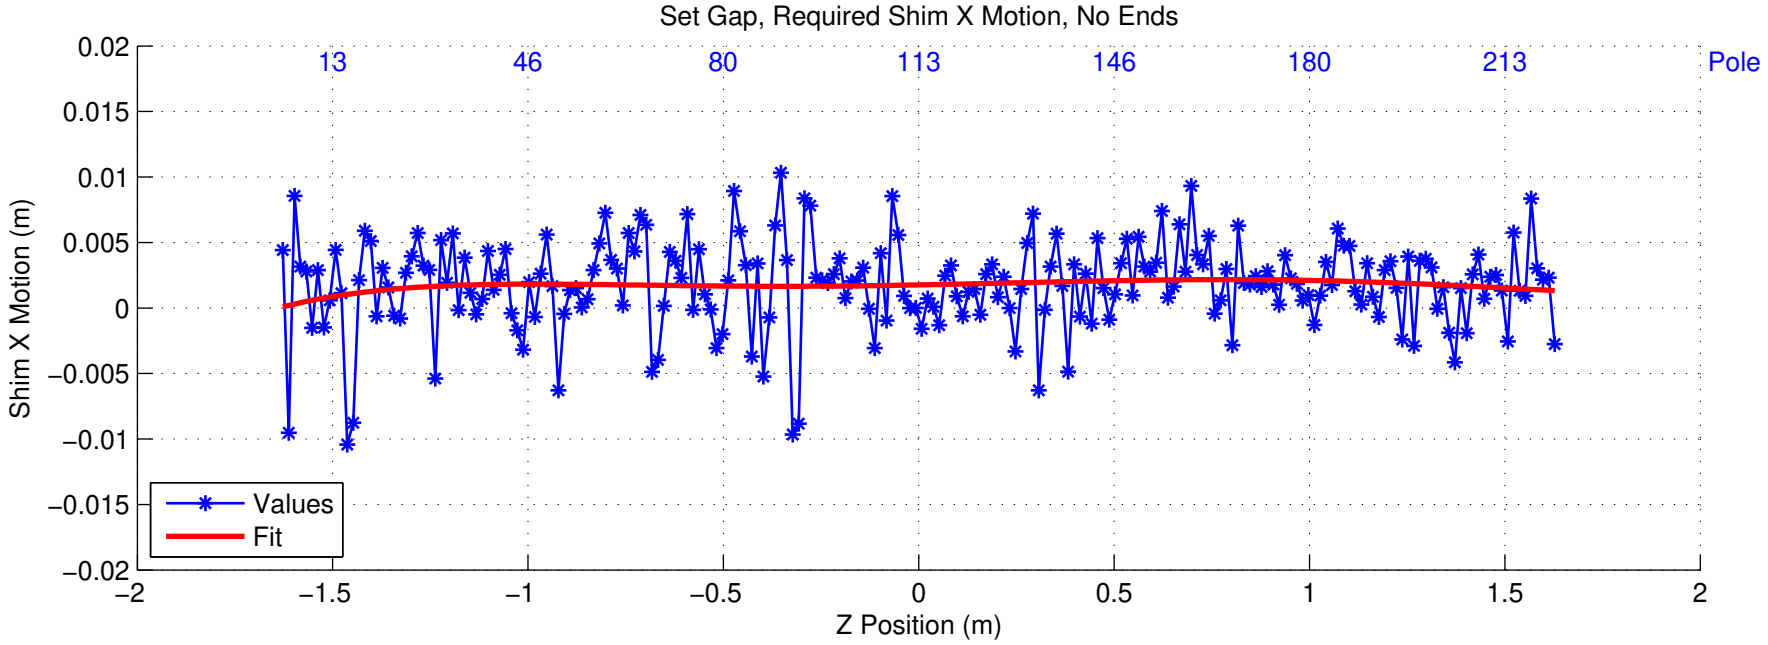
Set Gap, Required Shim X Motion, No Ends
Shim X Motion (m)
0.02
0.015
0.01
0.005
0
−0.005
−0.01
−0.015
−0.02
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Values
Fit

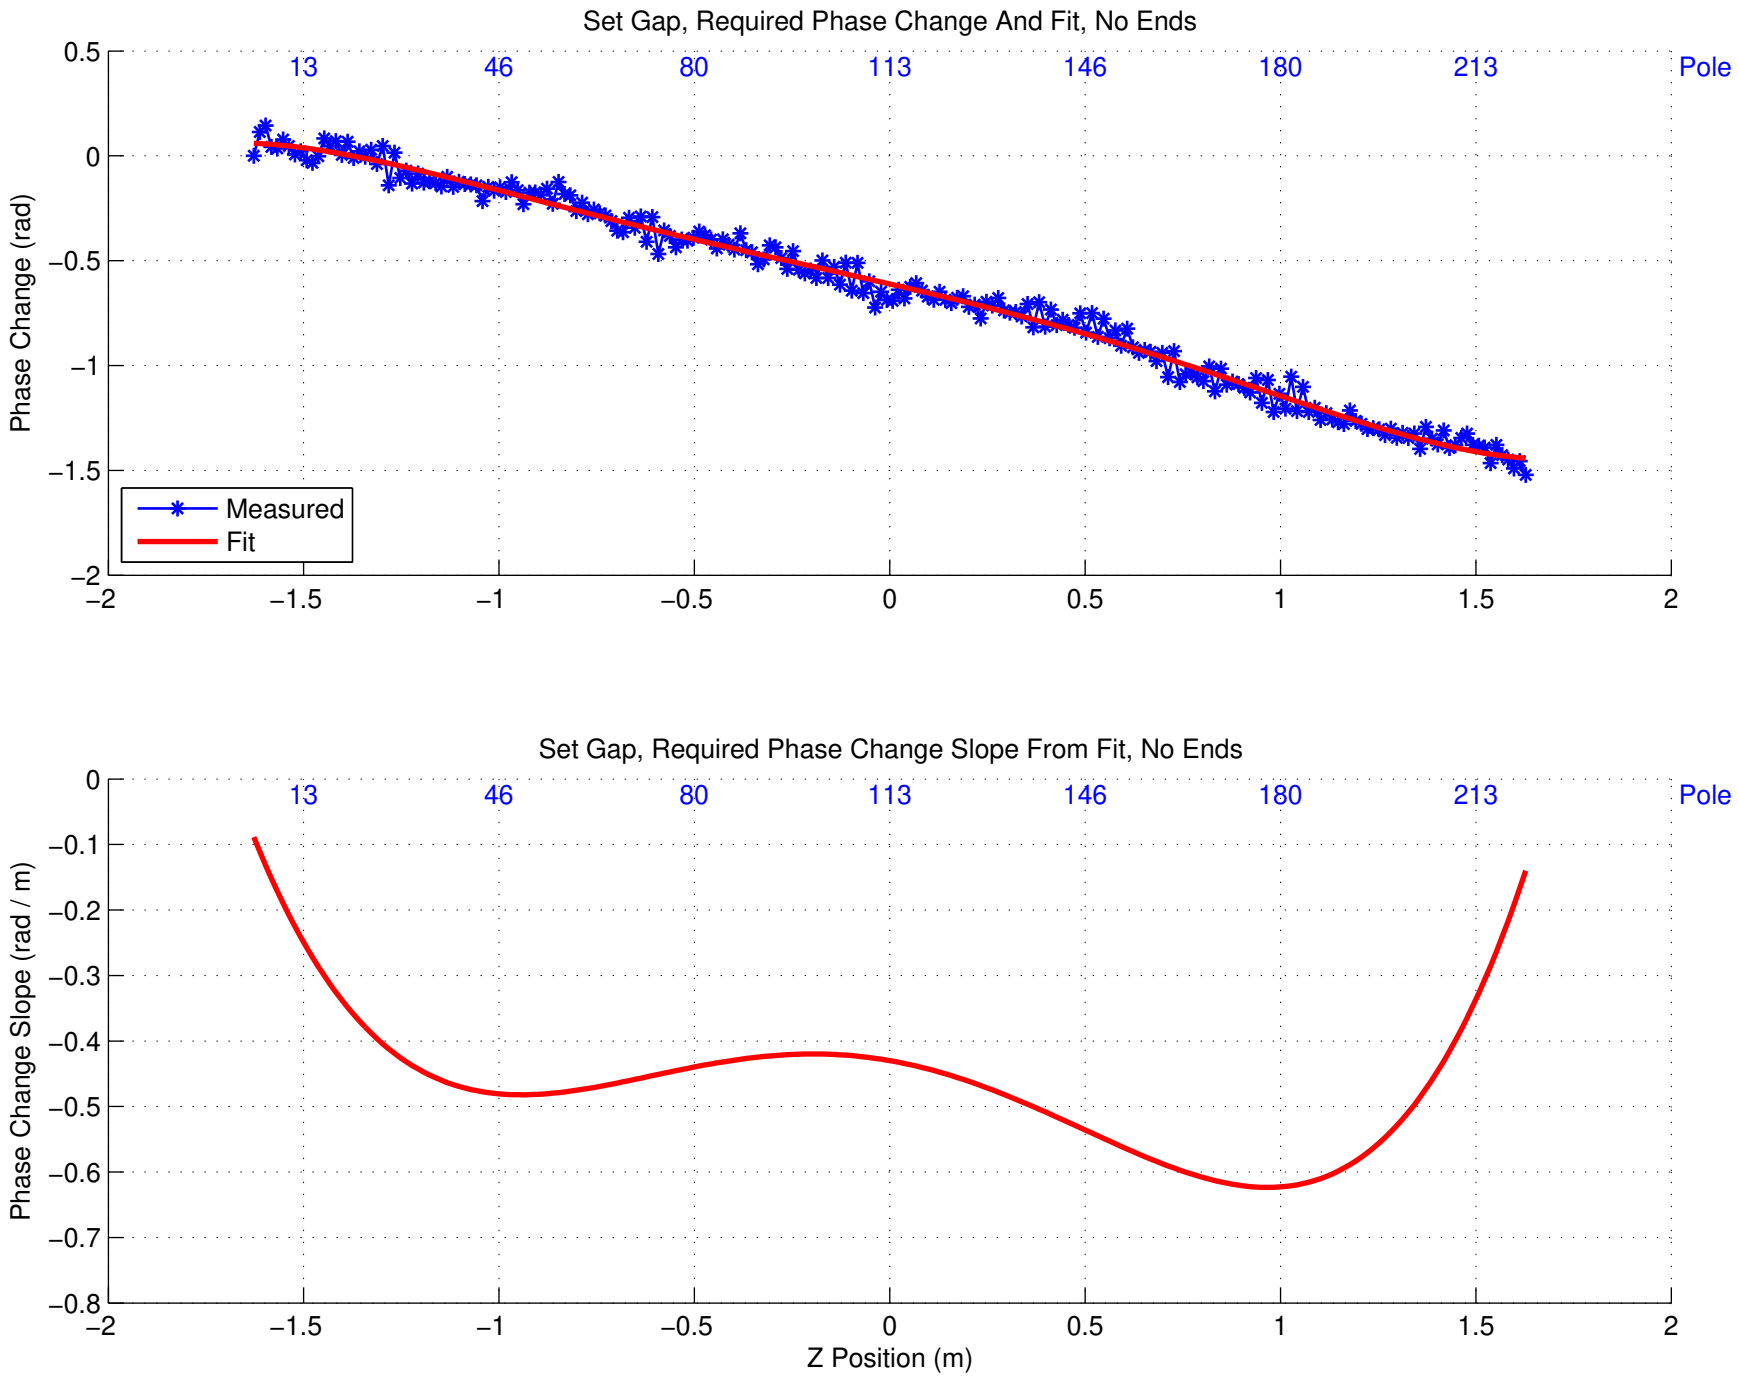
Set Gap, Required Phase Change And Fit, No Ends
13
46
80
113
146
180
213
Pole
Phase Change (rad)
0.5
0
−0.5
−1
−1.5
−2
Measured
Fit
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Set Gap, Required Phase Change Slope From Fit, No Ends
Phase Change Slope (rad / m)
0
−0.1
−0.2
−0.3
−0.4
−0.5
−0.6
−0.7
−0.8
Z Position (m)

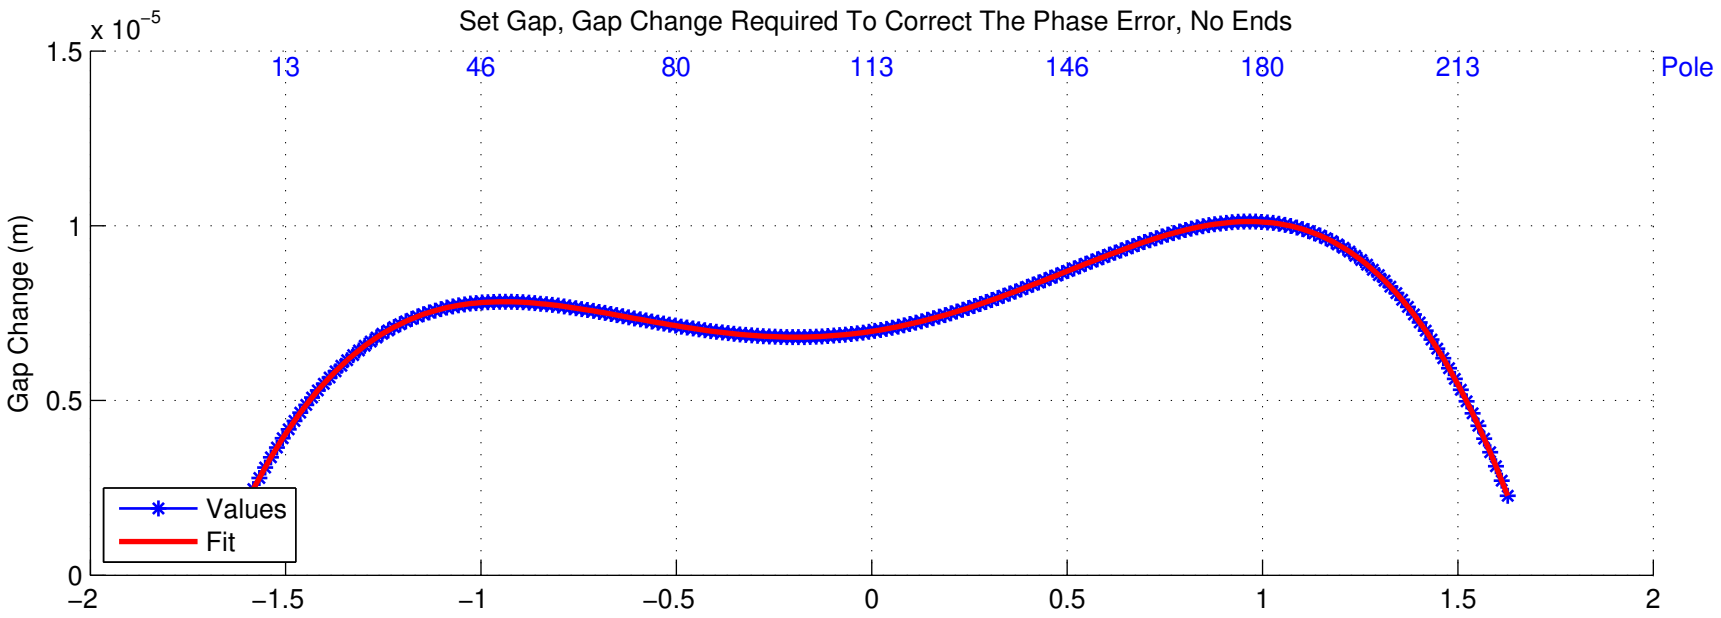
Set Gap, Gap Change Required To Correct The Phase Error, No Ends
x 10^-5
Gap Change (m)
13
46
80
113
146
180
213
Pole
Values
Fit

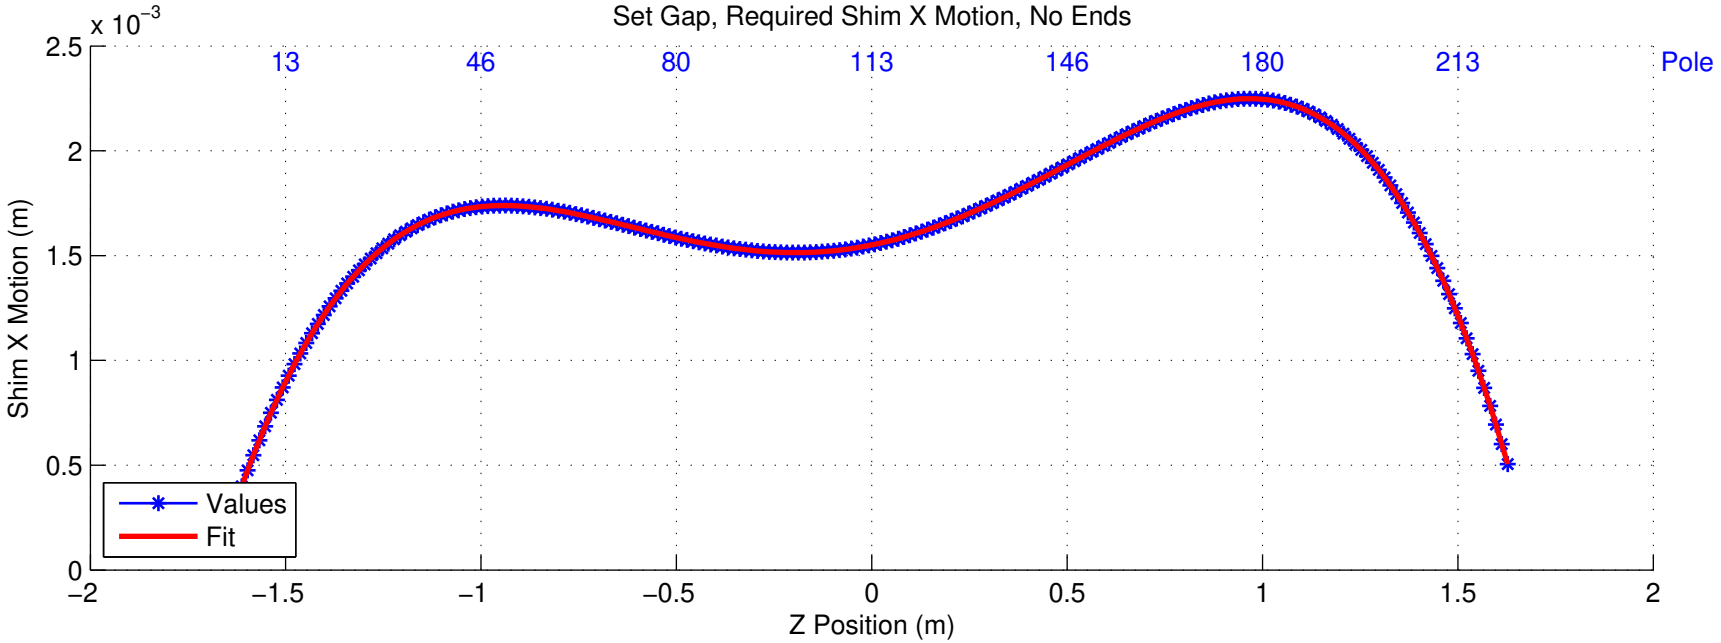
Set Gap, Required Shim X Motion, No Ends
x 10^-3
Shim X Motion (m)
13
46
80
113
146
180
213
Pole
Values
Fit
Z Position (m)

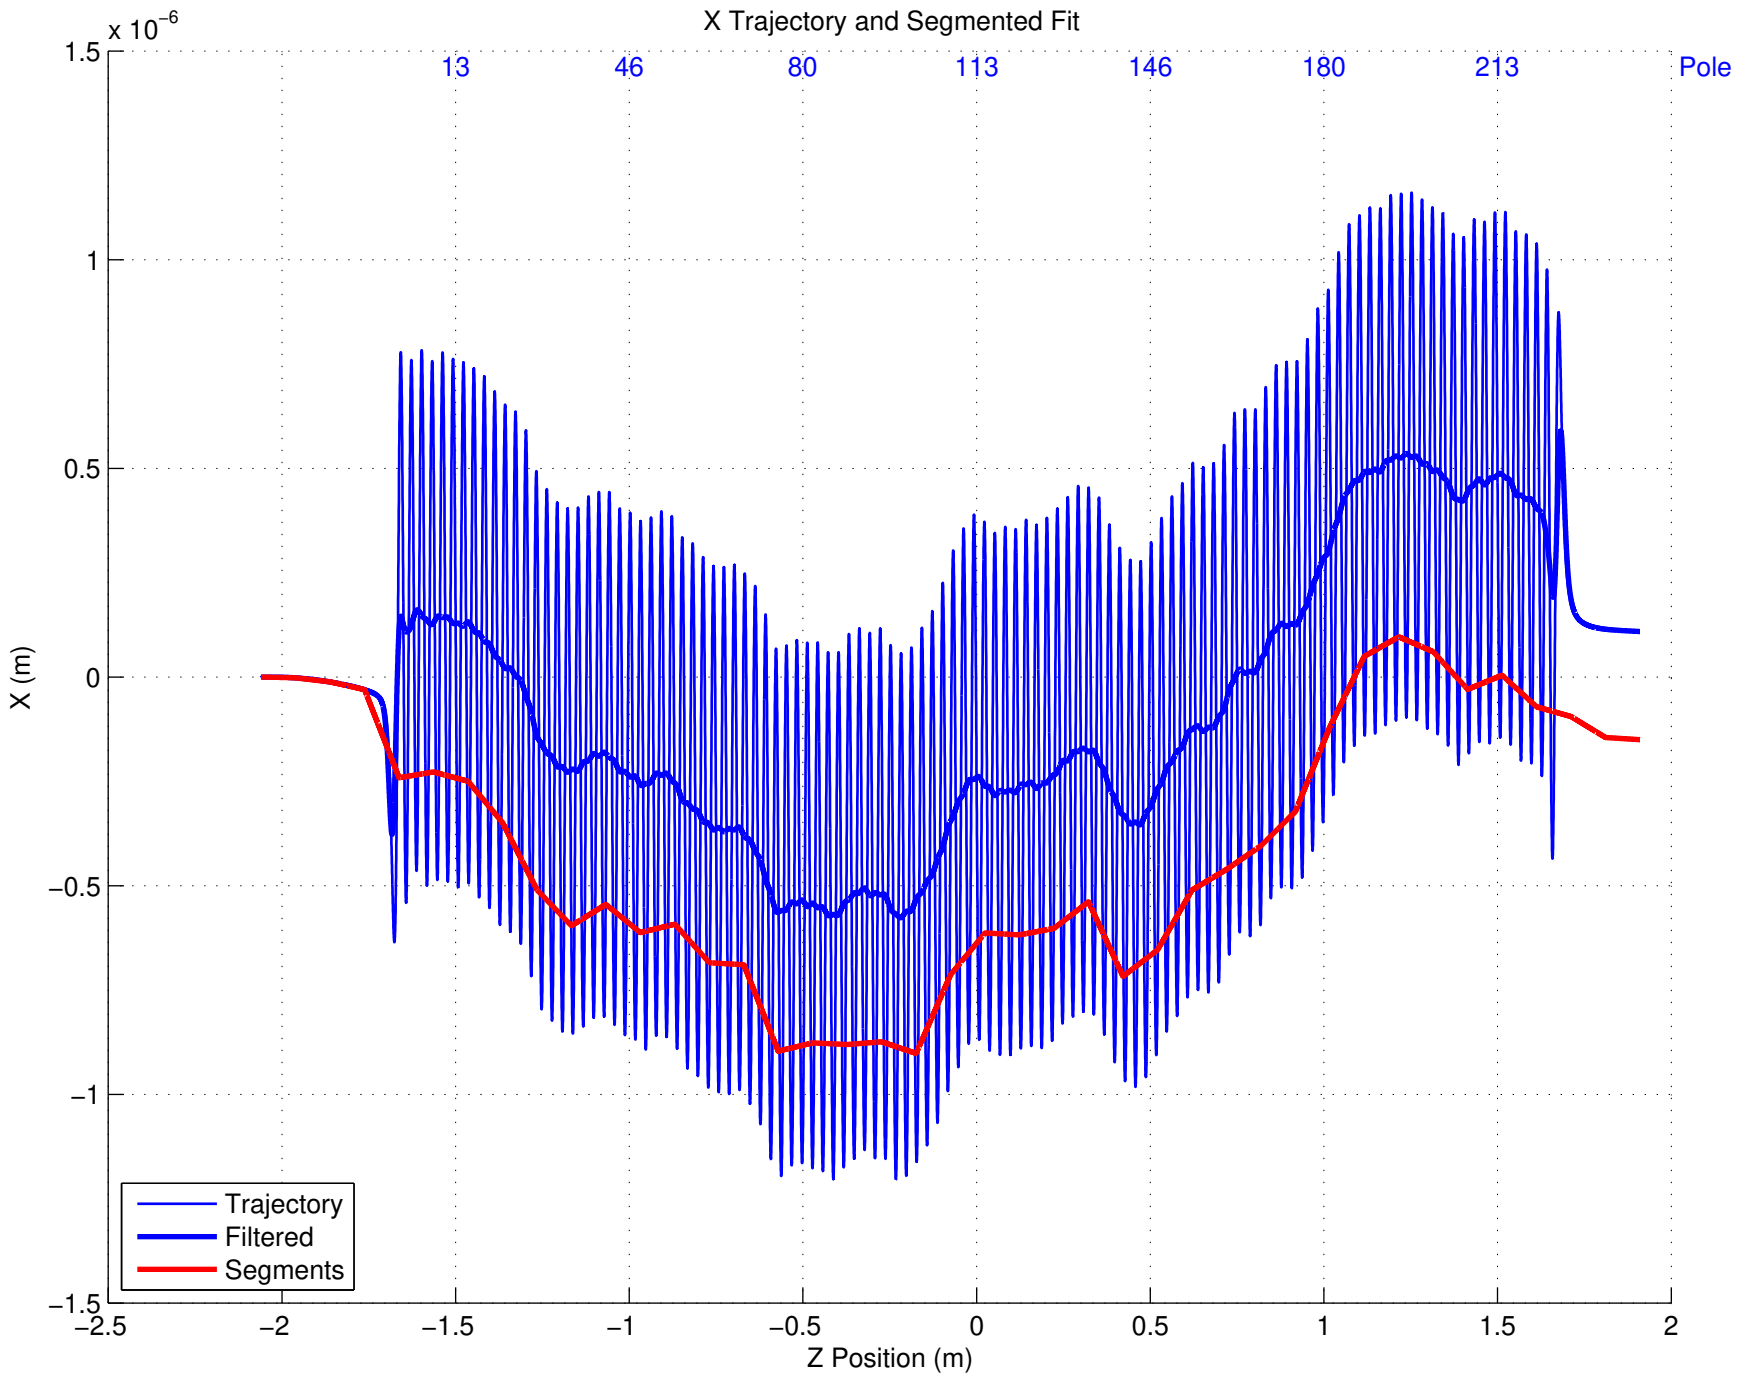
X Trajectory and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
1.5
1
0.5
0
−0.5
−1
−1.5
X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

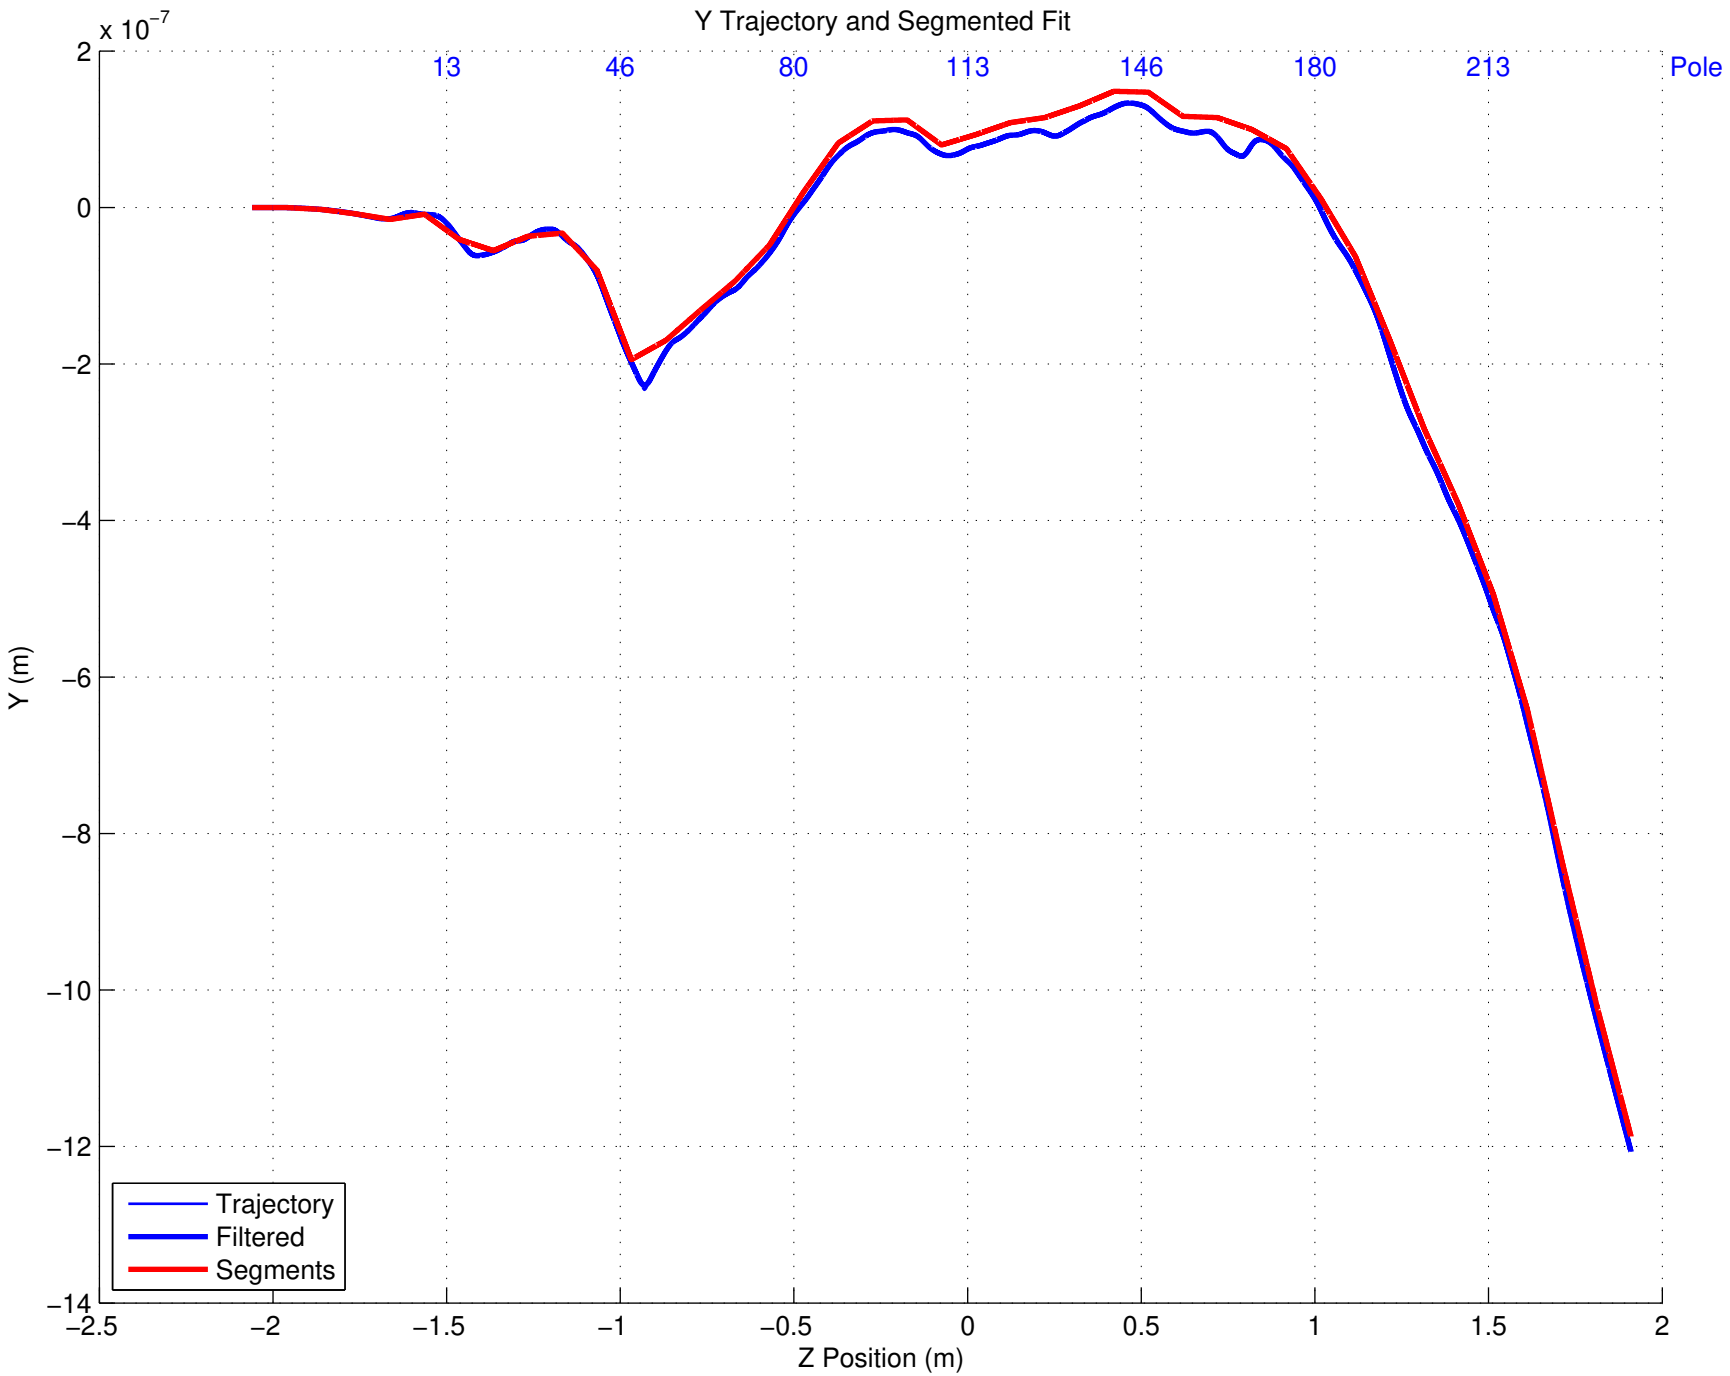
Y Trajectory and Segmented Fit
x 10^-7
13
46
80
113
146
180
213
Pole
2
0
−2
−4
−6
−8
−10
−12
−14
Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

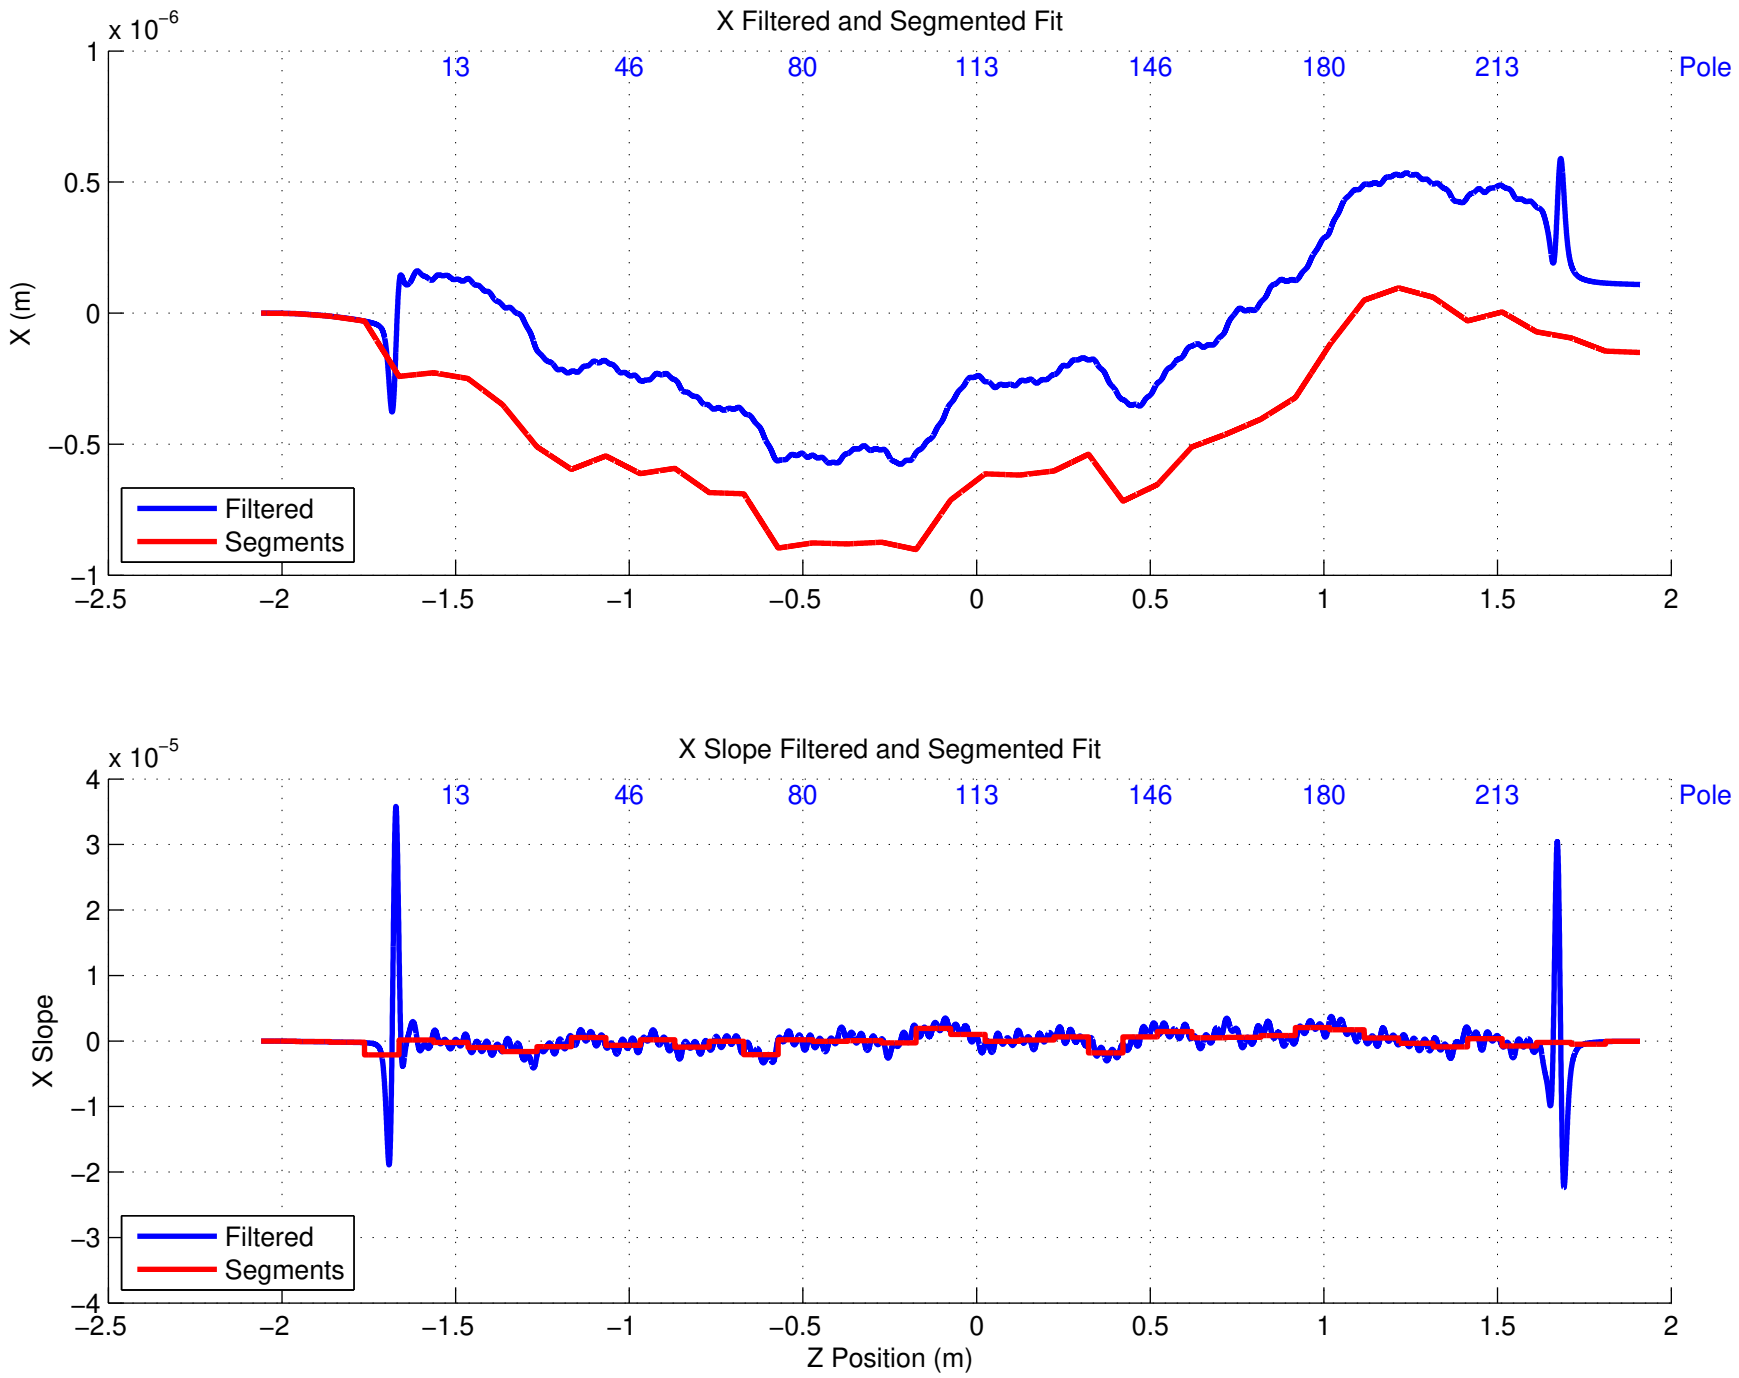
X Filtered and Segmented Fit
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
X Slope Filtered and Segmented Fit
x 10^-5
X Slope
Z Position (m)

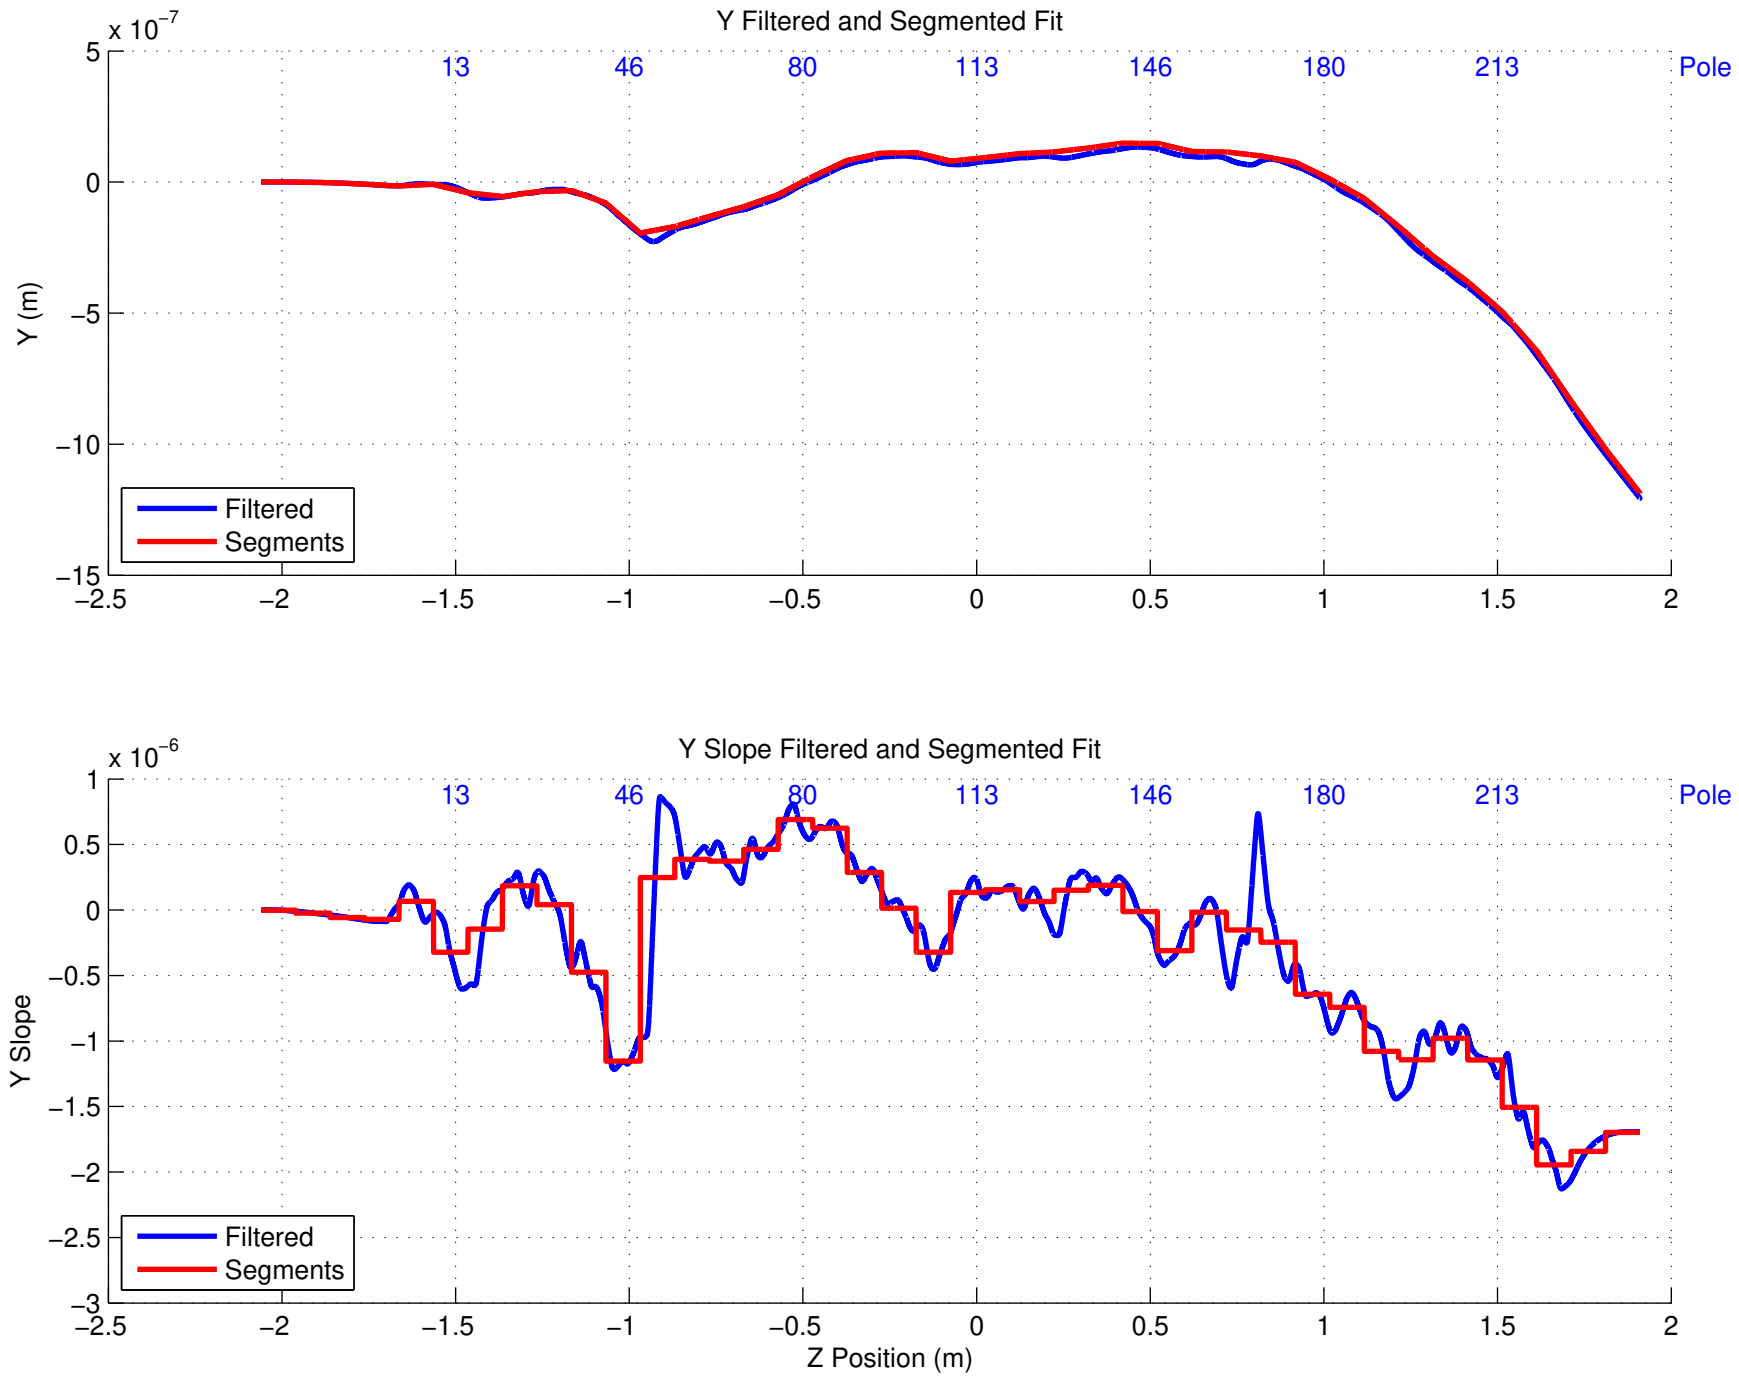
Y Filtered and Segmented Fit
x 10^-7
Y (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
Y Slope Filtered and Segmented Fit
x 10^-6
Y Slope
Z Position (m)

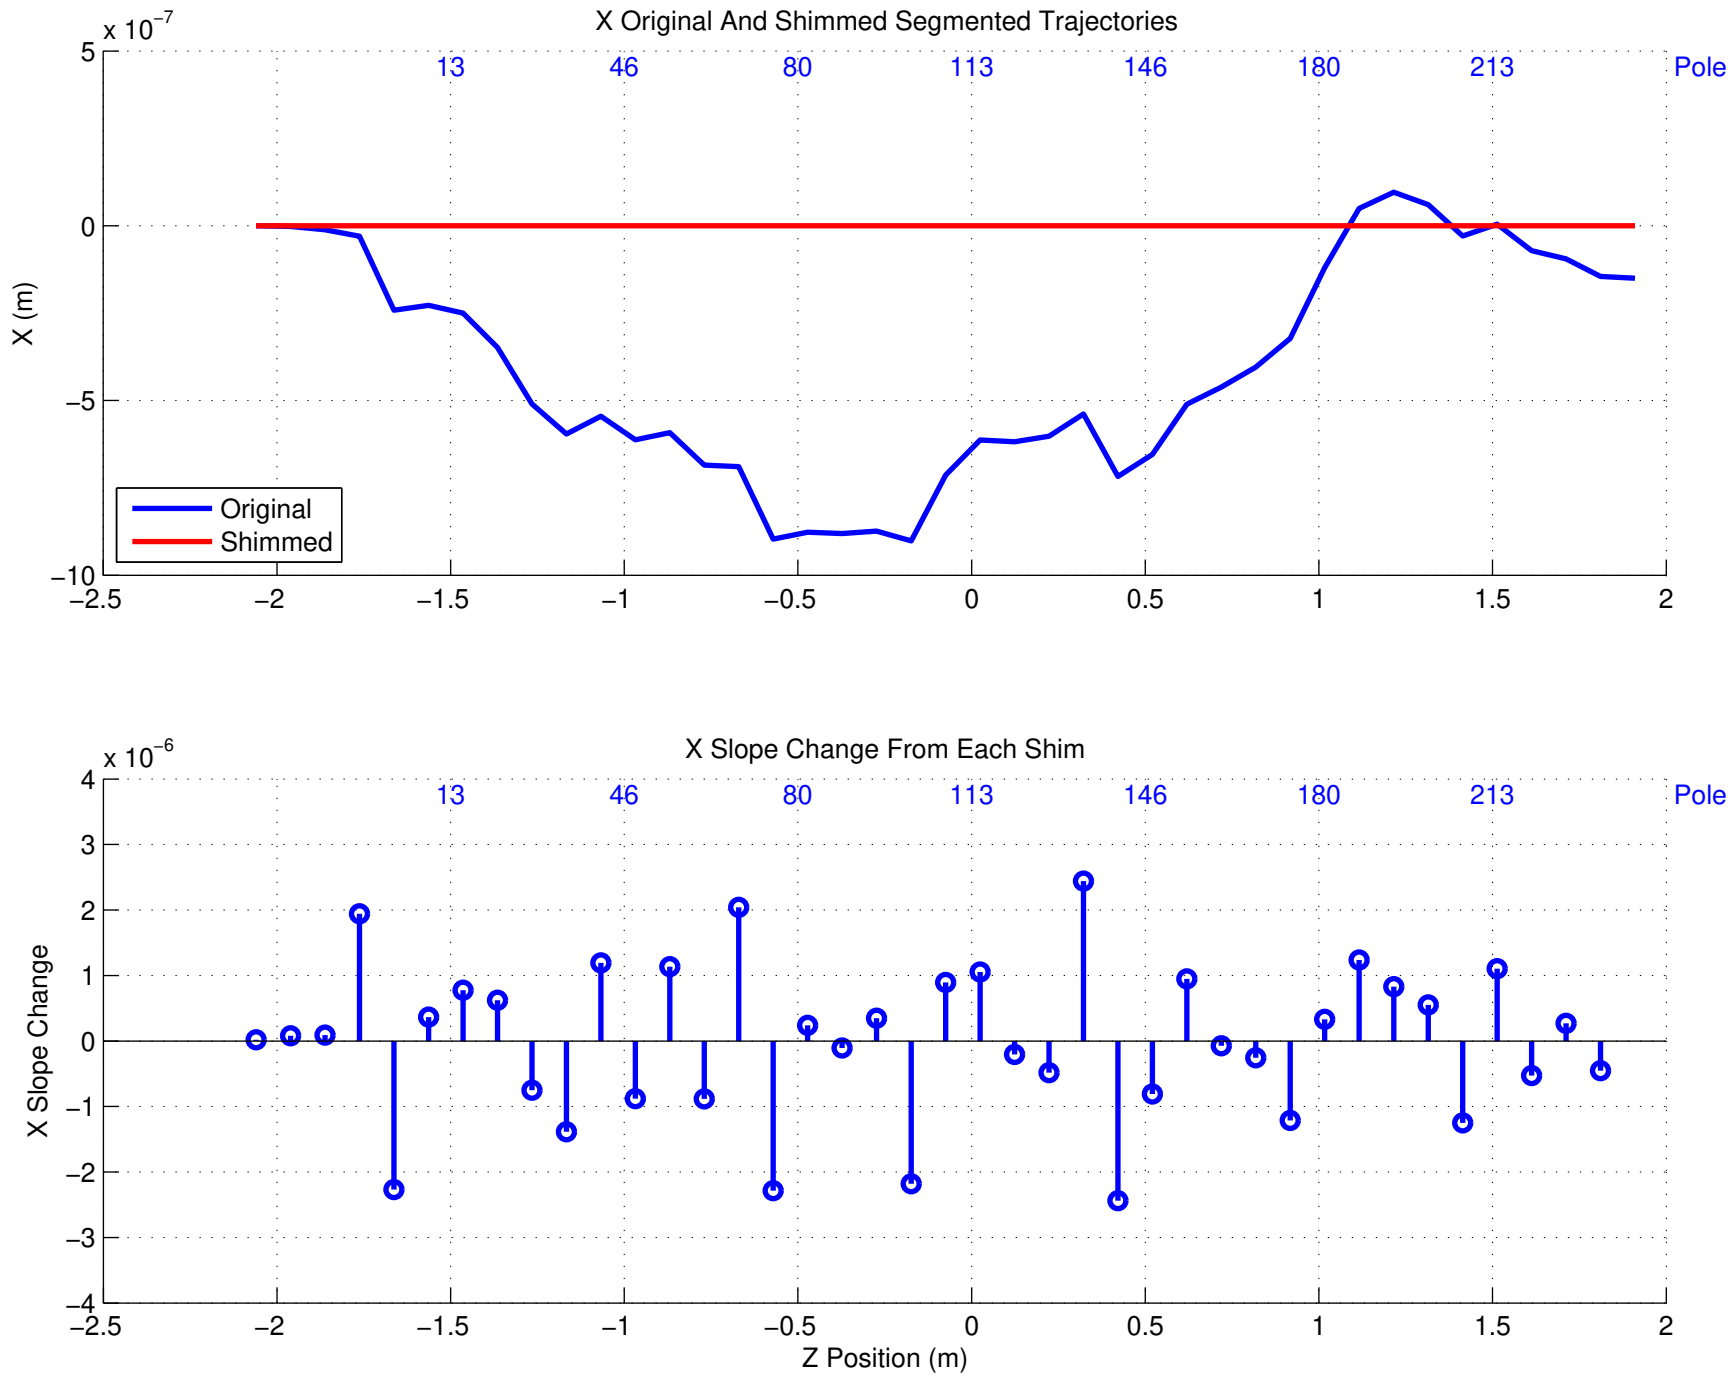
X Original And Shimmed Segmented Trajectories
x 10^-7
5
0
−5
−10
X (m)
13
46
80
113
146
180
213
Pole
Original
Shimmed
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
X Slope Change From Each Shim
x 10^-6
4
3
2
1
0
−1
−2
−3
−4
X Slope Change
Z Position (m)

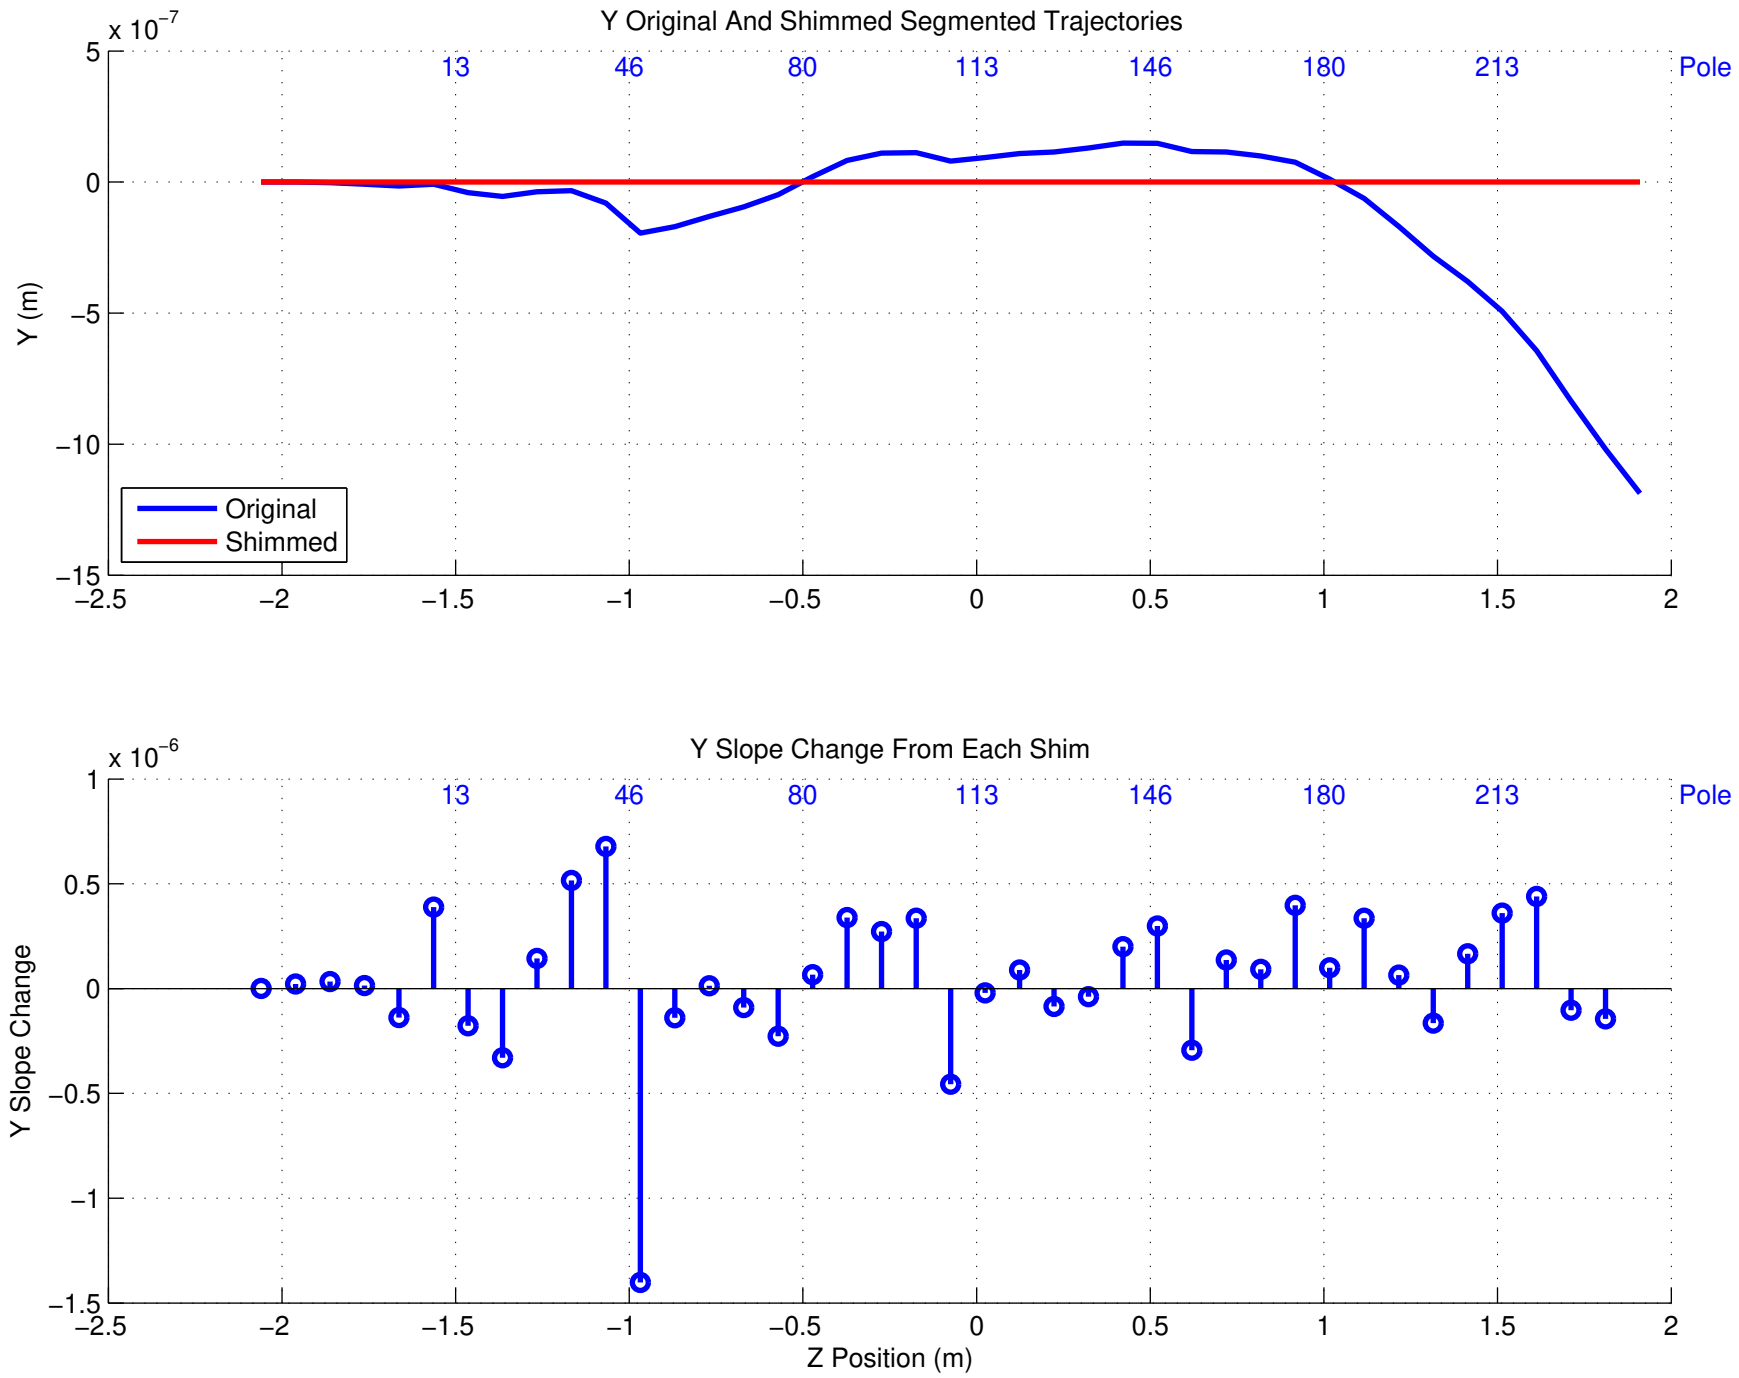
Y Original And Shimmed Segmented Trajectories
x 10^-7
5
0
−5
−10
−15
Y (m)
13
46
80
113
146
180
213
Pole
Original
Shimmed
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Y Slope Change From Each Shim
x 10^-6
1
0.5
0
−0.5
−1
−1.5
Y Slope Change
Z Position (m)

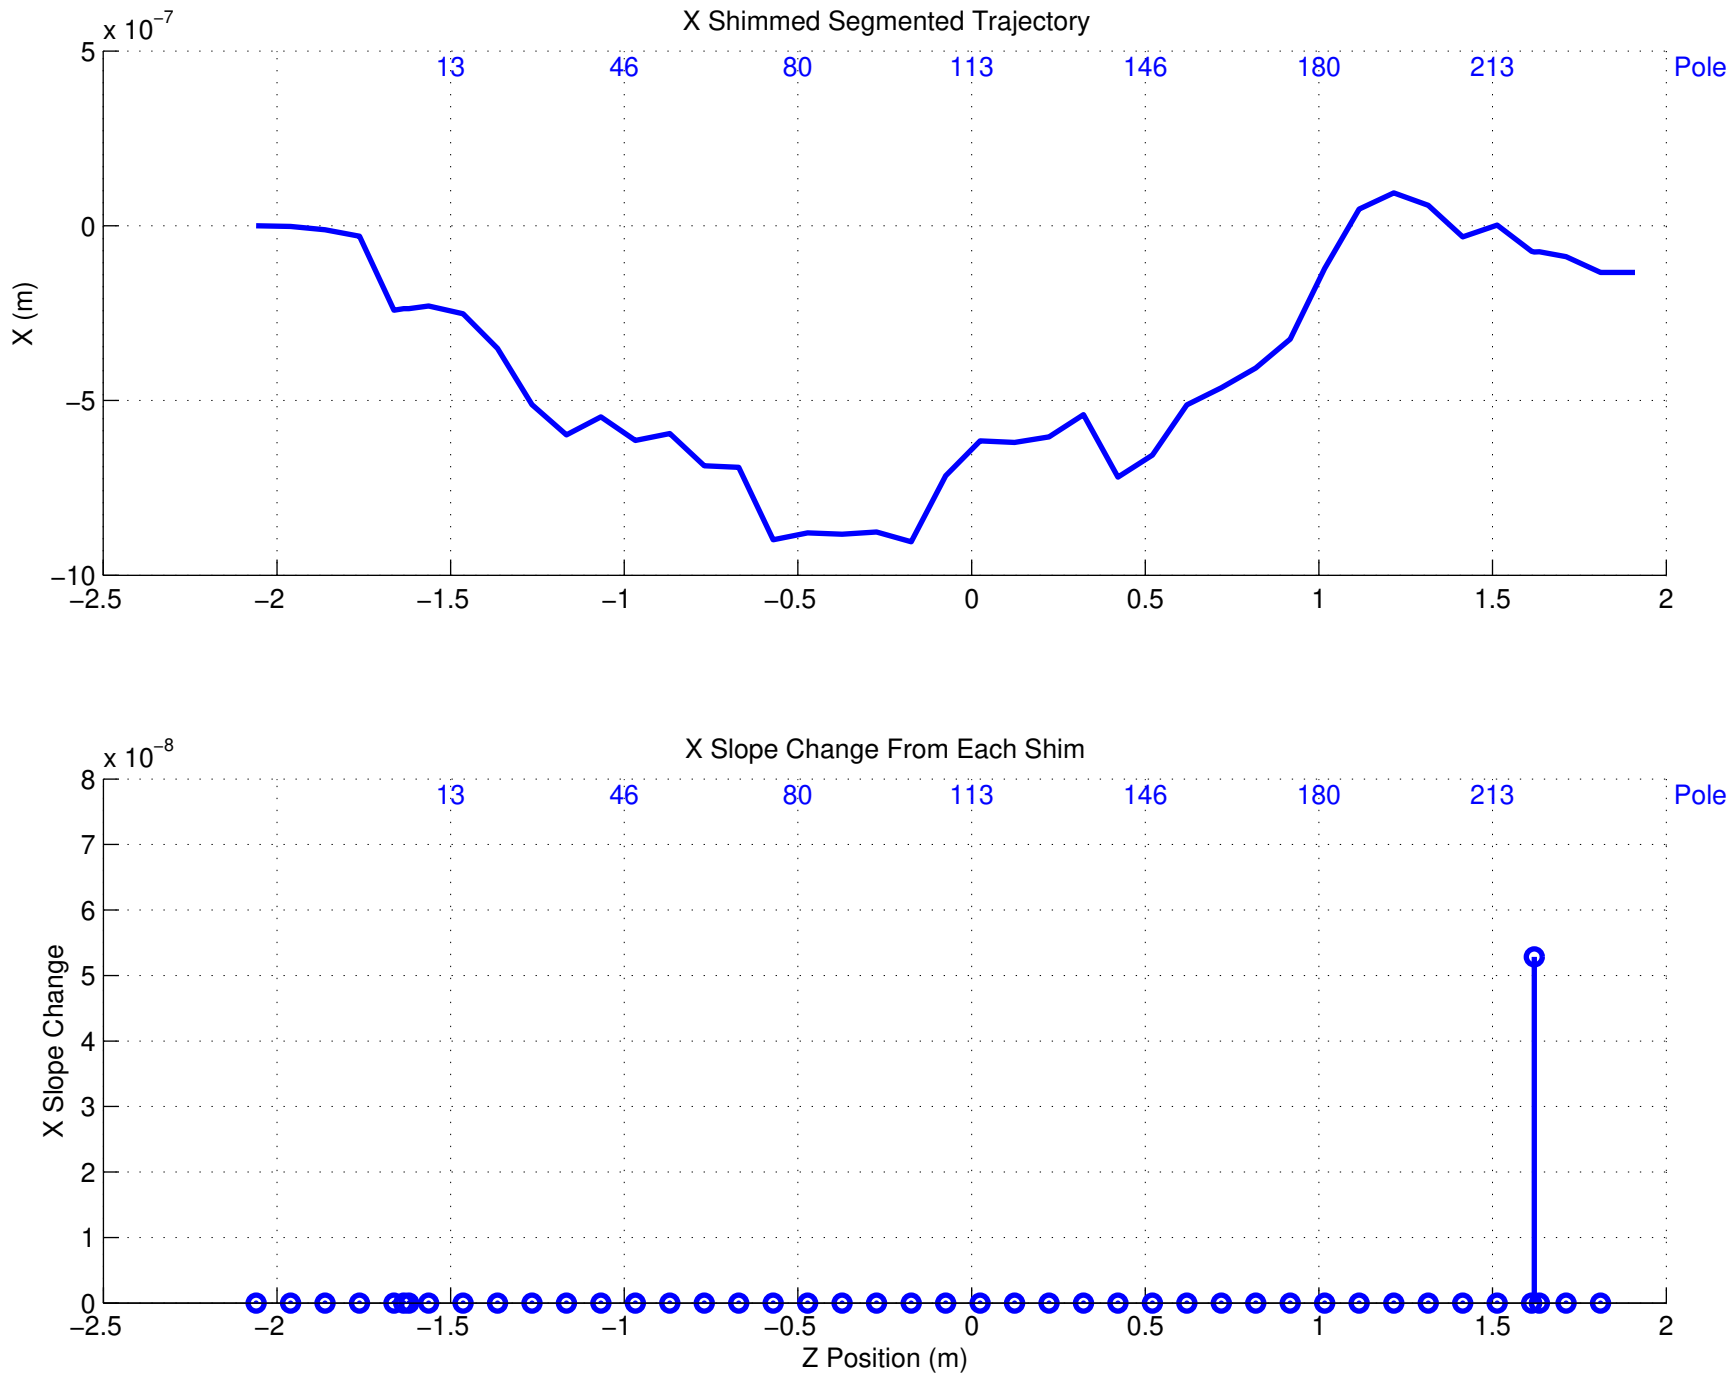
X Shimmed Segmented Trajectory
x 10^-7
X (m)
13
46
80
113
146
180
213
Pole
5
0
−5
−10
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
X Slope Change From Each Shim
x 10^-8
X Slope Change
8
7
6
5
4
3
2
1
0
Z Position (m)

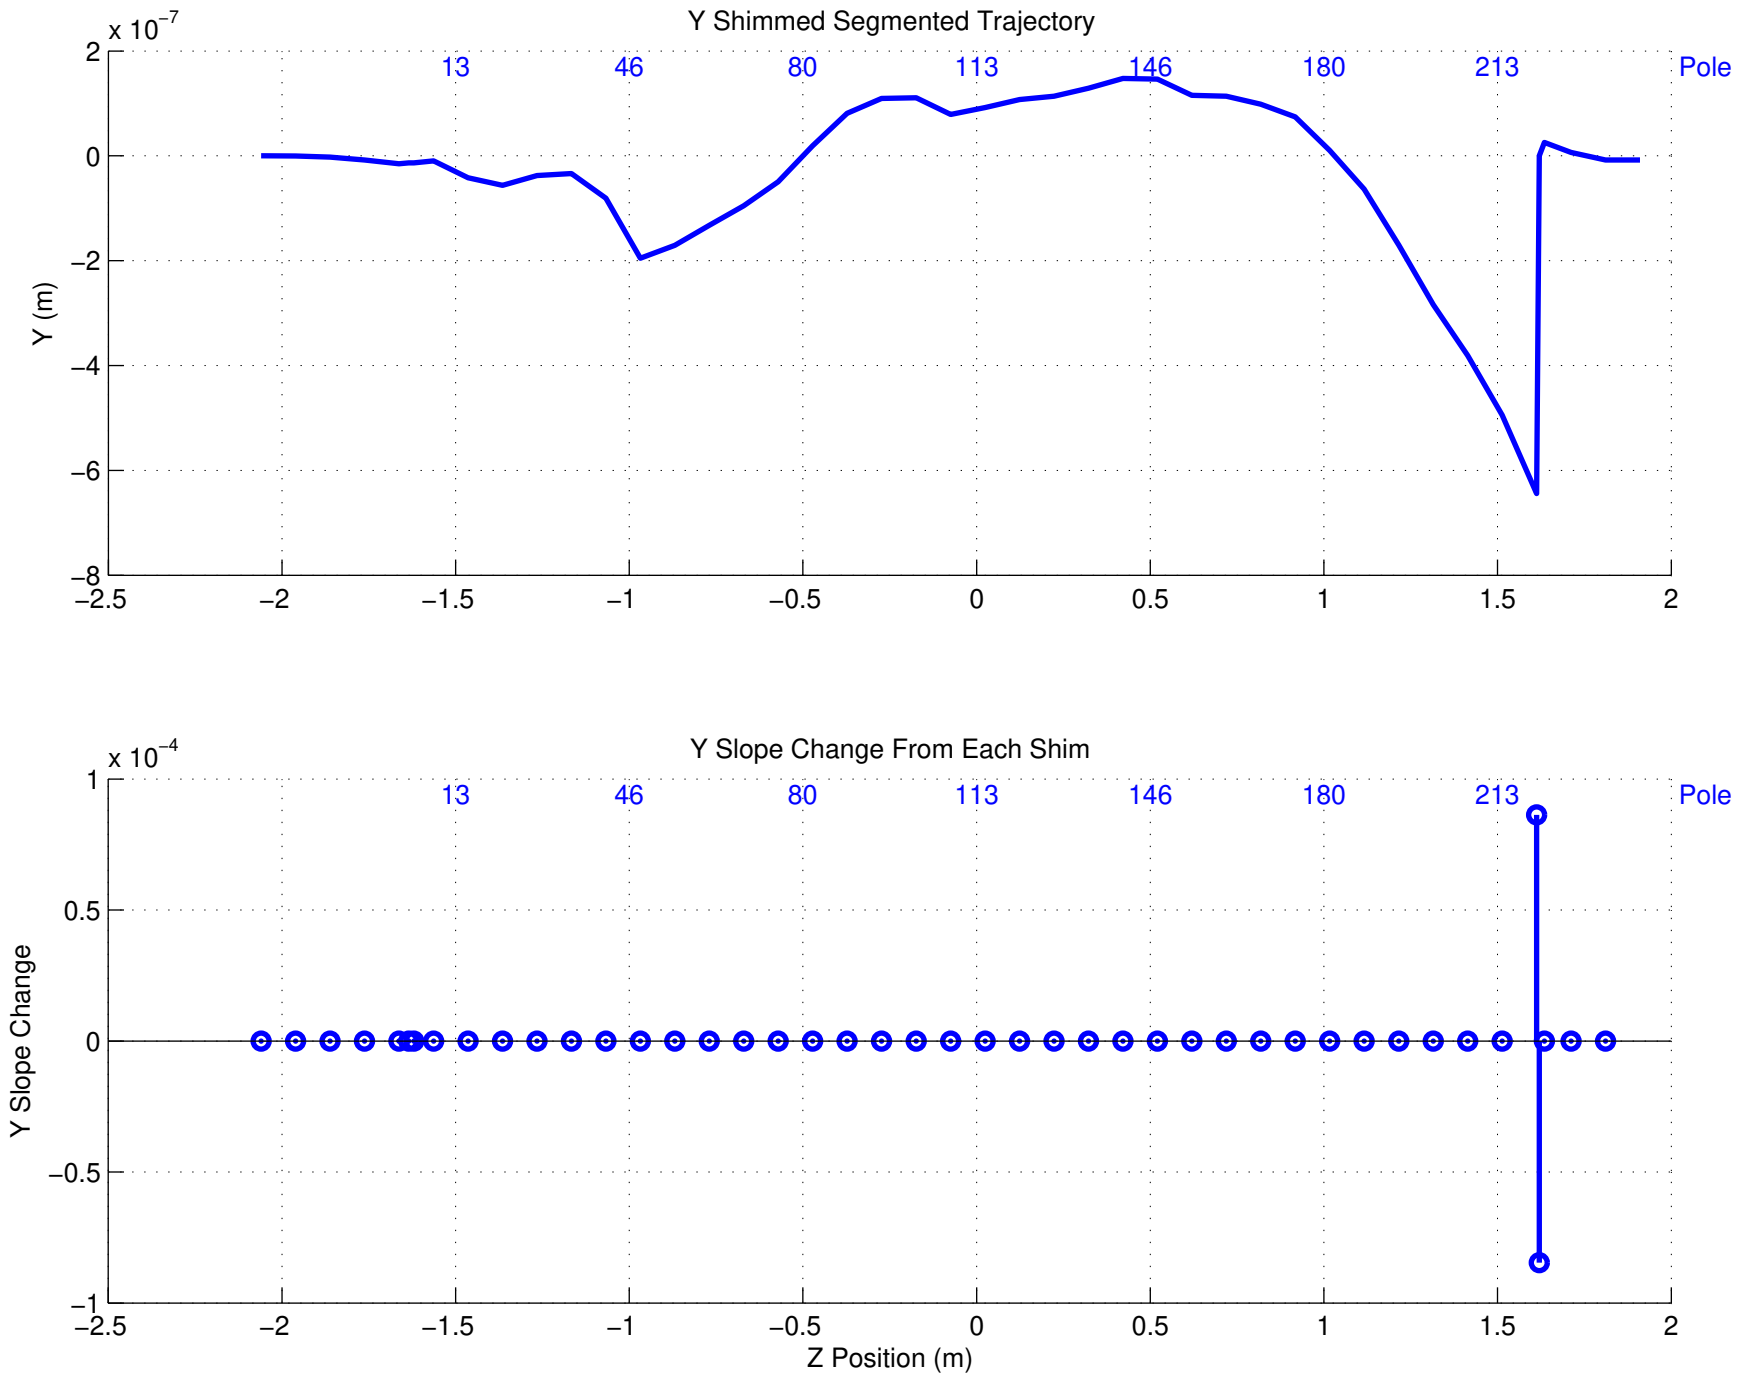
Y Shimmed Segmented Trajectory
x 10^-7
Y (m)
13
46
80
113
146
180
213
Pole
Y Slope Change From Each Shim
x 10^-4
Y Slope Change
Z Position (m)

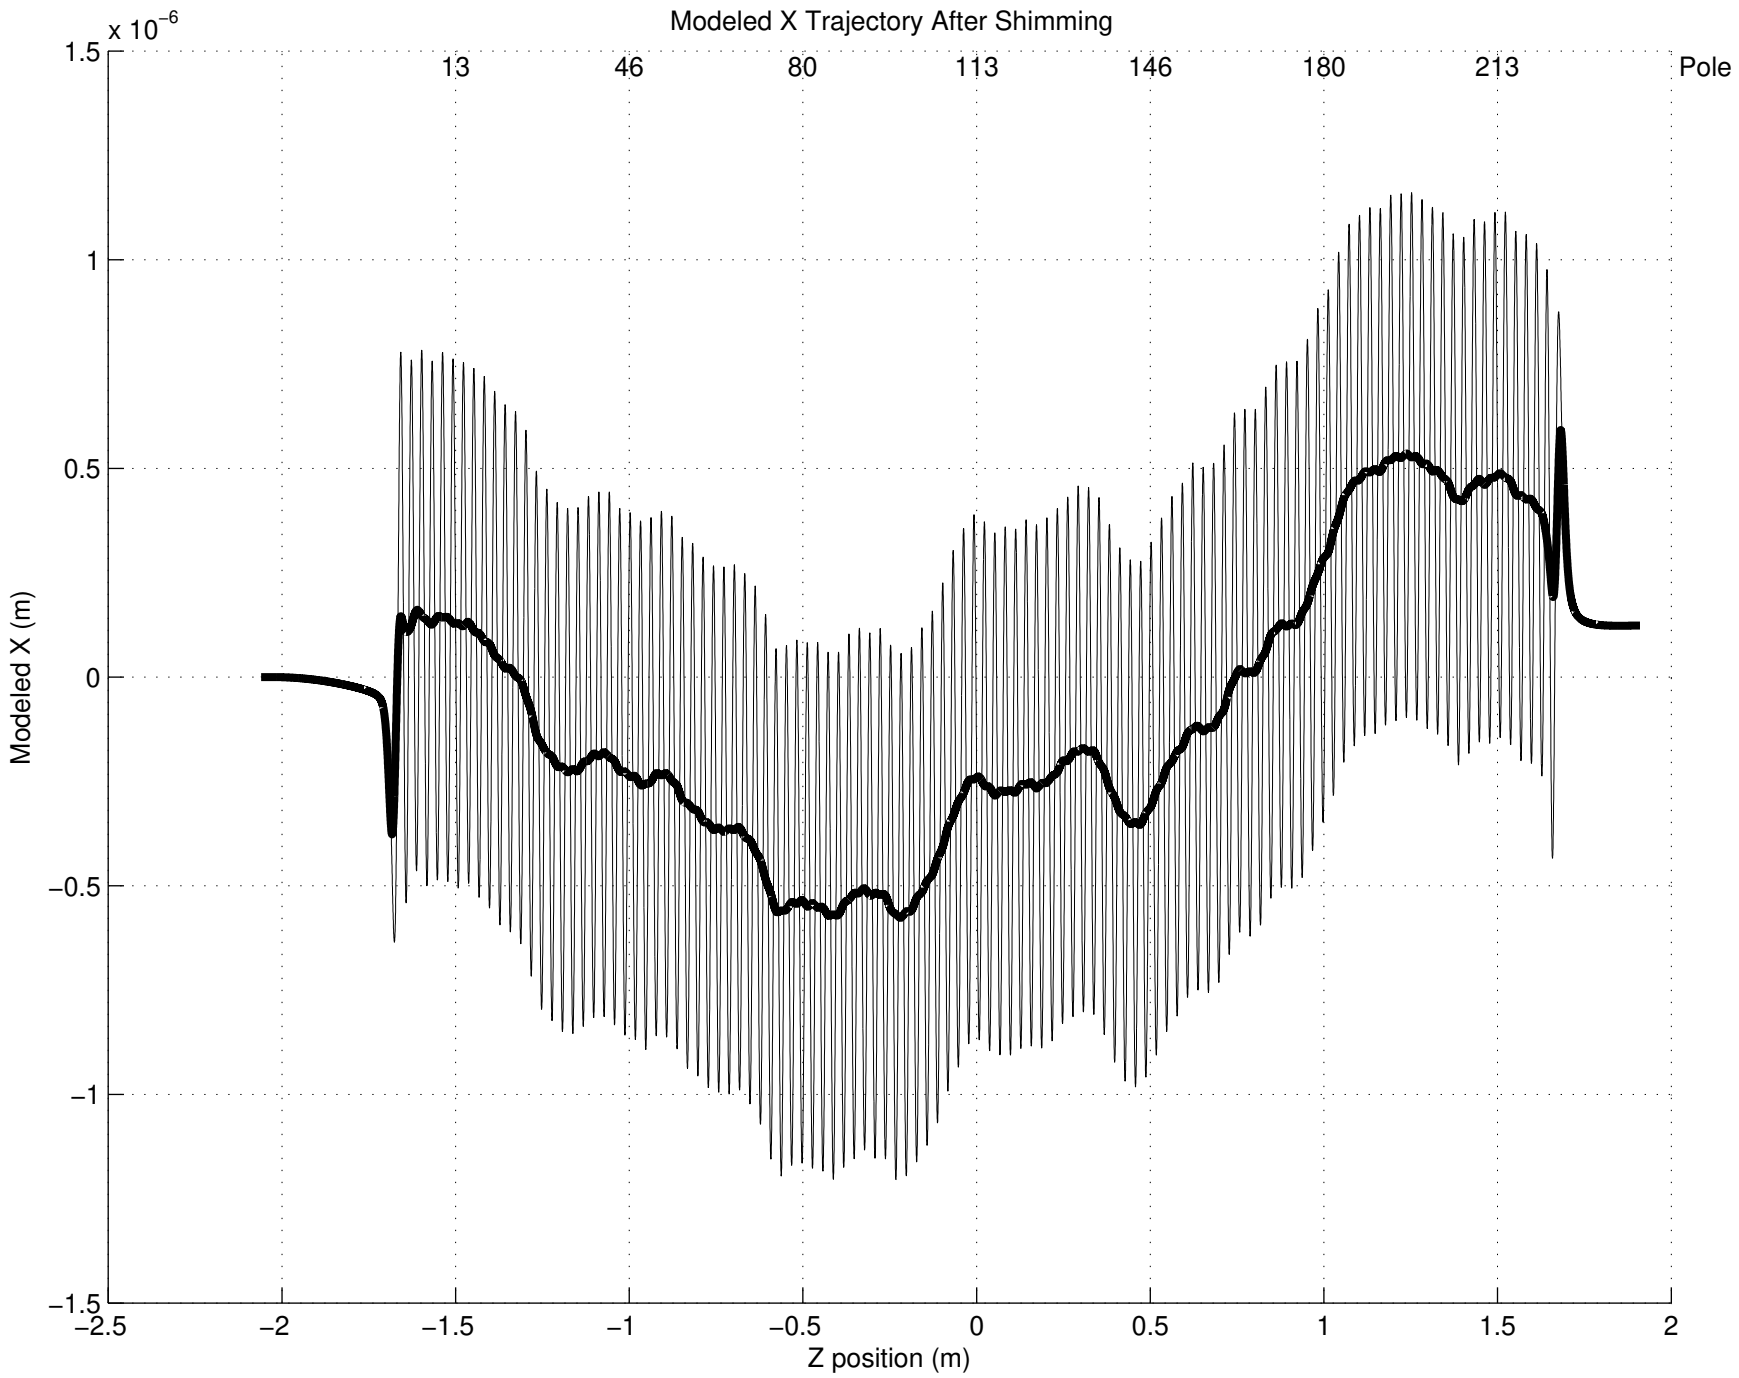
Modeled X Trajectory After Shimming
x 10^-6
1.5
1
0.5
0
−0.5
−1
−1.5
13
46
80
113
146
180
213
Pole
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Modeled X (m)
Z position (m)

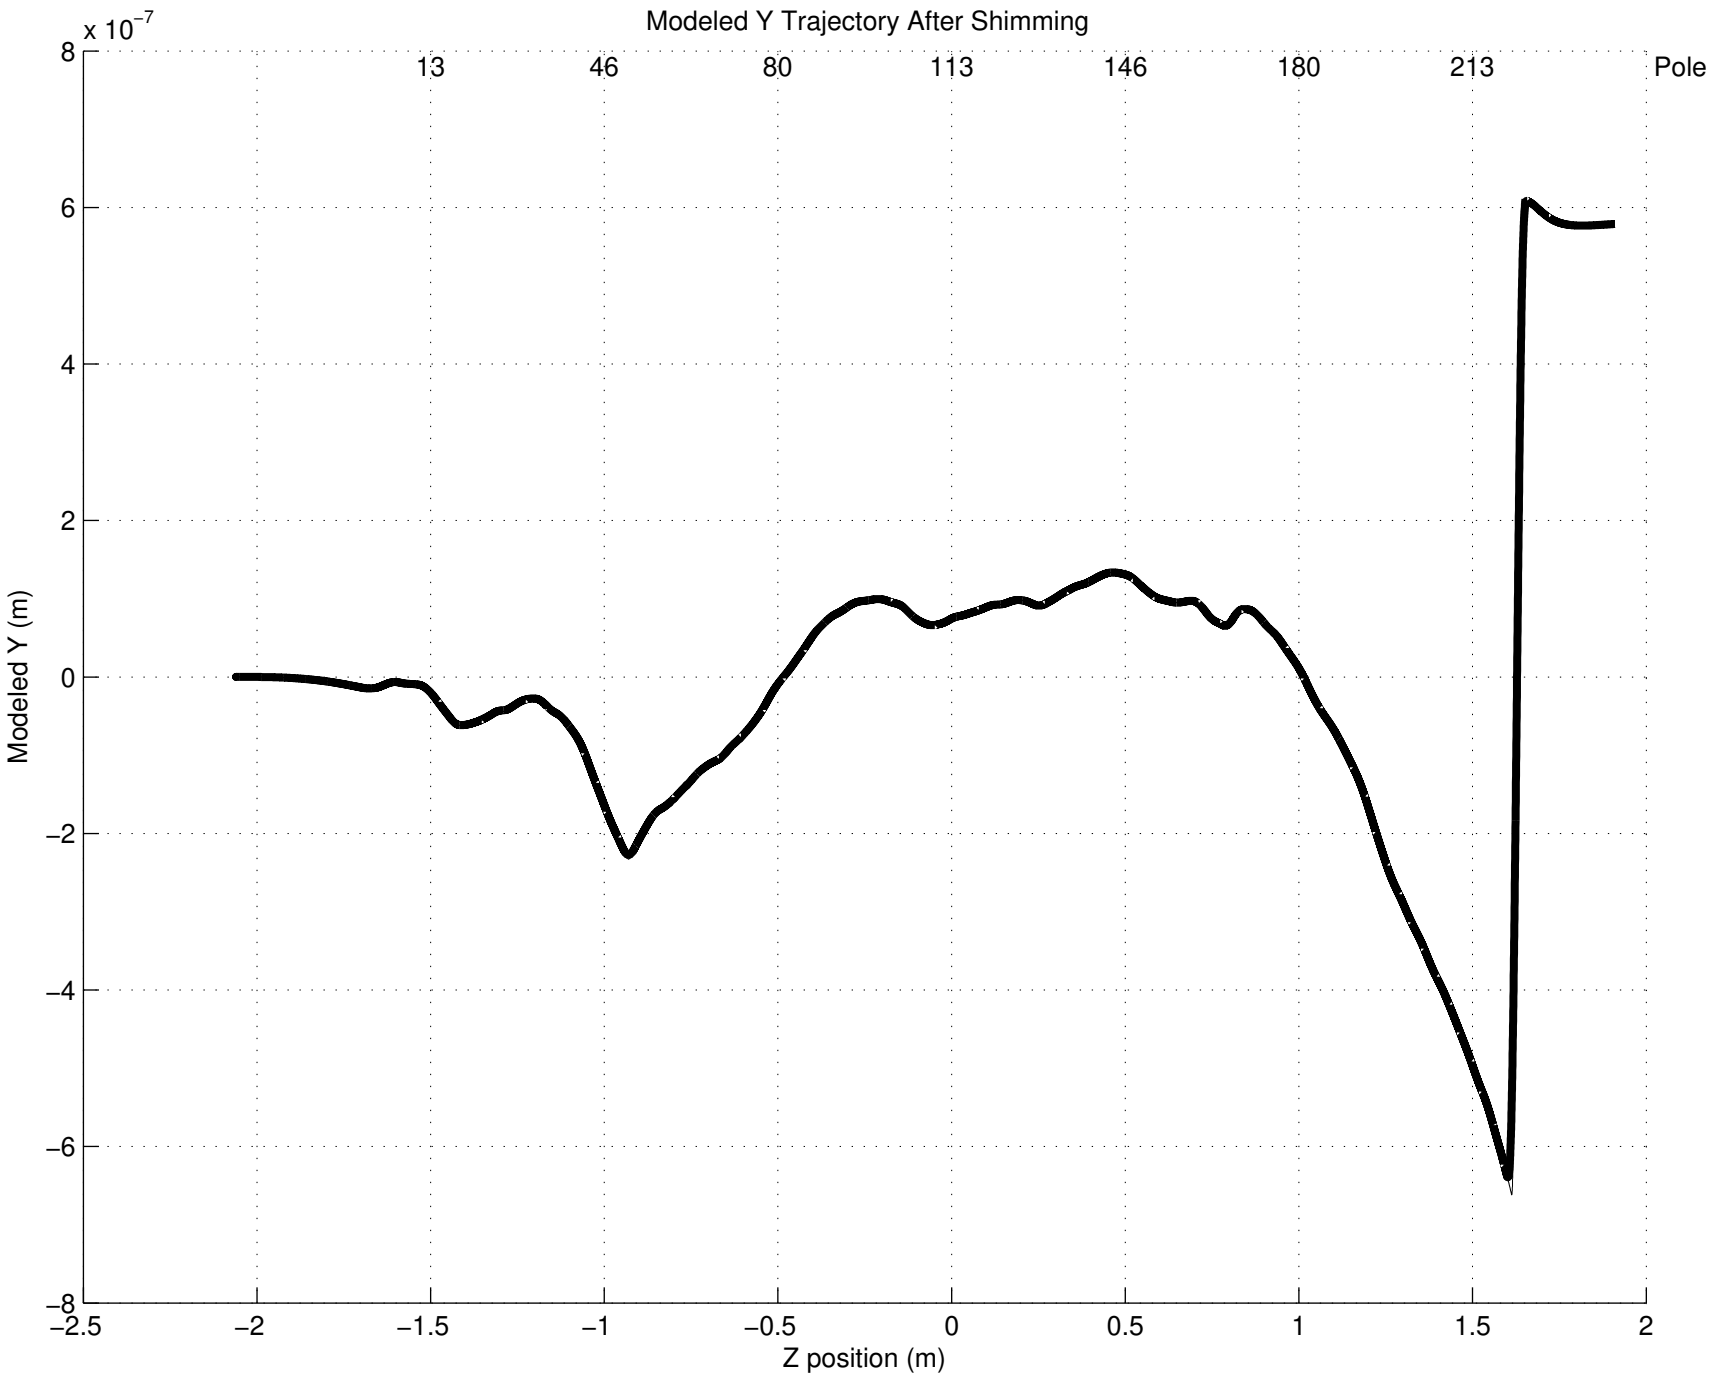
Modeled Y Trajectory After Shimming
x 10^-7
13
46
80
113
146
180
213
Pole
8
6
4
2
0
−2
−4
−6
−8
Modeled Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

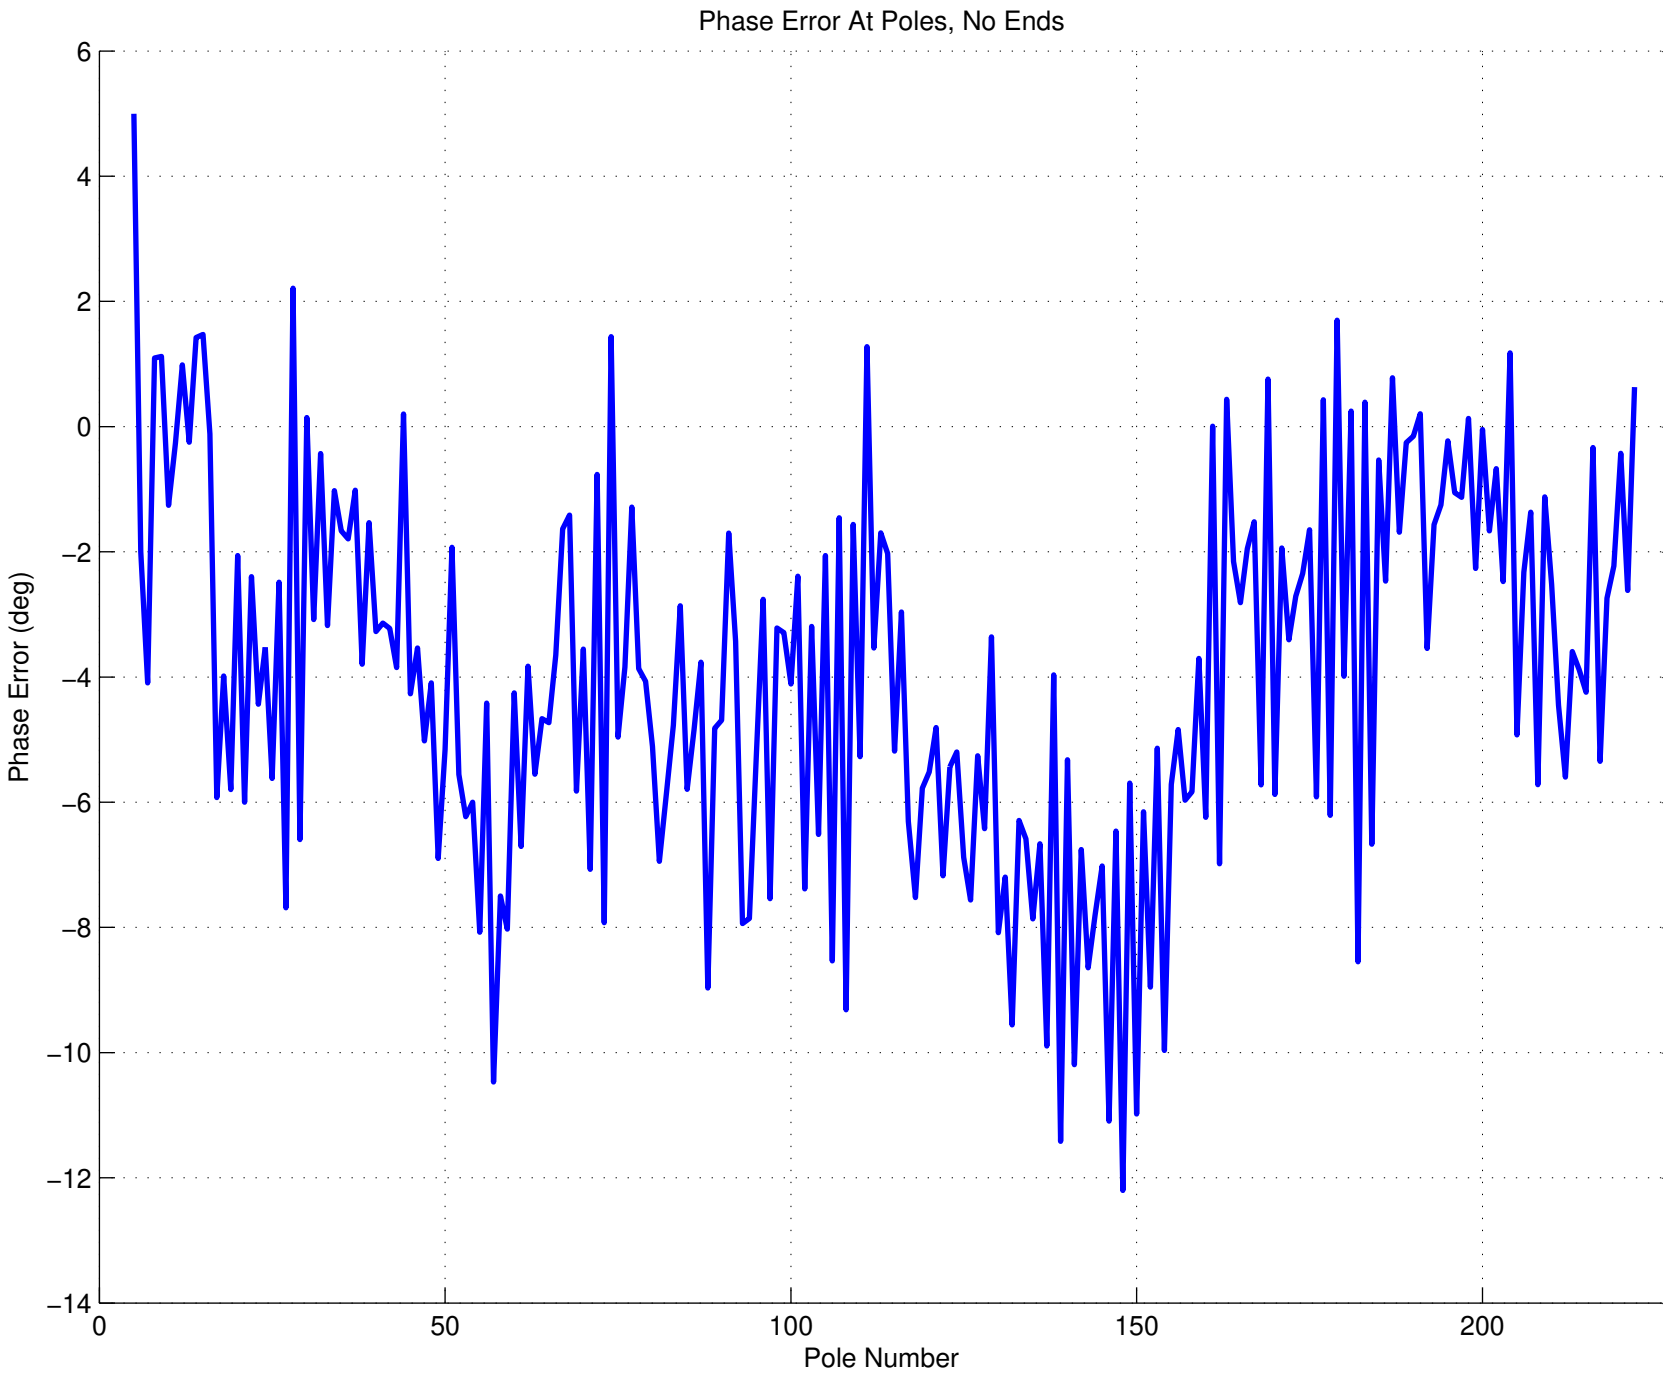
Phase Error At Poles, No Ends
Phase Error (deg)
Pole Number
6
4
2
0
−2
−4
−6
−8
−10
−12
−14
0
50
100
150
200

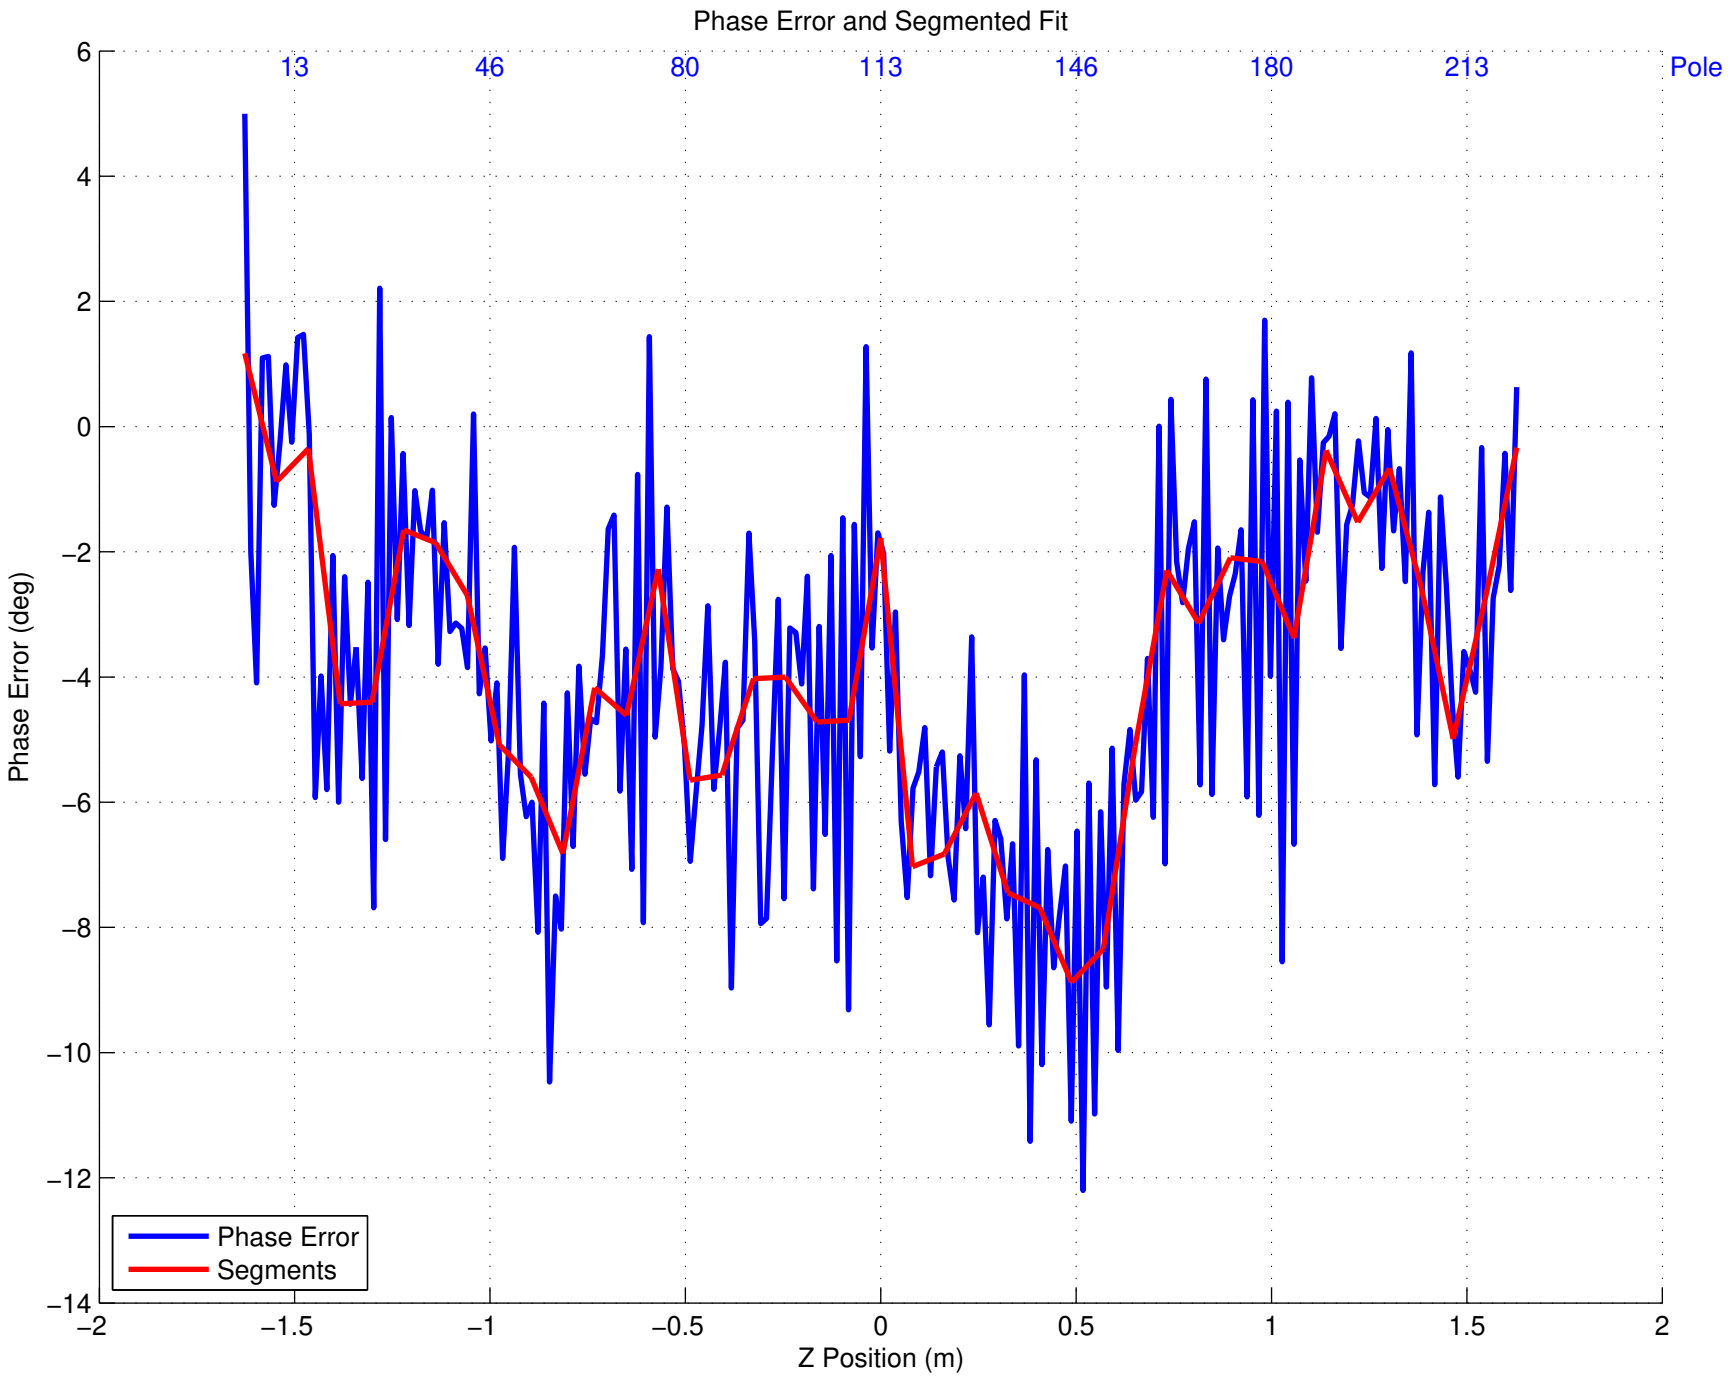
Phase Error and Segmented Fit
13
46
80
113
146
180
213
Pole
6
4
2
0
−2
−4
−6
−8
−10
−12
−14
Phase Error (deg)
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Phase Error
Segments

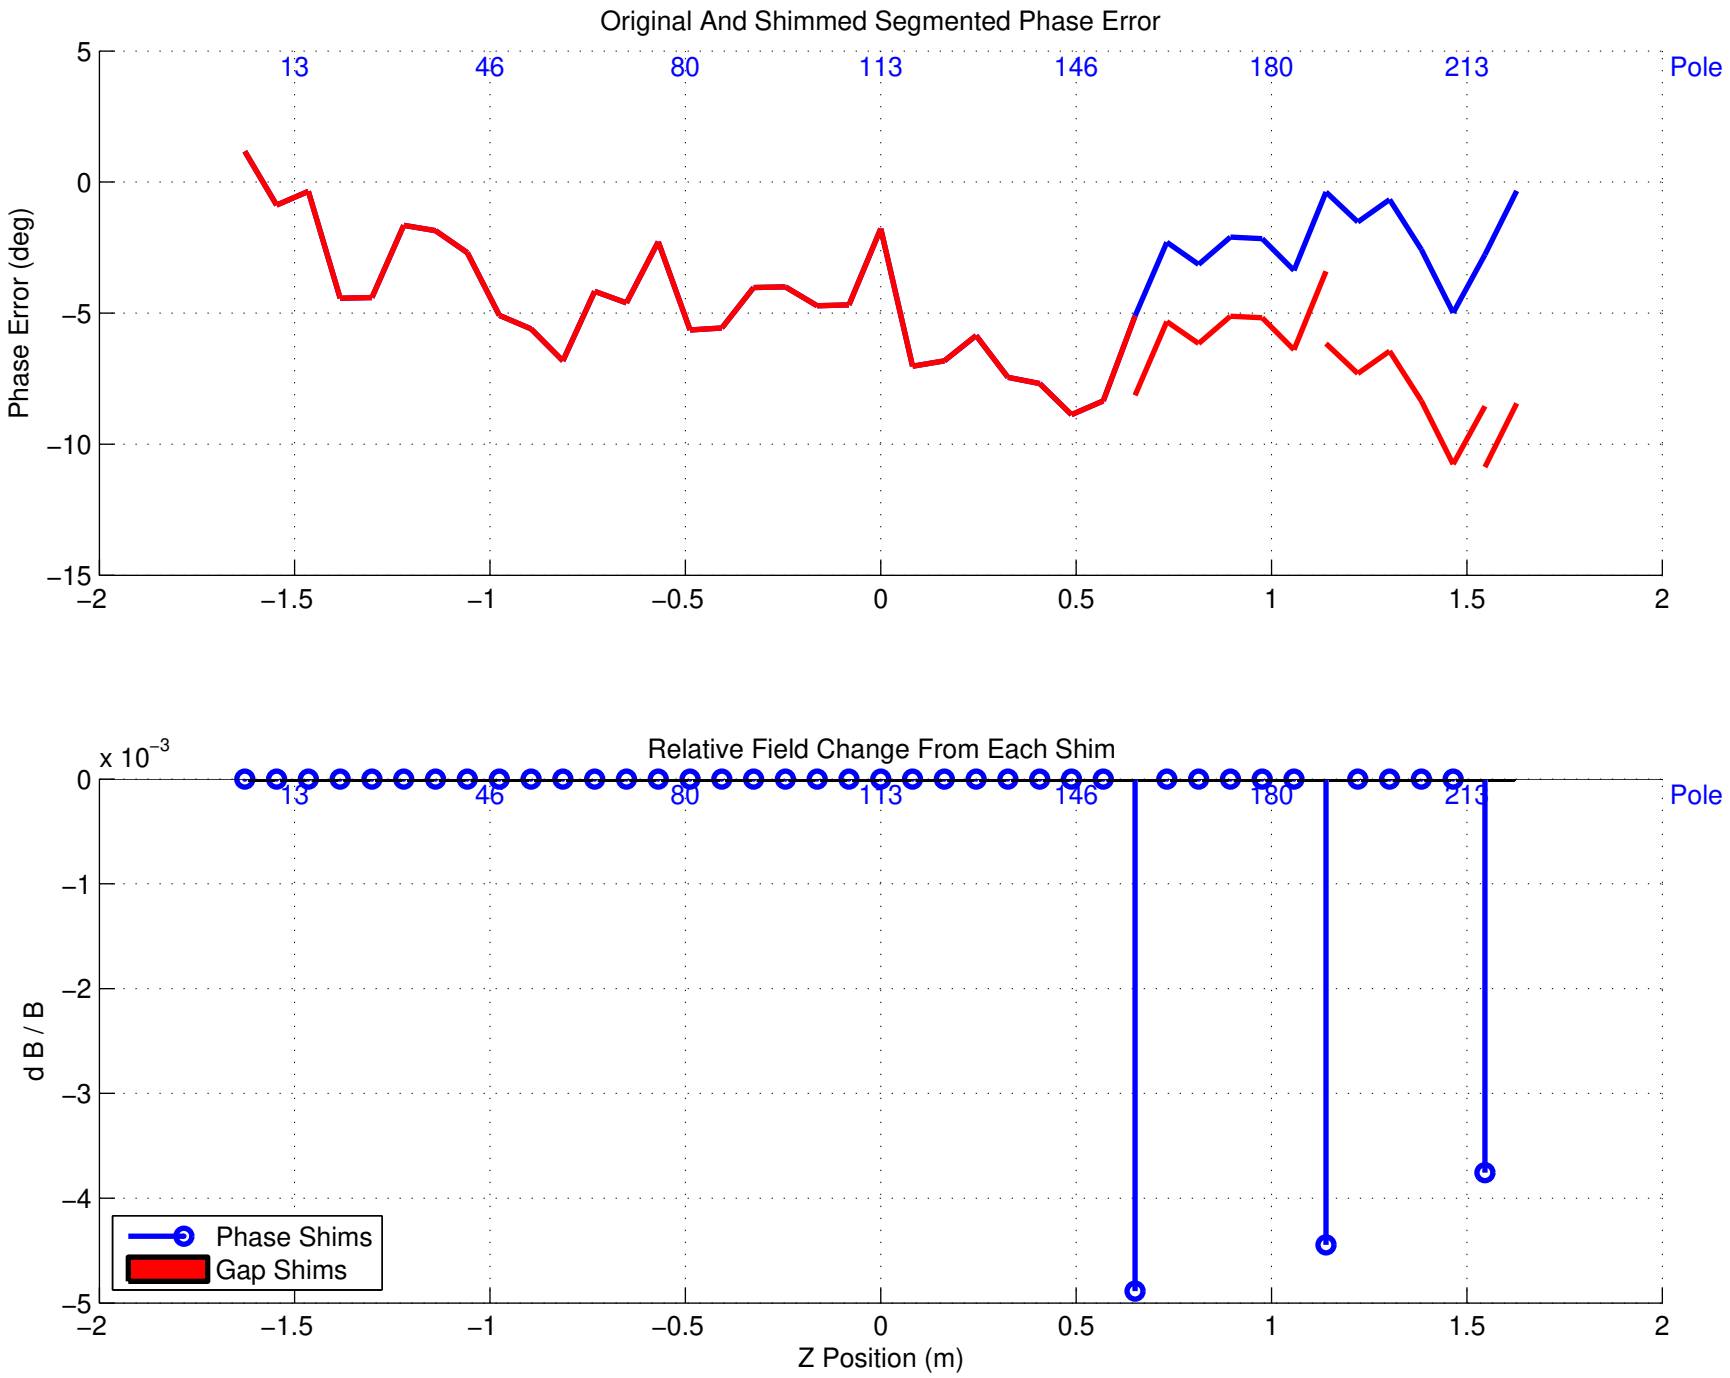
Original And Shimmed Segmented Phase Error
Phase Error (deg)
Pole
13
46
80
113
146
180
213
5
0
−5
−10
−15
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
Z Position (m)
Phase Shims
Gap Shims

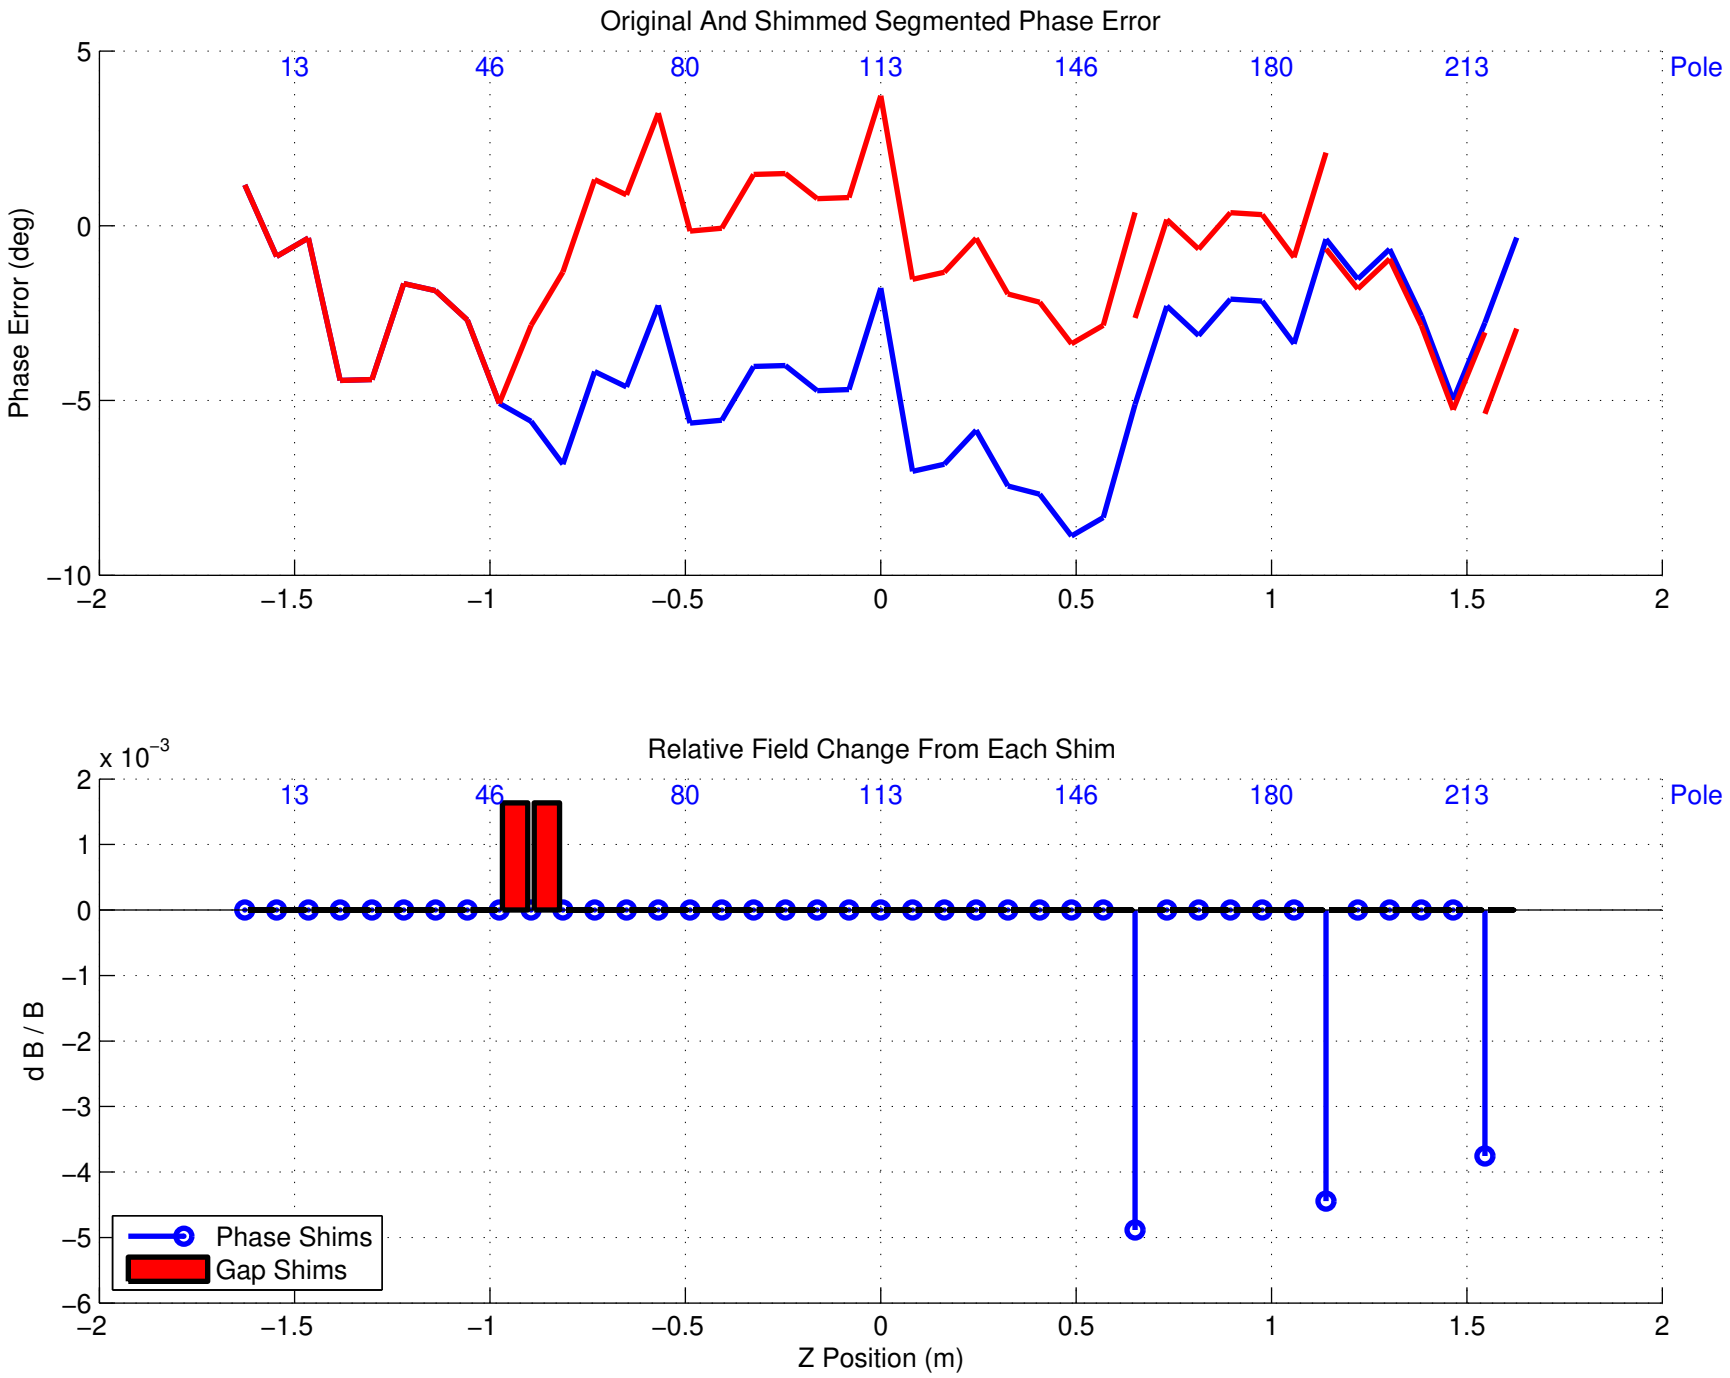
Original And Shimmed Segmented Phase Error
Phase Error (deg)
13
46
80
113
146
180
213
Pole
5
0
−5
−10
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
2
1
0
−1
−2
−3
−4
−5
−6
Phase Shims
Gap Shims
Z Position (m)

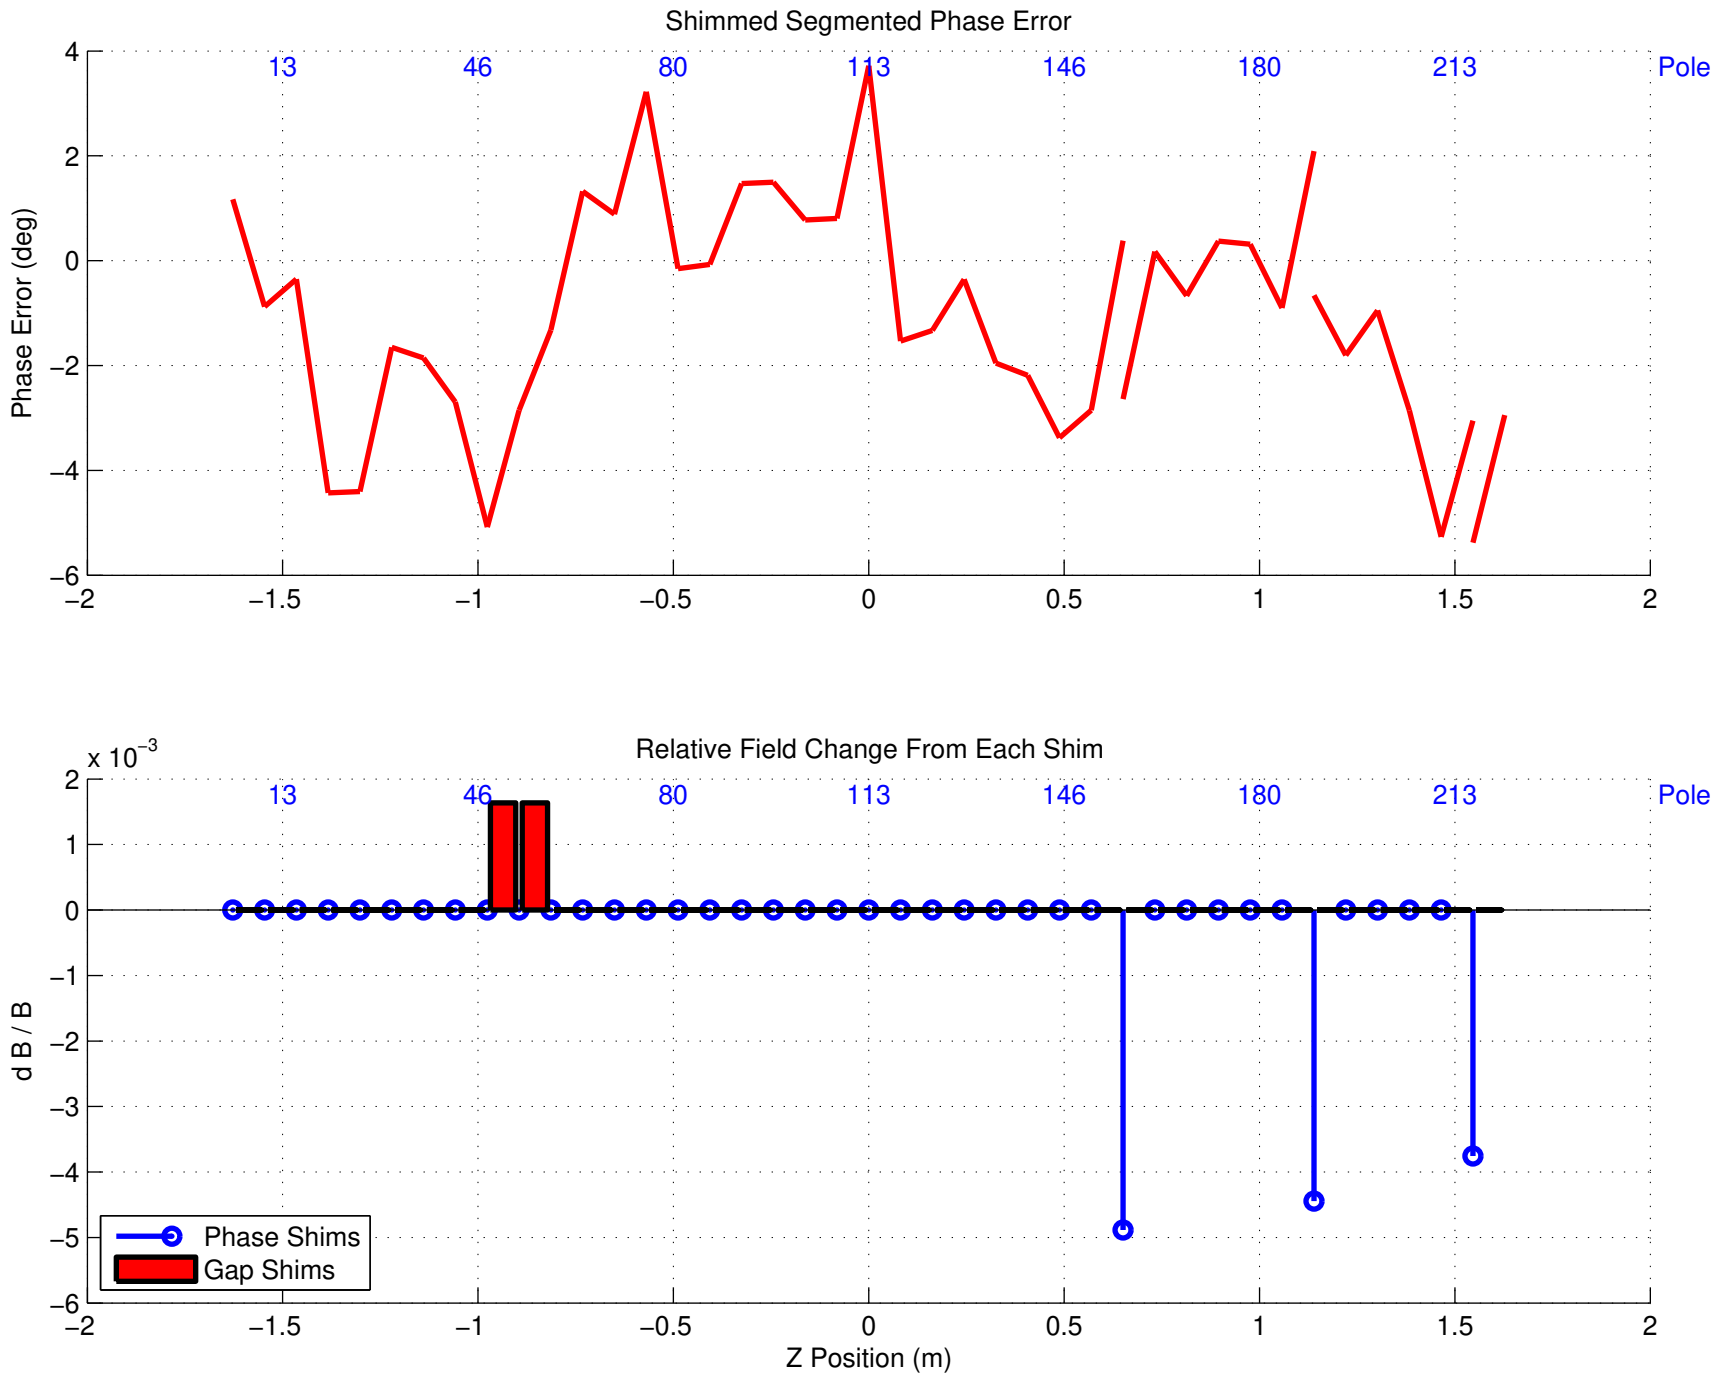
Shimmed Segmented Phase Error
13
46
80
113
146
180
213
Pole
Phase Error (deg)
4
2
0
−2
−4
−6
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
2
1
0
−1
−2
−3
−4
−5
−6
Phase Shims
Gap Shims
Z Position (m)

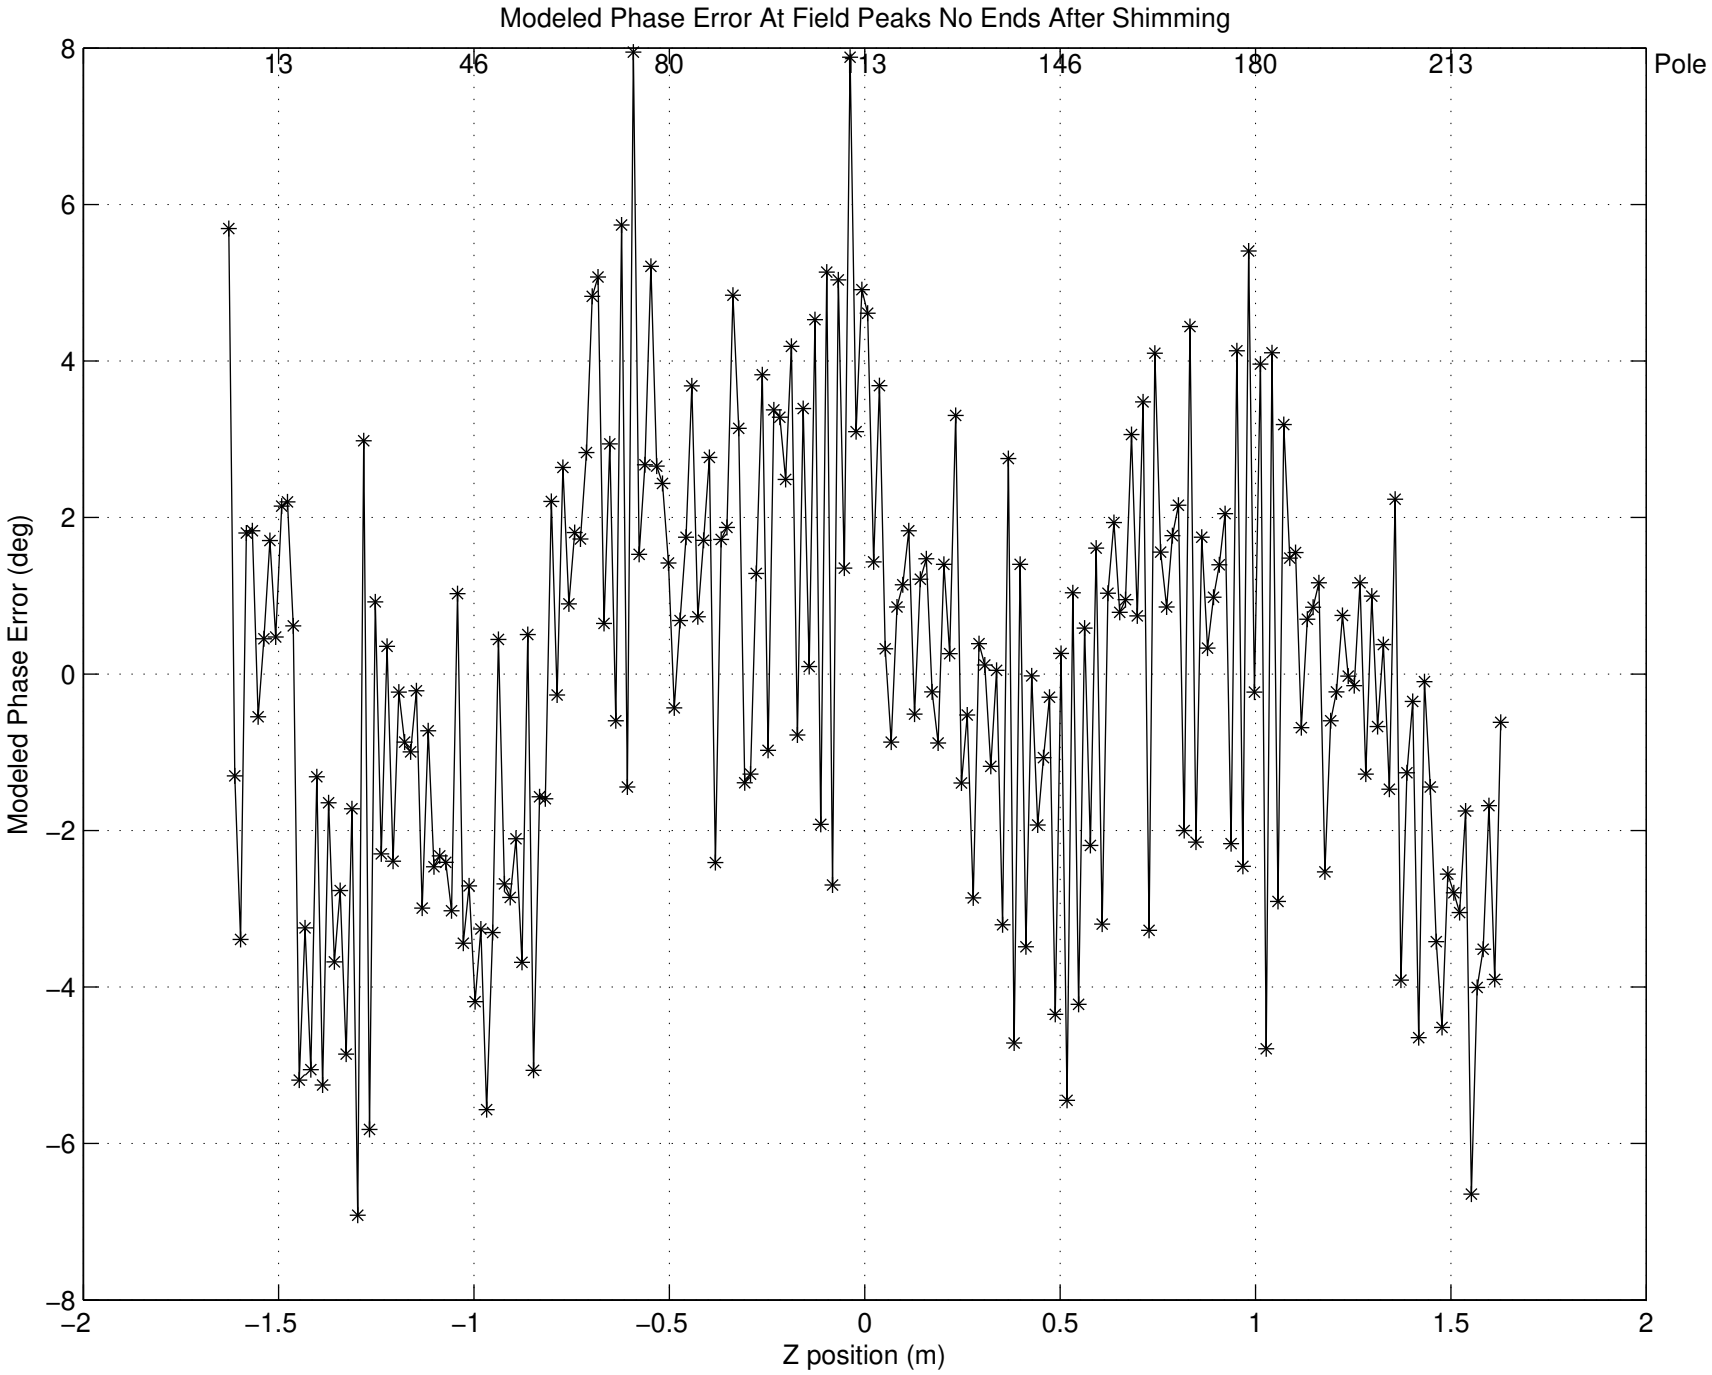

Phase Error: Ave = −0.000000 deg, RMS = 2.834747 deg