SLAC Magnetic Measurements

Planar Insertion Device Shim Analysis

Parameters:
INPUT−FILE−DIR =S:\MagData\LCLS\Undulator\L143−112000−17\DATASET0001\Rough Tuning\Z Scans\Run 077\
INPUT−FILE−NAME =bscanz−dat.001
INPUT−FILE−TYPE =ZVXYBXYH
CORR−REQUIRED =1
CORR−FILE =S:\Magdata\Earth Field Correction\earth−field−corr.dat
CORR−FILE−TYPE =CORR−ZBXY
GAMMA =26690.65
NOM−LAMBDA−U =0.03
NOM−K−VALUE =3.4996
NOM−LAMBDA−R =1.4999e−010
NUM−POLES =226
NUM−END−POLES =4
CELL−LENGTH =3.656

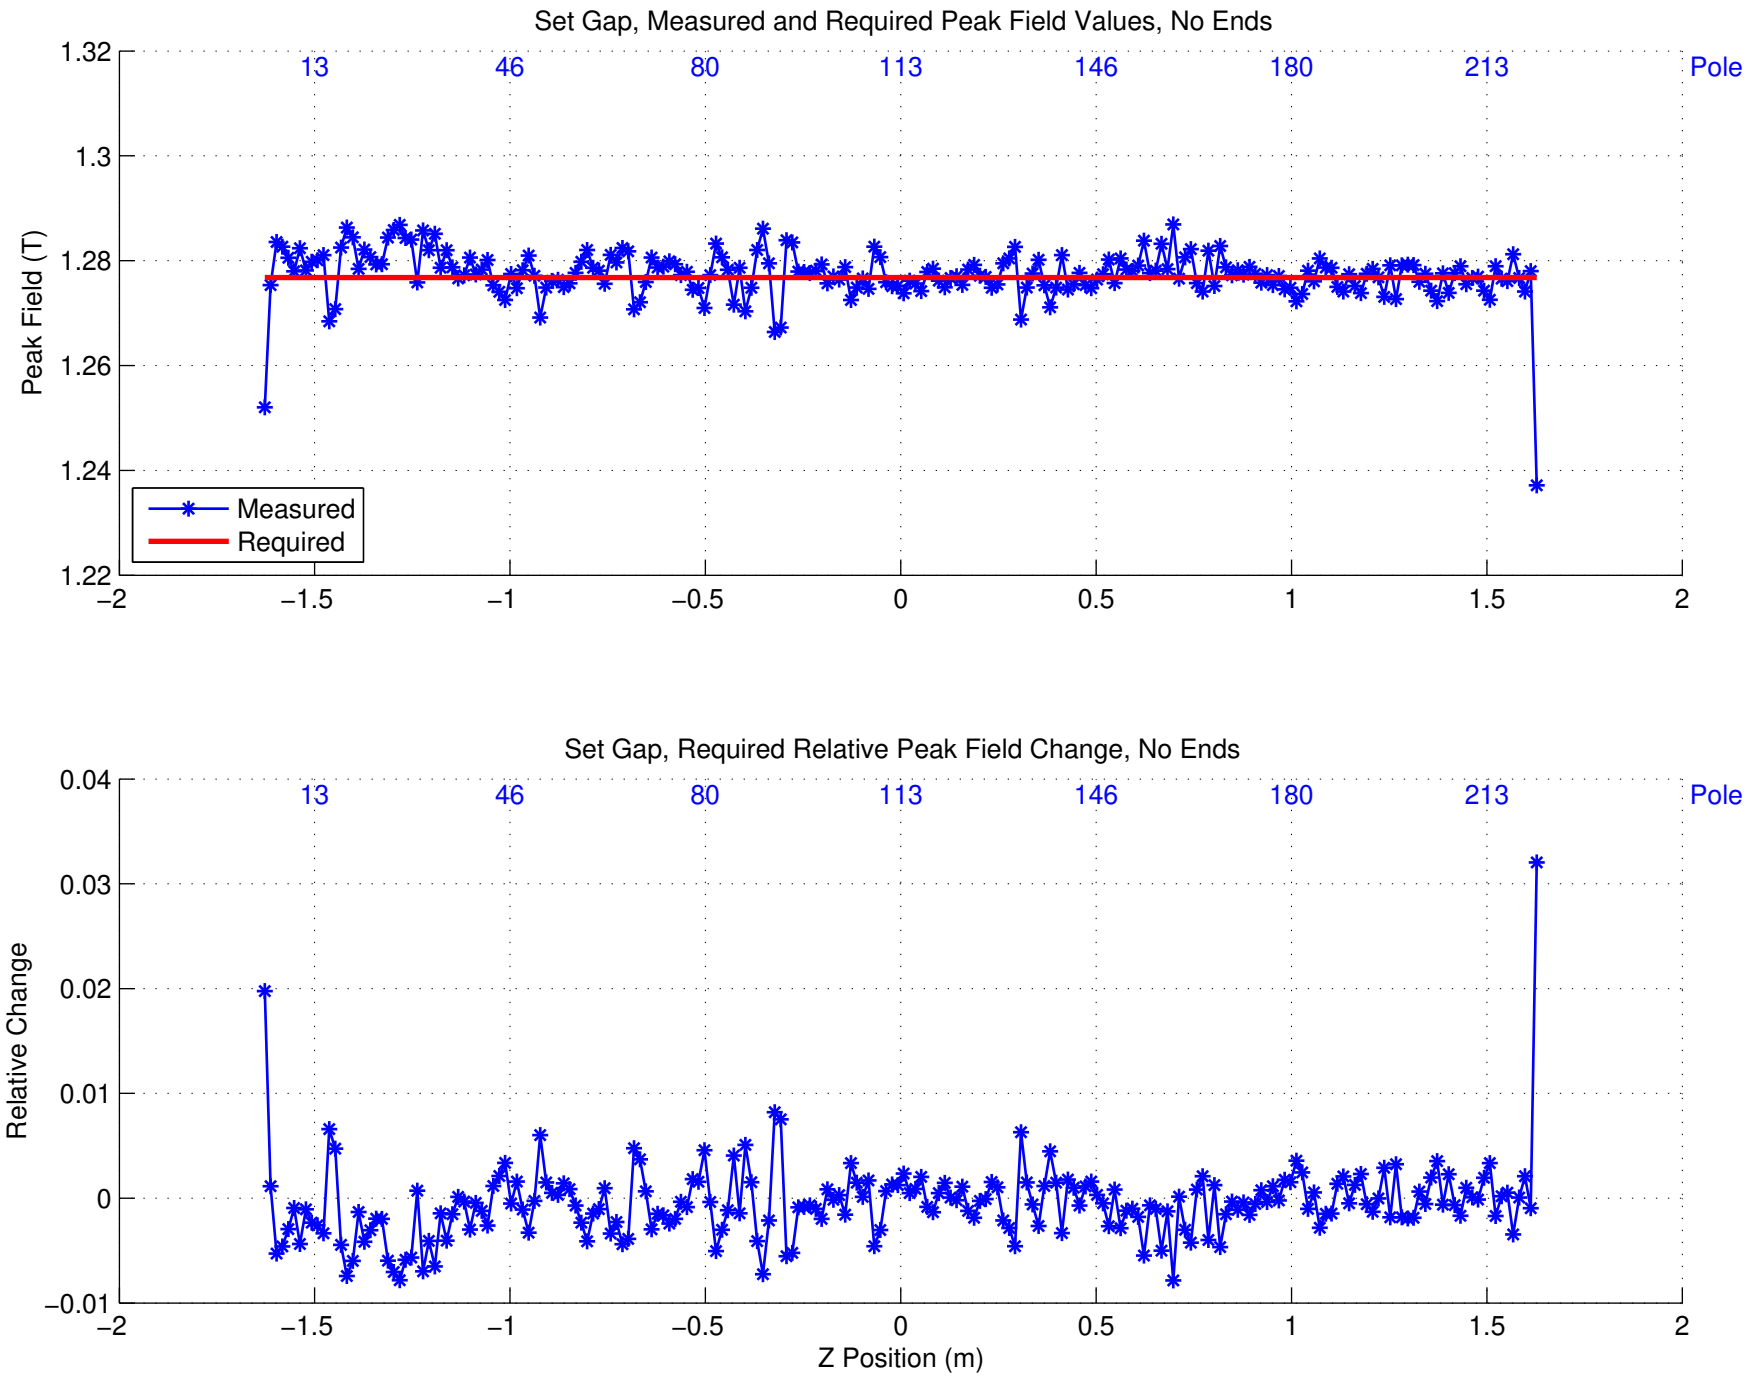
Set Gap, Measured and Required Peak Field Values, No Ends
13
46
80
113
146
180
213
Pole
1.32
1.3
1.28
1.26
1.24
1.22
Peak Field (T)
Measured
Required
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Set Gap, Required Relative Peak Field Change, No Ends
13
46
80
113
146
180
213
Pole
0.04
0.03
0.02
0.01
0
−0.01
Relative Change
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

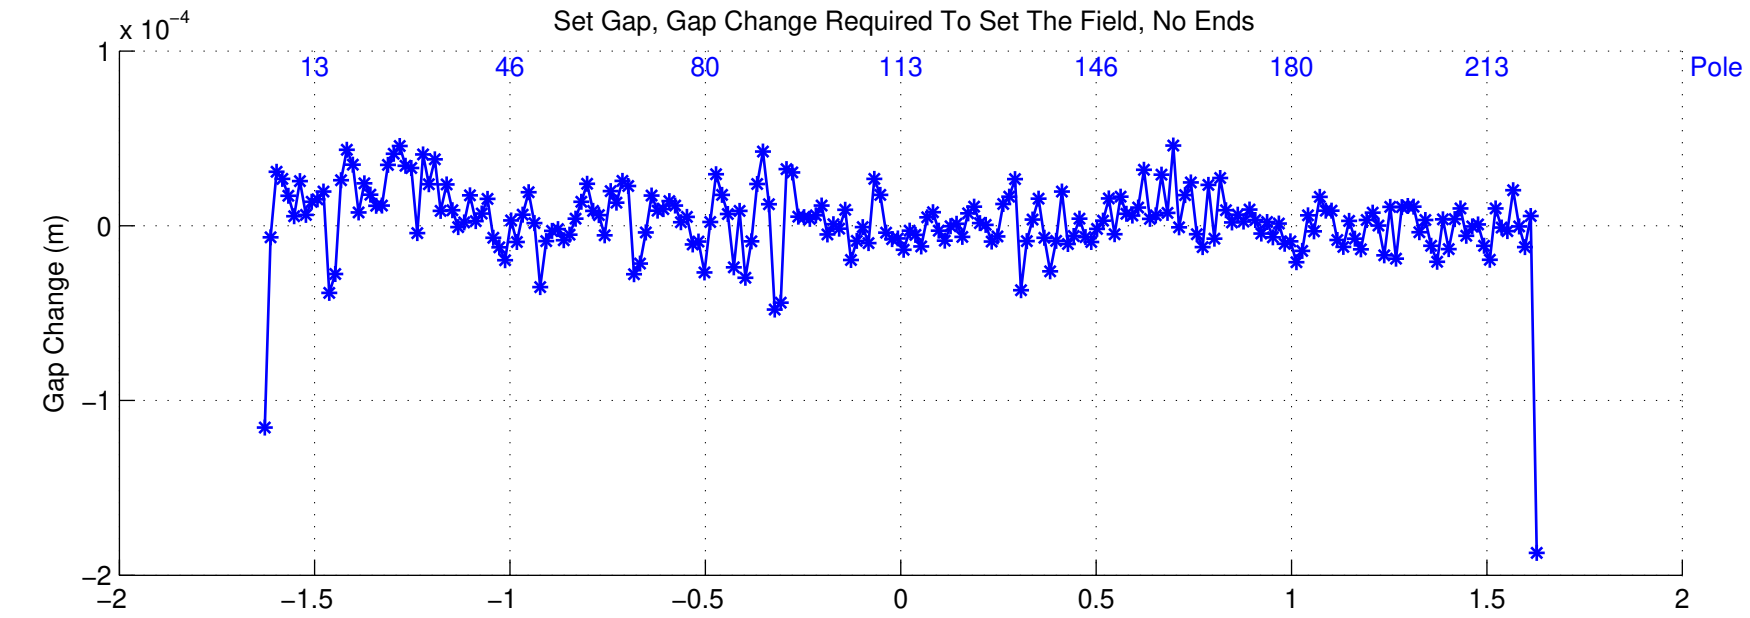
Set Gap, Gap Change Required To Set The Field, No Ends
x 10^-4
13
46
80
113
146
180
213
Pole
Gap Change (m)
1
0
−1
−2
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

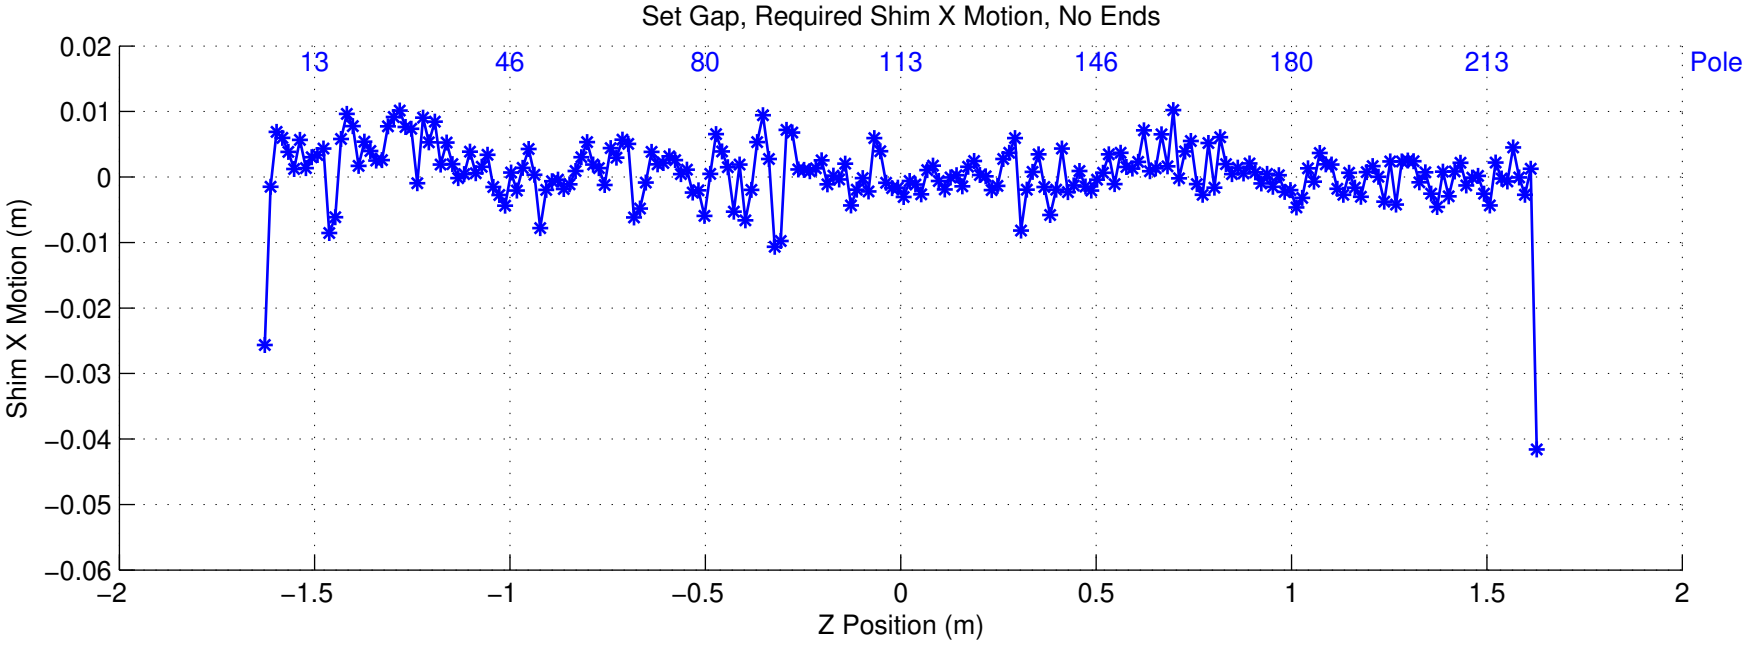
Set Gap, Required Shim X Motion, No Ends
13
46
80
113
146
180
213
Pole
Shim X Motion (m)
0.02
0.01
0
−0.01
−0.02
−0.03
−0.04
−0.05
−0.06
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

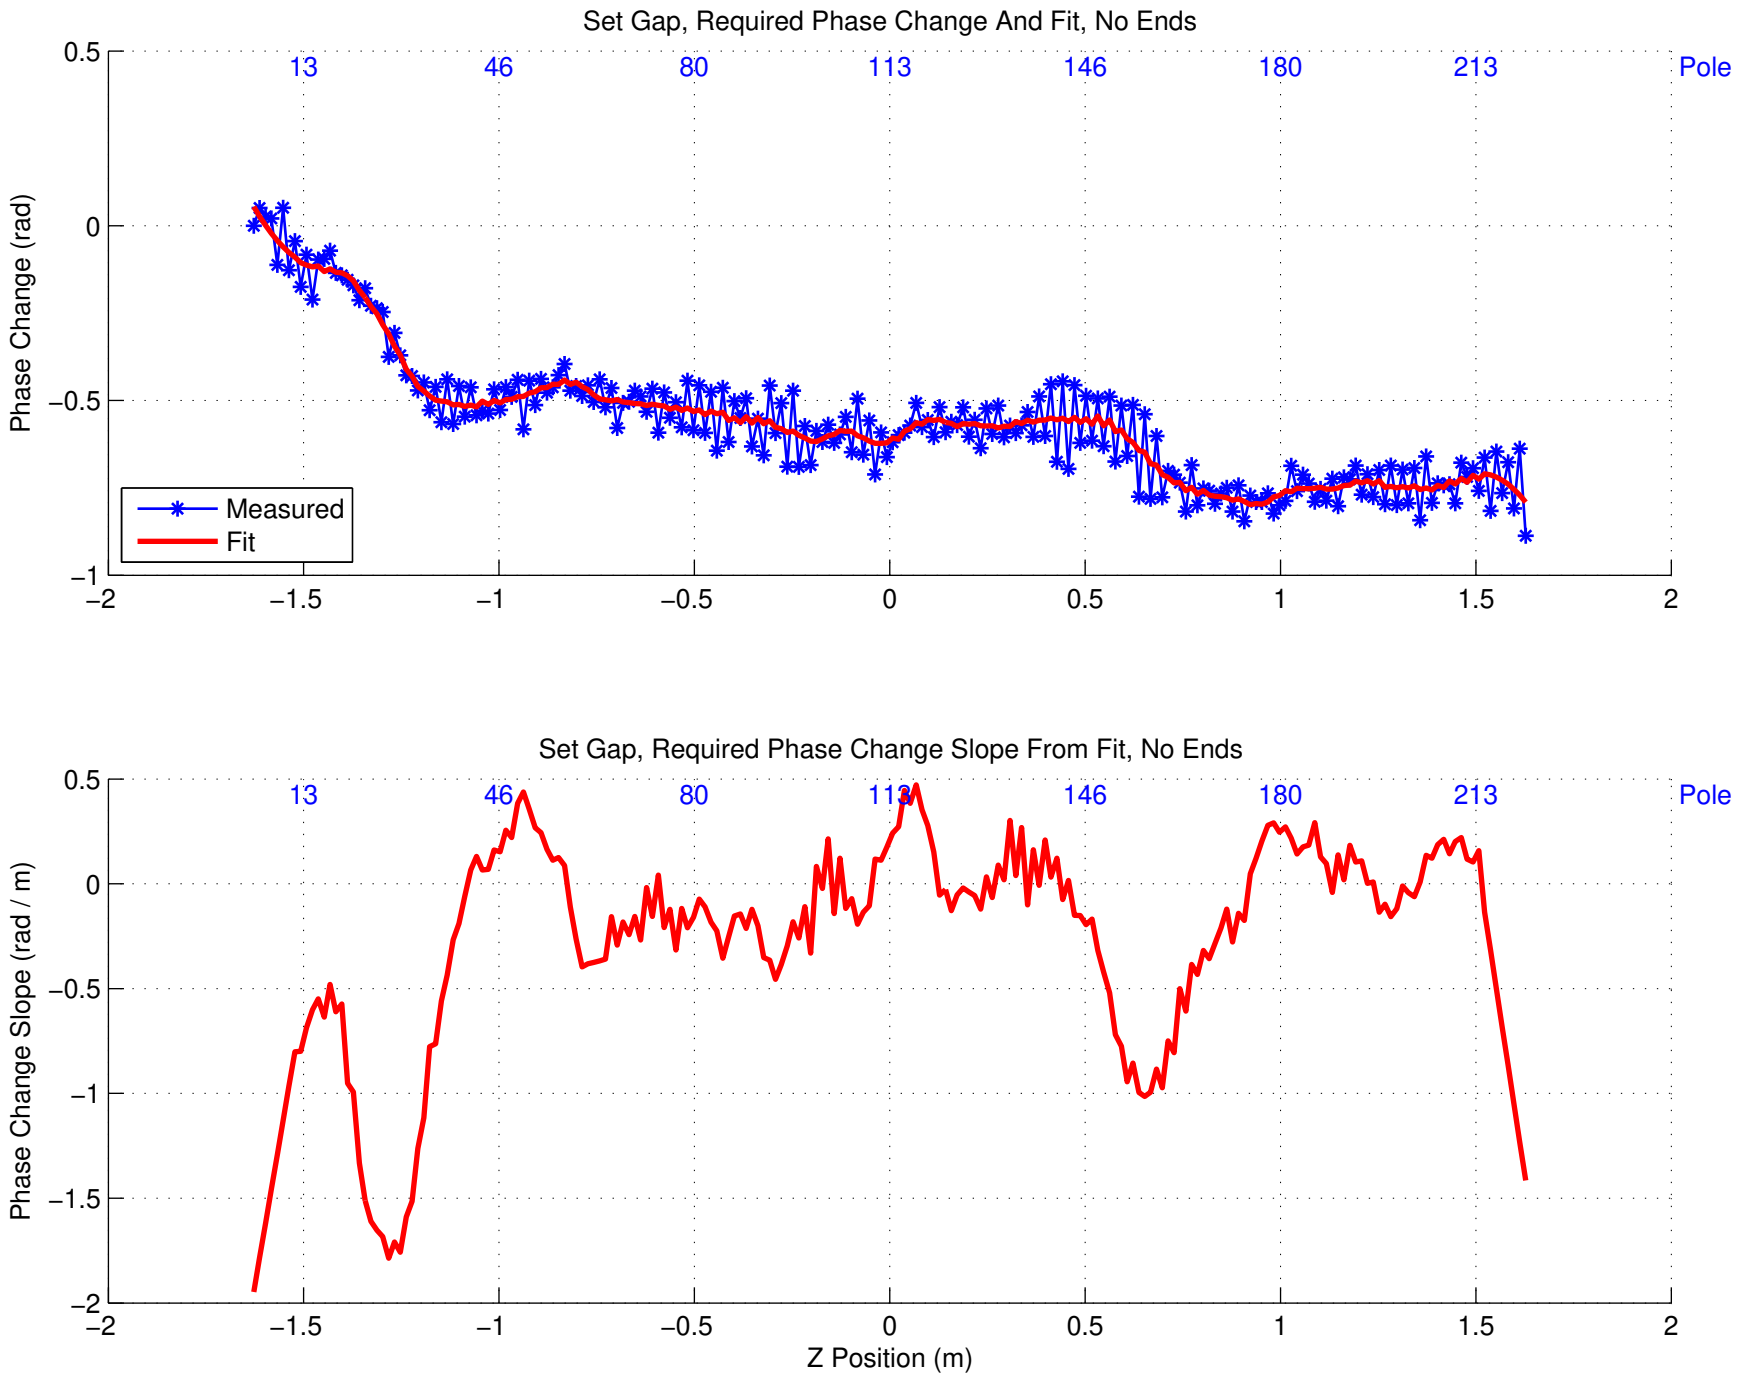
Set Gap, Required Phase Change And Fit, No Ends
Phase Change (rad)
13
46
80
113
146
180
213
Pole
0.5
0
−0.5
−1
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Measured
Fit
Set Gap, Required Phase Change Slope From Fit, No Ends
Phase Change Slope (rad / m)
Z Position (m)

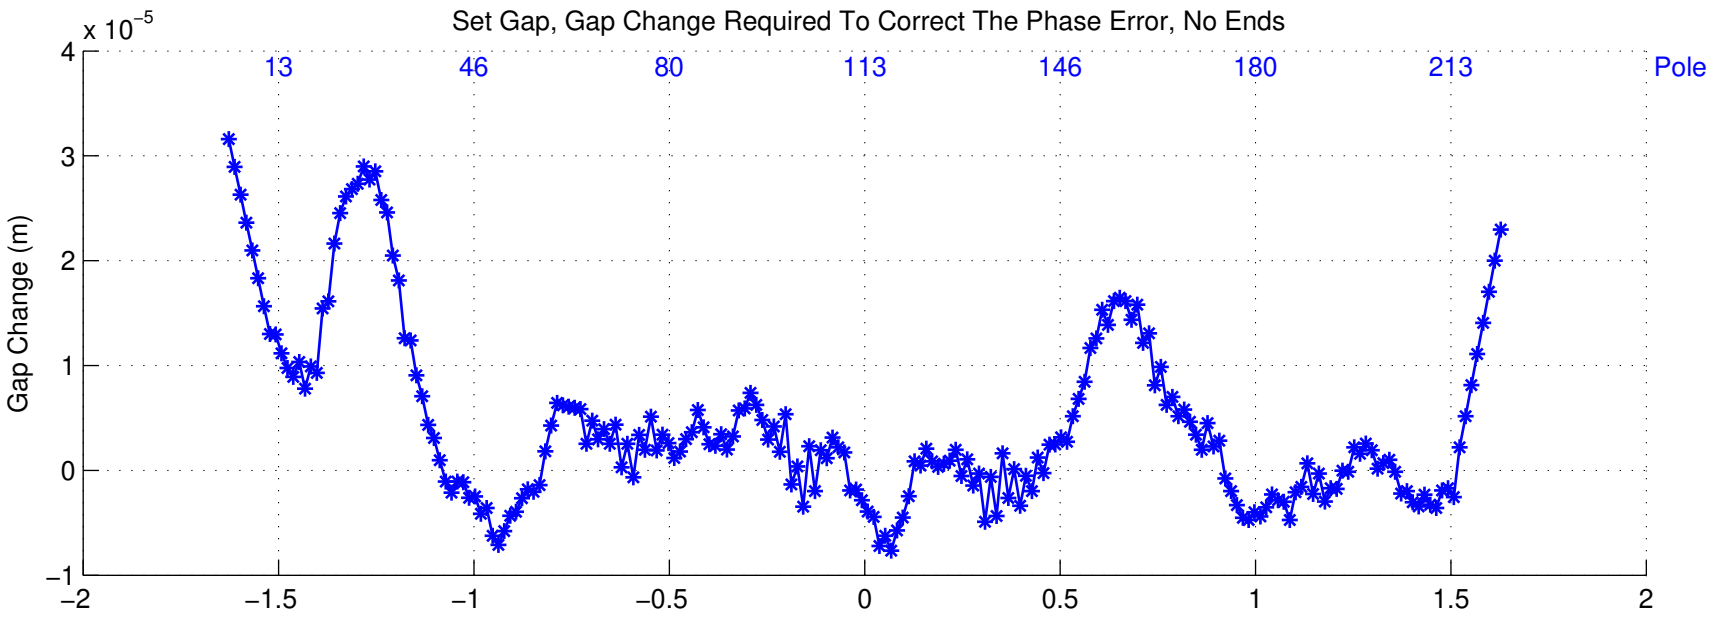
Set Gap, Gap Change Required To Correct The Phase Error, No Ends
x 10^-5
Gap Change (m)
13
46
80
113
146
180
213
Pole
4
3
2
1
0
−1
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

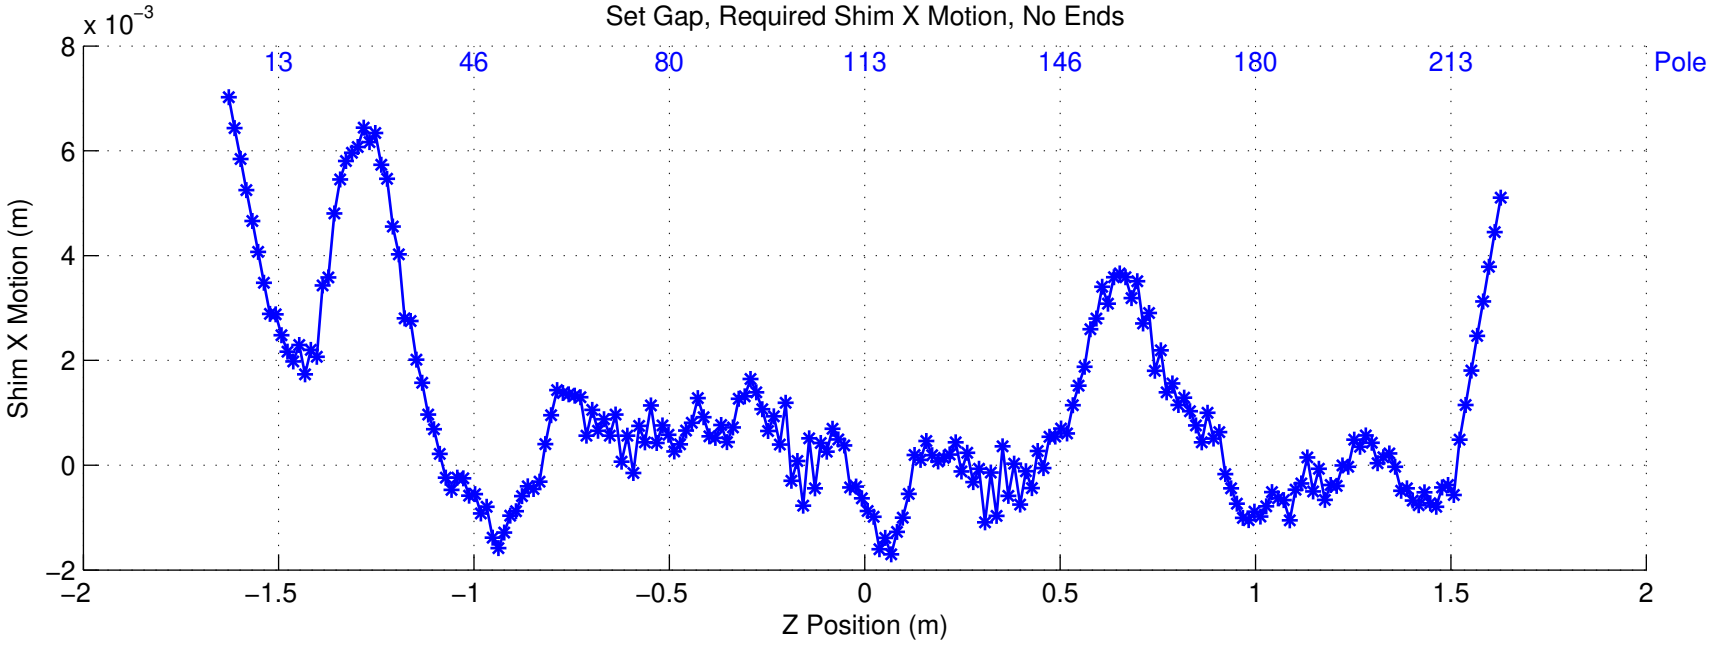
Set Gap, Required Shim X Motion, No Ends
x 10^-3
Shim X Motion (m)
13
46
80
113
146
180
213
Pole
8
6
4
2
0
−2
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

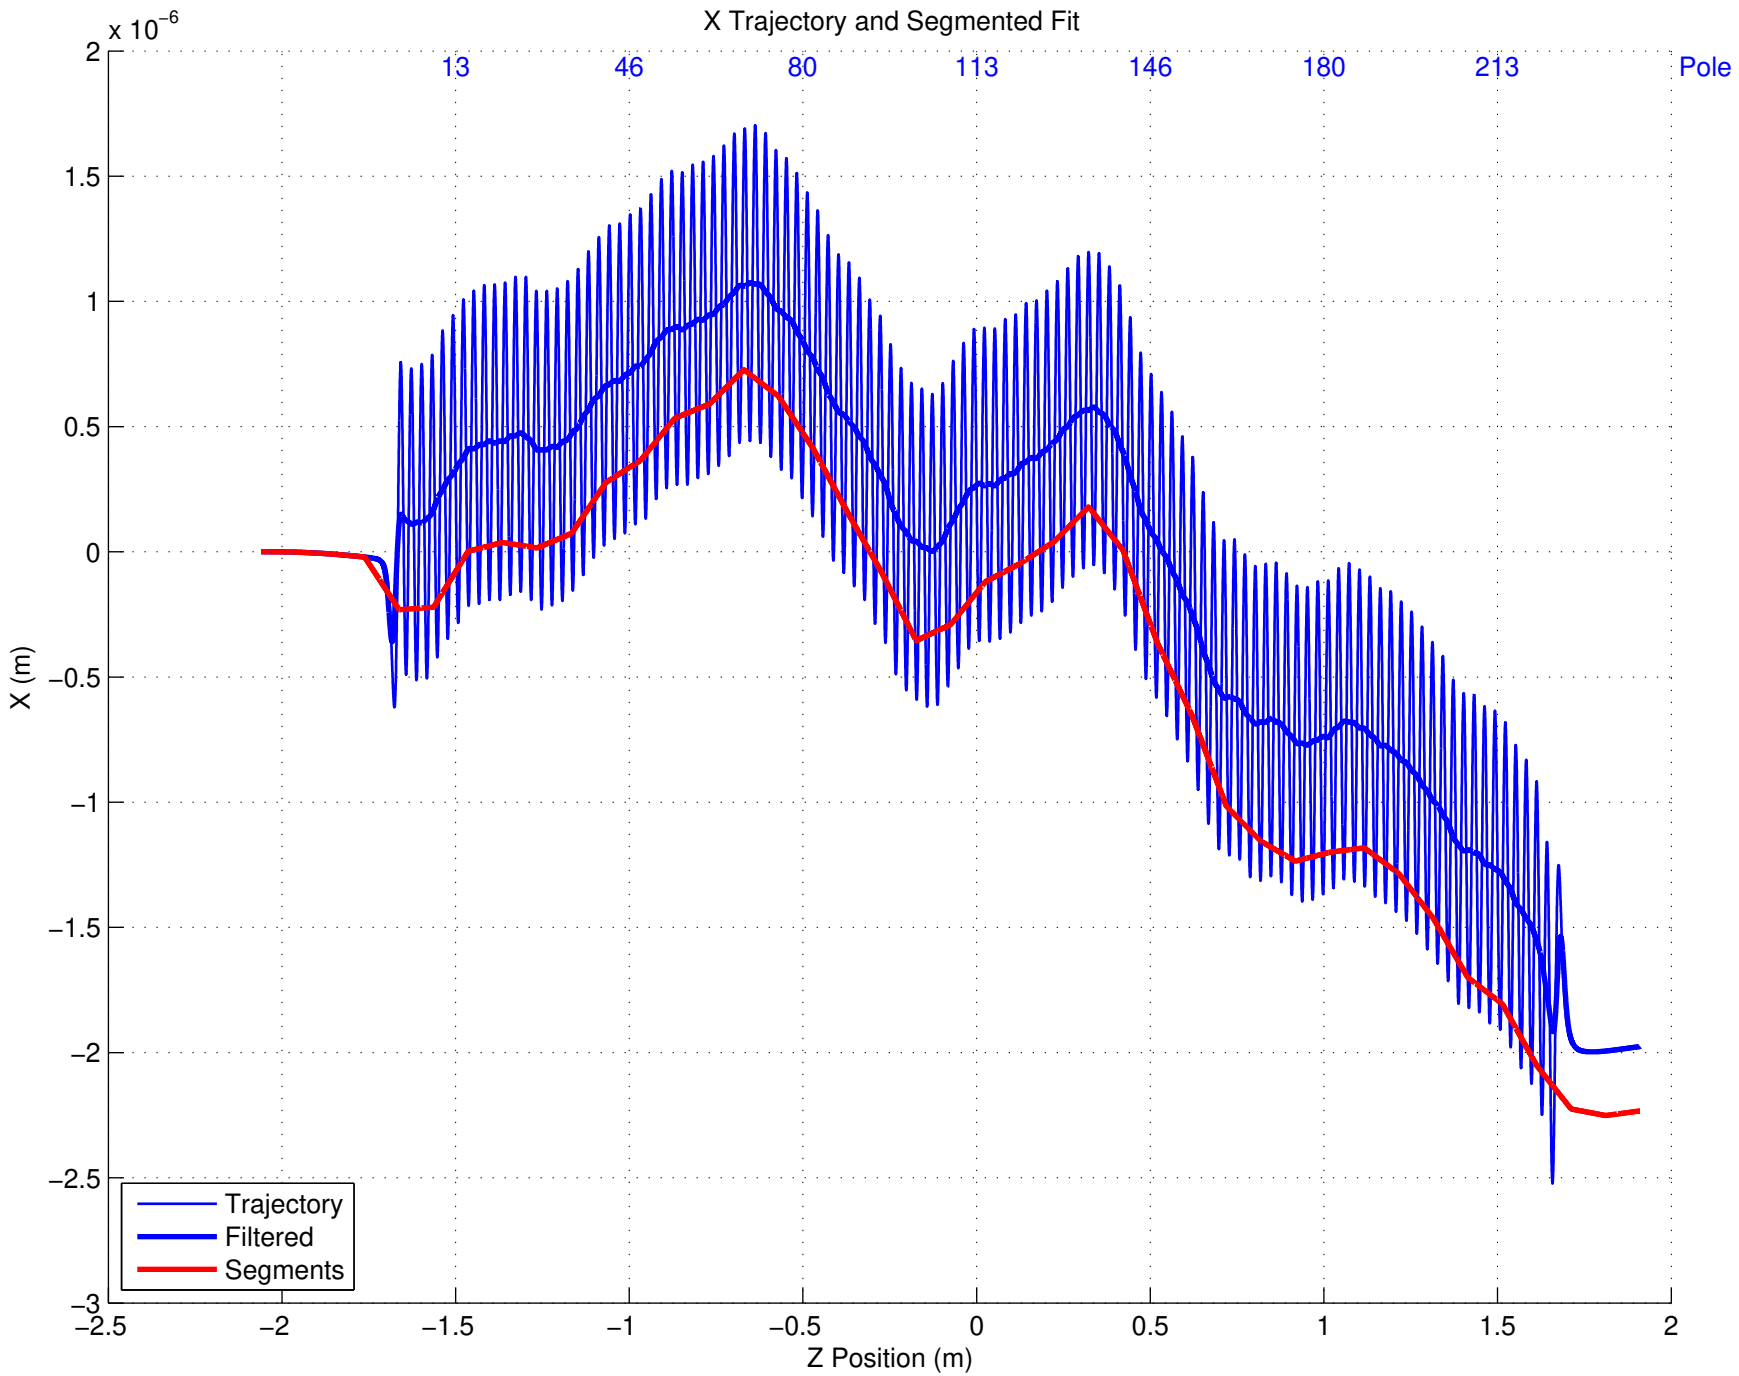
X Trajectory and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
2
1.5
1
0.5
0
−0.5
−1
−1.5
−2
−2.5
−3
X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

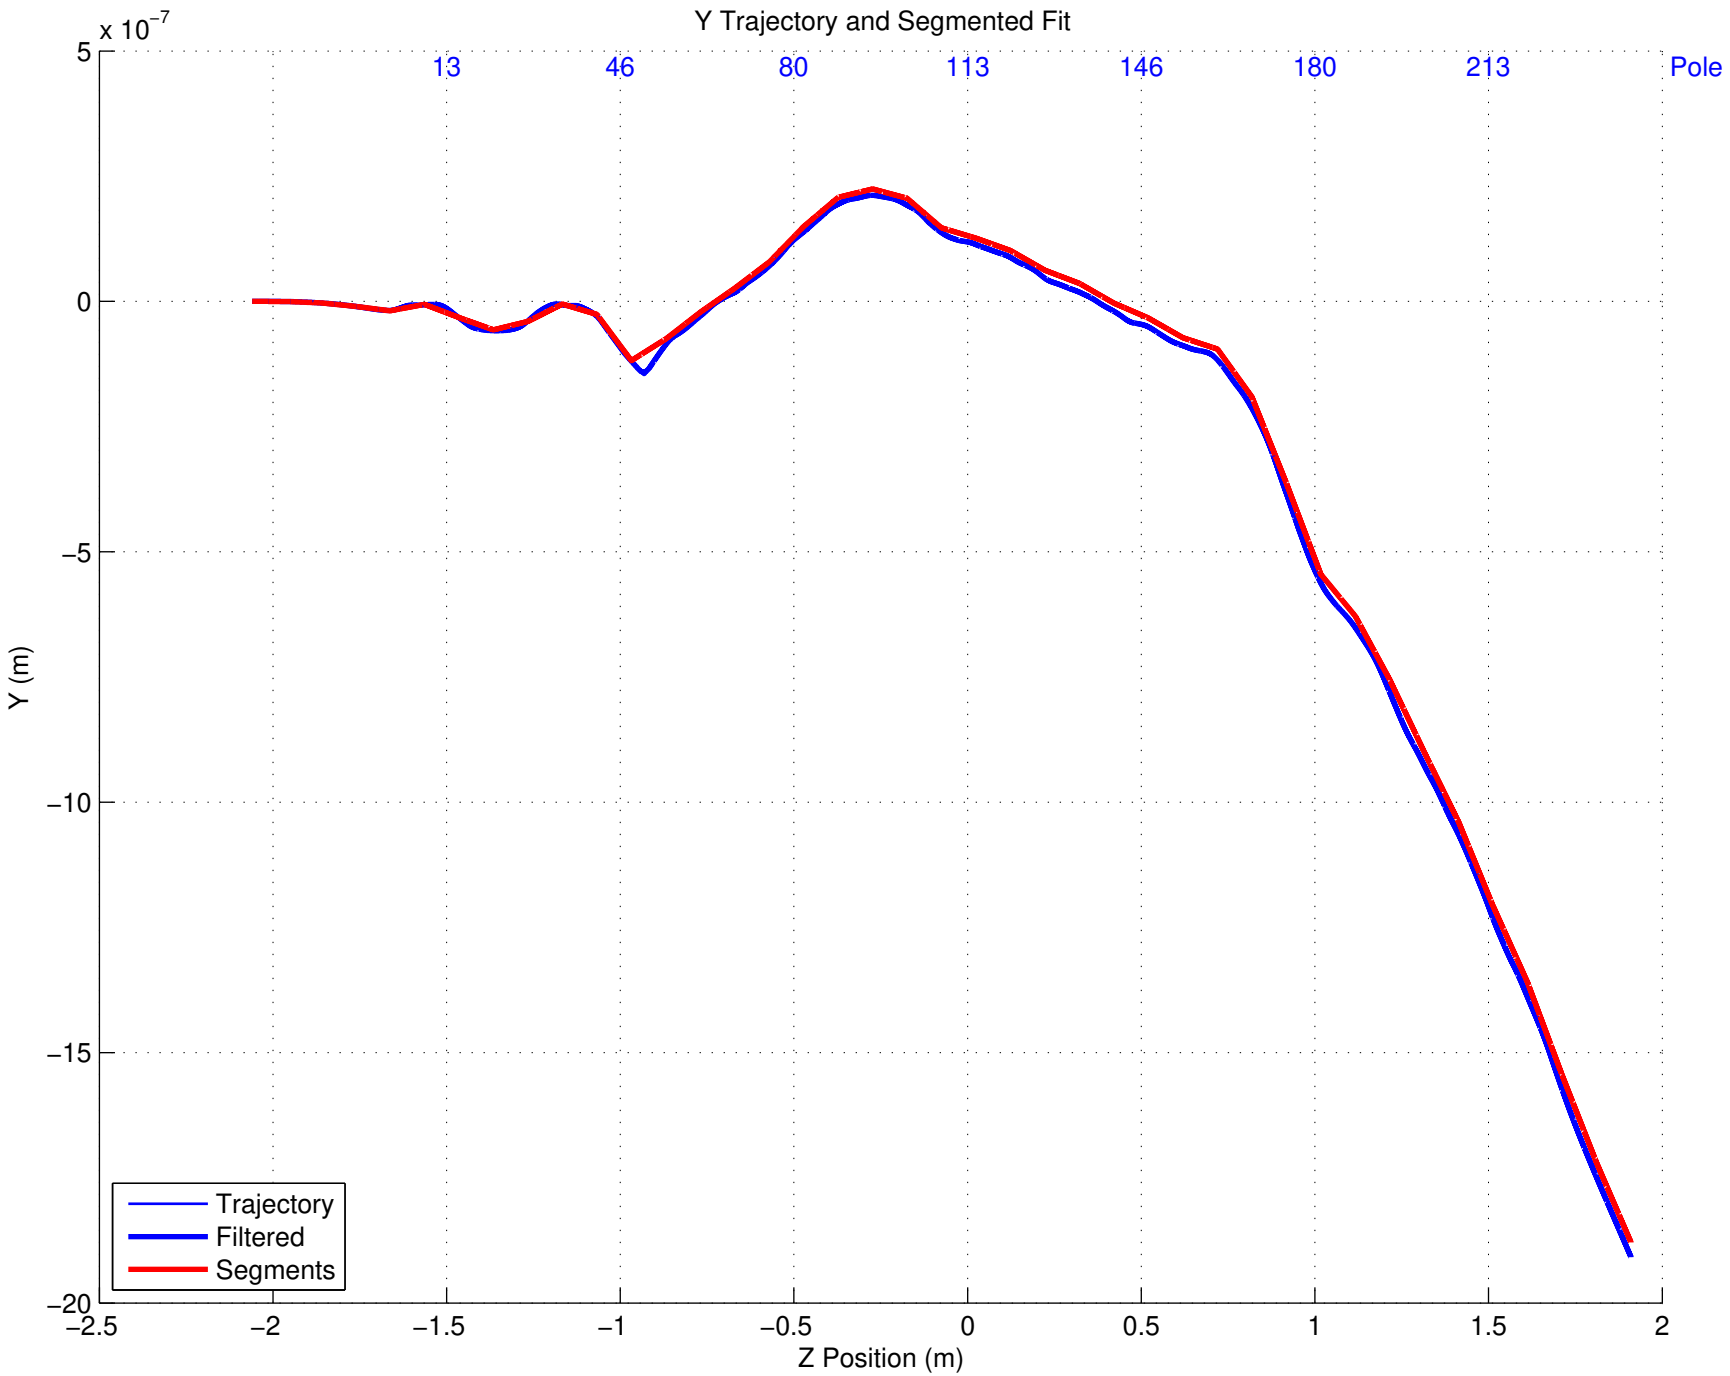
Y Trajectory and Segmented Fit
x 10^-7
5
0
−5
−10
−15
−20
13
46
80
113
146
180
213
Pole
Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

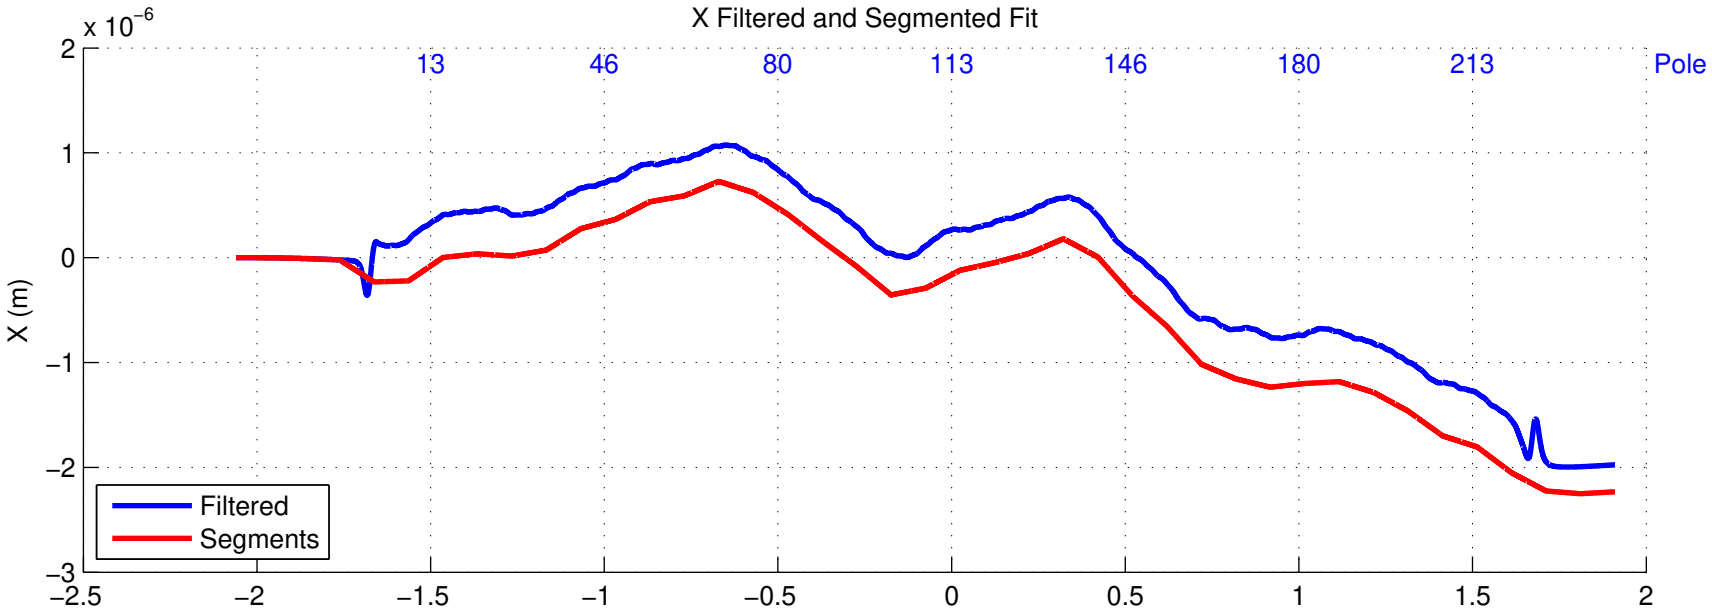
X Filtered and Segmented Fit
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
2
1
0
−1
−2
−3
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

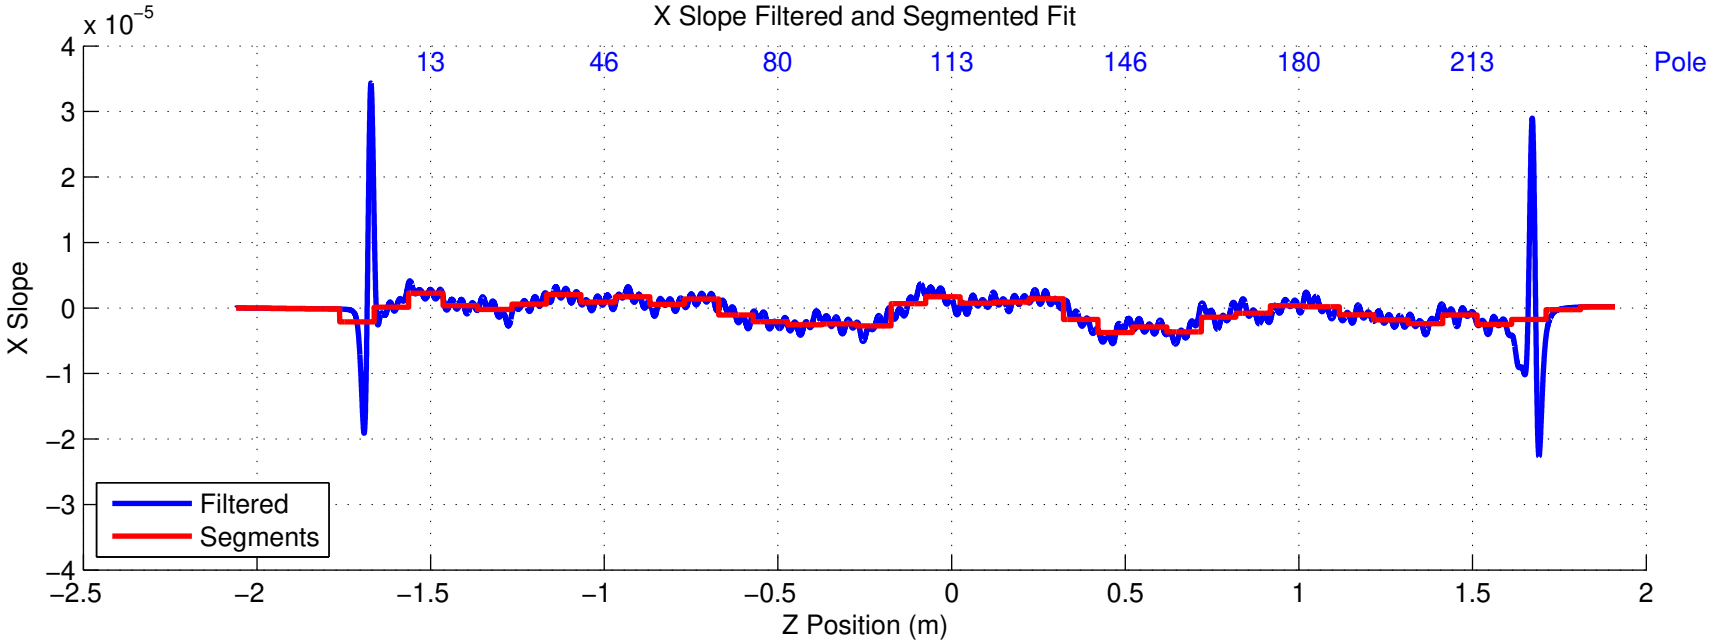
X Slope Filtered and Segmented Fit
x 10^-5
X Slope
13
46
80
113
146
180
213
Pole
Filtered
Segments
4
3
2
1
0
−1
−2
−3
−4
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

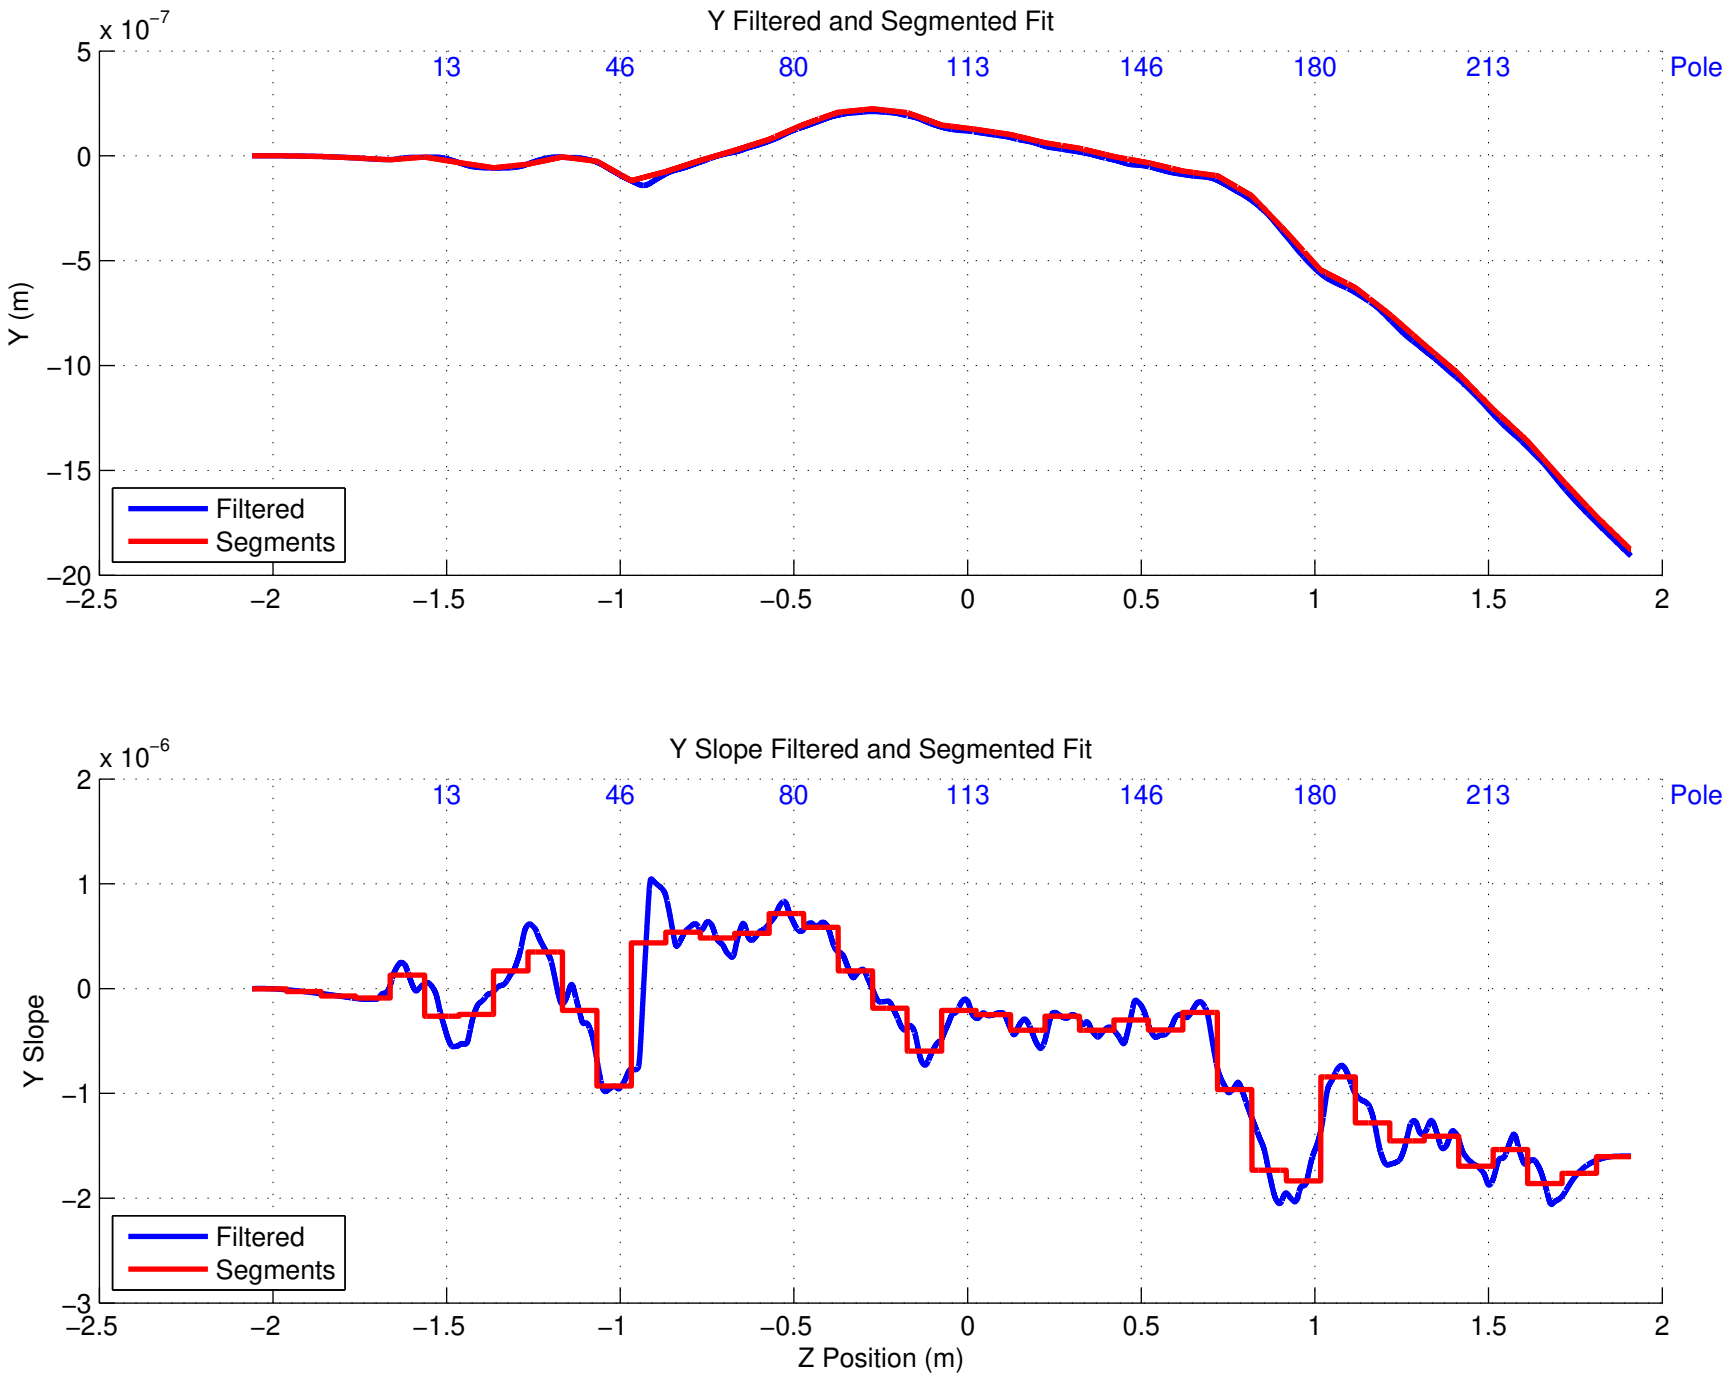
Y Filtered and Segmented Fit
x 10^-7
Y (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
Y Slope Filtered and Segmented Fit
x 10^-6
Y Slope
Z Position (m)

X Original And Shimmed Segmented Trajectories
x 10^-6
13
46
80
113
146
180
213
Pole
X (m)
Original
Shimmed

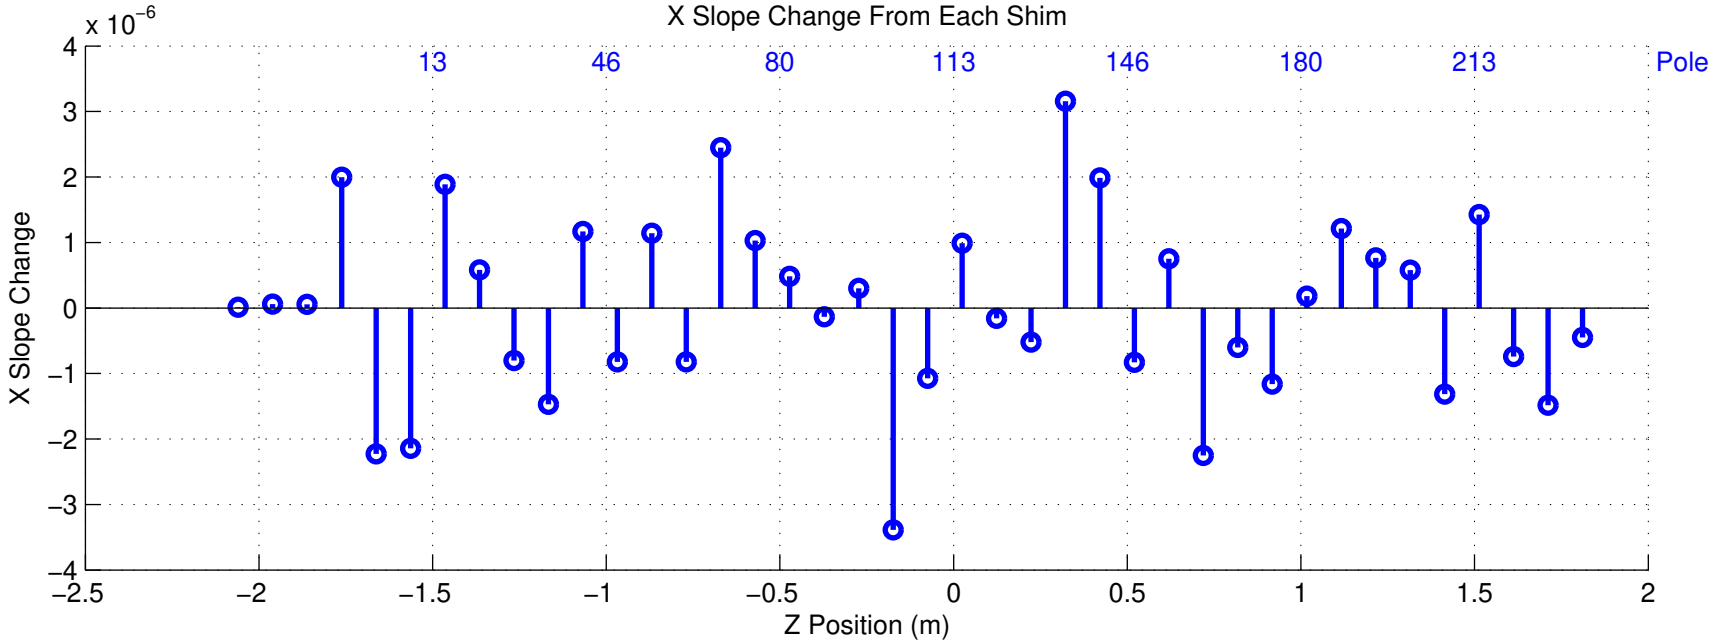
X Slope Change From Each Shim
x 10^-6
13
46
80
113
146
180
213
Pole
X Slope Change
Z Position (m)

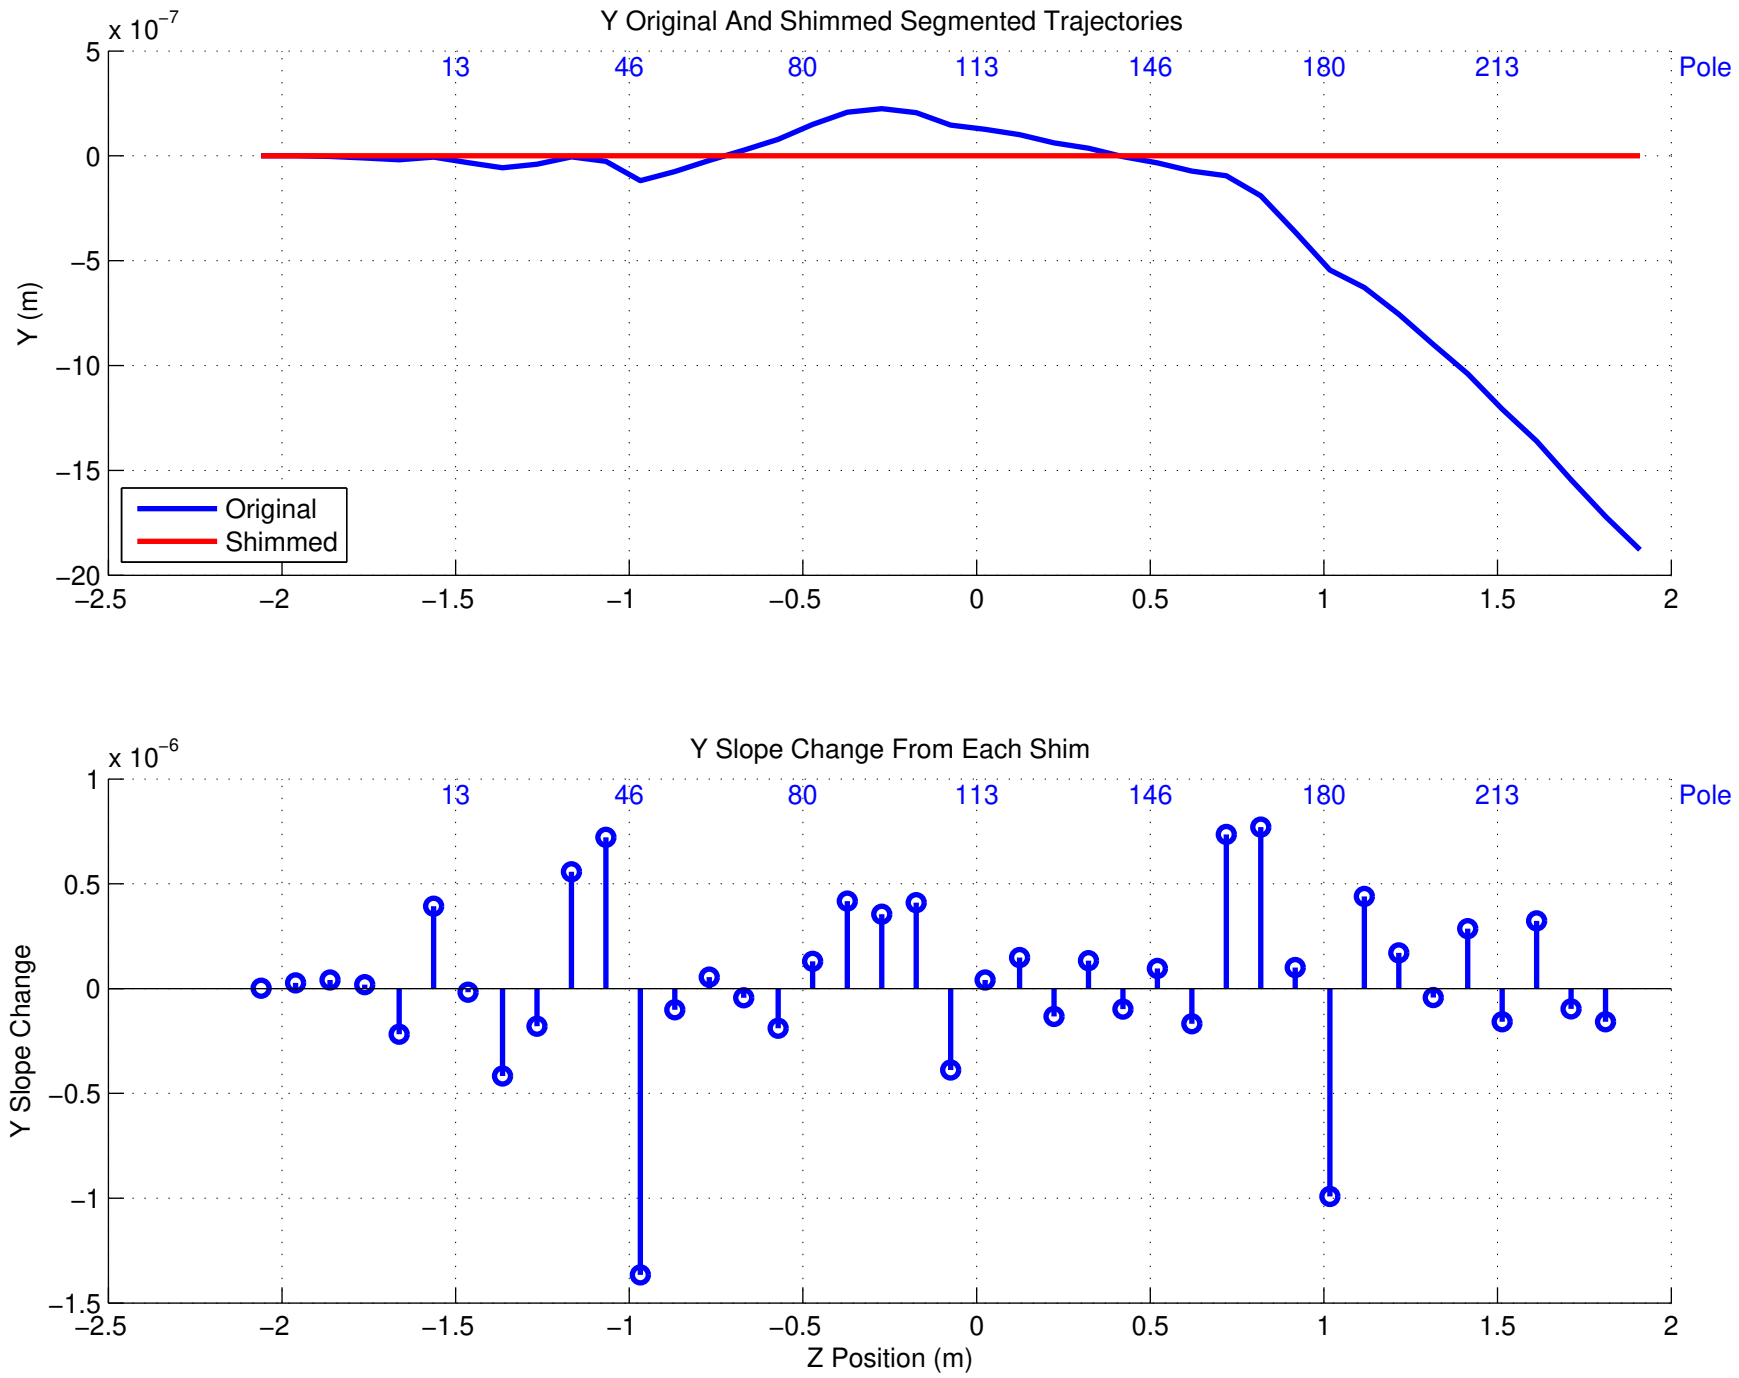
Y Original And Shimmed Segmented Trajectories
x 10^-7
Y (m)
13
46
80
113
146
180
213
Pole
Original
Shimmed
Y Slope Change From Each Shim
x 10^-6
Y Slope Change
Z Position (m)

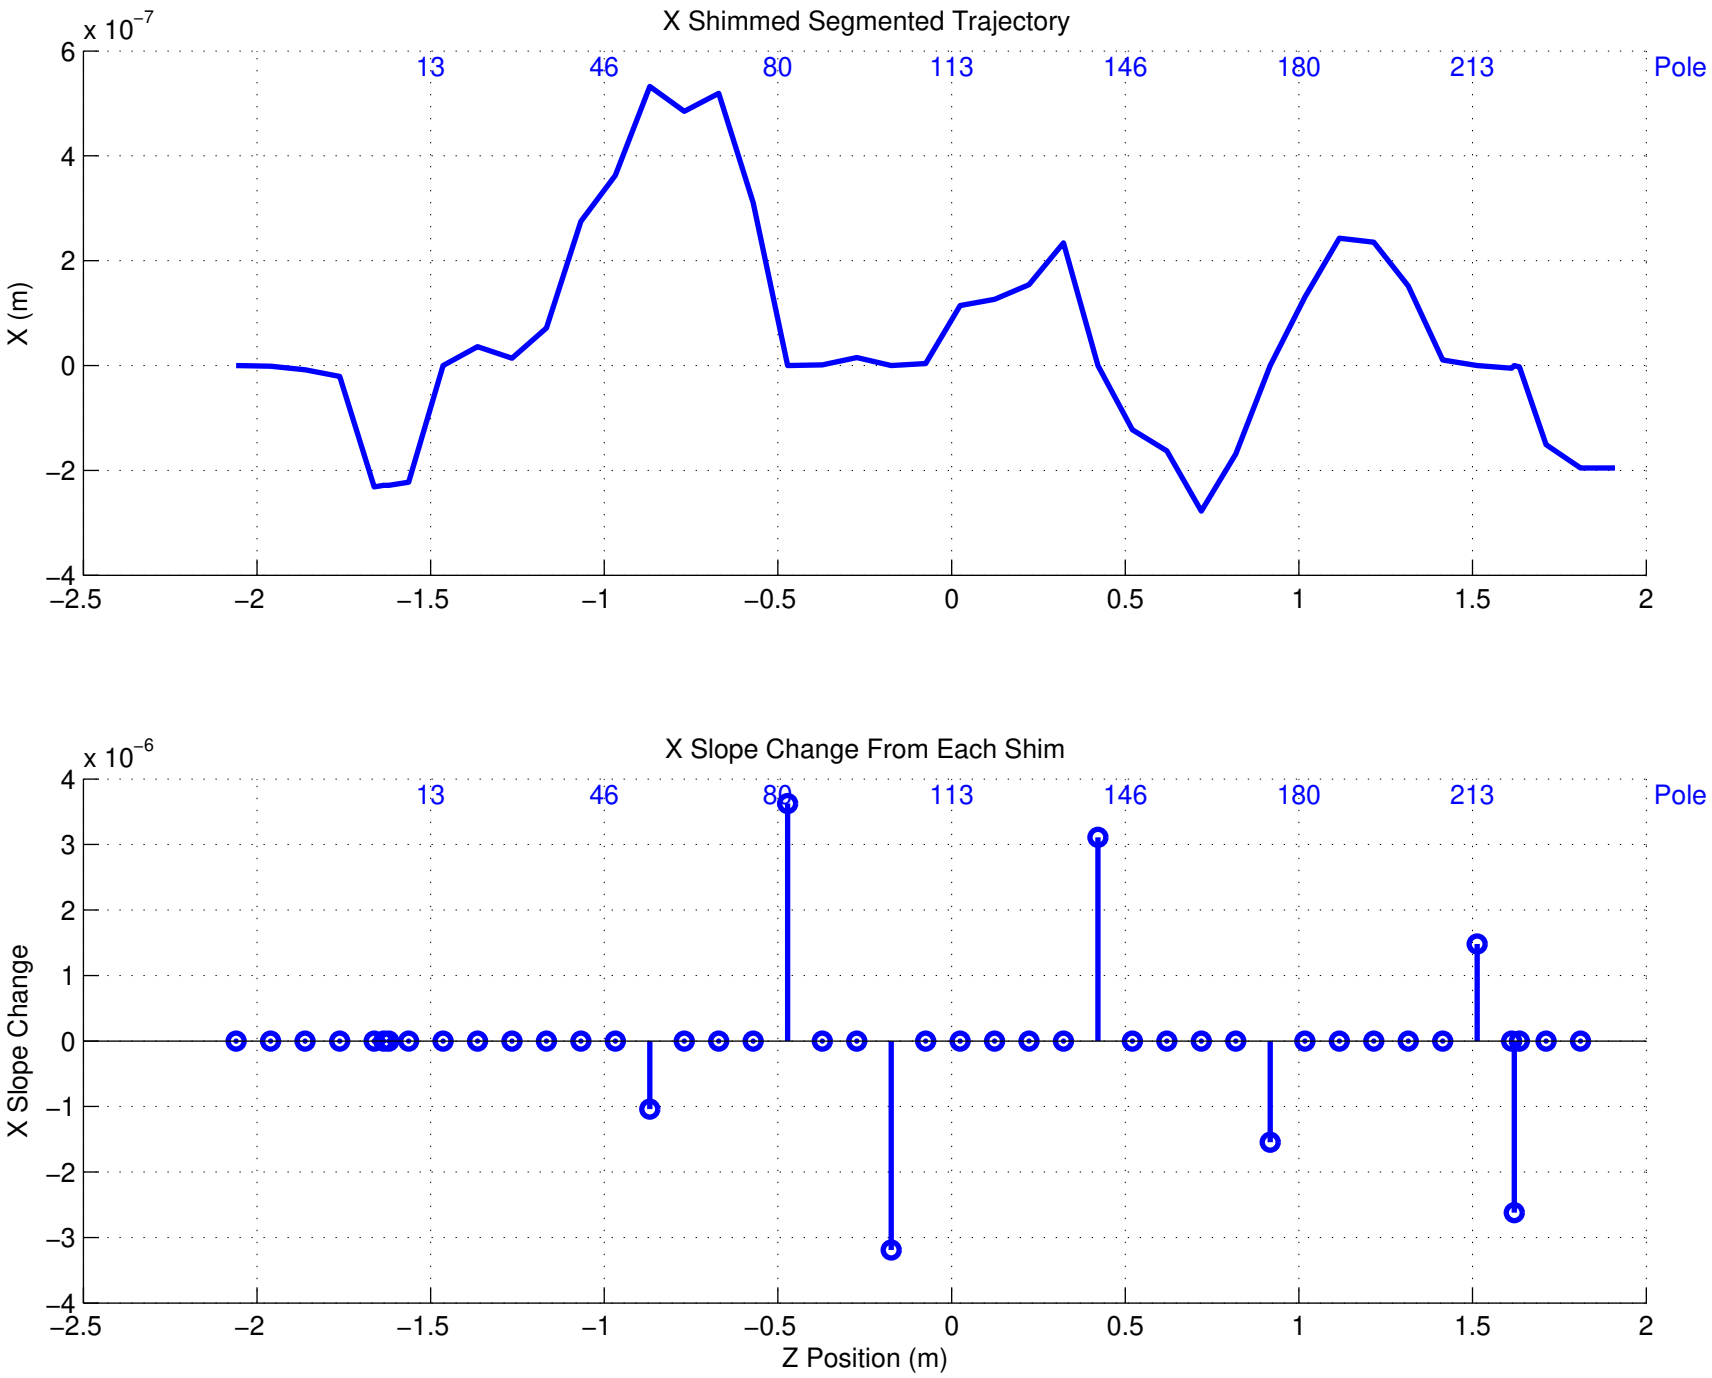
X Shimmed Segmented Trajectory
x 10^-7
X (m)
13
46
80
113
146
180
213
Pole
6
4
2
0
−2
−4
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
X Slope Change From Each Shim
x 10^-6
X Slope Change
Z Position (m)
4
3
2
1
0
−1
−2
−3
−4

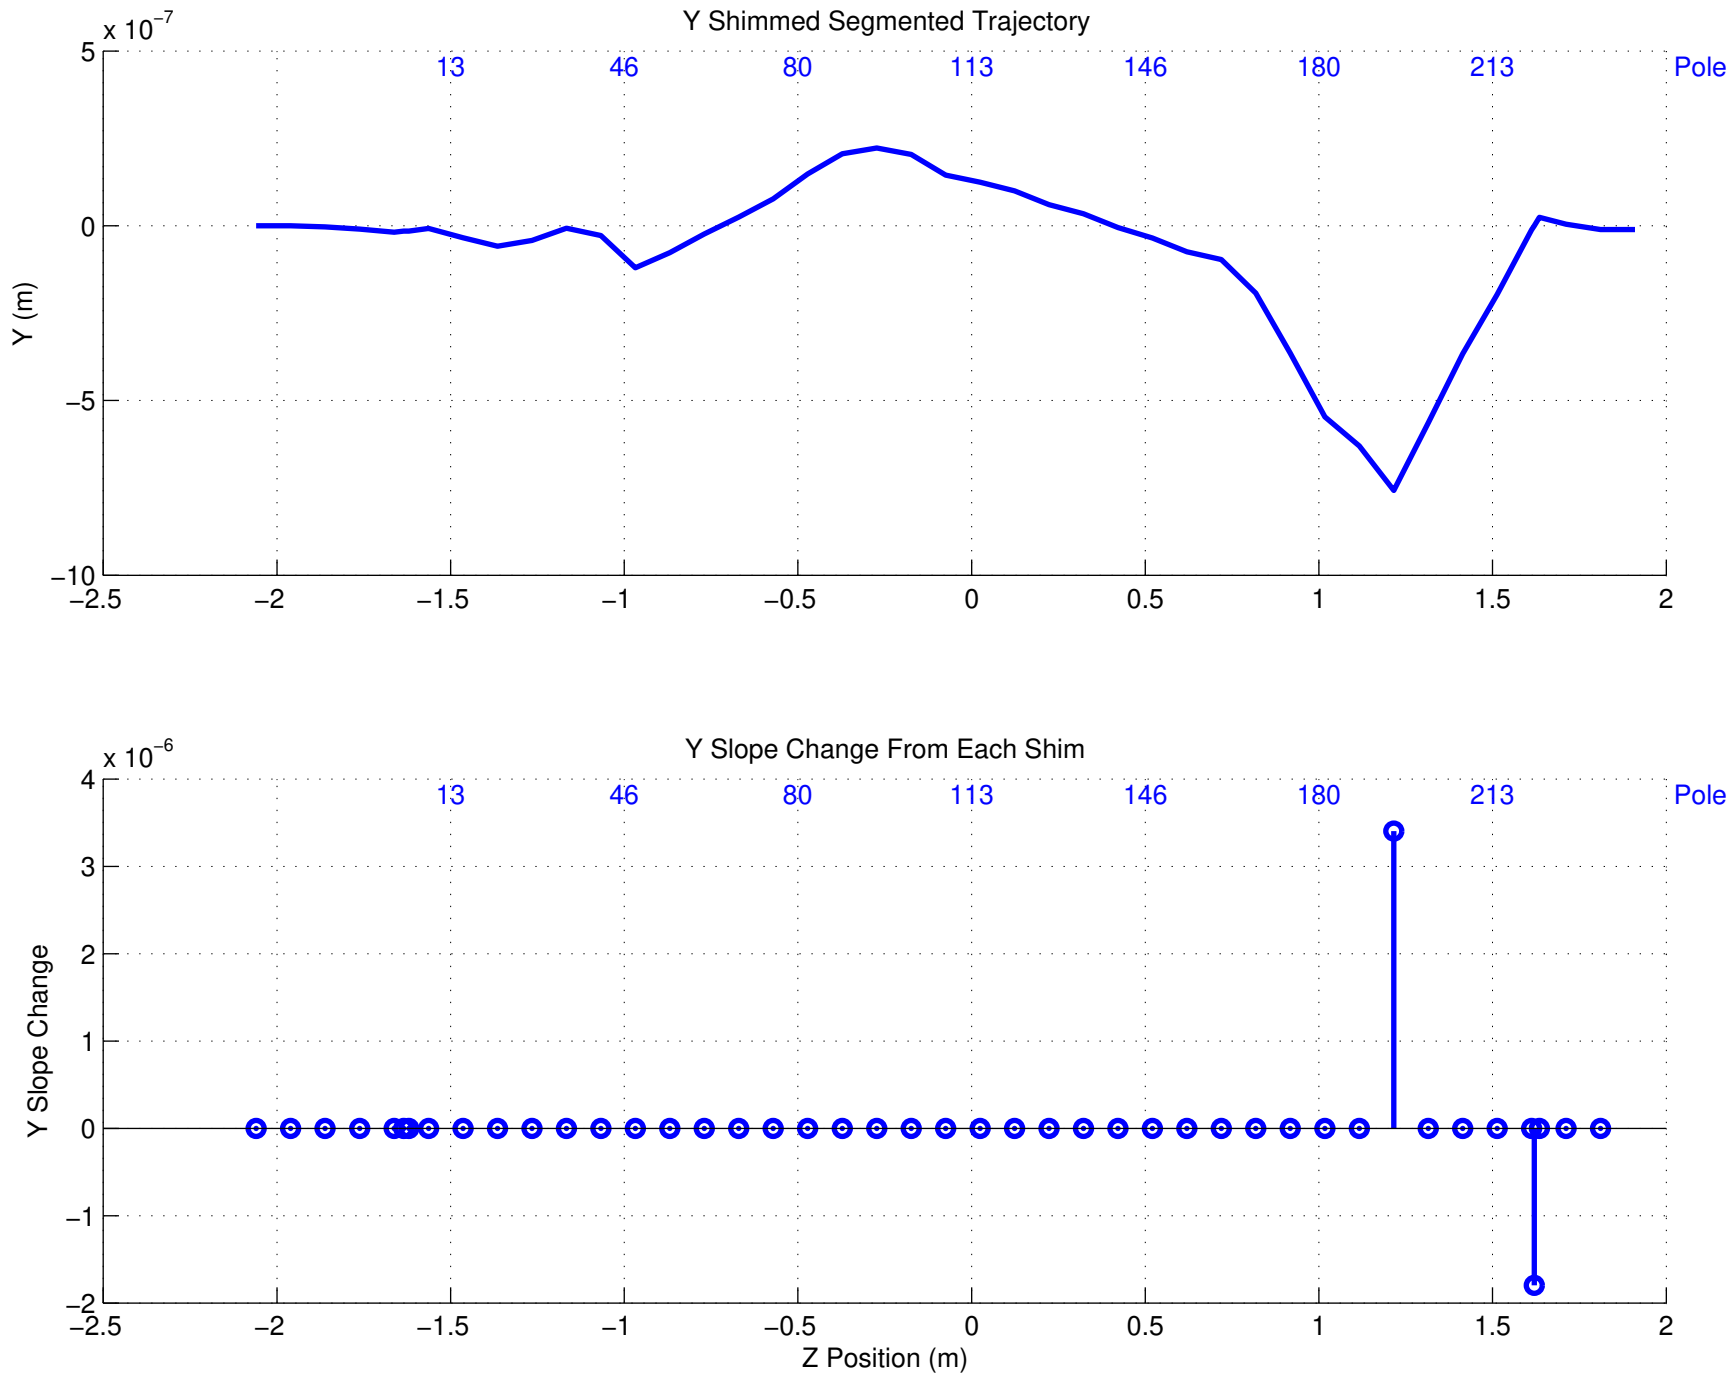
Y Shimmed Segmented Trajectory
x 10^-7
Y (m)
13
46
80
113
146
180
213
Pole
5
0
−5
−10
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Y Slope Change From Each Shim
x 10^-6
Y Slope Change
4
3
2
1
0
−1
−2
Z Position (m)

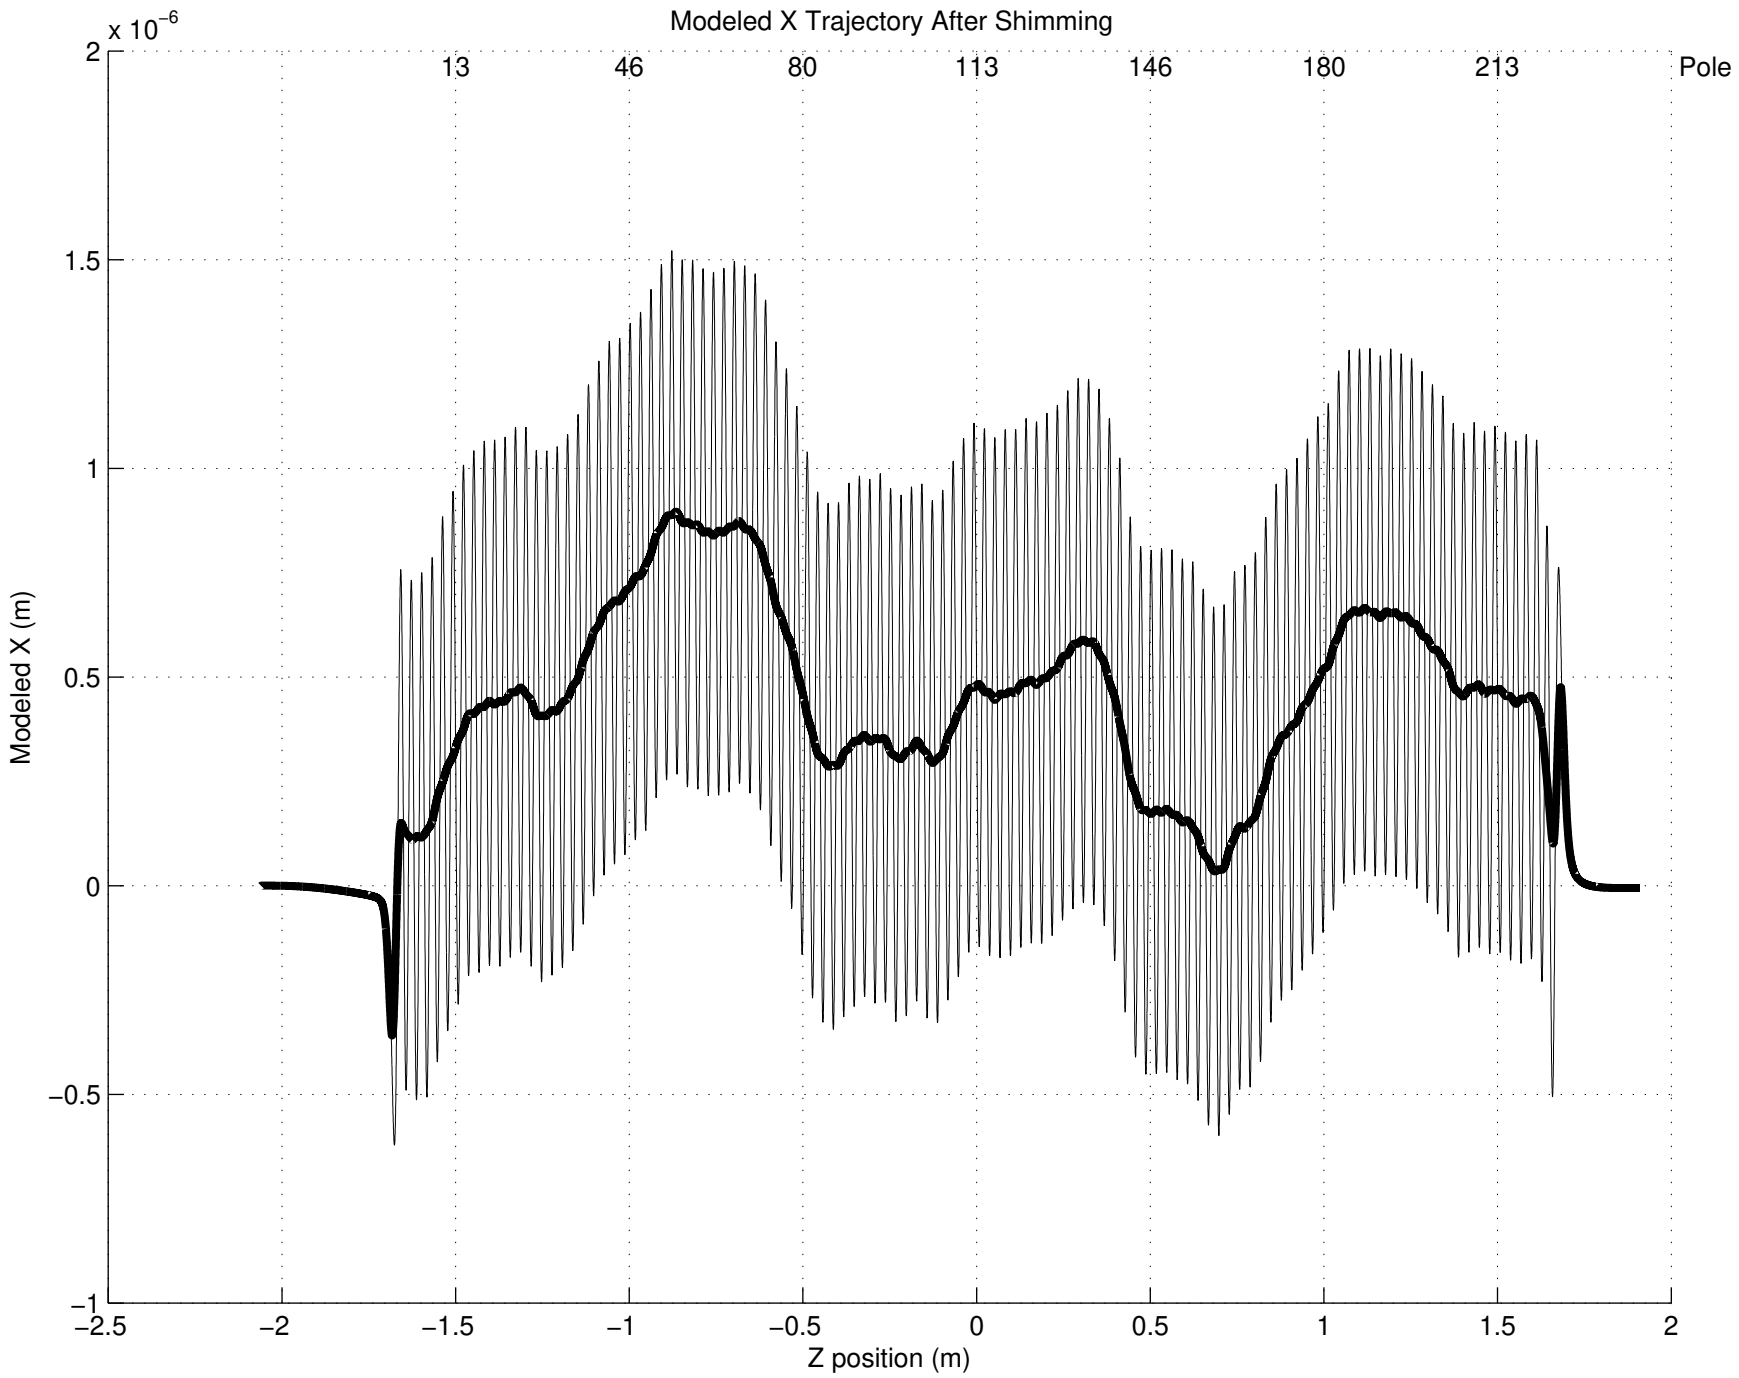
Modeled X Trajectory After Shimming
x 10^-6
2
1.5
1
0.5
0
−0.5
−1
13
46
80
113
146
180
213
Pole
Modeled X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

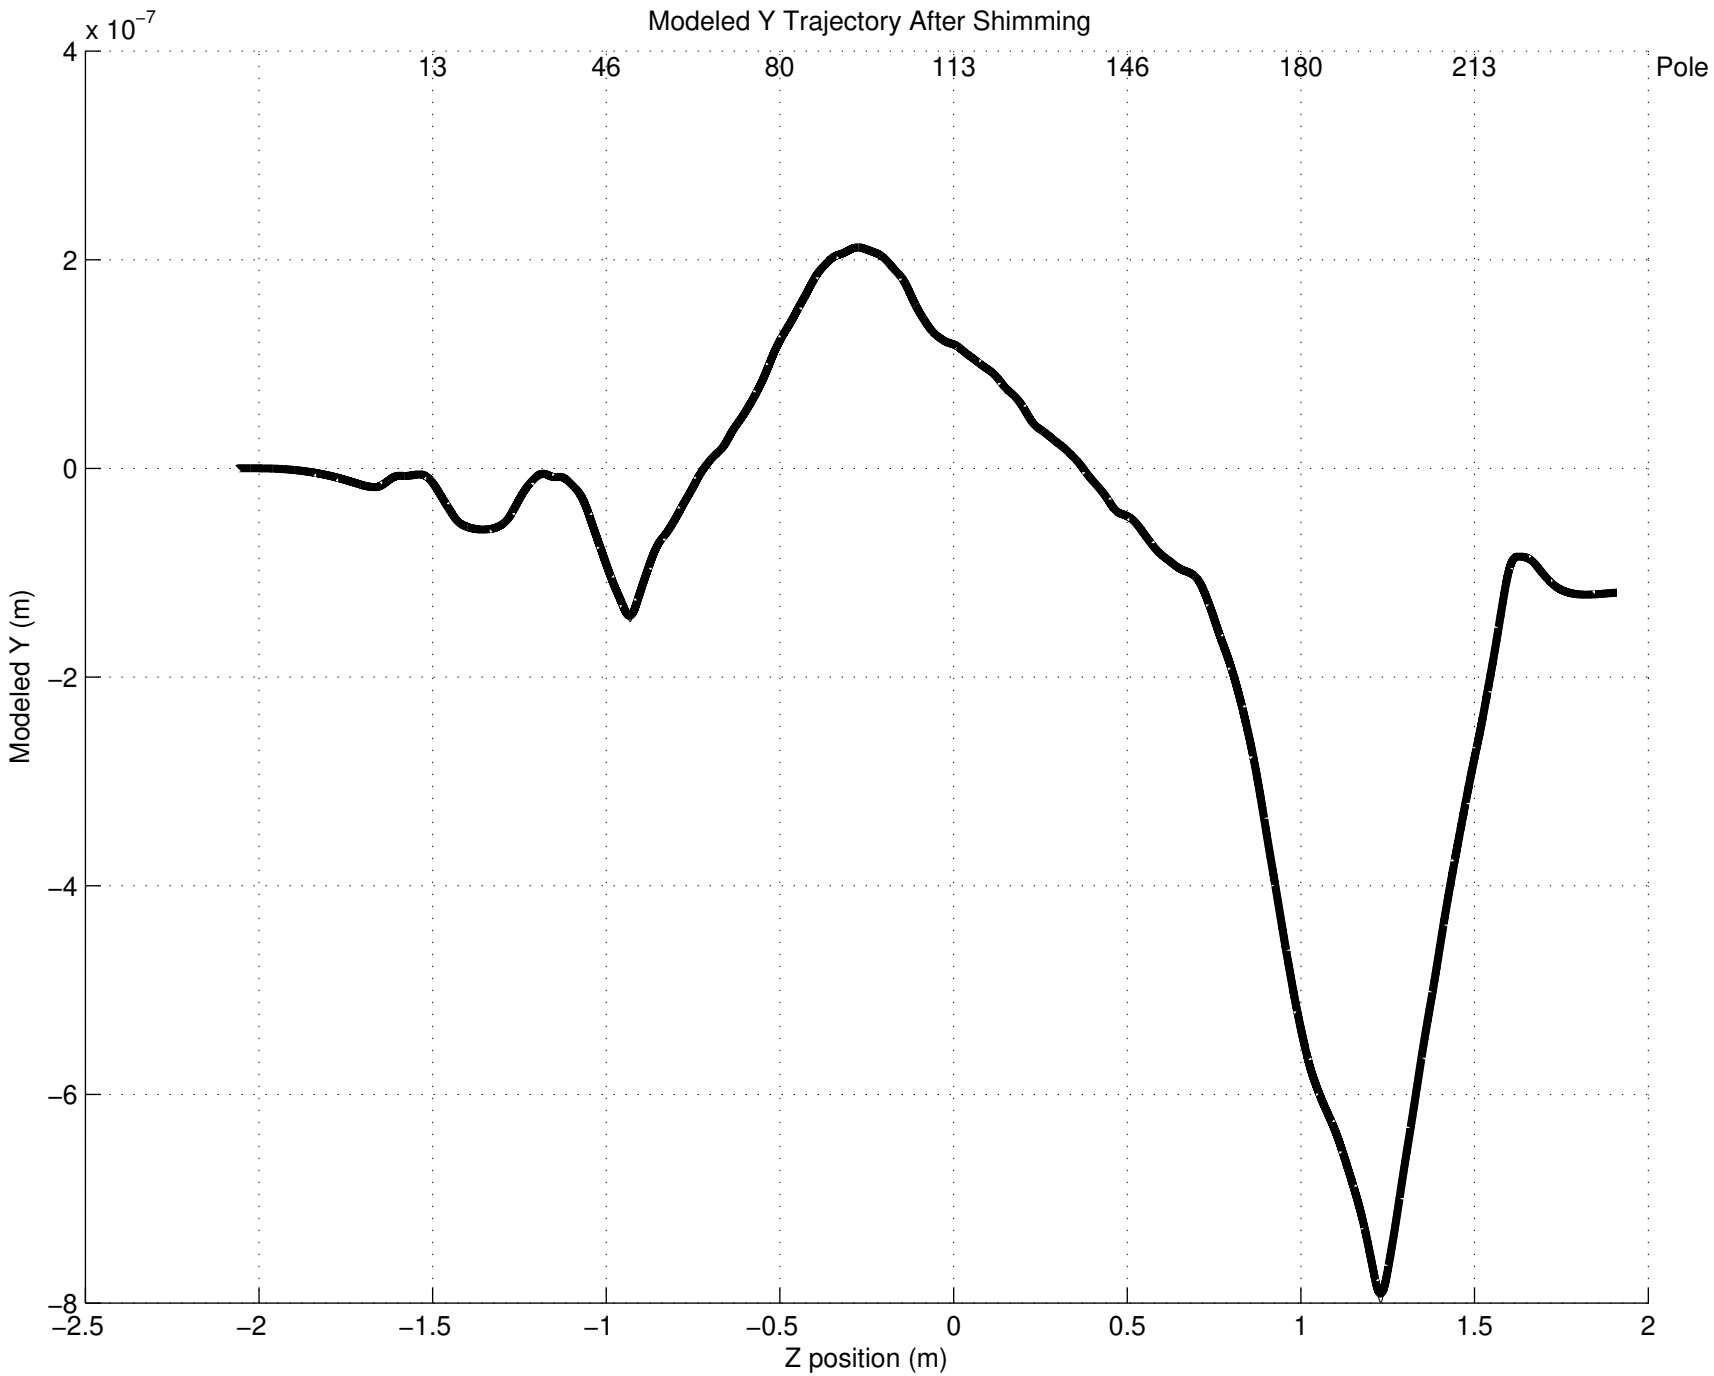
Modeled Y Trajectory After Shimming
x 10^-7
4
2
0
−2
−4
−6
−8
13
46
80
113
146
180
213
Pole
Modeled Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

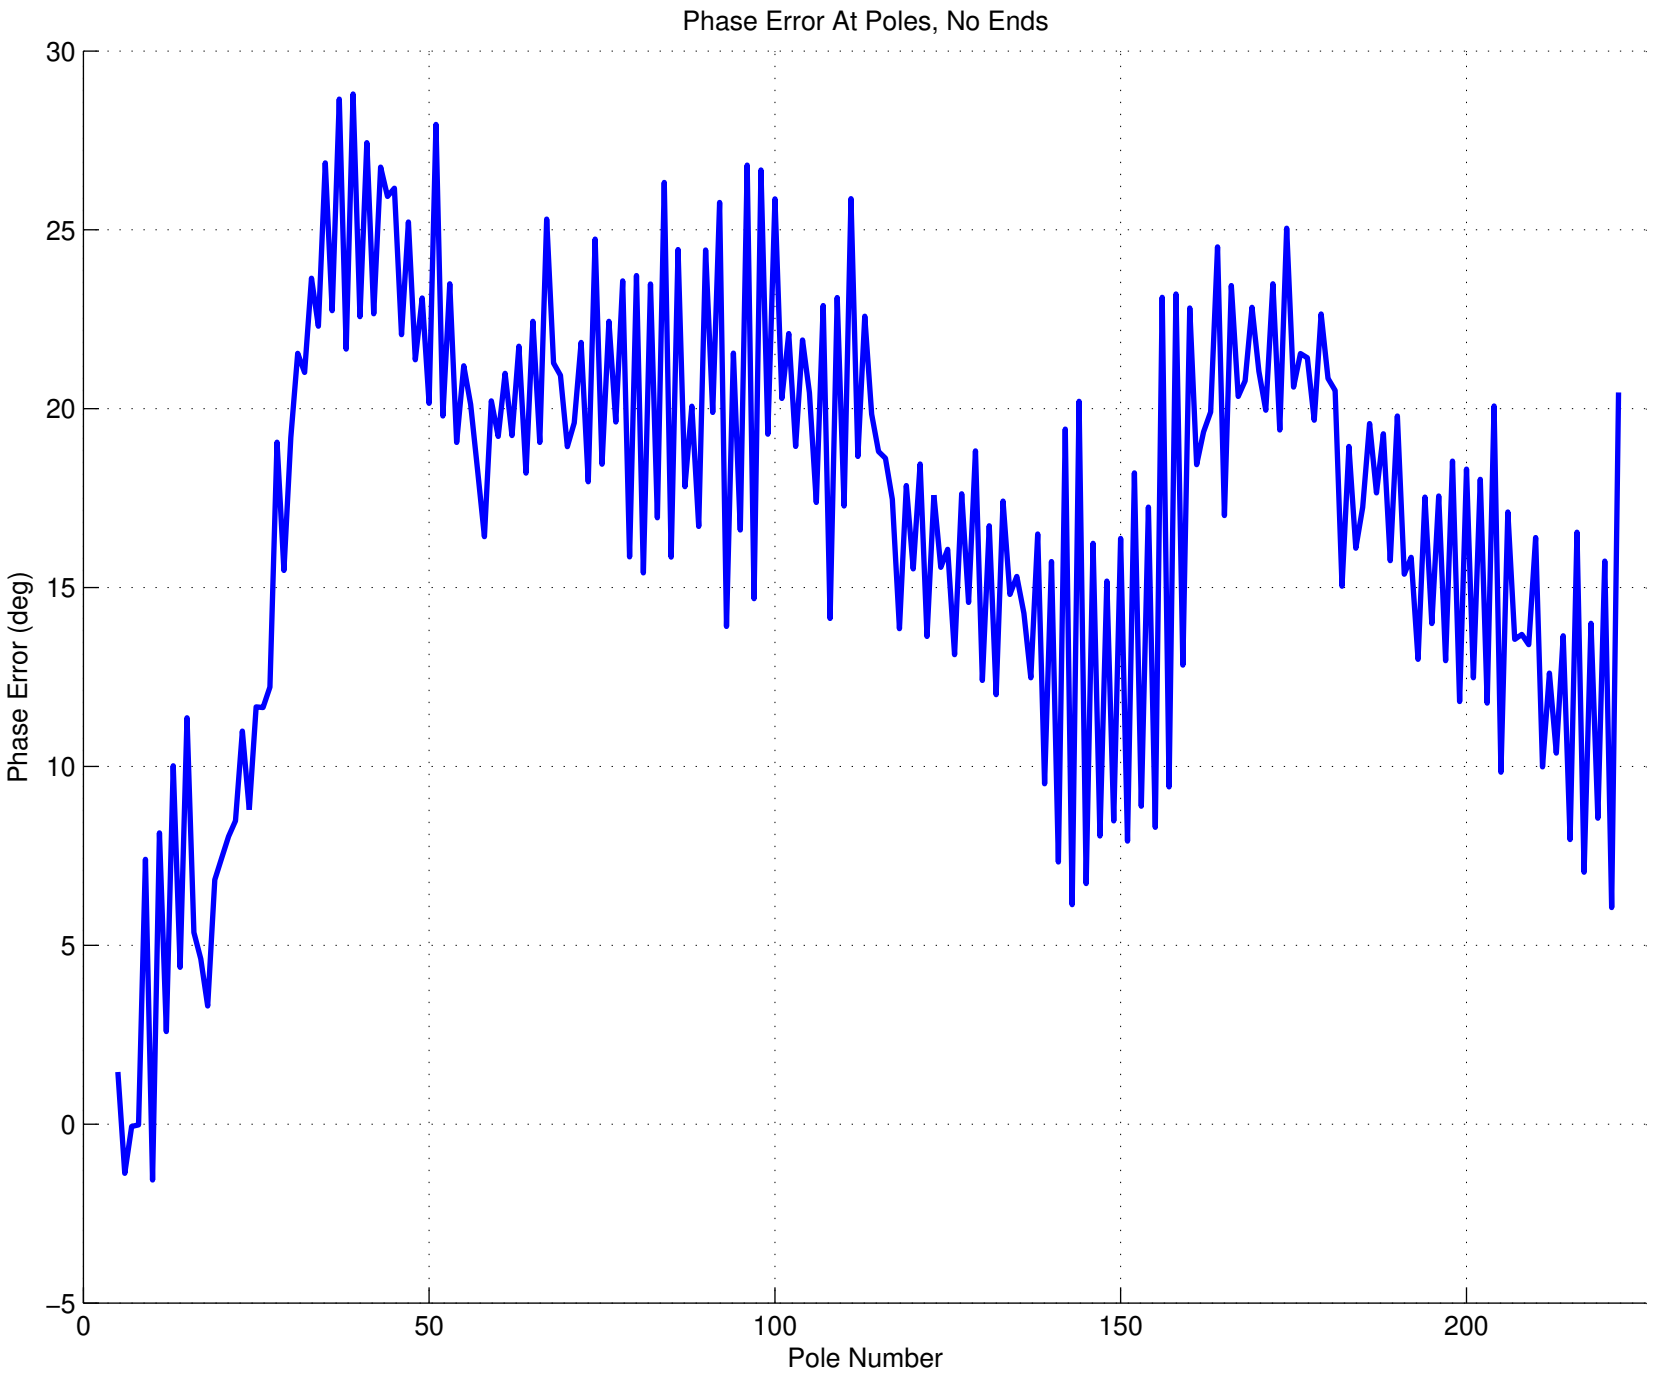
Phase Error At Poles, No Ends
Phase Error (deg)
Pole Number
30
25
20
15
10
5
0
−5
0
50
100
150
200

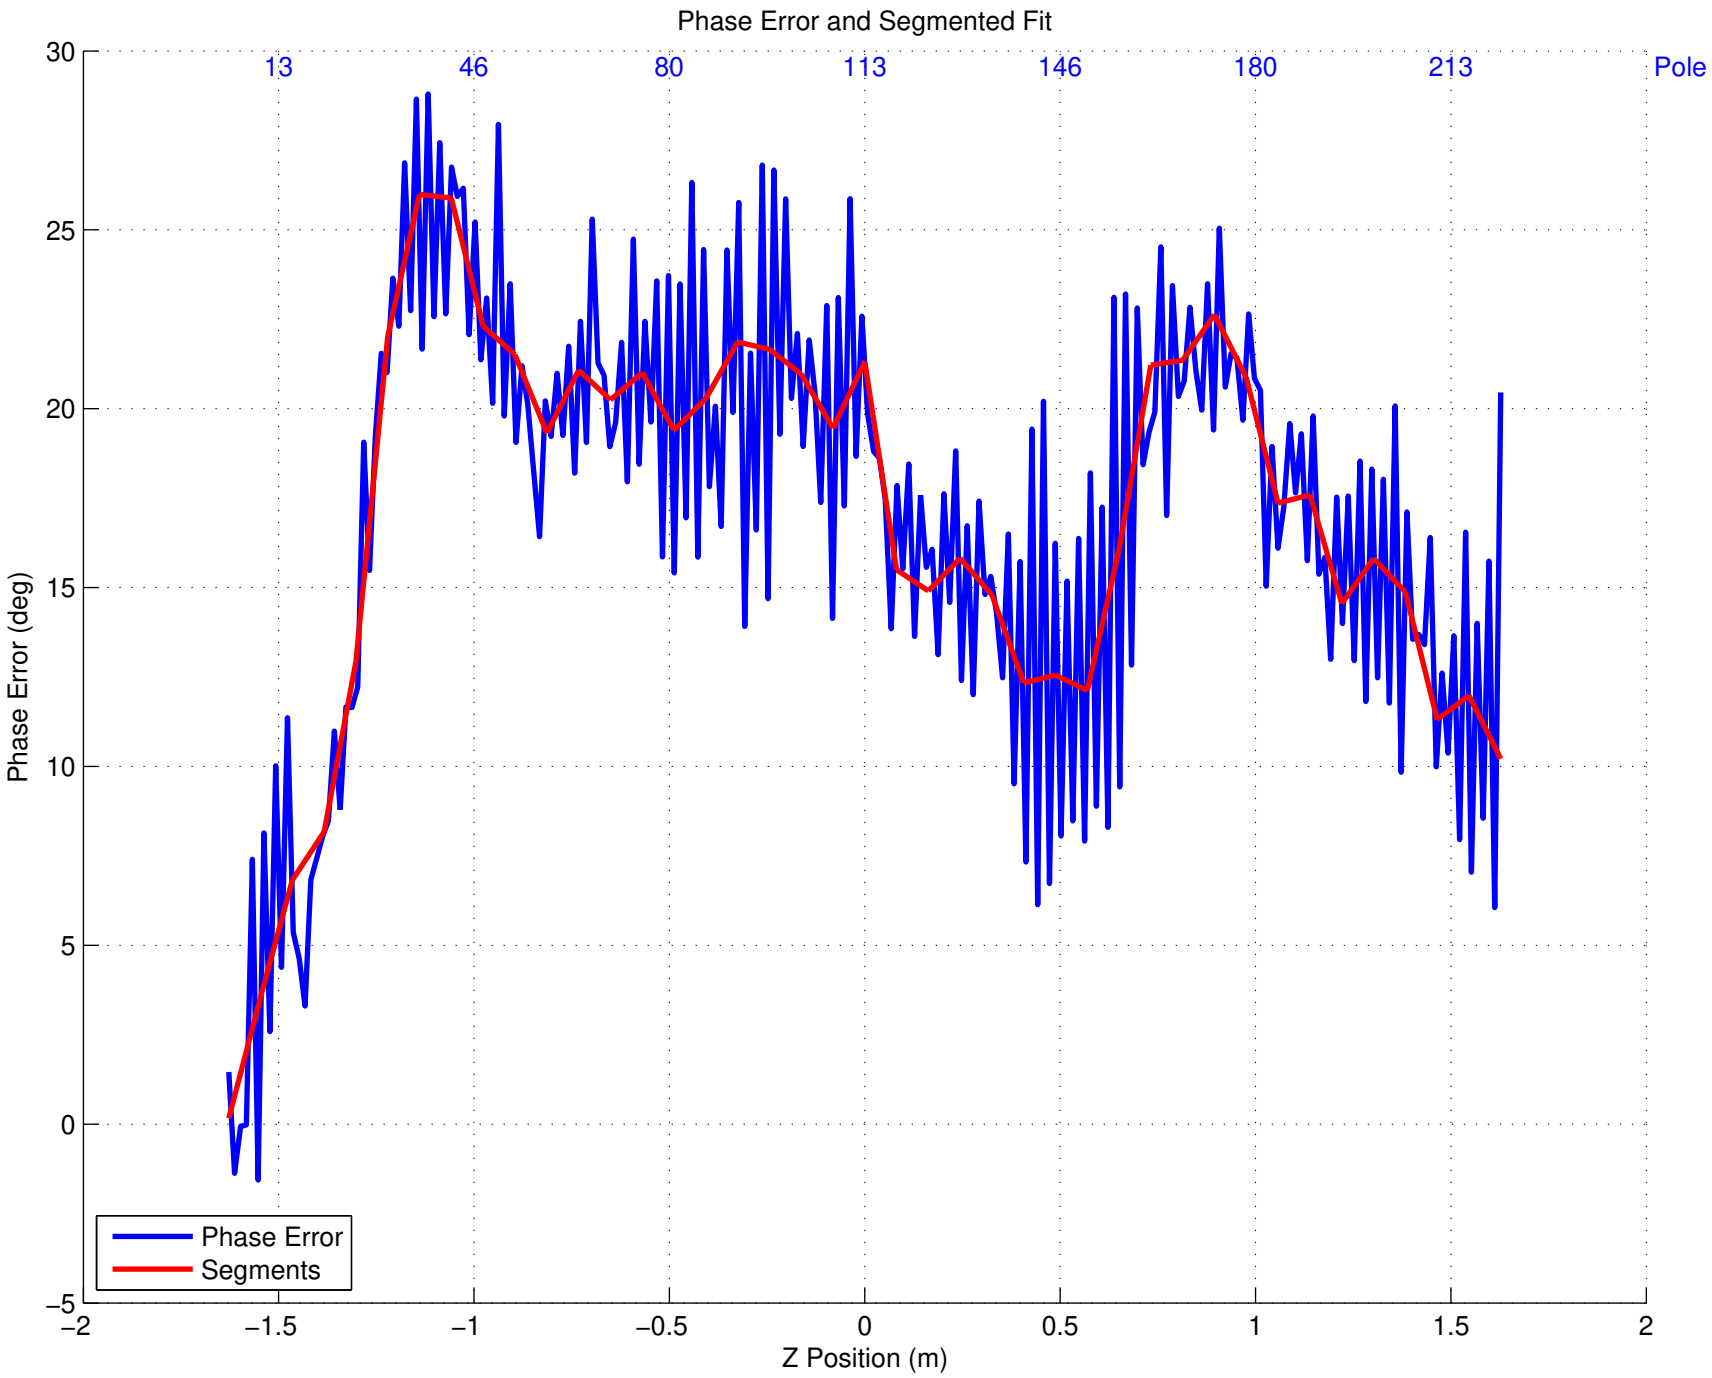
Phase Error and Segmented Fit
13
46
80
113
146
180
213
Pole
30
25
20
15
10
5
0
−5
Phase Error (deg)
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Phase Error
Segments

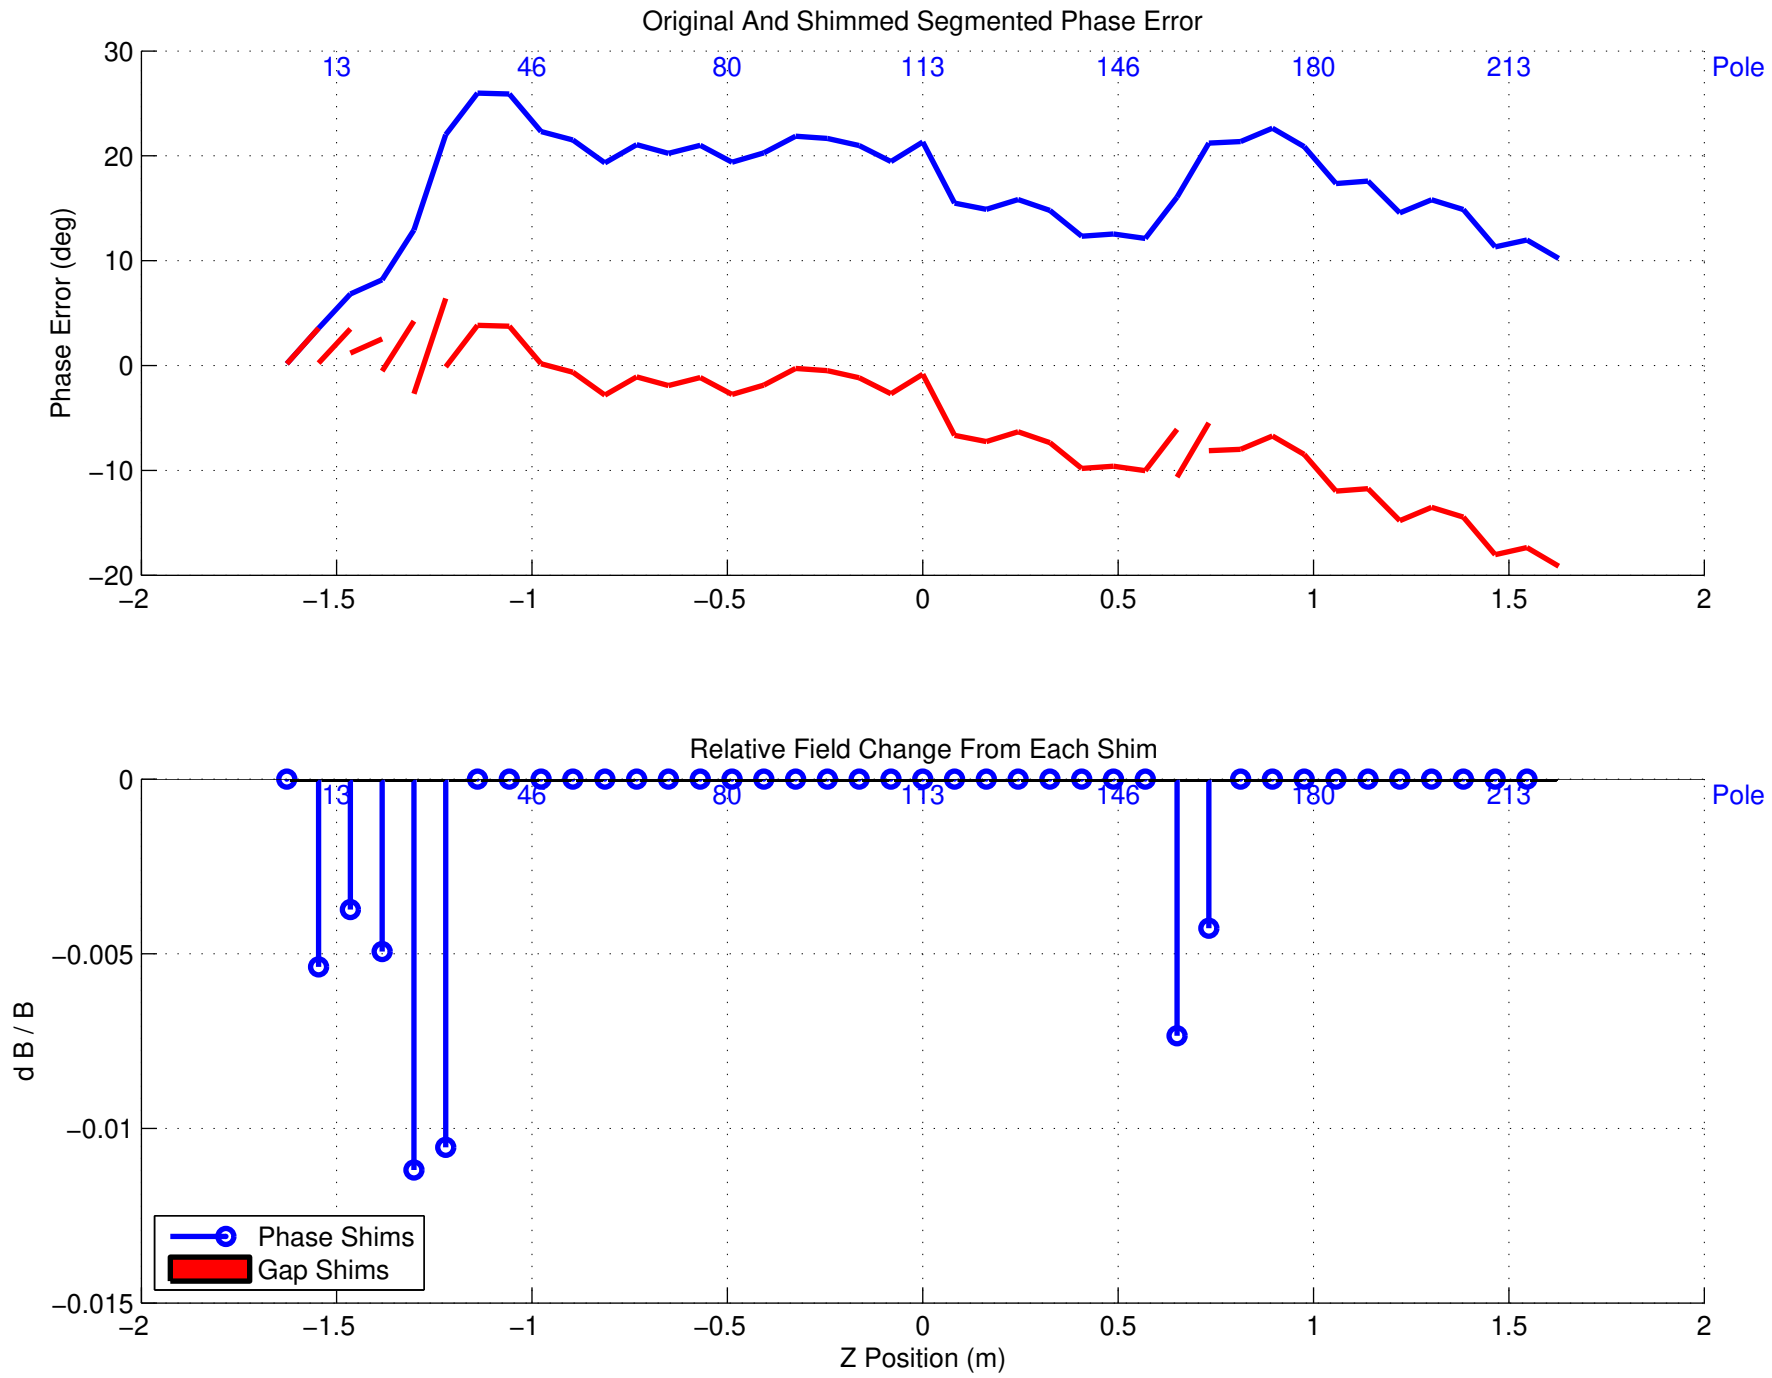
Original And Shimmed Segmented Phase Error
Phase Error (deg)
30
20
10
0
−10
−20
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
d B / B
0
−0.005
−0.01
−0.015
Phase Shims
Gap Shims
Z Position (m)

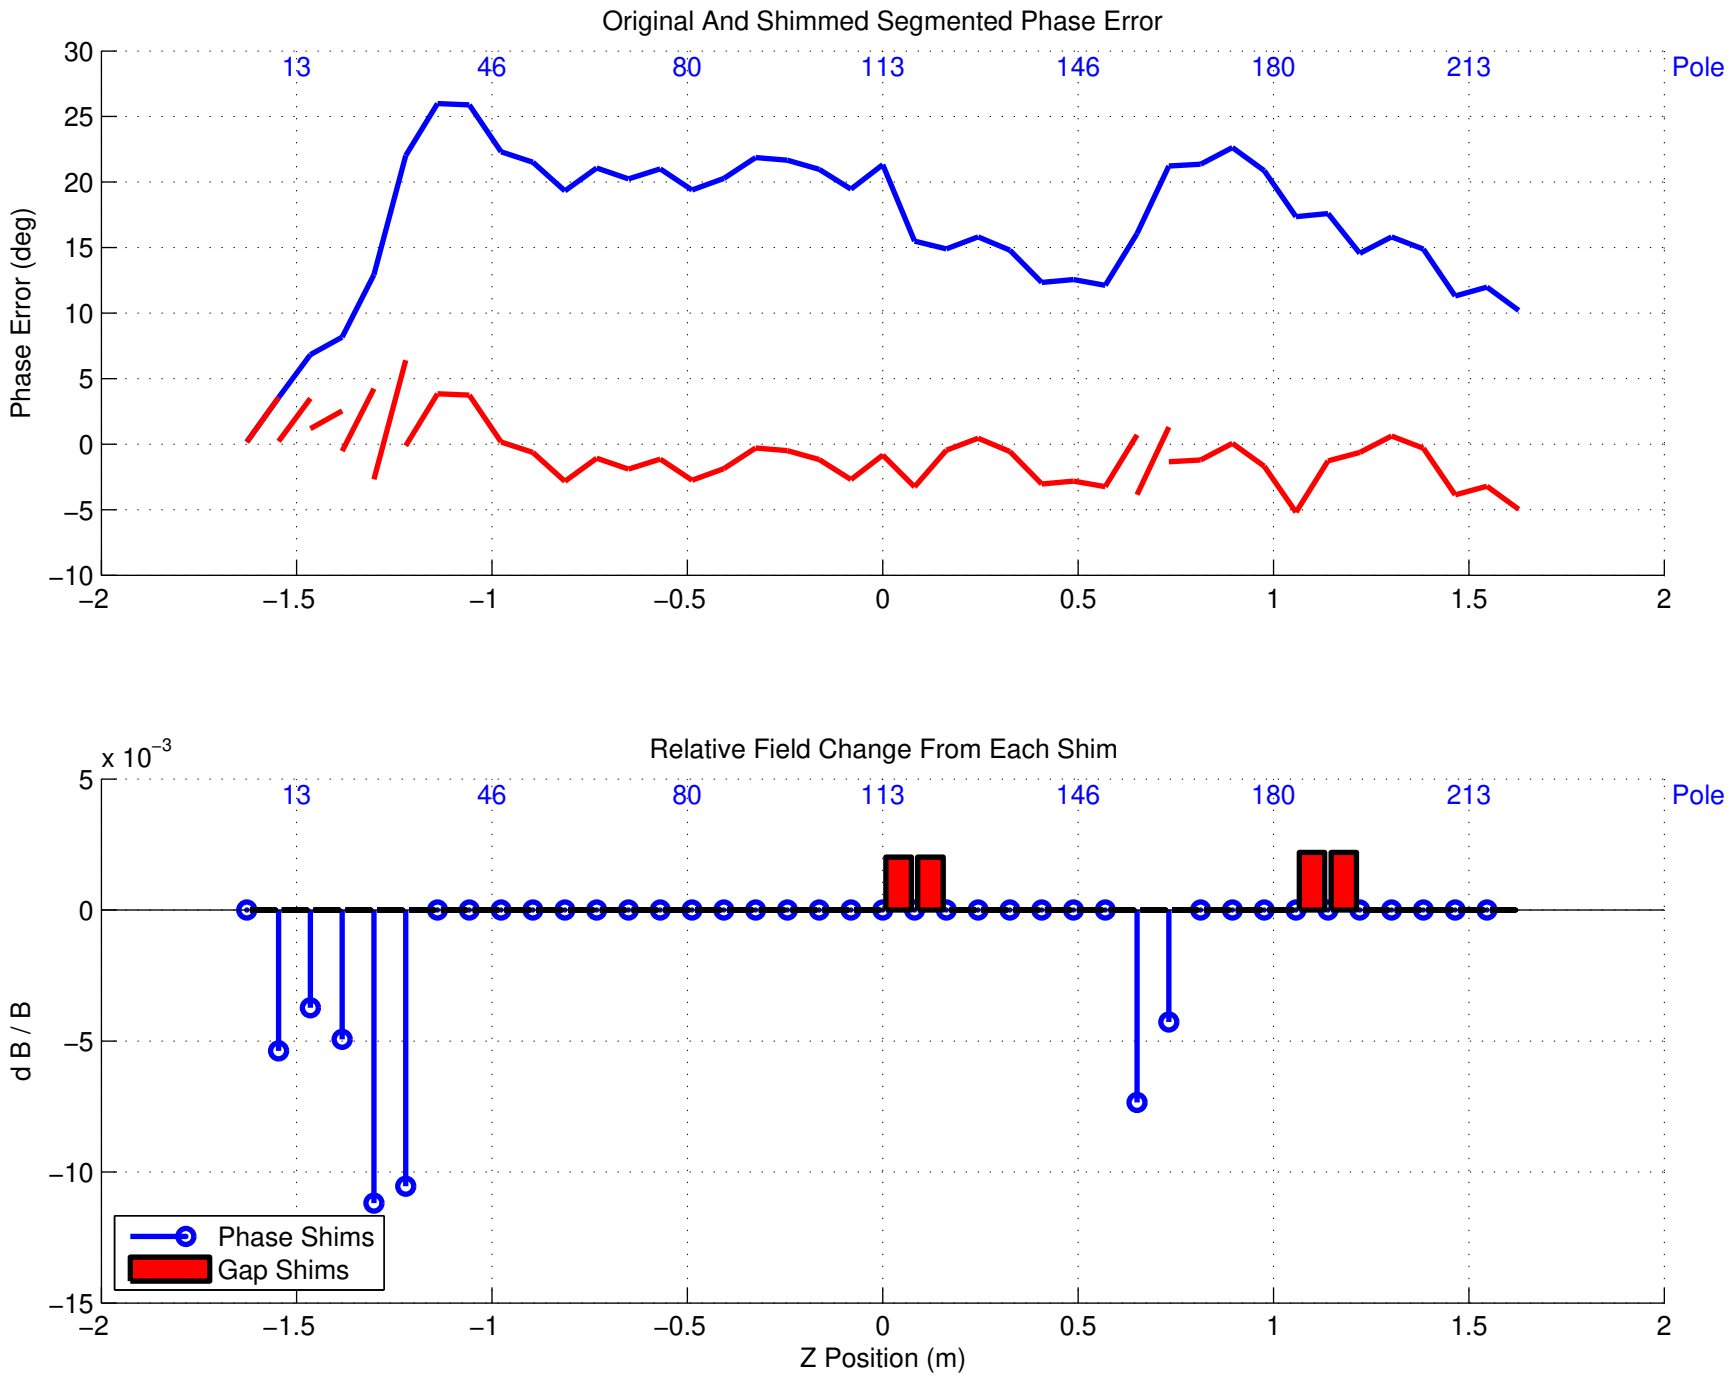
Original And Shimmed Segmented Phase Error
Phase Error (deg)
13
46
80
113
146
180
213
Pole
30
25
20
15
10
5
0
−5
−10
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
Phase Shims
Gap Shims
Z Position (m)

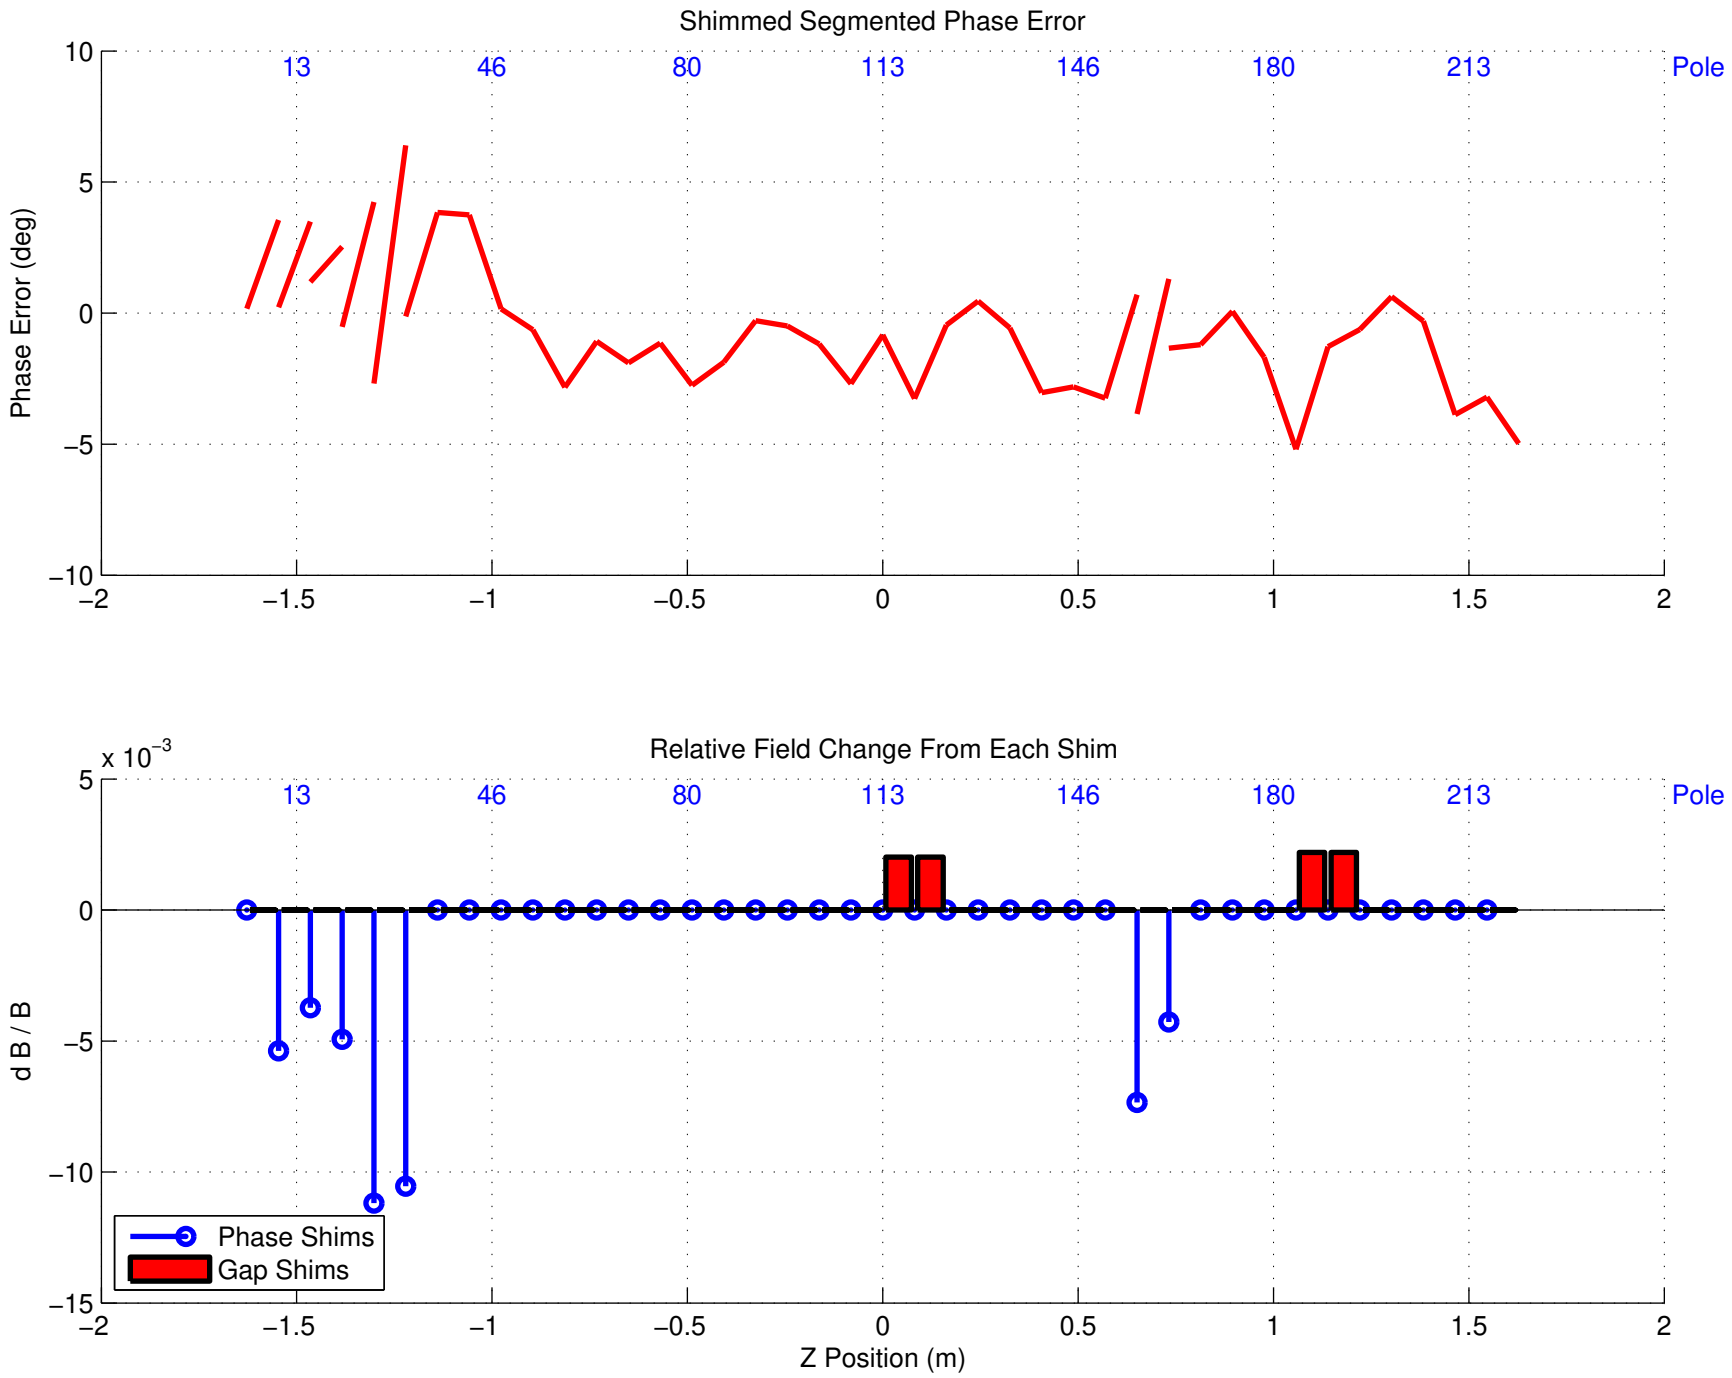
Shimmed Segmented Phase Error
Phase Error (deg)
10
5
0
−5
−10
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
5
0
−5
−10
−15
Phase Shims
Gap Shims
Z Position (m)

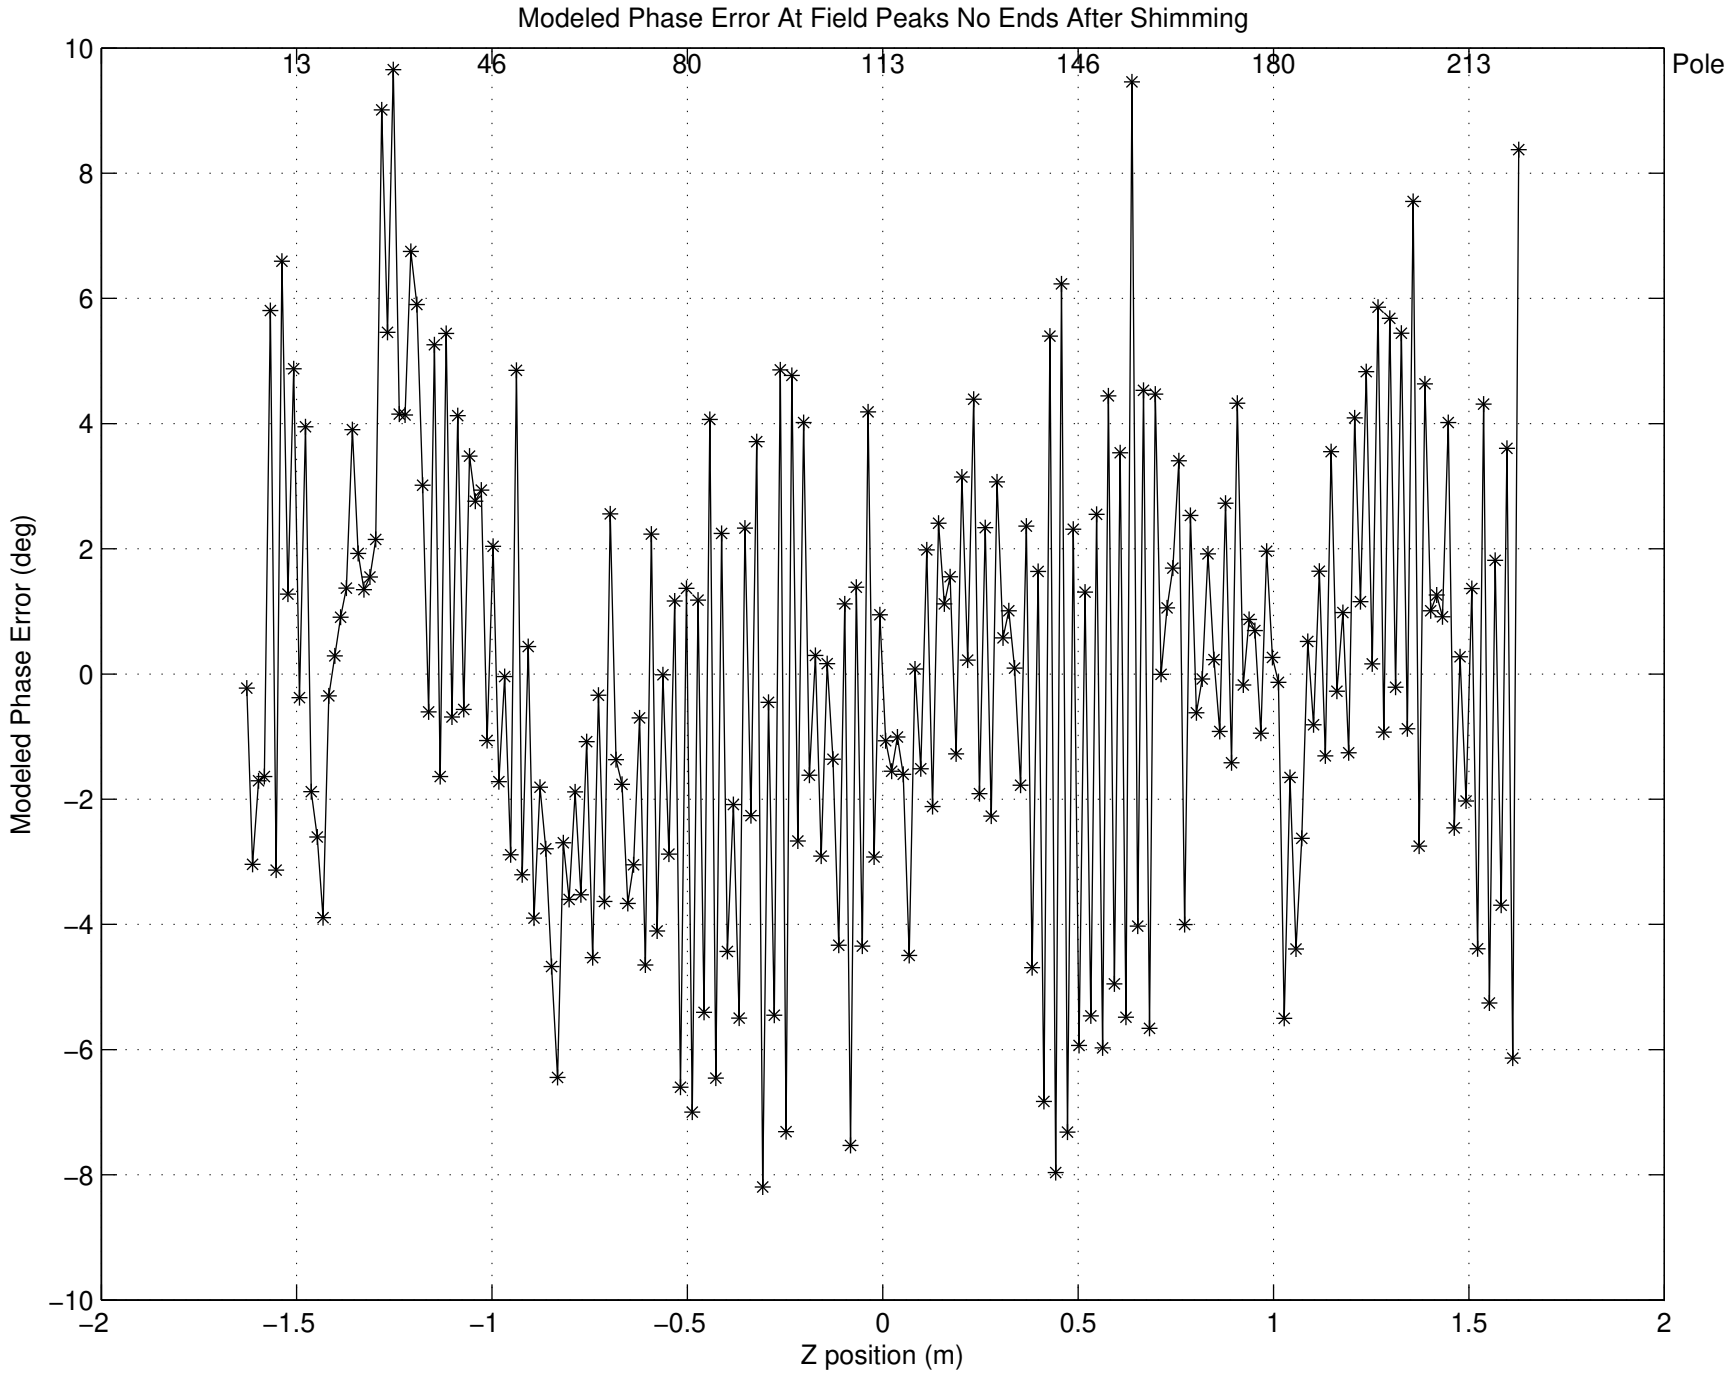

Phase Error: Ave = −0.000000 deg, RMS = 3.669917 deg