SLAC Magnetic Measurements

Planar Insertion Device Shim Analysis

Parameters:
INPUT−FILE−DIR =S:\MagData\LCLS\Undulator\L143−112000−26\DATASET0002\Rough Tuning\Z Scans\Run 029\
INPUT−FILE−NAME =x+00000−y+000−bscanz.dat
INPUT−FILE−TYPE =ZVXYBXYH
CORR−REQUIRED =1
GAMMA =26663.19
NOM−LAMBDA−U =0.03
NOM−K−VALUE =3.4936
NOM−LAMBDA−R =1.4986e−010
NUM−POLES =226
NUM−END−POLES =4
CELL−LENGTH =3.656

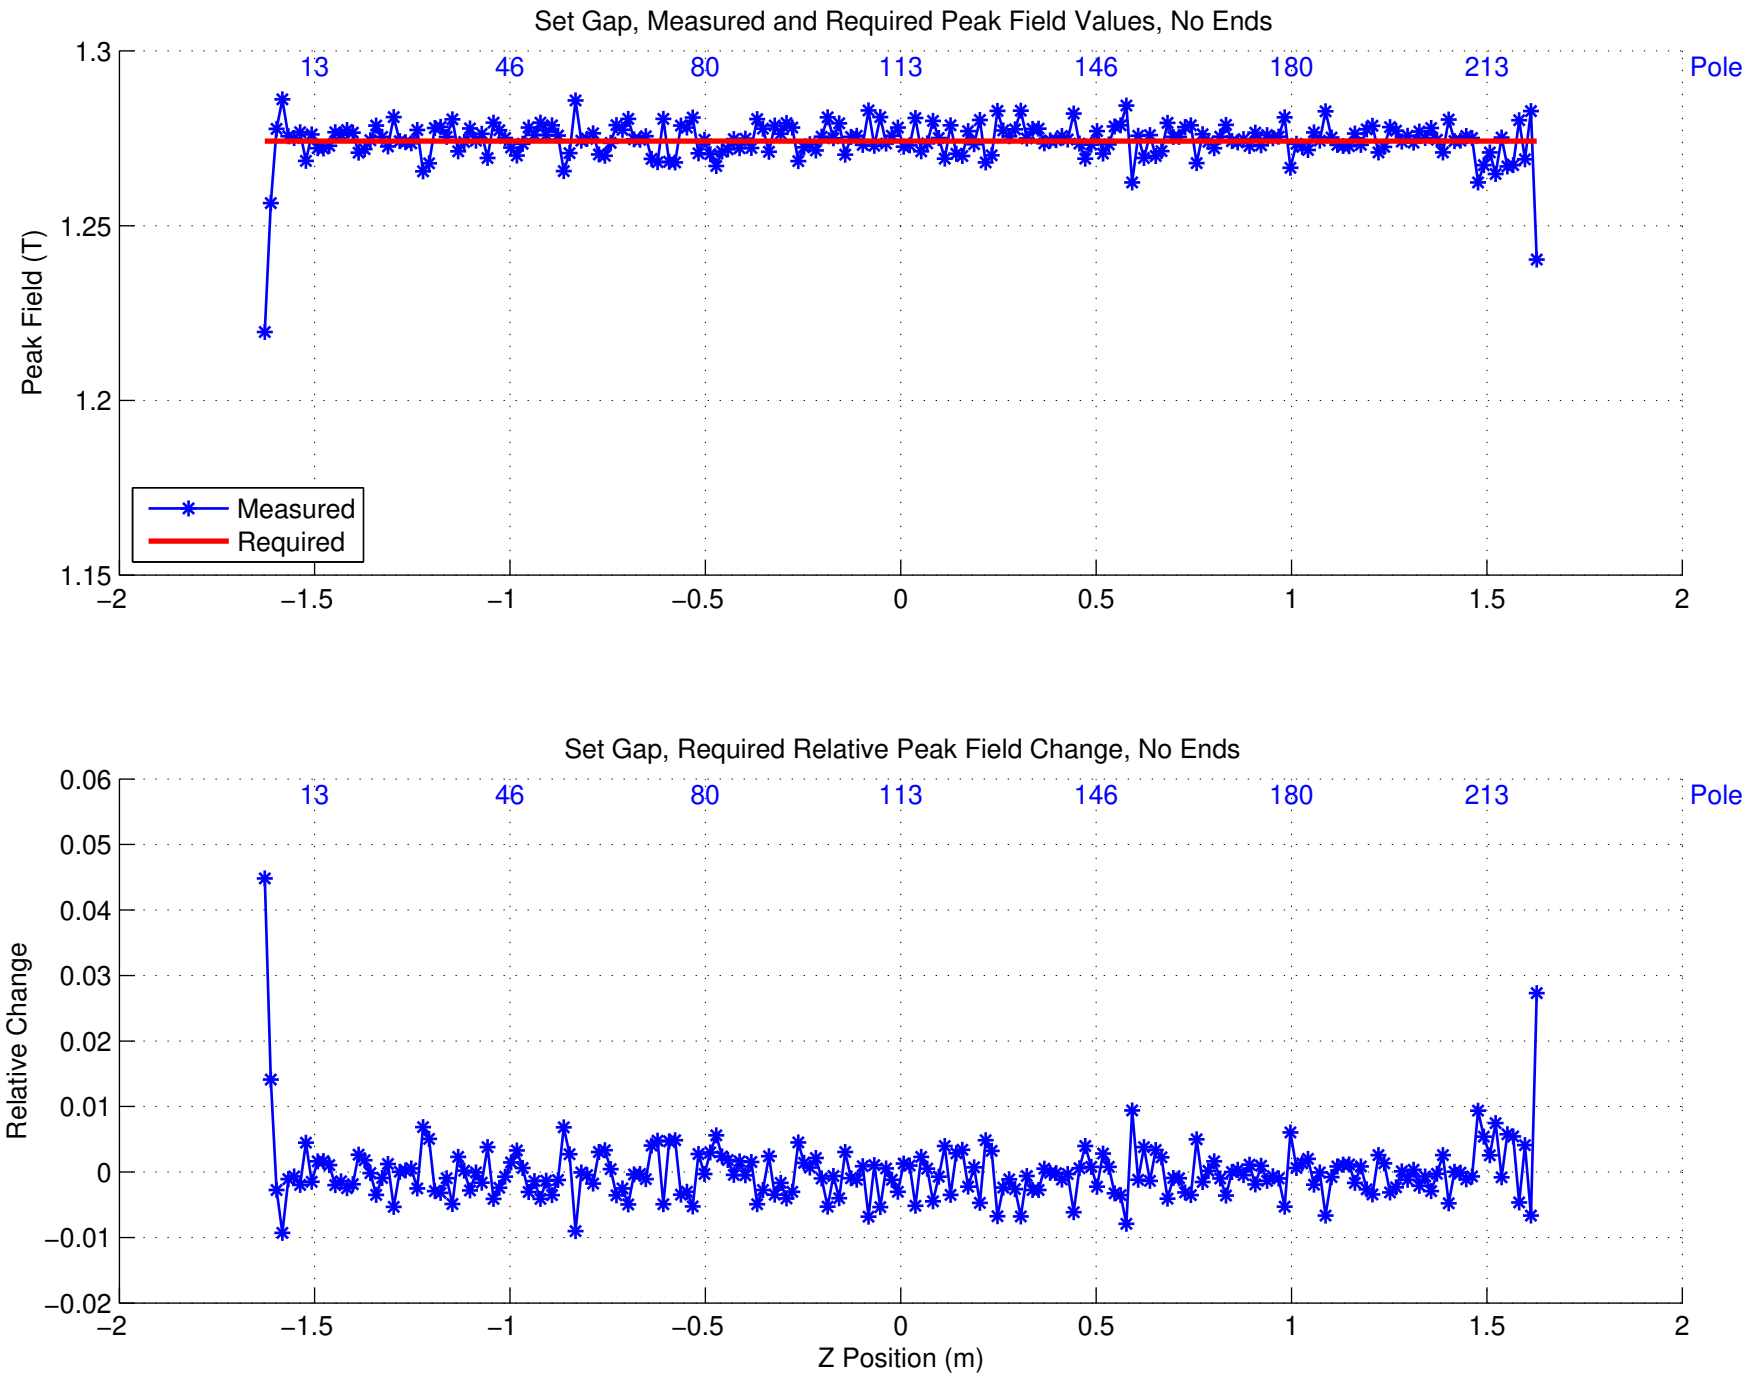
Set Gap, Measured and Required Peak Field Values, No Ends
13
46
80
113
146
180
213
Pole
1.3
1.25
1.2
1.15
Peak Field (T)
Measured
Required
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Set Gap, Required Relative Peak Field Change, No Ends
13
46
80
113
146
180
213
Pole
0.06
0.05
0.04
0.03
0.02
0.01
0
−0.01
−0.02
Relative Change
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

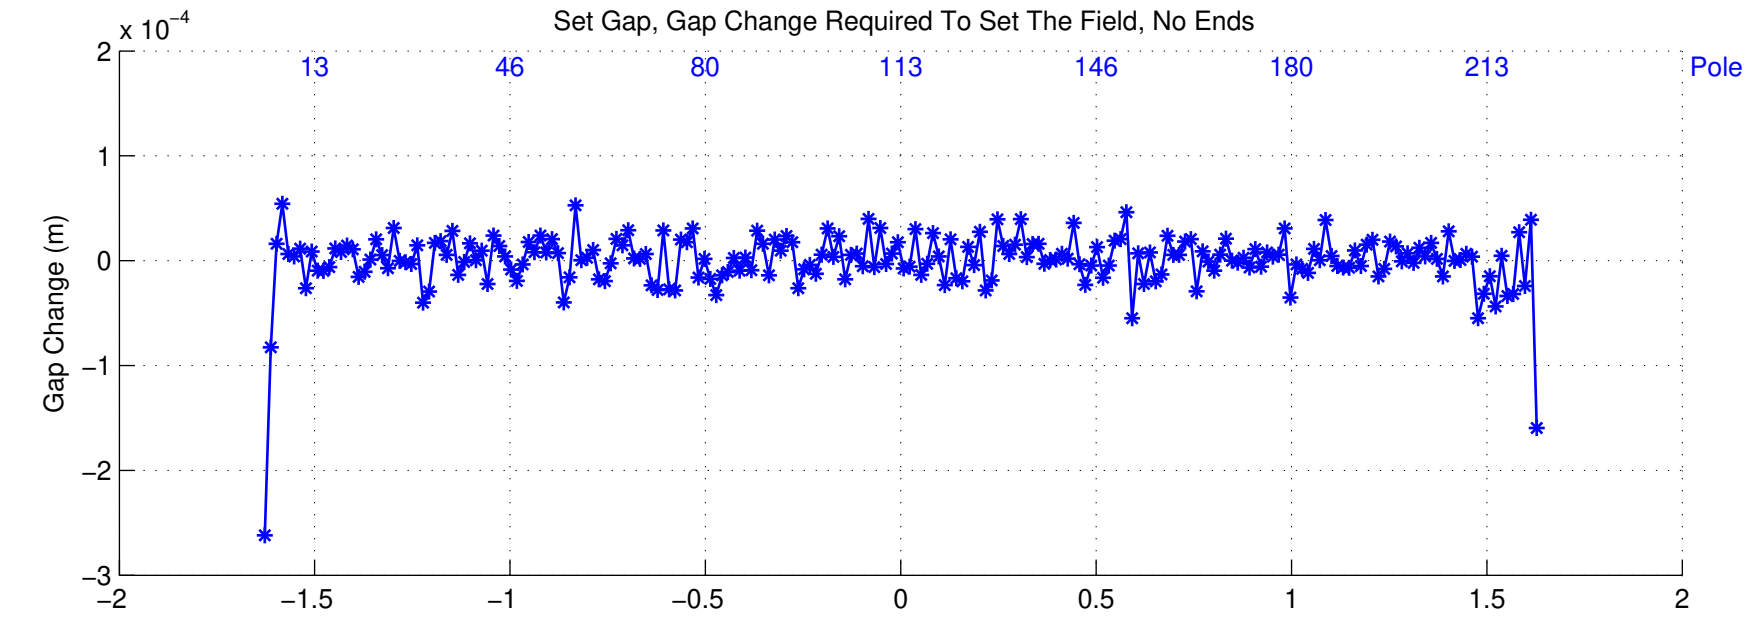
Set Gap, Gap Change Required To Set The Field, No Ends
x 10^-4
Gap Change (m)
13
46
80
113
146
180
213
Pole
2
1
0
−1
−2
−3
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

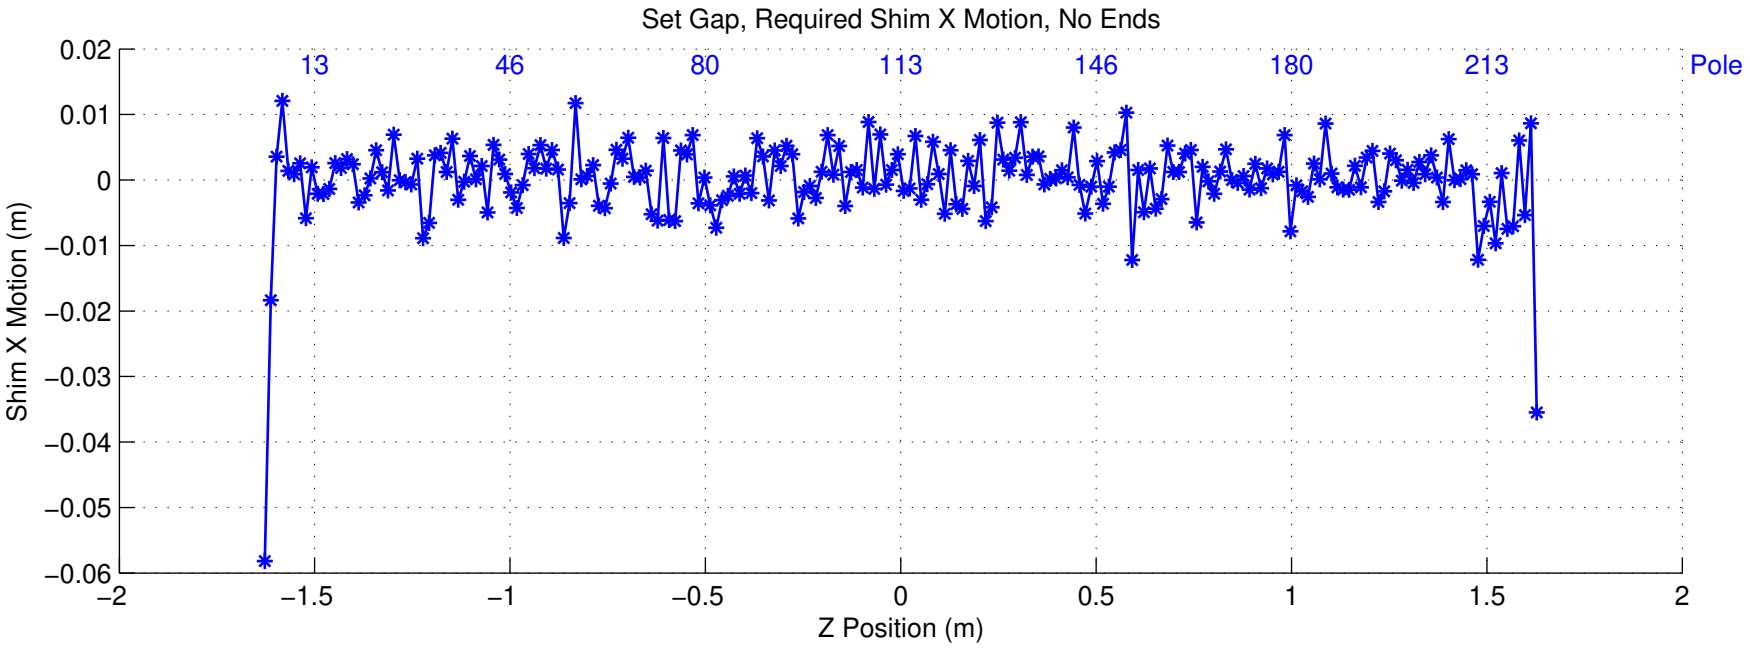
Set Gap, Required Shim X Motion, No Ends
Shim X Motion (m)
13
46
80
113
146
180
213
Pole
0.02
0.01
0
−0.01
−0.02
−0.03
−0.04
−0.05
−0.06
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

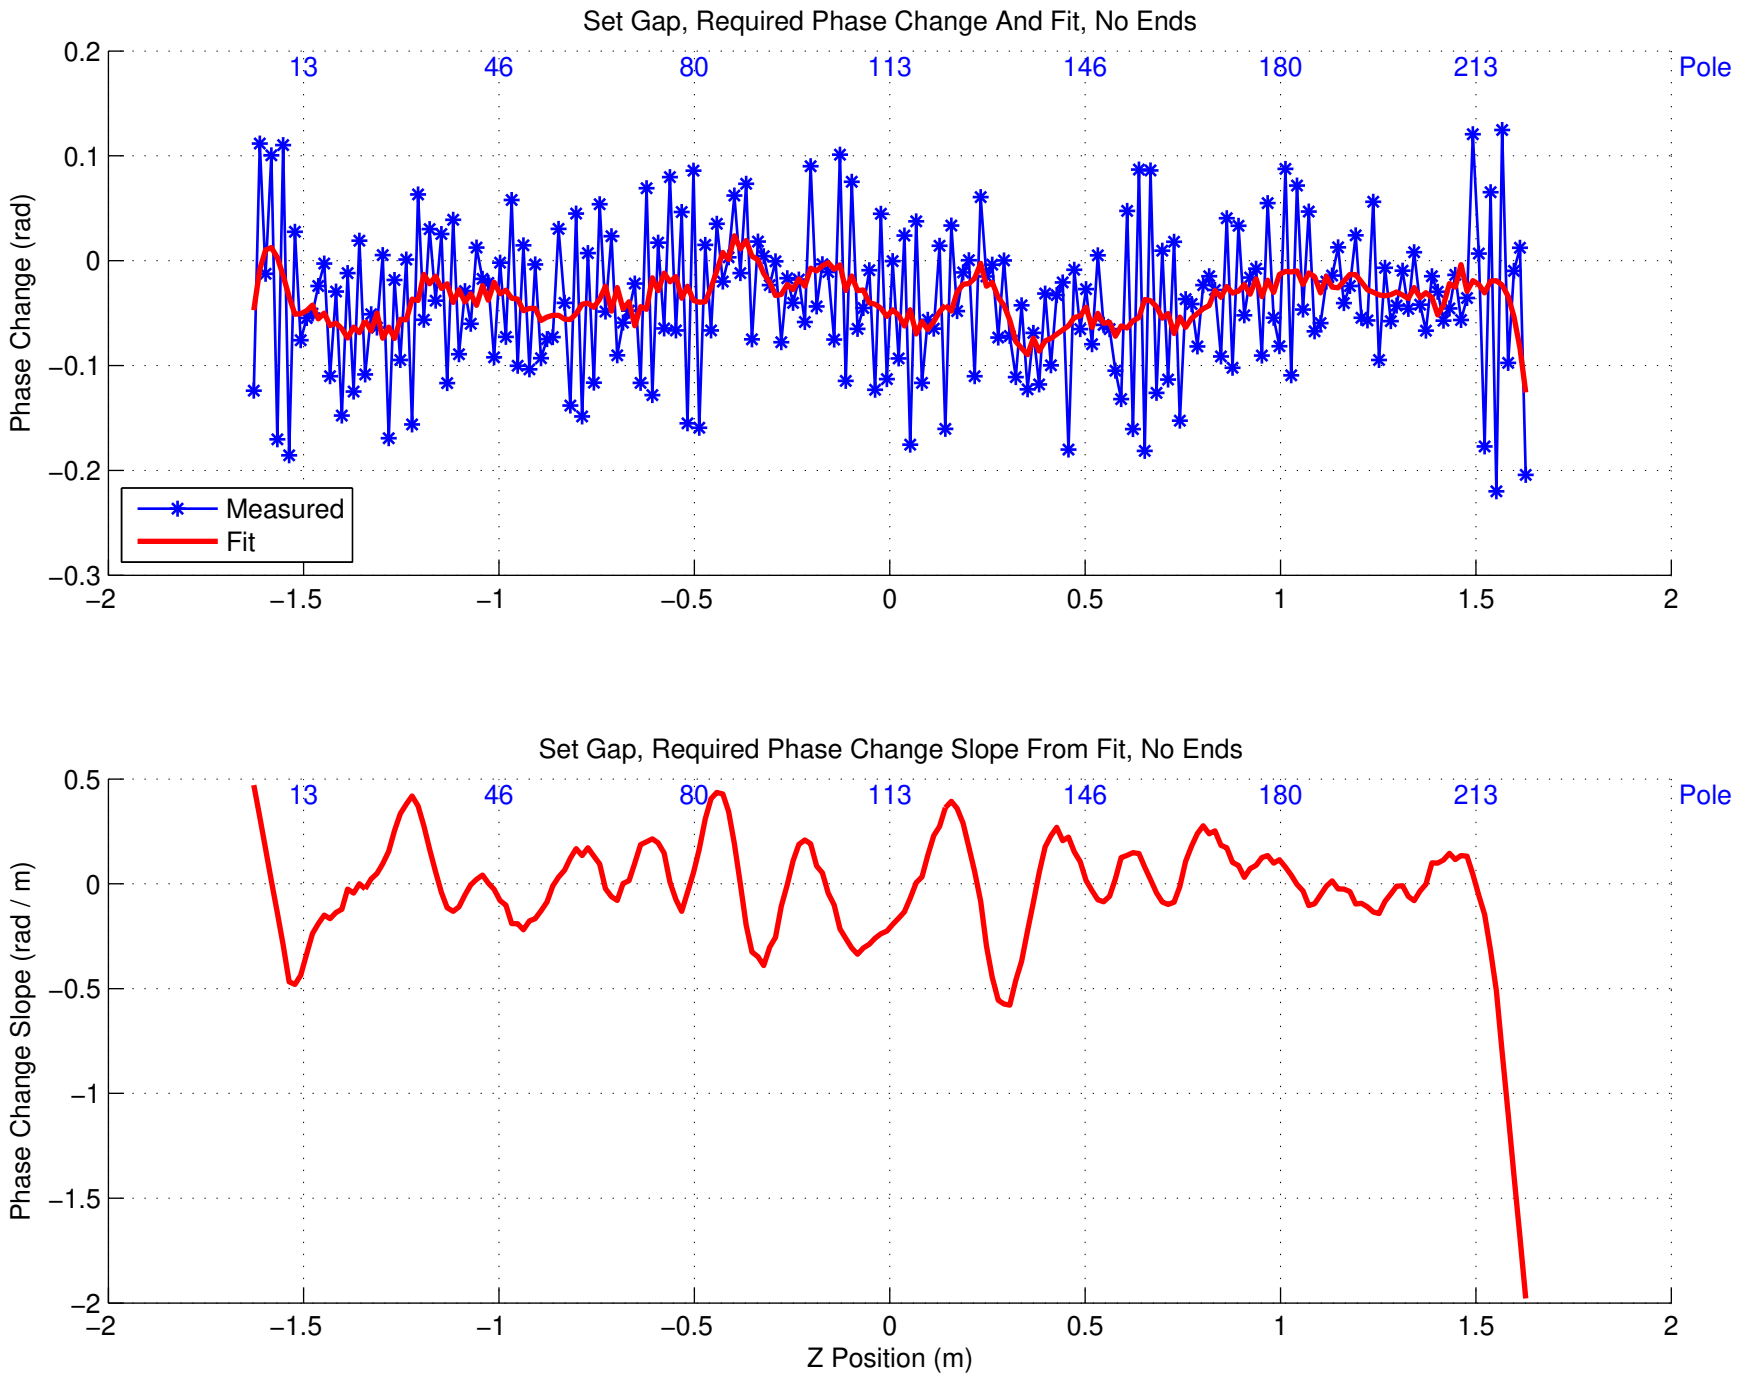
Set Gap, Required Phase Change And Fit, No Ends
Phase Change (rad)
Pole
13
46
80
113
146
180
213
Measured
Fit
Set Gap, Required Phase Change Slope From Fit, No Ends
Phase Change Slope (rad / m)
Z Position (m)

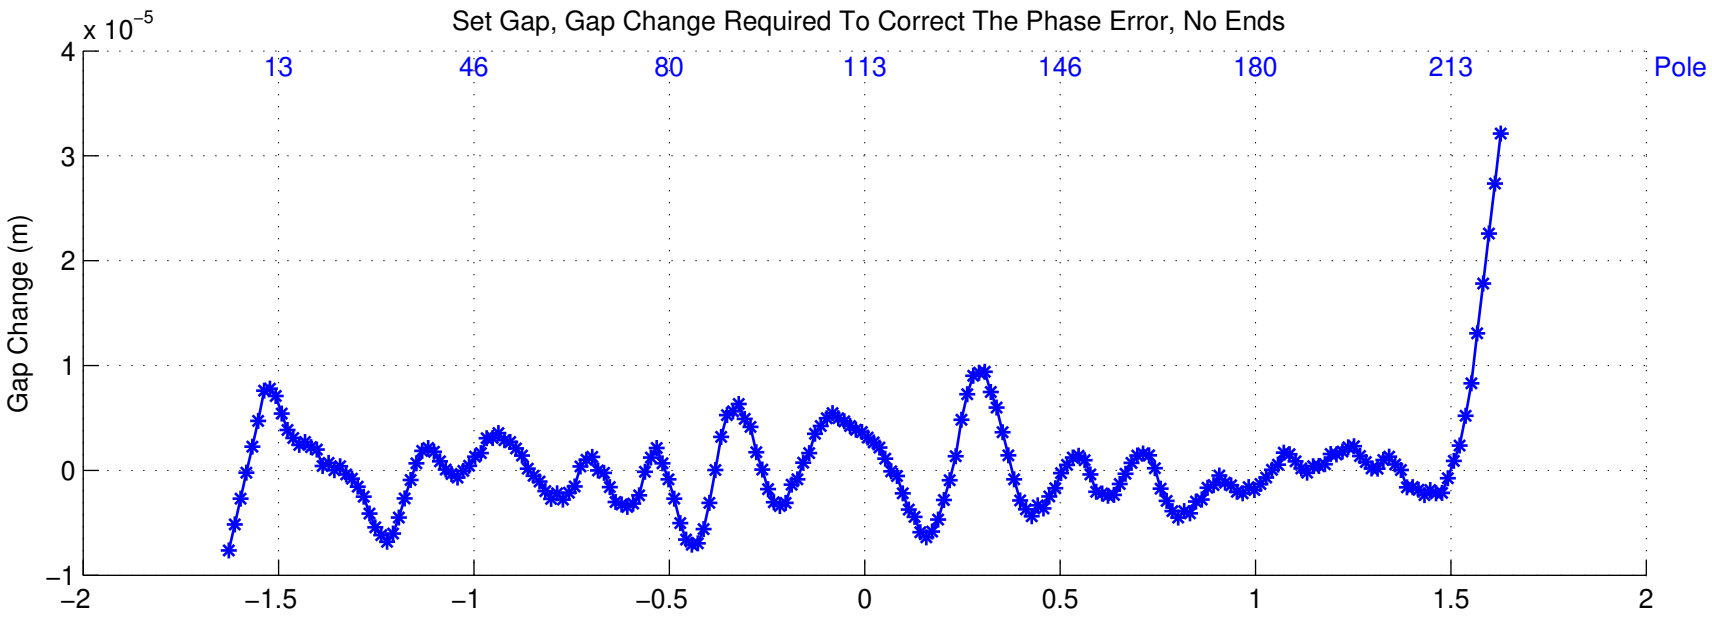
Set Gap, Gap Change Required To Correct The Phase Error, No Ends
x 10^-5
Gap Change (m)
13
46
80
113
146
180
213
Pole
4
3
2
1
0
−1
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

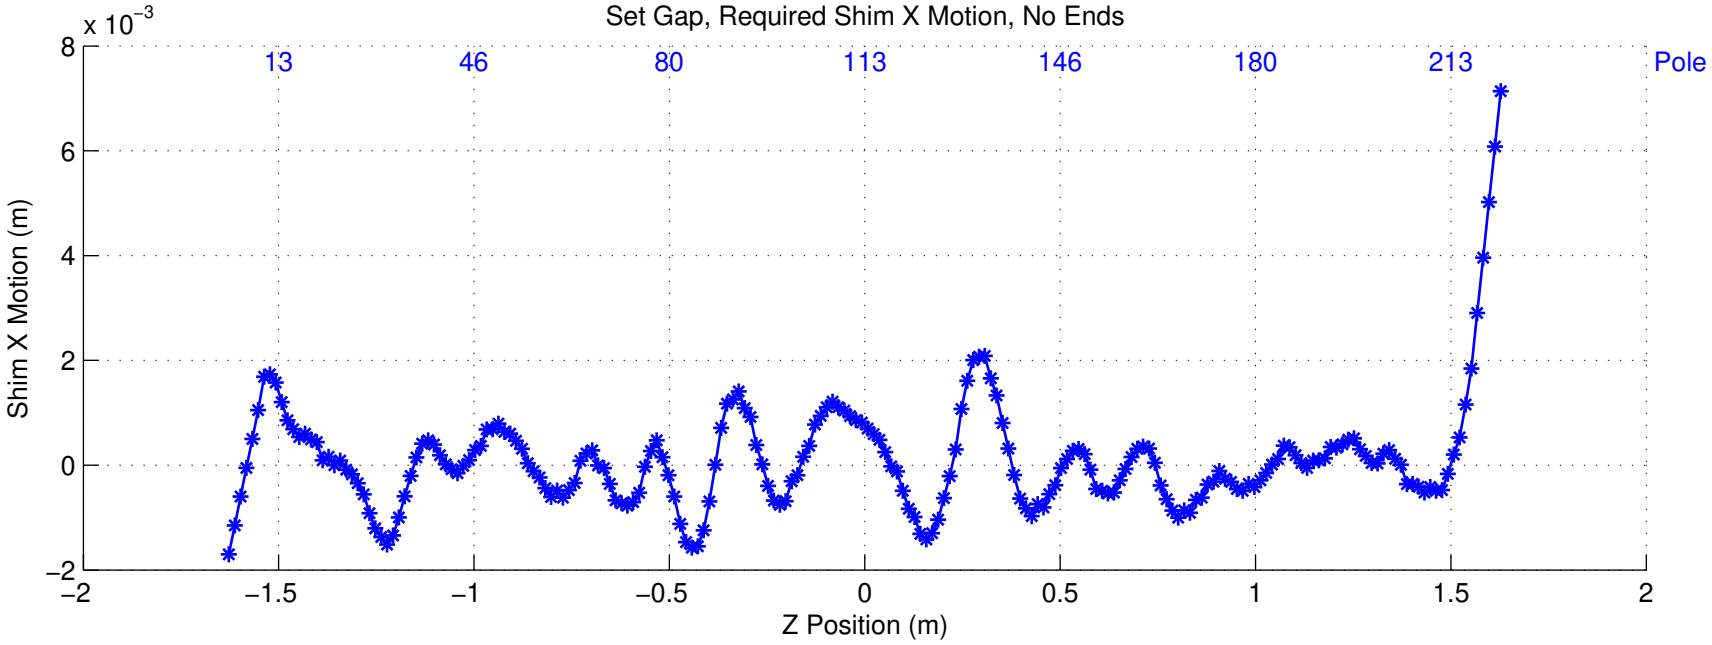
Set Gap, Required Shim X Motion, No Ends
x 10^-3
Shim X Motion (m)
13
46
80
113
146
180
213
Pole
8
6
4
2
0
−2
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

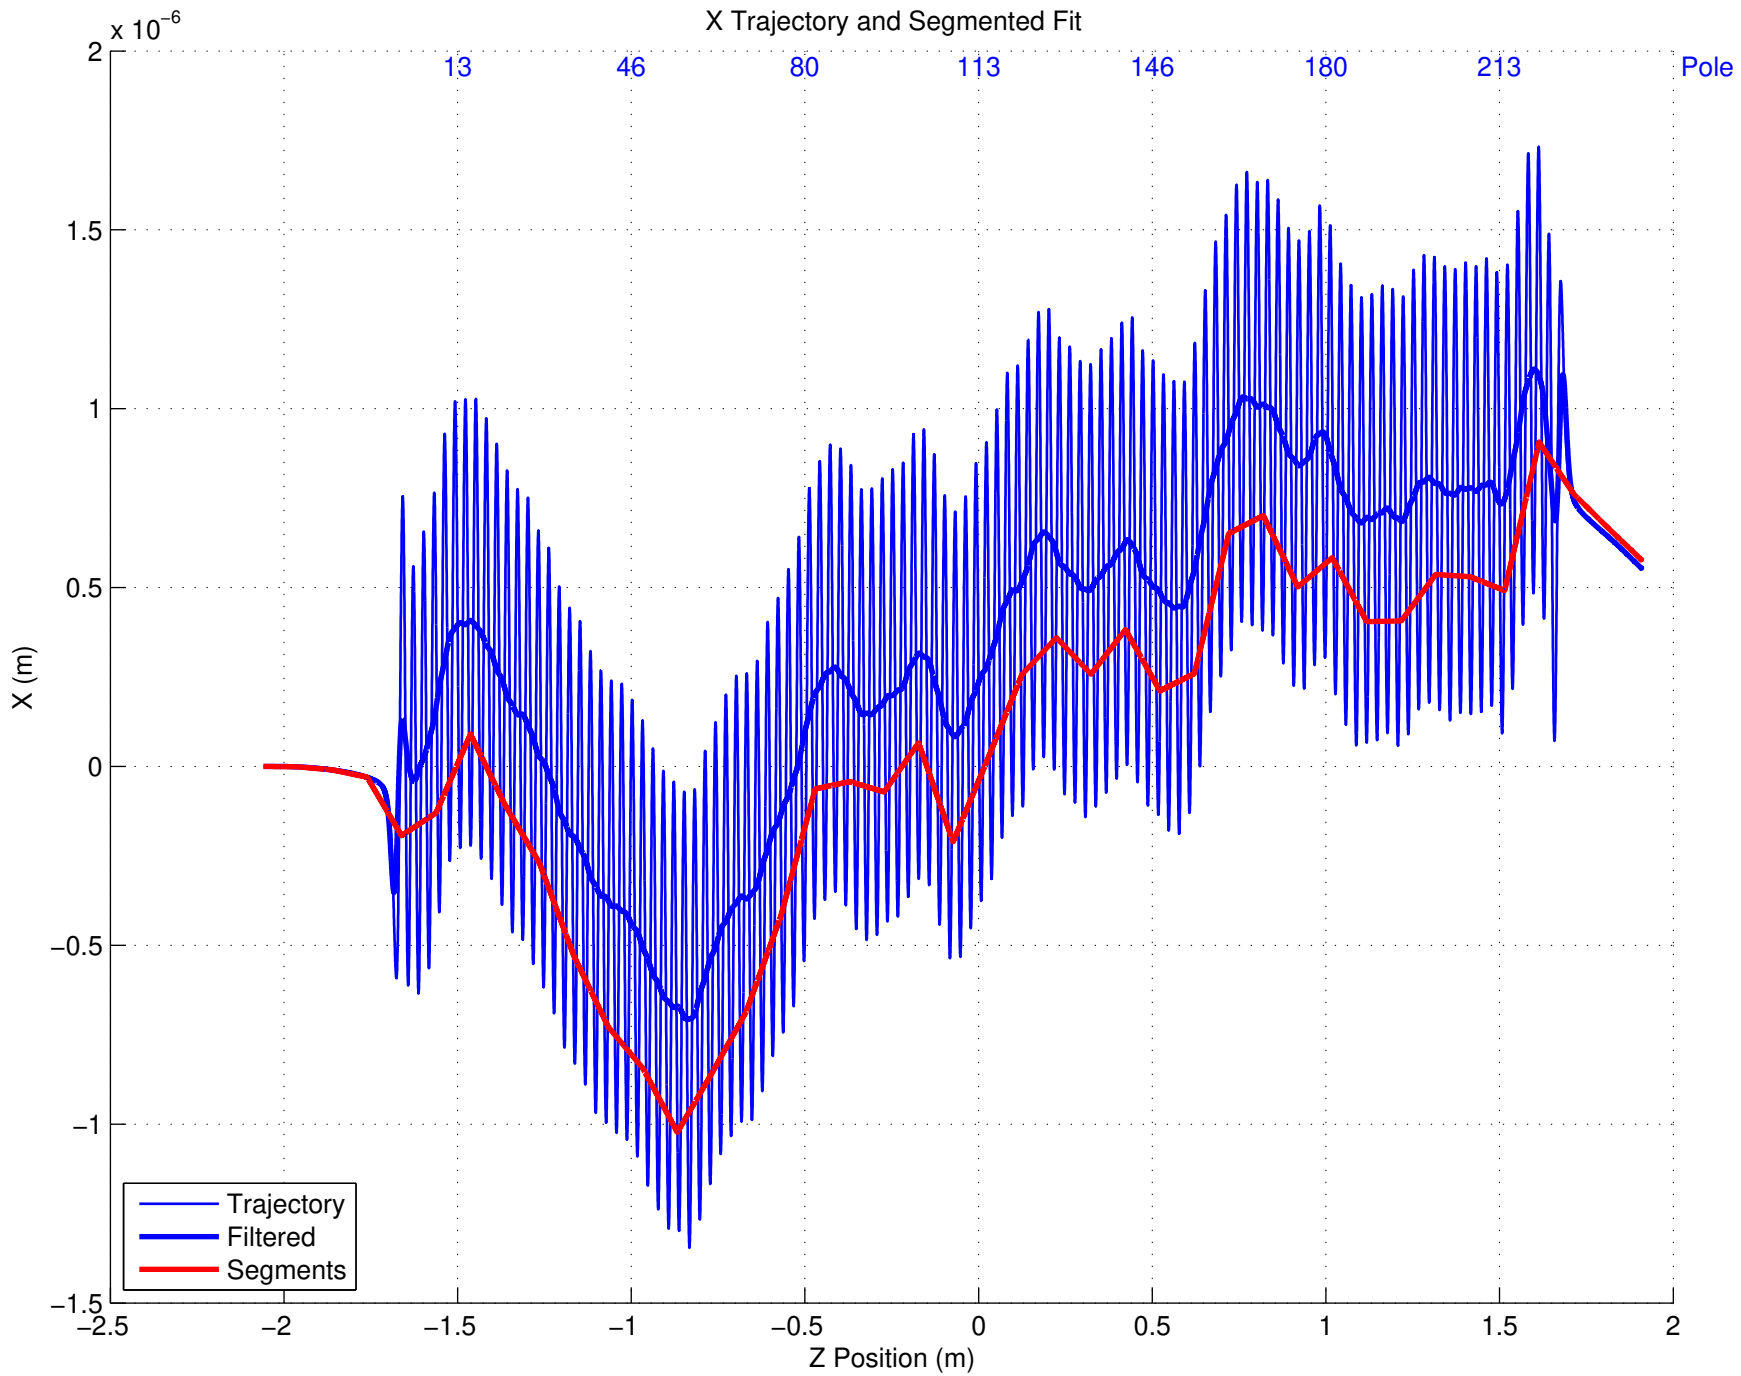
X Trajectory and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
2
1.5
1
0.5
0
−0.5
−1
−1.5
X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

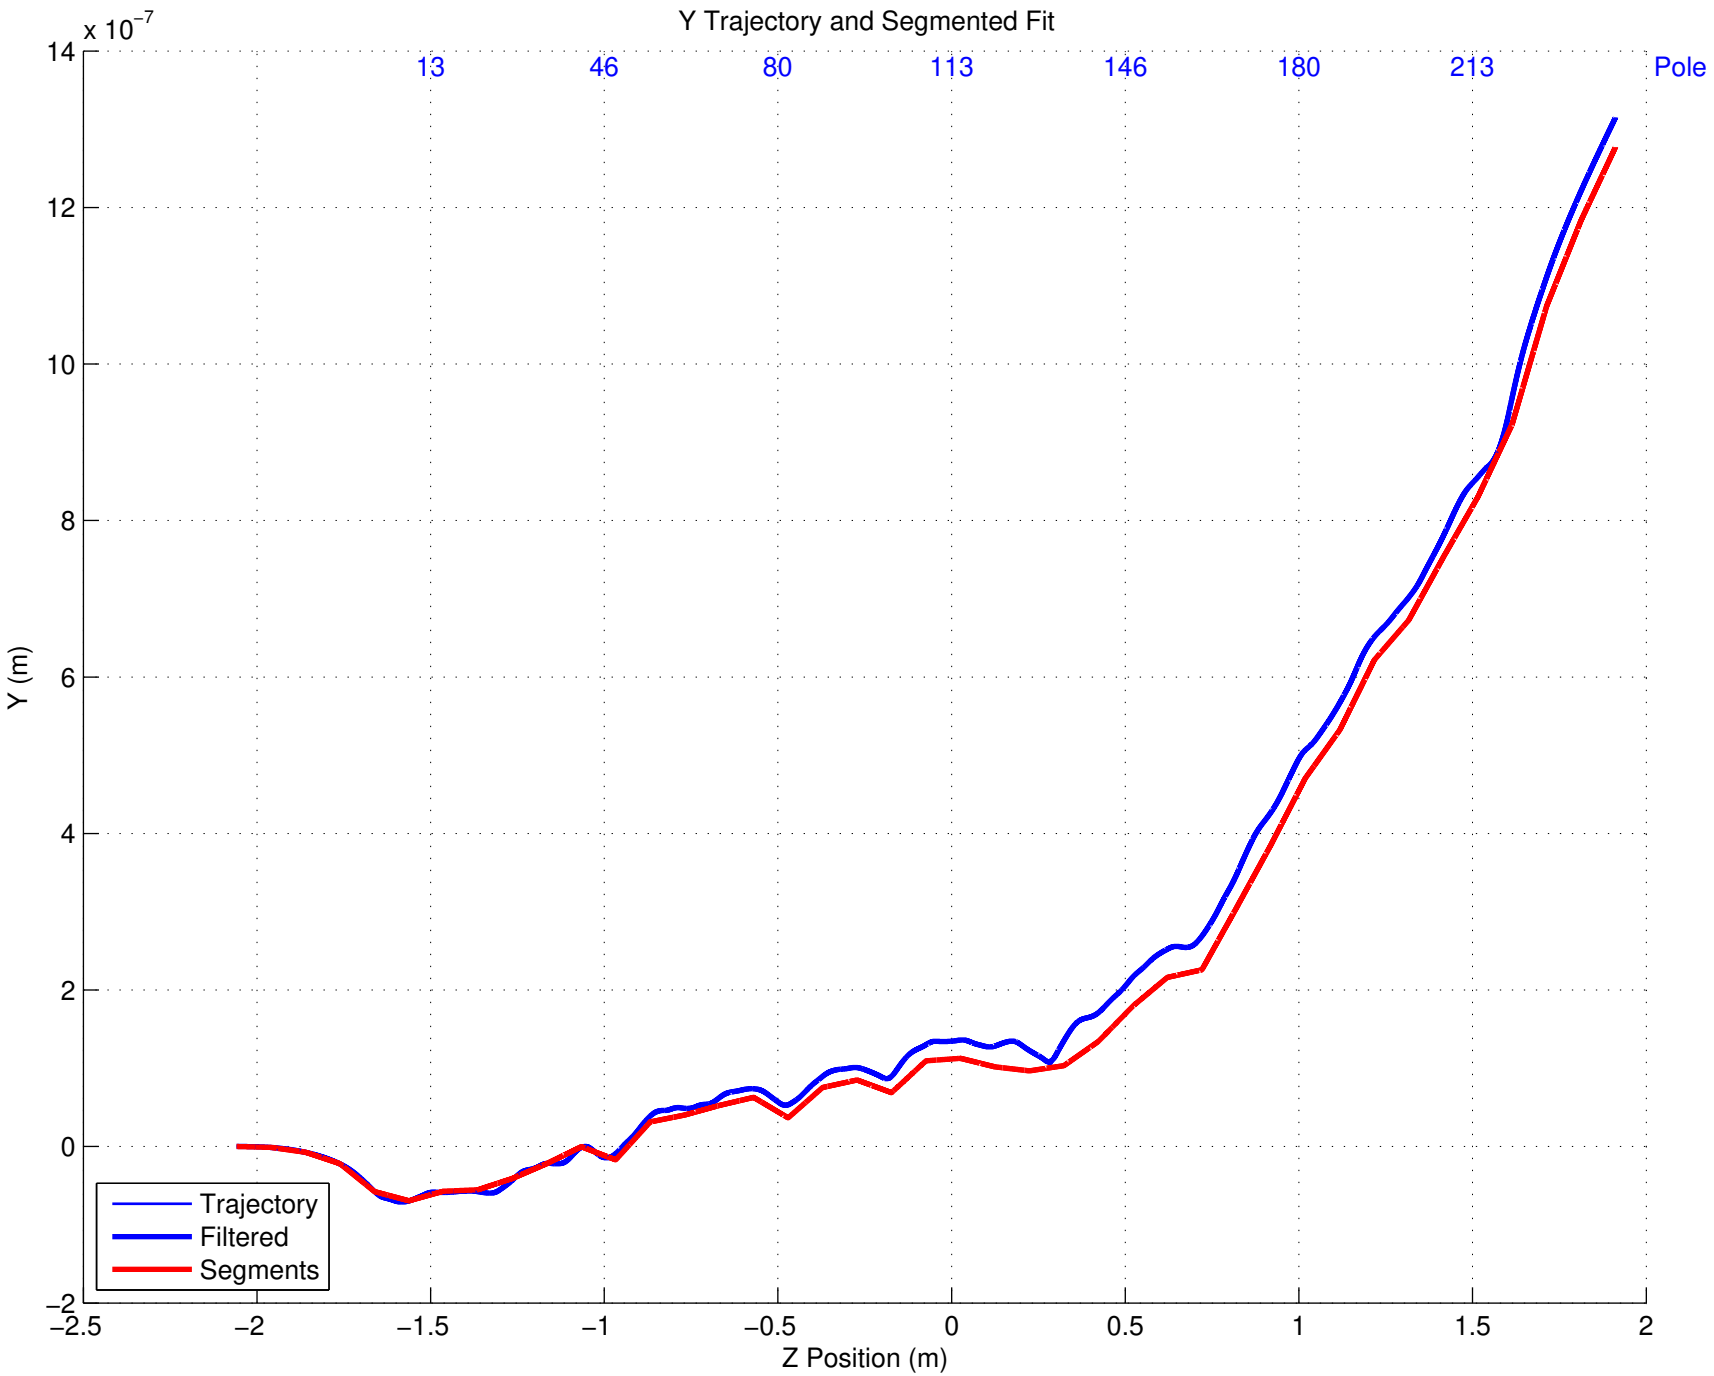
Y Trajectory and Segmented Fit
x 10^-7
13
46
80
113
146
180
213
Pole
14
12
10
8
6
4
2
0
−2
Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

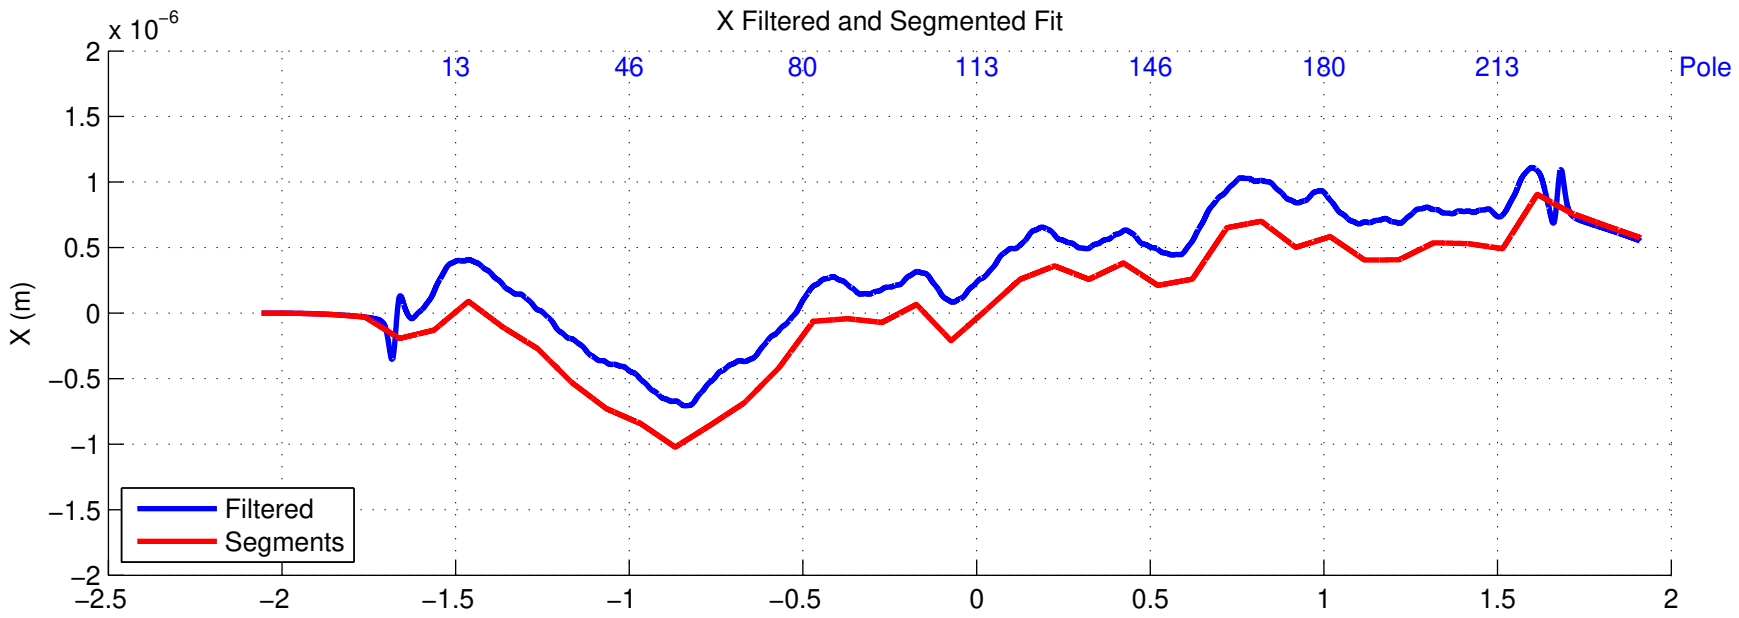
X Filtered and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
X (m)
Filtered
Segments

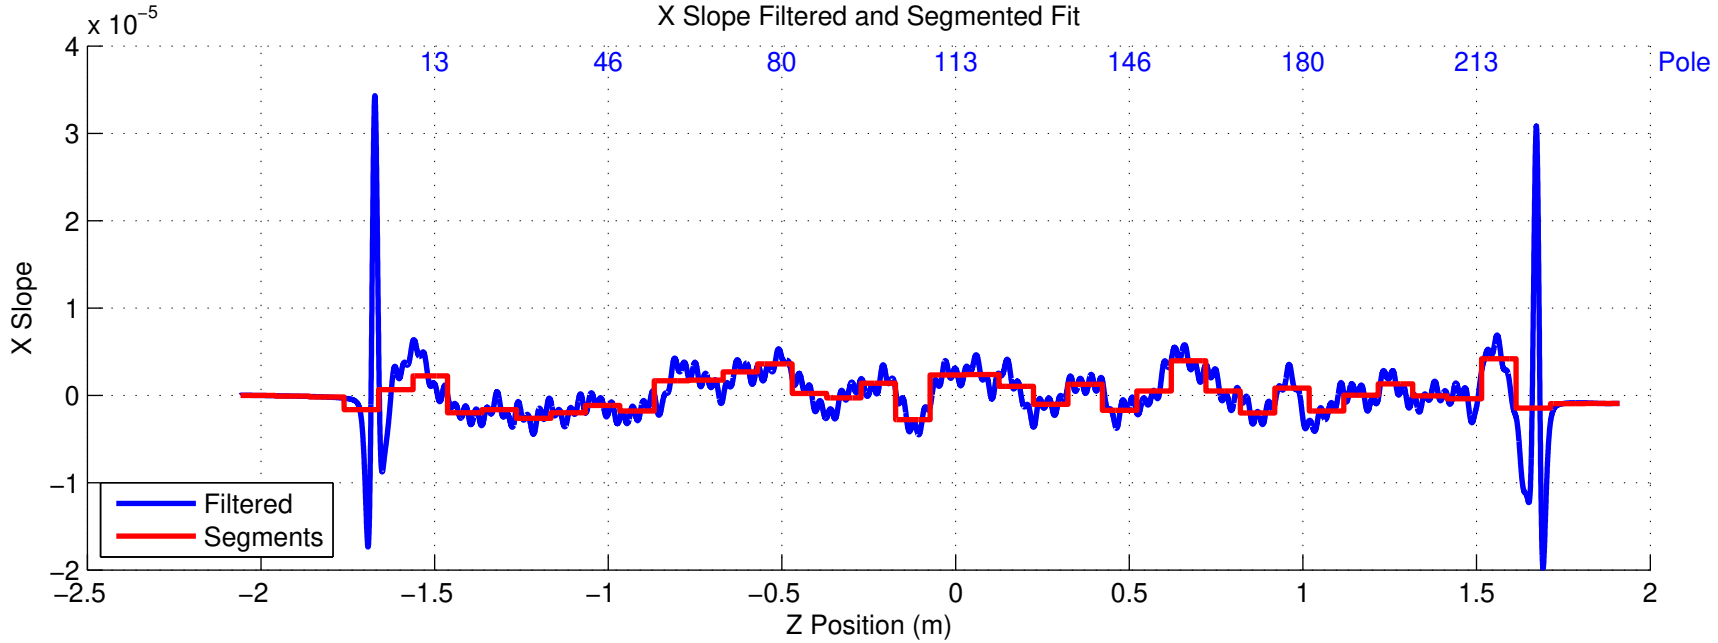
X Slope Filtered and Segmented Fit
x 10^-5
13
46
80
113
146
180
213
Pole
X Slope
Filtered
Segments
Z Position (m)

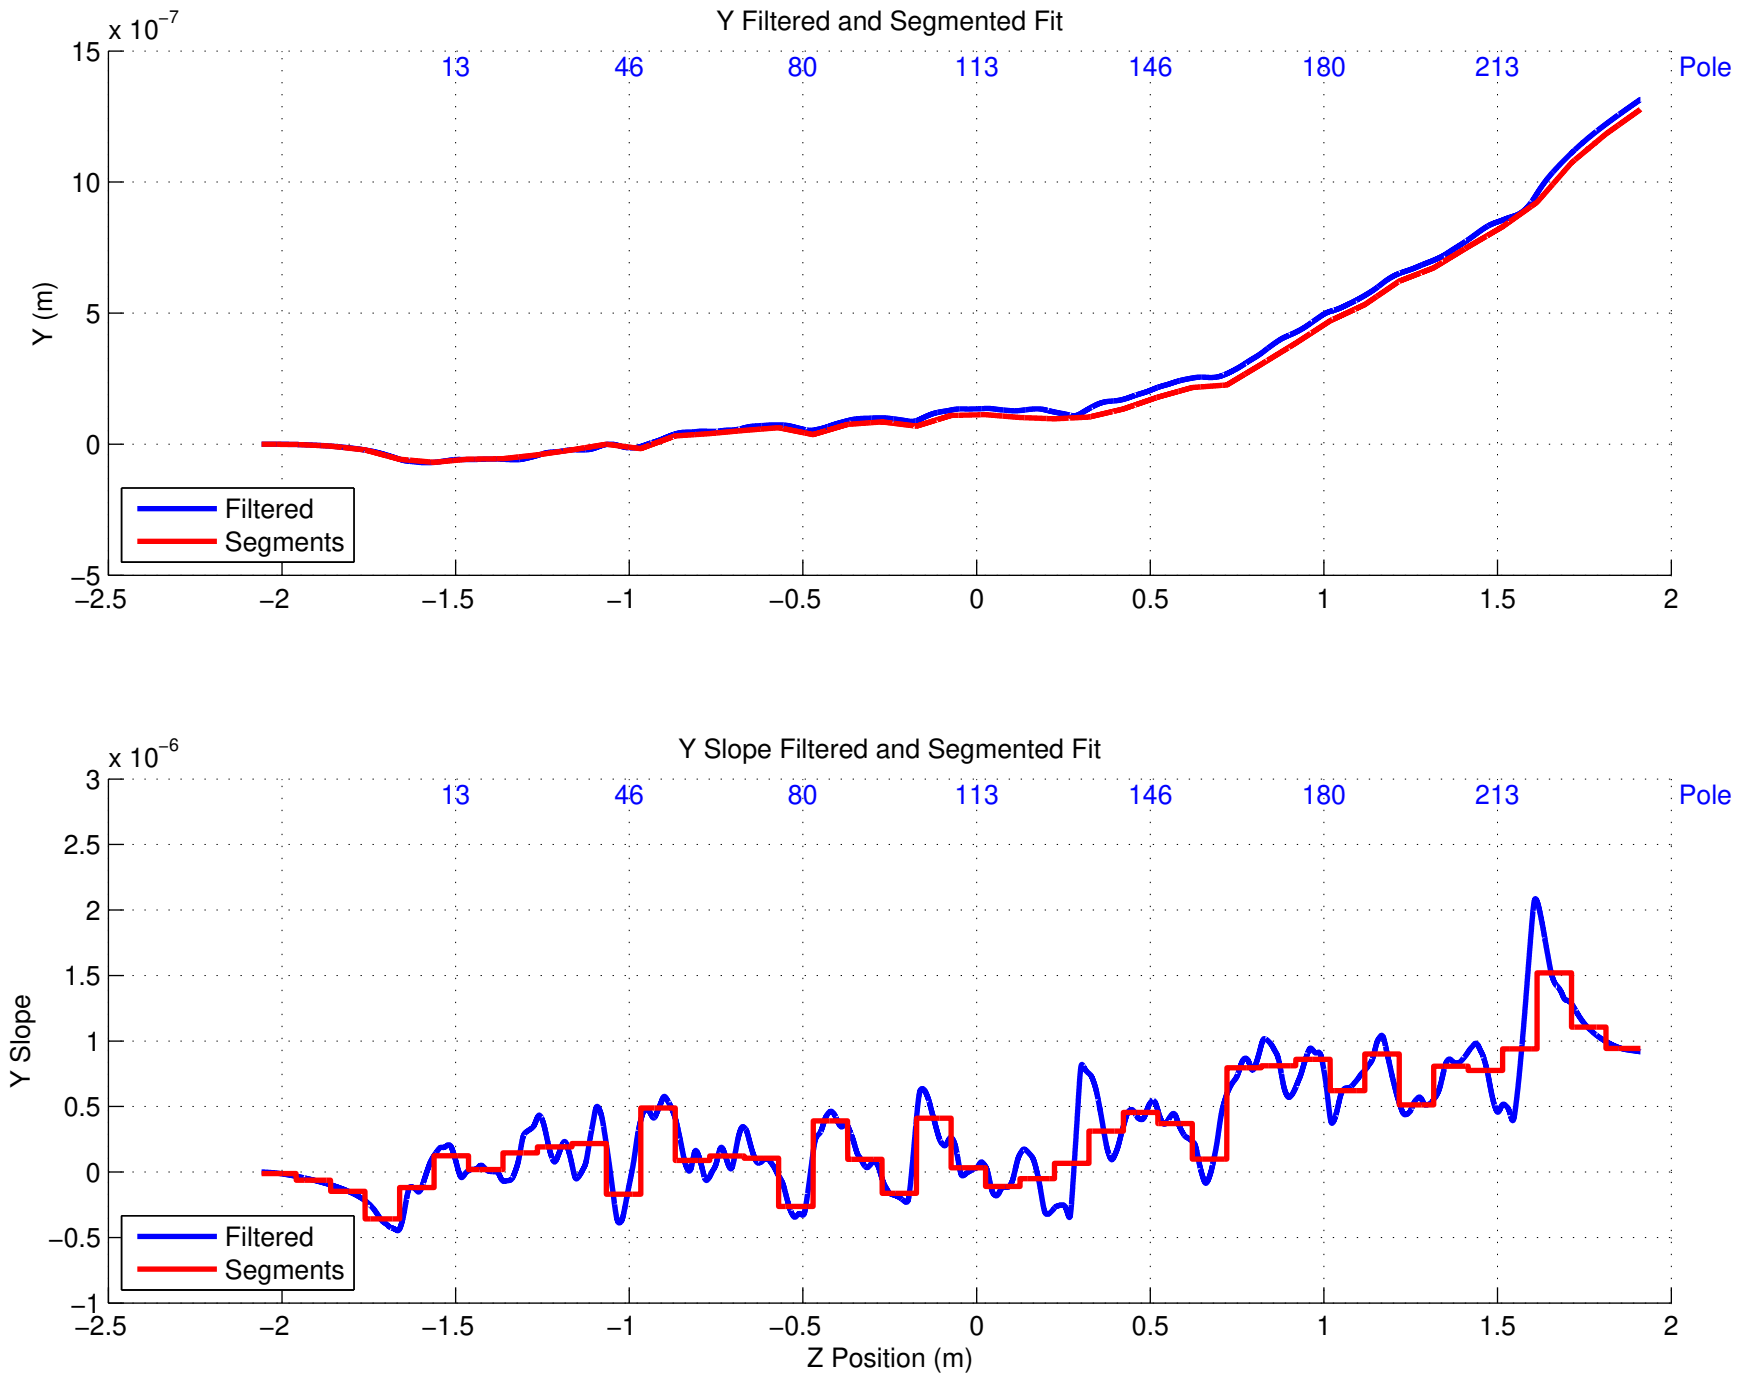
Y Filtered and Segmented Fit
x 10^-7
13
46
80
113
146
180
213
Pole
Y (m)
Filtered
Segments
Y Slope Filtered and Segmented Fit
x 10^-6
Y Slope
Z Position (m)

X Original And Shimmed Segmented Trajectories
x 10^-6
13
46
80
113
146
180
213
Pole
X (m)
Original
Shimmed

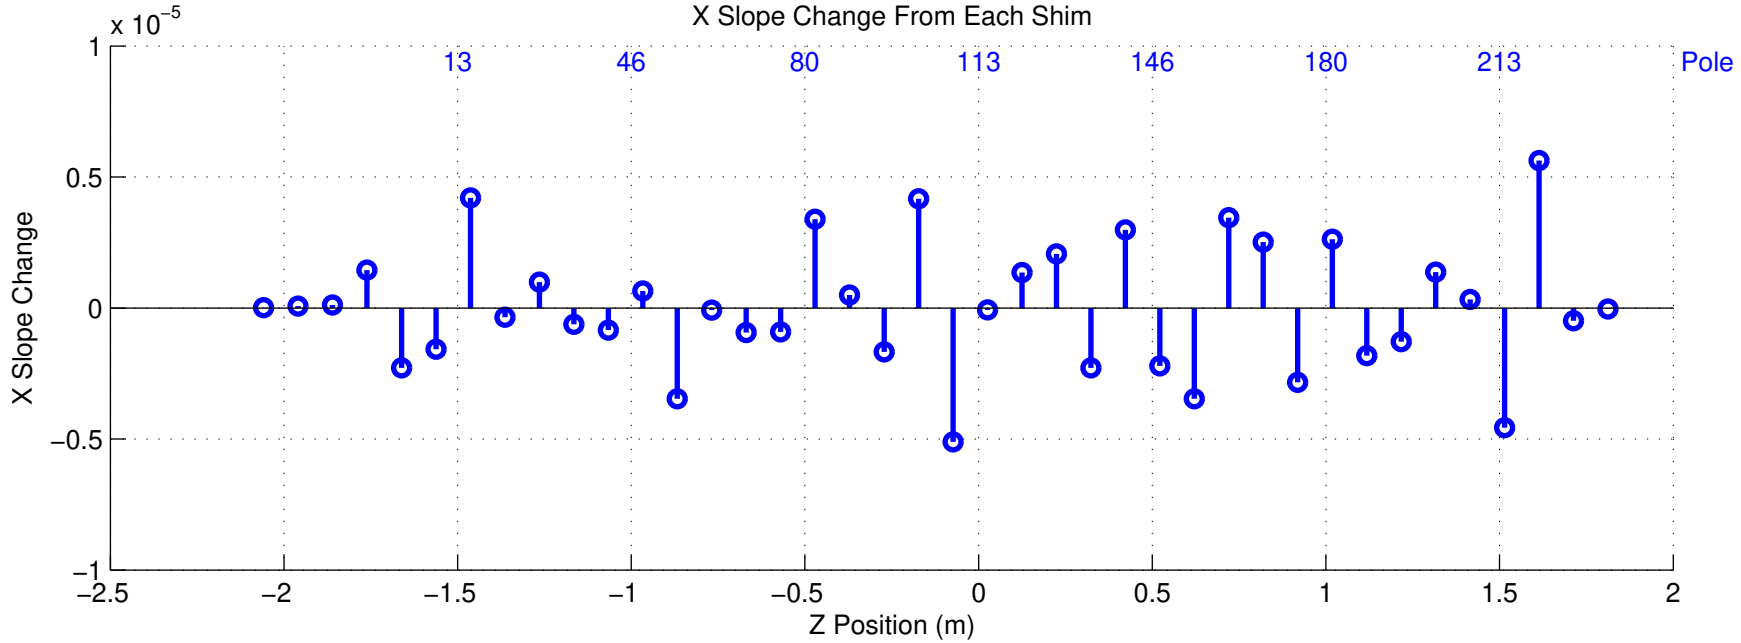
X Slope Change From Each Shim
x 10^-5
13
46
80
113
146
180
213
Pole
X Slope Change
Z Position (m)

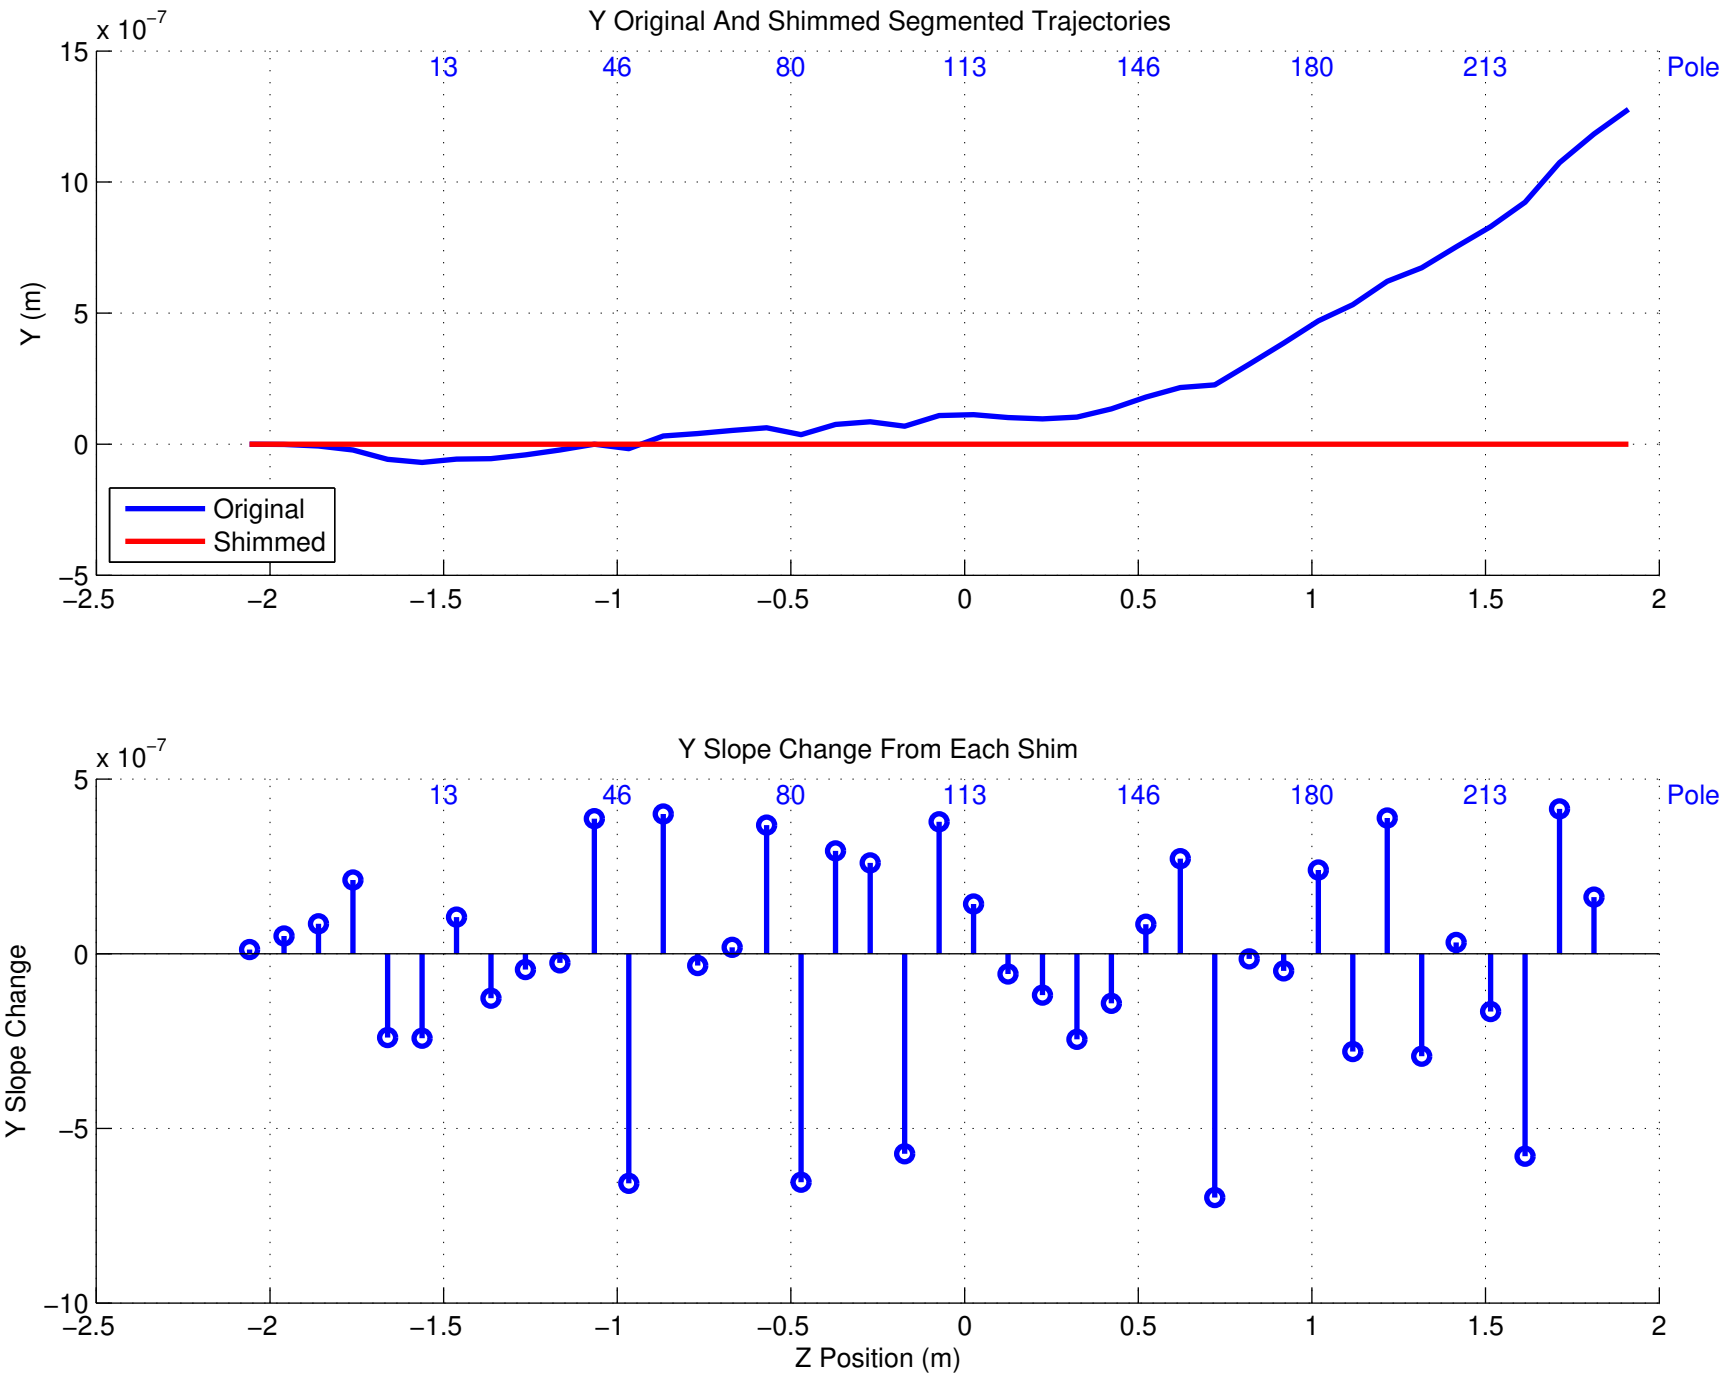
Y Original And Shimmed Segmented Trajectories
x 10^-7
15
10
5
0
−5
Y (m)
13
46
80
113
146
180
213
Pole
Original
Shimmed
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Y Slope Change From Each Shim
x 10^-7
5
0
−5
−10
Y Slope Change
Z Position (m)

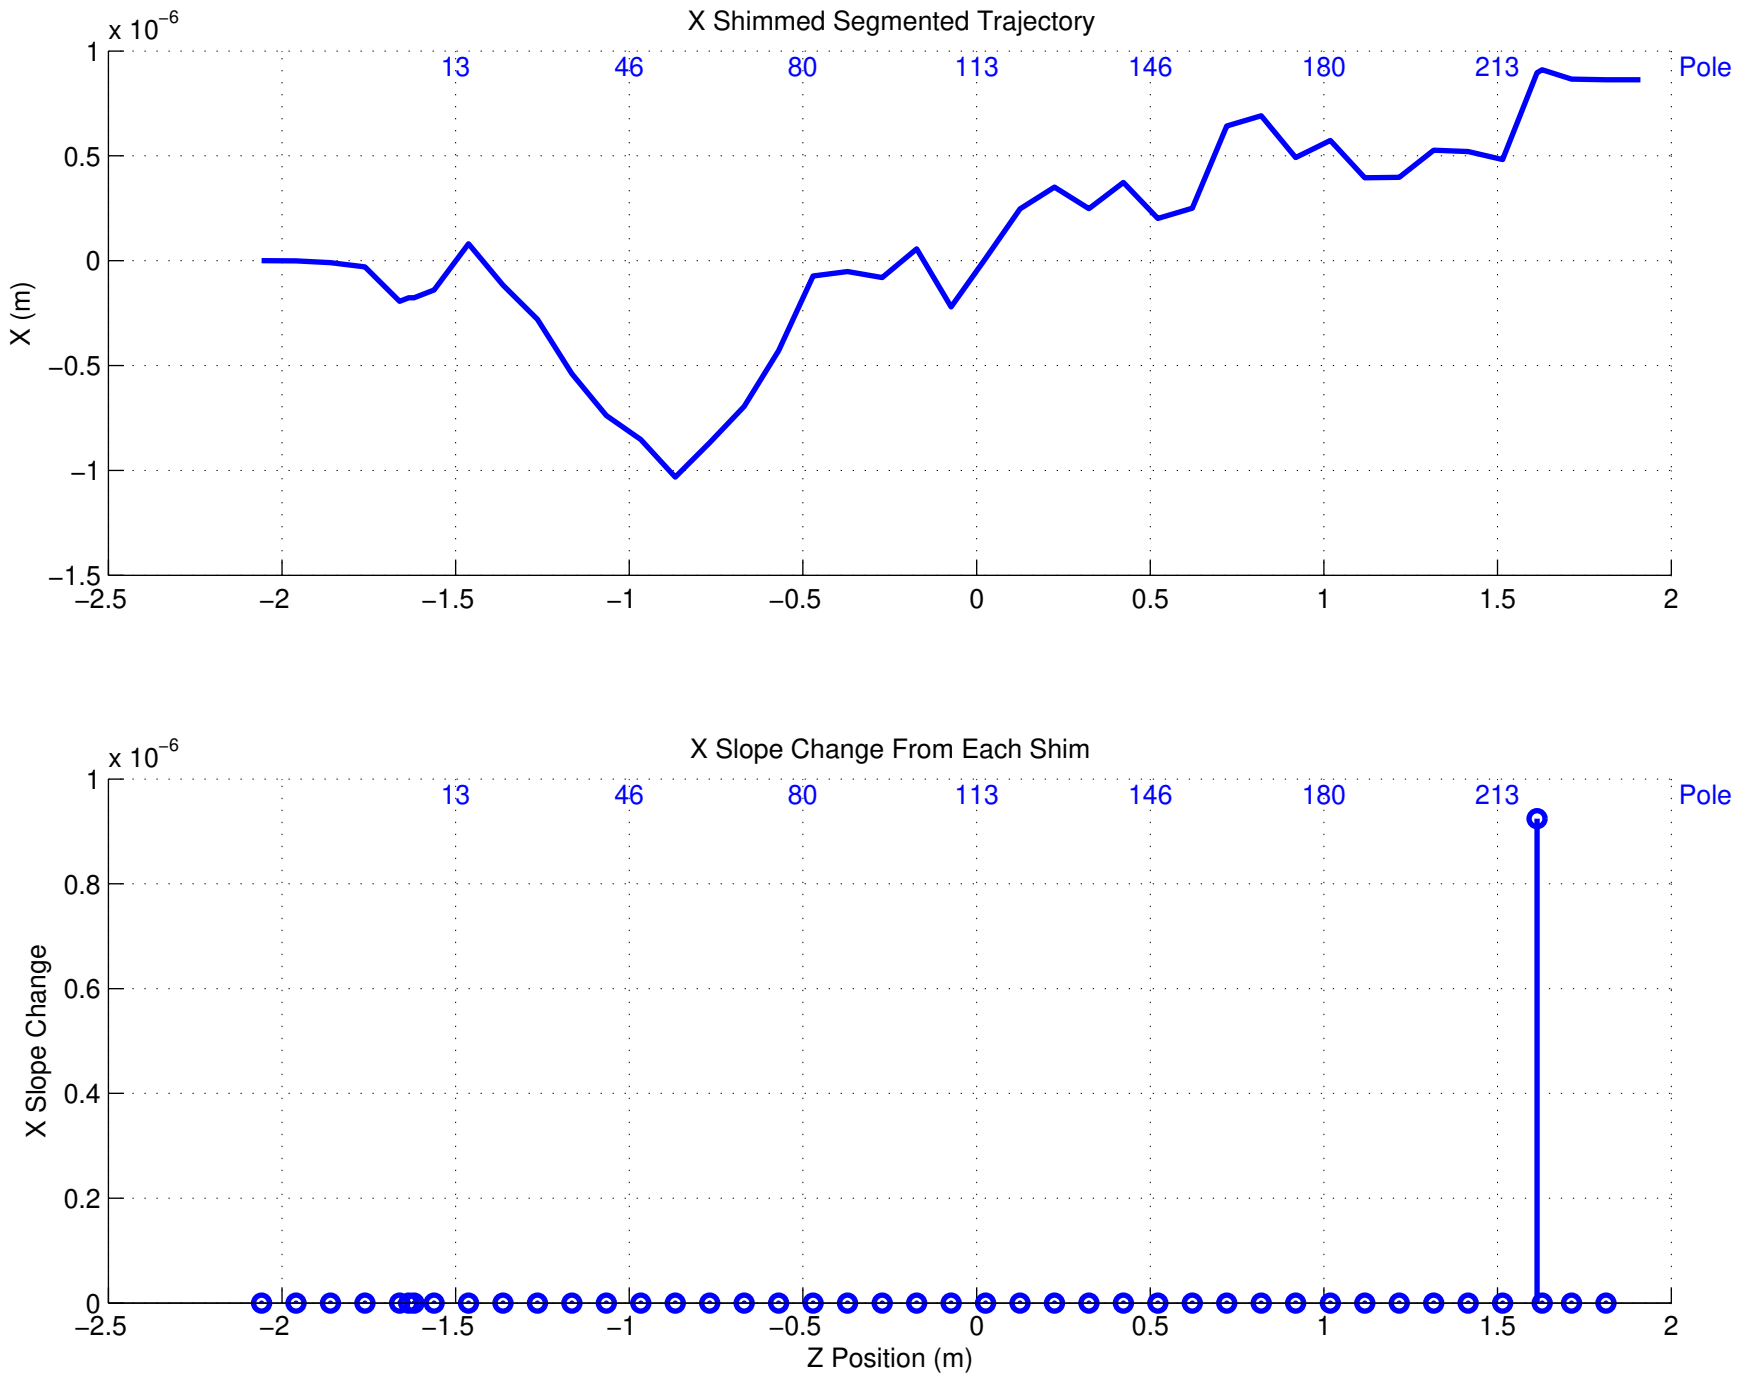
X Shimmed Segmented Trajectory
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
X Slope Change From Each Shim
X Slope Change
Z Position (m)

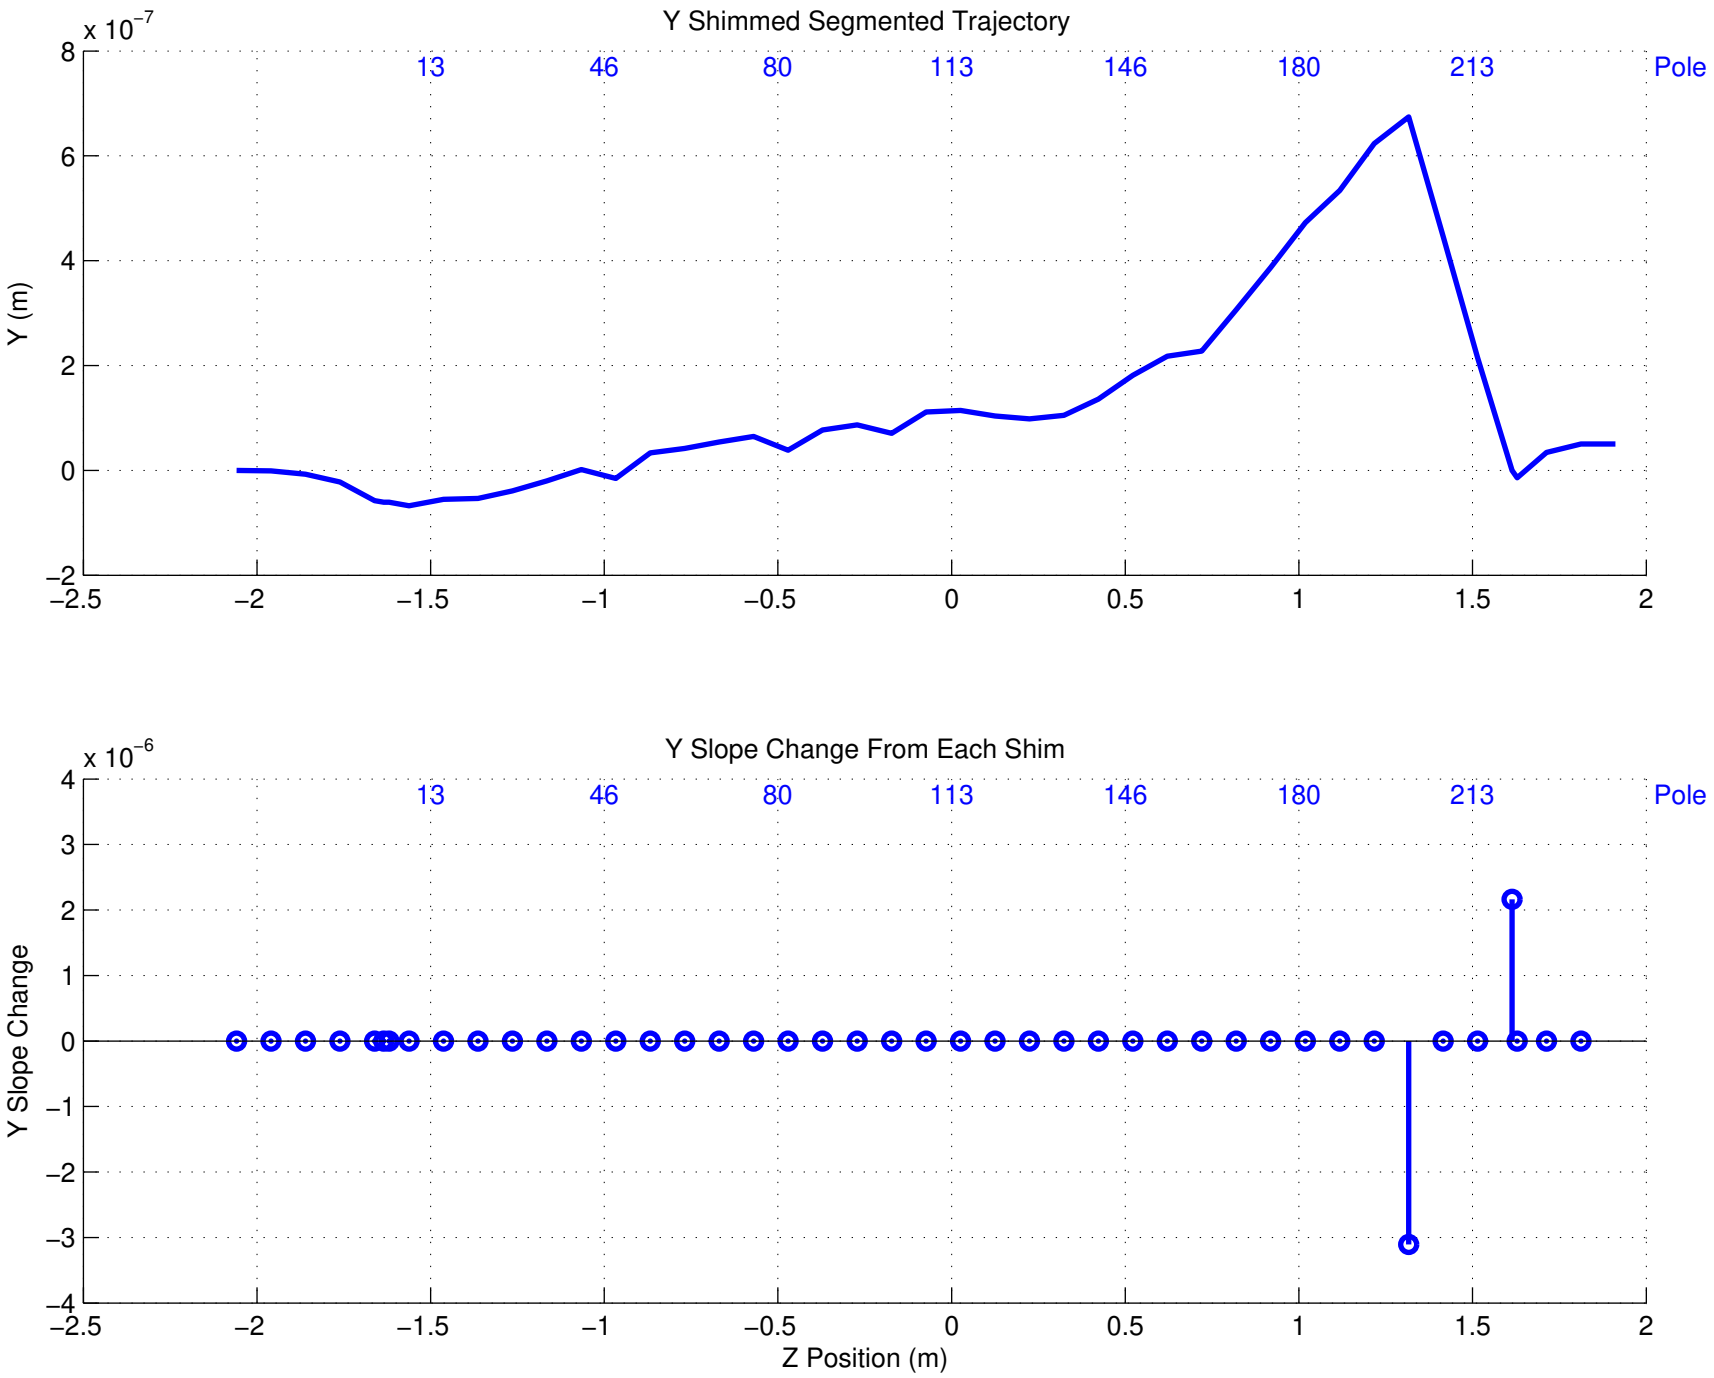
Y Shimmed Segmented Trajectory
x 10^-7
Y (m)
13
46
80
113
146
180
213
Pole
8
6
4
2
0
−2
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Y Slope Change From Each Shim
x 10^-6
Y Slope Change
4
3
2
1
0
−1
−2
−3
−4
Z Position (m)

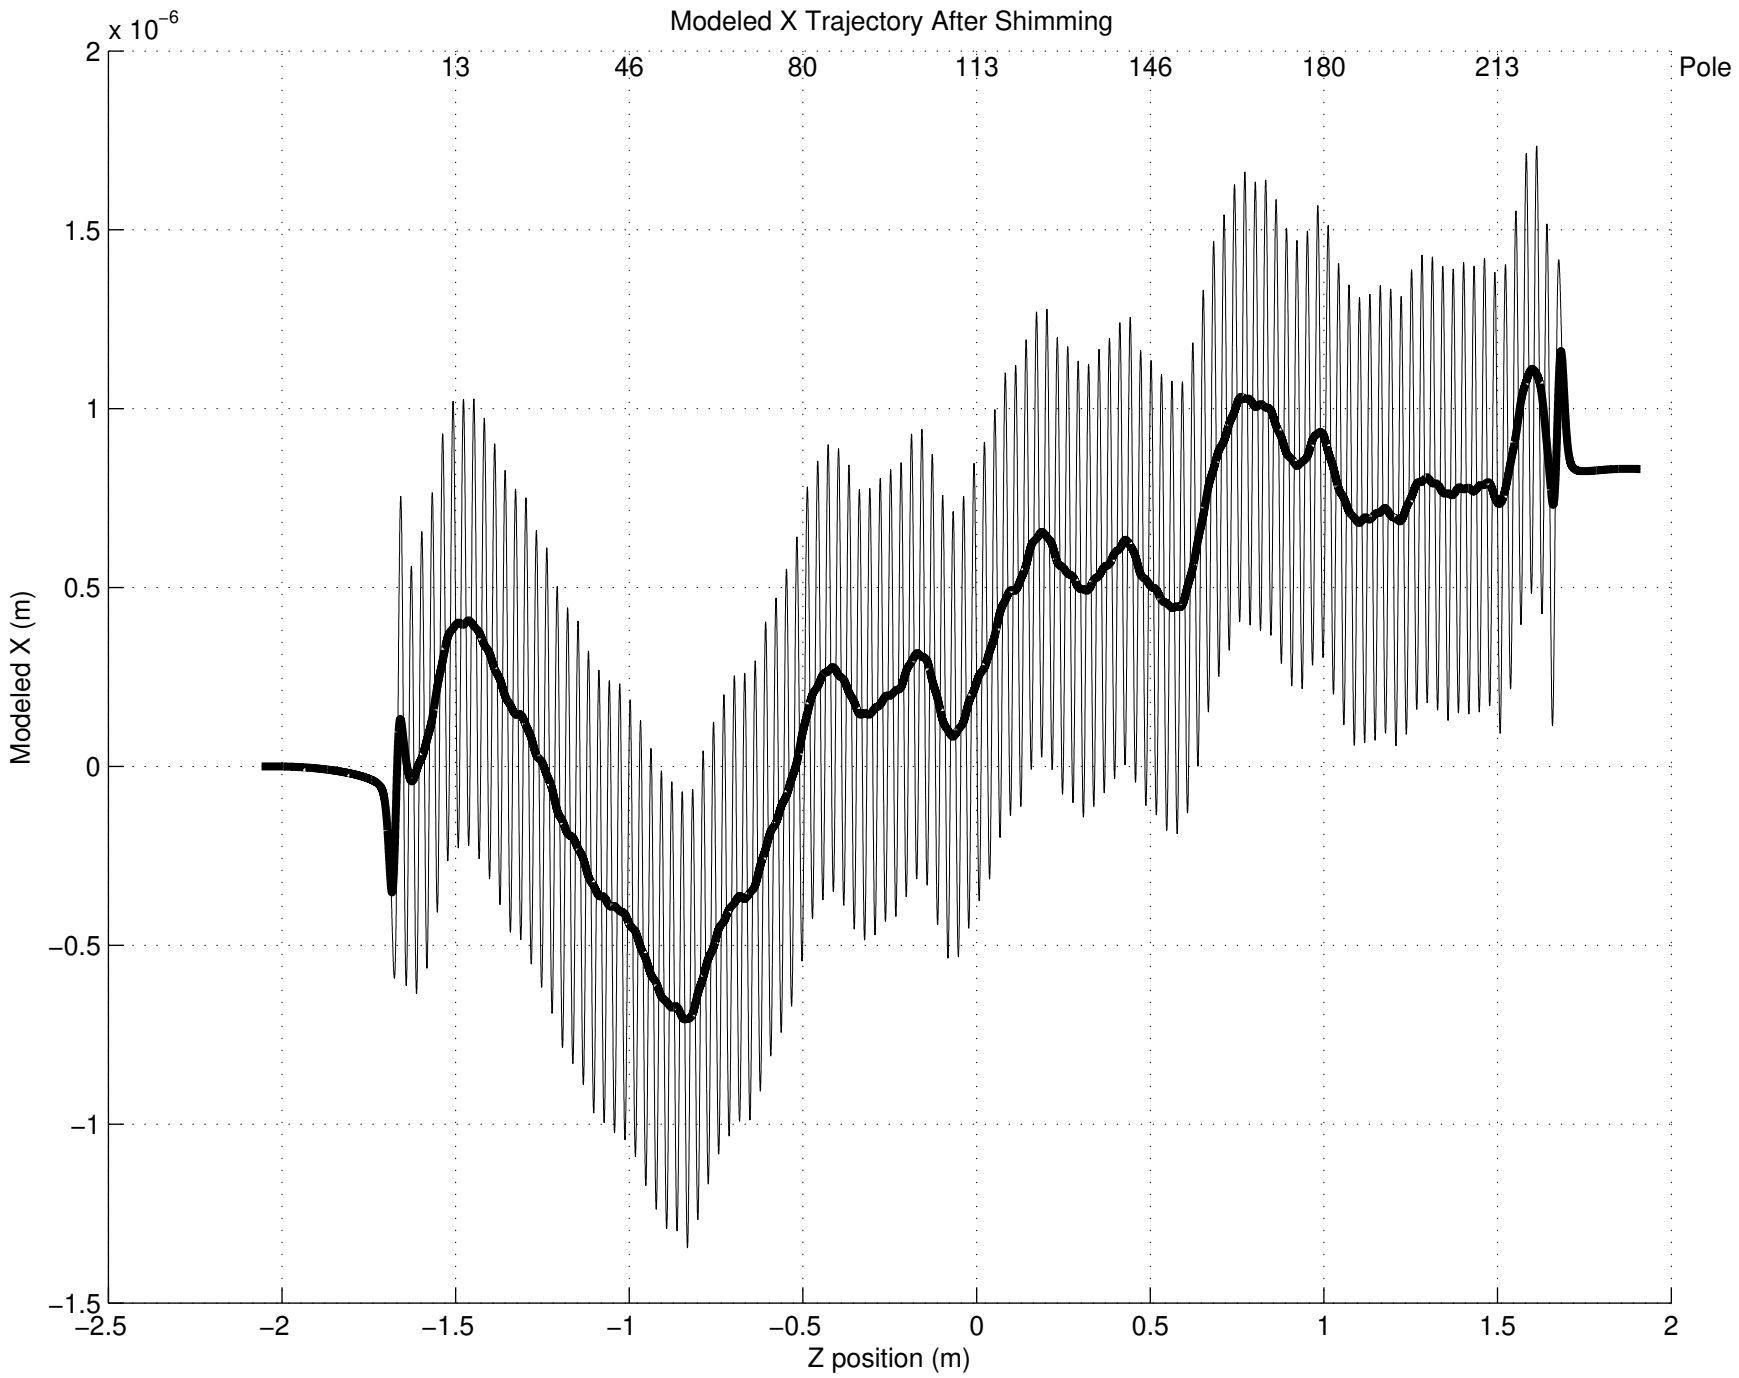
Modeled X Trajectory After Shimming
x 10^-6
2
1.5
1
0.5
0
−0.5
−1
−1.5
13
46
80
113
146
180
213
Pole
Modeled X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

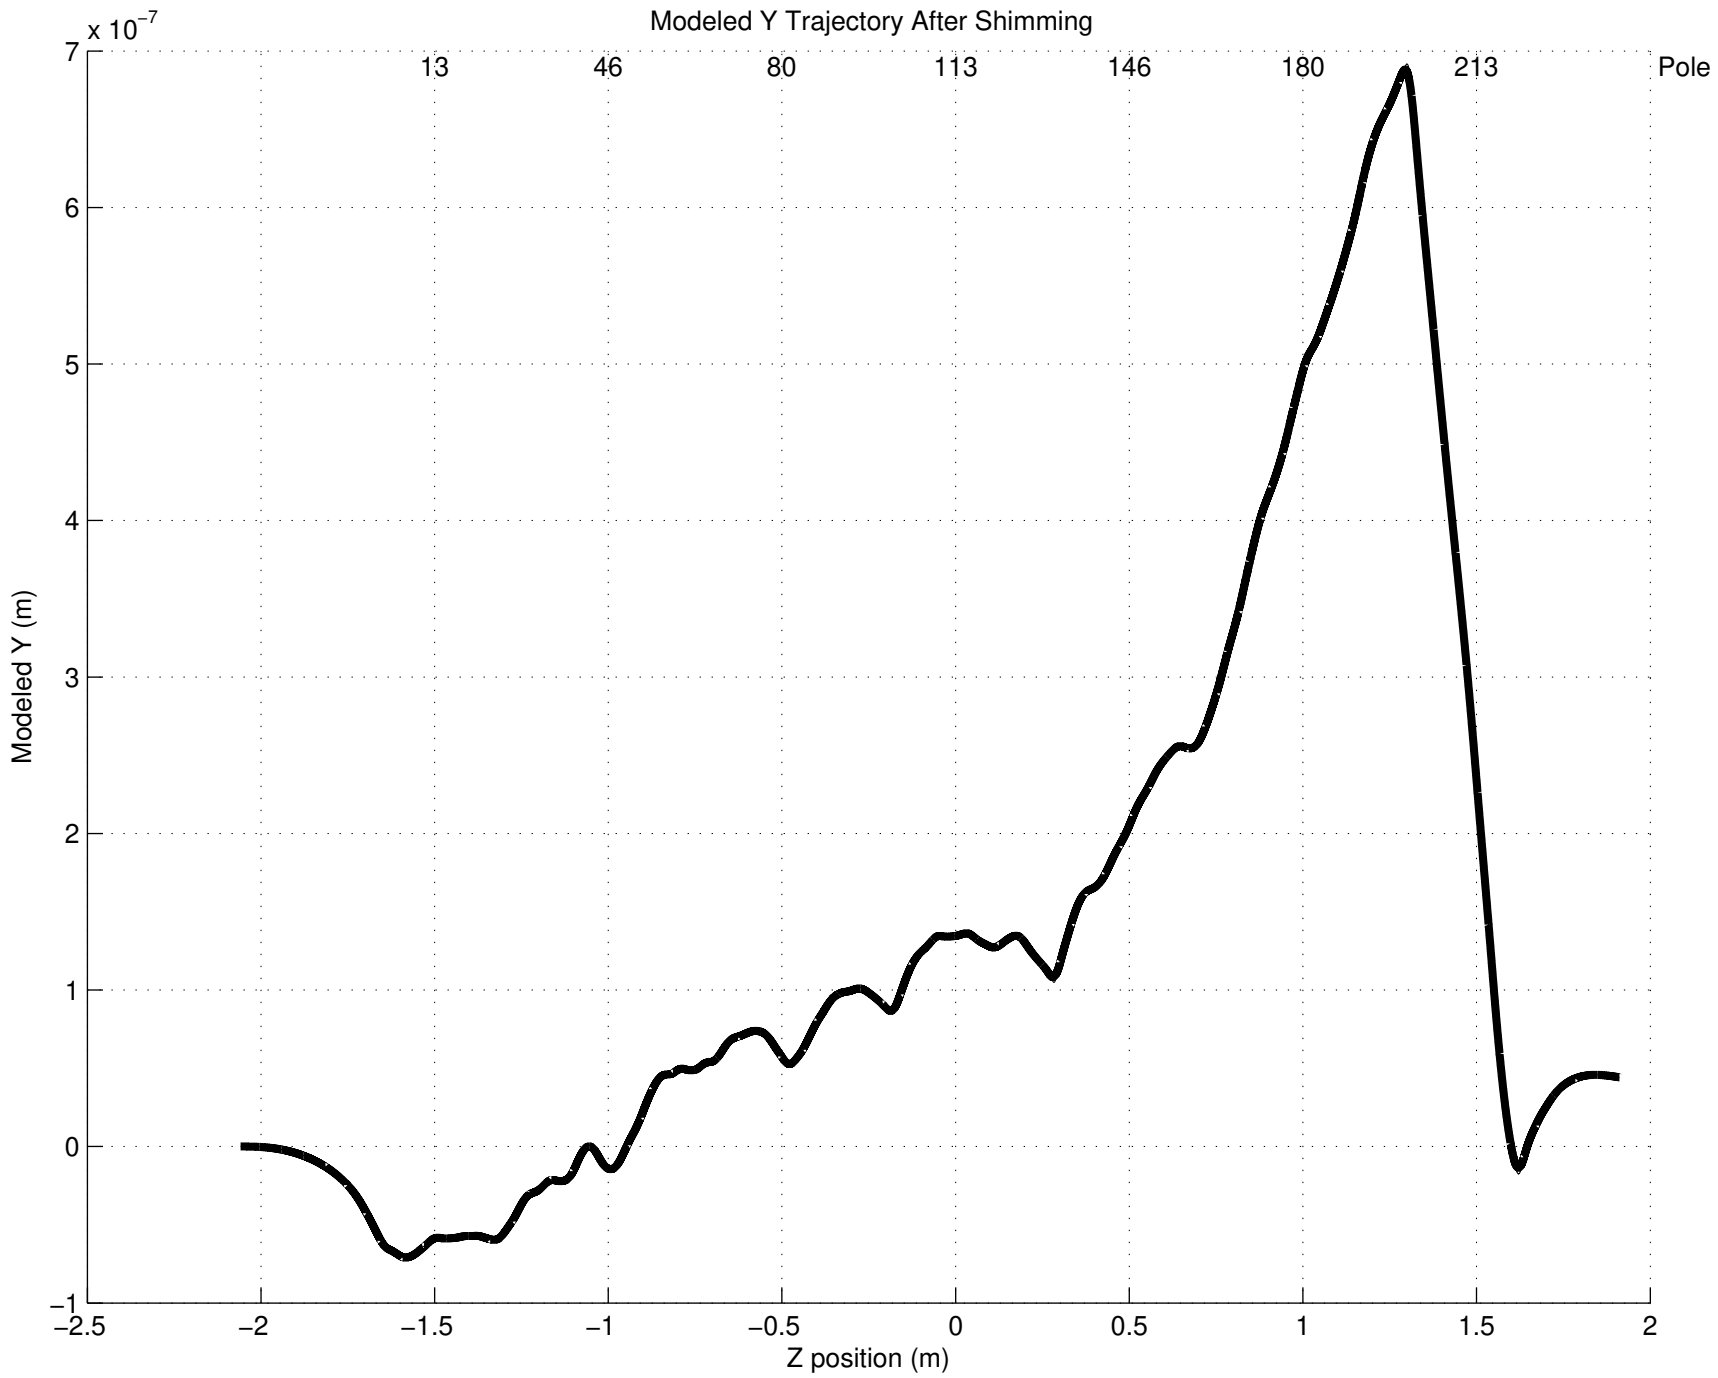
Modeled Y Trajectory After Shimming
x 10^-7
7
6
5
4
3
2
1
0
−1
13
46
80
113
146
180
213
Pole
Modeled Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

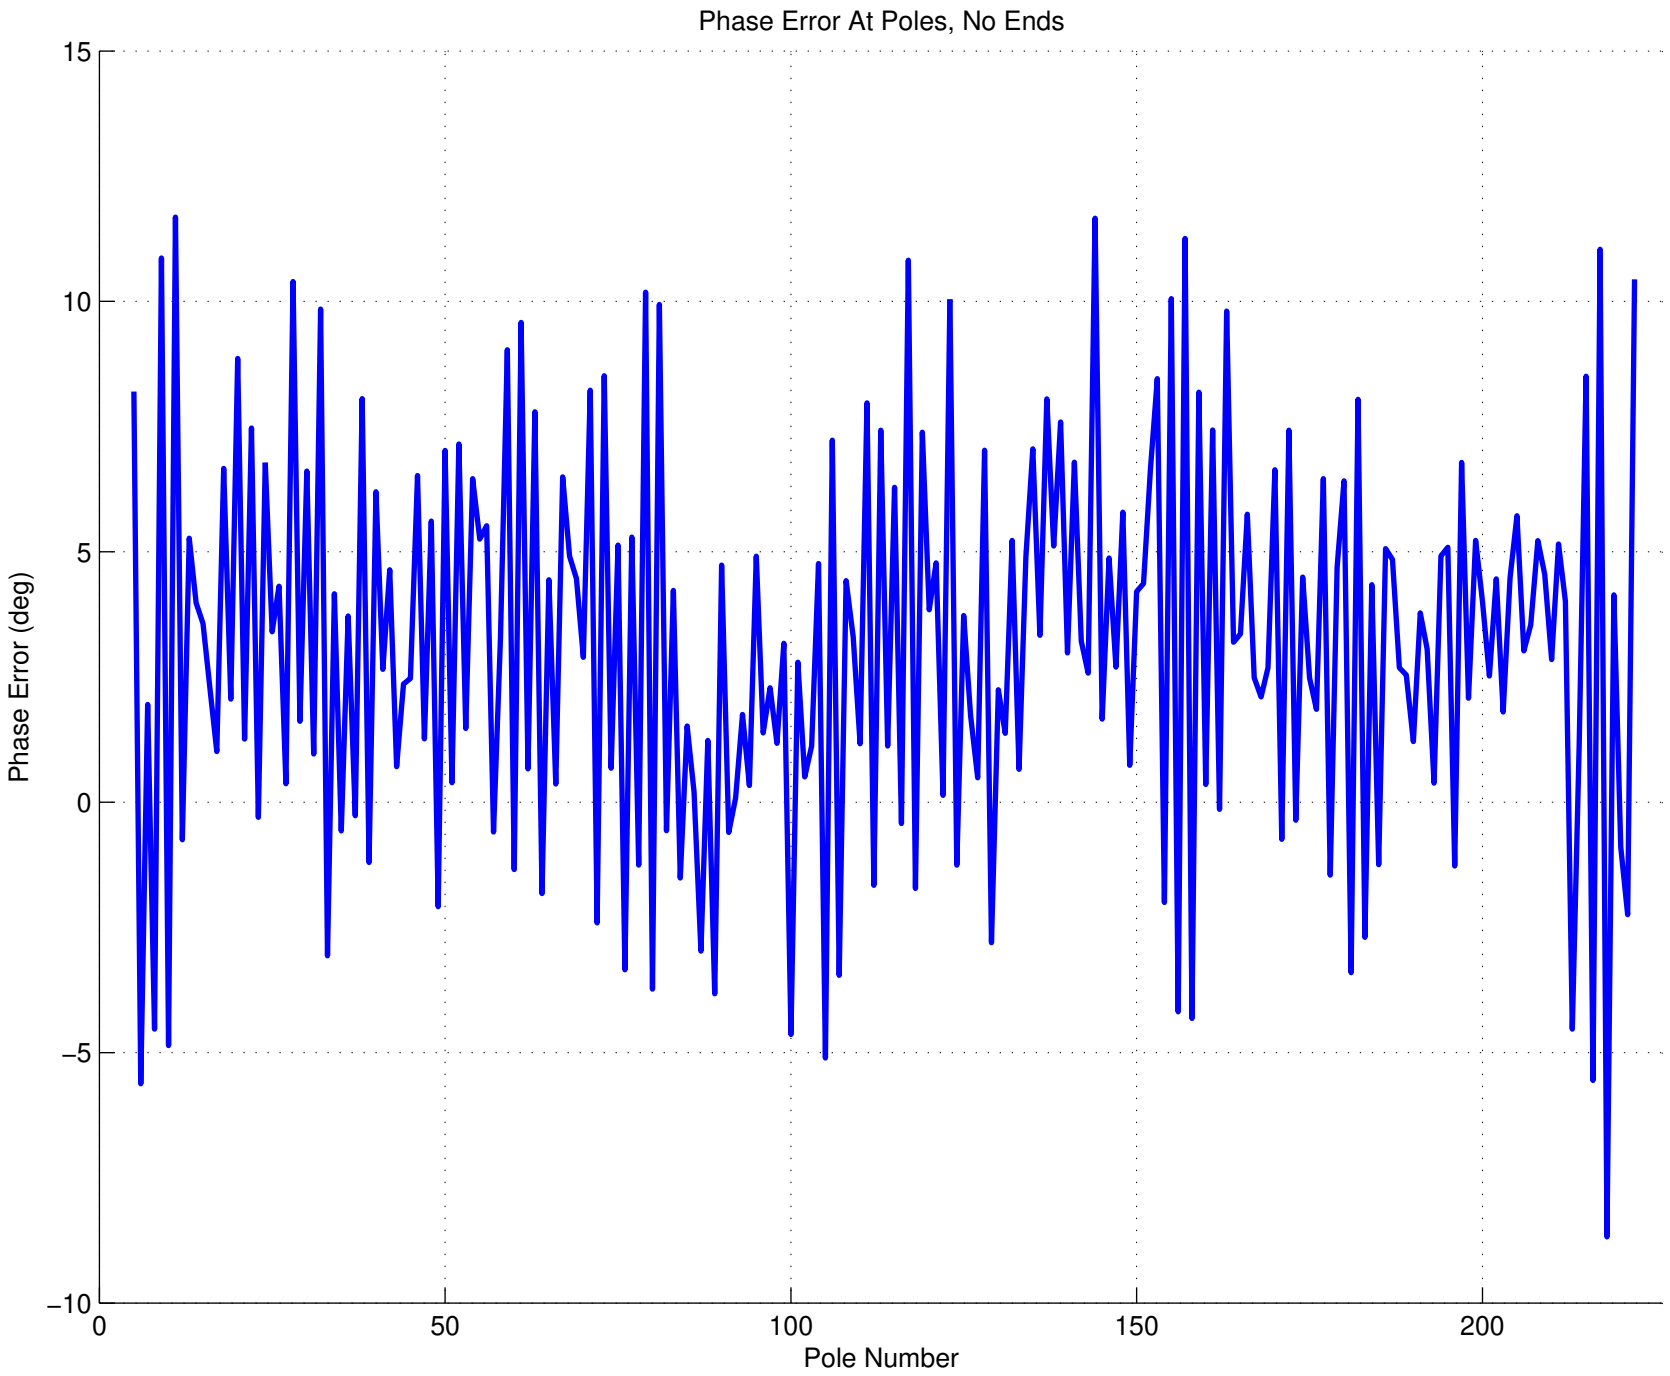
Phase Error At Poles, No Ends
Phase Error (deg)
15
10
5
0
−5
−10
0
50
100
150
200
Pole Number

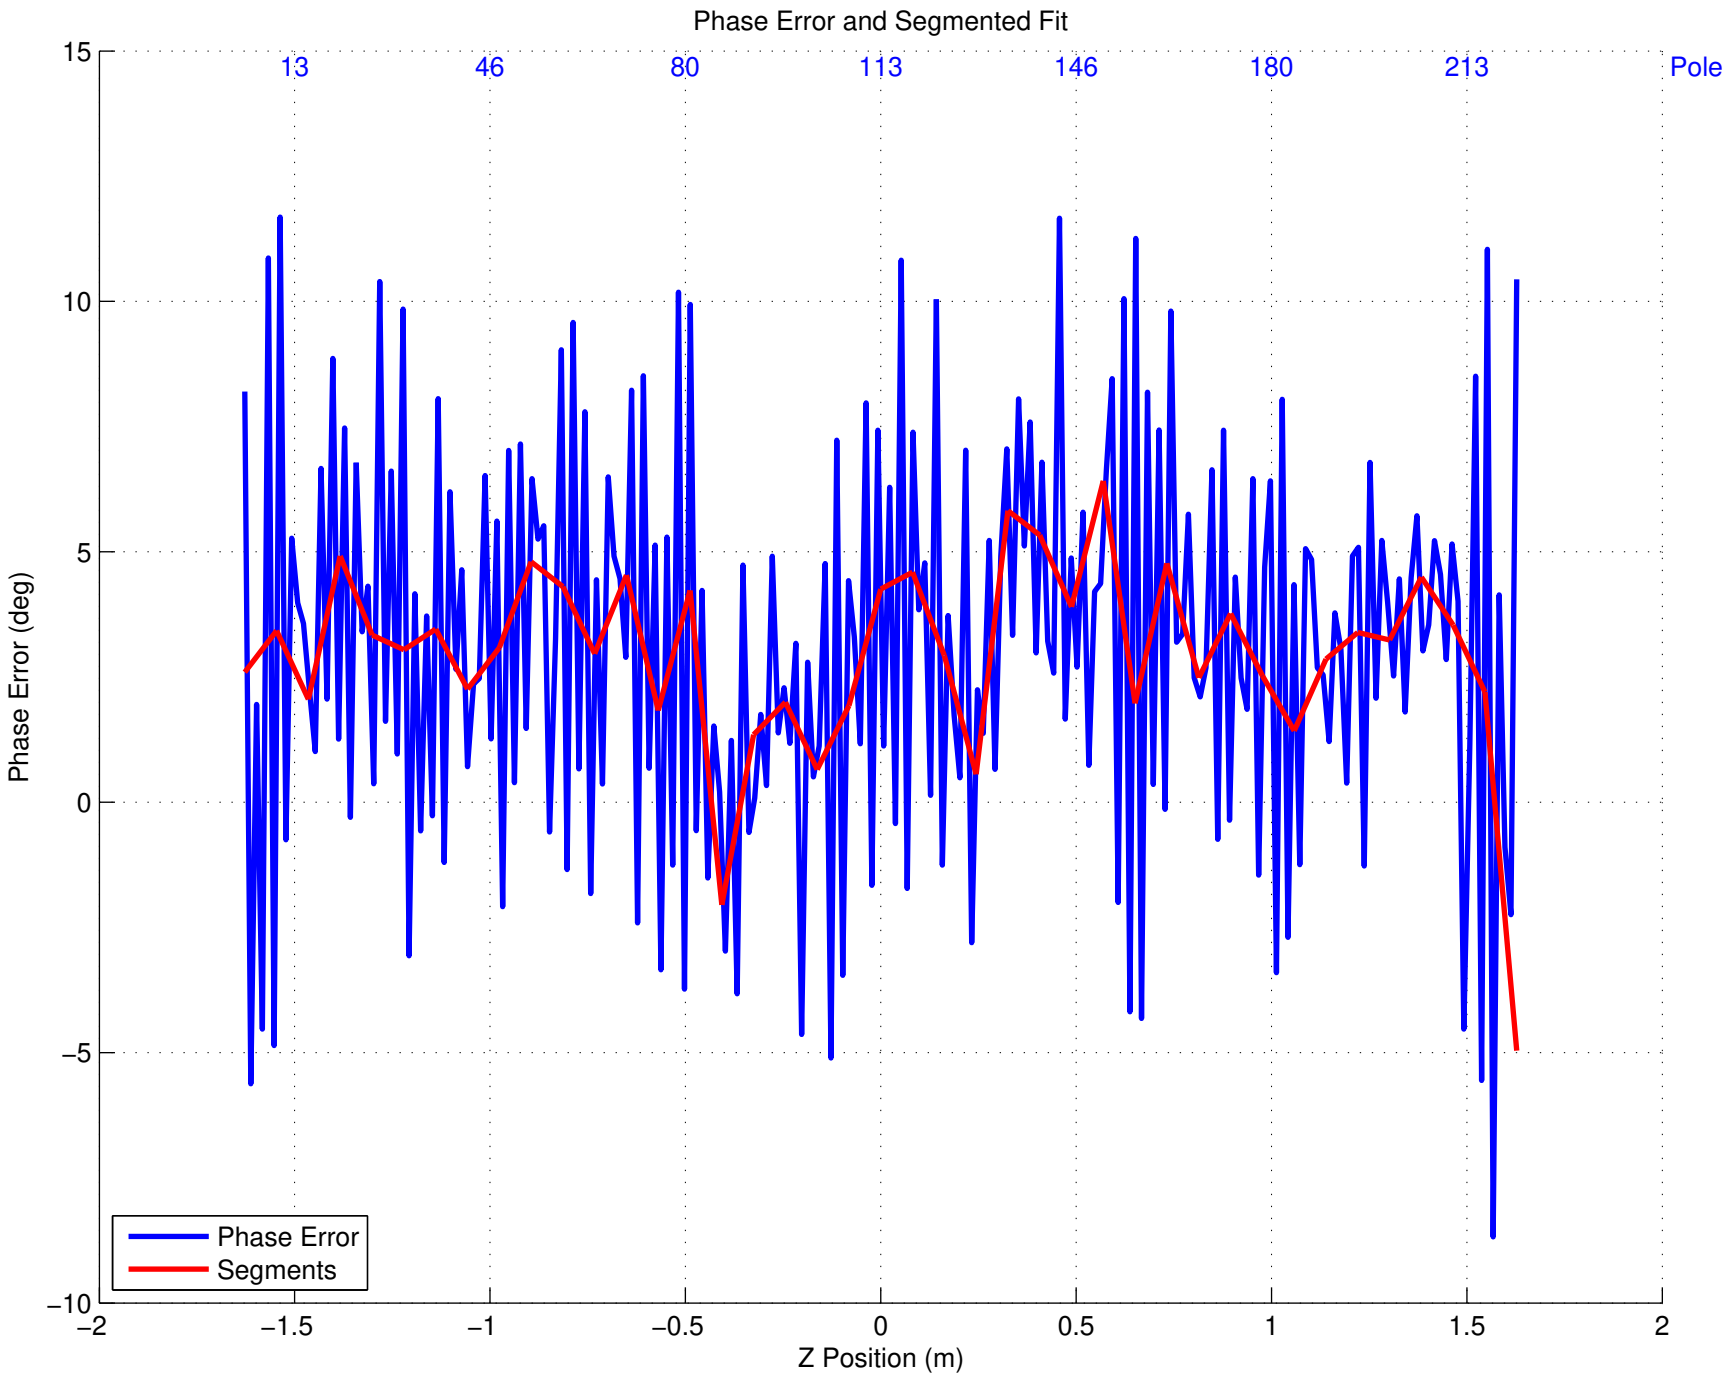
Phase Error and Segmented Fit
13
46
80
113
146
180
213
Pole
15
10
5
0
−5
−10
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Phase Error (deg)
Z Position (m)
Phase Error
Segments

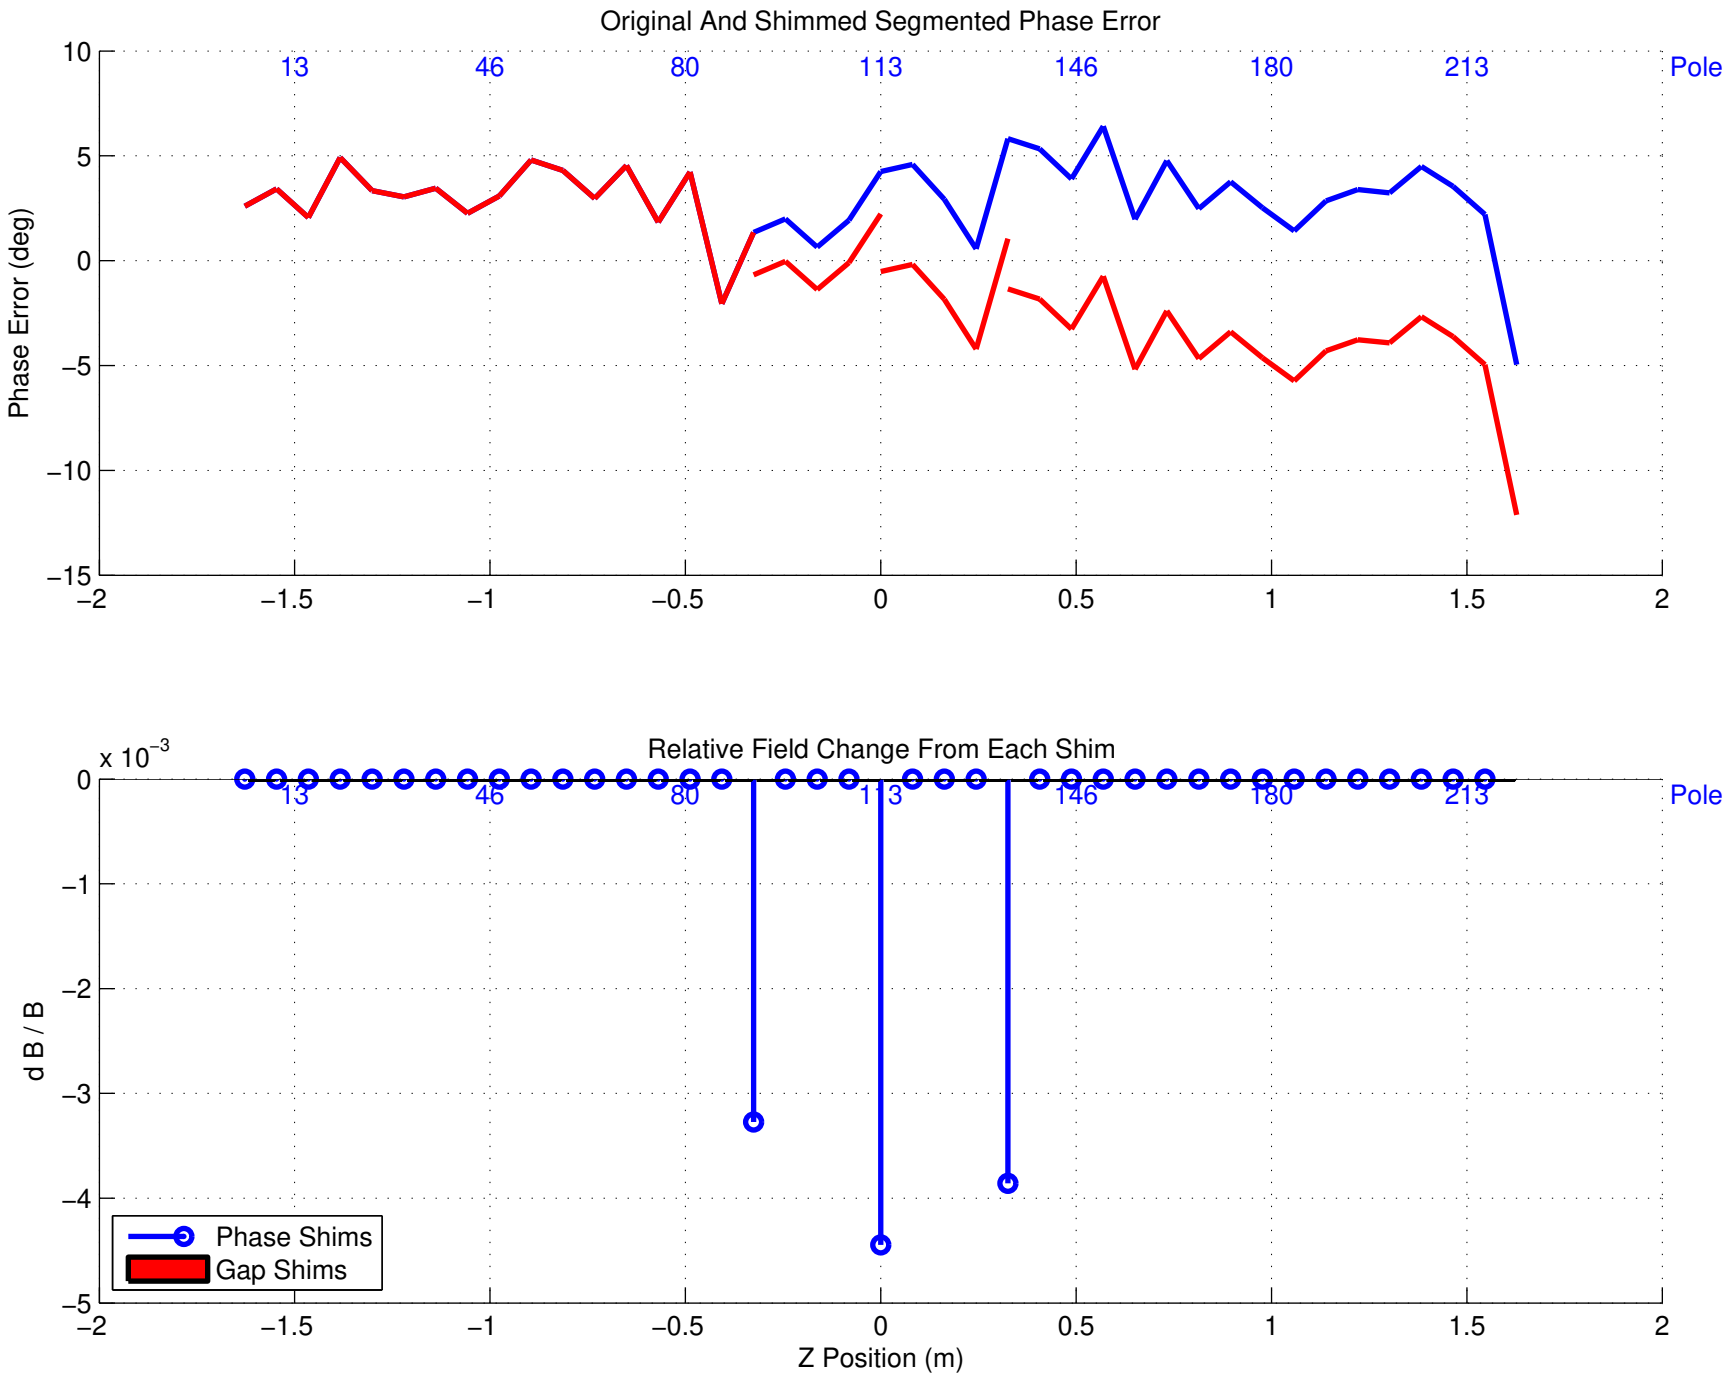
Original And Shimmed Segmented Phase Error
Phase Error (deg)
Pole
13
46
80
113
146
180
213
Relative Field Change From Each Shim
x 10^-3
d B / B
Z Position (m)
Phase Shims
Gap Shims

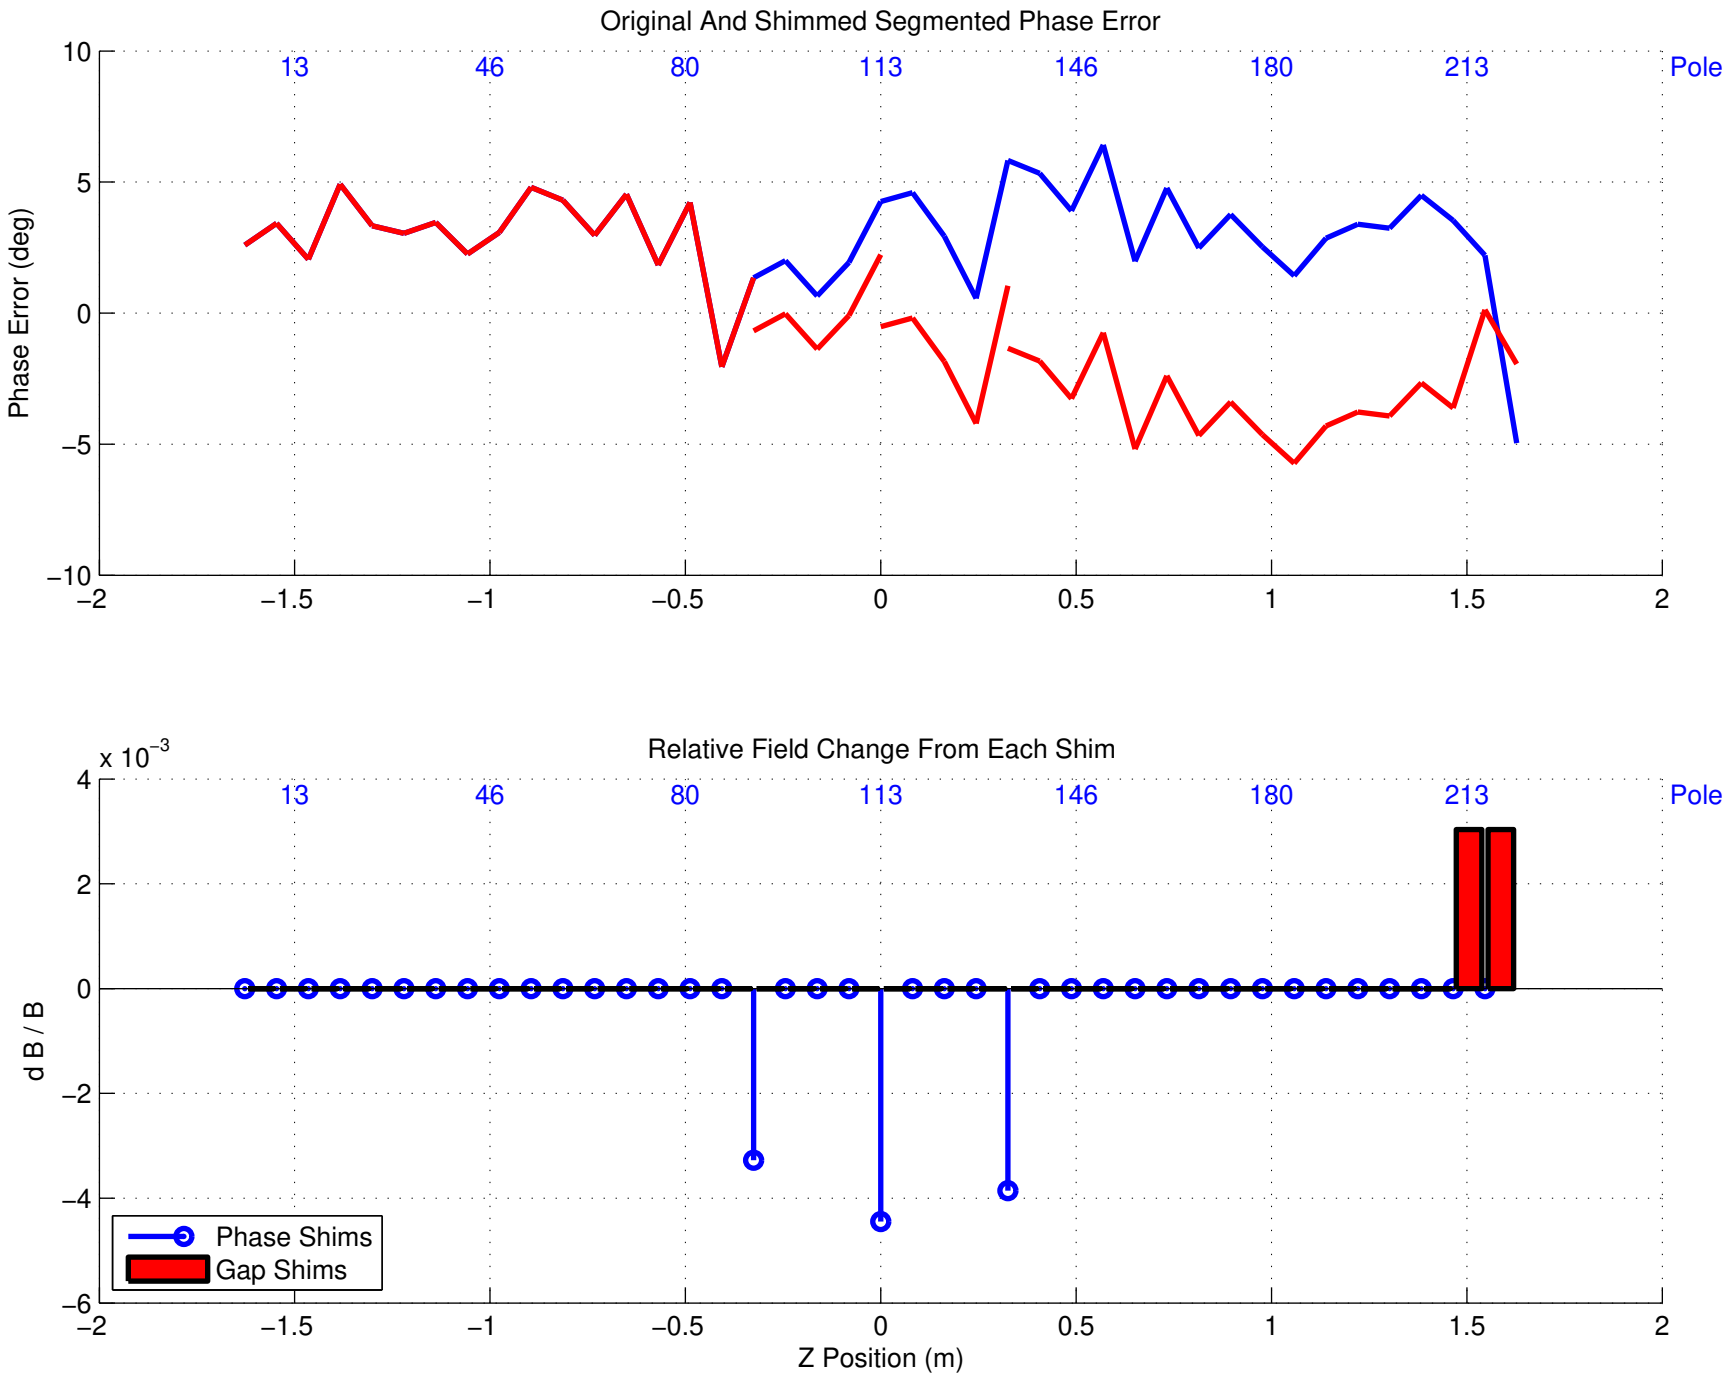
Original And Shimmed Segmented Phase Error
Phase Error (deg)
10
5
0
−5
−10
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
4
2
0
−2
−4
−6
Phase Shims
Gap Shims
Z Position (m)

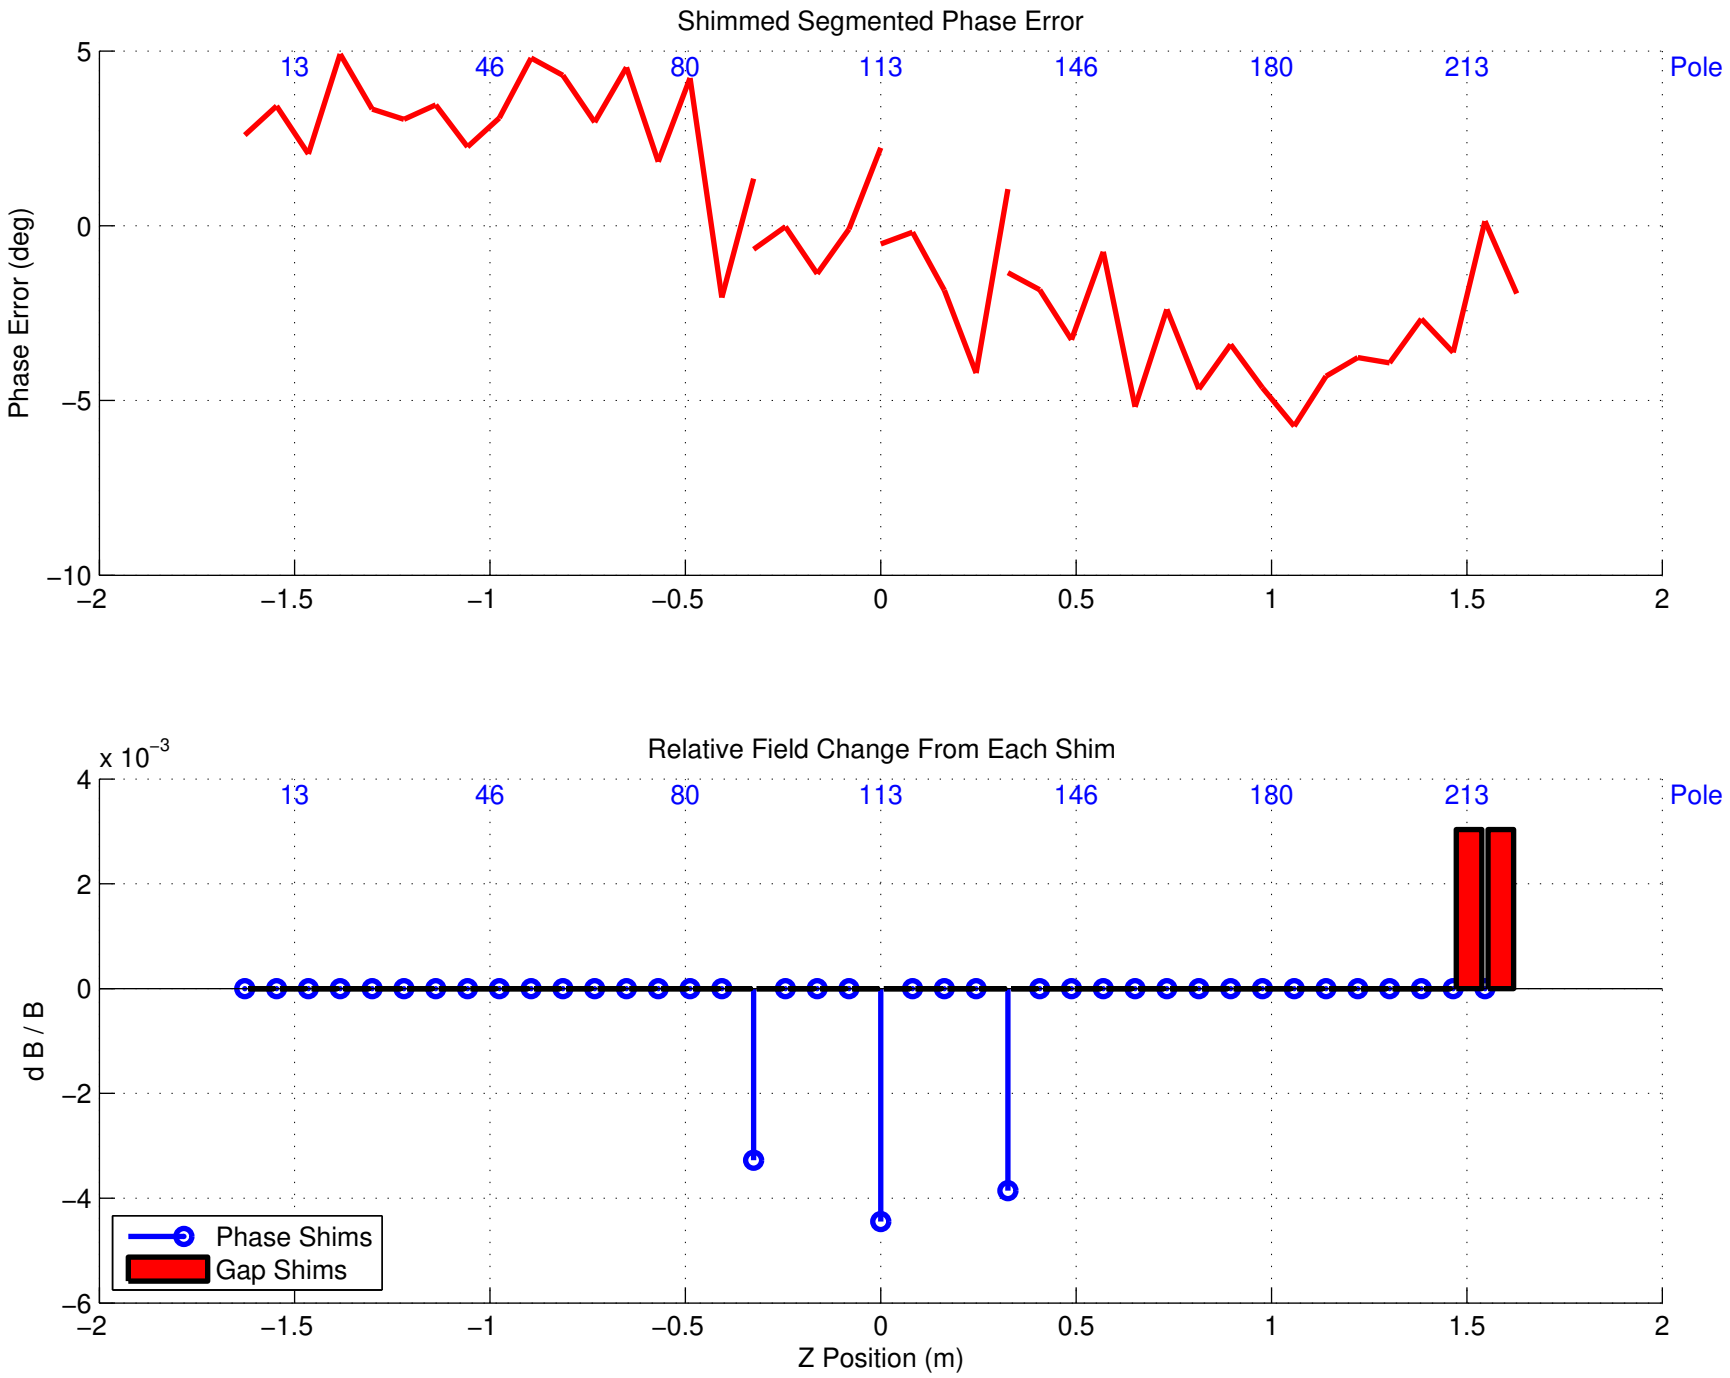
Shimmed Segmented Phase Error
Phase Error (deg)
13
46
80
113
146
180
213
Pole
5
0
−5
−10
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
4
2
0
−2
−4
−6
Phase Shims
Gap Shims
Z Position (m)

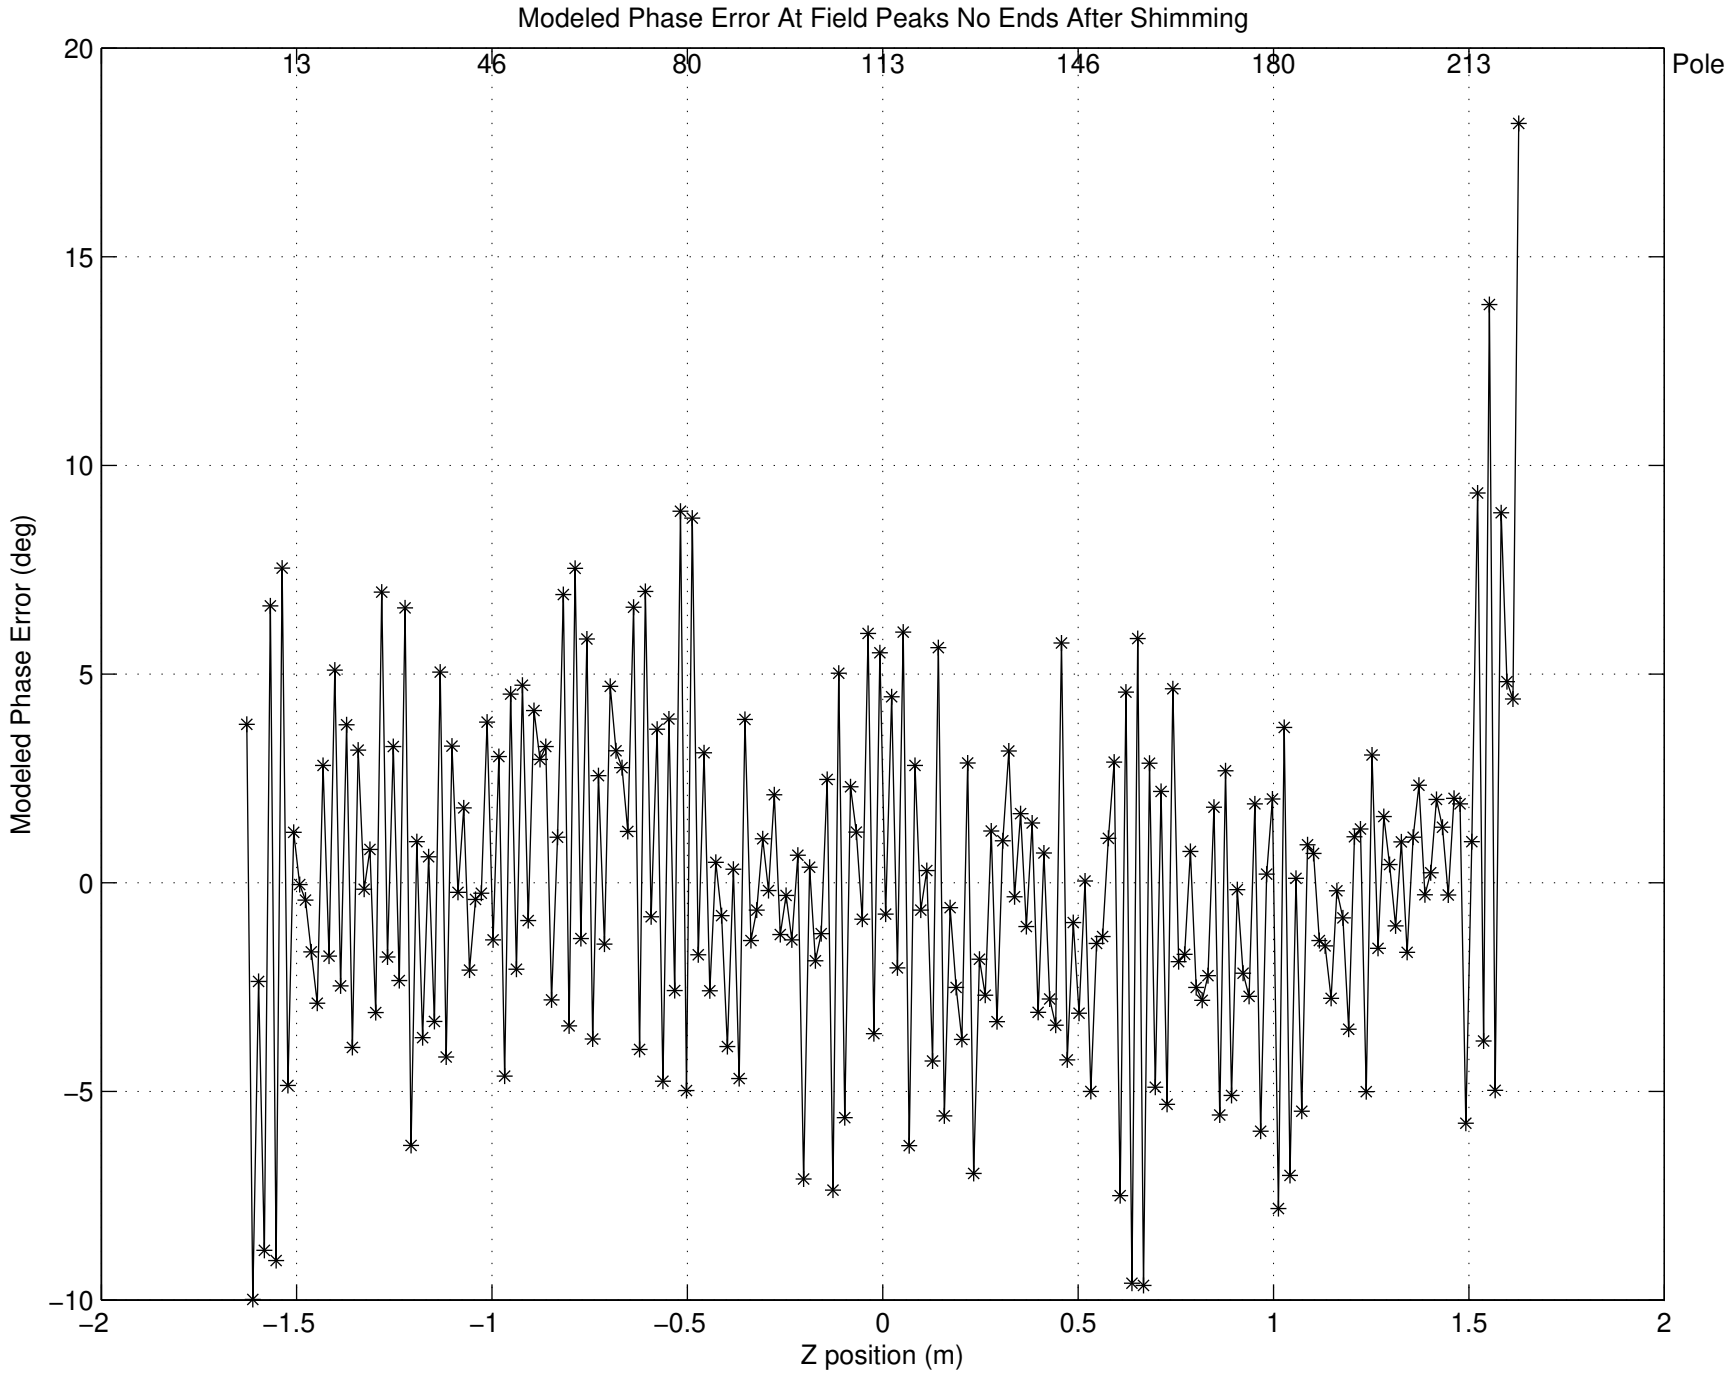

Phase Error: Ave = −0.000000 deg, RMS = 4.195064 deg