SLAC Magnetic Measurements
Mechanical Measurement Analysis

Parameters:
INPUT−FILE−DIR =V:\MET\MagServe\MagData\LCLS\Undulator\L143−112000−27\Temperature test\Align Cap Sensor\Run 009\
INPUT−FILE−NAME =mechp−dat.001

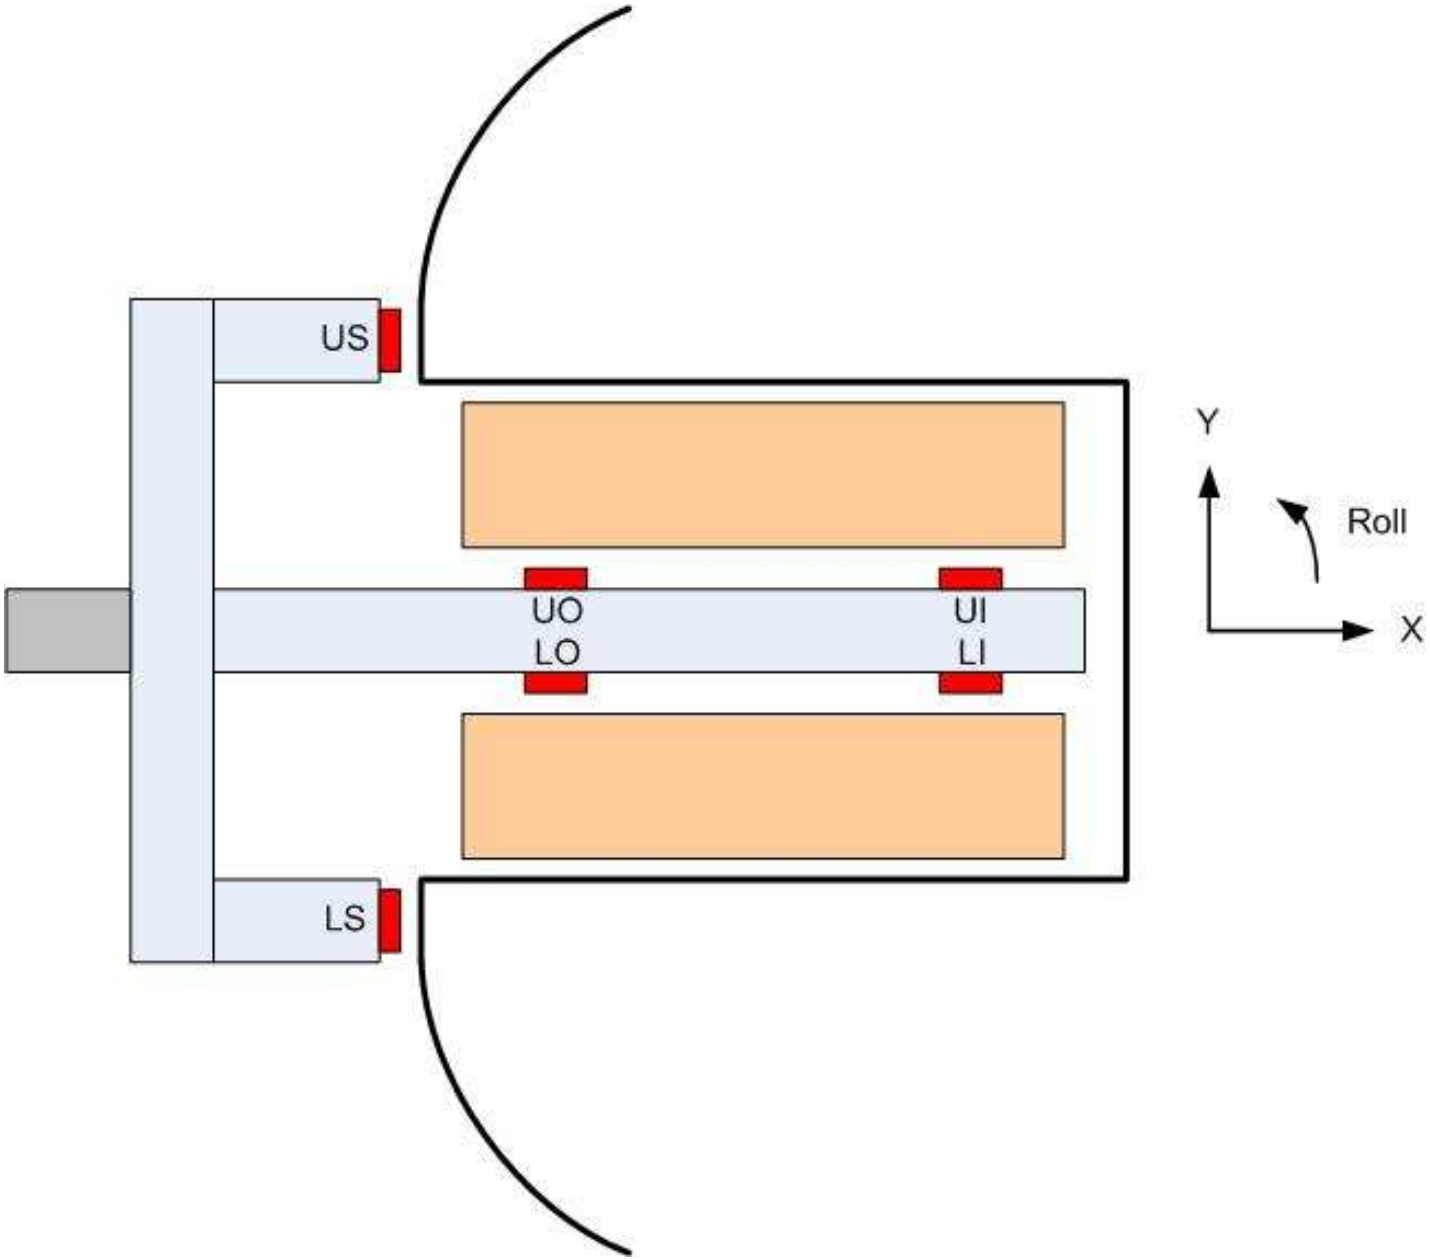
US
UO
LO
UI
LI
LS
Y
Roll
X

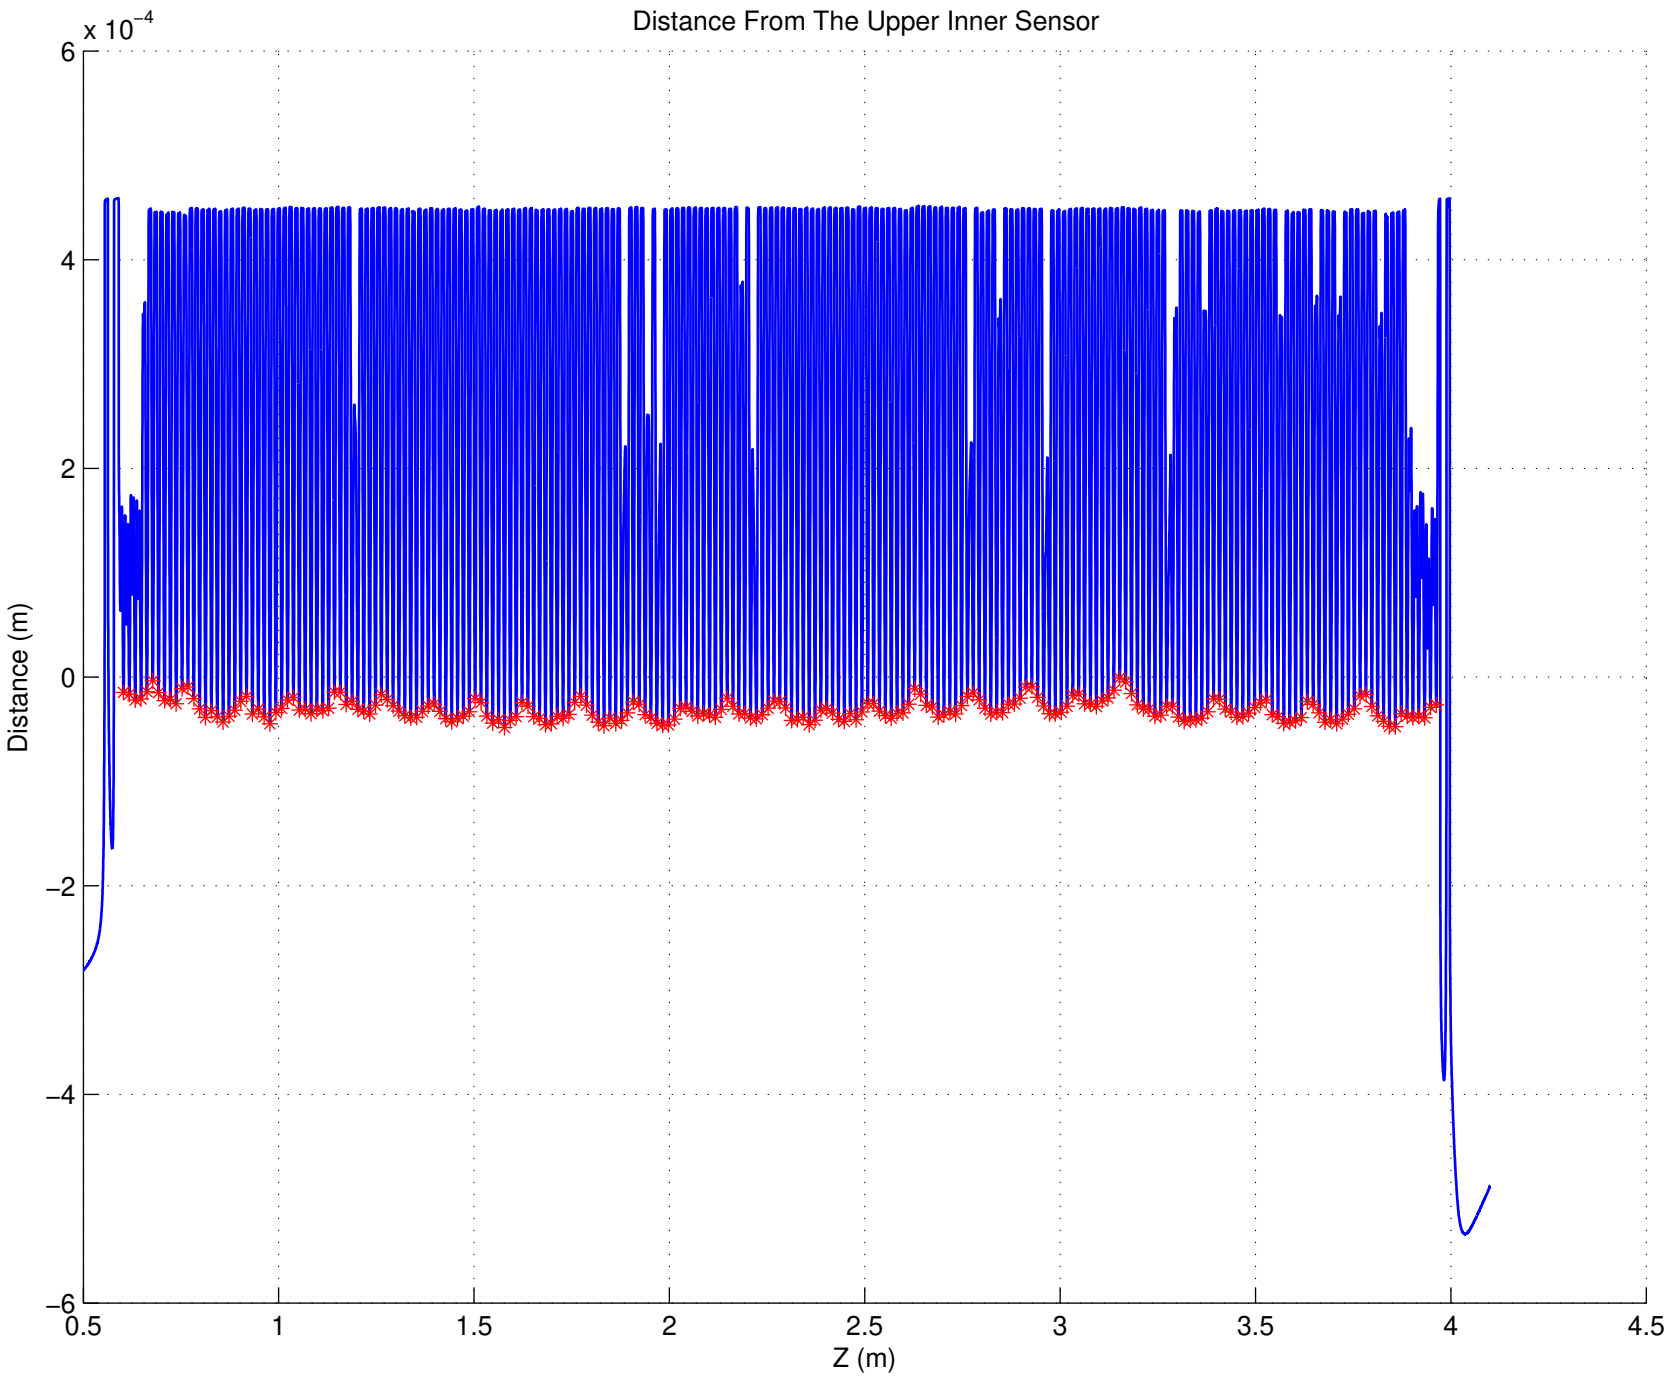
Distance From The Upper Inner Sensor
x 10^-4
6
4
2
0
−2
−4
−6
Distance (m)
0.5
1
1.5
2
2.5
3
3.5
4
4.5
Z (m)

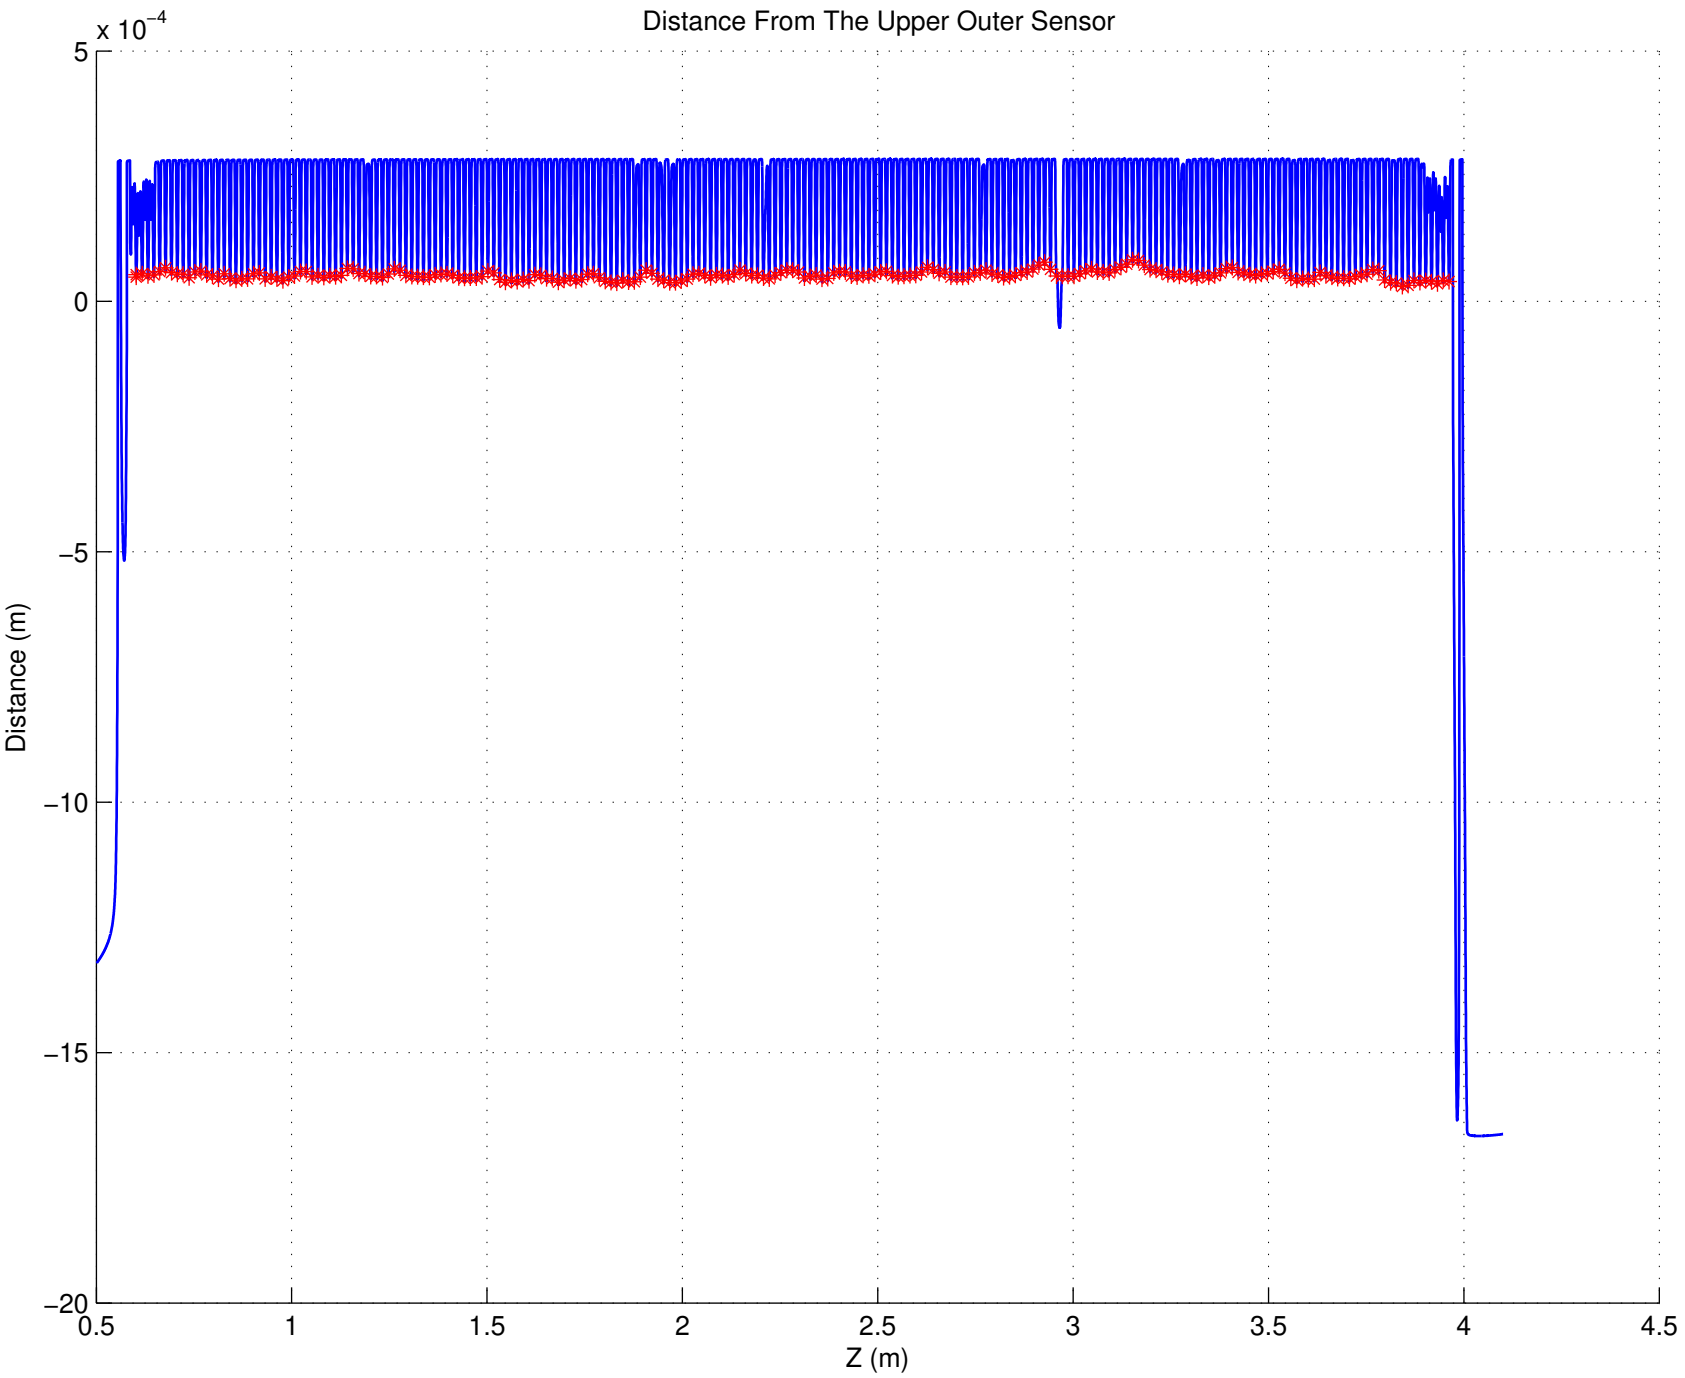
Distance From The Upper Outer Sensor
x 10^-4
5
0
−5
−10
−15
−20
Distance (m)
0.5
1
1.5
2
2.5
3
3.5
4
4.5
Z (m)

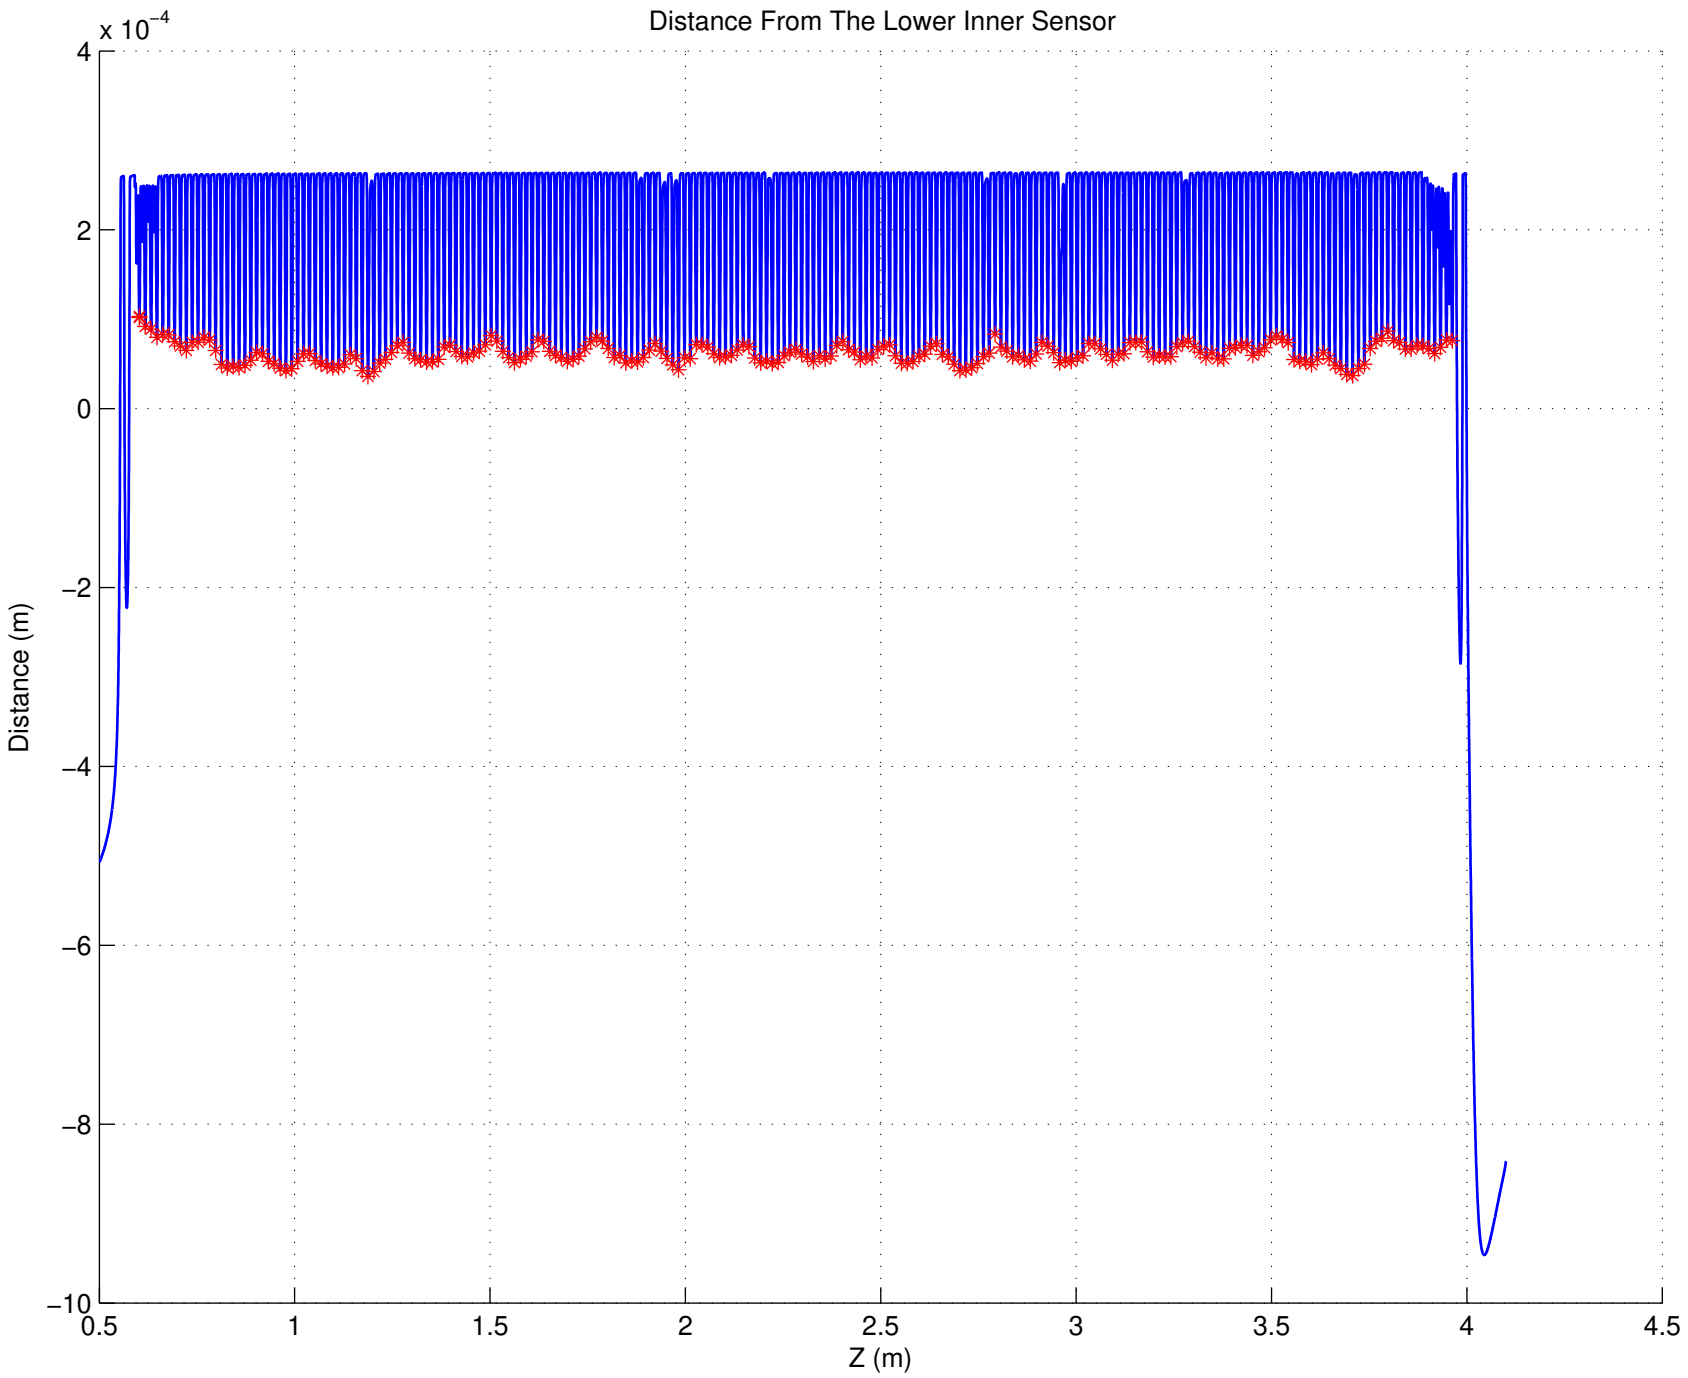
Distance From The Lower Inner Sensor
x 10^-4
4
2
0
−2
−4
−6
−8
−10
Distance (m)
0.5
1
1.5
2
2.5
3
3.5
4
4.5
Z (m)

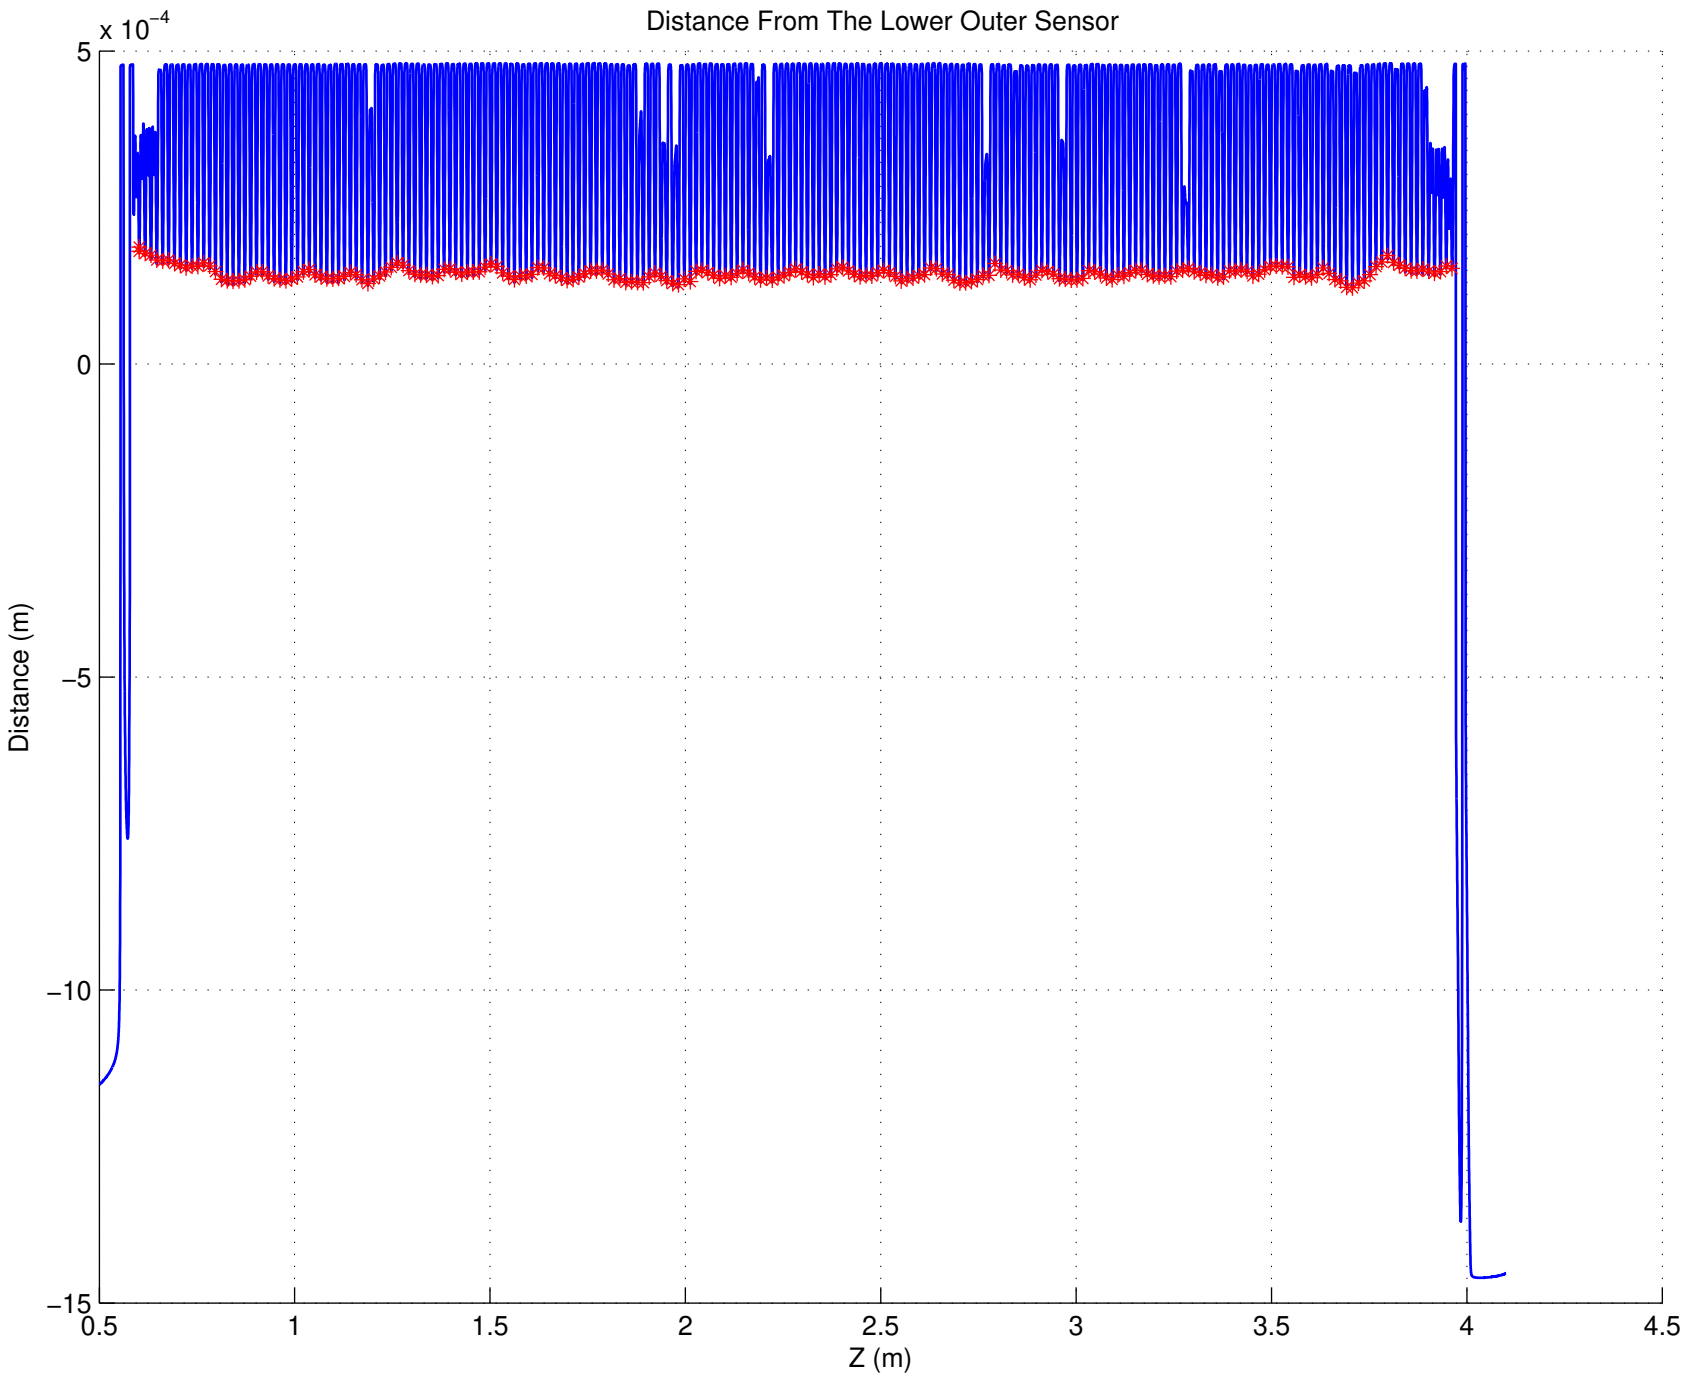
Distance From The Lower Outer Sensor
x 10^-4
5
0
−5
−10
−15
Distance (m)
0.5
1
1.5
2
2.5
3
3.5
4
4.5
Z (m)

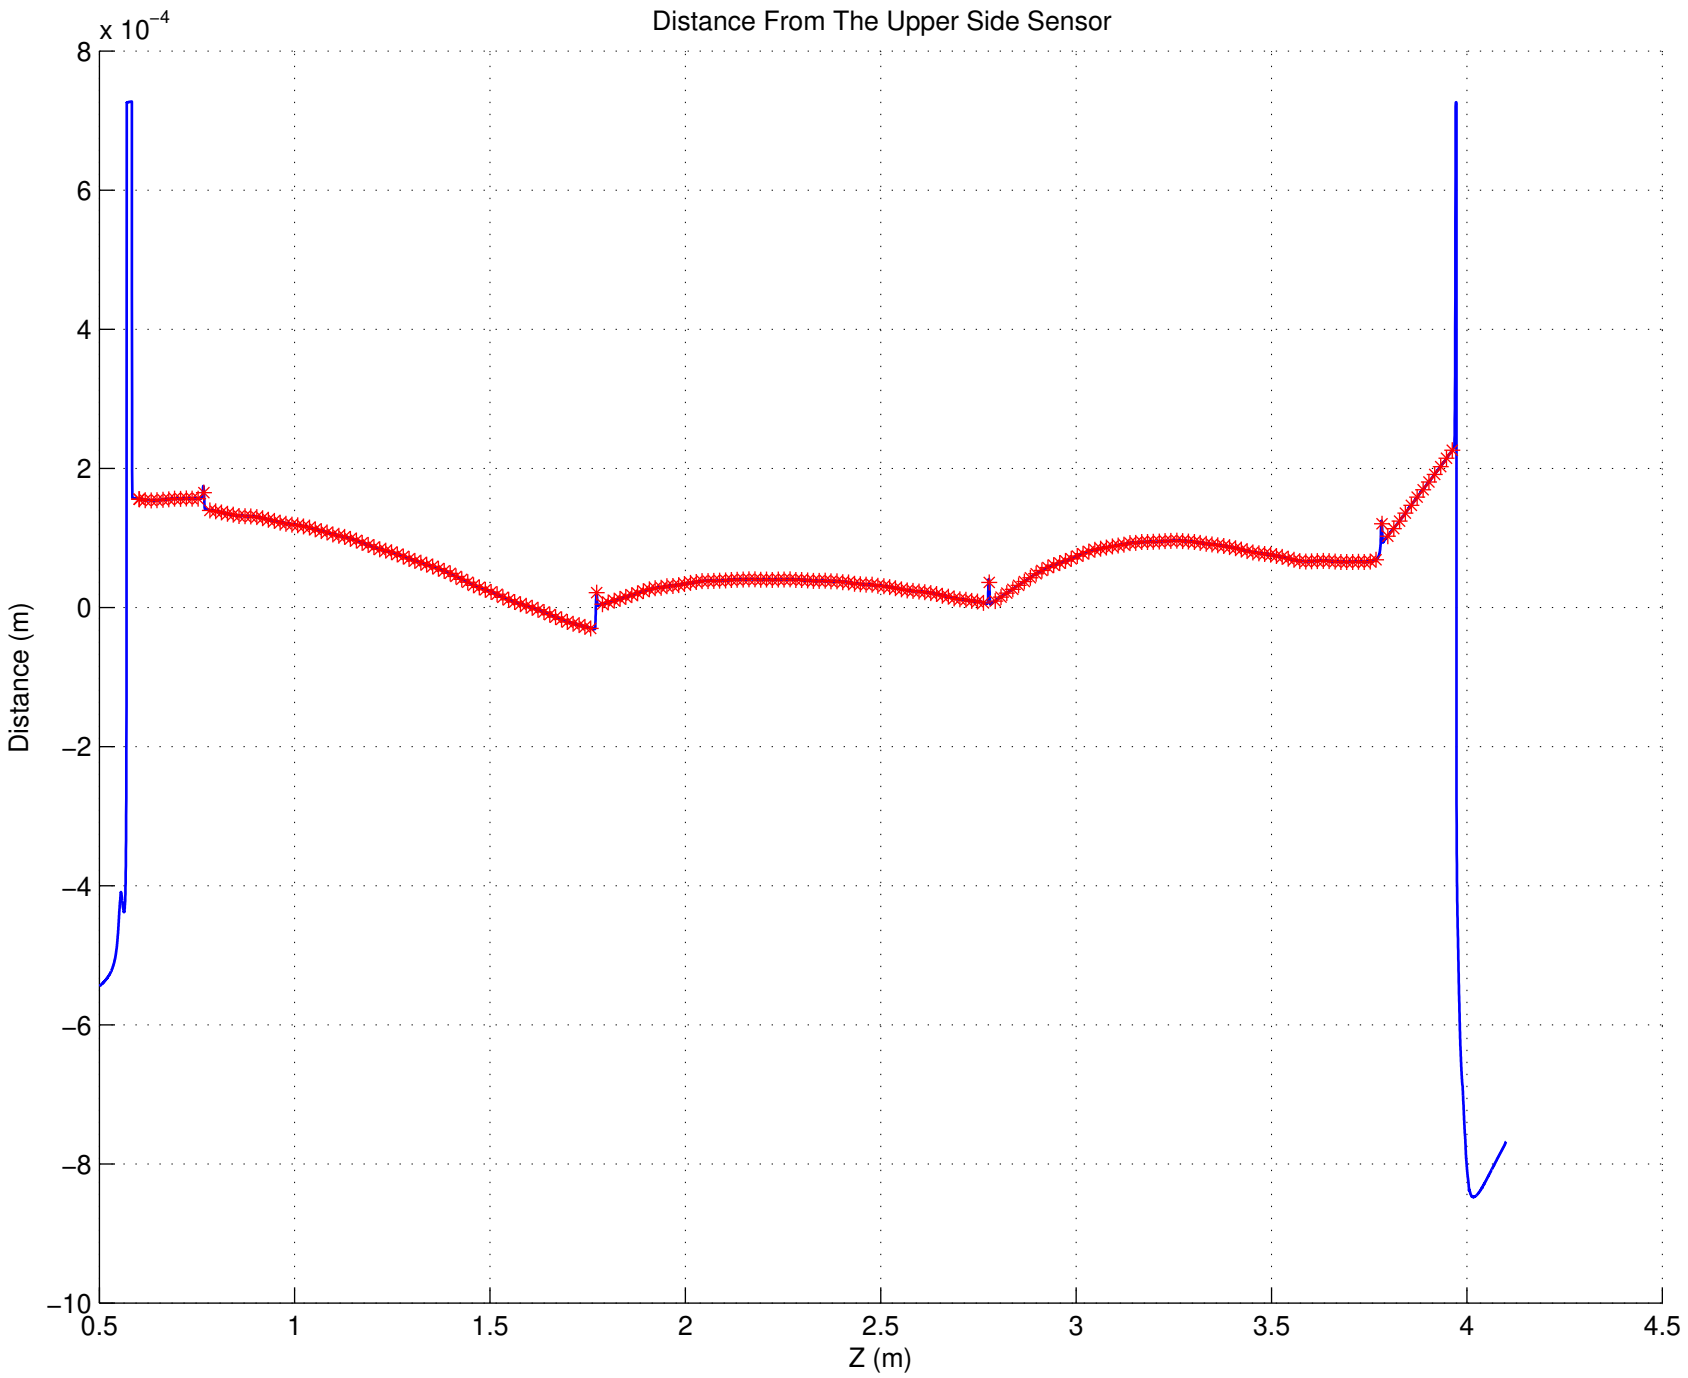
Distance From The Upper Side Sensor
x 10^-4
8
6
4
2
0
−2
−4
−6
−8
−10
Distance (m)
0.5
1
1.5
2
2.5
3
3.5
4
4.5
Z (m)

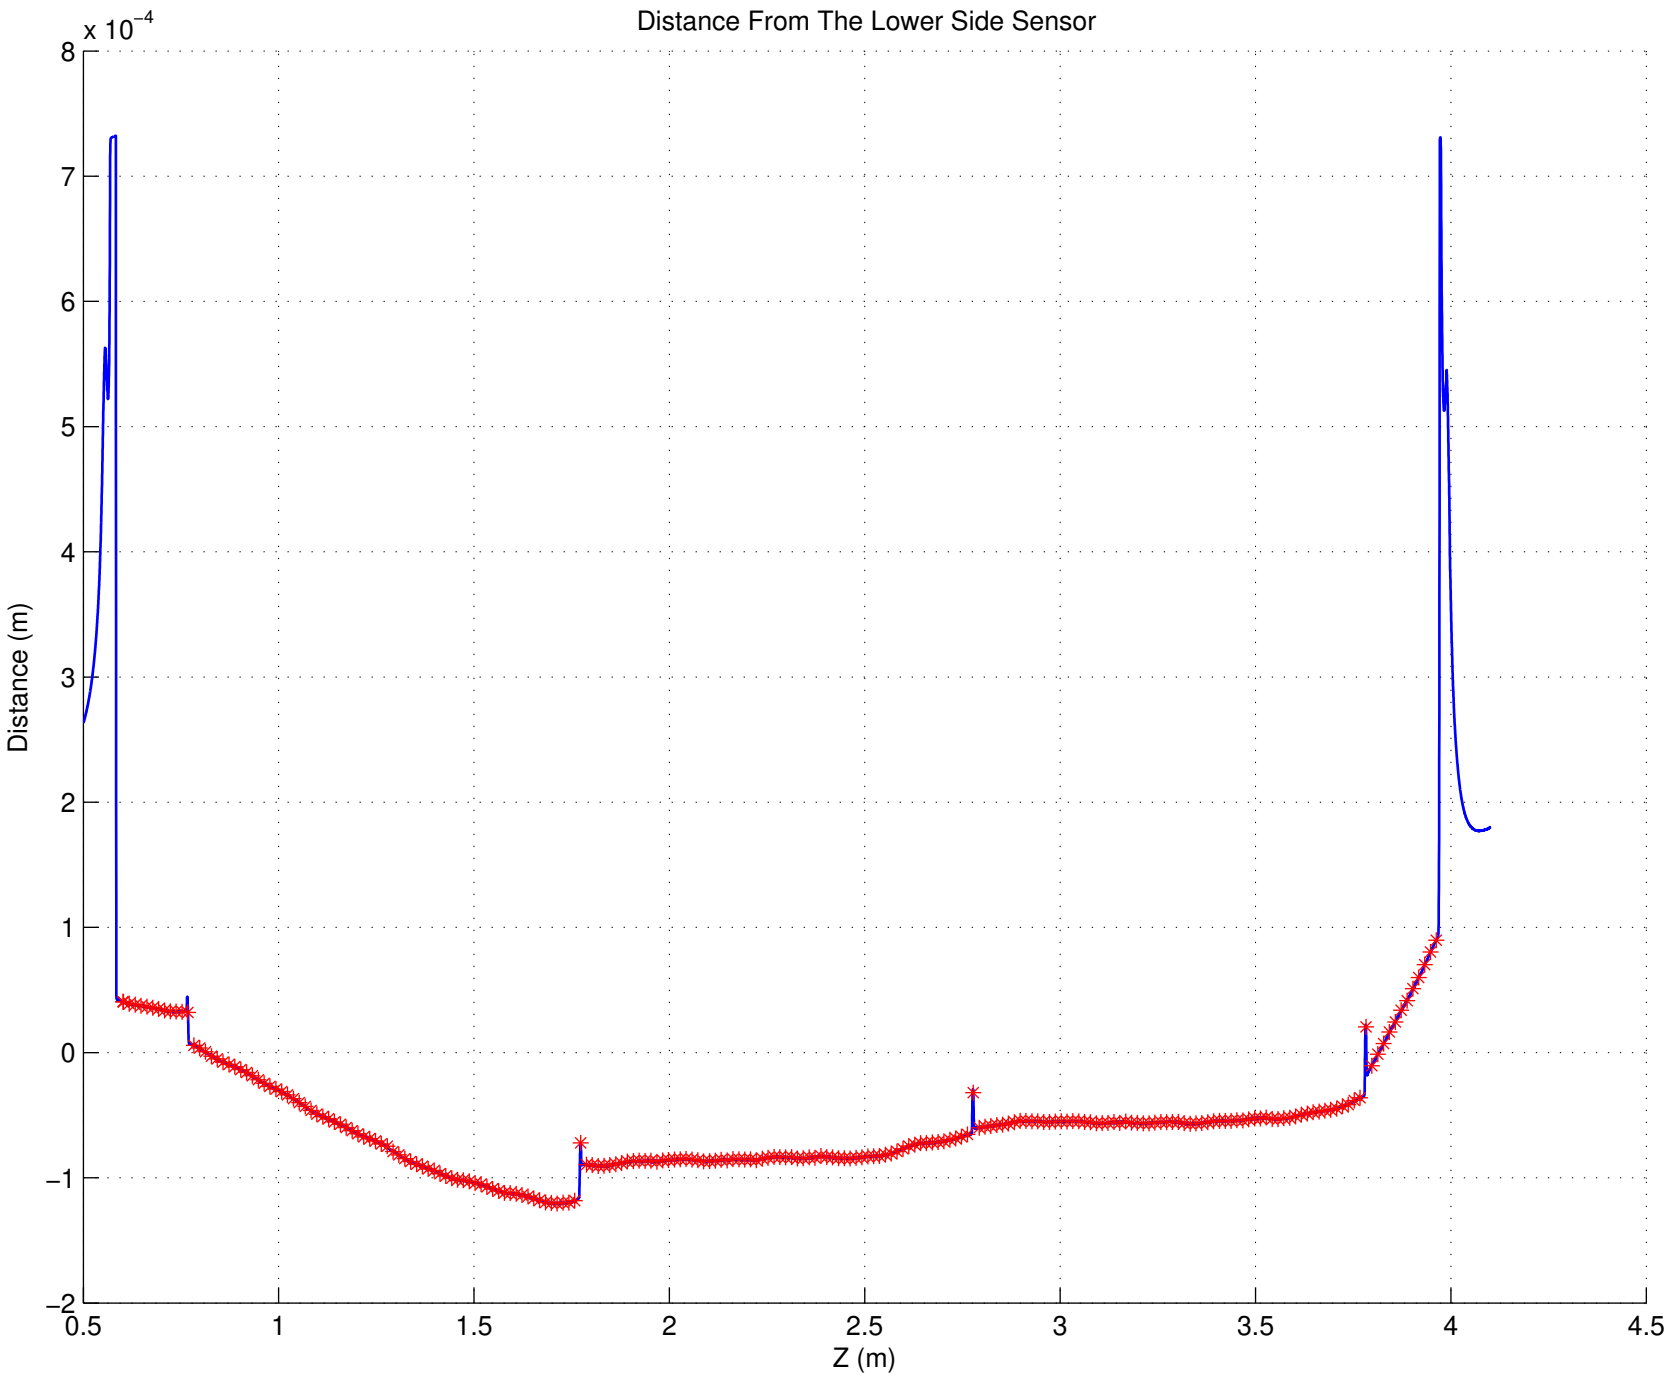
Distance From The Lower Side Sensor
x 10^-4
Distance (m)
Z (m)
8
7
6
5
4
3
2
1
0
−1
−2
0.5
1
1.5
2
2.5
3
3.5
4
4.5

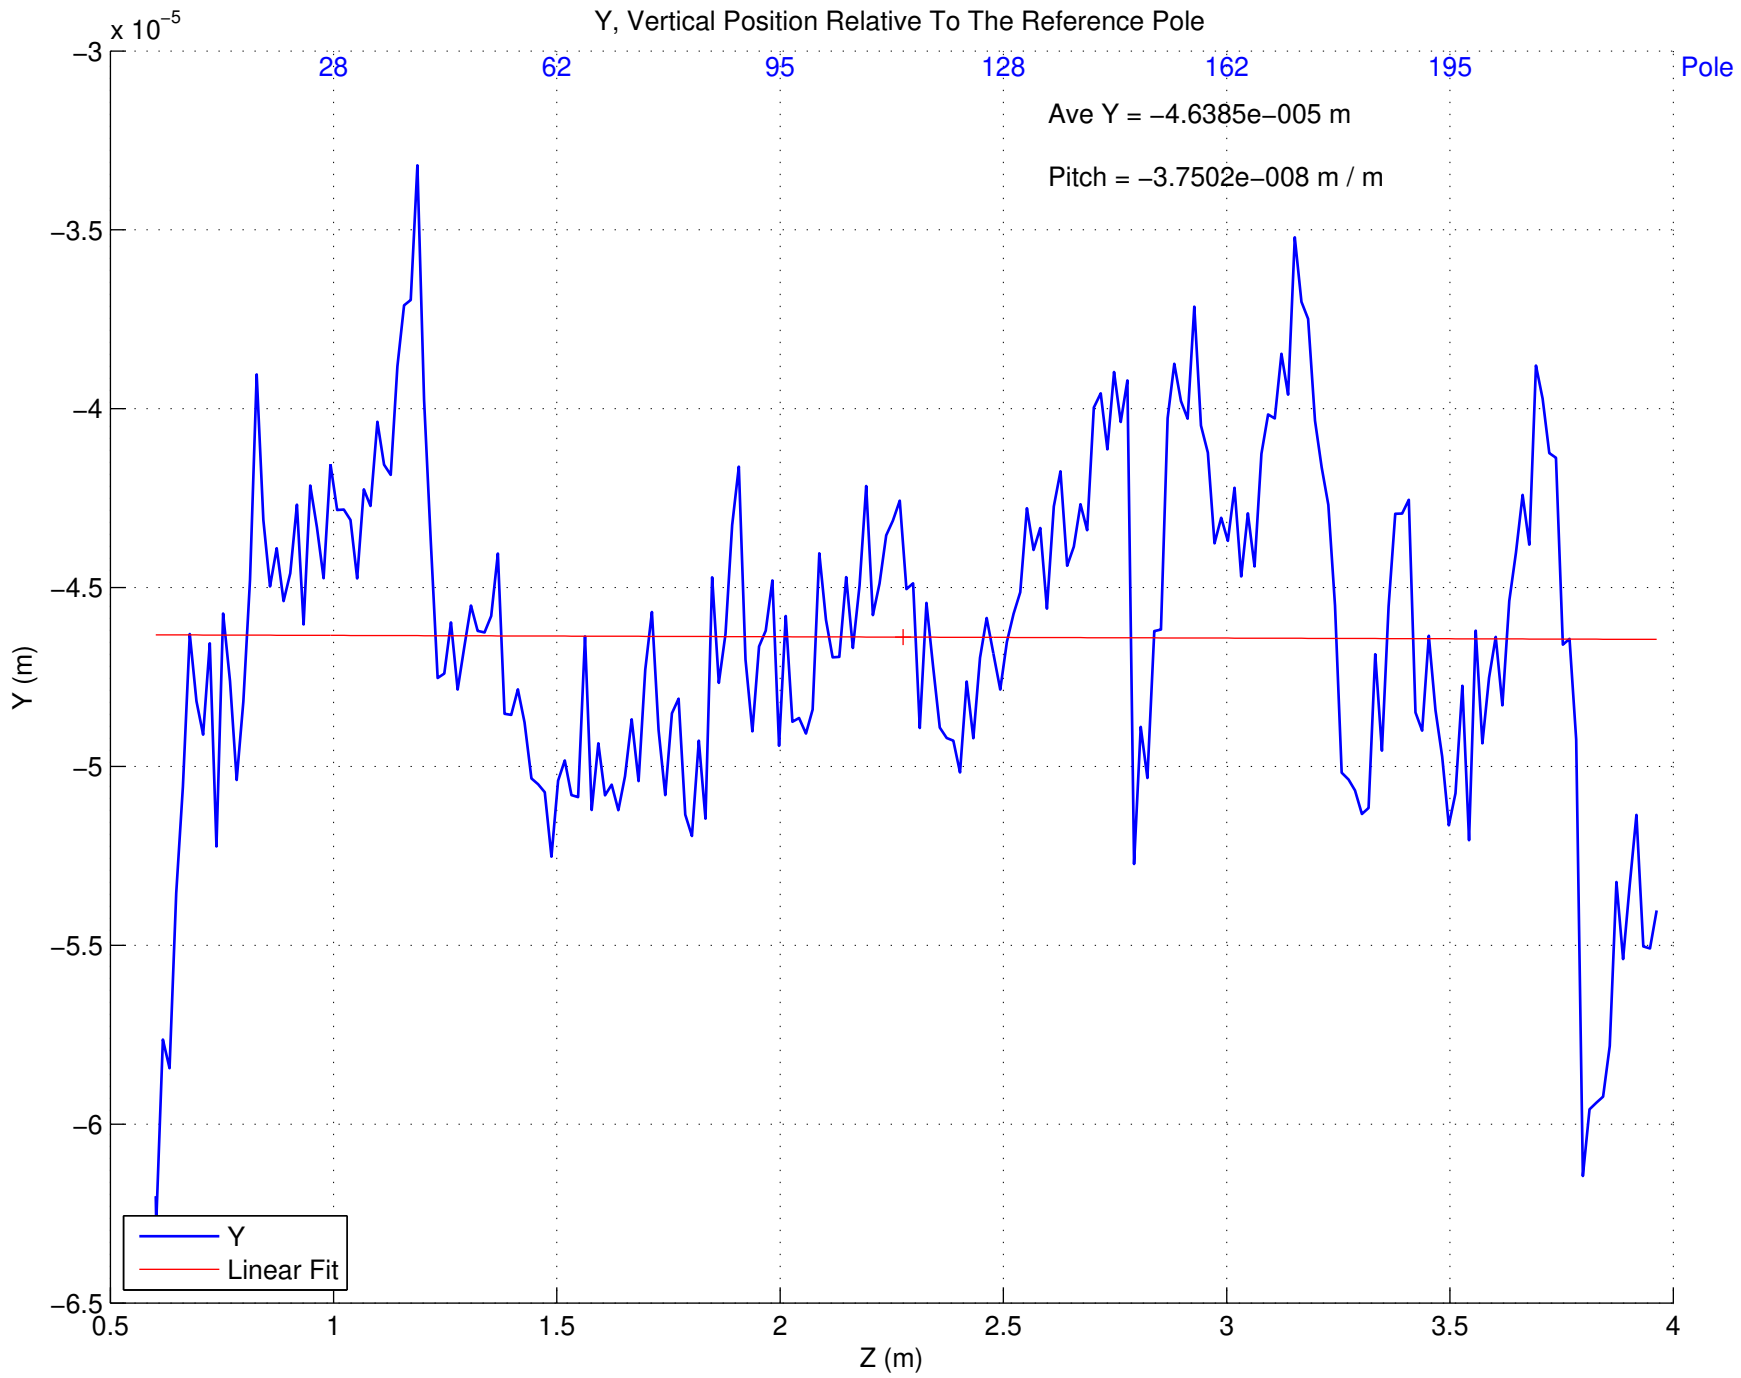
Y, Vertical Position Relative To The Reference Pole
x 10^-5
28
62
95
128
162
195
Pole
Ave Y = −4.6385e−005 m
Pitch = −3.7502e−008 m / m
−3
−3.5
−4
−4.5
−5
−5.5
−6
−6.5
Y (m)
0.5
1
1.5
2
2.5
3
3.5
4
Z (m)
Y
Linear Fit

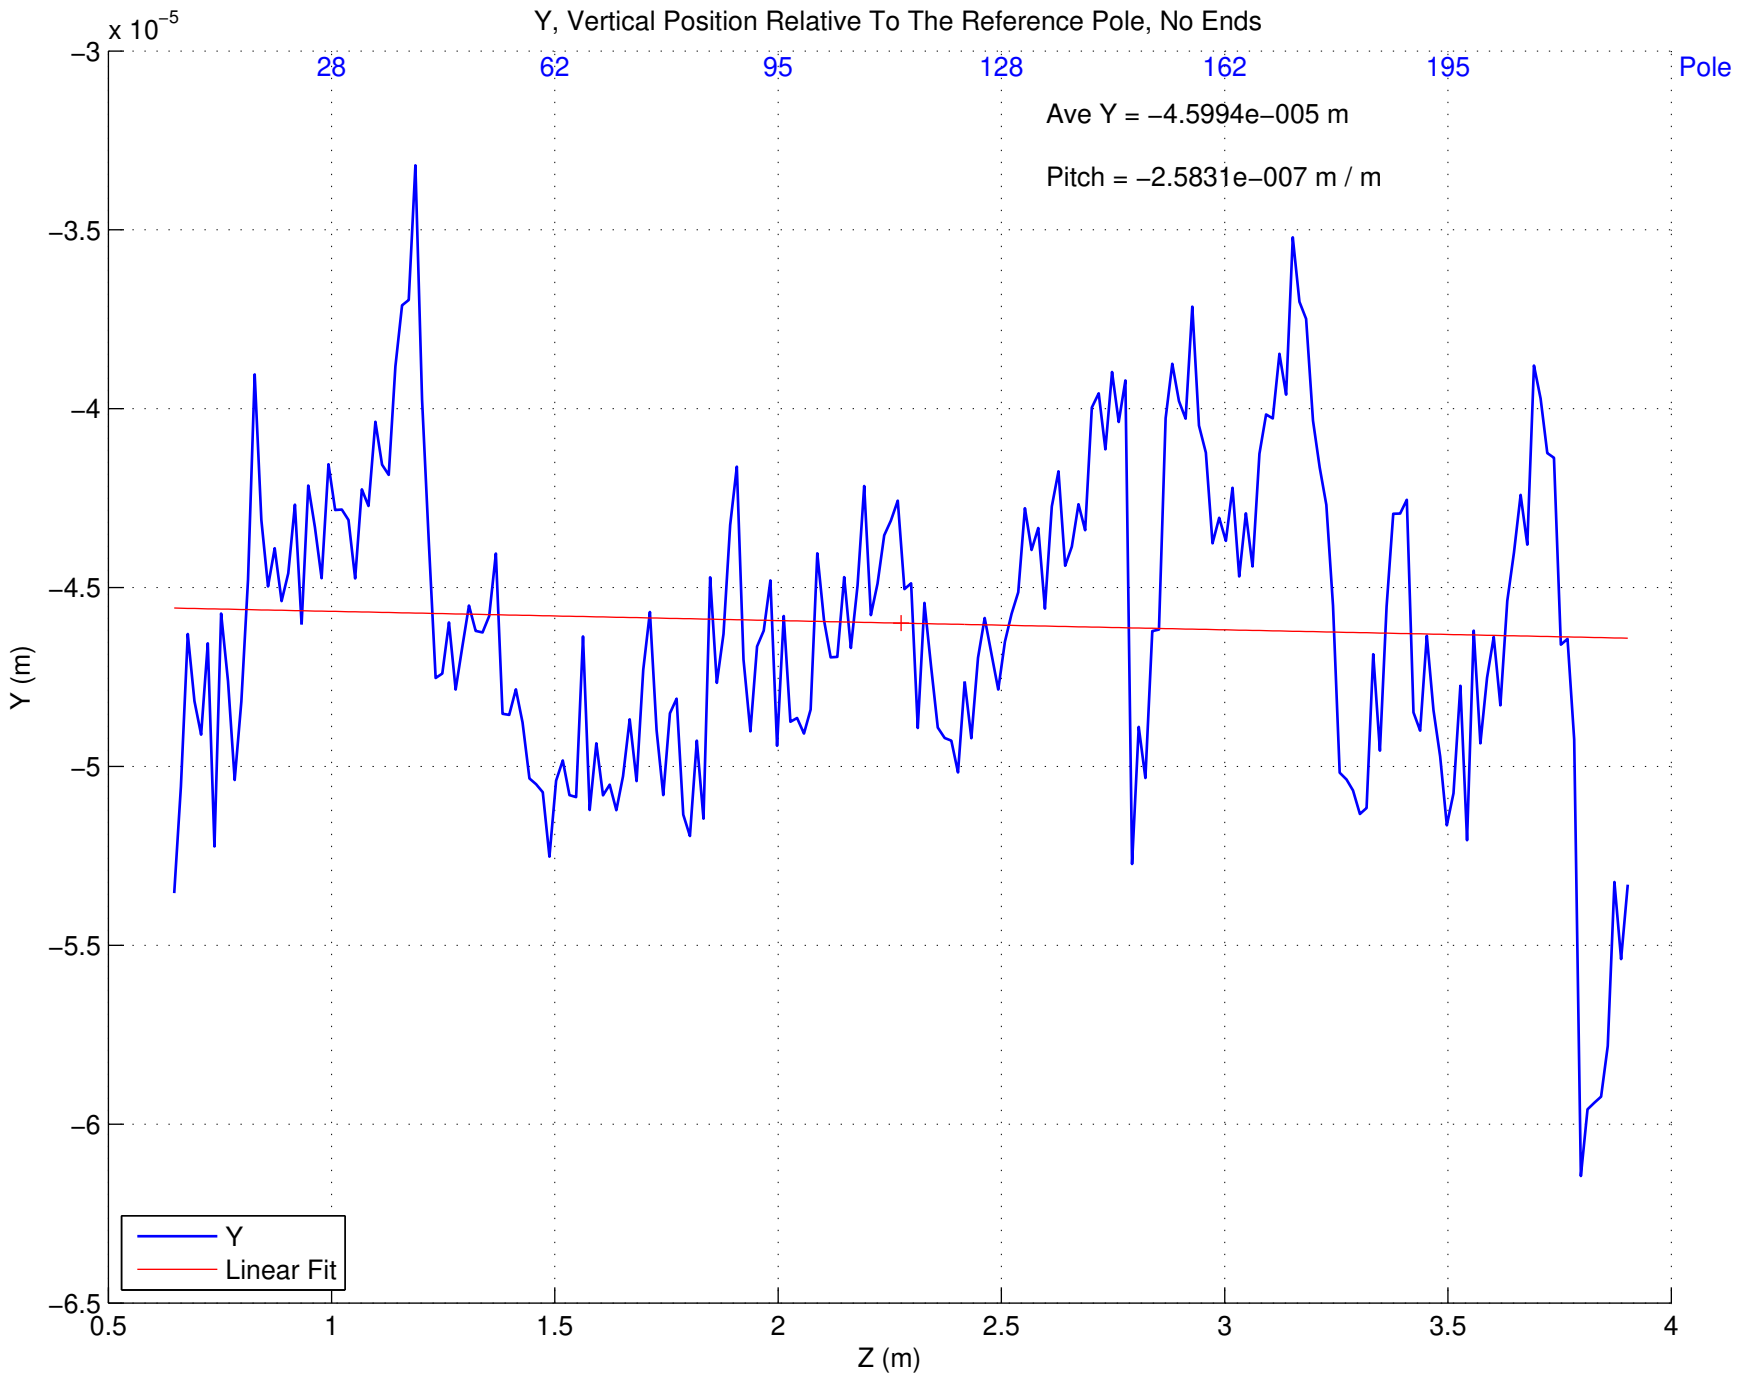
Y, Vertical Position Relative To The Reference Pole, No Ends
x 10^-5
28
62
95
128
162
195
Pole
Ave Y = −4.5994e−005 m
Pitch = −2.5831e−007 m / m
−3
−3.5
−4
−4.5
−5
−5.5
−6
−6.5
Y (m)
0.5
1
1.5
2
2.5
3
3.5
4
Z (m)
Y
Linear Fit

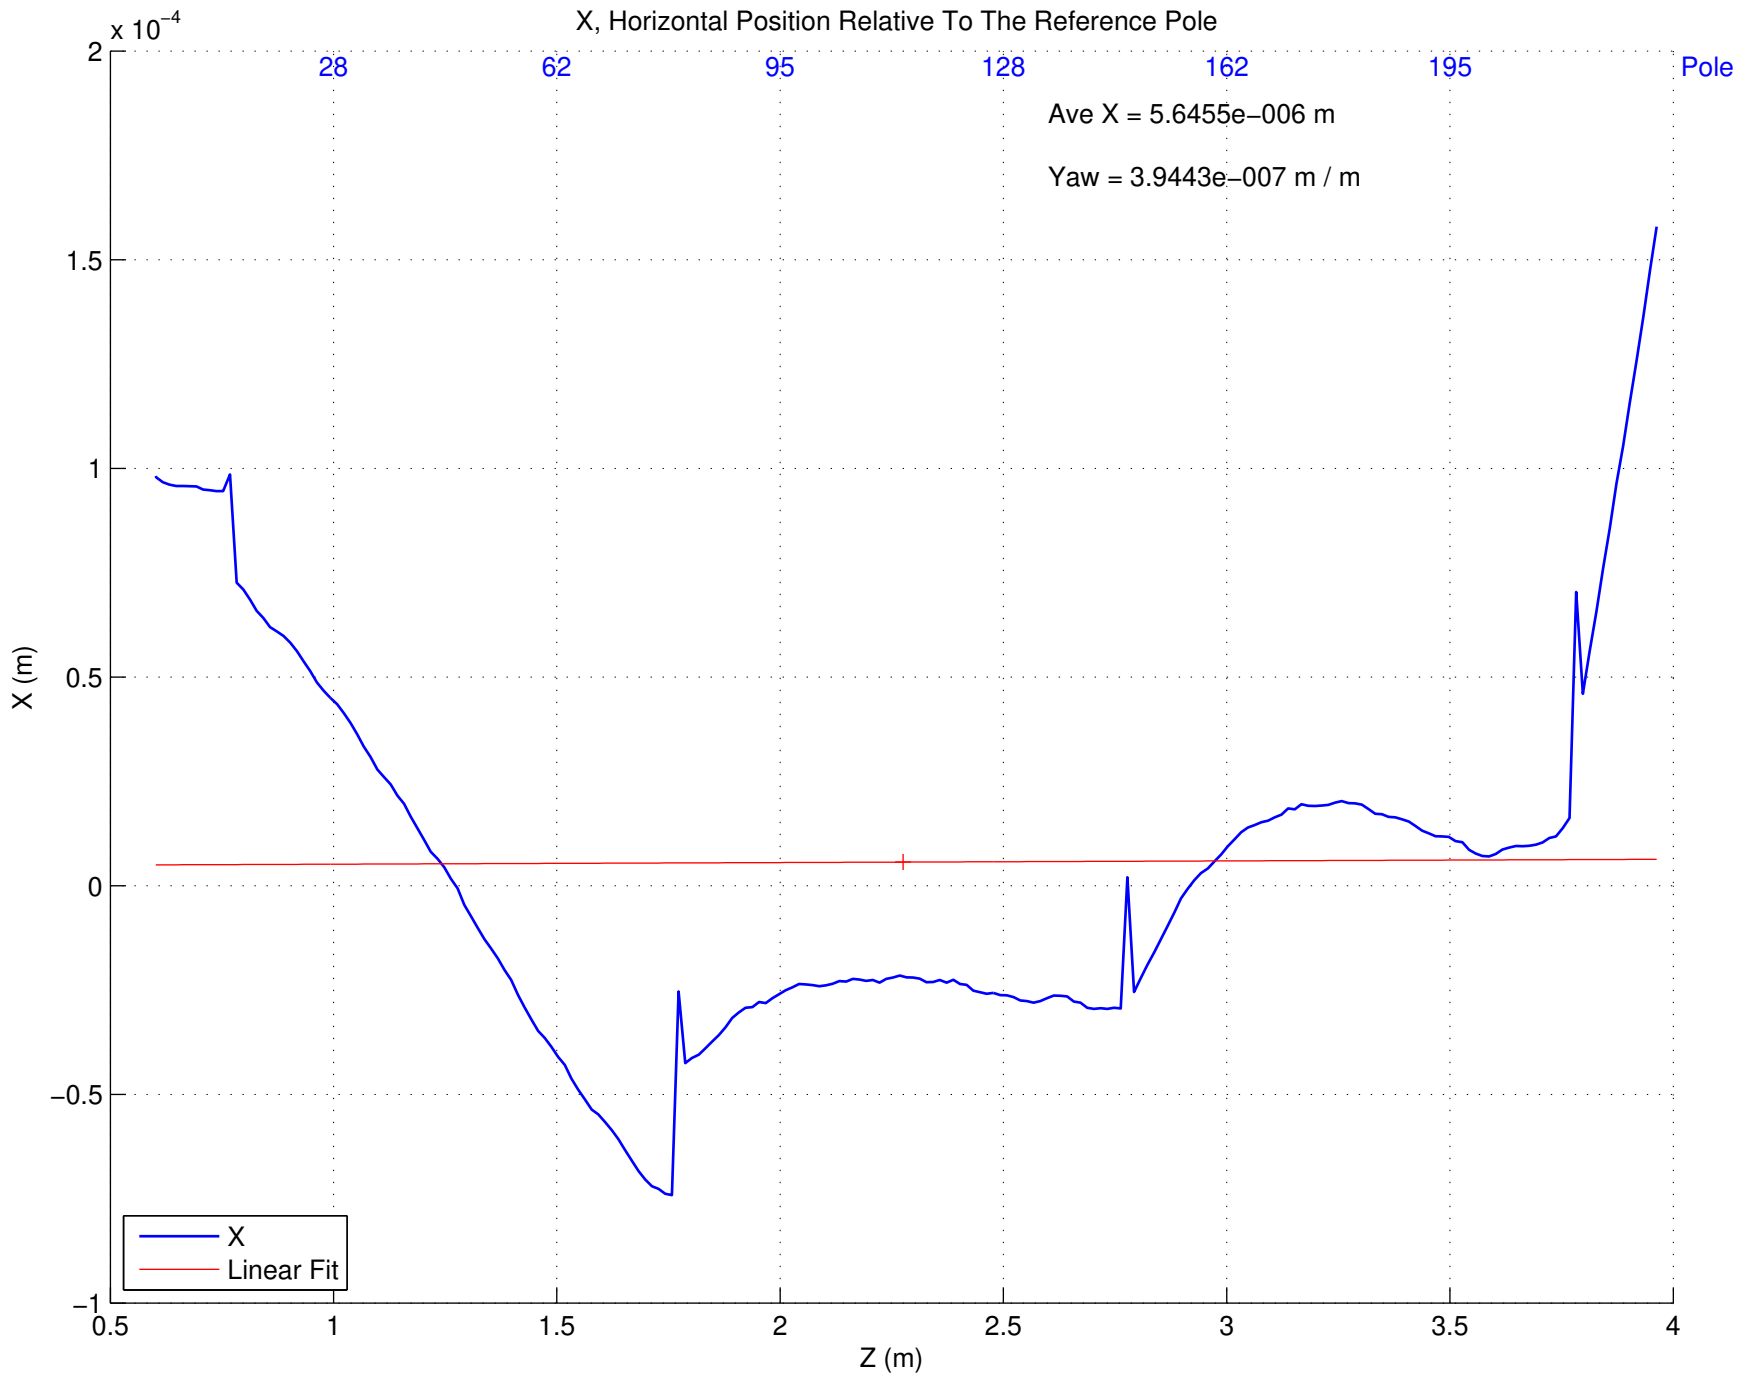
X, Horizontal Position Relative To The Reference Pole
x 10^-4
28
62
95
128
162
195
Pole
Ave X = 5.6455e−006 m
Yaw = 3.9443e−007 m / m
X (m)
Z (m)
X
Linear Fit

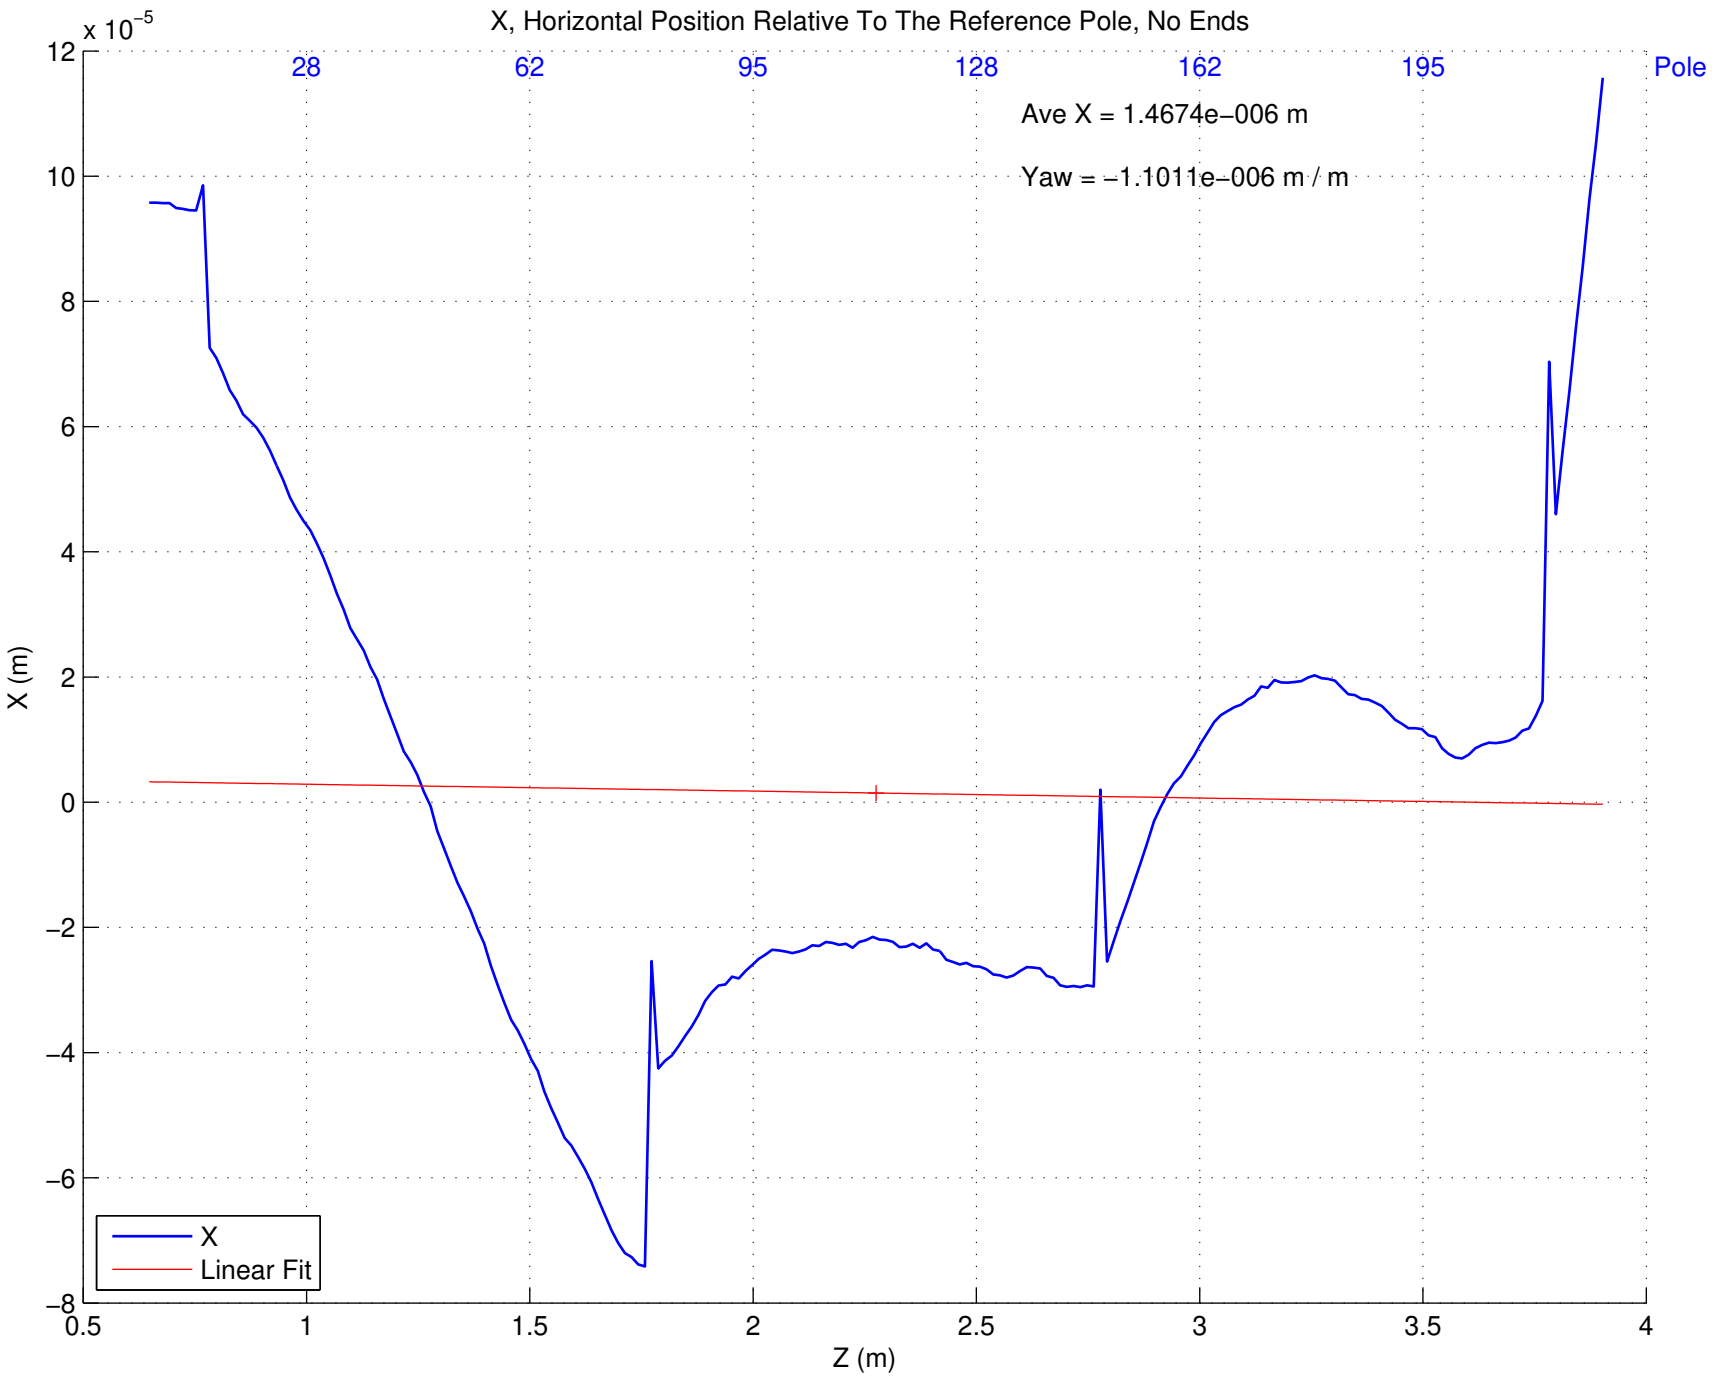
X, Horizontal Position Relative To The Reference Pole, No Ends
x 10^-5
28
62
95
128
162
195
Pole
Ave X = 1.4674e−006 m
Yaw = −1.1011e−006 m / m
X (m)
Z (m)
X
Linear Fit
12
10
8
6
4
2
0
−2
−4
−6
−8
0.5
1
1.5
2
2.5
3
3.5
4

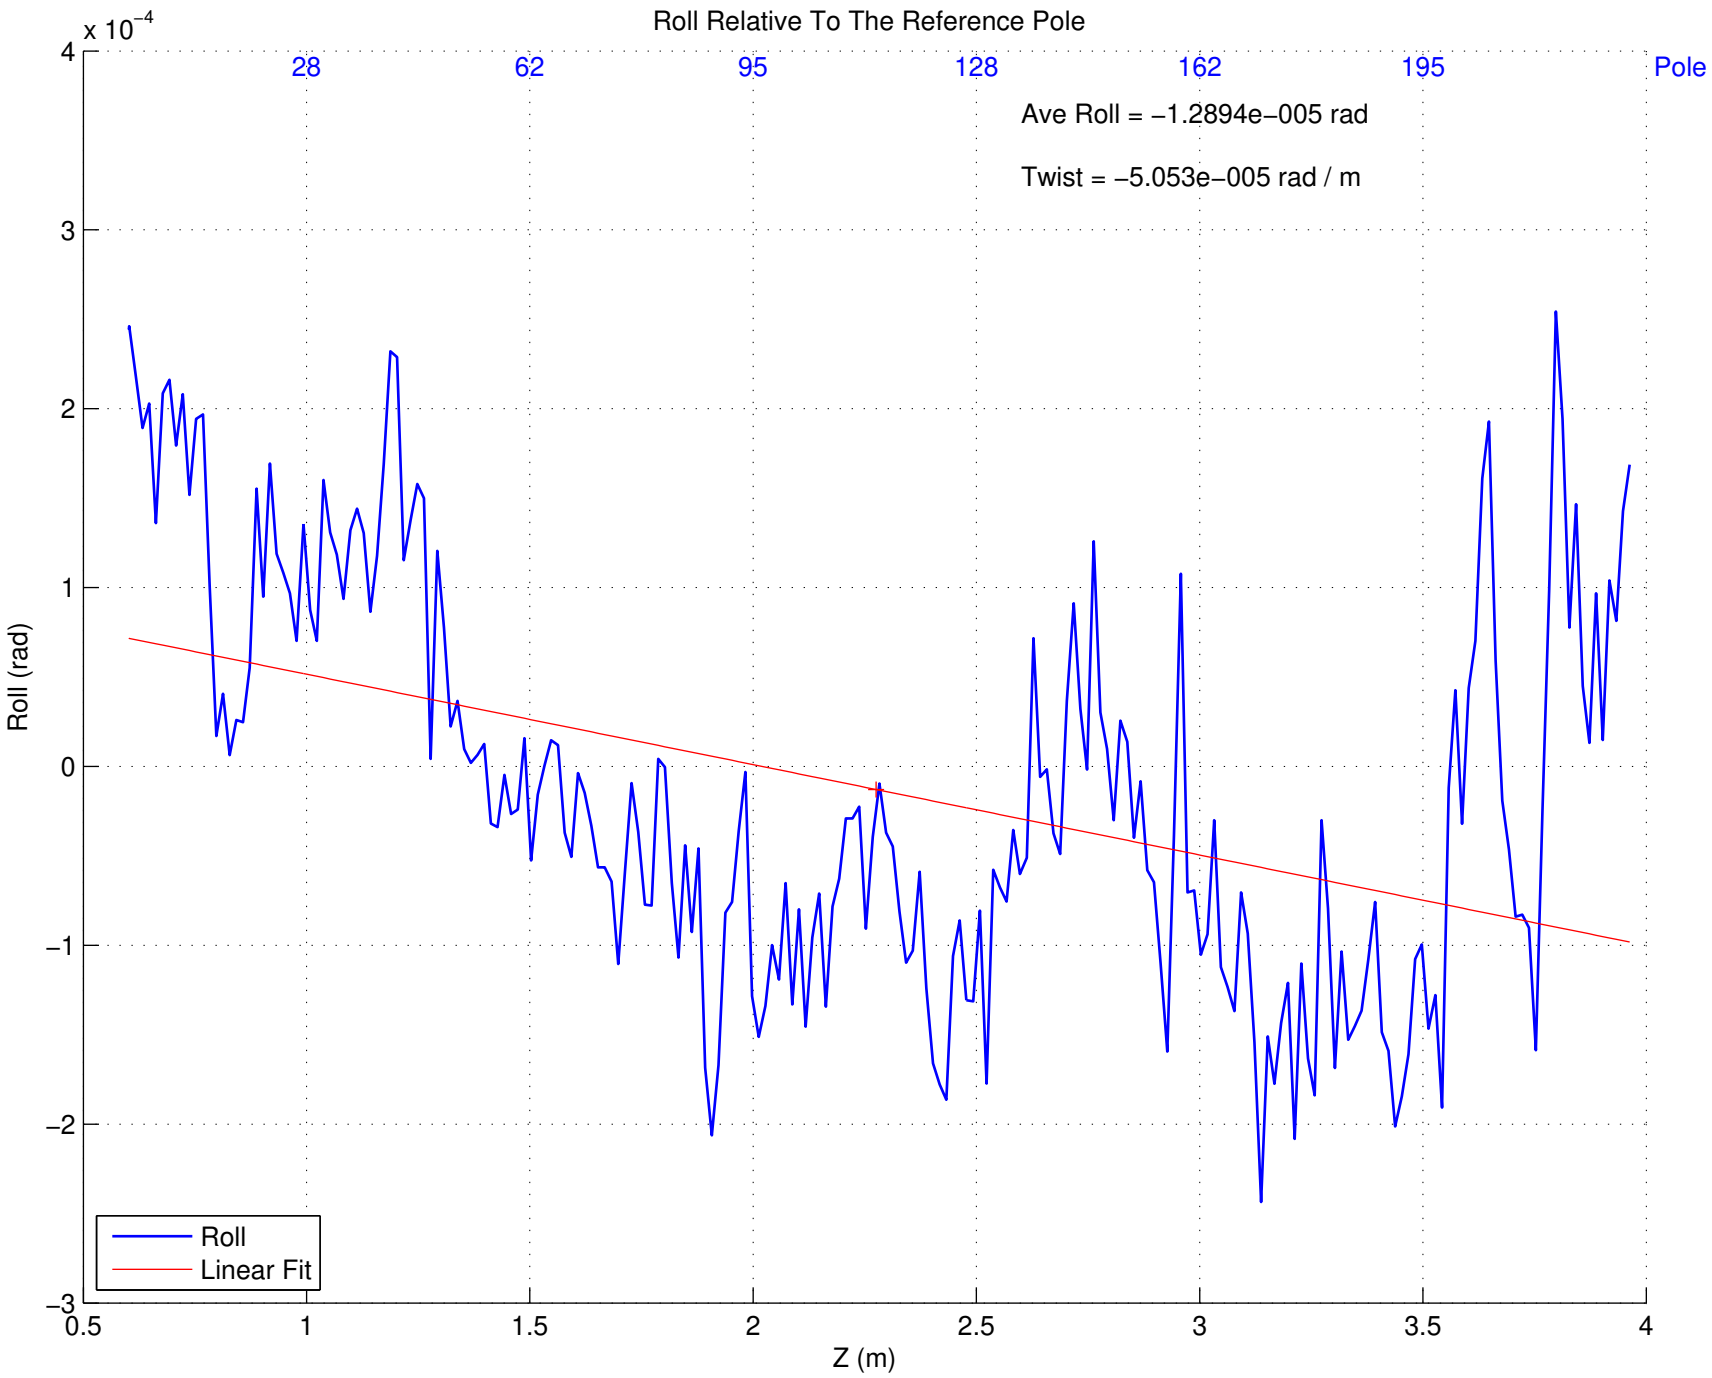
Roll Relative To The Reference Pole
x 10^-4
28
62
95
128
162
195
Pole
Ave Roll = −1.2894e−005 rad
Twist = −5.053e−005 rad / m
Roll (rad)
Z (m)
Roll
Linear Fit

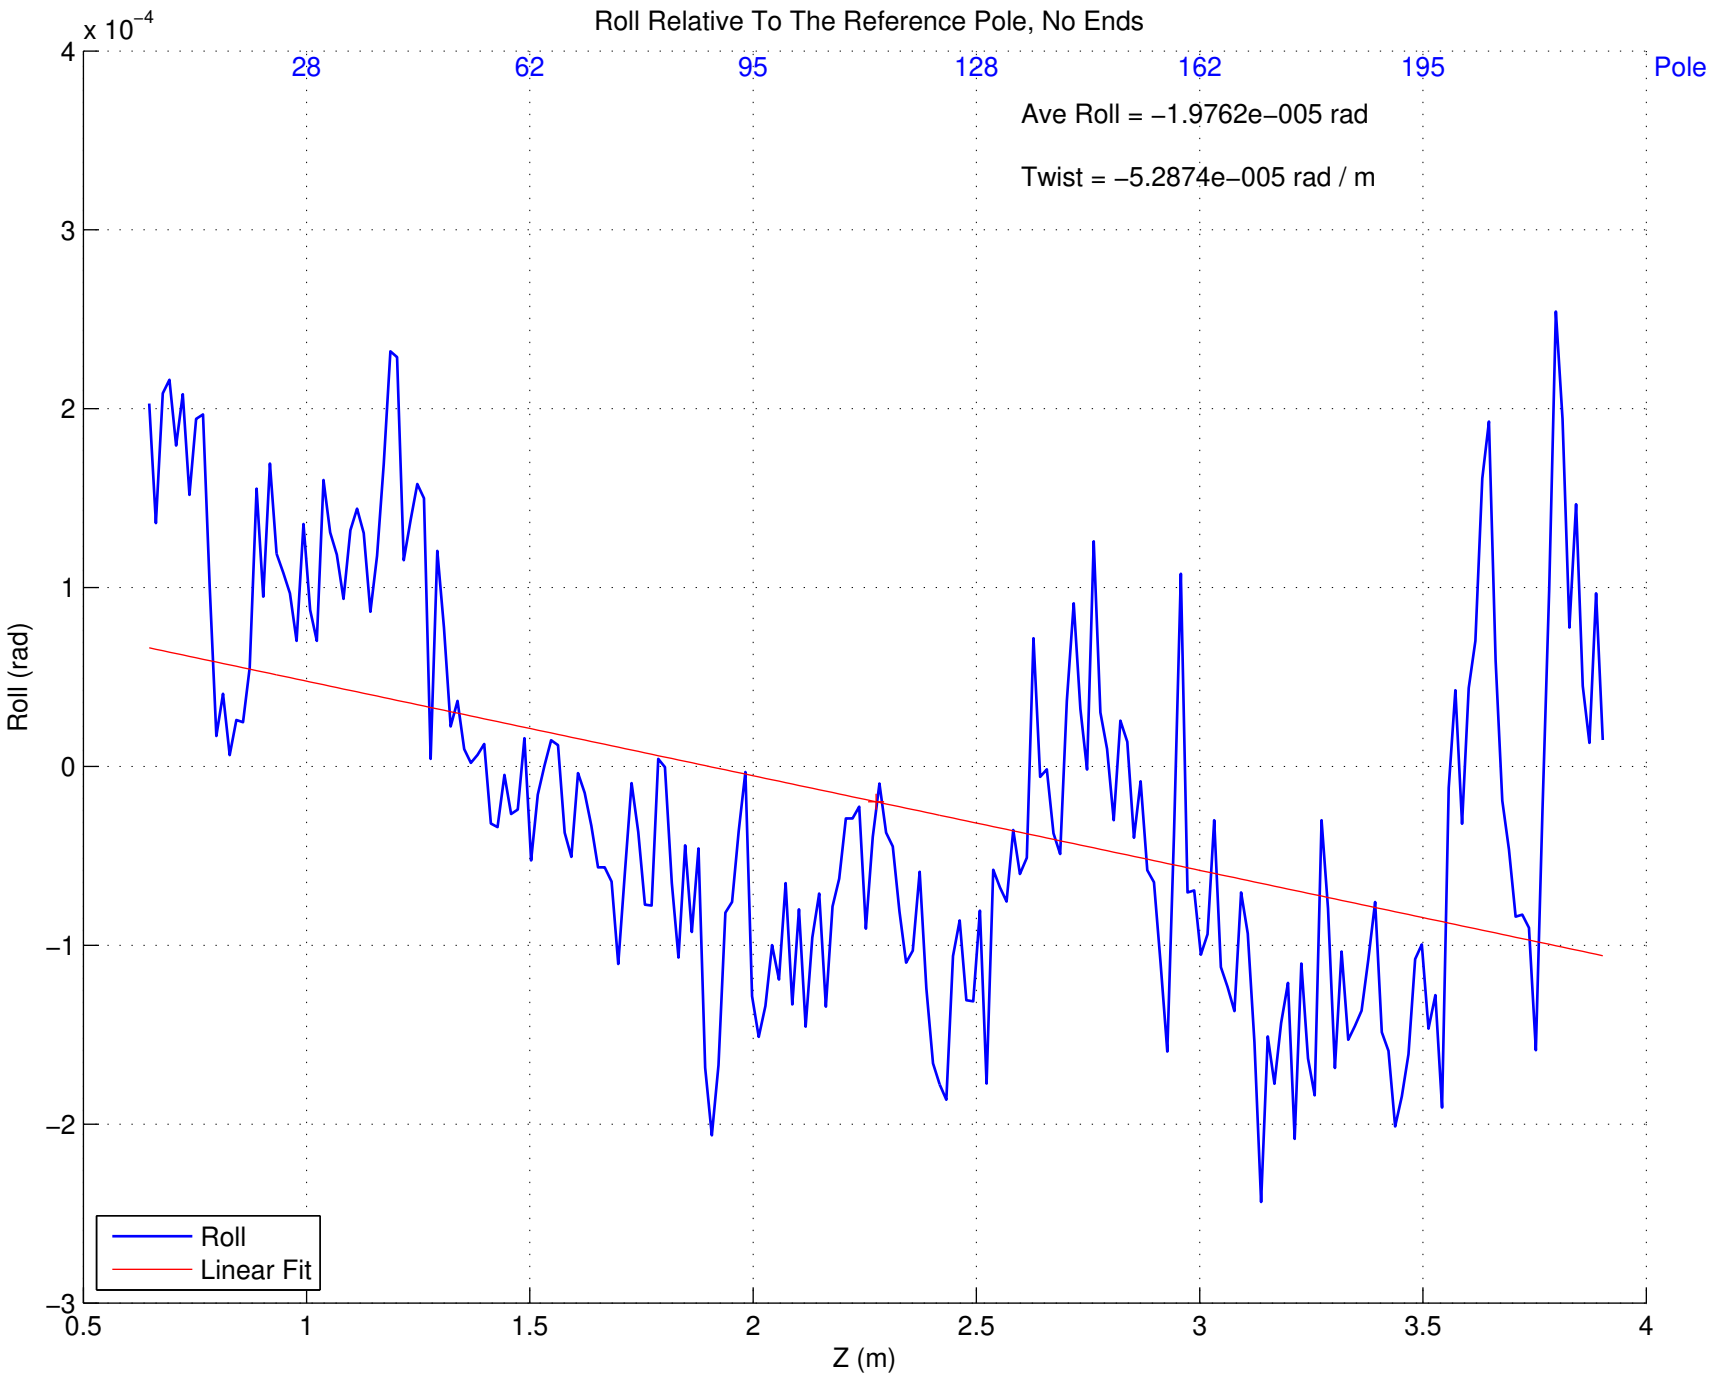
Roll Relative To The Reference Pole, No Ends
x 10^-4
28
62
95
128
162
195
Pole
Ave Roll = −1.9762e−005 rad
Twist = −5.2874e−005 rad / m
Roll (rad)
Z (m)
Roll
Linear Fit

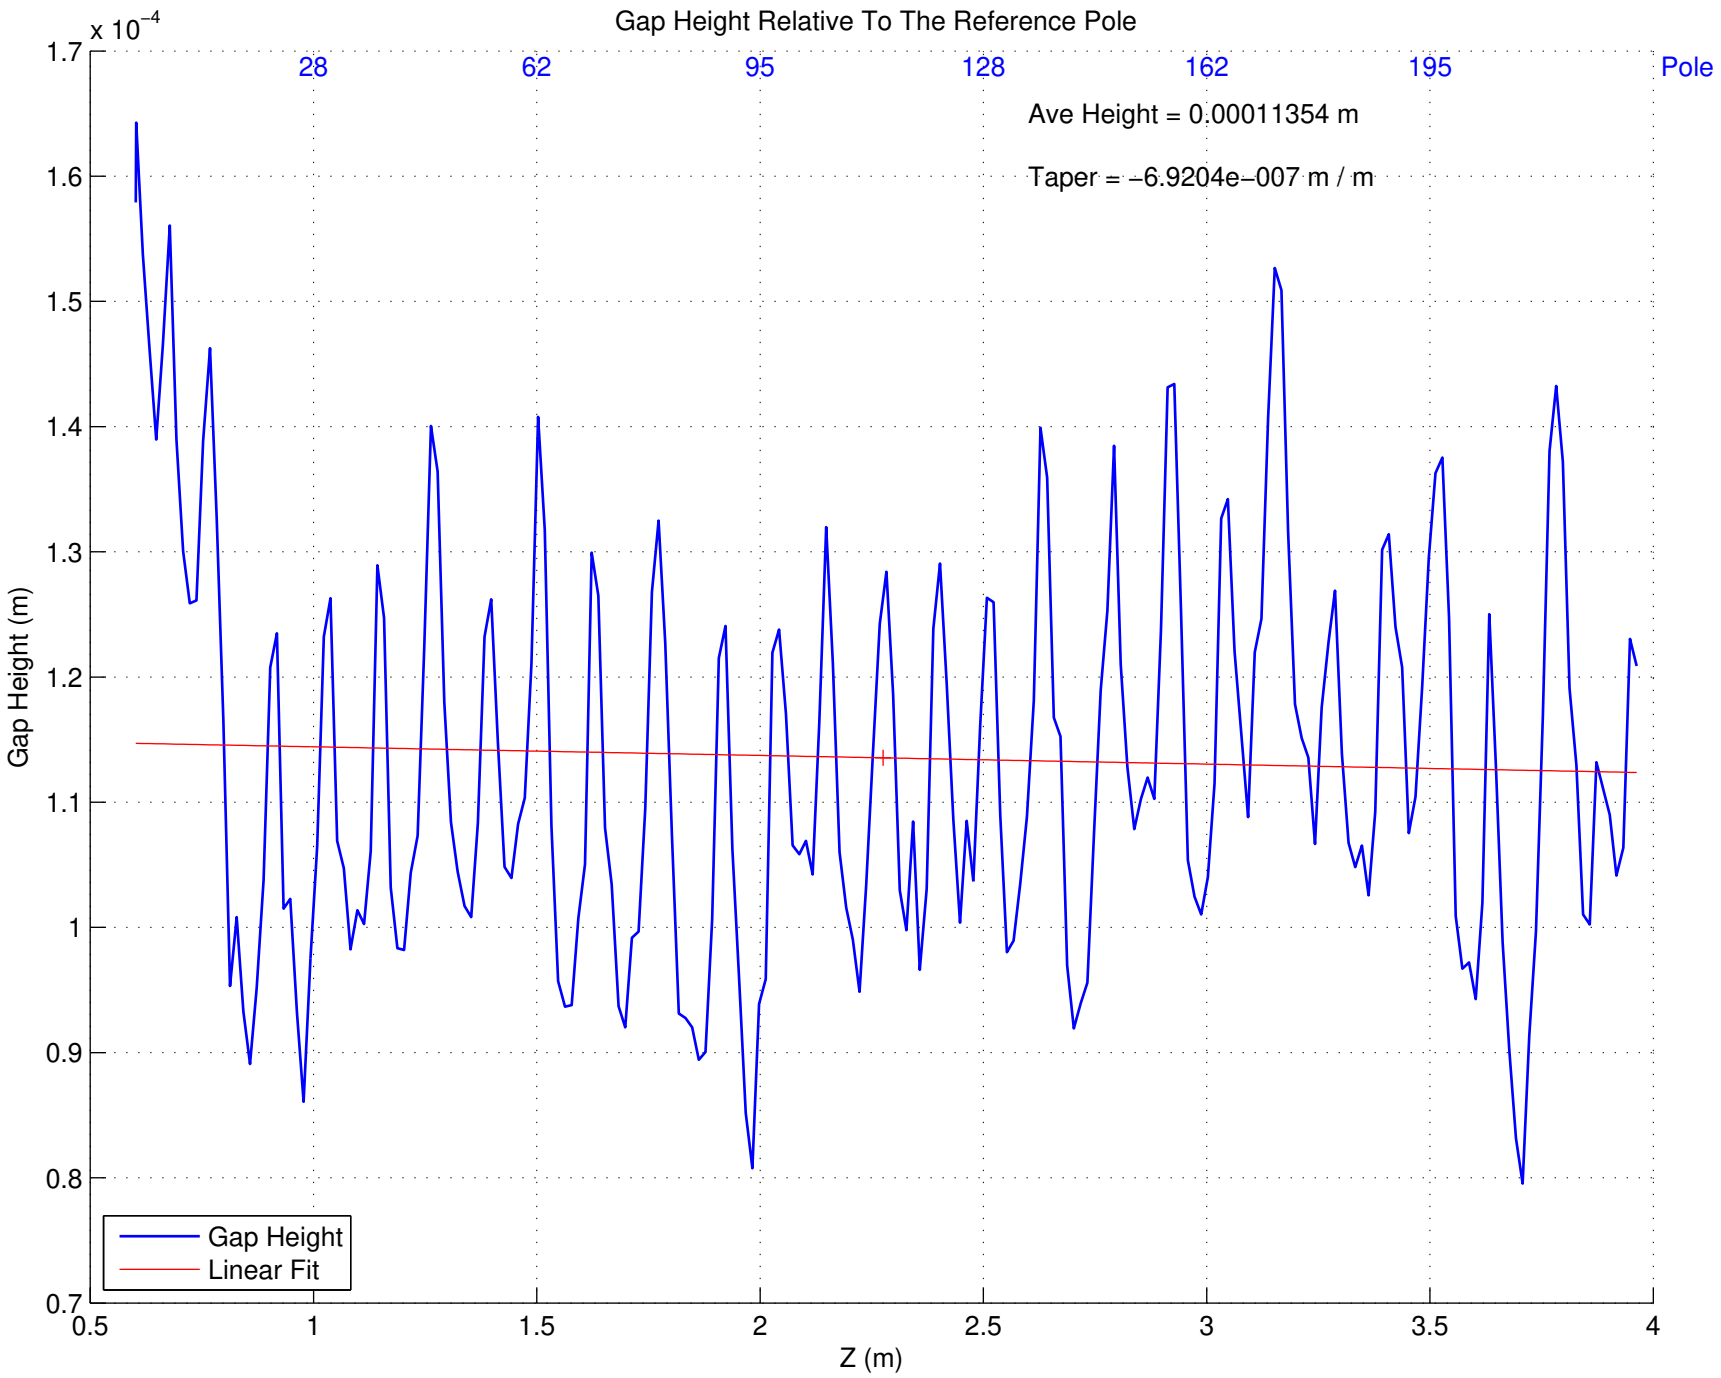
Gap Height Relative To The Reference Pole
x 10^-4
28
62
95
128
162
195
Pole
Ave Height = 0.00011354 m
Taper = -6.9204e-007 m / m
Gap Height (m)
Z (m)
Gap Height
Linear Fit

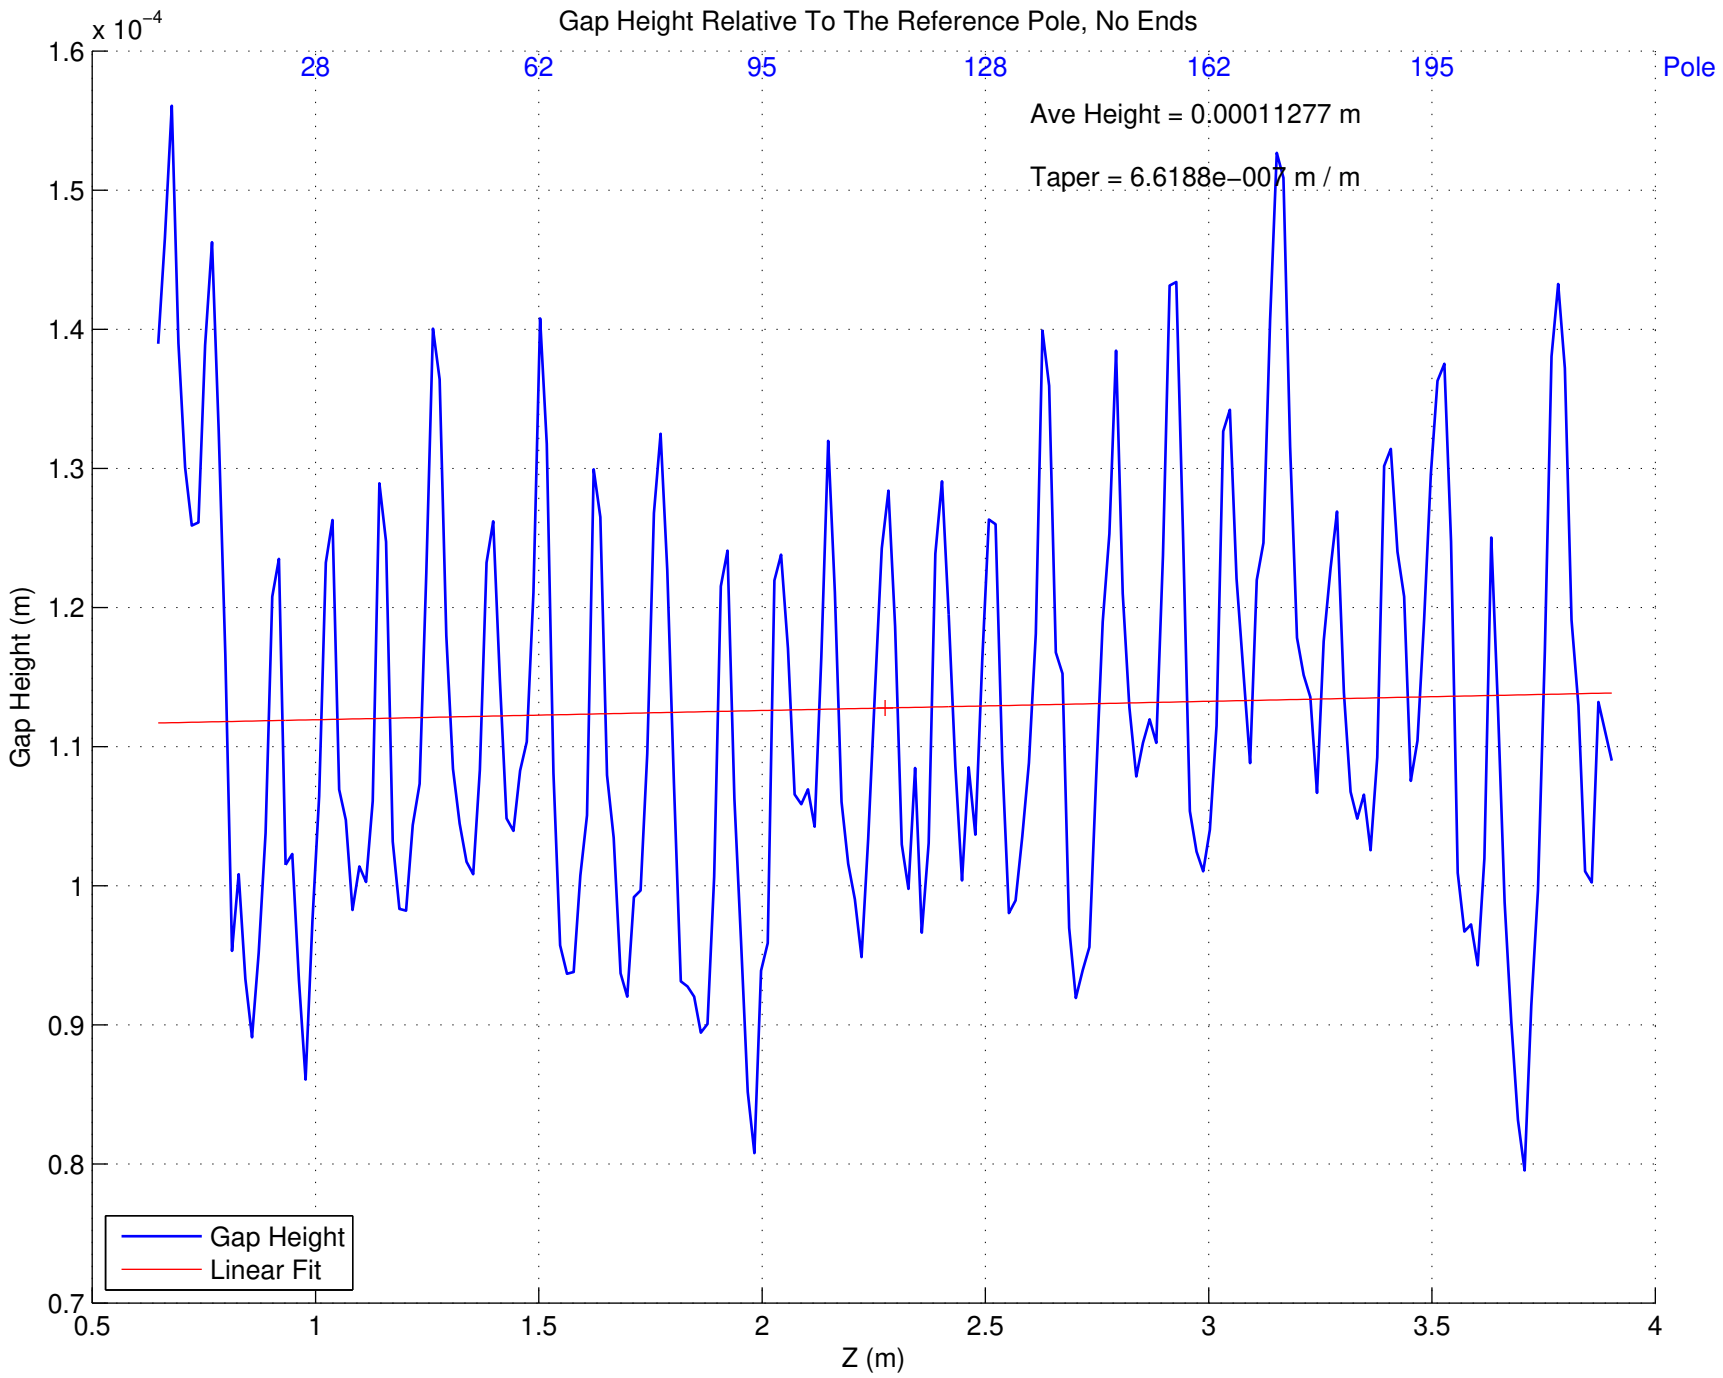
Gap Height Relative To The Reference Pole, No Ends
x 10^-4
28
62
95
128
162
195
Pole
Ave Height = 0.00011277 m
Taper = 6.6188e−007 m / m
Gap Height (m)
Z (m)
Gap Height
Linear Fit
1.6
1.5
1.4
1.3
1.2
1.1
1
0.9
0.8
0.7
0.5
1
1.5
2
2.5
3
3.5
4

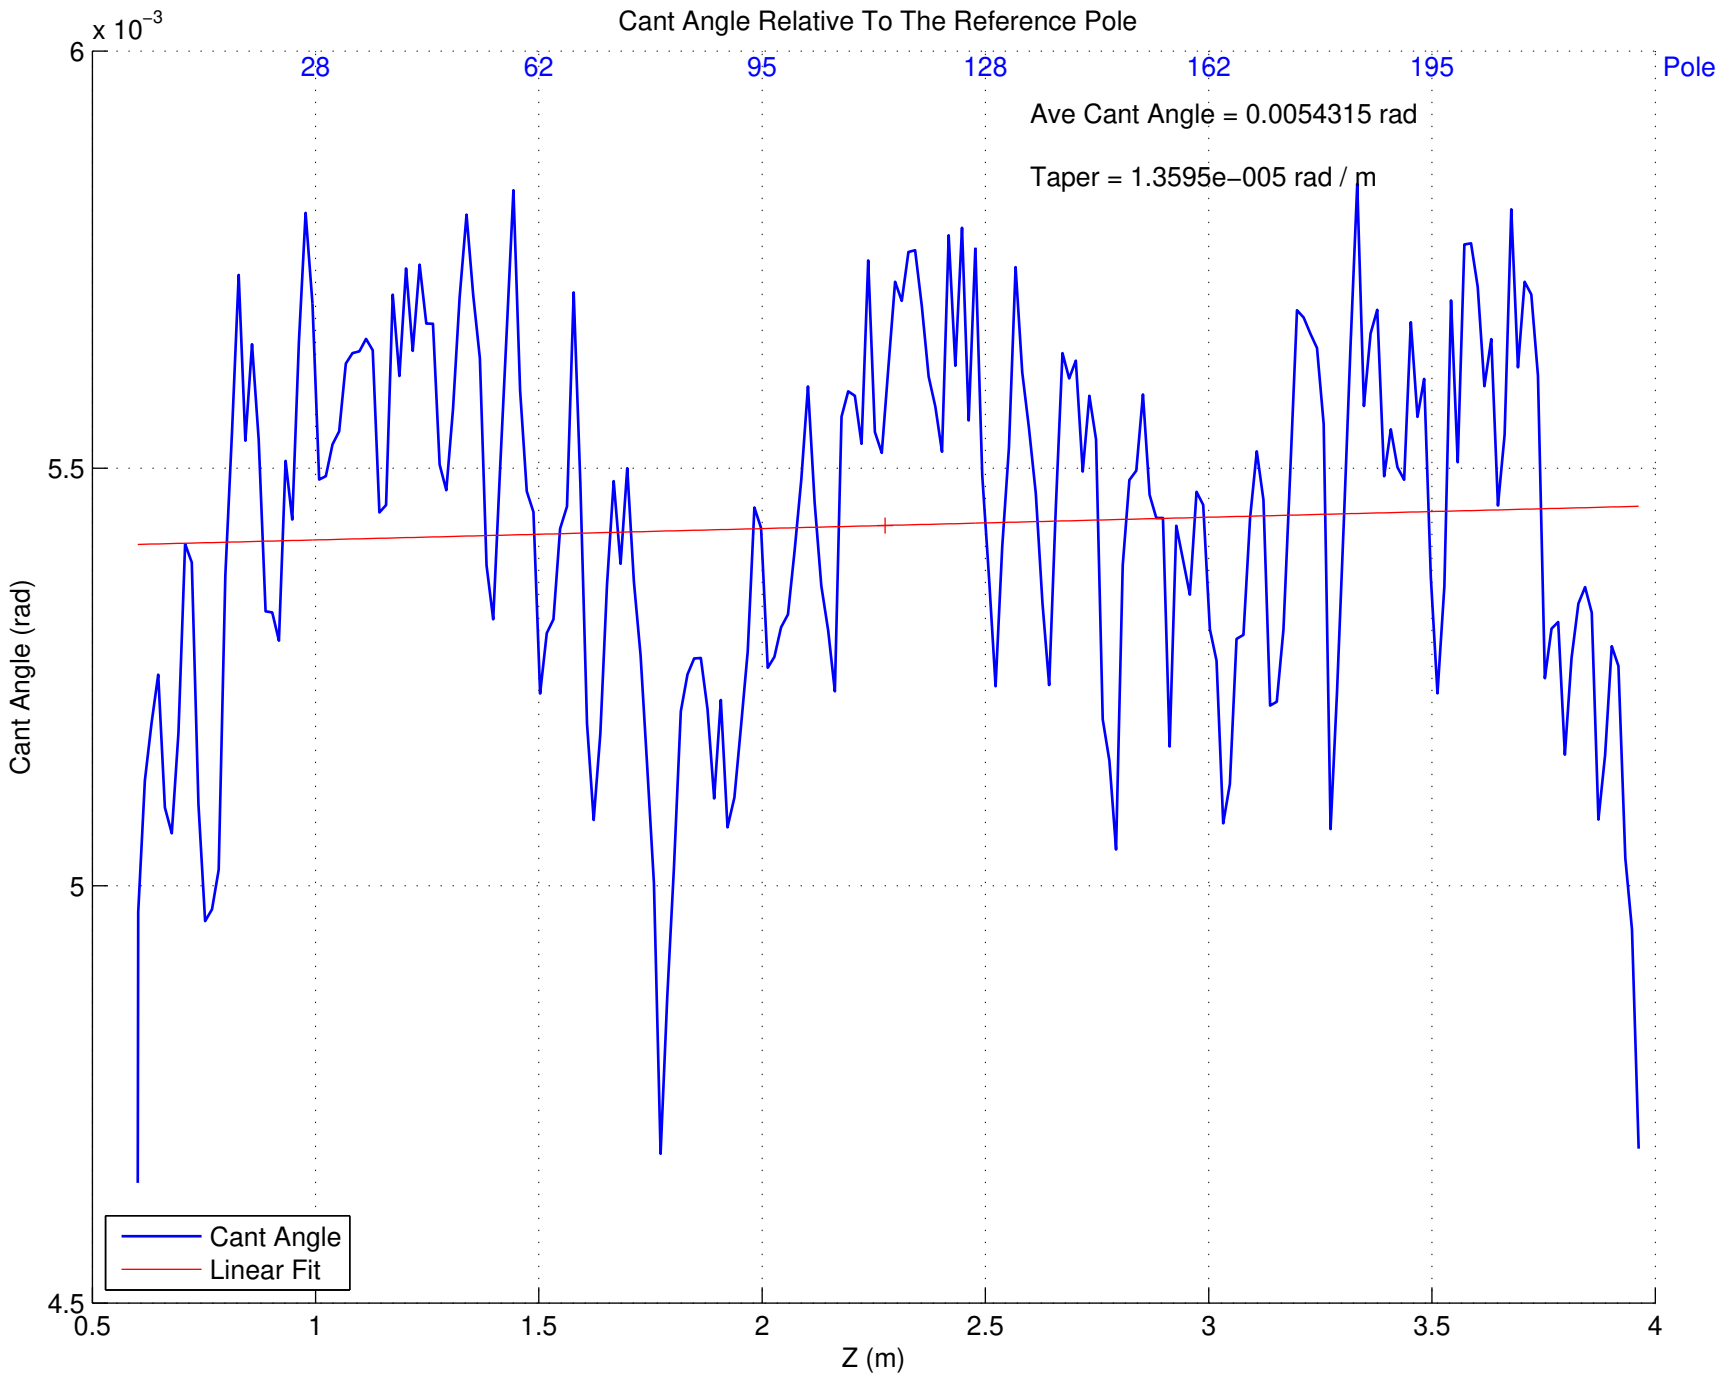
Cant Angle Relative To The Reference Pole
x 10^-3
6
5.5
5
4.5
28
62
95
128
162
195
Pole
Ave Cant Angle = 0.0054315 rad
Taper = 1.3595e−005 rad / m
Cant Angle (rad)
Z (m)
0.5
1
1.5
2
2.5
3
3.5
4
Cant Angle
Linear Fit

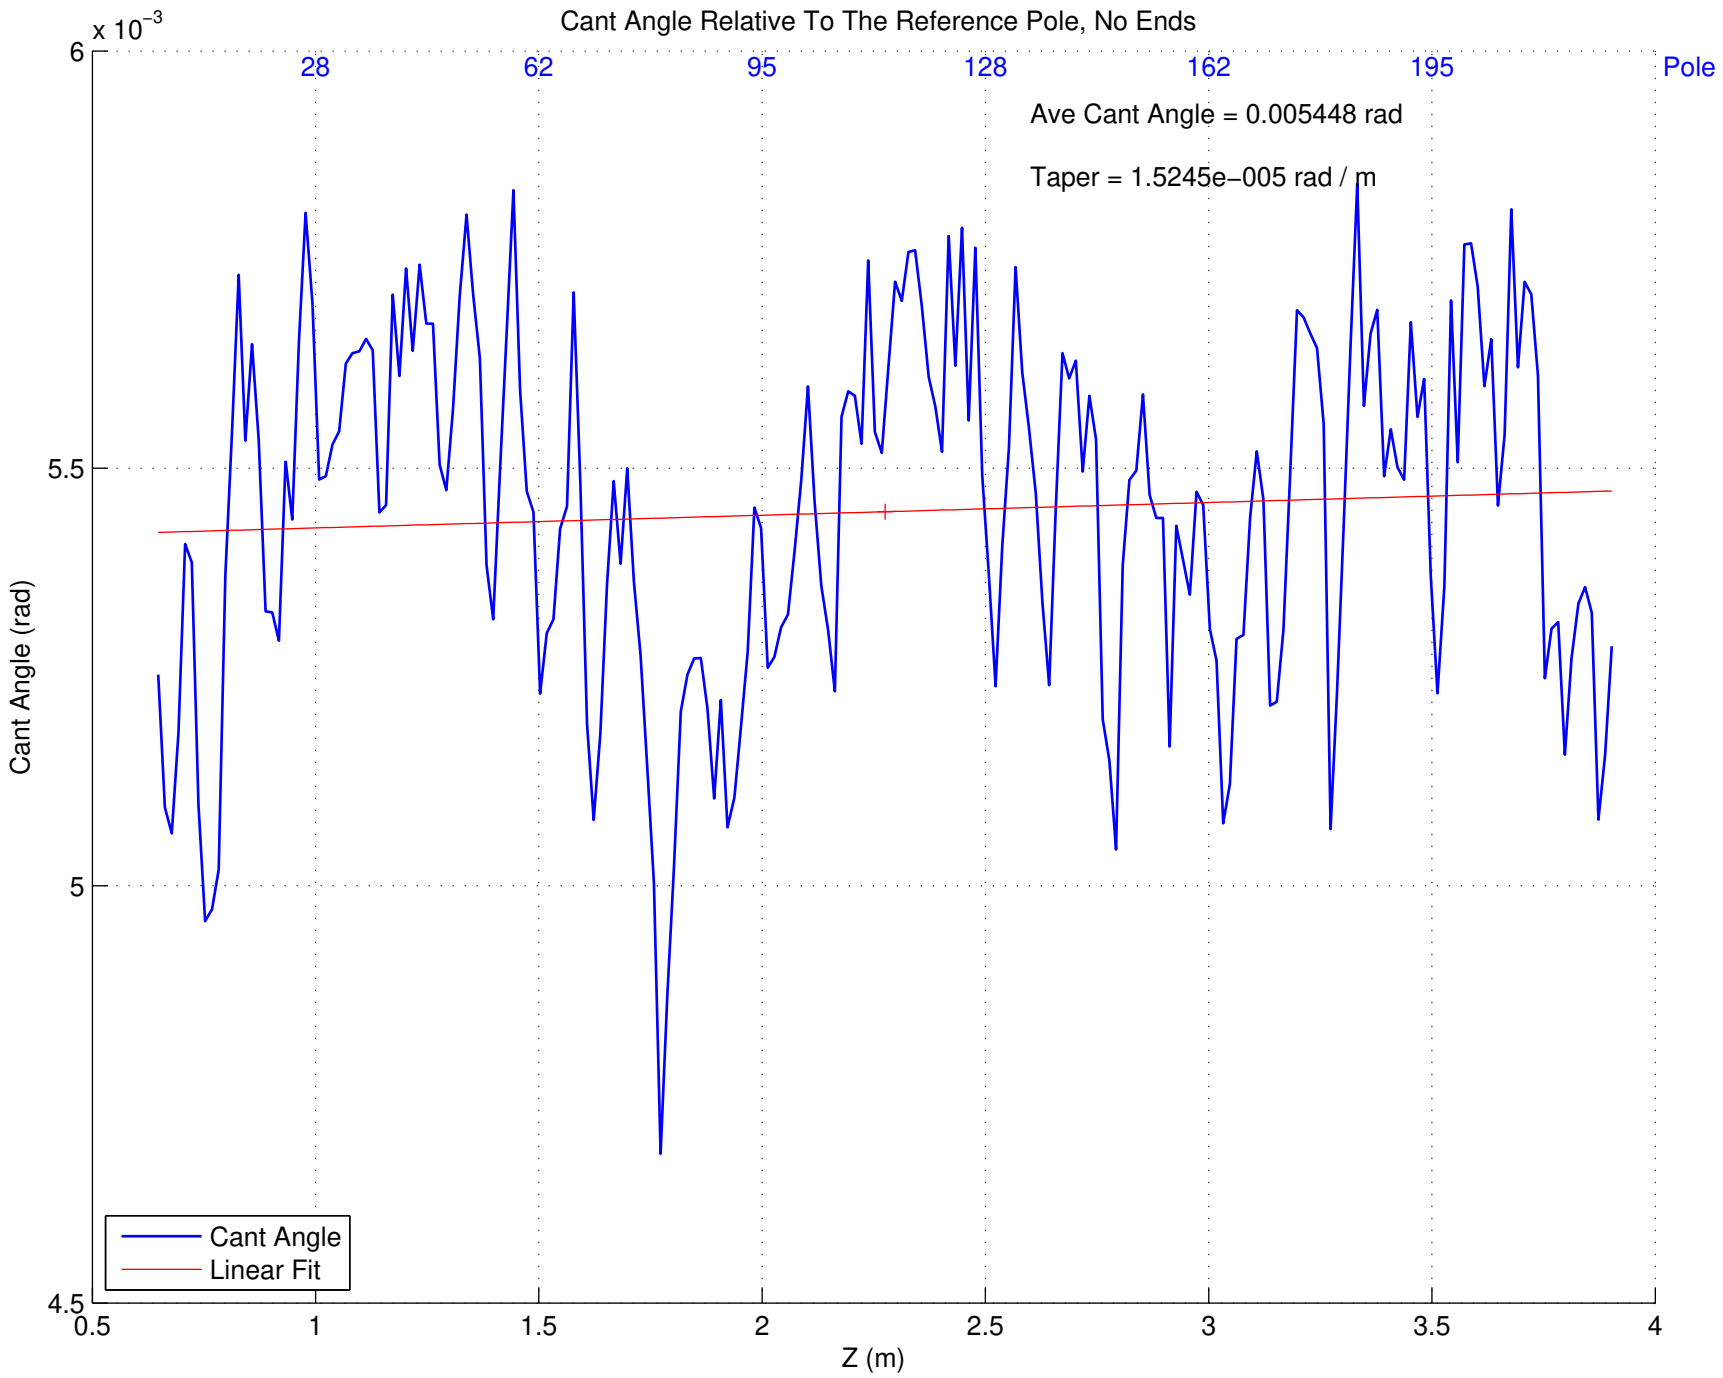
Cant Angle Relative To The Reference Pole, No Ends
x 10^-3
6
5.5
5
4.5
28
62
95
128
162
195
Pole
Ave Cant Angle = 0.005448 rad
Taper = 1.5245e−005 rad / m
Cant Angle (rad)
Z (m)
0.5
1
1.5
2
2.5
3
3.5
4
Cant Angle
Linear Fit