SLAC Magnetic Measurements

Planar Insertion Device Shim Analysis

Parameters:
INPUT−FILE−DIR =S:\MagData\LCLS\Undulator\L143−112000−35\DATASET0001\Rough Tuning\Z Scans\Run 046\
INPUT−FILE−NAME =x+00000−y+000−bscanz.dat
INPUT−FILE−TYPE =ZVXYBXYH
CORR−REQUIRED =1
GAMMA =26652.52
NOM−LAMBDA−U =0.03
NOM−K−VALUE =3.4913
NOM−LAMBDA−R =1.4981e−010
NUM−POLES =226
NUM−END−POLES =4
CELL−LENGTH =3.656

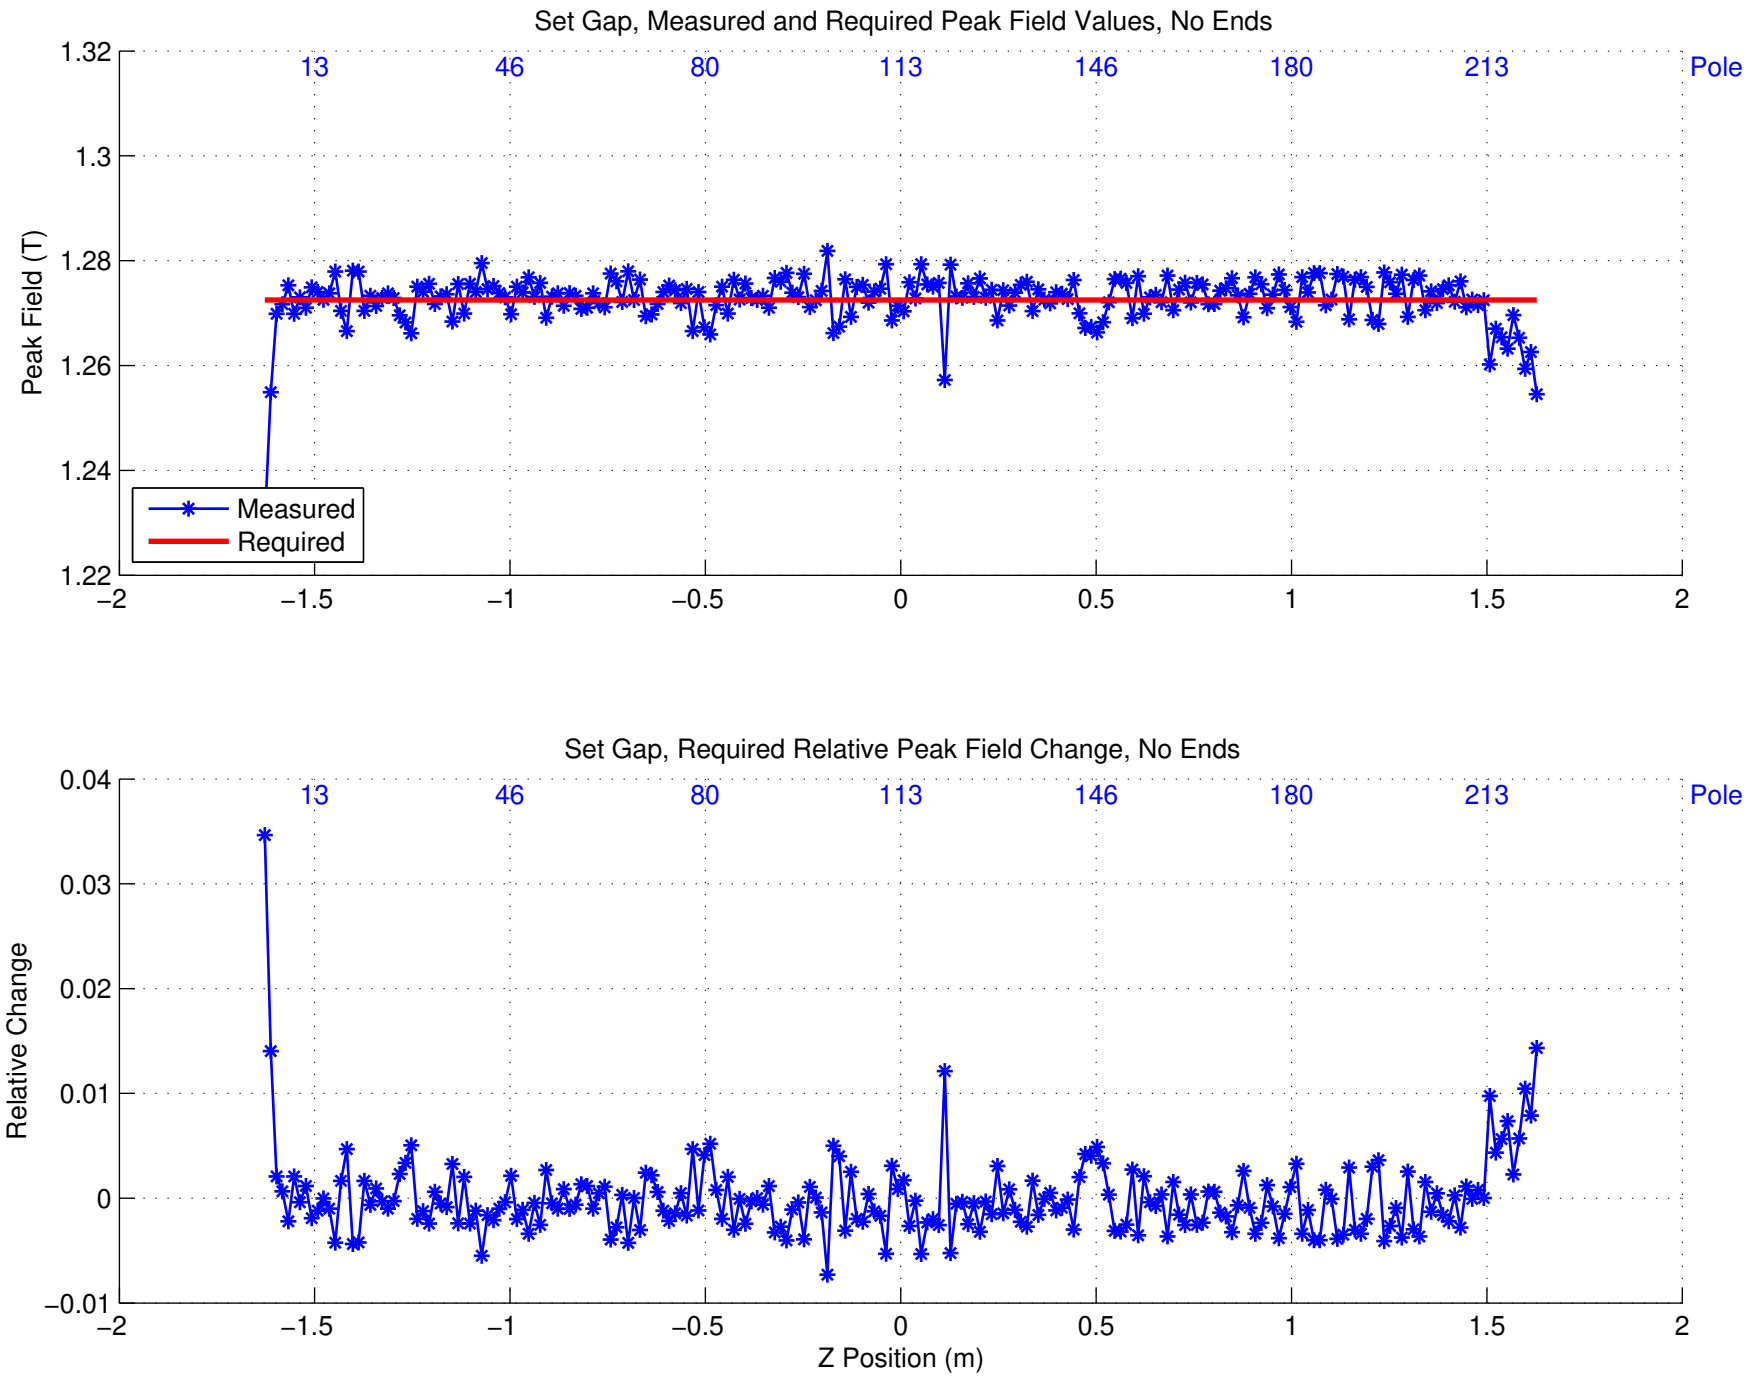
Set Gap, Measured and Required Peak Field Values, No Ends
13
46
80
113
146
180
213
Pole
1.32
1.3
1.28
1.26
1.24
1.22
Peak Field (T)
Measured
Required
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Set Gap, Required Relative Peak Field Change, No Ends
13
46
80
113
146
180
213
Pole
0.04
0.03
0.02
0.01
0
−0.01
Relative Change
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

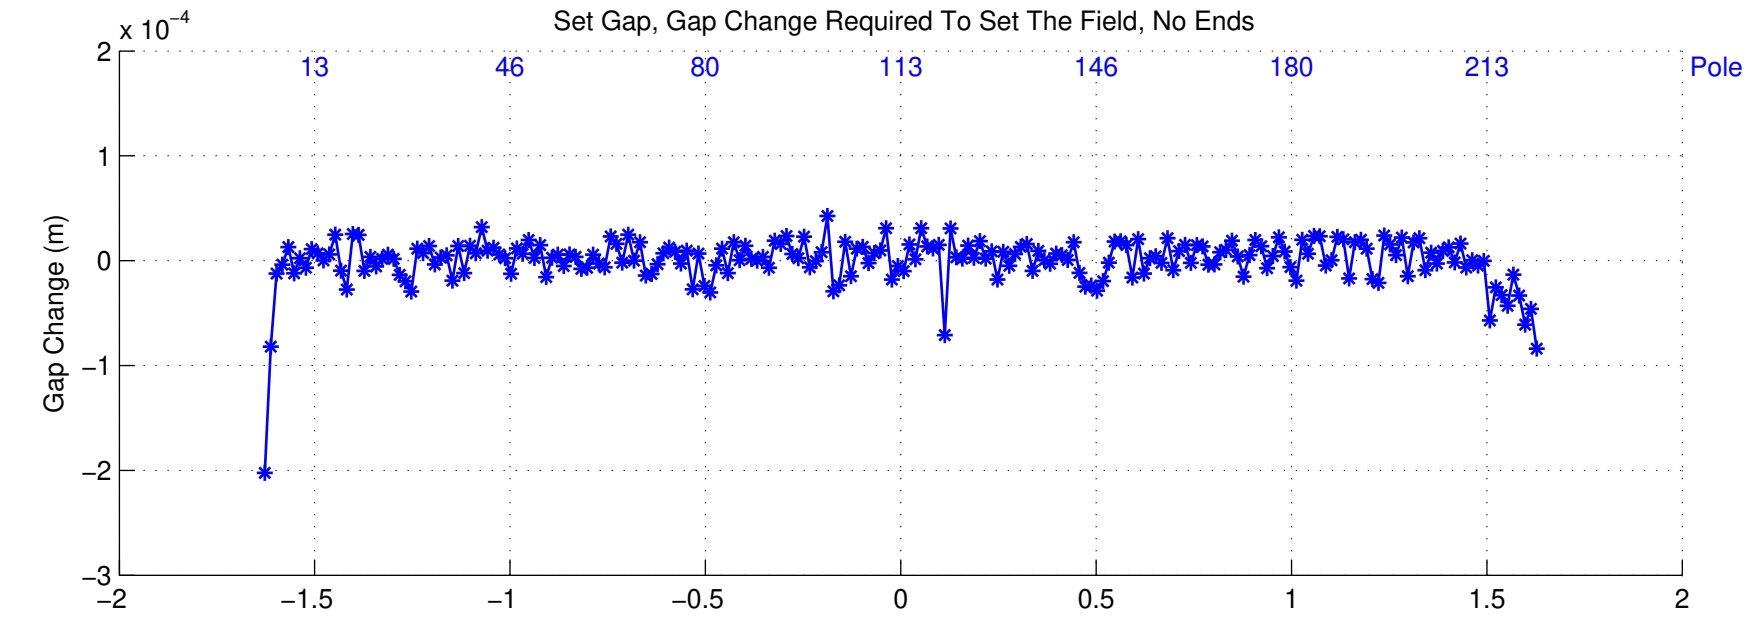
Set Gap, Gap Change Required To Set The Field, No Ends
x 10^-4
Gap Change (m)
13
46
80
113
146
180
213
Pole
2
1
0
−1
−2
−3
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

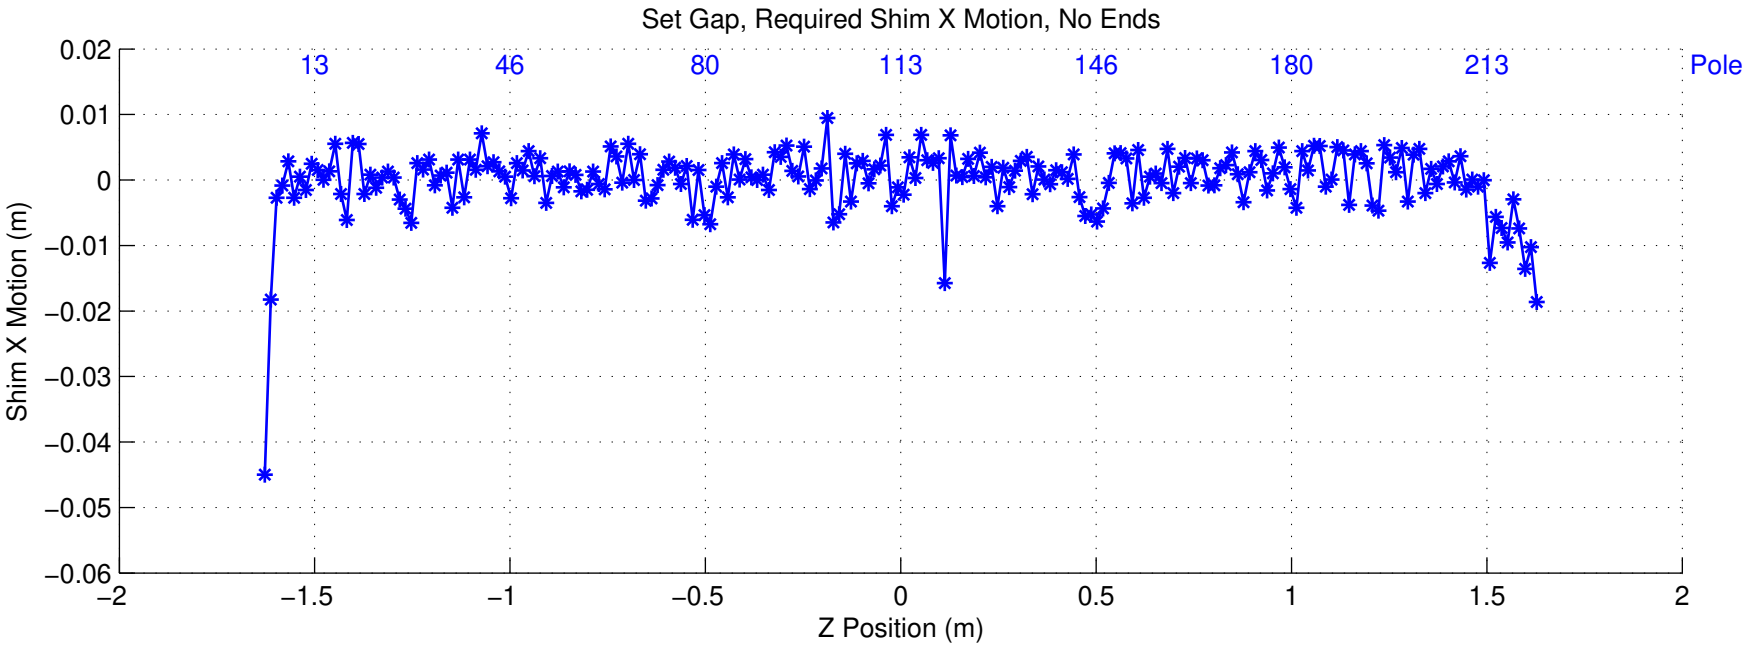
Set Gap, Required Shim X Motion, No Ends
Shim X Motion (m)
13
46
80
113
146
180
213
Pole
0.02
0.01
0
−0.01
−0.02
−0.03
−0.04
−0.05
−0.06
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

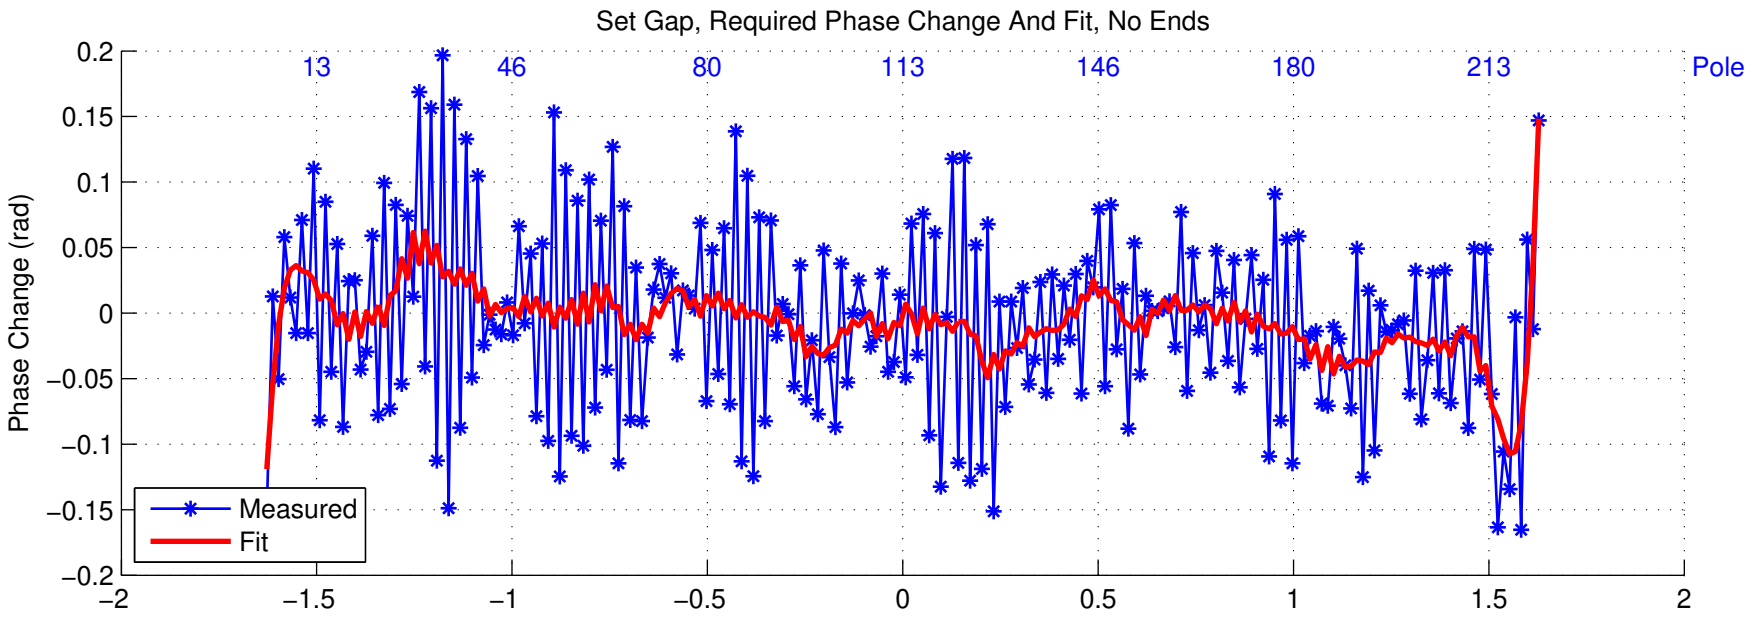
Set Gap, Required Phase Change And Fit, No Ends
13
46
80
113
146
180
213
Pole
Phase Change (rad)
0.2
0.15
0.1
0.05
0
−0.05
−0.1
−0.15
−0.2
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Measured
Fit

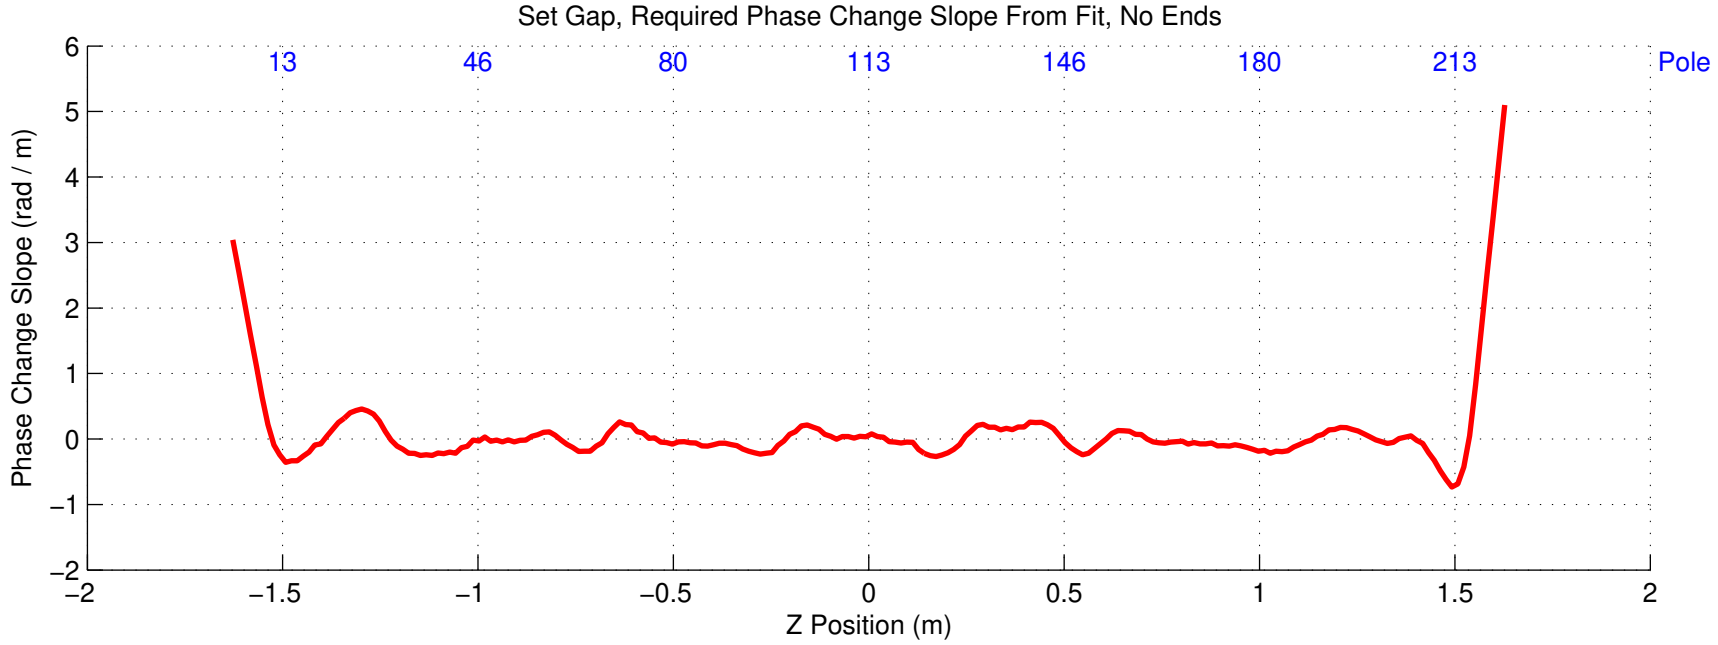
Set Gap, Required Phase Change Slope From Fit, No Ends
13
46
80
113
146
180
213
Pole
Phase Change Slope (rad / m)
6
5
4
3
2
1
0
−1
−2
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

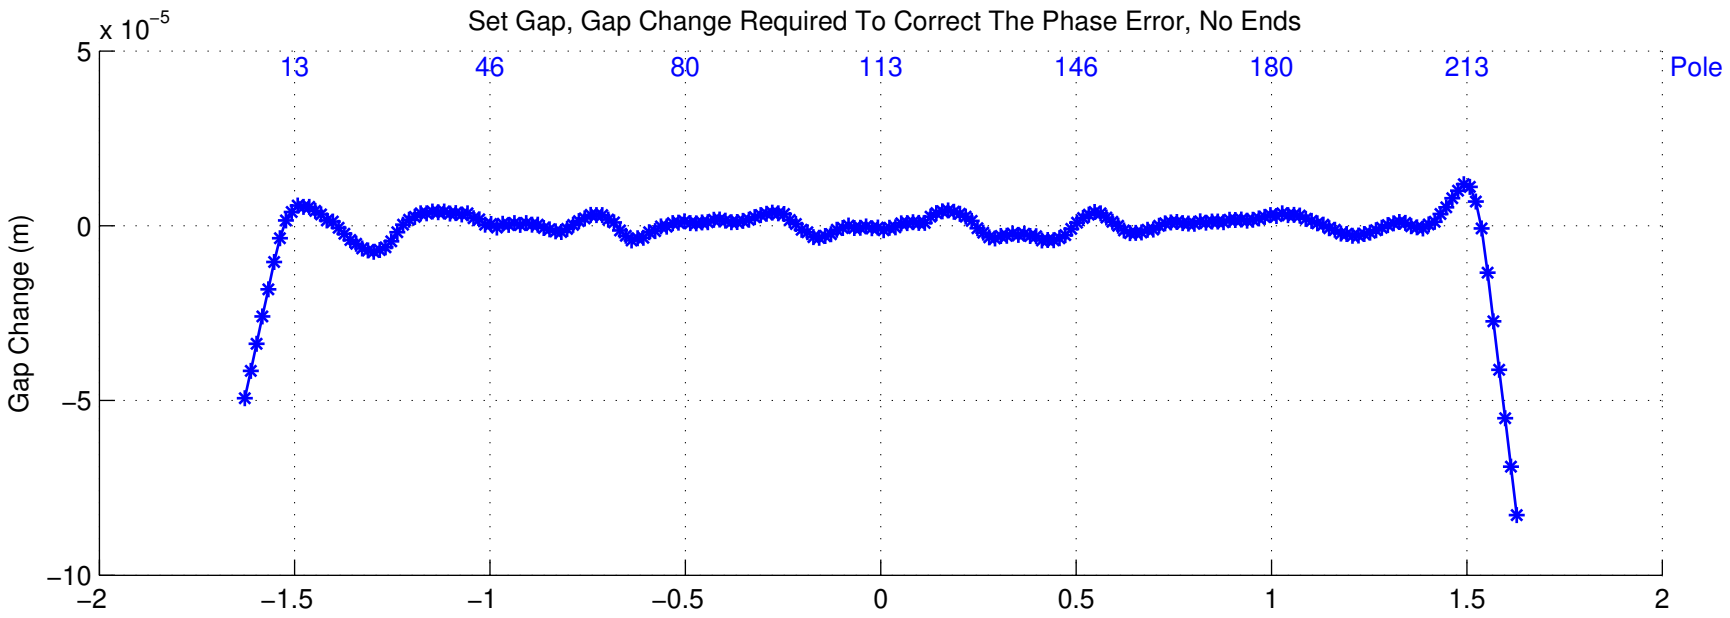
Set Gap, Gap Change Required To Correct The Phase Error, No Ends
x 10^-5
Gap Change (m)
5
0
−5
−10
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

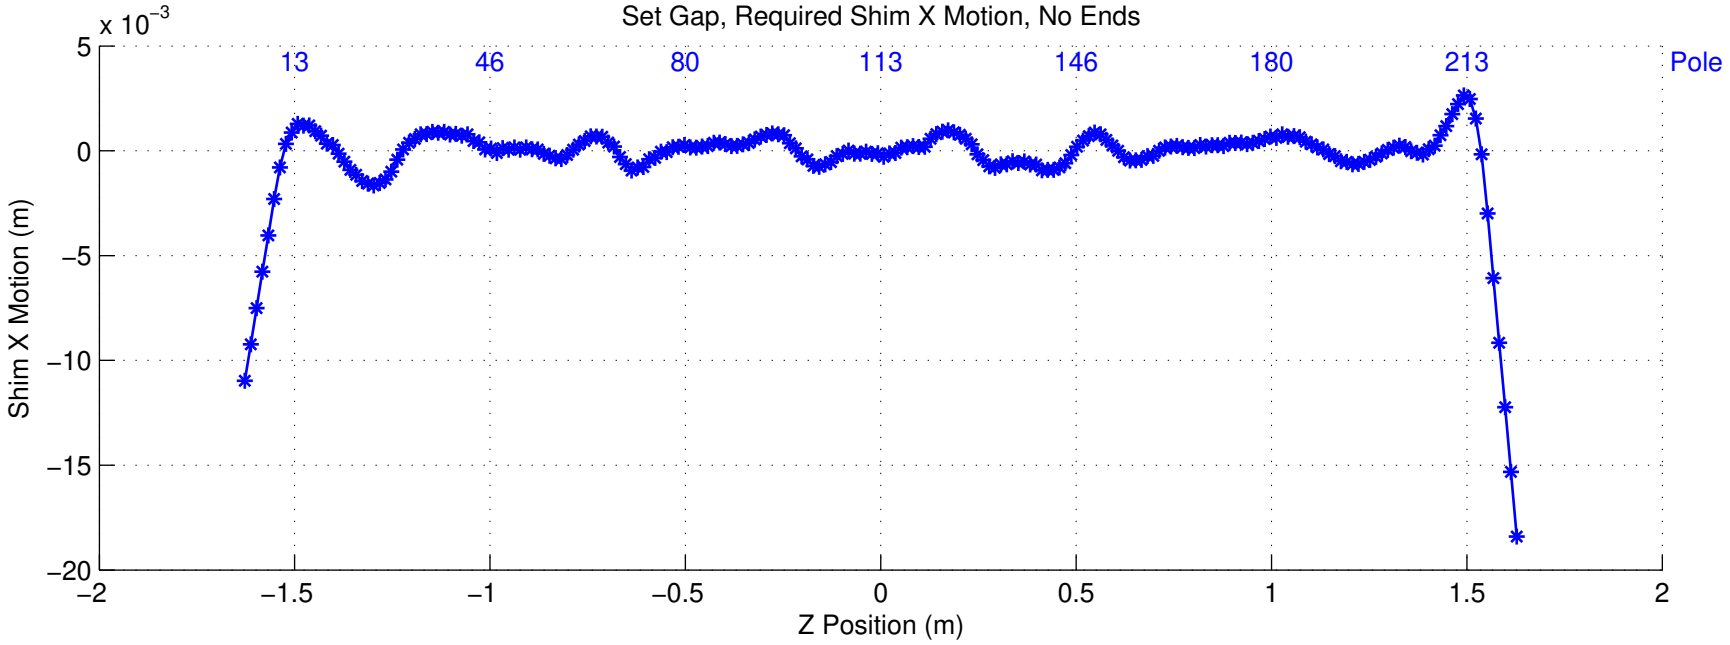
Set Gap, Required Shim X Motion, No Ends
x 10^-3
Shim X Motion (m)
5
0
−5
−10
−15
−20
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

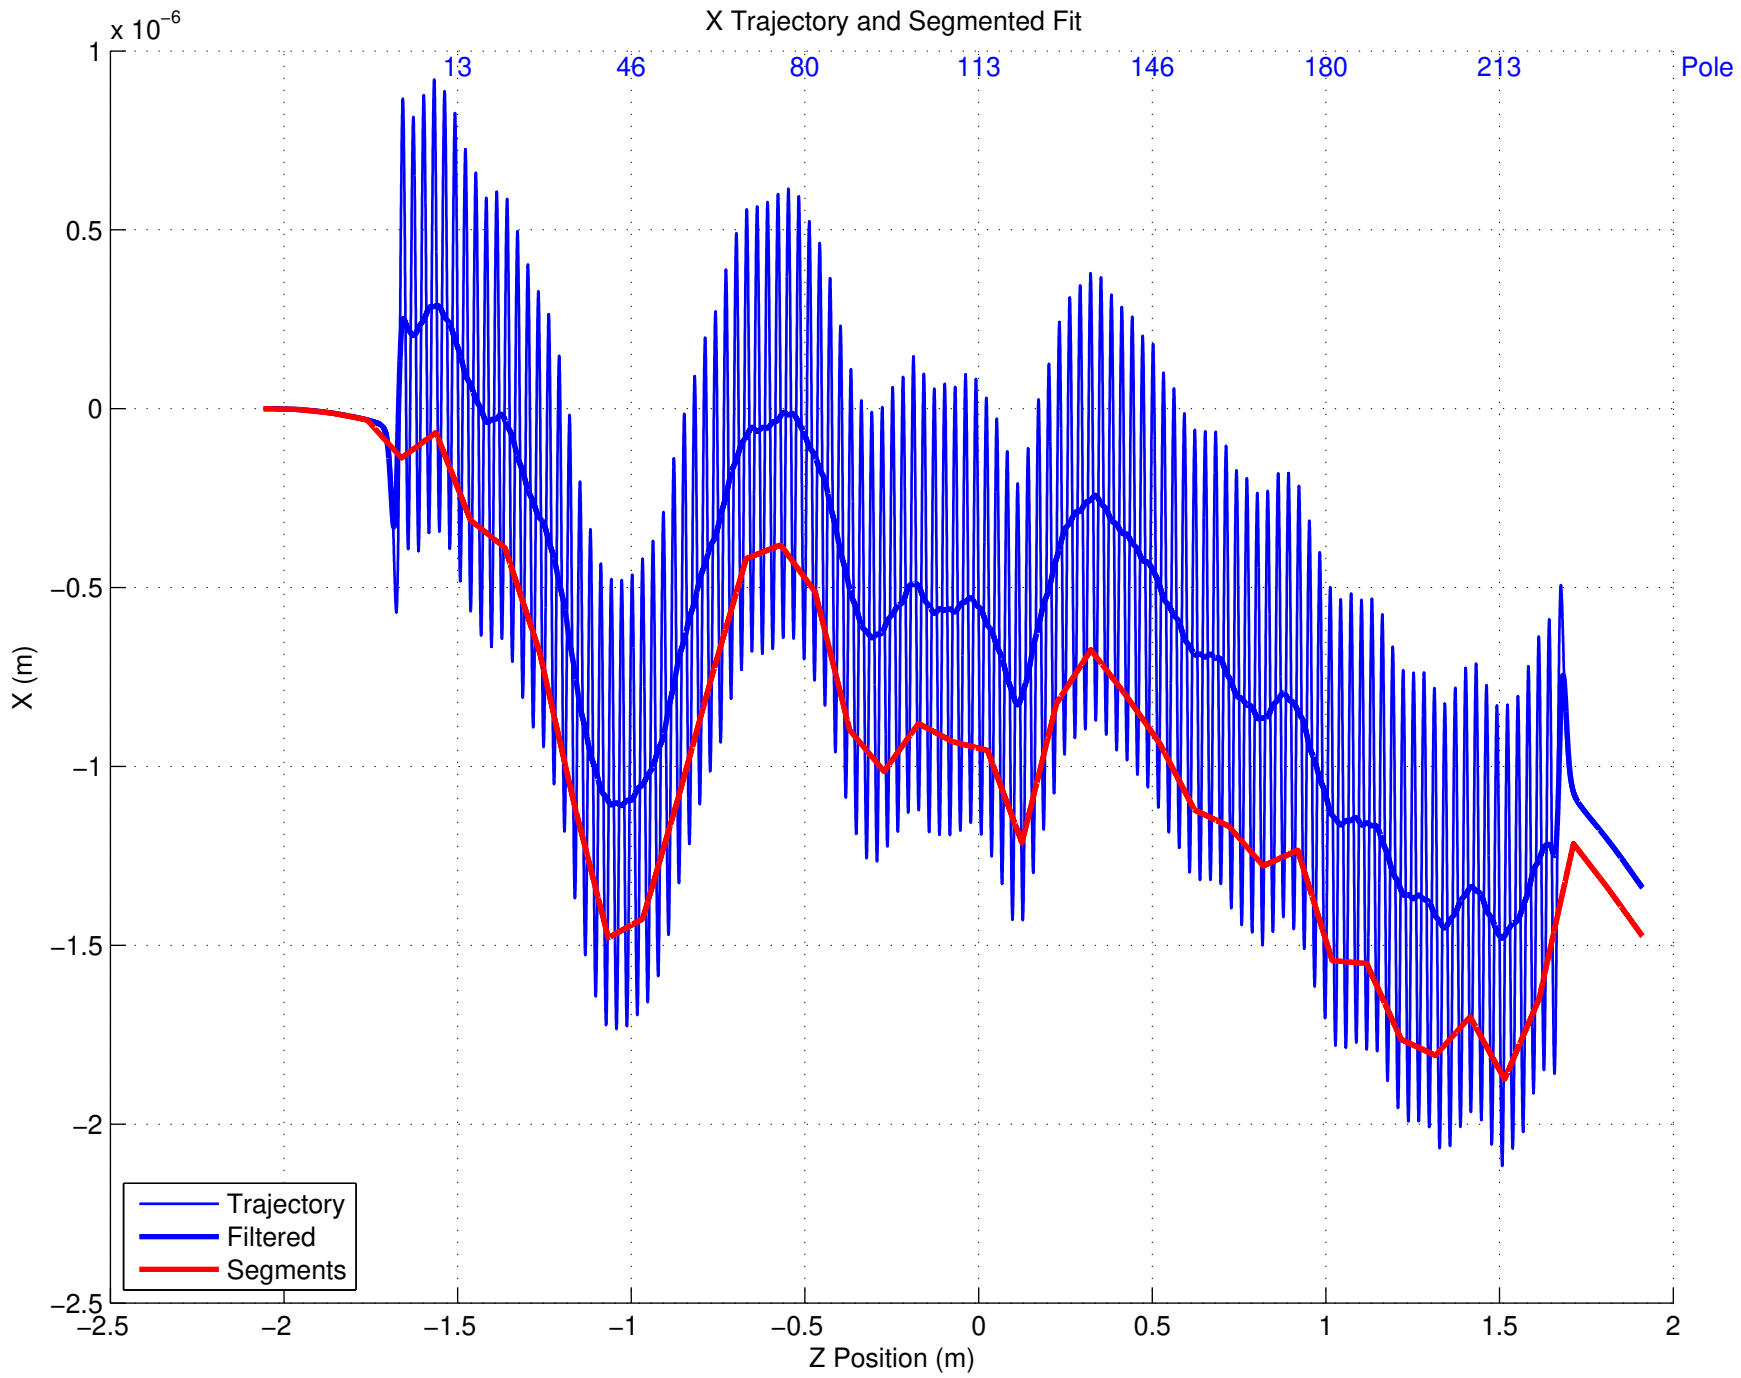
X Trajectory and Segmented Fit
x 10^-6
13
46
80
113
146
180
213
Pole
1
0.5
0
−0.5
−1
−1.5
−2
−2.5
X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

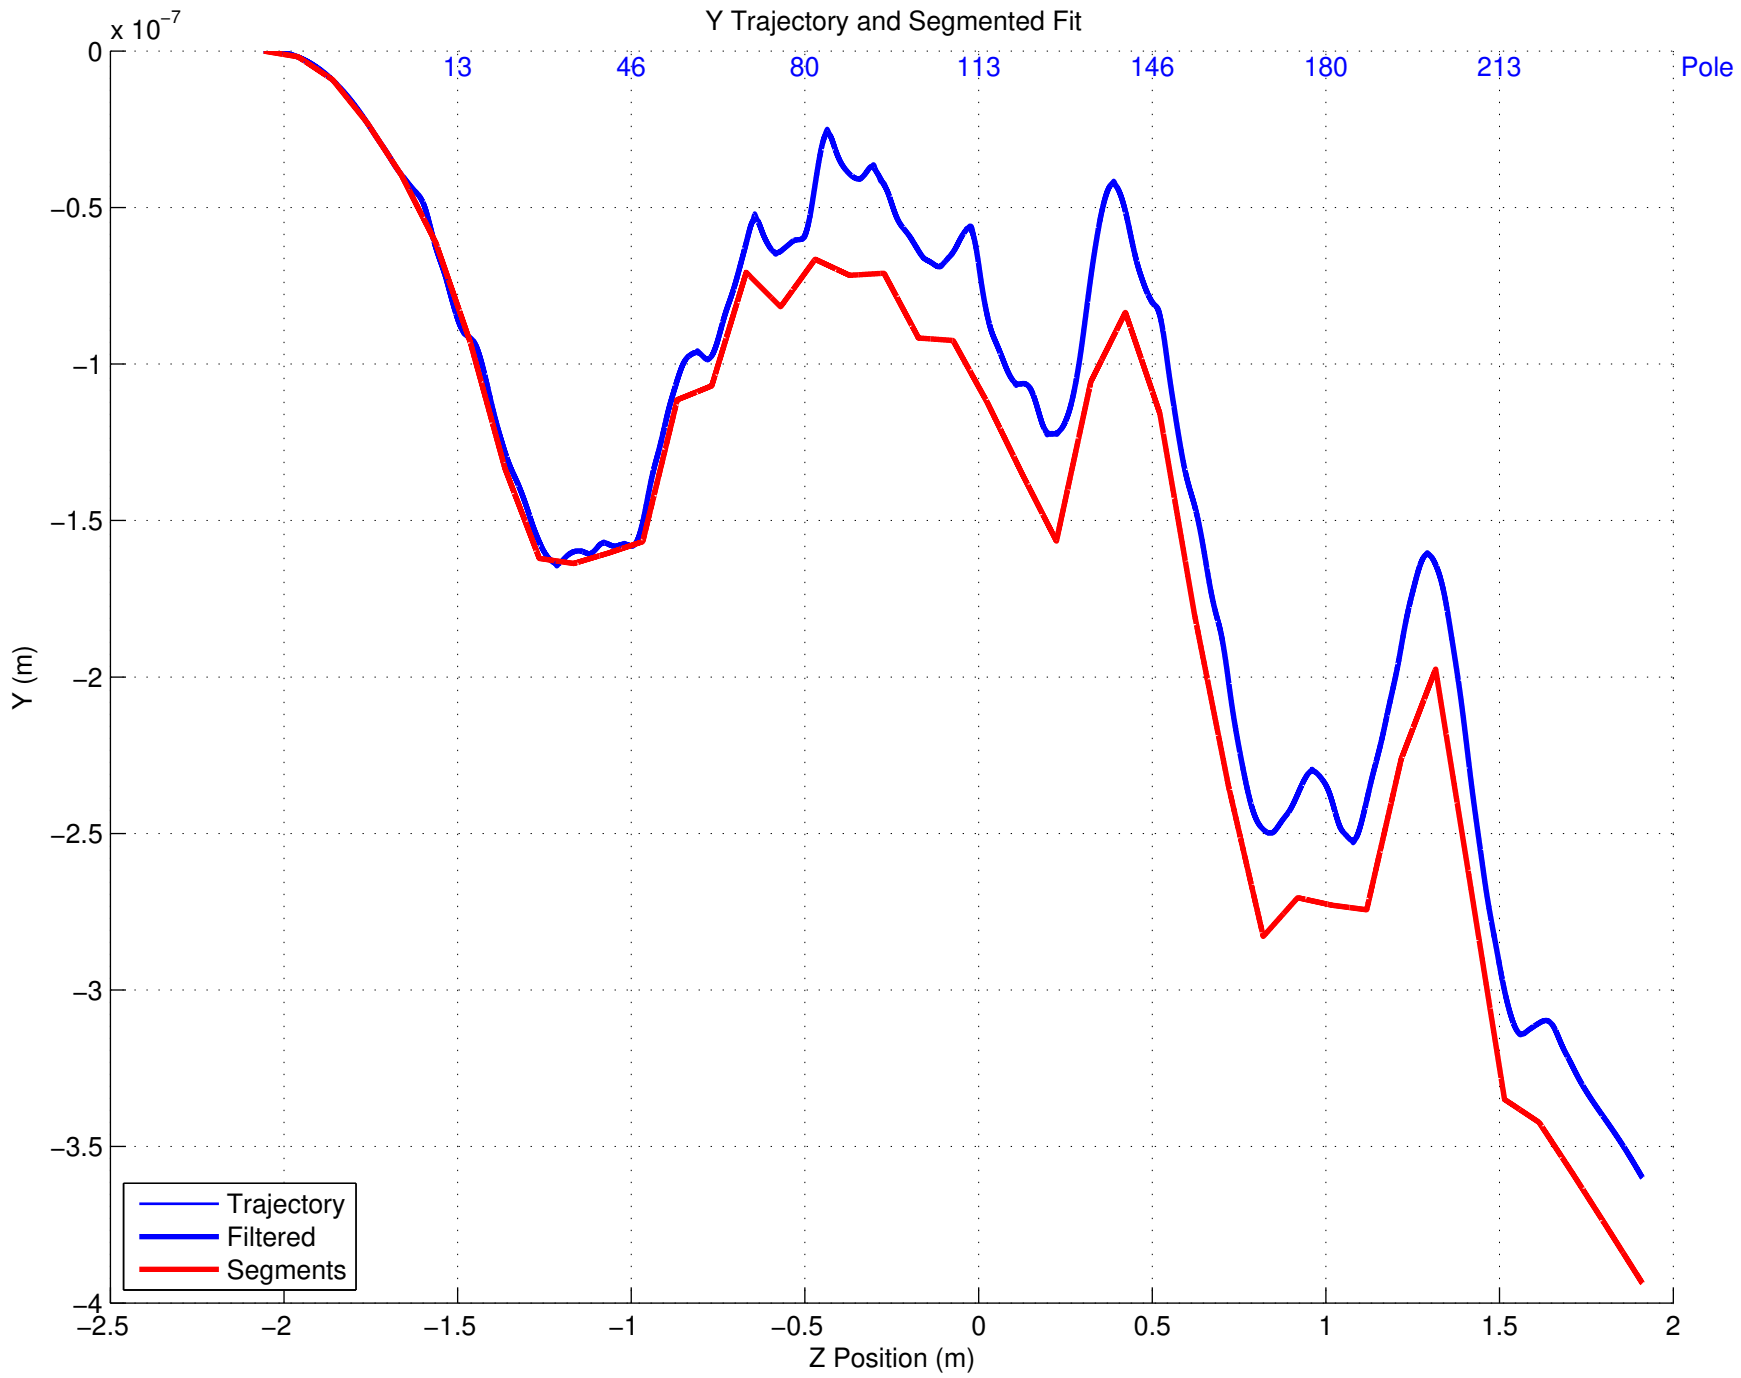
Y Trajectory and Segmented Fit
x 10^-7
13
46
80
113
146
180
213
Pole
0
−0.5
−1
−1.5
−2
−2.5
−3
−3.5
−4
Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)
Trajectory
Filtered
Segments

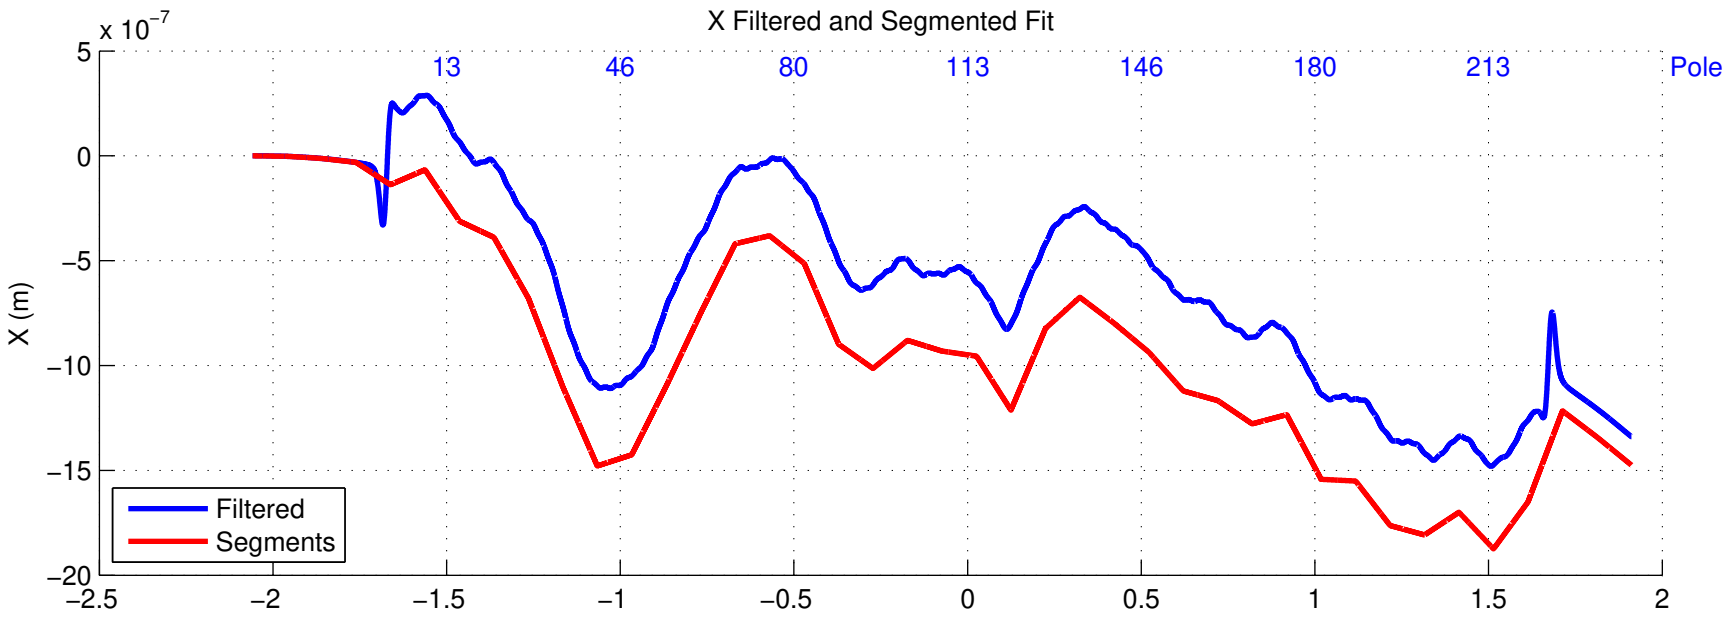
X Filtered and Segmented Fit
x 10^-7
X (m)
13
46
80
113
146
180
213
Pole
Filtered
Segments
5
0
−5
−10
−15
−20
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

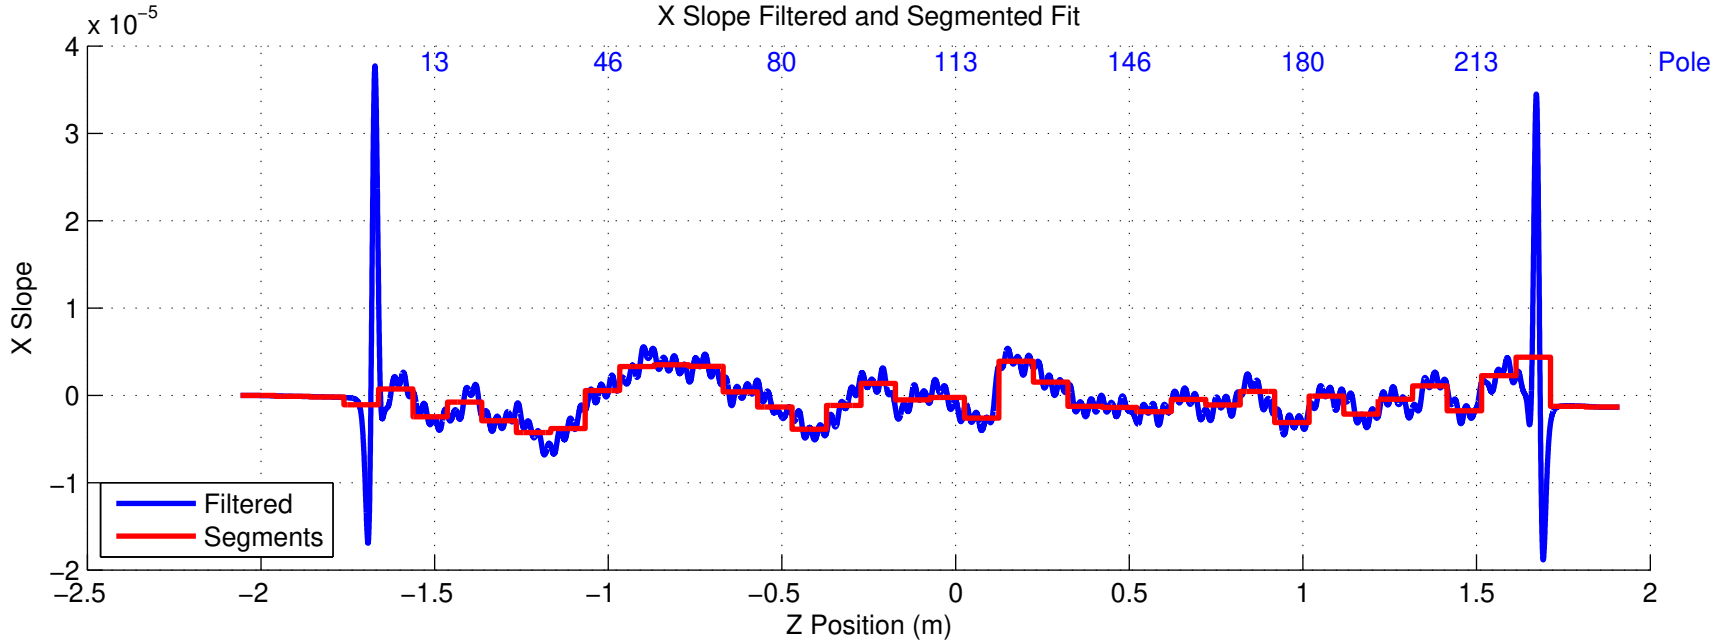
X Slope Filtered and Segmented Fit
x 10^-5
X Slope
13
46
80
113
146
180
213
Pole
Filtered
Segments
4
3
2
1
0
−1
−2
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

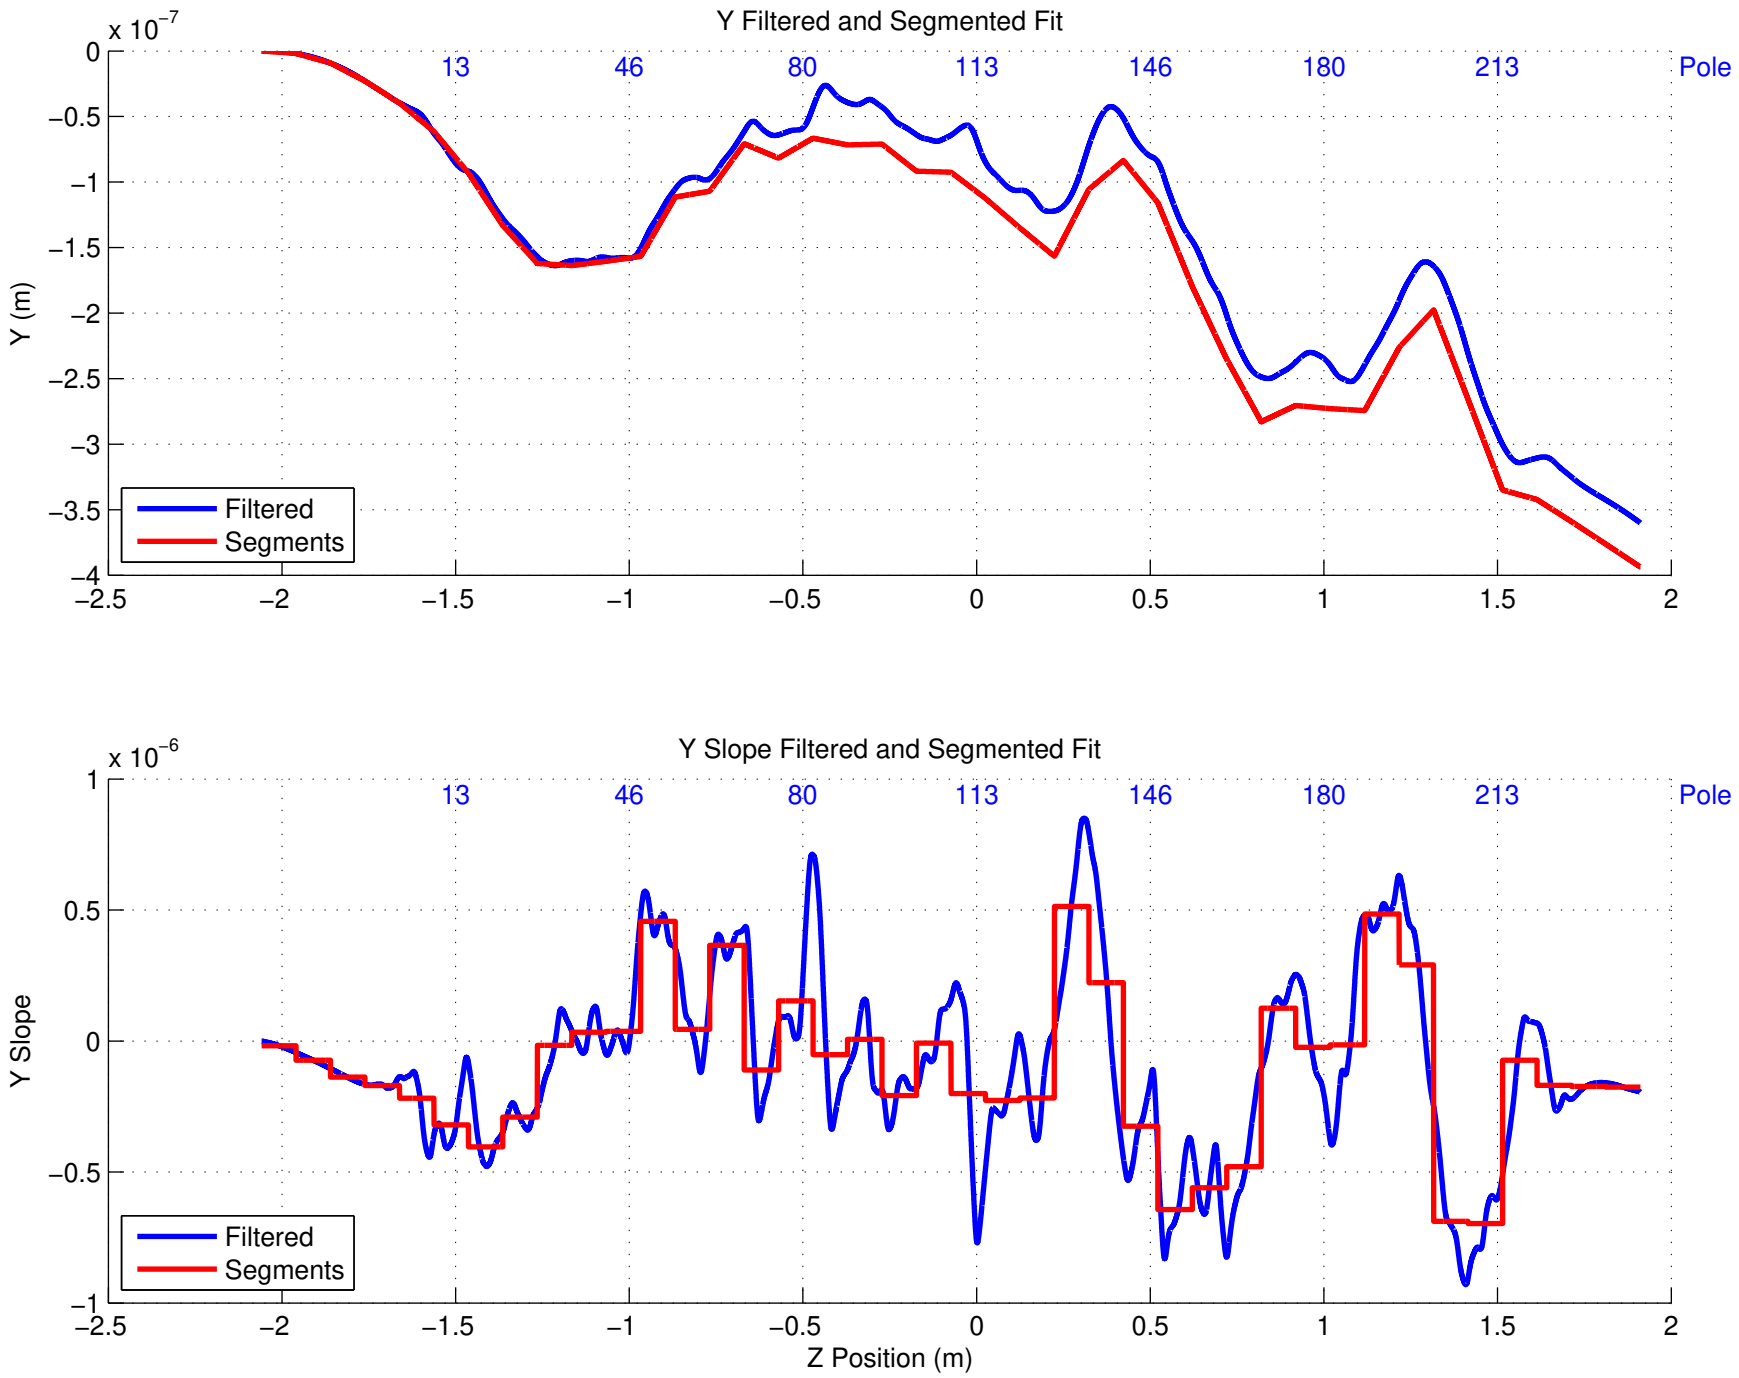
Y Filtered and Segmented Fit
x 10^-7
13
46
80
113
146
180
213
Pole
Y (m)
Filtered
Segments
Y Slope Filtered and Segmented Fit
x 10^-6
Y Slope
Z Position (m)

X Original And Shimmed Segmented Trajectories
x 10^-7
X (m)
13
46
80
113
146
180
213
Pole
Original
Shimmed

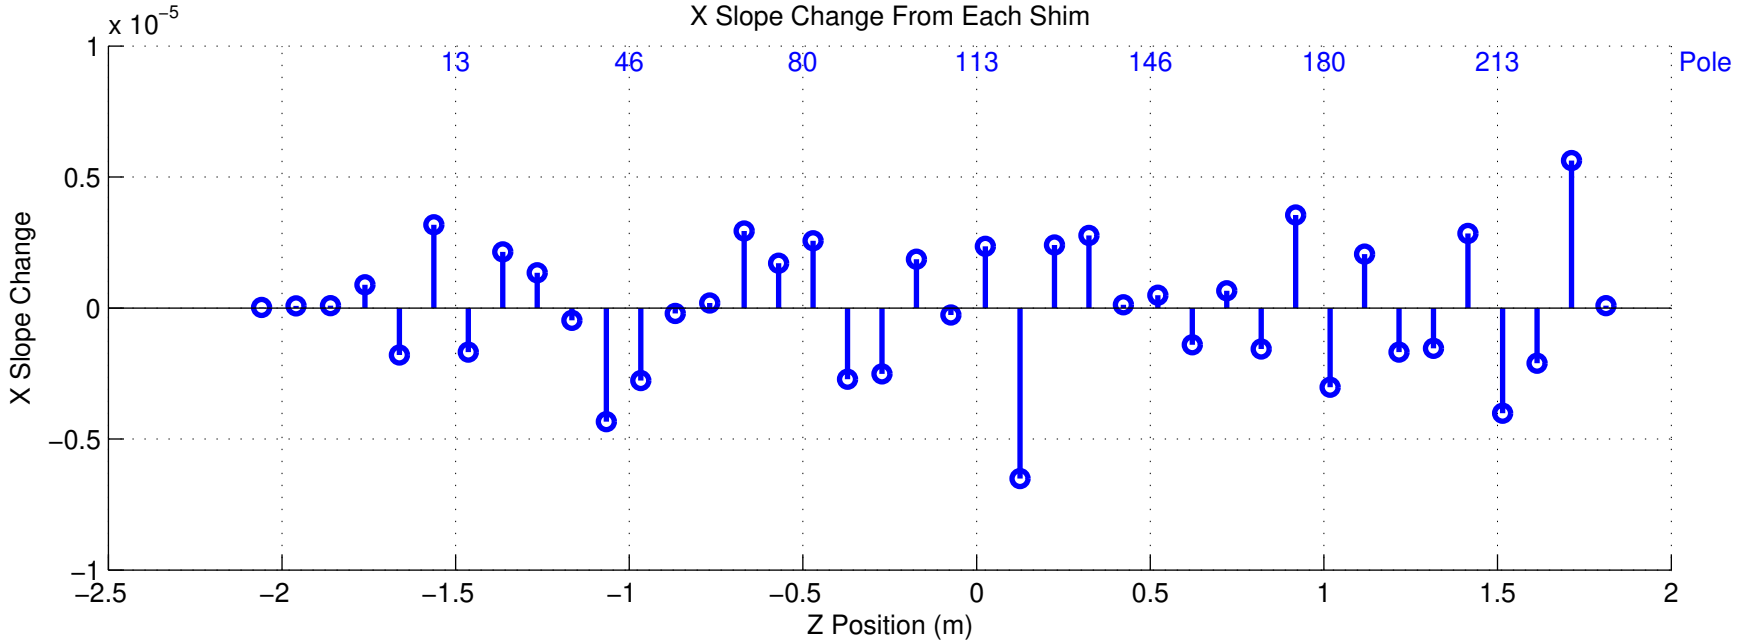
X Slope Change From Each Shim
x 10^-5
X Slope Change
13
46
80
113
146
180
213
Pole
Z Position (m)

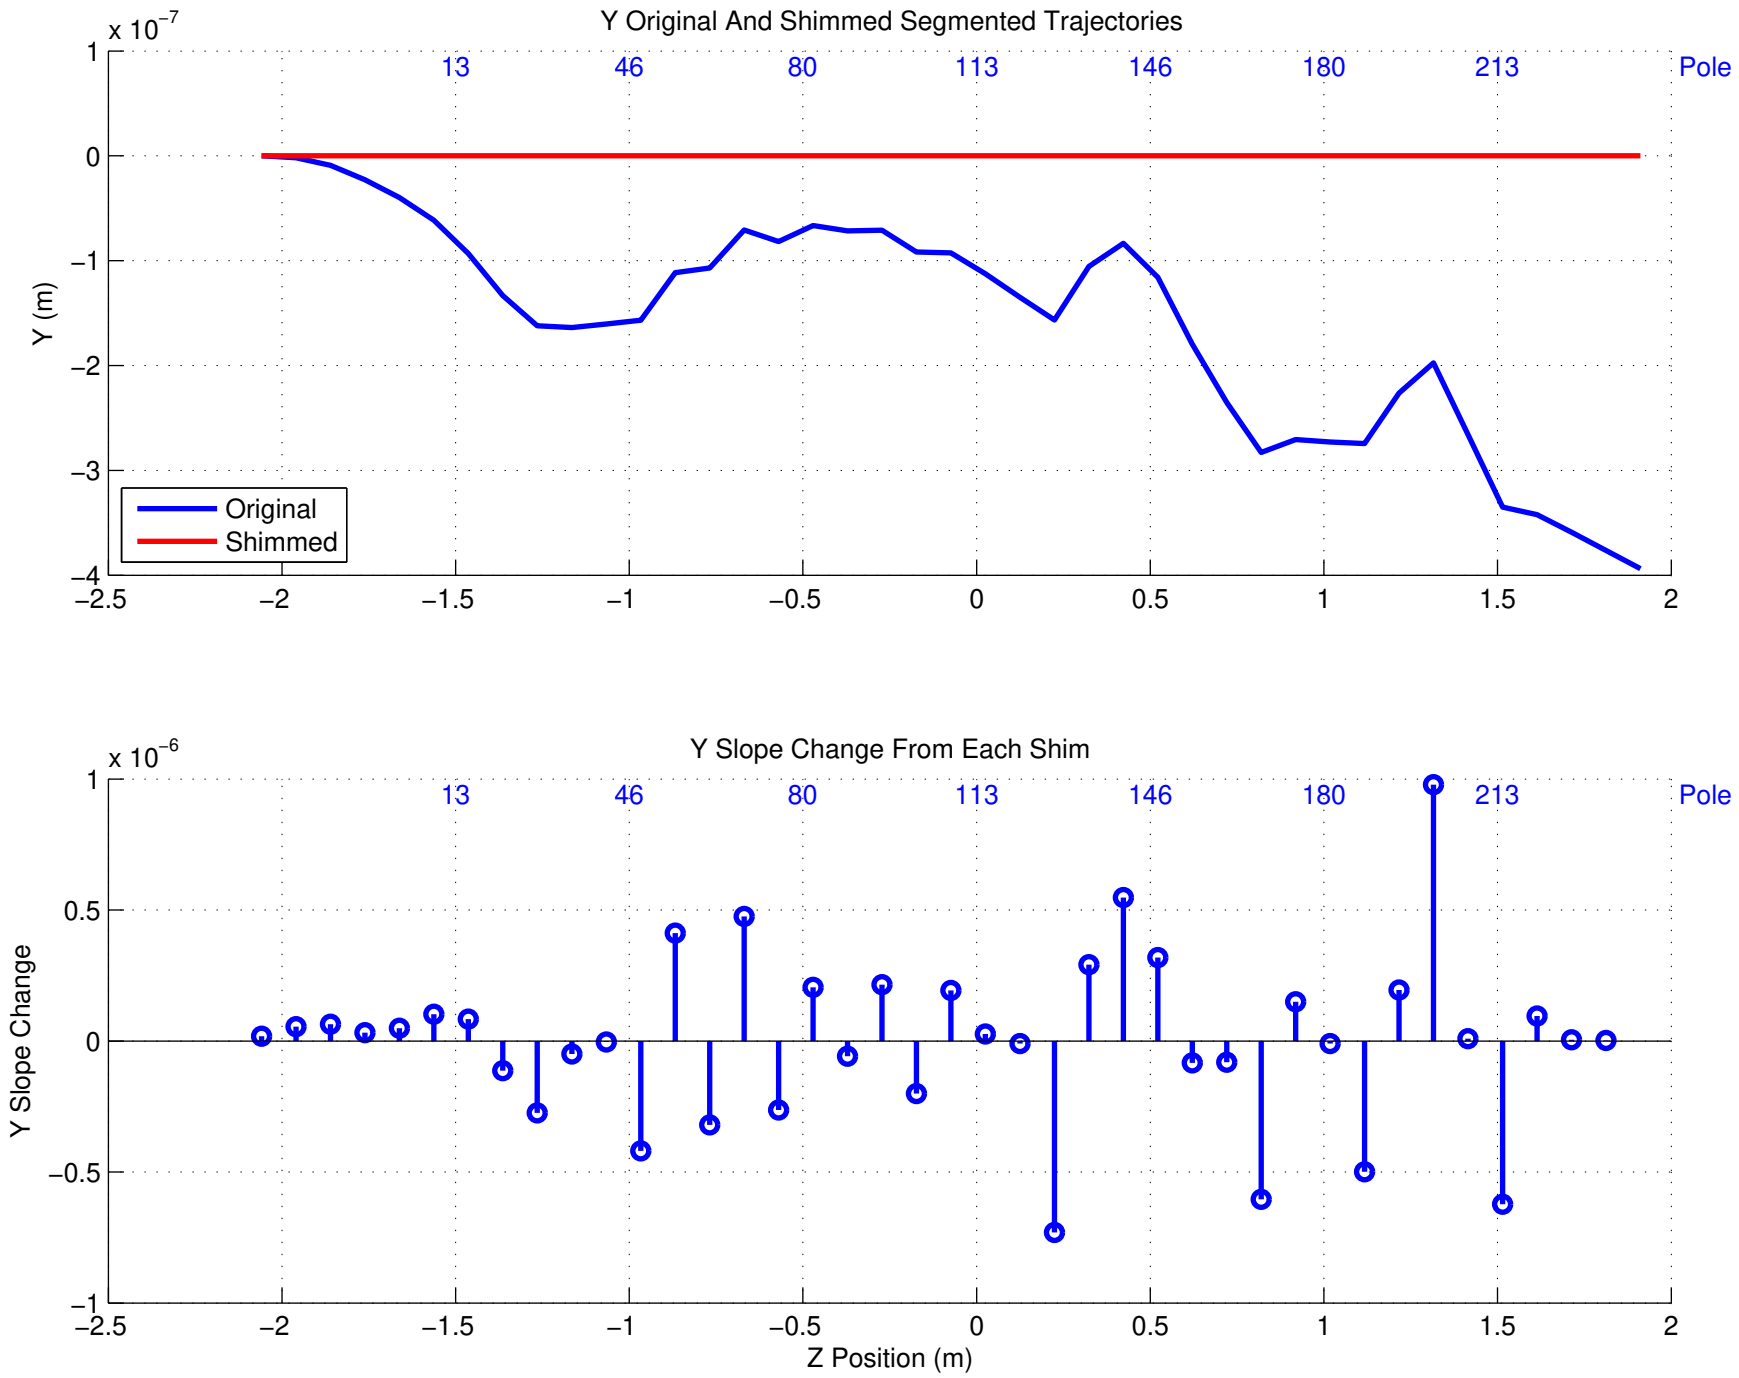
Y Original And Shimmed Segmented Trajectories
x 10^-7
13
46
80
113
146
180
213
Pole
Y (m)
Original
Shimmed
Y Slope Change From Each Shim
x 10^-6
Y Slope Change
Z Position (m)

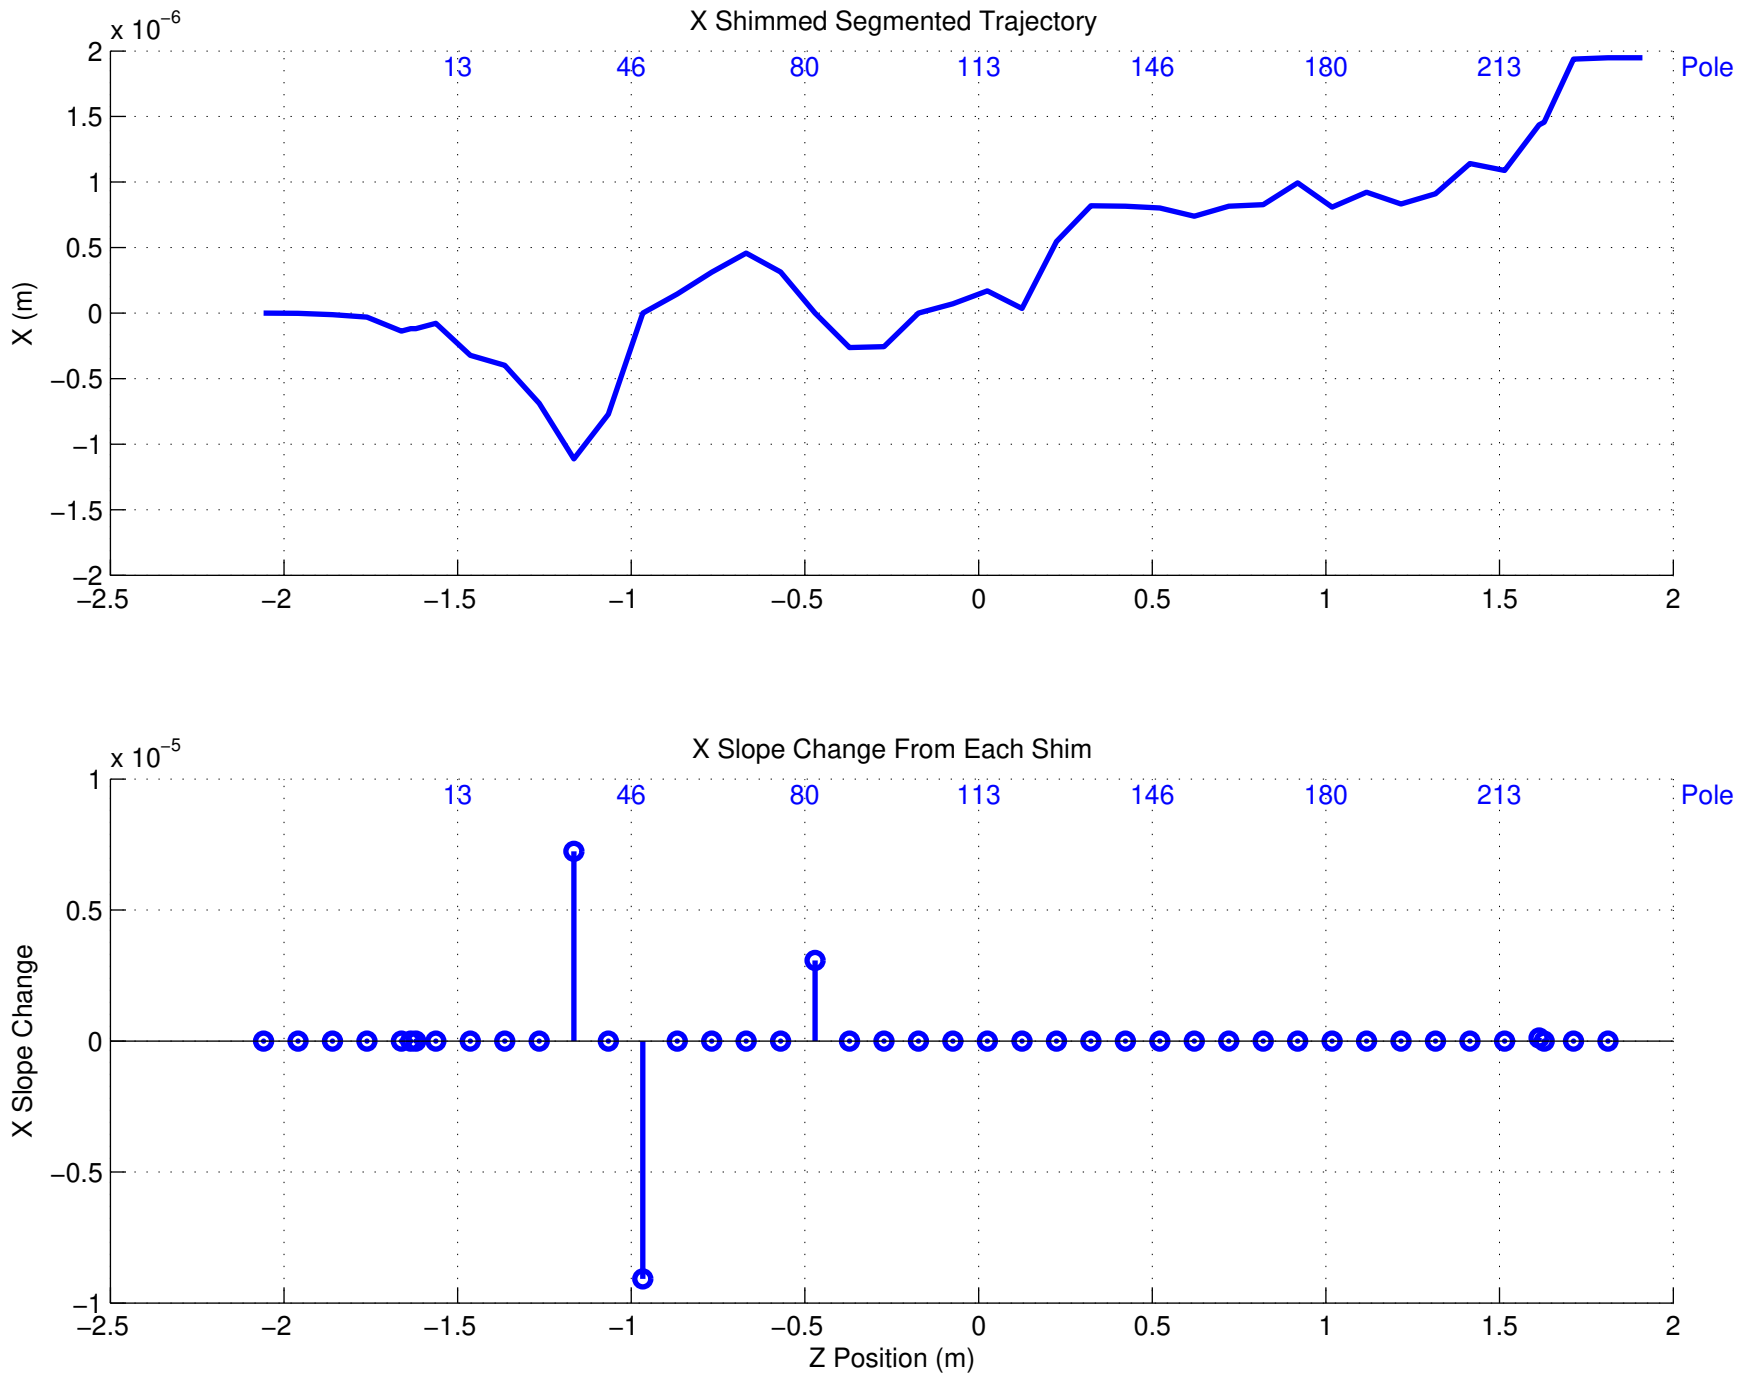
X Shimmed Segmented Trajectory
x 10^-6
X (m)
13
46
80
113
146
180
213
Pole
X Slope Change From Each Shim
x 10^-5
X Slope Change
Z Position (m)

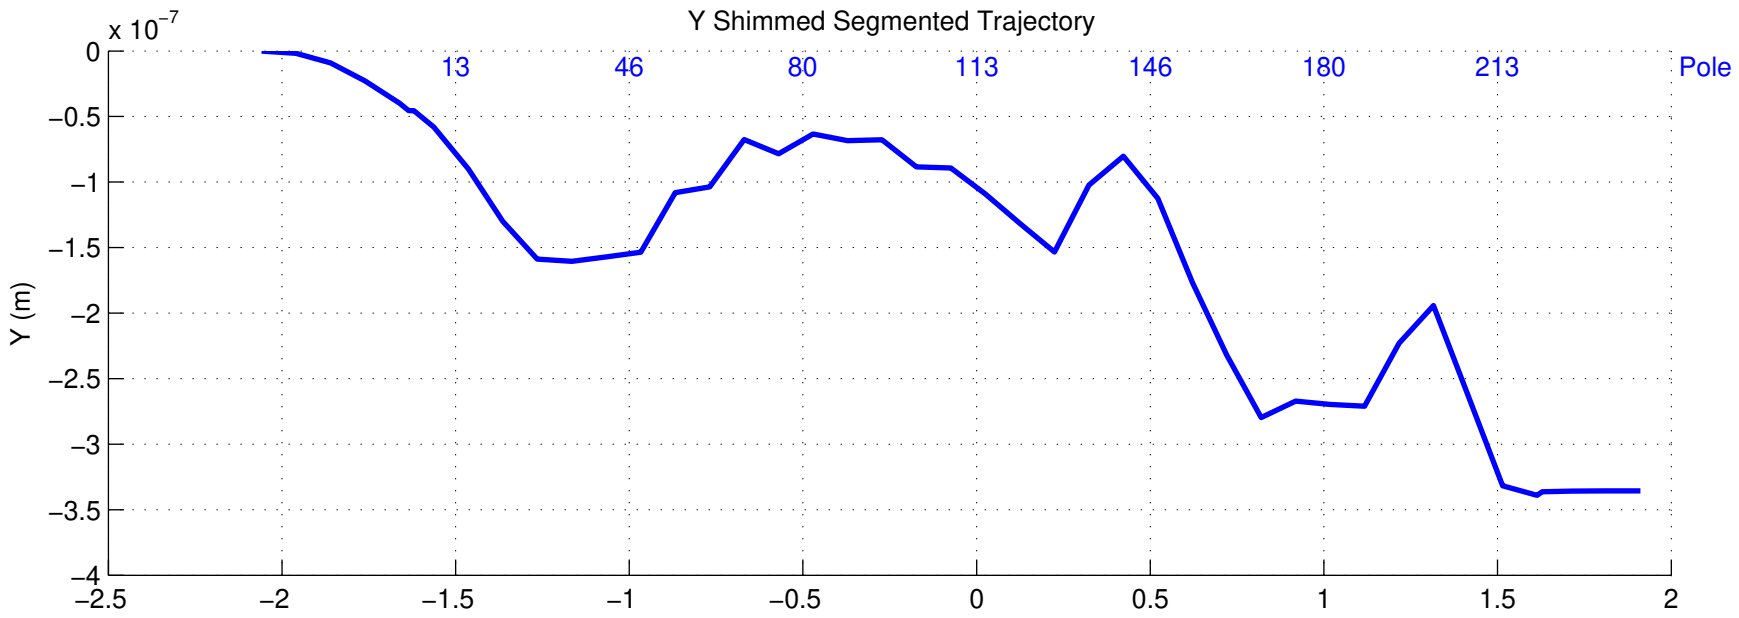
Y Shimmed Segmented Trajectory
x 10^-7
Y (m)
13
46
80
113
146
180
213
Pole
0
−0.5
−1
−1.5
−2
−2.5
−3
−3.5
−4
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2

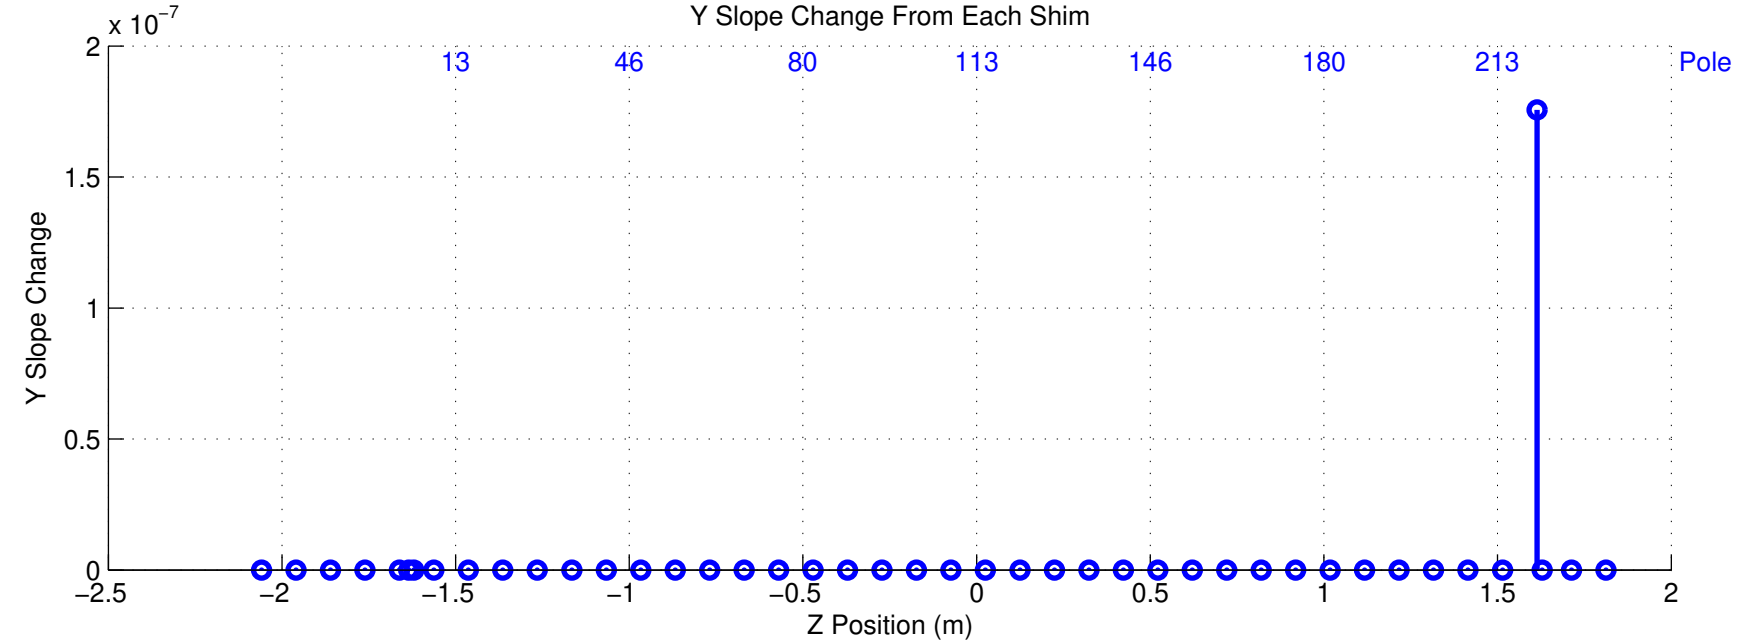
Y Slope Change From Each Shim
x 10^-7
Y Slope Change
13
46
80
113
146
180
213
Pole
2
1.5
1
0.5
0
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z Position (m)

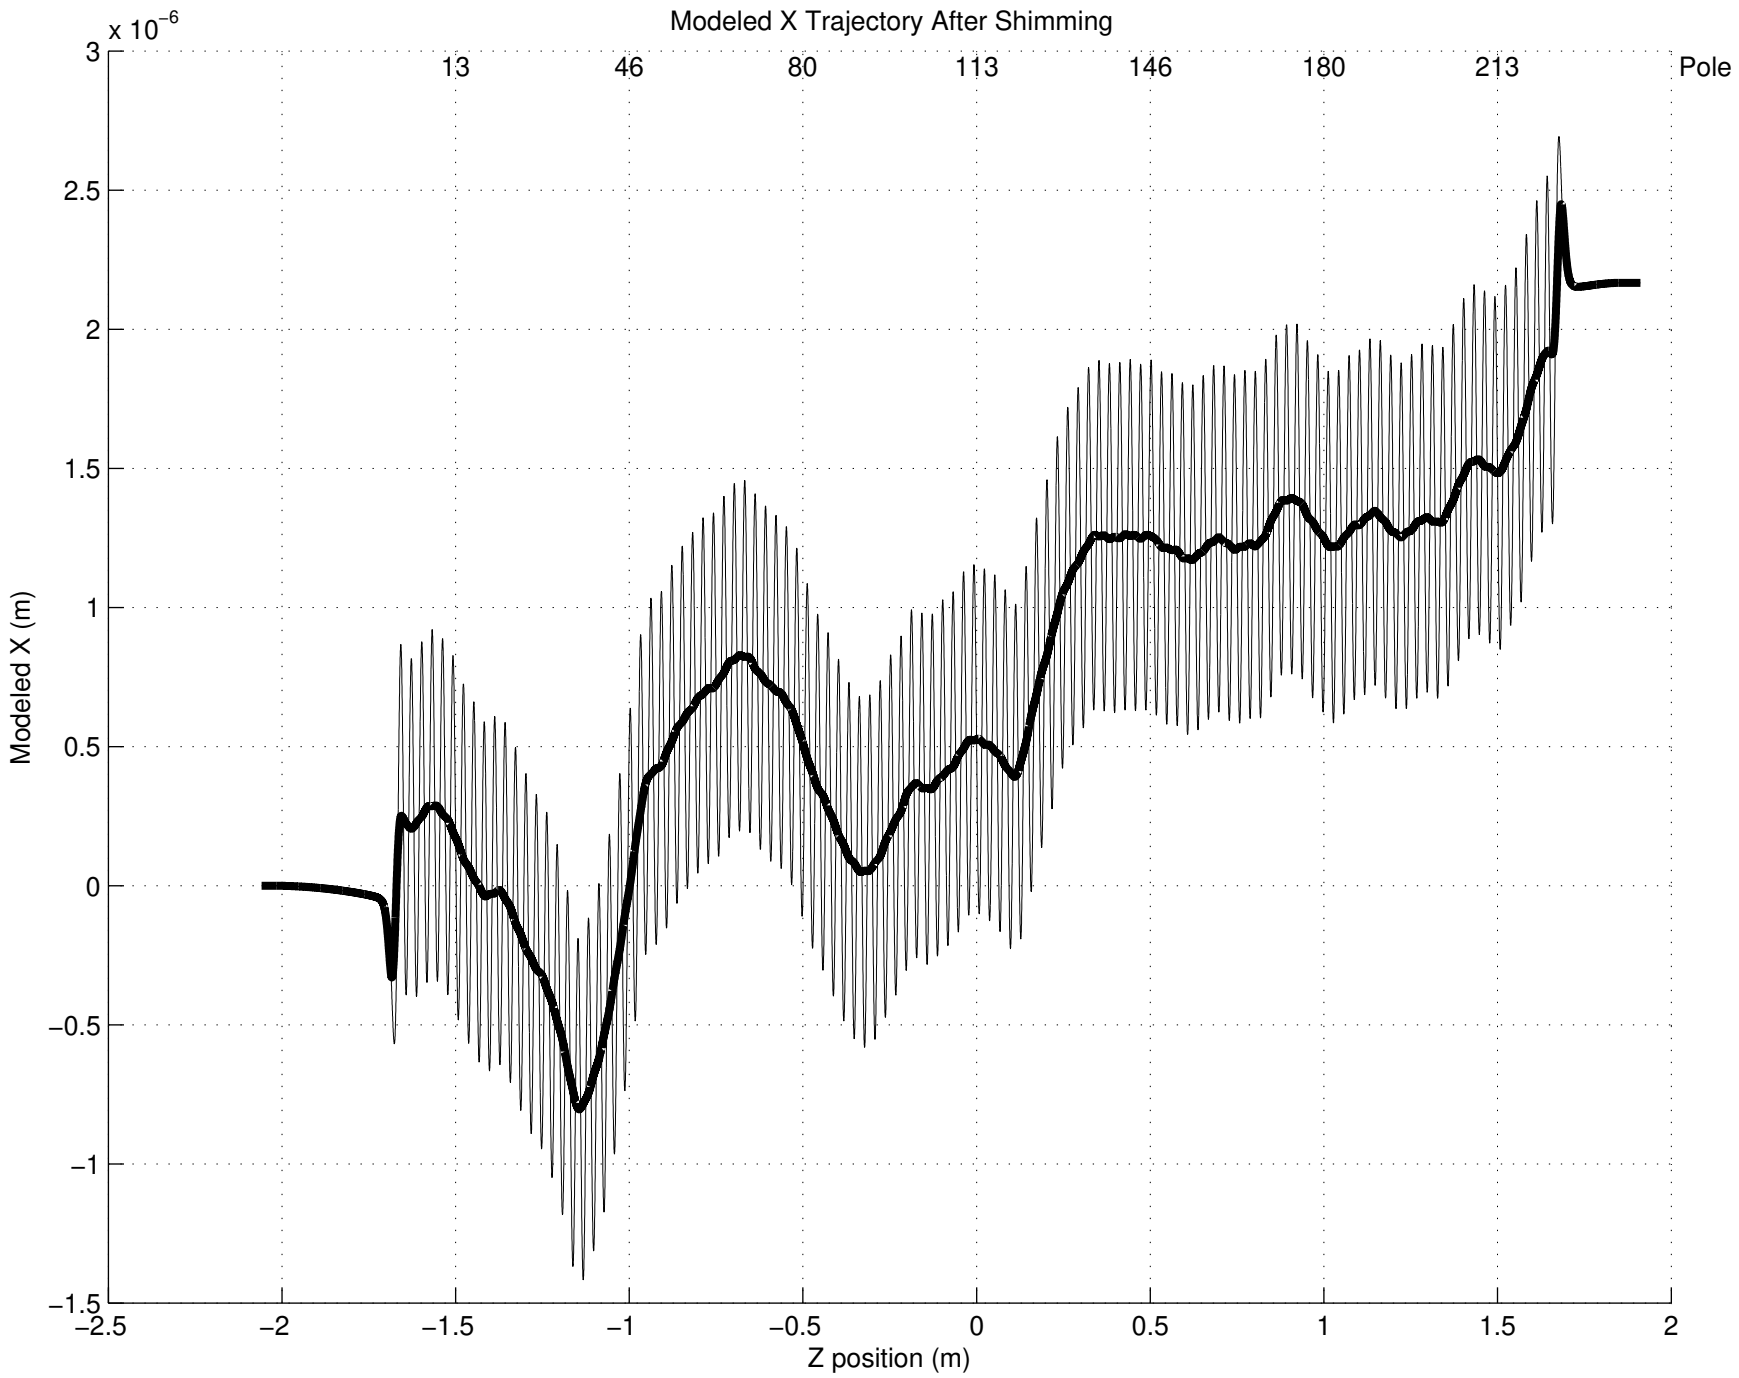
Modeled X Trajectory After Shimming
x 10^-6
3
2.5
2
1.5
1
0.5
0
−0.5
−1
−1.5
13
46
80
113
146
180
213
Pole
Modeled X (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

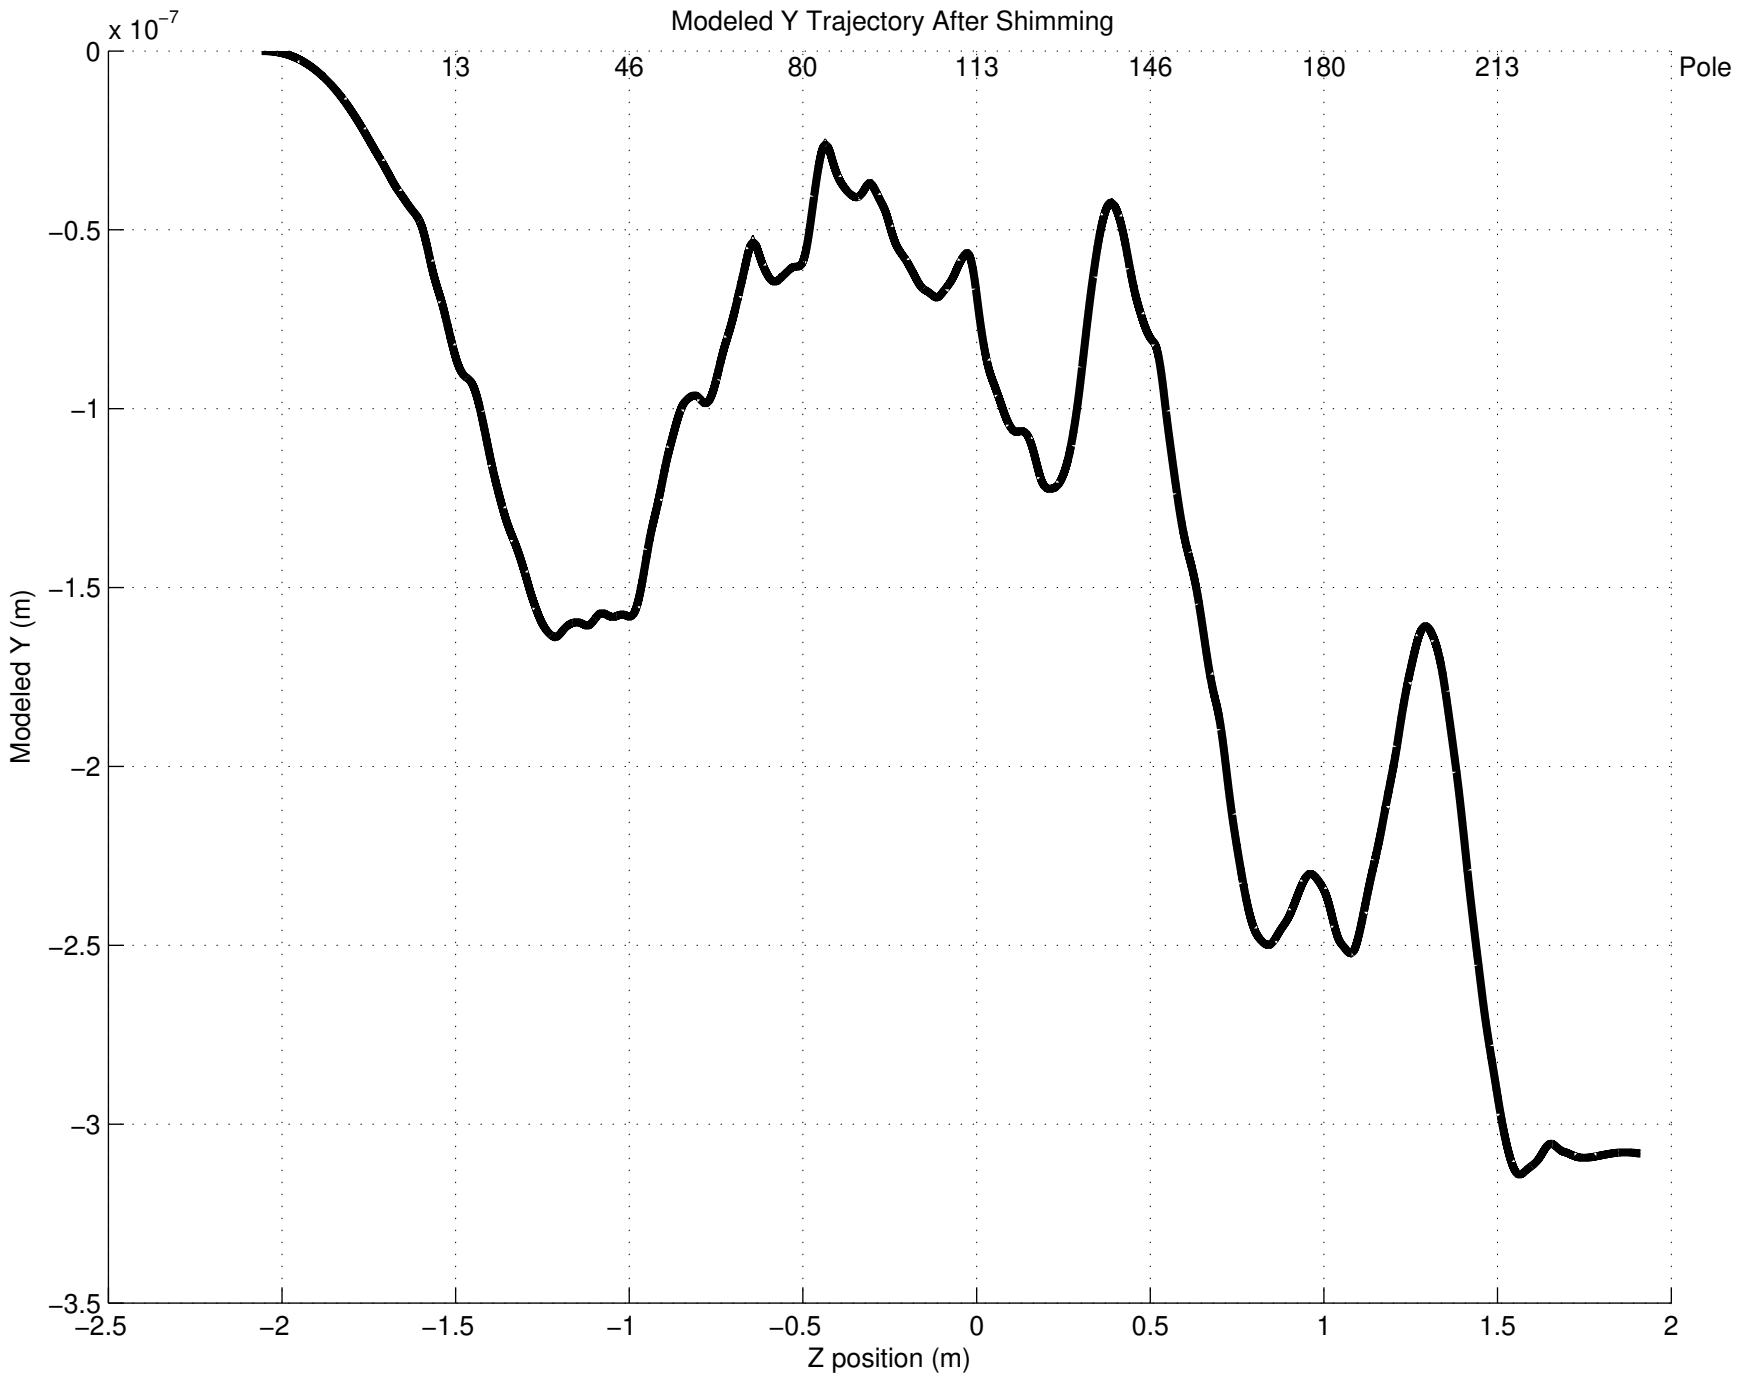
Modeled Y Trajectory After Shimming
x 10^-7
0
−0.5
−1
−1.5
−2
−2.5
−3
−3.5
13
46
80
113
146
180
213
Pole
Modeled Y (m)
−2.5
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Z position (m)

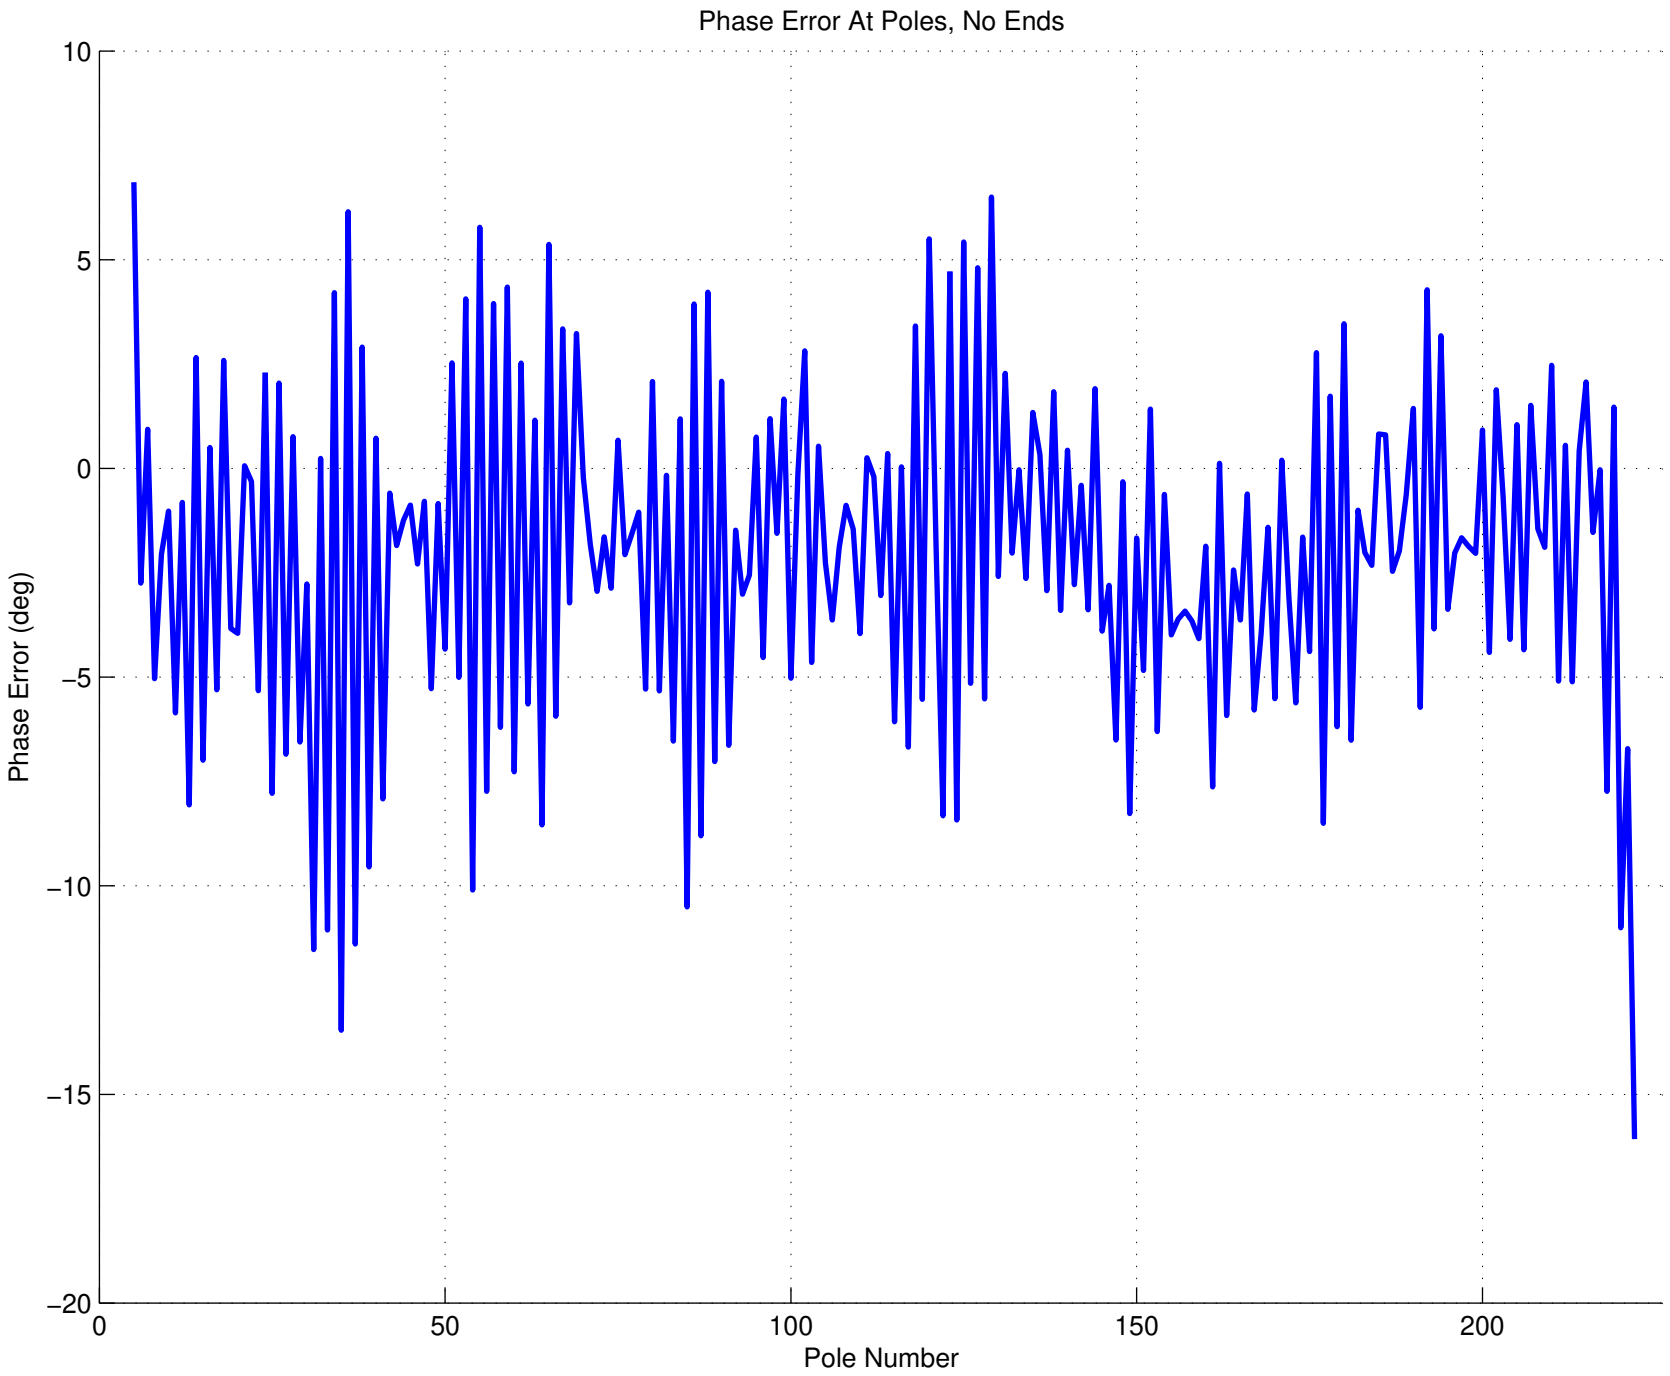
Phase Error At Poles, No Ends
Phase Error (deg)
Pole Number
10
5
0
−5
−10
−15
−20
0
50
100
150
200

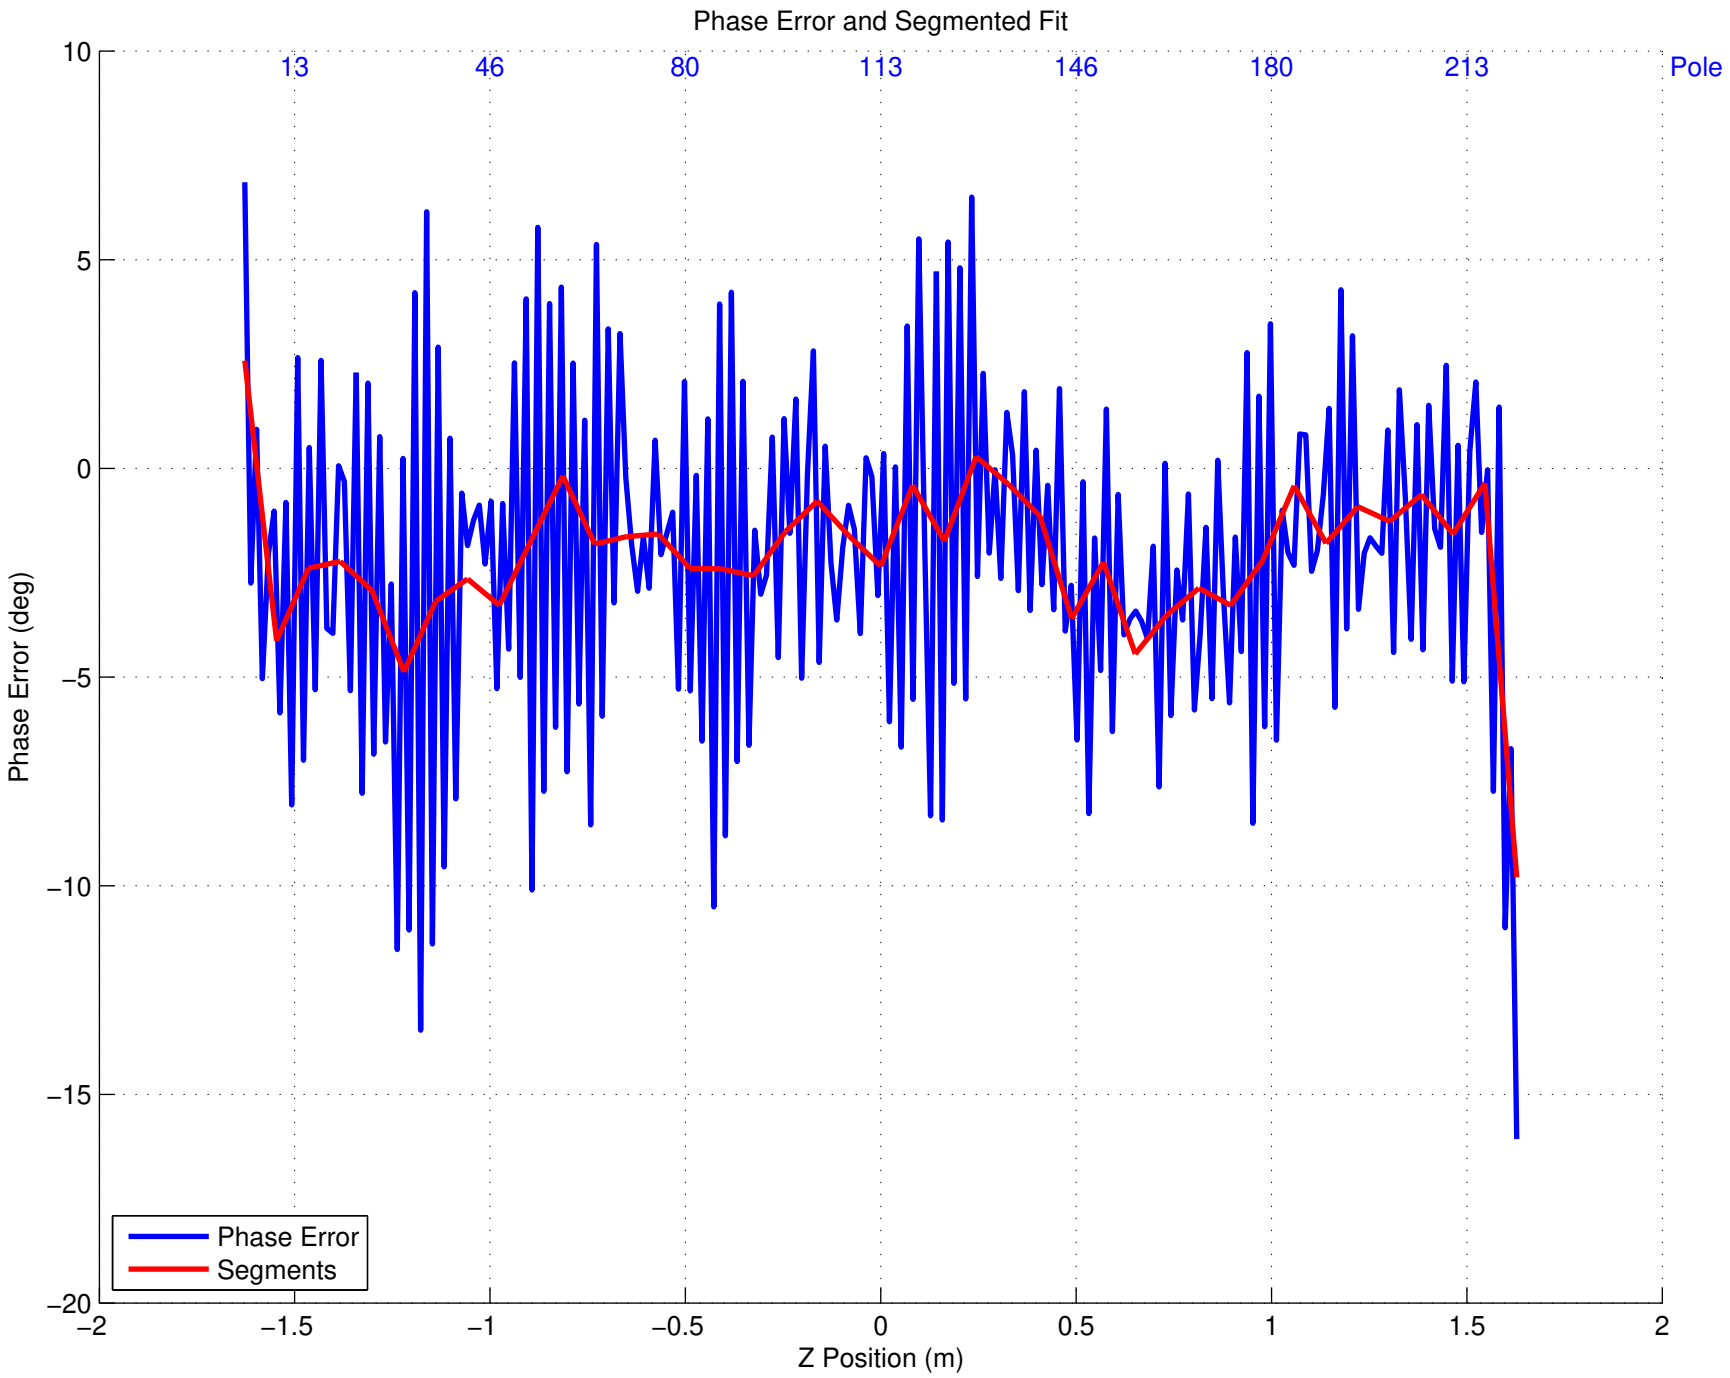
Phase Error and Segmented Fit
13
46
80
113
146
180
213
Pole
10
5
0
−5
−10
−15
−20
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Phase Error (deg)
Z Position (m)
Phase Error
Segments

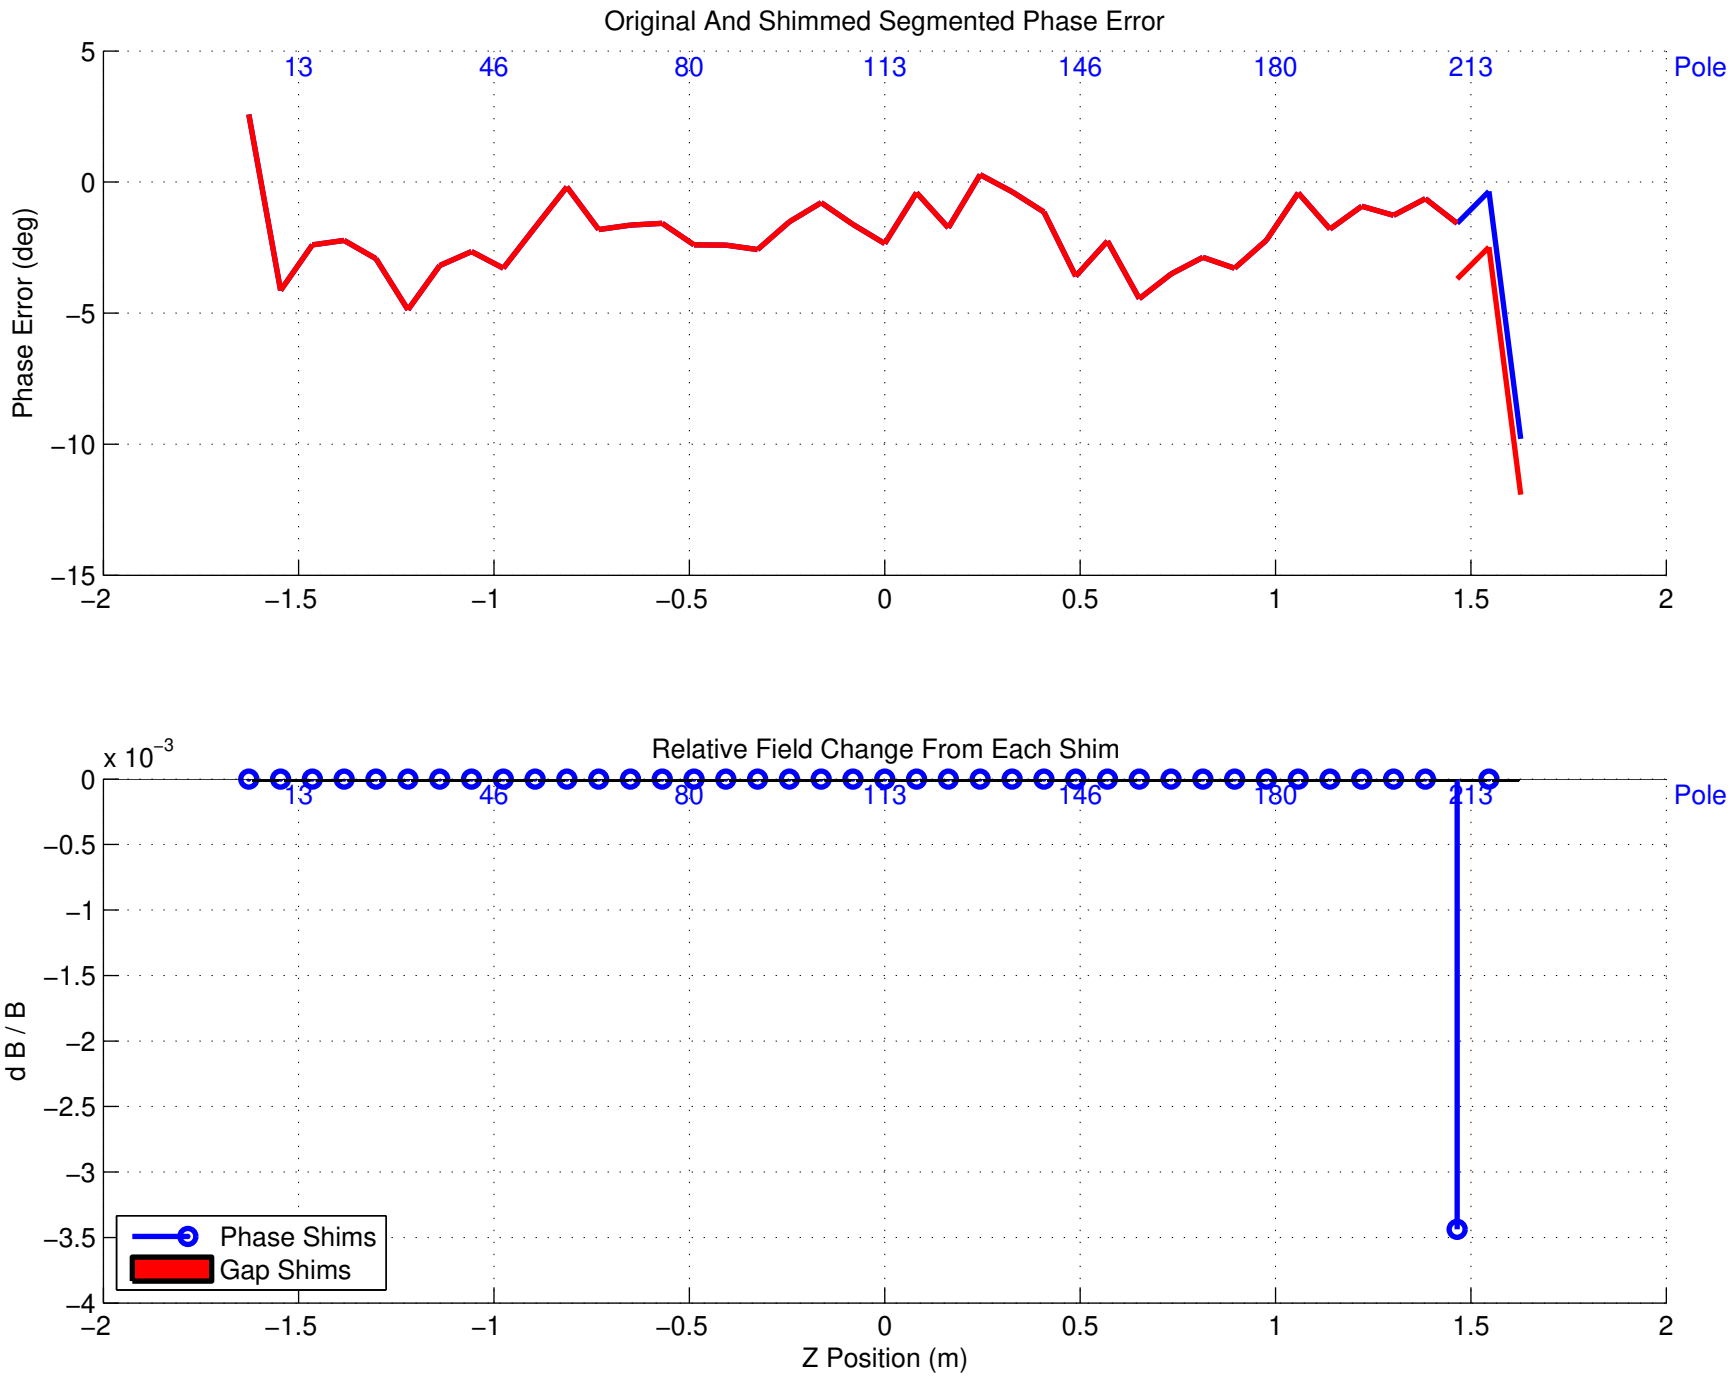
Original And Shimmed Segmented Phase Error
Phase Error (deg)
5
0
−5
−10
−15
13
46
80
113
146
180
213
Pole
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
0
−0.5
−1
−1.5
−2
−2.5
−3
−3.5
−4
Phase Shims
Gap Shims
Z Position (m)

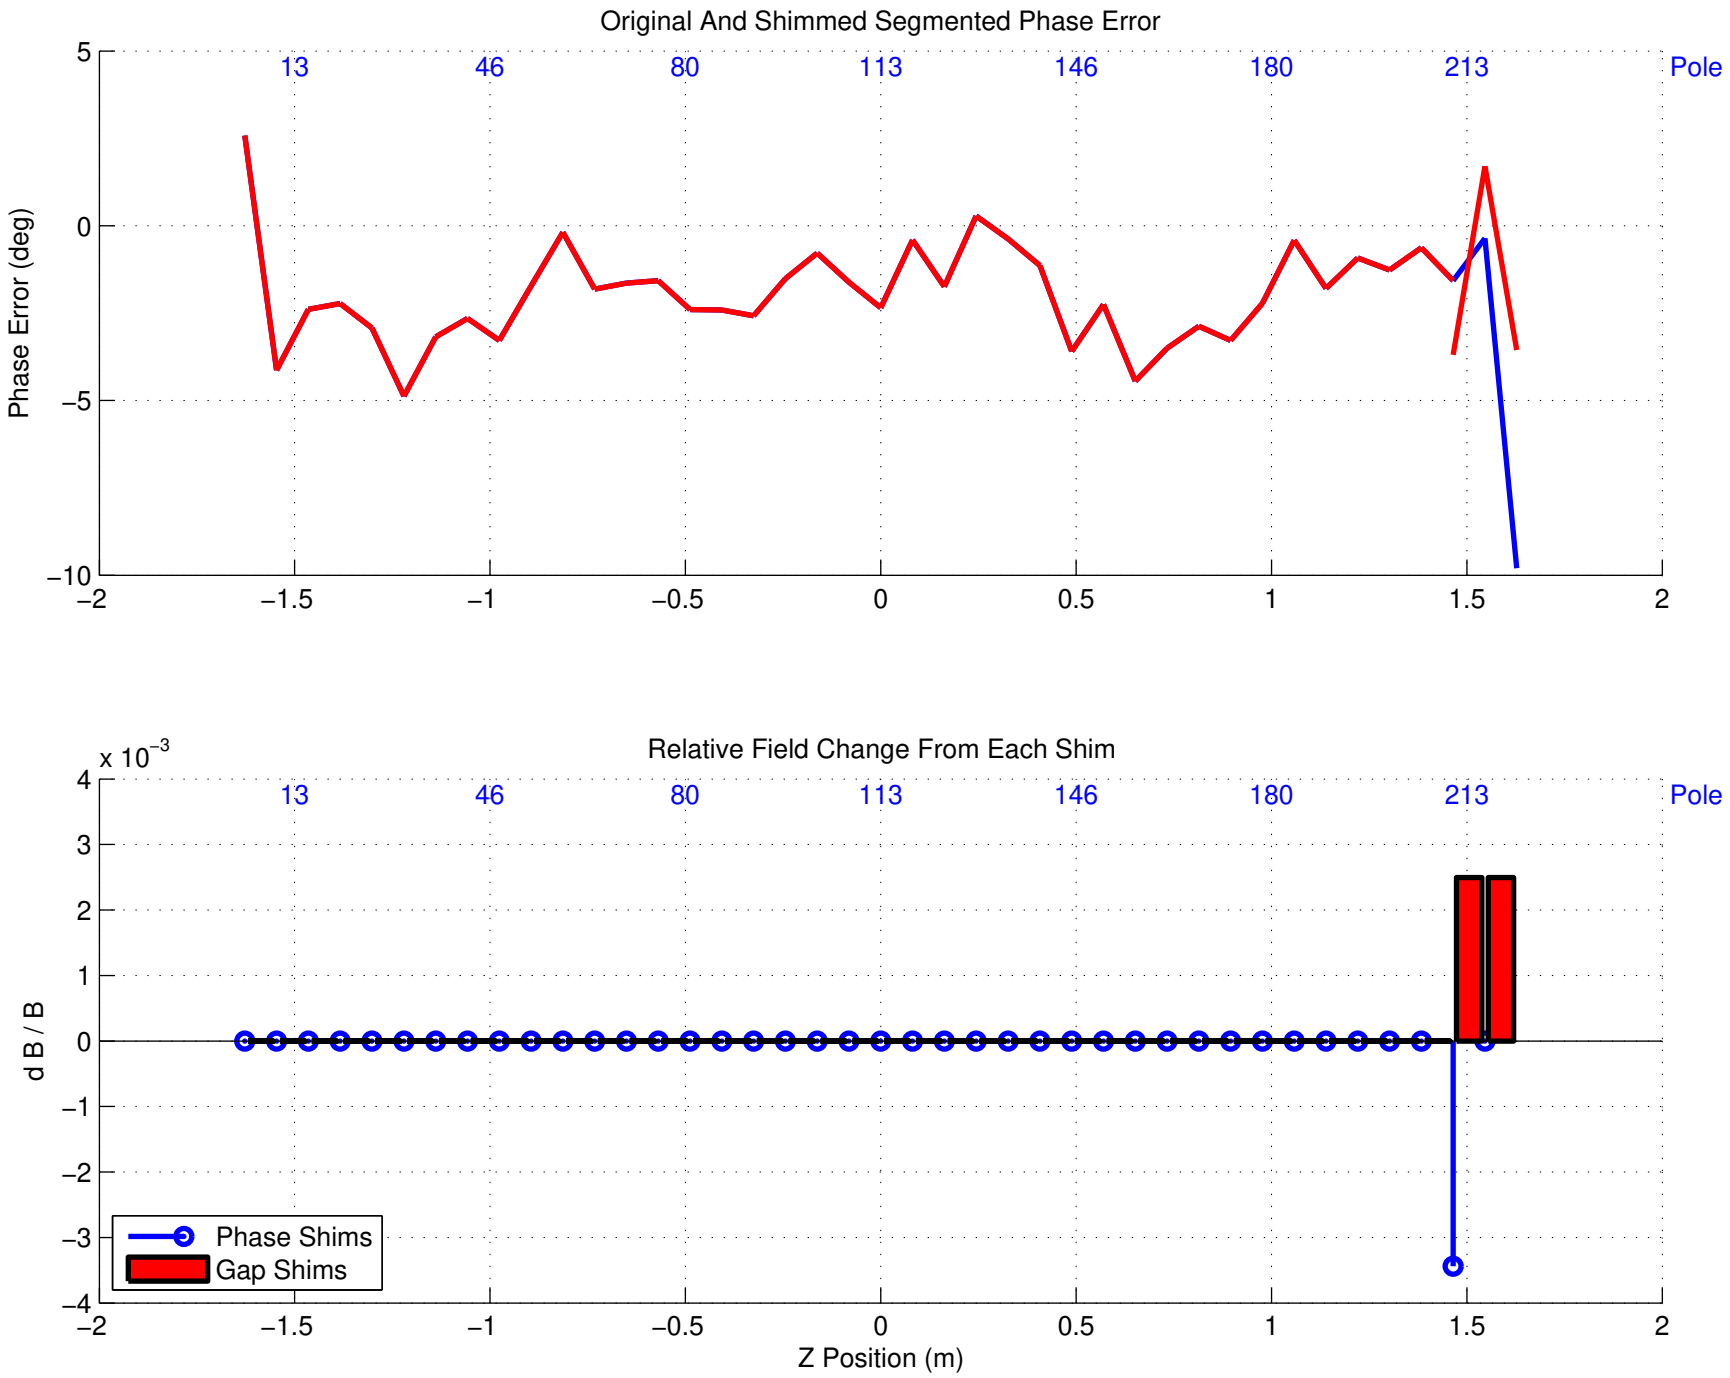
Original And Shimmed Segmented Phase Error
Phase Error (deg)
13
46
80
113
146
180
213
Pole
5
0
−5
−10
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
4
3
2
1
0
−1
−2
−3
−4
Phase Shims
Gap Shims
Z Position (m)

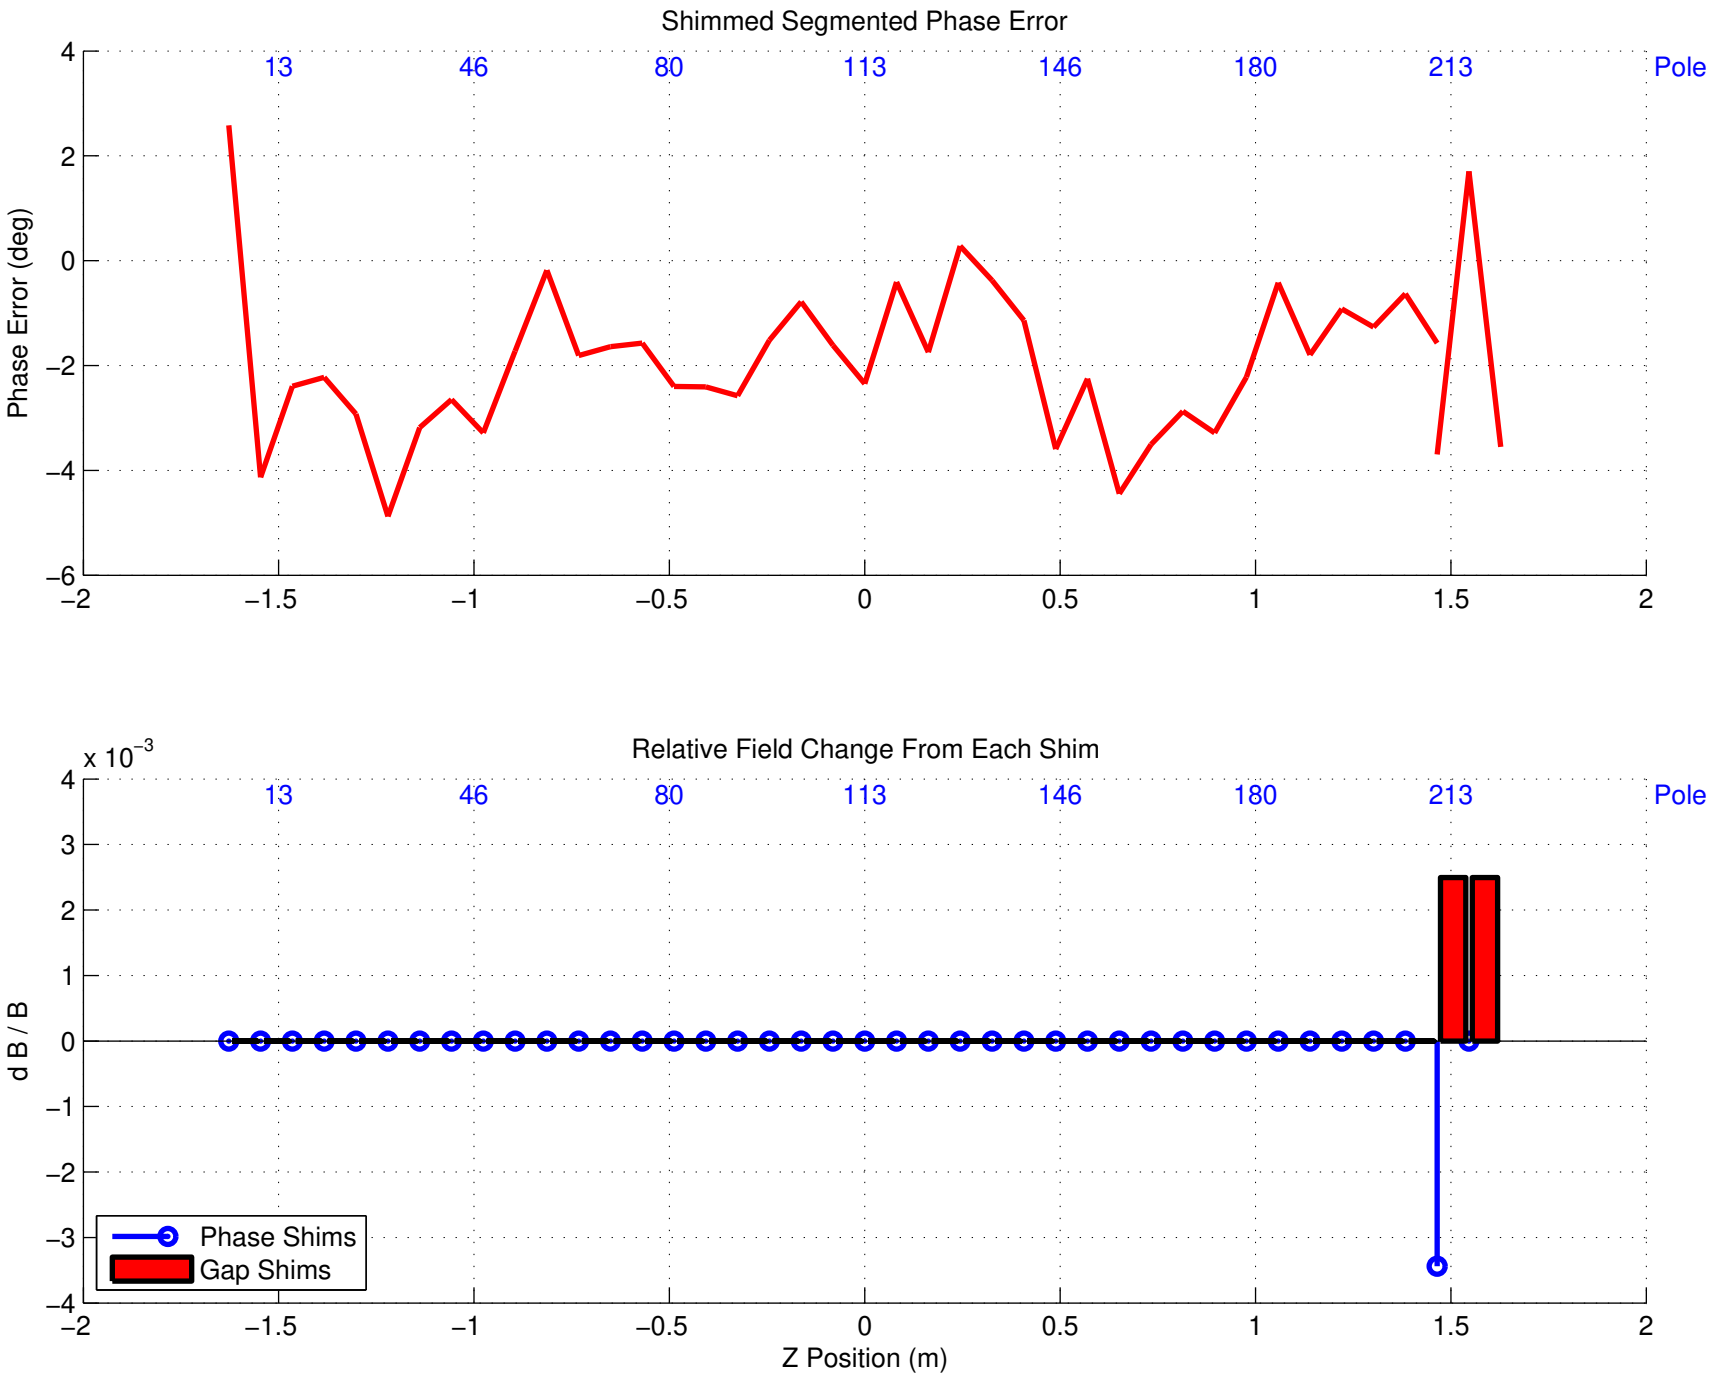
Shimmed Segmented Phase Error
13
46
80
113
146
180
213
Pole
Phase Error (deg)
4
2
0
−2
−4
−6
−2
−1.5
−1
−0.5
0
0.5
1
1.5
2
Relative Field Change From Each Shim
x 10^−3
d B / B
3
1
Phase Shims
Gap Shims
Z Position (m)

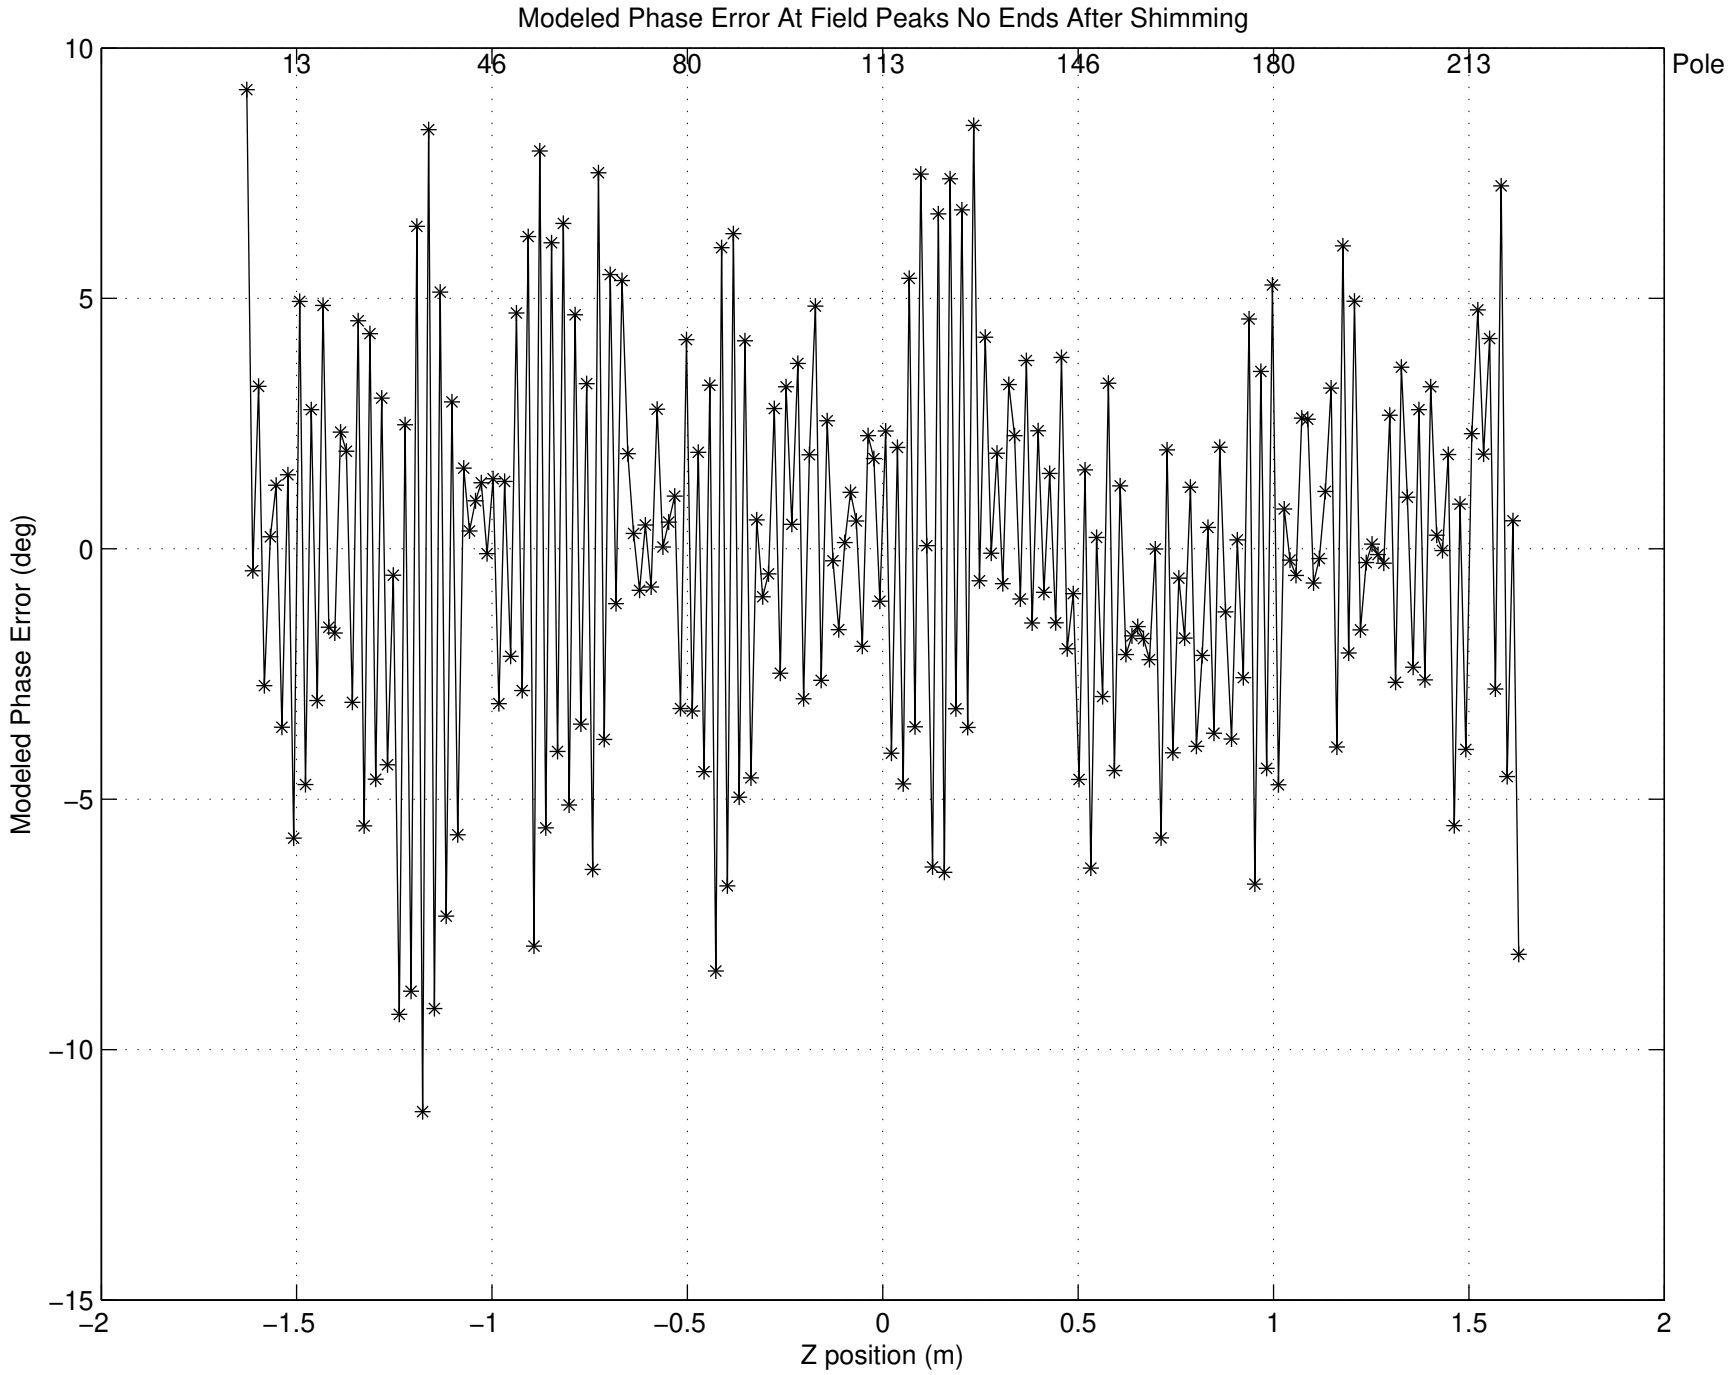

Phase Error: Ave = −0.000000 deg, RMS = 3.954291 deg