




LCLS II LTU Quad Fiducialization Report

1.26Q12 Quadrupole

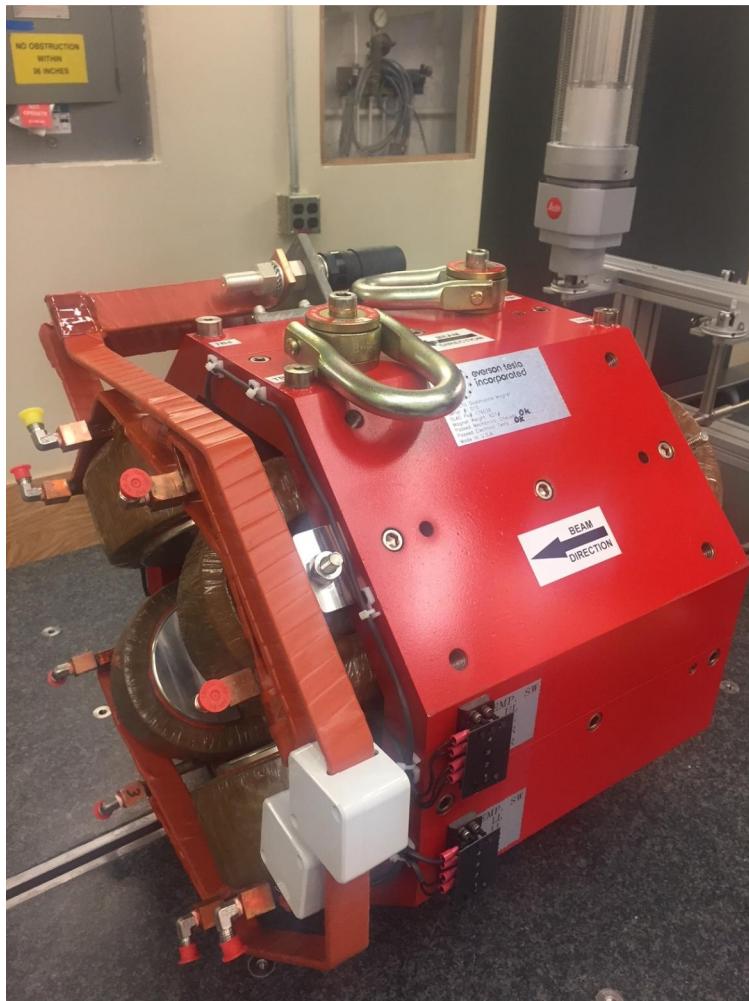

Inspector : K. Caban

Engineer : J. Amann

Drawing No. : SA-380-327-00 R1

Barcode # : 4056

Mfg. S/N : 016

Coordinate System Setup

Spatial Alignment

The Spatial Alignment of the magnet is created through a composite best-fit of the pole tips. Each pole tip scanned .100 inch inboard from the upstream magnet face and the downstream magnet face. A composite best-fit of the upstream poles and the downstream poles is made with the nominal pole tip shape and location. An axis is created through the two best-fit centerpoints. This axis is the spatial alignment of the magnet and defines the Z axis.

Planar Alignment


The Planar Alignment of the magnet is the created by averaging the rotations of the composite best-fits of the upstream pole tips and downstream pole tips. This direction defines the Y and X directions of the magnet.

Coordinate Origins

The origins of the magnet coordinate system are as follows. The XY origin lies on the axis of spatial alignment. The Z origin is the intersection of the mid-plane between the upstream and downstream magnet faces and the Z axis.

Barcode # : 4056
Mfg. S/N : 016

Tooling Ball Locations

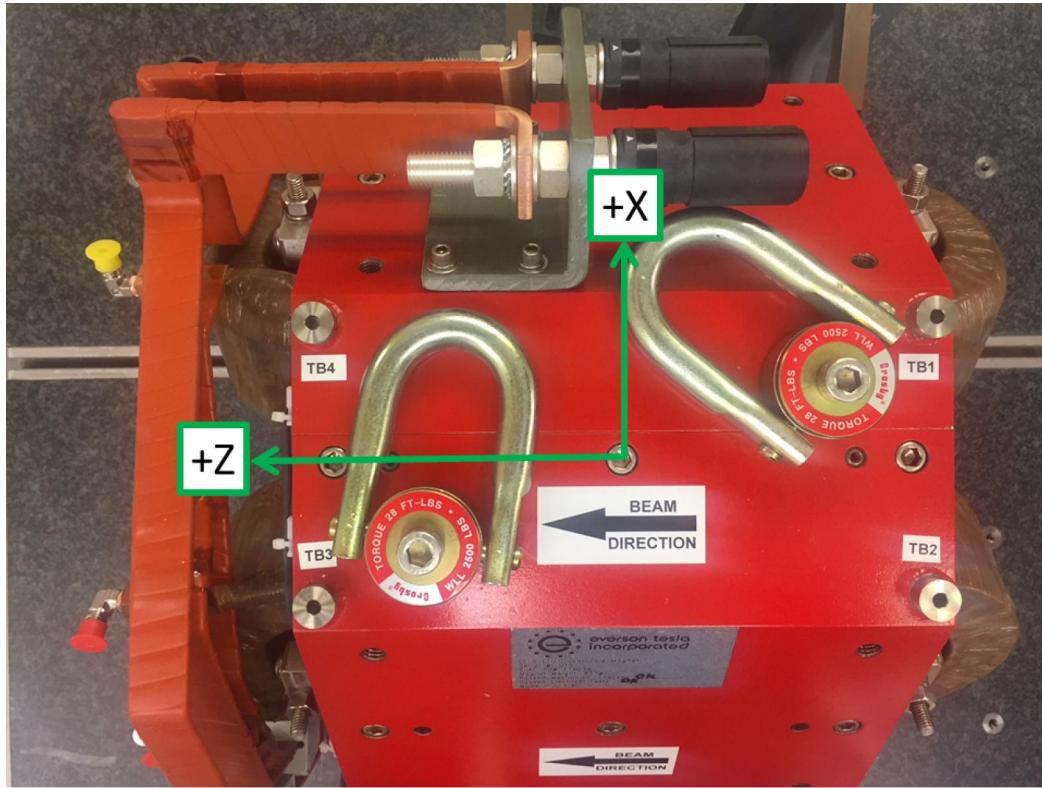

Tooling Ball	X Coord.	Y Coord.	Z Coord.
TB 1	-2.5198	10.2008	-5.4773
TB 2	2.4853	10.1991	-5.4896
TB 3	2.5026	10.1992	5.4759
TB 4	-2.4929	10.1985	5.4866
TB 1*	-2.5199	9.5140	-5.4783
TB 2*	2.4866	9.5113	-5.4889
TB 3*	2.5020	9.5111	5.4761
TB 4*	-2.4934	9.5113	5.4870

Tooling Ball (TB1-4) Locations are 1 inch above Tooling Ball Adapter Plane


Tooling Ball (TB1*-4*) Locations are 5/16 inch above Tooling Ball Adapter Plane

Dimensions in Inch

Barcode # : 4056

Mfg. S/N : 016

Pole Tip Gap Measurements

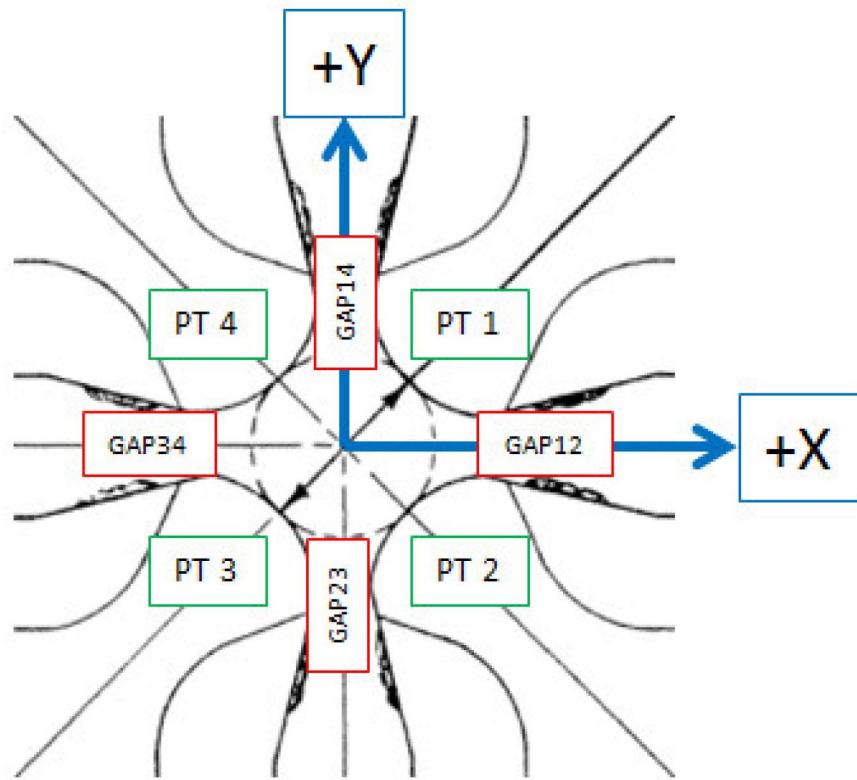


	Nominal Distance	Downstream Pole End	Upstream Pole End
Pole Tip Distance 1-3	1.260	1.2594	1.2592
Pole Tip Distance 2-4	1.260	1.2591	1.2584
Gap 1-2	0.432	0.4283	0.4278
Gap 2-3	0.432	0.4340	0.4340
Gap 3-4	0.432	0.4291	0.4280
Gap 4-1	0.432	0.4345	0.4333

Dimensions in Inch

Barcode # : 4056

Mfg. S/N : 016

Composite Best-fit of Pole Tips, Downstream

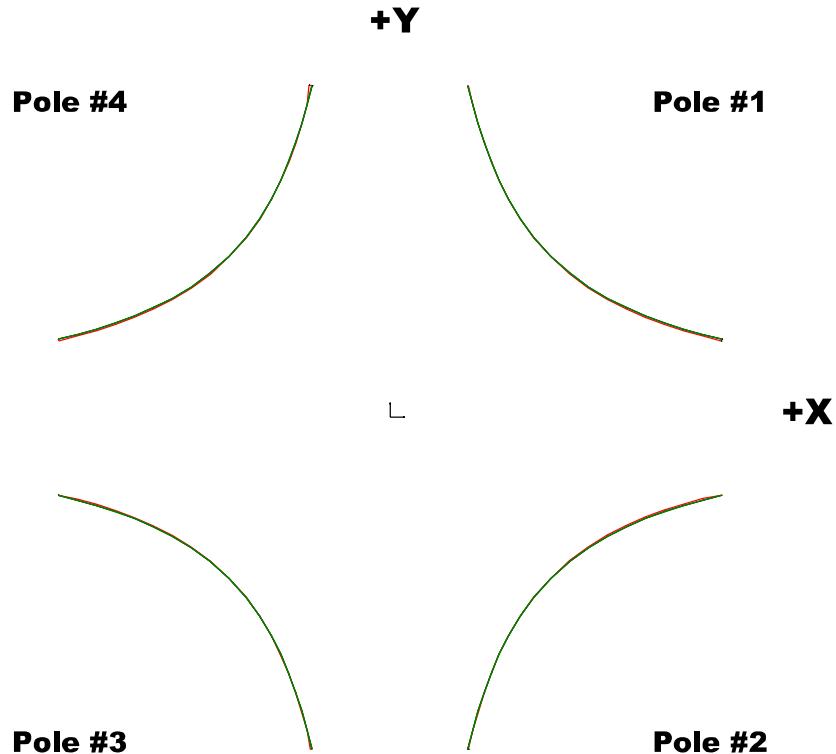

Black = Nominal Pole Tip

Red = Pole Tip Deviations

Green = +/- .001 Tolerance

Dimensions in Inch


Pole Tip Deviations

Pole Tip	#1	#2	#3	#4
Min. Dev.	-0.0006	-0.0004	-0.0027	-0.0040
Max. Dev.	0.0022	0.0023	0.0016	0.0021

Barcode # : 4056

Mfg. S/N : 016

Composite Best-fit of Pole Tips, Upstream

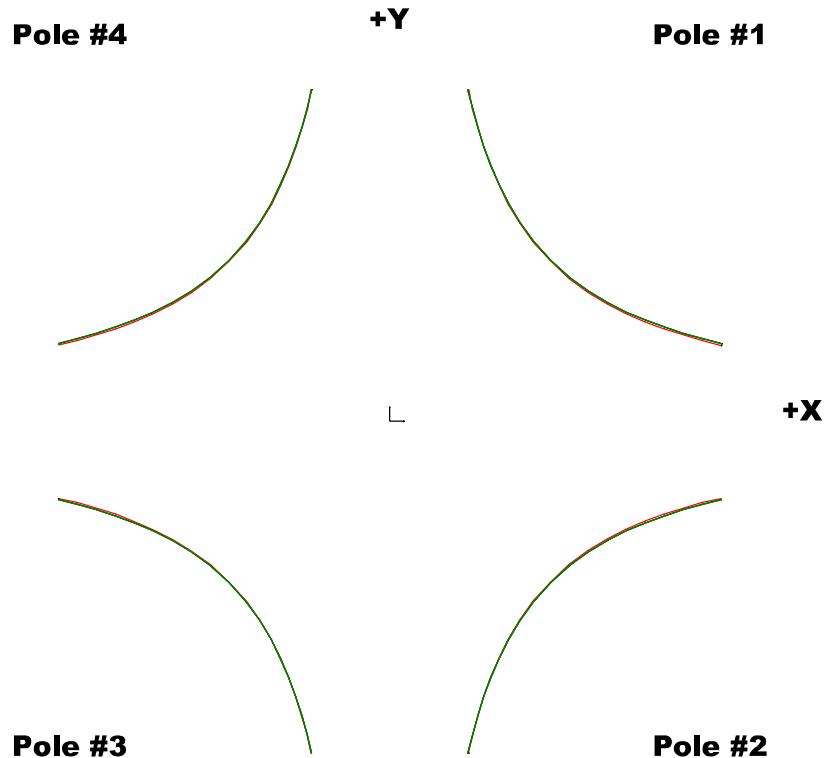

Black = Nominal Pole Tip

Red = Pole Tip Deviations

Green = +/- .001 Tolerance

Dimensions in Inch


Pole Tip Deviations

Pole Tip	#1	#2	#3	#4
Min. Dev.	-0.0012	-0.0009	-0.0017	-0.0011
Max. Dev.	0.0027	0.0025	0.0023	0.0025

Barcode # : 4056

Mfg. S/N : 016

Angle of the Composite Pole Tip Best-Fit In Relation to Base/CMM Granite Table

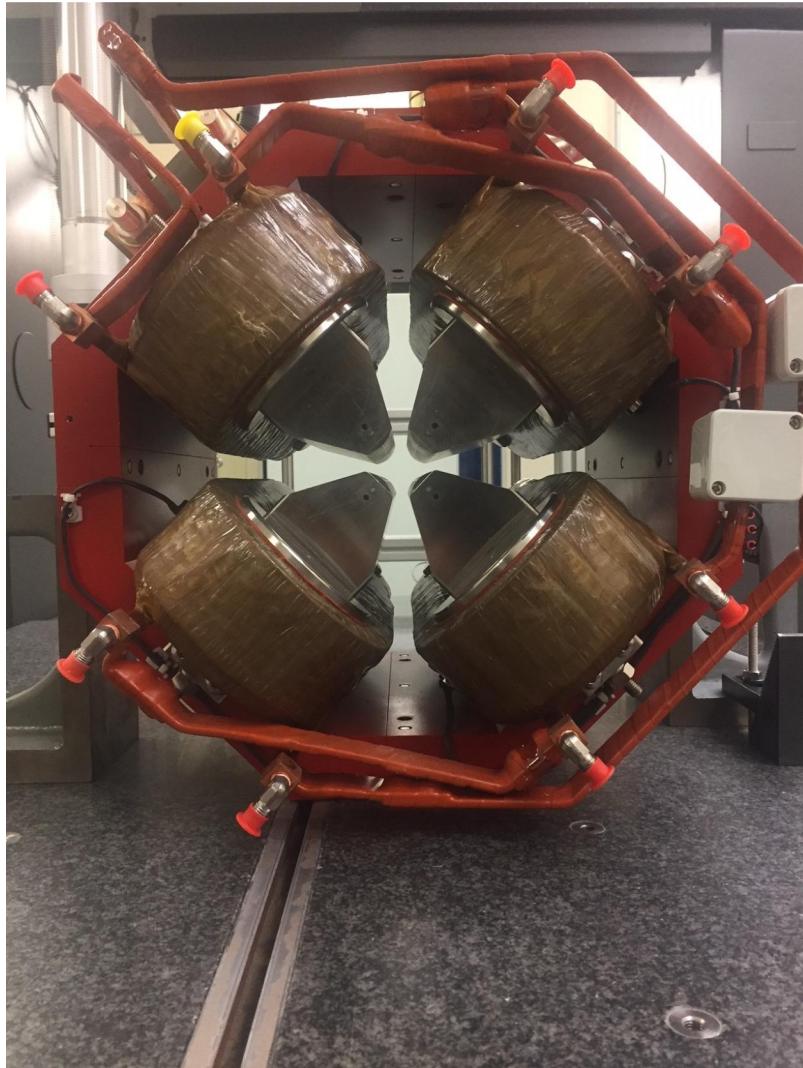

Angle in Decimal Degrees ° :-0.03107

Angle in Milliradians :-0.54232

Barcode # : 4056

Mfg. S/N : 016