



Pole Tip Number ----->

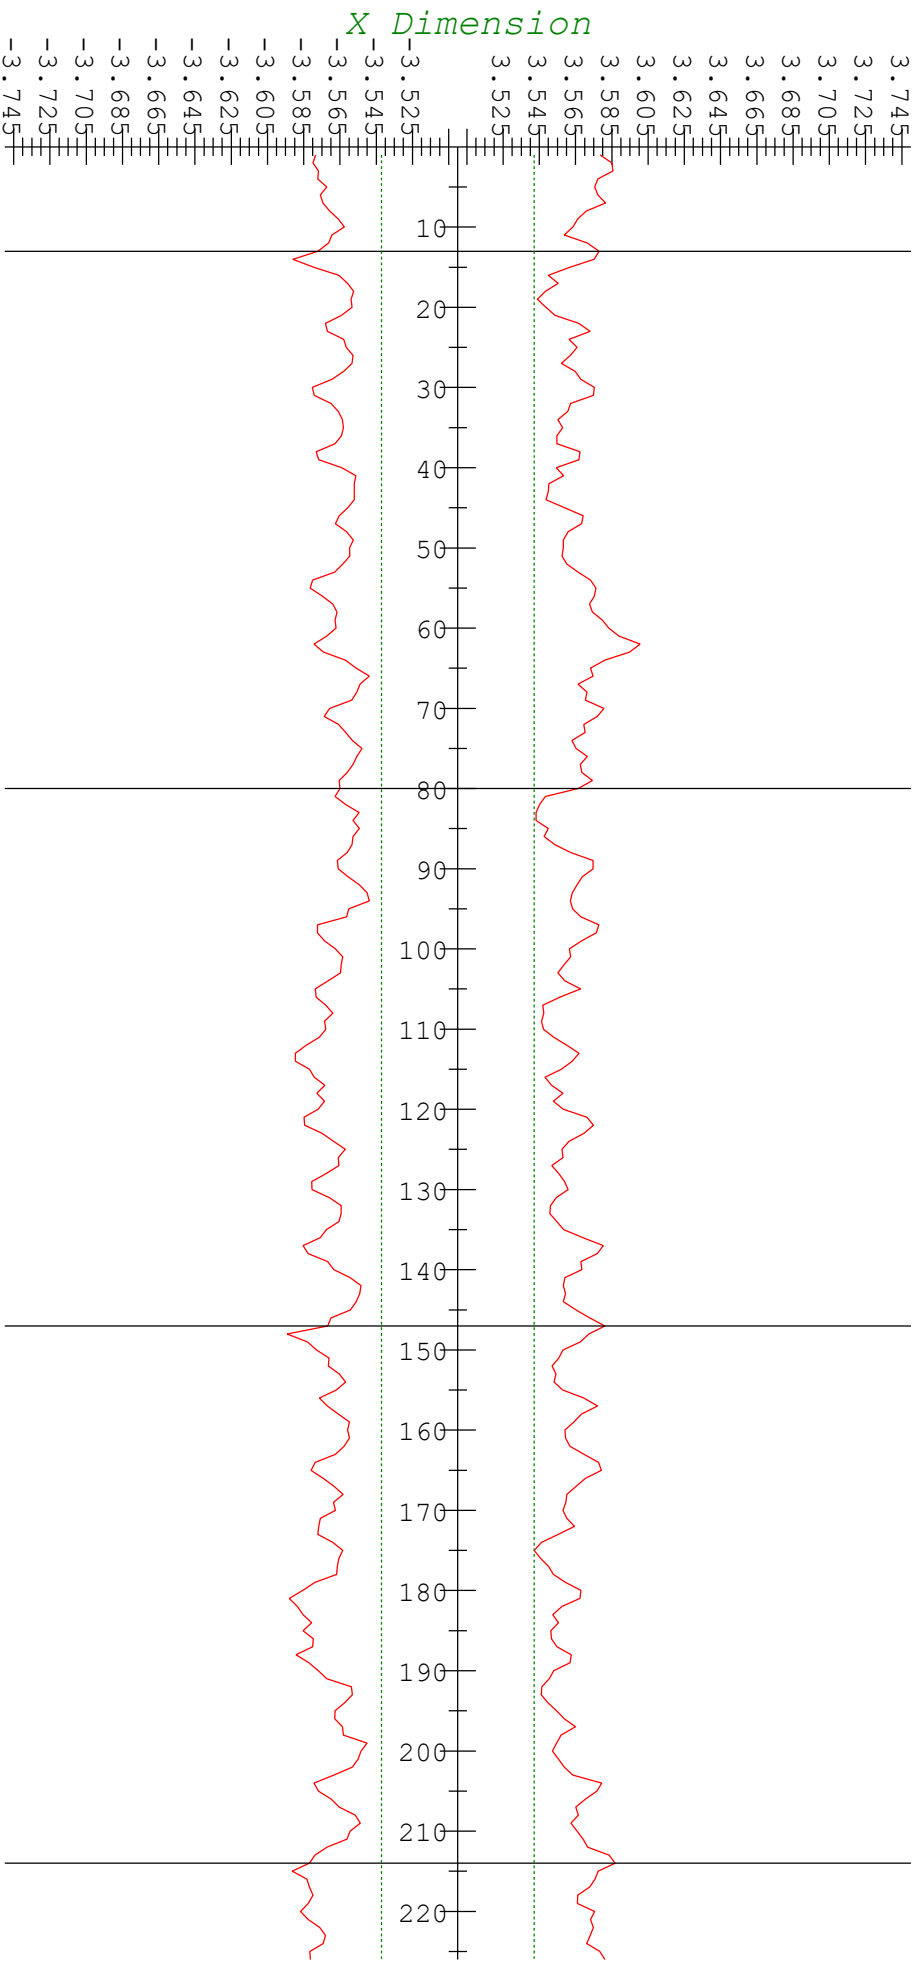

Minimum Gap = 7.084


Location of Tooling Ball Center 1 inch above Socket Surface

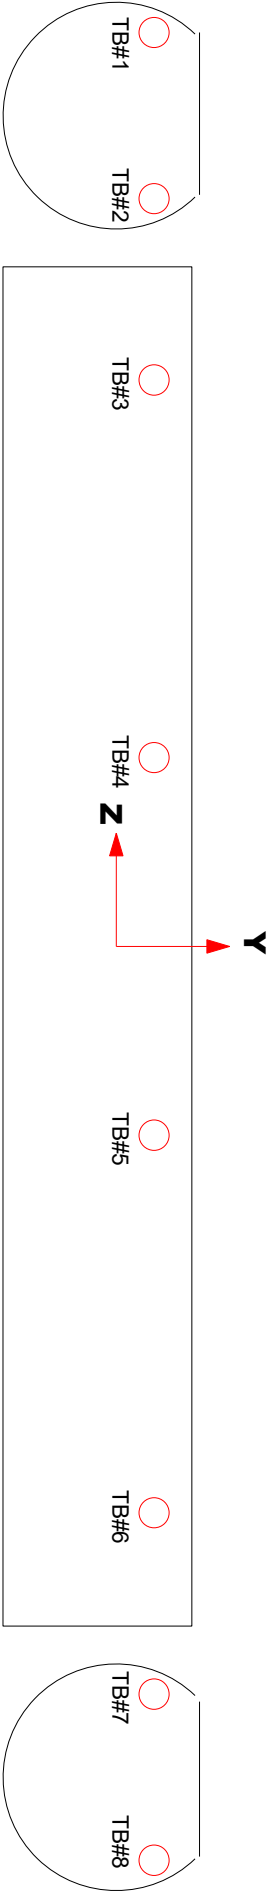

TB Number	X Corr.	Y Corr.	Z Corr.
#1	-5.07843	0.00499	67.9278
#2	5.07862	0.00816	67.92826
#3	7.08002	0.01382	61.48516
#4	7.07996	0.0077	23.26341
#5	7.08087	0.01014	-23.03481
#6	7.08016	0.00694	-61.37003
#7	5.07492	0.01114	-67.92842
#8	-5.08096	0.00849	-67.92815


Dimensions in Inch

Pole Tip Number ----->

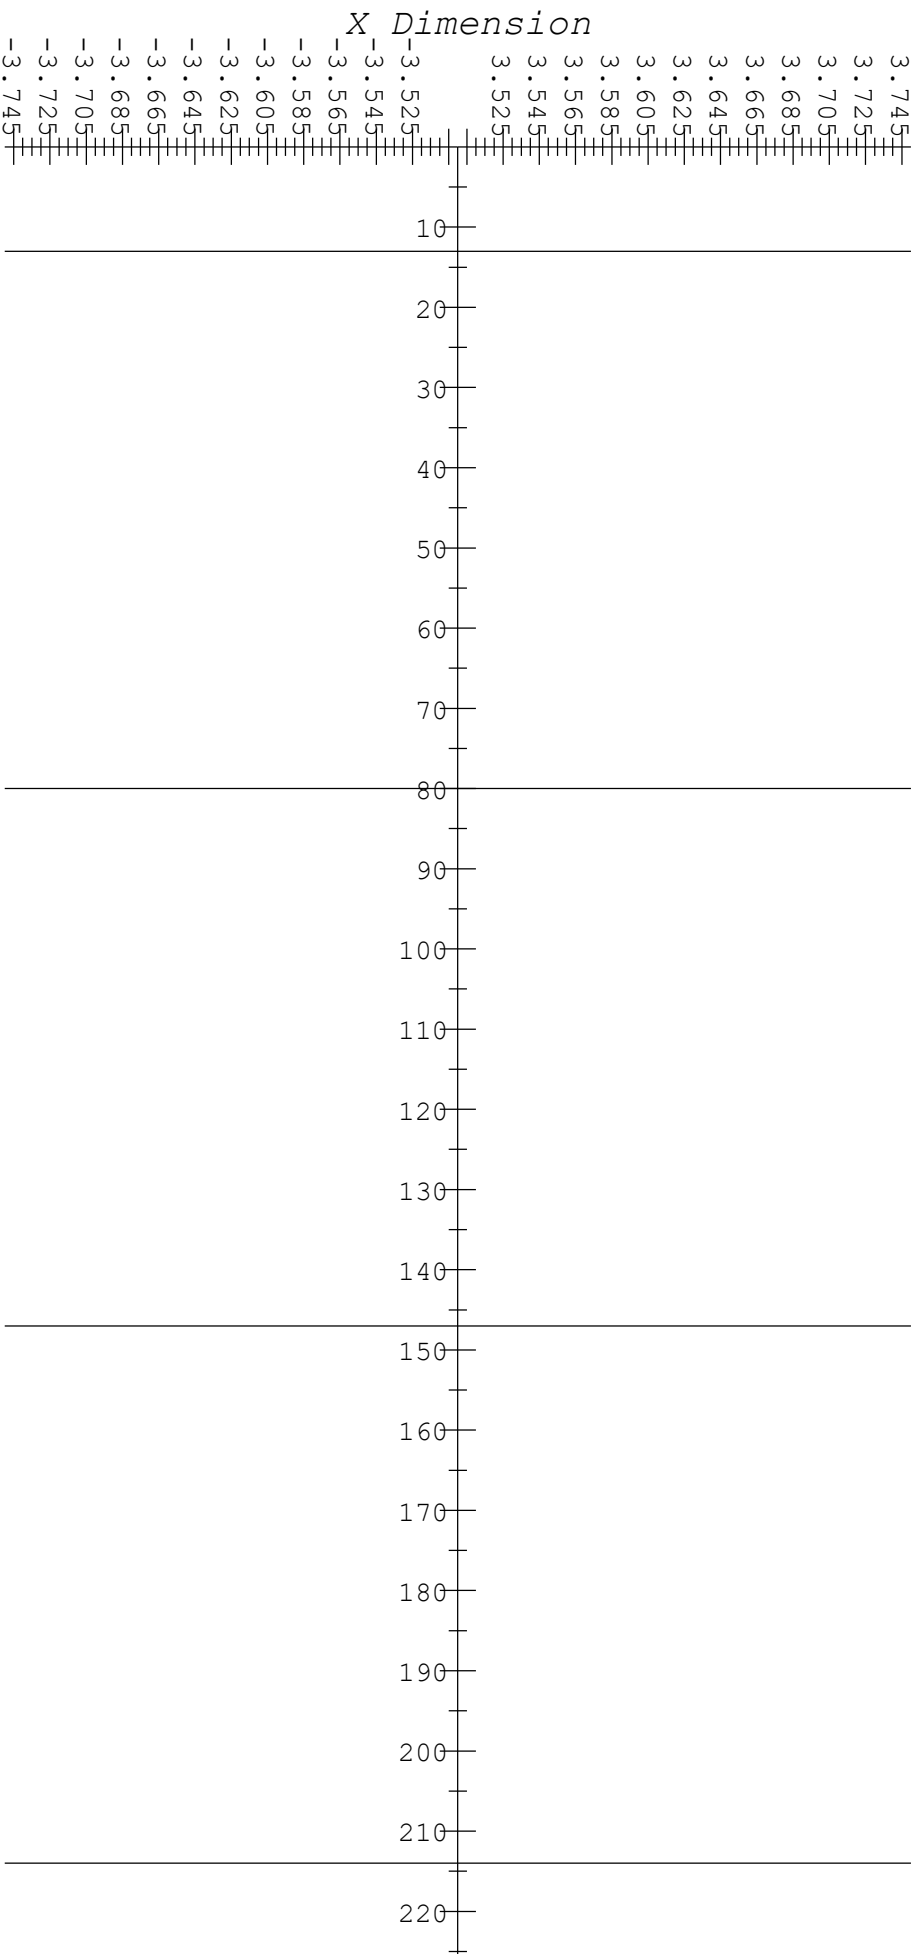


Section -45mm Below Top Plane
Section -75mm Below Top Plane


----->
----->

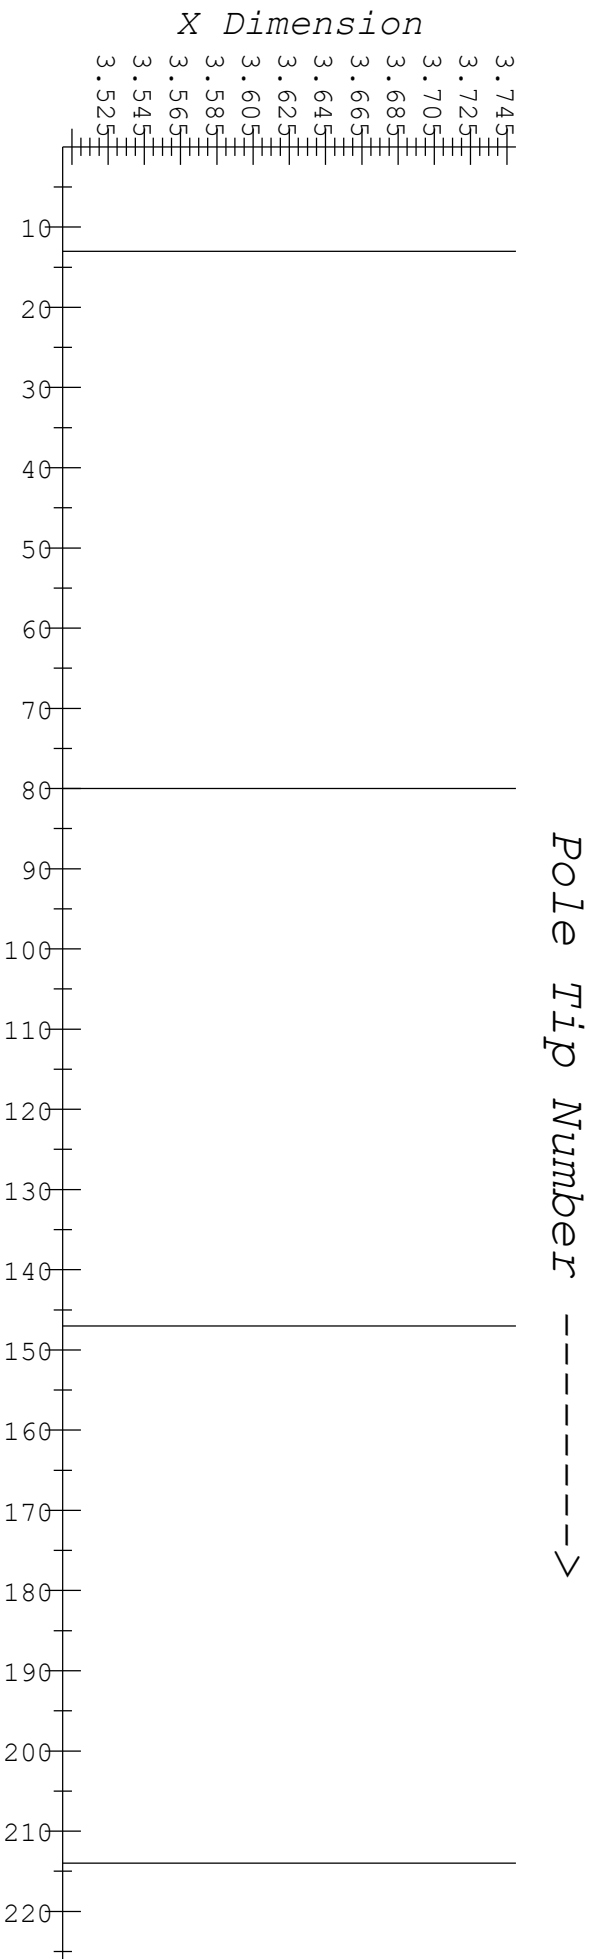

Pole Tip	Corr Val		Pole Tip	Corr Val
1.000	-0.141		121.000	-0.141
7.000	-0.141		129.000	-0.140
13.000	-0.141		137.000	-0.141
22.000	-0.140		148.000	-0.141
30.000	-0.141		156.000	-0.141
38.000	-0.140		164.000	-0.141
46.000	-0.141		172.000	-0.140
54.000	-0.141		180.000	-0.140
67.000	-0.142		188.000	-0.140
70.000	-0.141		196.000	-0.140
80.000	-0.140		204.000	-0.141
89.000	-0.141		214.000	-0.141
97.000	-0.141		219.000	-0.140
105.000	-0.140		226.000	-0.141
113.000	-0.141			

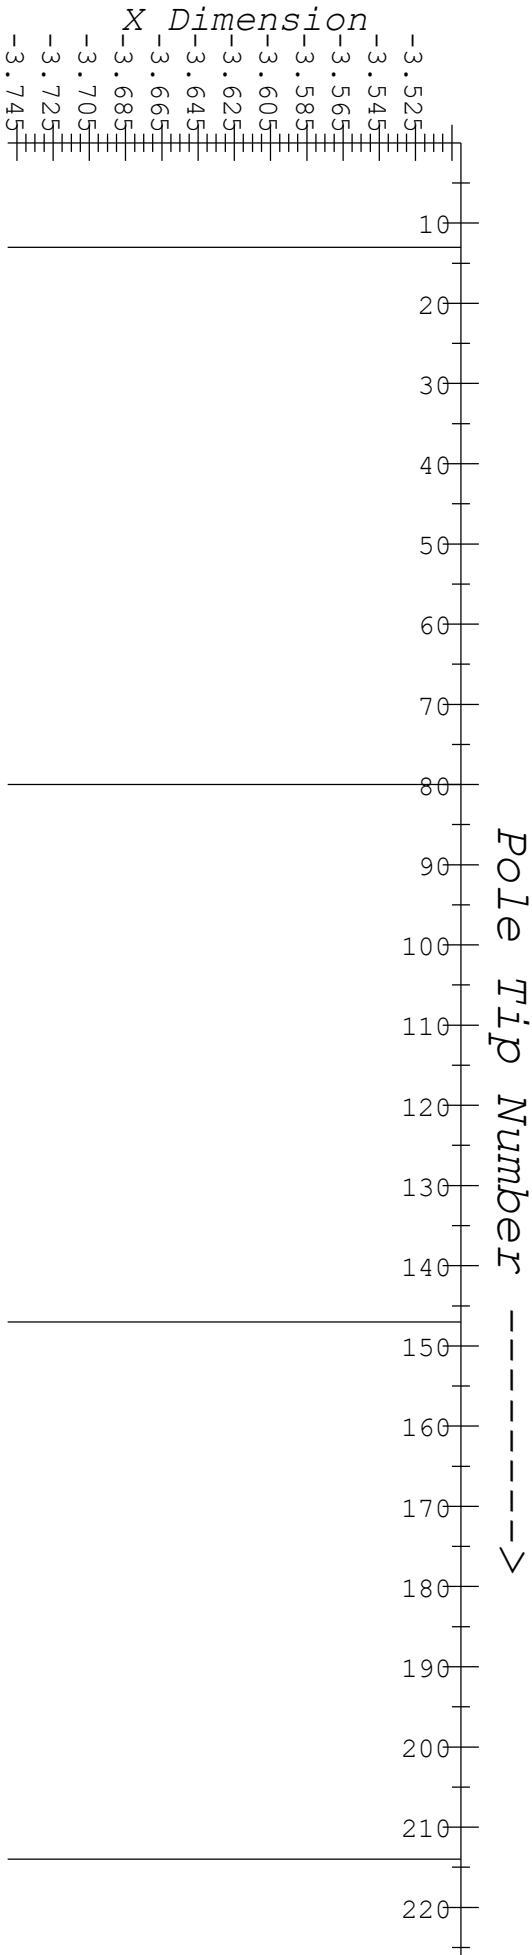

Pole Tip	Corr Val		Pole Tip	Corr Val
1.000	-0.141		121.000	-0.141
7.000	-0.141		129.000	-0.140
13.000	-0.141		137.000	-0.141
22.000	-0.140		148.000	-0.141
30.000	-0.141		156.000	-0.141
38.000	-0.140		164.000	-0.141
46.000	-0.141		172.000	-0.140
54.000	-0.141		180.000	-0.140
67.000	-0.142		188.000	-0.140
70.000	-0.141		196.000	-0.140
80.000	-0.140		204.000	-0.141
89.000	-0.141		214.000	-0.141
97.000	-0.141		219.000	-0.140
105.000	-0.140		226.000	-0.141
113.000	-0.141			

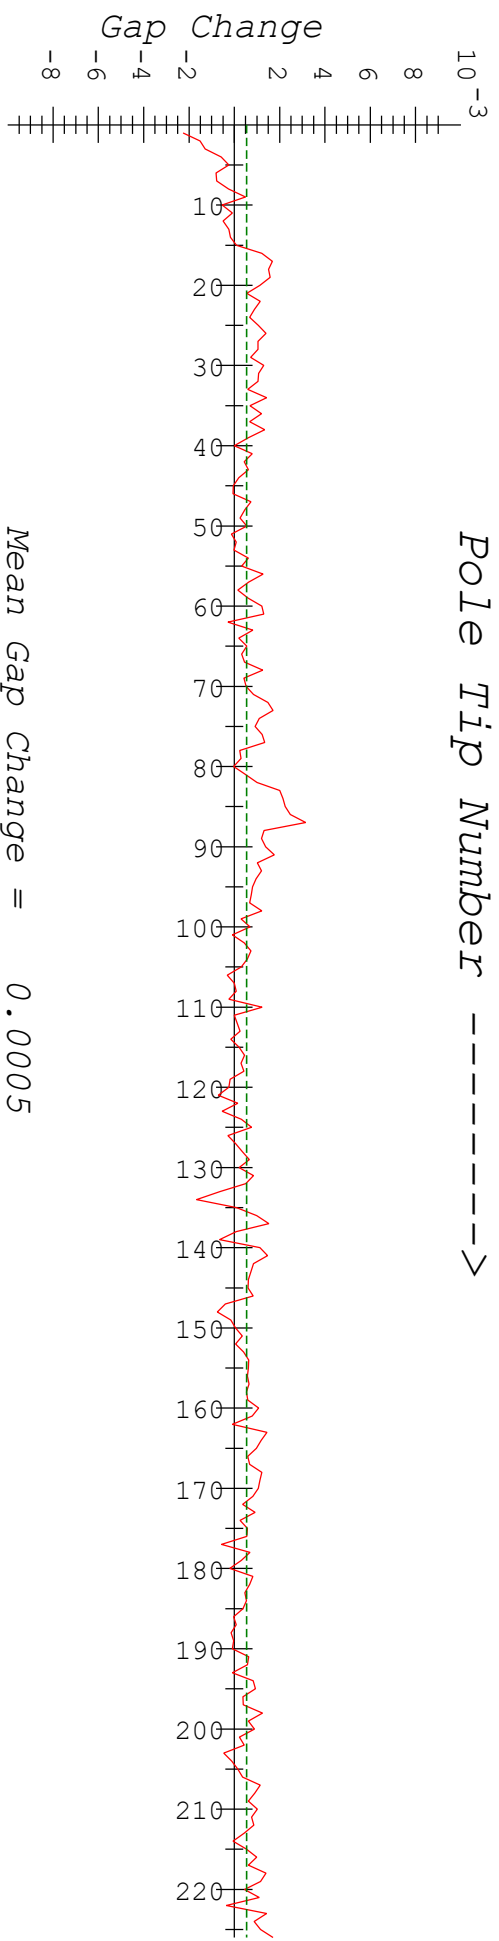

Dimensions in MM