



Pole Tip Number ----->

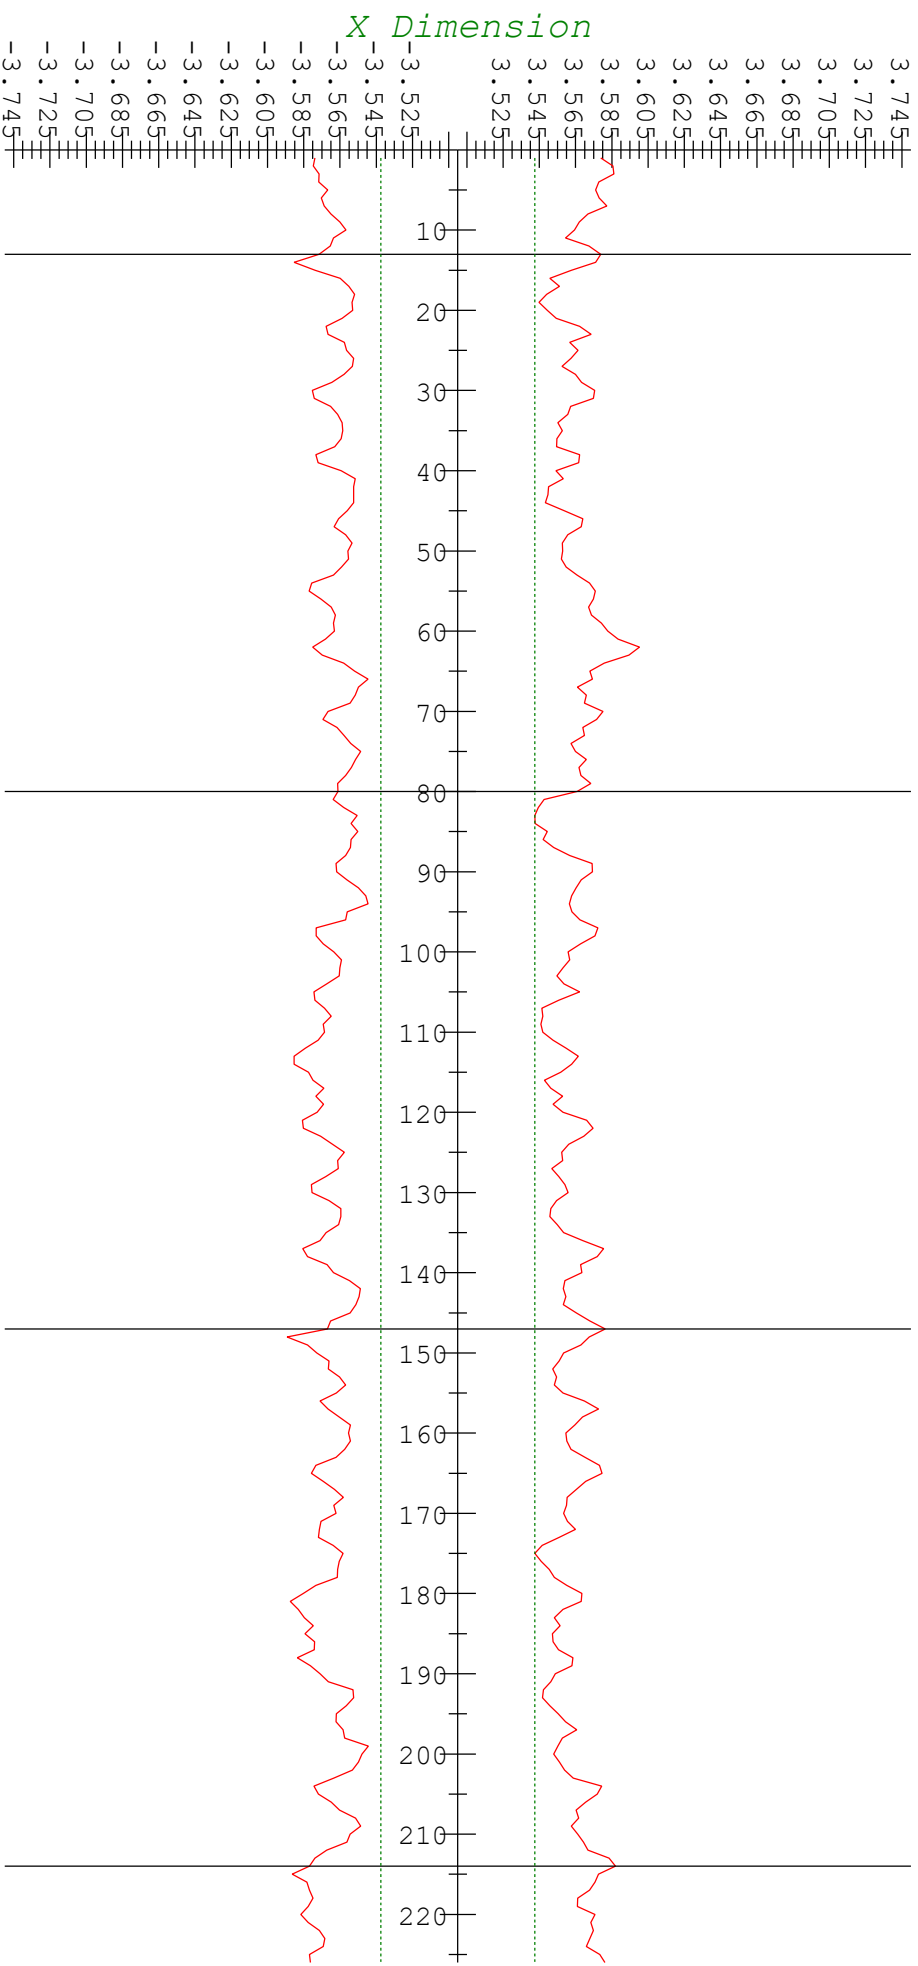

Minimum Gap = 7.085


Location of Tooling Ball Center 1 inch above Socket Surface

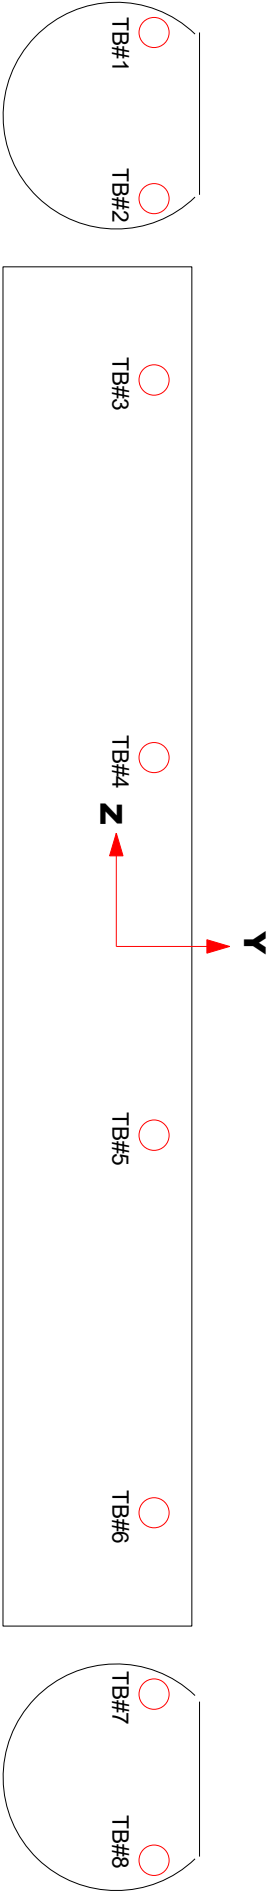


TB Number	X Corr.	Y Corr.	Z Corr.
#1	-5.07834	0.00506	67.92812
#2	5.07865	0.00741	67.92824
#3	7.08005	0.01387	61.4853
#4	7.07927	0.00717	23.26335
#5	7.08074	0.00997	-23.03453
#6	7.08041	0.00739	-61.37016
#7	5.07501	0.01065	-67.92782
#8	-5.08098	0.00799	-67.92763

Dimensions in Inch


Pole Tip Number ----->

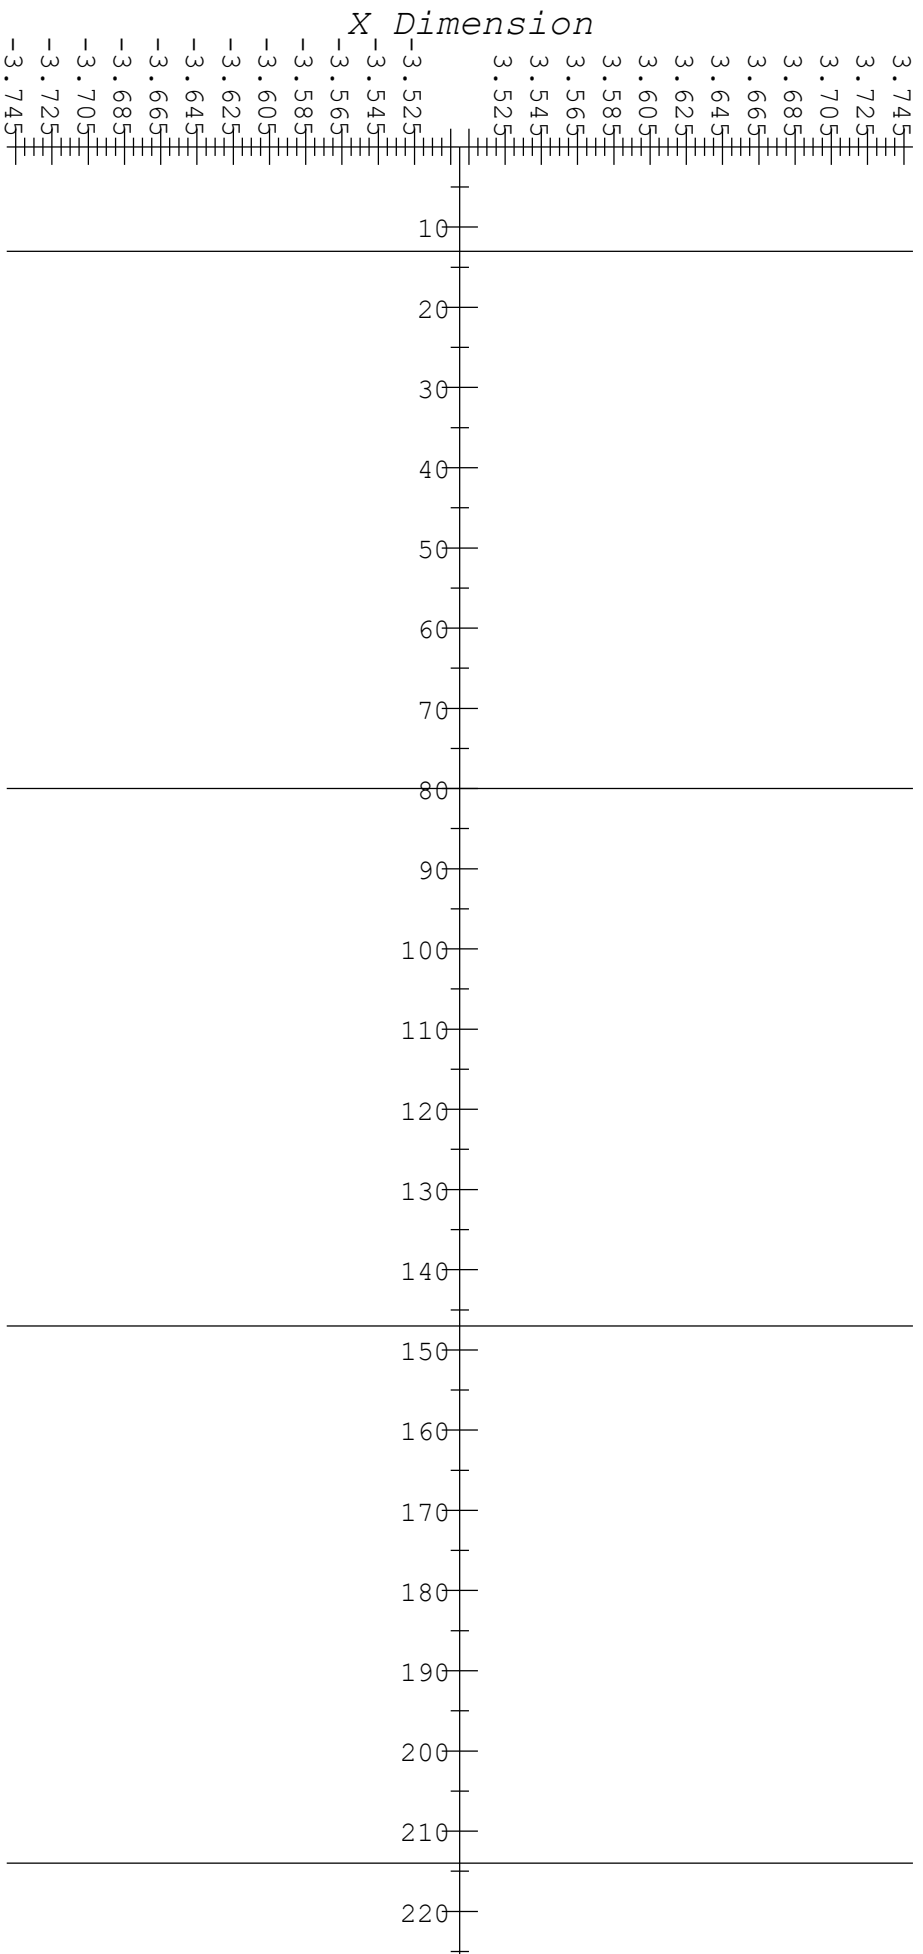


Section -45mm Below Top Plane
Section -75mm Below Top Plane

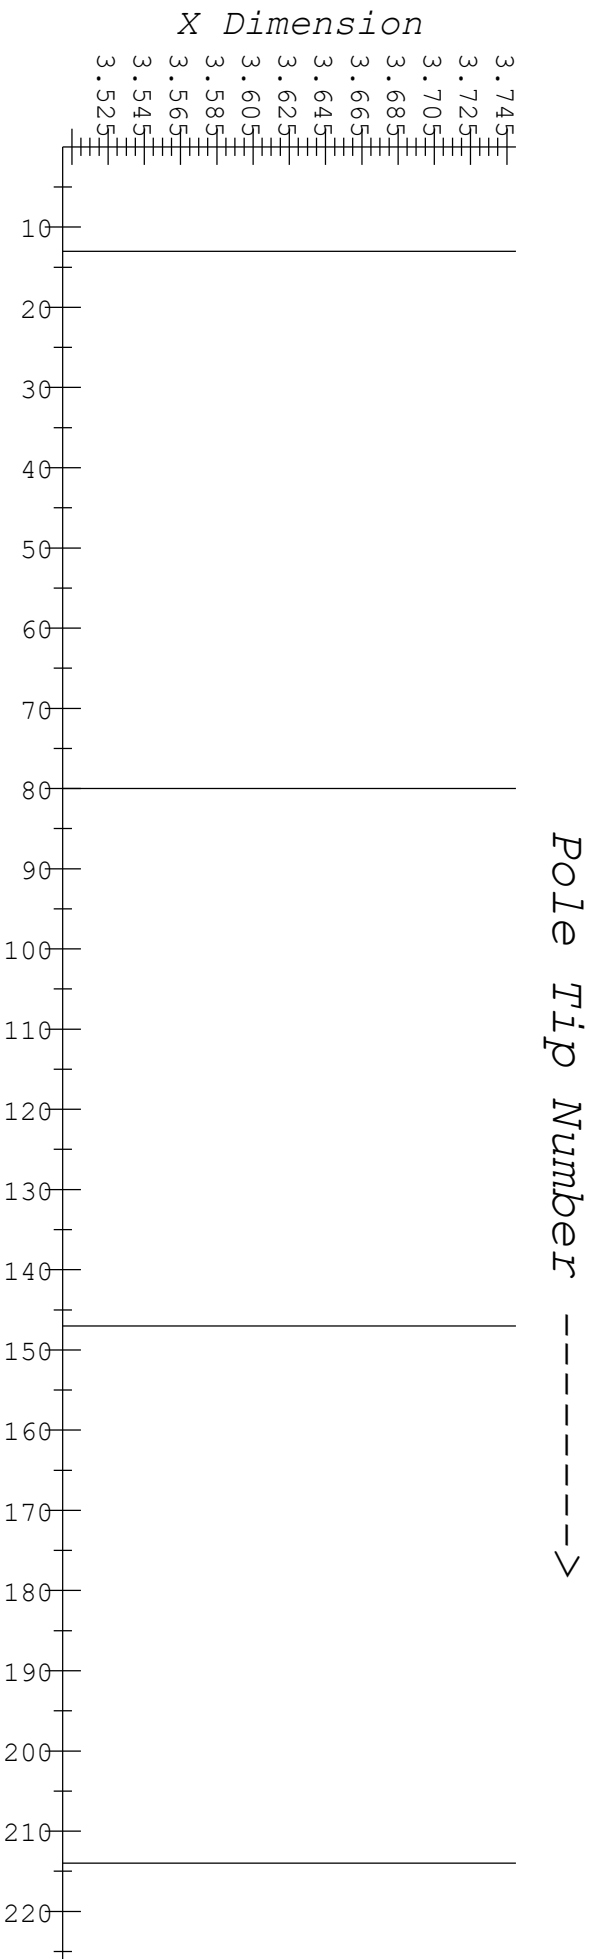

Pole Tip	Corr Val		Pole Tip	Corr Val
1.000	-0.141		121.000	-0.141
7.000	-0.141		129.000	-0.140
13.000	-0.141		137.000	-0.141
22.000	-0.140		148.000	-0.141
30.000	-0.141		156.000	-0.141
38.000	-0.140		164.000	-0.141
46.000	-0.141		172.000	-0.140
54.000	-0.141		180.000	-0.140
67.000	-0.142		188.000	-0.140
70.000	-0.141		196.000	-0.140
80.000	-0.140		204.000	-0.141
89.000	-0.141		214.000	-0.141
97.000	-0.141		219.000	-0.140
105.000	-0.140		226.000	-0.141
113.000	-0.141			

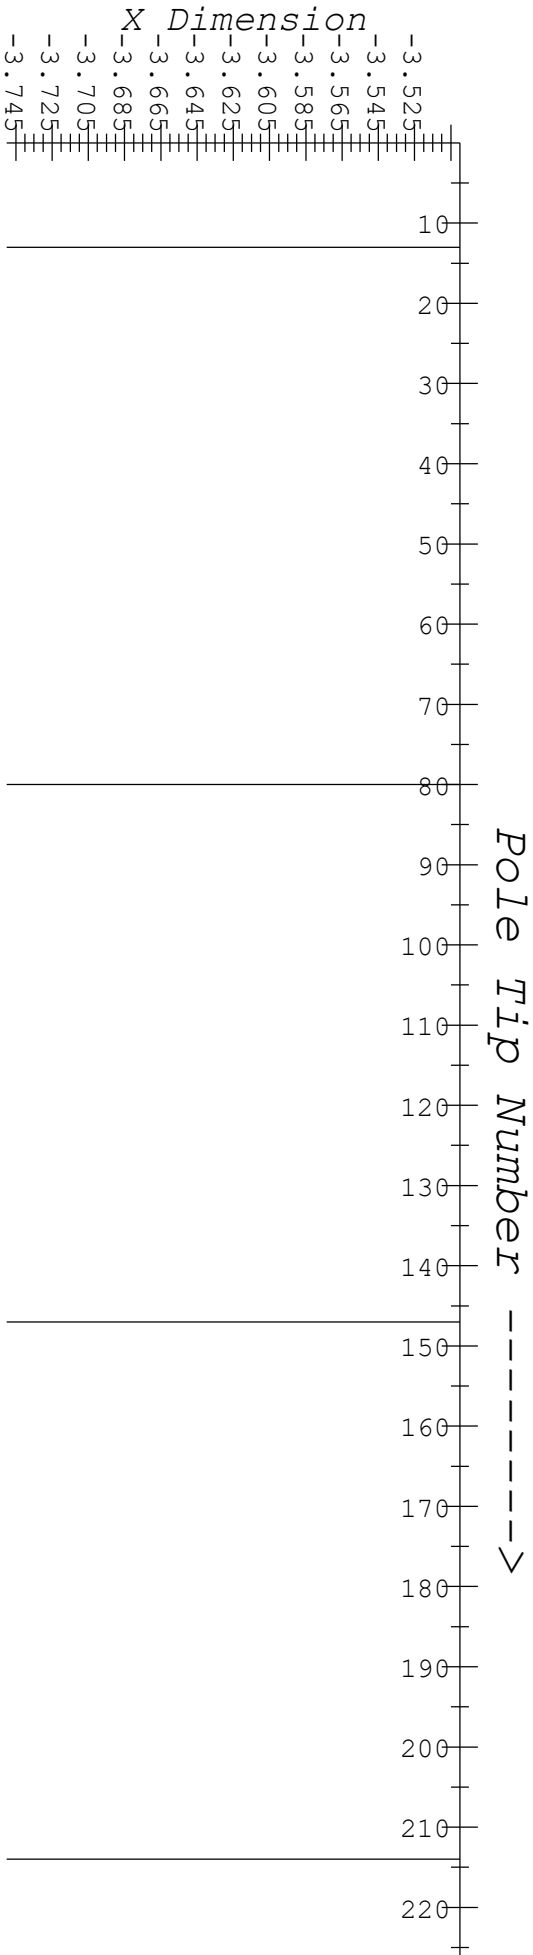

Pole Tip	Corr Val		Pole Tip	Corr Val
1.000	-0.141		121.000	-0.141
7.000	-0.141		129.000	-0.140
13.000	-0.141		137.000	-0.141
22.000	-0.140		148.000	-0.141
30.000	-0.141		156.000	-0.141
38.000	-0.140		164.000	-0.141
46.000	-0.141		172.000	-0.140
54.000	-0.141		180.000	-0.140
67.000	-0.142		188.000	-0.140
70.000	-0.141		196.000	-0.140
80.000	-0.140		204.000	-0.141
89.000	-0.141		214.000	-0.141
97.000	-0.141		219.000	-0.140
105.000	-0.140		226.000	-0.141
113.000	-0.141			

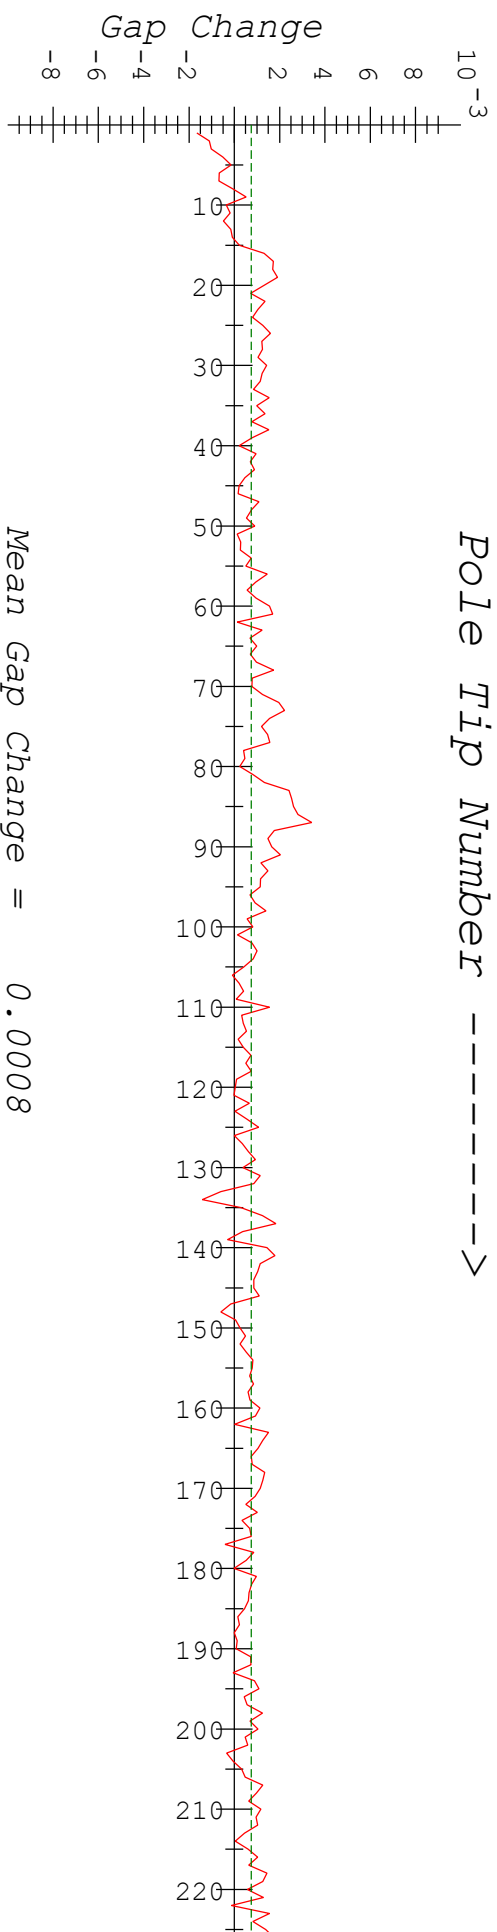

Dimensions in MM